



⚠ VARIANCE FLAGGED · ADMIN REVIEW


PREPARED FOR		PREPARED BY	
👤 Client	The Whitaker Family	👤 Contractor	Crown Roofing
📍 Property	1247 Bluegrass Pkwy, Lexington, KY 40503	👤 Project Lead	Tony Cross
Email	g.whitaker@protonmail.com	👤 License No.	LIC-KY-99214X
Phone	(859) 555-0142	📍 Region	Lexington, KY · Central Kentucky Service Region

FLIGHT RECORD		👤 Pilot in Command	Ramon Field
🔑 Project Code	AD-KY041	📅 Flight Completed	Sun, Feb 15, 2026, 1:17 AM UTC
🕒 Flight Started	Sun, Feb 15, 2026, 12:42 AM UTC	📏 Calibration	± 0.92 · Radiometrically corrected
🌤 Weather at Capture	Clear · Post-Sunset · 38.2°F · wind 4.1/6.8mph	📶 RTK / Uplink	100% lock · 92 dBm avg
📷 Frames Captured	1284 · 4 passes		

🏠 ROOF COMPOSITION · DIGITAL TWIN

TOTAL SQUARES 16.21	TOTAL SQ FT 1,621	VALLEY LINEAR FT 148.67 lf
PRIMARY MATERIAL Finished Slate		
SUB-LAYER Ice & Water Shield + Synthetic Underlayment		

FACET	LABEL	SQ FT	PITCH	EXP
F1	South Facing	612	8/12	S
F2	North Facing	612	8/12	N
F3	East Dormer	198	10/12	E

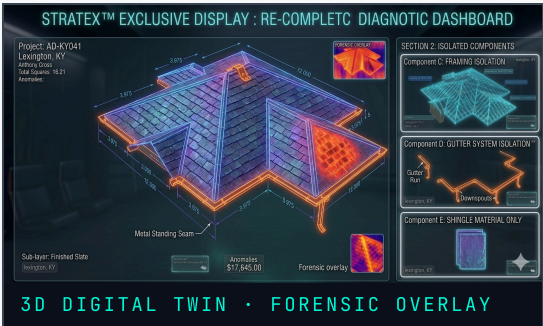

ROOF • NET SQUARES 16.21 sq	VALLEY • LINEAR FEET 148.66 lf	RAKE & GABLE • LINEAR 192.33 lf	WALL SIDING • NET AREA 2,450 ft²
--	---	--	--

DIAGNOSTIC GRID	CONCERN CODE	PROBABILITY	FIELD NOTE
Grid B2-RED-H1 High Dormer Corner	CODE A14-RED-V1 ⚠ CRITICAL	78% 	Trapped moisture detected. High risk of CDX deck rot and structural framing decay.
DIAGNOSTIC GRID	CONCERN CODE	PROBABILITY	FIELD NOTE
Grid C4-1 & C4-2 Multiple Valley Junction	CODE C33-YELLOW-V3 ⚠ MILD	65% 	Elevated moisture detected near transition runs. Monitor closely.

// P1 • AD-KY041-004 • FACET F2

Trapped Moisture / CDX Deck Rot

Affected area: 38.7 sq ft · depth 0.55"

Recommended remediation: Cut & replace 4x8 CDX section · re-bed I&WS · color-match slate replacement

Remediation cost · \$17,645.00

CONFIDENCE 92.45%

The screenshot shows the STRATEX Thermal Imaging Software interface. It features a 3D model of a roof with a thermal overlay. The overlay highlights a red/orange area on the roof, indicating trapped moisture or rot. The interface includes various data fields and a 'Tolerant Overlay' section.

PHASE

Framing

Structural framing repair, dormer corner reconstruction, sub-deck reinforcement

Made with Emergen

		180 man-hours · 26.9% of total	\$61,714.00
	PHASE Roofing	Finished slate replacement, valley re-detail, ridge & hip cap, I&WS underlayment 285 man-hours · 42.0% of total	PHASE TOTAL \$96,170.00
	PHASE Gutters	Half-round copper gutter replacement, downspouts, internal box gutter relining 55 man-hours · 9.8% of total	PHASE TOTAL \$22,538.00
	PHASE Siding	James Hardie fiber-cement plank, factory-finished, color-matched to historic palette 120 man-hours · 21.3% of total	PHASE TOTAL \$48,734.00

COMBINED MAN-HOURS	PHASE SUBTOTAL
640	\$229,156.00

STANDARD PRICING

LINE ITEM	AMOUNT
Material · Finished Slate (16.21sq × \$685.00/sq)	\$11,103.85
Labor · install (16.21sq × \$175.00/sq)	\$2,836.75
Tear-off & disposal (16.21sq × \$95.00/sq)	\$1,539.95
Underlayment · I&WS + synthetic (16.21sq × \$28.00/sq)	\$453.88
Valley detail · custom step flash (148.7 lf × \$14.50/lf)	\$2,155.71
Permits & dump fees	\$285.00
Anomaly AD-KY041-004 · Trapped Moisture / CDX Deck Rot · Cut & replace 4×8 CDX section · re-bed I&WS · color-match slate replacement	\$17,645.00
Subtotal	\$36,020.14
Overhead (18%)	\$6,483.63
Margin (22%)	\$9,350.83
TOTAL · ESTIMATE	\$51,854.60

Estimate valid through 2026-07-01 (30 days). Pricing subject to material market

 DISPOSAL & OVERALL PROJECT VALUE

DUMPSTER • FLAT FEE

\$1,800.00

COMBINED MAN-HOURS

640

OVERALL PROJECT VALUE

\$203,080.00

AUTHORIZED BY

ACCEPTED BY

Crown Roofing — Project Lead

The Whitaker Family — Homeowner / Property Owner

Generated by STRATEX™ Strategic Thermal Reconnaissance • STRATEX-AD-KY041-20260601 • This deliverable was assembled from radiometrically-corrected drone telemetry. STRATEX certifies the geometric measurements and forensic classifications above; remediation pricing reflects the contractor's standard schedule and is subject to on-site verification.