

ECAM procedure lines for the SURV systems, and CABIN CREW on the LINE-UP checklist

The WXR & TAWS and XPDR & TCAS lines of the ADR / IR / TCAS fault procedures tick from the real system selection

Aircraft	A380X
Where to find it	EWD procedures (ADR x+y FAULT, IR x+y FAULT, TCAS 1 / 2 FAULT); MFD SURV STATUS & SWITCHING page; EWD checklist LINE-UP
PR branch	pr/06-a380x-checklists-surv (stacked on PR 5: needs its system selection)
Status	Tested in the sim (September 2026).
Pictures	EWD and MFD in the local browser harness, running the builds installed in the sim; the EWD states are the ones the FWS sends.

1. What it is for

2. Where the systems are selected

3. What you see
4. LINE-UP checklist

5. Limitations and why

1. What it is for

The dual ADR and IR fault procedures ask the crew to move the WXR & TAWS and the XPDR & TCAS to the system that still has valid data. Those lines were hard-coded as done, so the ECAM ticked them even when the wrong system stayed selected. They now follow the selection made on the MFD SURV STATUS & SWITCHING page (PR 5), and the TCAS 1 / 2 FAULT procedures show their XPDR & TCAS line, which was hidden.

2. Where the systems are selected

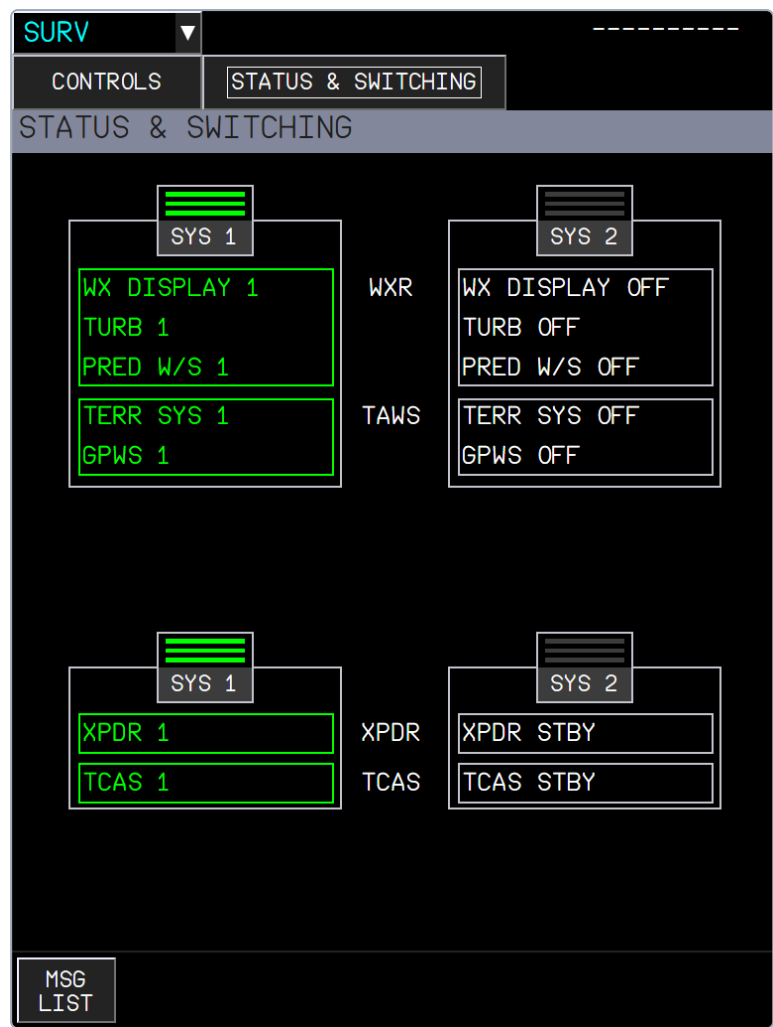


Figure 1. MFD SURV STATUS & SWITCHING: the SYS 1 / SYS 2 buttons of WXR & TAWS (top) and XPDR & TCAS (bottom).

3. What you see

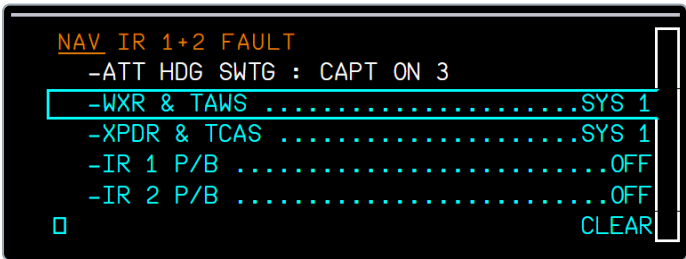


Figure 2. IR 1+2 FAULT with both systems on SYS 2: the two lines wait, in cyan.

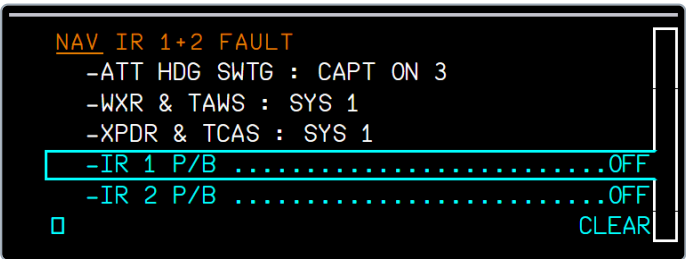


Figure 3. After selecting SYS 1 on the SURV page: the lines are done (white) and the cursor moves on.

Procedure	WXR & TAWS	XPDR & TCAS
ADR 1+2 FAULT, ADR 2+3 FAULT, IR 1+2 FAULT, IR 2+3 FAULT	SYS 1	SYS 1
ADR 1+3 FAULT, IR 1+3 FAULT	SYS 2	SYS 2
TCAS 1 FAULT	-	SYS 2
TCAS 2 FAULT	-	SYS 1

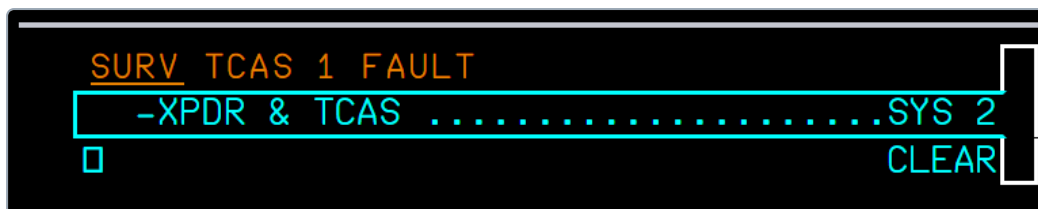


Figure 4. TCAS 1 FAULT: the XPDR & TCAS line is now shown.

Situation	What you should see
The right system is already selected when the fault appears	The line is shown already done.
The crew selects the other system	The line ticks within a second; the cursor moves to the next line.
The crew goes back to the failed side	The line becomes due again (it follows the live selection).

4. LINE-UP checklist

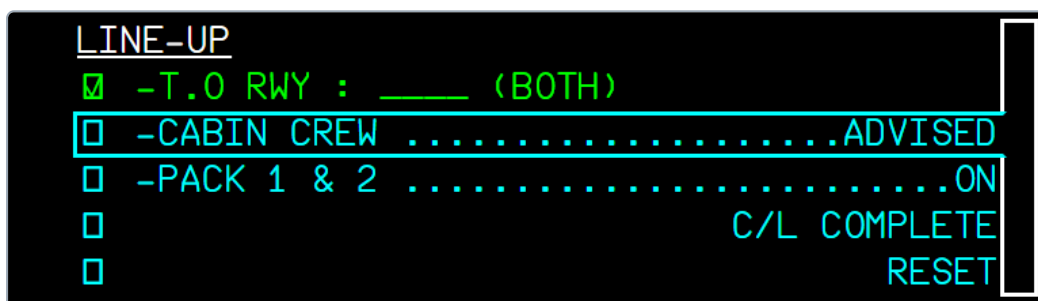


Figure 5. ECAM LINE-UP: the CABIN CREW ... ADVISED line (crew check).

The ECAM LINE-UP checklist gets the CABIN CREW line that the flyPad checklist already had (A380 FCOM BEFORE TAKEOFF checklist: CABIN CREW ... ADVISE). It is ticked by the crew.

5. Limitations and why

Limitation	Why	What to do
No SURV lines in the normal checklists.	The A380 FCOM normal checklists (PRO-NOR-C-L) have none; an earlier version of this change added some and was reverted.	-
Needs PR 5.	The system selection LVars come from the SURV panel of PR 5.	Install both.