



T H E S T O N E H O U S E C O M P A N Y
Nashville, Tennessee

BUYER • CLOSING PACKET

CLOSING PACKET

PROPERTY

9614 DEER TRACK CT, BRENTWOOD, TN 37027

PREPARED FOR

JONATHAN DE JONG & MADISYN DE JONG

CLOSING DATE

FRIDAY, AUGUST 28, 2026

PREPARED BY

Ryan Stonehouse

The Stonehouse Company

(615) 812-0066 · ryan@thestonehouseco.com

HOW TO USE THIS BINDER

GUIDE TO THIS BINDER

Every attached document lives at a fixed page in this PDF. Use the page numbers below to jump straight to what you need — the reader controls at the bottom of the app also let you type a page number directly.

THE PACKET (THIS DOCUMENT)

Cover Property, buyers, closing date, prepared by	PAGE 1
Deal Summary Purchase, financing, key dates	PAGE 5
Your Team Every person involved + closing location	PAGE 6
At the Closing Table Day-of walkthrough + wire fraud warning	PAGE 7
Documents Provided What follows this packet + why	PAGE 9
First Week + Utilities Move-in checklist, door codes, utility contacts	PAGE 12

CONTRACT + SETTLEMENT

Purchase & Sale Agreement (RF401) Signed by buyer + seller · 11 pages	PAGE 14
Buyer Representation Agreement (RF141) Designated Agency · 6 pages	PAGE 25
Confirmation of Agency (COA) All-party acknowledgment	PAGE 31
Property Condition Disclosure Seller's PCD · 5 pages	PAGE 32
Repair & Replacement Proposal (RF654) Buyer's requested repairs	PAGE 37
Amendment #1 Signed by both parties	PAGE 38
Repair Amendment (FE)	PAGE

Seller's agreed repair scope	39
ALTA Settlement Statement Premier Escrow · File MS2026-1061 · 3 pages	PAGE 40

INSPECTION REPORTS — DILIGENT

Home Inspection Brennan Wade · Aug 3, 2026 · 96 pages	PAGE 43
Mold Screening Result: CLEAR · 9 pages	PAGE 139
Termite Inspection 4 pages	PAGE 148
Radon Report Result: CLEAR · 3 pages	PAGE 152

REPAIR RESOLUTION

Structural Engineer Re-Inspection W.L. Johanan P.E. · Aug 24, 2026 · confirms sound	PAGE 155
Structural Repairs Invoice Jeremy Woodson · \$1,735	PAGE 158
Structural Eval Statement Johanan P.E. · \$600 · Aug 12	PAGE 159
Re-Inspection Statement Johanan P.E. · \$300 · Aug 24	PAGE 160
Electrical Repair Receipt Forwarded by Paula Hinegardner	PAGE 163

APPRAISAL

Appraisal Report Clear Capital / Reggora · Aug 7, 2026 · 47 pages	PAGE 167
---	-------------

This PDF is 213 pages total. Save it somewhere permanent — you'll reference it for taxes, insurance claims, warranty questions, and any future sale of the home.

SECTION ONE

DEAL SUMMARY

Everything in one place — the numbers, the dates, and what to expect next. Verify every value against your fully executed contract before closing.

PROPERTY + PURCHASE

PROPERTY ADDRESS	9614 Deer Track Ct, Brentwood, TN 37027
PURCHASE PRICE	\$2,250,000
EARNEST MONEY	\$22,500 · held by Premier Escrow LLC
FINANCING	Conventional · \$1,450,000 loan through Churchill Mortgage Corporation
SELLER CONCESSIONS	None

KEY DATES

CONTRACT (UC) DATE	July 29, 2026
EARNEST MONEY DEADLINE	August 3, 2026 · ✓ complete
INSPECTION PERIOD ENDS	August 8, 2026 · ✓ complete
RESOLUTION PERIOD ENDS	August 12, 2026 · ✓ complete
APPRAISAL ORDERED / DUE	August 7, 2026
FINANCING CONTINGENCY ENDS	Financed through Churchill Mortgage (contingency date TBD — confirm from contract)
FINAL WALKTHROUGH	August 26, 2026
CLOSING DATE + TIME	Friday, August 28, 2026 · 9:00 AM CT

Note: All dates are calendar days unless the contract explicitly says business days. If a deadline falls on a weekend or holiday, most contracts push it to the next business day — verify with your closing attorney if timing is close.

SECTION TWO

YOUR TEAM

Every person involved in getting your keys in your hand. Save these to your phone before closing so you can reach anyone quickly if a question comes up.

YOUR BUYER'S AGENT · STONEHOUSE

RYAN STONEHOUSE

Phone (615) 812-0066 Email ryan@thestonehouseco.com

LISTING AGENT · OTHER SIDE

PAULA HINEGARDNER

Phone TBD Email TBD · Brokerage: Keller Williams

CLOSING ATTORNEY

DYLAN POTTER

Phone (615) 337-3082 Email dylan@premierescrowllc.com

CLOSING / TITLE COMPANY

PREMIER ESCROW LLC

Phone TBD Email 4301 Hillsboro Pike, Suite 300, Nashville, TN 37215

INSPECTION COMPANY

DILIGENT

Phone TBD Email office@getdiligent.com

LENDER / LOAN OFFICER

DAVID PORTER · CHURCHILL MORTGAGE

Phone (615) 767-5148 Email david.porter@churchillmortgage.com · \$1,450,000 loan

CLOSING LOCATION

Premier Escrow LLC · 4301 Hillsboro Pike, Suite 300, Nashville, TN 37215

SECTION THREE

AT THE CLOSING TABLE

THE DAY-OF WALKTHROUGH

- Arrive 10 minutes early. Bring a valid government-issued photo ID (driver's license or passport) for every buyer on the loan and title.
- Review the final Closing Disclosure (CD) — you should have received this at least 3 business days before closing. Compare it against your Loan Estimate; flag any discrepancies immediately.
- Sign the loan and title documents — this takes 45 to 90 minutes on average. The closing attorney walks you through every page.
- Bring or wire your closing funds ahead of time (see the Wire Fraud Warning below). Certified checks are also accepted; personal checks over \$500 are typically not.
- Once all documents are signed and funds have been received, you get the keys. Your buyer's agent will do a final handoff.
- If the seller is doing a post-occupancy leaseback, keys transfer per the agreed schedule — not at closing.

⚠ WIRE FRAUD WARNING — READ CAREFULLY

Wire fraud is the #1 threat in real estate closings. Criminals impersonate closing attorneys, title companies, or agents and email fake wire instructions. Losses are often unrecoverable.

BEFORE WIRING ANY FUNDS:

1. Call the closing company using a phone number you find independently (from their website or your Stonehouse agent) — NEVER the number in the email. Verify the wire instructions with them verbally.
2. Do NOT trust wire instructions received by email or text alone. Legitimate closing companies expect you to verify.
3. Send from your bank's official ACH/wire portal or in-person at the branch — not from a link.
4. After sending, call the closing company AGAIN within one hour to confirm receipt. If they don't confirm, call your bank immediately to attempt a recall.

When in doubt, don't send. Call your Stonehouse agent first — we'll walk you through the verification.

VERIFIED WIRE INSTRUCTIONS

The closing company will provide wire instructions directly. This block is a place for you to write them down after phone verification — do NOT trust anything emailed to you until you've called and verified.

VERIFIED WITH (NAME)	_____
PHONE NUMBER CALLED	_____
DATE VERIFIED	_____
BANK NAME	_____
ROUTING NUMBER	_____
ACCOUNT NUMBER	_____
WIRE AMOUNT	_____

SECTION FOUR

DOCUMENTS PROVIDED

The pages that follow this packet contain every transaction document assembled for your closing. Keep this binder in a safe place — you'll reference it for taxes, insurance claims, warranty questions, and any future sale of the home.

CONTRACT + SETTLEMENT

Purchase & Sale Agreement (RF401)

Fully signed by buyer and seller · 11 pages

Buyer Representation Agreement (RF141)

Designated Agency · Signed by buyers and Stonehouse · 6 pages

Confirmation of Agency (COA)

Signed by all parties

Seller's Property Condition Disclosure (PCD)

Signed by seller · 5 pages

Repair & Replacement Proposal (RF654)

Signed · Buyer's requested repairs following inspection

Amendment #1

Signed by both parties

Repair Amendment

Fully executed · Seller's agreed repair scope

ALTA Settlement Statement

Premier Escrow LLC · File MS2026-1061 · Prepared Aug 24, 2026 · Line-by-line breakdown of every credit + debit at closing

INSPECTION REPORTS · DILIGENT

Home Inspection Report

Diligent · Brennan Wade · Aug 3, 2026 · Full property inspection (96 pages)

Mold Screening Report

Diligent · Aug 3, 2026 · Result: CLEAR

Termite Inspection

Diligent · Brennan Wade (Cat7 #148477) · Aug 3, 2026

Radon Report

Diligent · Aug 3, 2026 · Below EPA action level · Result: CLEAR

REPAIR RESOLUTION

Structural finding on a floor joist in the mechanical room was identified during inspection. The seller engaged a licensed structural engineer (William L. Johanan, P.E.) and a licensed contractor (Jeremy Woodson) to remediate. The engineer re-inspected on 8/24/26 and confirmed the structure is now STRUCTURALLY SOUND. Full paper trail attached.

Structural Engineer Re-Inspection Letter

William L. Johanan, P.E. · Aug 24, 2026 · Confirms repairs completed + structure is structurally sound

Structural Repairs Invoice

Jeremy Woodson · Aug 18, 2026 · \$1,735 · Installed structural member additions per engineer report

Structural Engineer Statement — Evaluation

William L. Johanan, P.E. · Aug 12, 2026 · \$600 · Original evaluation of damaged joist

Structural Engineer Statement — Re-Inspection

William L. Johanan, P.E. · Aug 24, 2026 · \$300 · Post-repair re-inspection

Electrical Repair Receipt

Forwarded by listing agent Paula Hinegardner · Aug 21, 2026

APPRAISAL

Appraisal Report

Clear Capital / Reggora · Ordered Aug 7, 2026 · Prepared for Churchill Mortgage

If anything in this binder is missing or unclear, call your Stonehouse agent — we keep signed originals on file and can send a copy anytime.

SECTION FIVE

FIRST WEEK + UTILITY TRANSFERS

PROPERTY ACCESS — FROM THE SELLER

The seller passed along the following access info. Change every code and reassign the locks in your own account on Day 1 — this is Step 1 on the checklist below.

BACK DOOR + GARAGE DOOR	Code 8657, then push the bar at the bottom
SMART LOCK / SMART-HOME APP	XthingsHome · Buyers can change codes and reassign the locks from within the app

MOVE-IN CHECKLIST

Practical items to knock out in your first week. Print this page and cross items off as you go.

- ☐ Change every exterior door lock (or rekey with a locksmith). Include garage door codes if applicable.
- ☐ Test every smoke and CO detector; replace batteries if unsure of their age.
- ☐ Locate + label the main water shutoff, main electrical panel, and gas shutoff.
- ☐ Change HVAC filters. Note the size on your phone for future orders.
- ☐ File USPS mail forwarding at moversguide.usps.com (starts within 7 days).
- ☐ Update address with employer, bank, credit cards, insurance, DMV, IRS, and any subscription services.
- ☐ Test the garage door opener + reset any keypad codes.
- ☐ If there's a security system, contact the provider to transfer or set up service; change the master code.
- ☐ Photograph and archive every serial number + model on major appliances for warranty reference.
- ☐ Locate the HOA welcome packet (if applicable) — dues, rules, board contact.
- ☐ Schedule a chimney inspection if the home has a fireplace and it hasn't been swept in 12+ months.
- ☐ Set up an emergency binder: closing docs, warranty info, insurance policy, appliance manuals.

UTILITY TRANSFERS — NASHVILLE AREA

Contact each utility 1-2 weeks before closing to schedule the transfer for your closing date. Most take same-day or next-day for existing service; new construction may take longer.

ELECTRIC · NES	nespower.com · (615) 736-6900
WATER + SEWER · METRO WATER	nashville.gov/water · (615) 862-4600
NATURAL GAS · PIEDMONT	piedmontng.com · (800) 752-7504
TRASH + RECYCLING	nashville.gov/water · (615) 862-4600 (bundled w/ water)
INTERNET · AT&T FIBER	att.com · (800) 288-2020
INTERNET · XFINITY/COMCAST	xfinity.com · (800) 934-6489
STREAMING / CABLE · YOUTUBE TV / HULU	set up online — no transfer needed
HOA (IF APPLICABLE)	Bonbrook Homeowners Association · c/o Westwood Management, Inc · \$658 working capital + \$400 transfer fee due at closing

THE STONEHOUSE COMPANY

Thank you for trusting us with your home purchase. If anything comes up before, during, or after closing — call your agent first.

PURCHASE AND SALE AGREEMENT

1. Purchase and Sale. For and in consideration of the mutual covenants herein and other good and valuable consideration, the receipt and sufficiency of which is hereby acknowledged, the undersigned buyer

Jonathan De Jong, Madisyn De Jong ("Buyer") agrees to buy and the undersigned seller Faron Kelsh, Connie Kelsh ("Seller")

agrees to sell all that tract or parcel of land, with such improvements as are located thereon, described as follows:

All that tract of land known as: 9614 Deer Track Ct

(Address) Brentwood (City), Tennessee, 37027 (Zip), as recorded in

County Register of Deeds Office, deed book(s), page(s),

and/or 034F A 008.00 000 instrument number and as further described as:

034F A 008.00 000 9614 Deer Track Ct Brentwood, TN 37027 together with all fixtures, landscaping, improvements, and appurtenances, all being hereinafter collectively referred to as the "Property."

A. INCLUDED as part of the Property (if present): all attached light fixtures and bulbs including ceiling fans; permanently attached plate glass mirrors; heating, cooling, and plumbing fixtures and equipment; all doors, storm doors and windows; all window treatments (e.g., shutters, blinds, shades, curtains, draperies) and hardware; all wall-to-wall carpet; range; all built-in kitchen appliances; all bathroom fixtures and bathroom mirrors; all gas logs, fireplace doors and attached screens; all security system components and controls; garage door opener(s) and all (at least 1) remote controls; any wired electric vehicle wall charging stations; swimming pool and its equipment; awnings; permanently installed outdoor cooking grills; all landscaping and all outdoor lighting; mailbox(es); attached basketball goals and backboards; TV mounting brackets (inclusive of wall mount and TV brackets) but excluding flat screen TVs); antennae and satellite dishes (excluding components); central vacuum systems and attachments; and all available keys, key fobs, access codes, master codes or other methods necessary for access to the Property, including mailboxes and/or amenities.

B. Other items that REMAIN with the Property at no additional cost to Buyer:

All Appliances including refrigerator, dishwasher, drink fridge, ice maker

C. Items that SHALL NOT REMAIN with the Property:

washer, dryer, all furniture

D. LEASED ITEMS: Leased items that remain with the Property: (e.g., security systems, water softener systems, fuel tank, etc.):

Buyer shall assume any and all lease payments as of Closing. If leases are not assumable, the balance shall be paid in full by Seller at or before Closing.

☒ Buyer does not wish to assume a leased item. **(THIS BOX MUST BE CHECKED IN ORDER FOR IT TO BE A PART OF THIS AGREEMENT.)**

Buyer does not wish to assume Seller's current lease of _____; therefore, Seller shall have said lease cancelled and leased items removed from Property prior to Closing.

E. FUEL: Fuel, if any, shall be adjusted and charged to Buyer and credited to Seller at Closing at current market prices.

2. Purchase Price, Method of Payment and Closing Expenses. Buyer warrants that, except as may be otherwise provided herein, Buyer shall at Closing have sufficient cash to complete the purchase of the Property under the terms of this Purchase and Sale Agreement (hereinafter "Agreement"). The purchase price to be paid is: \$ 2,250,000.00, Two Million, Two Hundred Fifty Thousand U.S. Dollars, ("Purchase Price") which shall be disbursed to Seller or Seller's Closing Agency by one of the following methods:

- i. a Federal Reserve Bank wire transfer;
- ii. a Cashier's Check issued by a financial institution as defined in 12 CFR § 229.2(i); OR
- iii. other such form as is approved in writing by Seller.

A. Financial Contingency – Loan(s) To Be Obtained. This Agreement is conditioned upon Buyer's ability to obtain a loan(s) in the principal amount up to 80 % of the Purchase Price listed above to be secured by a deed of trust on the Property. "Ability to obtain" as used herein means that Buyer is qualified to receive the loan described herein

based upon Lender's customary and standard underwriting criteria. In consideration of Buyer, having acted in good faith and in accordance with the terms below, being unable to obtain financing by the Closing Date, the sufficiency of such consideration being hereby acknowledged, Buyer may terminate this Agreement by providing written notice via the Notification form or equivalent written notice. Seller shall have the right to request any supporting documentation regarding loan denial. Upon termination, Buyer is entitled to a refund of the Earnest Money/Trust Money. Lender is defined herein as the financial institution funding the loan.

The loan shall be of the type selected below (Select the appropriate box.):

- ☒ Conventional Loan ☐ FHA Loan; attach addendum
☐ VA Loan; attach addendum ☐ Rural Development/USDA
☐ Other _____

Buyer may apply for a loan with different terms and conditions and also Close the transaction provided all other terms and conditions of this Agreement are fulfilled, and the new loan does not increase any costs charged to Seller. Buyer shall be obligated to Close this transaction if Buyer has the ability to obtain a loan with terms as described herein and/or any other loan for which Buyer has applied and been approved.

Loan Obligations: The Buyer agrees and/or certifies as follows:

- (1) Within three (3) days after the Binding Agreement Date, Buyer shall make application for the loan and shall pay for credit report. Buyer shall immediately notify Seller or Seller's representative of having applied for the loan and provide Lender's name and contact information, and that Buyer has instructed Lender to order credit report. Such certifications shall be made via the Notification form or equivalent written notice;
- (2) Within fourteen (14) days after the Binding Agreement Date, Buyer shall warrant and represent to Seller via the Notification form or equivalent written notice that:
 - a. Buyer has secured evidence of hazard insurance which shall be effective at Closing and Buyer shall notify Seller of the name of the hazard insurance company;
 - b. Buyer has notified Lender of an Intent to Proceed and has available funds to Close per the signed Loan Estimate; and
 - c. Buyer has requested that the appraisal be ordered and affirms that the appraisal fee has been paid.
- (3) Buyer shall pursue qualification for and approval of the loan diligently and in good faith;
- (4) Buyer shall continually and immediately provide requested documentation to Lender and/or loan originator;
- (5) Unless otherwise stated in this Agreement, Buyer represents that this loan is not contingent upon the lease or sale of any other real property and the same shall not be used as the basis for loan denial; and
- (6) Buyer shall not intentionally make any material changes in Buyer's financial condition which would adversely affect Buyer's ability to obtain the Primary Loan or any other loan referenced herein.

Should Buyer fail to timely comply with section 2.A.(1) and/or 2.A.(2) above **and provide notice as required**, Seller may make written demand for compliance via the Notification form or equivalent written notice. If Buyer does not furnish Seller the requested documentation within two (2) days after such demand for compliance, Buyer shall be considered in default and Seller has the right to terminate this Agreement. If the Seller fails to terminate before the Buyer cures, then that right has been waived.

☐ **B. Financing Contingency Waived (THIS BOX MUST BE CHECKED TO BE PART OF THIS AGREEMENT.)**

(e.g. "All Cash", etc.): Buyer's obligation to close shall not be subject to any financial contingency. Buyer reserves the right to obtain a loan. Buyer shall furnish proof of available funds to close in the following manner:

_____ (e.g. bank statement, Lender's commitment letter) within five (5) days after Binding Agreement Date. Should Buyer fail to do so, Seller may make written demand for compliance via the Notification form or equivalent written notice. If Buyer does not furnish Seller with the requested documentation within two (2) days after such demand for compliance, Buyer shall be considered in default and Seller has the right to terminate this Agreement. If the Seller fails to terminate before the Buyer cures, then that right has been waived. Failure to Close due to lack of funds shall be considered default by Buyer.

In the event this Agreement is contingent upon an appraisal (See Section 2.C. below), Buyer must order the appraisal and provide Seller with the name and telephone number of the appraisal company and proof that appraisal was ordered within five (5) days of the Binding Agreement Date. Should Buyer fail to do so, Seller may make written demand for compliance via the Notification form or equivalent written notice. If Buyer does not furnish Seller with the requested documentation within two (2) days after such demand for compliance, Buyer shall be considered in default and Seller has the right to terminate this Agreement. If the Seller fails to terminate before the Buyer cures, then that right has been waived.

C. Appraisal (Select either 1 or 2 below. The sections not checked are not a part of this Agreement).

- ☐ **1.** This Agreement **IS NOT** contingent upon the appraised value either equaling or exceeding the agreed upon

This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.



- Purchase Price. Thereafter, failure to appraise shall not be used as the basis for loan denial or termination of Agreement.
- ✕ 2. This Agreement **IS CONTINGENT** upon the appraised value either equaling or exceeding the agreed upon Purchase Price. If the appraised value is equal to or exceeds Purchase Price, this contingency is satisfied. In consideration of Buyer having conducted an appraisal, the sufficiency of such consideration being hereby acknowledged, if the appraised value of the Property does not equal or exceed the Purchase Price, Buyer shall promptly notify the Seller via the Notification form or equivalent written notice. Buyer shall then have three (3) days to either:
1. waive the appraisal contingency via the Notification form or equivalent written notice
 - OR**
 2. terminate the Agreement by giving notice to Seller via the Notification Form or equivalent written notice. Upon timely termination, Buyer is entitled to a refund of the Earnest Money/Trust Money.
- In the event Buyer fails to either waive the appraisal contingency or terminate the Agreement as set forth above, this contingency shall be deemed satisfied. Thereafter, failure to appraise shall not be used as the basis for loan denial or termination of Agreement. Seller shall have the right to request any supporting documentation showing appraised value did not equal or exceed the agreed upon Purchase Price.

D. Closing Expenses.

1. **Seller Expenses.** Seller shall pay all existing loans and/or liens affecting the Property, including all penalties, release preparation costs, and applicable recording costs; any accrued and/or outstanding association dues or fees; fee (if any) to obtain lien payoff/estoppel letters/statement of accounts from any and all associations, property management companies, mortgage holders or other liens affecting the Property; Seller's closing fee, document preparation fee and/or attorney's fees; fee for preparation of deed; notary fee on deed; and financial institution (Bank, Credit Union, etc.) wire transfer fee or commercial courier service fee related to the disbursement of any lien payoff(s). Seller additionally agrees to permit any withholdings and/or to pay any additional sum due as is required under the Foreign Investment in Real Property Tax Act. Failure to do so shall constitute a default by Seller.

In the event Seller is subject to Tax Withholding as required by the Foreign Investment in Real Property Tax Act, (hereinafter "FIRPTA"), Seller additionally agrees that such Tax Withholding must be collected from Seller by Buyer's Closing Agent at the time of Closing. In the event Seller is not subject to FIRPTA, Seller shall be required as a condition of Closing to sign appropriate affidavits certifying that Seller is not subject to FIRPTA. *It is Seller's responsibility to seek independent tax advice or counsel prior to the Closing Date regarding such tax matters.*

2. **Buyer Expenses.** Buyer shall pay all transfer taxes and recording fees on deed of conveyance and deed of trust; Buyer's closing fee, document preparation fee and/or attorney's fees; preparation of note, deed of trust, and other loan documents; mortgage loan inspection or boundary line survey; credit report; required premiums for private mortgage, hazard and flood insurance; required reserved deposits for insurance premiums and taxes; prepaid interest; re-inspection fees pursuant to appraisal; insured Closing Protection Letter; association fees as stated within section 4.F.; and any costs incident to obtaining and closing a loan, including but not limited to: appraisal, origination, discount points, application, commitment, underwriting, document review, courier, assignment, photo, tax service, notary fees, and any wire fee or other charge imposed for the disbursement of the Seller's proceeds according to the terms of this Agreement.

3. **Title Expenses.** Cost of title search, mortgagee's policy and owner's policy (rates to be as filed with the Tennessee Department of Commerce and Insurance) shall be paid as follows:

Buyer to Pay

Simultaneous issue rates shall apply. It is the Buyer's responsibility to seek independent advice or counsel prior to Closing from Buyer's Closing Agency regarding the availability and coverage provided under an American Land Title Association Standard Owner's Insurance Policy and, if available, a Homeowner's Title Insurance Policy which provides additional coverage.

Not all of the above items (Seller Expenses, Buyer Expenses and Title Expenses) are applicable to every transaction and may be modified as follows:

Closing Agency for Buyer & Contact Information: Premier Escrow LLC, Dylan Potter 615-337-3082 4301 Hillsboro Pike Suite 300 Nashville, TN 37215

Closing Agency for Seller & Contact Information: _____

3. Earnest Money/Trust Money. Buyer has paid or shall pay within 5 days after the Binding Agreement Date to Premier Escrow LLC, Dylan Potter 615-337-3082 (name of Holder) ("Holder") located at 4301 Hillsboro Pike Suite 300 Nashville, TN 37215 (address of Holder), an Earnest Money/Trust Money deposit of \$ 22,500.00 by check (OR _____) ("Earnest Money/Trust Money").

A. Failure to Receive Earnest Money/Trust Money. In the event Earnest Money/Trust Money (if applicable) is not timely received by Holder or Earnest Money/Trust Money check or other instrument is not honored for any reason by the bank upon which it is drawn, Holder shall promptly notify Buyer and Seller of the Buyer's failure to deposit the agreed upon Earnest Money/Trust Money. Buyer shall then have one (1) day to deliver Earnest Money/Trust Money in immediately available funds to Holder. In the event Buyer does not deliver such funds, Buyer is in default and Seller shall have the right to terminate this Agreement by delivering to Buyer or Buyer's representative written notice via the Notification form or equivalent written notice. In the event Buyer delivers the Earnest Money/Trust Money in immediately available funds to Holder before Seller elects to terminate, Seller shall be deemed to have waived Seller's right to terminate, and the Agreement shall remain in full force and effect.

B. Handling of Earnest Money/Trust Money upon Receipt by Holder. Earnest Money/Trust Money (if applicable) is to be deposited promptly after the Binding Agreement Date or the agreed upon delivery date in this Earnest Money/Trust Money section or as specified in the Special Stipulations section contained herein. Holder shall disburse Earnest Money/Trust Money only as follows:

- (a) at Closing to be applied as a credit toward Buyer's Purchase Price;
- (b) upon a written agreement signed by all parties having an interest in the funds;
- (c) upon order of a court or arbitrator having jurisdiction over any dispute involving the Earnest Money/Trust Money;
- (d) upon a reasonable interpretation of the Agreement; or
- (e) upon the filing of an interpleader action with payment to be made to the clerk of the court having jurisdiction over the matter.

Holder shall be reimbursed for, and may deduct from any funds interpleaded, its costs and expenses, including reasonable attorney's fees. The prevailing party in the interpleader action shall be entitled to collect from the other party the costs and expenses reimbursed to Holder. No party shall seek damages from Holder (nor shall Holder be liable for the same) for any matter arising out of or related to the performance of Holder's duties under this Earnest Money/Trust Money section. Earnest Money/Trust Money shall not be disbursed prior to fourteen (14) days after deposit unless written evidence of clearance by bank is provided.

4. Closing, Prorations, Special Assessments and Warranties Transfer.

A. Closing Date. This transaction shall be closed ("Closed") (evidenced by delivery of warranty deed and payment of Purchase Price, the "Closing"), and this Agreement shall expire, at 11:59 p.m. local time on the 30th day of August, 2026 ("Closing Date"), or on such earlier date as may be agreed to by the parties in writing. Such expiration does not extinguish a party's right to pursue remedies in the event of default. Any extension of this date must be agreed to by the parties in writing via the Closing Date/Possession Date Amendment or equivalent written agreement.

1. Possession. Possession of the Property is to be given (Select the appropriate boxes below. Unselected items shall not be part of this Agreement):

☒ at Closing as evidenced by delivery of warranty deed and payment of Purchase Price;
OR

☐ as agreed in the attached and incorporated Temporary Occupancy Agreement;

B. Prorations. Real estate taxes, rents, dues, maintenance fees, and association fees on said Property for the calendar year in which the sale is Closed shall be prorated as of the Closing Date. If the final tax rate for the current year has not been set by the Taxing Authority at time of Closing, the tax rate and property assessment for the immediately preceding calendar year shall be utilized for calculation of the tax proration. In the event of a change or reassessment of taxes for the calendar year after Closing, the parties agree to pay their recalculated share. Real estate taxes, rents, dues, maintenance fees, and association fees for prior years and rollback taxes, if any, shall be paid by Seller.

C. Greenbelt. If property is currently classified by the property tax assessor as "Greenbelt" (minimum of 15 acres or otherwise qualifies), does the Buyer intend to keep the property in the Greenbelt? (Select the appropriate boxes below. Unselected items shall not be part of this Agreement):

- ☐ Buyer intends to maintain the property's Greenbelt classification and acknowledges that it is Buyer's responsibility to make timely and proper application to ensure such status. Buyer's failure to timely and properly make application shall result in the assessment of rollback taxes for which Buyer shall be obligated to pay. Buyer should consult the tax assessor for the county where the property is located prior to making this offer to verify that their intended use shall qualify for Greenbelt classification.
- ☒ Buyer does not intend to maintain the property's Greenbelt status and rollback taxes shall be payable by the Seller at time of closing.

D. Special Assessments. Special assessments approved or levied prior to the Closing Date shall be paid by the Seller at or prior to Closing unless otherwise agreed as follows:

E. Warranties Transfer. Seller, at the option of Buyer and at Buyer's cost, agrees to transfer Seller's interest in any manufacturer's warranties, service contracts, termite bond or treatment guarantee and/or similar warranties which by their terms may be transferable to Buyer.

F. Association Fees. Buyer shall be responsible for all homeowner or condominium association transfer fees, related administration fees (not including statement of accounts), capital expenditures/contributions incurred due to the transfer of Property and/or like expenses which are required by the association, property management company and/or the bylaws, declarations or covenants for the Property (unless otherwise specifically addressed herein and/or unless specifically chargeable to Seller under applicable bylaws, declarations, and/or neighborhood covenants).

5. Title and Conveyance.

A. Seller warrants that at the time of Closing, Seller shall convey or cause to be conveyed to Buyer or Buyer's assign(s) good and marketable title to said Property by general warranty deed, subject only to:

- (1) zoning;
- (2) setback requirements and general utility, sewer, and drainage easements of record on the Binding Agreement Date upon which the improvements do not encroach;
- (3) subdivision and/or condominium declarations, covenants, restrictions, and easements of record on the Binding Agreement Date; and
- (4) leases and other encumbrances specified in this Agreement.

If title examination, closing or loan survey pursuant to Tenn. Code Ann. § 62-18-126, boundary line survey, or other information discloses material defects, Buyer may, at Buyer's discretion:

- (1) accept the Property with the defects **OR**
- (2) require Seller to remedy such defects prior to the Closing Date. Buyer shall provide Seller with written notice of such defects via the Notification form or equivalent written notice. If defects are not remedied prior to Closing Date, Buyer and Seller may elect to extend the Closing Date by mutual written agreement evidenced by the Closing Date/Possession Amendment form or other written equivalent. If defects are not remedied by the Closing Date or any mutually agreed upon extension thereof, this Agreement shall terminate, and Buyer shall be entitled to refund of Earnest Money/Trust Money.

Good and marketable title as used herein shall mean title which a title insurance company licensed to do business in Tennessee shall insure at its regular rates, subject only to standard exceptions. The title search or abstract used for the purpose of evidencing good and marketable title must be acceptable to the title insurance agent and the issuing title insurance company. Seller agrees to execute such appropriate affidavits and instruments as may be required by the issuing title insurance company.

B. Buyer warrants Buyer has reviewed Tenn. Code Ann. Title 66, Chapter 2, Part 3 and is not a prohibited foreign party or prohibited foreign-party controlled business prohibited from purchasing agricultural or non-agricultural land in Tennessee pursuant to the statute.

C. Deed. Name(s) on Deed to be: Jonathan & Madisyn De Jong It is the Buyer's responsibility to consult the closing agency or attorney prior to Closing as to the manner in which Buyer holds title.

D. Association Lien Payoff. In the event the Property is subject to mandatory association assessments or other fees, which may impose a lien, Seller shall cause to be delivered to Buyer or Buyer's Closing Agent not later than seven (7) days before Closing a lien payoff, estoppel letter or a statement of account reflecting that the account relating to the Property is current or setting forth the sum due to bring the account current.

6. Public Water or Public Sewer Systems

In the event it is discovered that Public Water or Public Sewer System is accessible to the Property and connection to the Property is required by a governmental agency/authority or Lender, Buyer shall promptly notify the Seller via the

This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.



Notification form or equivalent written notice. Seller and Buyer shall have five (5) days following such written notice but not later than the Closing Date to negotiate in good faith the payment for the cost and the connection to the Public Water or Public Sewer System. In the event Seller and Buyer do not reach a mutual written agreement for the payment of such cost or a mutually agreeable written extension of such time period as evidenced in an Amendment to this Agreement signed by both parties within such period of time, this Agreement is hereby terminated. If terminated the Buyer is entitled to a refund of the Earnest Money/Trust Money.

7. Lead-Based Paint Disclosure (Select the appropriate box.)

☒ does not apply. ☐ does apply (Property built prior to 1978 – see attached Lead-Based Paint Disclosure)

8. Inspections.

A. Buyer's Right to Make Inspection(s). All inspections/reports, including but not limited to the home inspection report, those required/recommended in the home inspection report, Wood Destroying Insect Infestation Inspection Report, septic inspection and well water test, are to be made at Buyer's expense, unless otherwise stipulated in this Agreement. The parties hereto agree that in the event Buyer shall elect to contract with a third-party inspector to obtain a "Home Inspection" as defined by Tennessee law, said inspection shall be conducted by a licensed Home Inspector. However, nothing in this section shall preclude Buyer from conducting any inspections on Buyer's own behalf, nor shall it preclude Buyer from retaining a qualified (and if required by law, licensed) professional to conduct inspections of particular systems or issues within such professional's expertise or licensure, including but not limited to inspection of the heating/cooling systems, electrical systems, foundation, etc., so long as said professional is not in violation of Tenn. Code Ann. § 62-6-301, et seq. as may be amended. **Seller shall cause all utility services and any pool, spa, and similar items to be operational so that Buyer may complete all inspections and tests under this Agreement.** Buyer agrees to indemnify Seller from the acts of Buyer, Buyer's inspectors and/or representatives in exercising Buyer's rights under this Purchase and Sale Agreement. Buyer's obligations to indemnify Seller shall also survive the termination of this Agreement by either party, which shall remain enforceable.

Buyer waives any objections to matters of purely cosmetic nature (e.g. decorative, color or finish items) disclosed by inspection. Buyer has no right to require repairs or alterations purely to meet current building codes, unless required to do so by governmental authorities.

B. Initial Inspections. Buyer and/or Buyer's inspectors/representatives shall have the right and responsibility to enter the Property during normal business hours, for the purpose of making inspections and/or tests of the Property. Buyer and/or Buyer's inspectors/representatives shall have the right to perform a visual analysis of the condition of the Property, any reasonably accessible installed components, the operation of the Property's systems including but not limited to the following components: heating systems, cooling systems, electrical systems, plumbing systems, structural components, foundations, roof coverings, exterior and interior components, any other site aspects that affect the Property, and environmental issues (e.g. radon, mold, asbestos, etc.).

C. Wood Destroying Insect Infestation Inspection Report. If desired by Buyer or required by Buyer's Lender, it shall be Buyer's responsibility to obtain **at Buyer's expense** a Wood Destroying Insect Infestation Inspection Report (the "Report"), which shall be made by a Tennessee licensed and chartered pest control operator. Requests for treatment or for repair of damage, if any, should be addressed in the Buyer's request for repairs pursuant to Subsection 8.D., Buyer's Inspection and Resolution below.

D. Buyer's Inspection and Resolution. Within 10 days after the Binding Agreement Date ("Inspection Period"), Buyer shall cause to be conducted any inspection provided for herein, including but not limited to the Wood Destroying Insect Infestation Inspection Report **AND** shall provide written notice of such to Seller as described below. ***In the event Buyer fails to timely make such inspections and respond within said timeframe as described herein, the Buyer shall have forfeited any rights provided under this Section 8, and in such case shall accept the Property in its current condition, normal wear and tear excepted.***

In said notice Buyer shall either:

(1) In consideration of Buyer having conducted Buyer's good faith inspections as provided for herein, the sufficiency of such consideration being hereby acknowledged, Buyer shall furnish Seller with a list of written specified objections and immediately terminate this Agreement via the Notification form or equivalent written notice. All Earnest Money/Trust Money shall be returned to Buyer upon termination.

OR

(2) accept the Property in its present "AS IS" condition with any and all faults and no warranties expressed or implied via the Notification form or equivalent written notice. Seller has no obligation to make repairs.

OR

- (3) furnish Seller a written list of items which Buyer requires to be repaired and/or replaced with like quality or value in a professional and workmanlike manner via the Repair/Replacement Proposal or equivalent written notice. Seller shall have the right to request any supporting documentation that substantiates any item listed.

Resolution Period. Seller and Buyer shall then have a period of 4 days following receipt of the above stated written list ("Resolution Period") to reach a mutual agreement as to the items to be repaired or replaced with like quality or value by Seller, which shall be evidenced by the Repair / Replacement Amendment or written equivalent(s). The receipt by Seller of the above stated written list or Repair/Replacement Proposal marks the end of the Inspection Period and the beginning of the Resolution Period. ***The parties agree to negotiate repairs in good faith during the Resolution Period.*** Buyer reserves the right to withdraw the above stated written list or Repair/Replacement Proposal during the Resolution Period via the Notification form or equivalent written notice. Upon withdrawal, Buyer shall be deemed to have accepted the Property in its present "AS IS" condition and Seller shall have no obligation to make repairs.

This Agreement shall terminate at the end of the Resolution Period with a refund of Earnest Money/Trust Money to the Buyer, unless one of the following occurs:

(1) Seller and Buyer enter into a Repair/Replacement Amendment or written equivalent(s);

OR

(2) Buyer provides written notice to Seller that Buyer is accepting Property "AS IS";

OR

(3) Seller and Buyer enter into a written amendment extending the Resolution Period.

- ☐ Buyer waives the option to request items to be repaired and/or replaced under D (3) above and there shall be no Resolution Period. Buyer retains the right to perform Buyer's Inspections and to timely furnish Seller with a list of written specified objections and immediately terminate this Agreement as provided in D (1) above or accept the Property in its present AS IS condition as provided under D (2) above.

- ☐ **E. Waiver of All Inspections. THIS BOX MUST BE CHECKED TO BE PART OF THIS AGREEMENT.**

Buyer, having been advised of the benefits of inspections, waives any and all Inspection Rights under this Section 8 (including but not limited to the Wood Destroying Insect Infestation Inspection Report).

- 9. Completion of Repairs.** In the event a Completion of Repairs Deadline is not established in a Repair/ Replacement Amendment or written equivalent, the Buyer shall use the Final Inspection to determine that all repairs/ replacements agreed to during the Resolution Period, if any, have been completed.

In the event repairs have not been completed by the established deadline, Seller shall be considered in default of this Agreement and Buyer may terminate via the Notification Form or written equivalent. Upon termination, Earnest Money/ Trust Money shall be returned to Buyer.

- 10. Final Inspection.** Buyer and/or Buyer's inspectors/representatives shall have the right to conduct a final inspection of Property on the Closing Date or within 1 day(s) prior to the Closing Date only to confirm Property is in the same or better condition as it was on the Binding Agreement Date, normal wear and tear excepted. Property shall remain in such condition until Closing at Seller's expense.

Closing of this sale constitutes acceptance of Property in its condition as of the time of Closing, unless otherwise mutually agreed upon in writing.

- 11. Buyer's Additional Due Diligence Options.** If any of the matters below are of concern to Buyer, Buyer should address the concern by specific contingency in the Special Stipulations Section of this Agreement.

A. Survey and Flood Certification. Survey Work and Flood Certifications are the best means of identifying boundary lines and/or encroachments and easements or flood zone classifications. Buyer may obtain a Mortgage Inspection or Boundary Line Survey and Flood Zone Certifications.

B. Insurability. Many different issues can affect the insurability and the rates of insurance for property. These include factors such as changes in the Flood Zone Certifications, changes to the earthquake zones maps, the insurability of the buyer, and previous claims made on the Property. It is the right and responsibility of Buyer to determine the insurability, coverage and the cost of insuring the Property. It is also the responsibility of Buyer to determine whether any exclusions shall apply to the insurability of said Property.

C. Water Supply. The system may or may not meet state and local requirements. It is the right and responsibility of Buyer to determine the compliance of the system with state and local requirements. [For additional information on this subject, request the "Water Supply and Waste Disposal Notification" form.]

D. Waste Disposal. The system may or may not meet state and local requirements. It is the right and responsibility of Buyer to determine the compliance of the system with state and local requirements. In addition, Buyer may, for a fee, obtain a septic system inspection letter from the Tennessee Department of Environment and Conservation, Division of Ground Water Protection. [For additional information on this subject, request the "Water Supply and Waste Disposal Notification" form.]

E. Title Exceptions. At Closing, the general warranty deed shall be subject to subdivision and/or condominium declarations, covenants, restrictions and easements of record, which may impose obligations and may limit the use of the Property by Buyer.

12. Disclaimer. It is understood and agreed that the real estate firms and real estate licensee(s) representing or assisting Seller and/or Buyer and their brokers (collectively referred to as "Brokers") are not parties to this Agreement and do not have or assume liability for the performance or nonperformance of Seller or Buyer. Buyer and Seller agree that Brokers shall not be responsible for any of the following, including but not limited to, those matters which could have been revealed through a survey, flood certification, title search or inspection of the Property; the insurability of the Property or cost to insure the Property; for the condition of the Property, any portion thereof, or any item therein; for any geological issues present on the Property; for any issues arising out of the failure to physically inspect Property prior to entering into this Agreement and/or Closing; for the necessity or cost of any repairs to the Property; for hazardous or toxic materials; for the tax or legal consequences of this transaction; for the availability, capability, and/or cost of utility, sewer, septic, or community amenities; for any proposed or pending condemnation actions involving Property; for applicable boundaries of school districts or other school information; for the appraised or future value of the Property; for square footage or acreage of the Property; for any condition(s) existing off the Property which may affect the Property; for the terms, conditions, and availability of financing; and/or for the uses and zoning of the Property whether permitted or proposed. Buyer and Seller acknowledge that Brokers are not experts with respect to the above matters and that they have not relied upon any advice, representations or statements of Brokers (including their firms and affiliated licensees) and waive and shall not assert any claims against Brokers (including their firms and affiliated licensees) involving same. Buyer and Seller understand that it has been strongly recommended that if any of these or any other matters concerning the Property are of concern to them, that they secure the services of appropriately credentialed experts and professionals of Buyer's or Seller's choice for the independent expert advice and counsel relative thereto. Buyer and Seller acknowledge that photographs, marketing materials, and digital media used in the marketing of the property may continue to remain in publication after Closing. Buyer and Seller agree that Brokers shall not be liable for any uses of photographs, marketing materials or digital media which the Broker is not in control.

13. Brokerage. As specified by separate agreement(s), the parties agree and acknowledge that the Brokers involved in this transaction may receive compensation for their services; the compensation may come from more than one party. All parties to this Agreement agree and acknowledge that any real estate firm involved in this transaction shall be deemed a third-party beneficiary only for the purposes of enforcing their compensation rights, and as such, shall have the right to maintain an action on this Agreement for any and all compensations due and any reasonable attorney's fees and court costs. **Broker compensation is not set by law and compensation rates are fully negotiable.**

14. Default. Should Buyer default hereunder, the Earnest Money/Trust Money shall be forfeited as damages to Seller and shall be applied as a credit against Seller's damages. Seller may elect to sue, in contract or tort, for additional damages or specific performance of the Agreement, or both. Should Seller default, Buyer's Earnest Money/Trust Money shall be refunded to Buyer. In addition, Buyer may elect to sue, in contract or tort, for damages or specific performance of this Agreement, or both. In the event that any party hereto shall file suit for breach or enforcement of this Agreement (including suits filed after Closing which are based on or related to the Agreement), the prevailing party shall be entitled to recover all costs of such enforcement, including reasonable attorney's fees. In the event that any party exercises its right to terminate due to the default of the other pursuant to the terms of this Agreement, the terminating party retains the right to pursue any and all legal rights and remedies against the defaulting party following termination. The parties hereby agree that all remedies are fair and equitable and neither party shall assert the lack of mutuality of remedies, rights and/or obligations as a defense in the event of a dispute.

15. Home Protection Plan. This is not a substitution for Home Inspection. Exclusions to coverage may apply. **(Select the appropriate box below. Items not selected are not part of this Agreement).**

- ☐ **Home Protection Plan.** _____ to pay \$ _____ for the purchase of a limited home protection plan to be funded at Closing. Plan Provider: _____
Ordered by: _____ (Real Estate Company)
- ☒ **Home Protection Plan waived.**

16. Non-Assignability. This Purchase and Sale Agreement shall not be assignable by the Buyer without prior written consent by the Seller.

17. Other Provisions.

- A. Binding Effect, Entire Agreement, Modification, Assignment, and Binding Agreement Date.** This Agreement shall be for the benefit of, and be binding upon, the parties hereto, their heirs, successors, legal representatives and approved assigns. This Agreement constitutes the sole and entire agreement between the parties hereto and no modification of this Agreement shall be binding unless signed by all parties or approved assigns to this Agreement. No representation, promise, or inducement not included in this Agreement shall be binding upon any party hereto. It is hereby agreed by both Buyer and Seller that any real estate agent working with or representing either party shall not have the authority to bind the Buyer, Seller or any approved assignee to any contractual agreement unless specifically authorized in writing within this Agreement. Any approved assignee shall fulfill all the terms and conditions of this Agreement. The parties hereby authorize either licensee to insert the time and date of receipt of the notice of acceptance of the final offer. The foregoing time and date shall be referred to for convenience as the Binding Agreement Date for purposes of establishing performance deadlines.
- B. Survival Clause.** Any provision contained herein, which by its nature and effect is required to be performed after Closing, shall survive the Closing and delivery of the deed and shall remain binding upon the parties to this Agreement and shall be fully enforceable thereafter.
- C. Governing Law and Venue.** This Agreement is intended as a contract for the purchase and sale of real property and shall be governed by and interpreted in accordance with the laws and in the courts of the State of Tennessee.
- D. Time of Essence.** Time is of the essence in this Agreement.
- E. Terminology.** As the context may require in this Agreement: (1) the singular shall mean the plural and vice versa; (2) all pronouns shall mean and include the person, entity, firm or corporation to which they relate; (3) the masculine shall mean the feminine and vice versa; and (4) the term day(s) used throughout this Agreement shall be deemed to be calendar day(s) ending at 11:59 p.m. local time unless otherwise specified in this Agreement. Local time shall be determined by the location of Property. **In the event a performance deadline**, other than the Closing Date (as defined herein), Date of Possession (as defined herein), Completion of Repair Deadline (as defined in the Repair/Replacement Amendment), and Offer Expiration Date (as defined in Time Limit of Offer Section), occurs on a Saturday, Sunday or legal holiday, the performance deadline shall extend to the next following business day. Holidays as used herein are those days deemed federal holidays pursuant to 5 U.S.C. § 6103(a). In calculating any time period under this Agreement, the commencement shall be the day following the initial date (e.g. Binding Agreement Date).
- F. Responsibility to Cooperate.** Buyer and Seller agree to timely take such actions and produce, execute, and/or deliver such information and documentation as is reasonably necessary to carry out the responsibilities and obligations of this Agreement, including any information a reporting officer, such as a closing agent, may need to complete any reporting mandated by federal, state, or local governments (e.g. FINCEN, FIRPTA, etc.). Except as to matters which are occasioned by clerical errors or omissions or erroneous information, the approval of the closing documents by the parties shall constitute their approval of any differences between this Agreement and the Closing. Buyer and Seller agree that if requested after Closing, they shall correct any documents and pay any amounts due where such corrections or payments are appropriate by reason of mistake, clerical errors or omissions, or the result of erroneous information.
- G. Notices.** Except as otherwise provided herein, all notices and demands required or permitted hereunder shall be in writing and delivered either (1) in person; (2) by a prepaid overnight delivery service; (3) by facsimile transmission (FAX); (4) by the United States Postal Service, postage prepaid, registered or certified, return receipt requested; or (5) Email. **NOTICE** shall be deemed to have been given as of the date and time it is actually received. Receipt of notice by the real estate licensee or their Broker assisting a party as a client or customer shall be deemed to be notice to that party for all purposes under this Agreement as may be amended, unless otherwise provided in writing.
- H. Risk of Loss.** The risk of hazard or casualty loss or damage to Property shall be borne by the Seller until transfer of title. If casualty loss prior to Closing exceeds 10% of the Purchase Price, Seller or Buyer may elect to terminate this Agreement with a refund of Earnest Money/Trust Money to Buyer.
- I. Equal Housing.** This Property is being sold without regard to race, color, creed, sex, religion, handicap, familial status, or national origin.
- J. Severability.** If any portion or provision of this Agreement is held or adjudicated to be invalid or unenforceable for any reason, each such portion or provision shall be severed from the remaining portions or provisions of this Agreement, and the remaining portions or provisions shall be unaffected and remain in full force and effect. In the event that the contract fails due to the severed provisions, then the offending language shall be amended to be in conformity with state and federal law.

K. Alternative Dispute Resolution. In the event the parties elect to utilize Alternative Dispute Resolution, incorporate "Resolution of Disputes by Mediation Addendum/Amendment" (RF629).

L. Contract Construction. This Agreement or any uncertainty or ambiguity herein shall not be construed against any party but shall be construed as if all parties to this Agreement jointly prepared this Agreement.

M. Section Headings. The Section Headings as used herein are for reference only and shall not be deemed to vary the content of this Agreement or limit the scope of any Section.

18. Seller's Additional Obligations. In addition to any other disclosure required by law, the Seller shall, prior to entering into an Agreement with a Buyer, disclose in writing including acknowledgement of receipt: (a) the presence of any known exterior injection well or sinkhole (as defined in TCA § 66-5-212) on the property; (b) the results of any known percolation test or soil absorption rate performed on the property that is determined or accepted by the Department of Environment and Conservation; (c) if the property is located in a Planned Unit Development (PUD); (d) if the property is located in a PUD, make available to the Buyer a copy of the development's restrictive covenants, homeowner bylaws and master deed upon request; (e) if any single-family residence located on the Property has been moved from an existing foundation to another foundation where such information is known to the Seller; and (f) if a permit for a subsurface sewage disposal system for the Property was issued during a sewer moratorium pursuant to TCA § 68-221-409. If so, Buyer may have a future obligation to connect to the public sewer system.

19. Method of Execution. The parties agree that signatures and initials transmitted by facsimile, other photocopy transmittal, or by transmittal of digital signature as defined by the applicable State or Federal law shall be acceptable and may be treated as originals and that the final Purchase and Sale Agreement containing all signatures and initials may be executed partially by original signature and partially on facsimile, other photocopy documents, or by digital signature as defined by the applicable State or Federal law.

20. Exhibits and Addenda. All exhibits and/or addenda attached hereto, listed below, or referenced herein are made a part of this Agreement:

21. Special Stipulations. The following Special Stipulations, if conflicting with any preceding section, shall control:
Seller / Sellers Broker to pay Compass Tennessee 3% of the purchase price for buyers broker compensation.

22. Time Limit of Offer. This Offer may be withdrawn at any time before acceptance with Notice. Offer terminates if not countered or accepted by 05:00 o'clock ☐ a.m./ ☒ p.m.; on the 30th day of July, 2026.

LEGAL DOCUMENTS: This is an important legal document creating valuable rights and obligations. If you have any questions about it, you should review it with your attorney. Neither the Broker nor any Agent or Facilitator is authorized or qualified to give you any advice about the advisability or legal effect of its provisions.

NOTE: Any provisions of this Agreement which are preceded by a box "☐" must be marked to be a part of this Agreement. Any blank herein that is not otherwise completed shall be deemed to be zero or not applicable.


This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.




WIRE FRAUD WARNING: Never trust wiring instructions sent via email. Cyber criminals are hacking email accounts and sending emails with fake wiring instructions. These emails are convincing and sophisticated. Always independently confirm wiring instructions in person or via a telephone call to a trusted and verified phone number. Never wire money without double-checking that the wiring instructions are correct. NEVER ACCEPT WIRING INSTRUCTIONS FROM YOUR AGENT OR BROKER.

BY AFFIXING YOUR SIGNATURE BELOW, YOU ACKNOWLEDGE THAT YOU HAVE REVIEWED AND UNDERSTAND ALL TERMS OF THIS AGREEMENT.

Buyer hereby makes this offer.


07/29/26 - 03:31 PM CDT
BUYER


07/29/26 - 03:31 PM CDT
BUYER

07/29/2026 at 3:31 o'clock ☐ am/ ☒ pm
Offer Date

07/29/2026 at 3:01 o'clock ☐ am/ ☒ pm
Offer Date

Seller hereby:

☒ **ACCEPTS** – accepts this offer.

☐ **COUNTERS** – accepts this offer subject to the attached Counter Offer(s).

☐ **REJECTS** – rejects this offer and makes no counter offer.



dotloop verified
07/29/26 5:43 PM CDT
ZXGC-Z7ZT-EKTF-BT2Z

SELLER



dotloop verified
07/29/26 5:44 PM CDT
VDSJ-NPGY-3KZI-NISH

SELLER

_____ at _____ o'clock ☐ am/ ☐ pm
Date

_____ at _____ o'clock ☐ am/ ☐ pm
Date

Acknowledgement of Receipt. Ryan Stonehouse hereby acknowledges receipt of the final accepted offer on July 29th, 2026 at 6:31 o'clock ☐ am/ ☒ pm, and this shall be referred to as the Binding Agreement Date for purposes of establishing performance deadlines as set forth in the Agreement.

For Information Purposes Only:

Listing Firm: Keller Williams Realty Nashville/Franklin

Listing Firm Address: _____

Firm License No.: _____

Firm Telephone No.: _____

Listing Licensee: Paula Hinegardner

Licensee License Number: 322409

Licensee Email: phinegardner@me.com

Licensee Cellphone No.: (615) 618-1330

Home Owner's / Condominium Association ("HOA/COA")/ Property Management Company: _____

Buying Firm: Compass

Buying Firm Address: 2206 21st Avenue South, Nashville, TN 37212

Firm License No.: 264416

Firm Telephone No.: (615) 475-5616

Buying Licensee: Ryan Stonehouse

Licensee License Number: 375079

Licensee Email: ryanstonehouse@compass.com

Licensee Cellphone No.: (615) 812-0066

Phone: _____

Email: _____

NOTE: This form is provided by Tennessee REALTORS® to its members for their use in real estate transactions and is to be used as is. By downloading and/or using this form, you agree and covenant not to alter, amend, or edit said form or its contents except as where provided in the blank fields, and agree and acknowledge that any such alteration, amendment or edit of said form is done at your own risk. Use of the Tennessee REALTORS® logo in conjunction with any form other than standardized forms created by Tennessee REALTORS® is strictly prohibited. This form is subject to periodic revision and it is the responsibility of the member to use the most recent available form.

EXCLUSIVE BUYER REPRESENTATION AGREEMENT (Designated Agency)

Broker/Firm: Compass

Address of Firm: 2206 21st Avenue South, Nashville, TN 37212

Buyer: Jonathan De Jong, Madisyn De Jong

1. TERM.

For and in consideration of the mutual promises contained herein and other good and valuable consideration, the receipt and sufficiency of which is hereby acknowledged, this Agreement is entered into on this 16th day of July, 2026 ("Effective Date") by and between the undersigned Jonathan De Jong, Madisyn De Jong ("Client" or "Buyer") and Firm/Broker of Compass ("Broker"). Broker shall act as Client's exclusive agent to locate property for Client's purchase, lease, exchange or option (collectively "Purchase") during the term of this agreement, and to advocate the Client's best interests in the negotiation of terms and conditions of any such Purchase. This Buyer Representation Agreement ("Agreement") begins on the Effective Date and terminates at 11:59 p.m. local time on September 30th, 2026, or at the closing (or in the case of a lease, the date of possession) of any Purchase under this Agreement, if such occurs earlier. If a contract to purchase, exchange, or lease is signed before this Agreement expires, the term hereof shall continue until final disposition of the Purchase and Sales Agreement, exchange agreement, or lease agreement.

2. Properties Specifically Exempted from this Agreement: _____

3. CLIENT DUTIES.

Buyer agrees:

- A. To Purchase property exclusively through Broker during the term of this Agreement;
- B. To furnish Broker on a timely basis with any necessary personal and/or financial information to ensure Client's ability to Purchase;
- C. That Client is not under an exclusive right to buy contract or exclusive buyer representation agreement with any other agent at this time;
- D. **Termination.** Should the Broker consent to release this Representation Agreement prior to the expiration of the term of this Agreement or any extensions, Buyer agrees to pay all costs incurred by Broker or other amount as agreed to by the parties as a cancellation fee, in addition to any other sums that may be due to Broker.
- E. **Carry-Over Clause.** Should the Buyer contract to buy or exchange, or contract to lease a property within _____ days after the expiration of this Agreement with any Seller/Landlord (or anyone acting on Seller's/Landlord's behalf) who has been introduced to Buyer, directly or indirectly, during the term hereof, as extended, the Buyer agrees to pay the compensation as set forth below. This carry-over clause shall not apply if the Buyer is subject to a buyer's representation agreement with another licensed real estate broker at the time of such contract.
- F. That Client has reviewed this Agreement and agrees with the terms herein.

4. COMPENSATION.

BROKER COMPENSATION IS NOT SET BY LAW AND COMPENSATION RATES ARE FULLY NEGOTIABLE.

- A. **Compensation for Broker's Services:** Broker shall be compensated an amount of \$ _____ or 3 % based on the total sale price in consideration of Broker's services as described herein.
- B. **Compensation from Seller:** Buyer authorizes Broker to negotiate with the Seller and/or the Seller's agent for this fee, the payment of which shall be fully disclosed to Buyer.

This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.



- C. **Difference:** In the event that the amount of any cooperating compensation paid by Seller or Seller's broker is less than the amount listed herein, Buyer agrees to pay Broker the difference at closing.
- D. **Compensation if Buyer Leases:** In the event that Buyer leases a property in lieu of purchase, the Buyer agrees to pay Broker a total of \$_____ in compensation unless otherwise stated herein.
- E. **Cap on Compensation:** If Broker is an MLS participant, Broker shall not receive compensation from any source that exceeds the amount listed herein.
- F. **VA Buyer:** In the event the buyer broker compensation herein is considered a non-allowable pursuant to VA guidelines and thus cannot be paid by Buyer, this obligation is waived by Broker.
- G. Broker's fee is earned at the signing by both parties of an agreement to purchase, lease, exchange or the exercise of an option for any property(ies) as described above and is due at the closing of any such transaction or upon possession of property unless otherwise stated herein. In the event that Buyer defaults on performance of a valid contract for sale, lease, exchange or exercised option, Broker's fee shall be due on the date of default. Buyer agrees to pay all reasonable attorney's fees together with any court costs and expenses which real estate firm incurs in enforcing any of Buyer's obligations to pay compensation under this Agreement. The parties hereby agree that all remedies are fair and equitable and neither party shall assert the lack of mutuality of remedies as a defense in the event of a dispute.
- H. The payment of any fee by Seller shall not make Broker either the Agent or Subagent of the Seller.
- I. If Buyer utilizes the services of another real estate broker or deals solely with a Seller's Agent or the Seller directly at any time during the effective period of this Agreement and/or any extensions thereof and then enters into an agreement with a seller/owner to Purchase any property(ies) described above, the Buyer still owes a commission to the Broker provided herein.

5. AGENCY.

A. Definitions

1. **Broker.** In this Agreement, the term "Broker" shall mean a licensed Tennessee real estate broker or brokerage firm and where the context would indicate, the Broker's affiliated licensees, including but not limited to the Designated Agent.
2. **Designated Agent for the Buyer.** The individual licensee that has been assigned by the Managing Broker and is working as an agent for the Buyer in this consumer's prospective transaction, to the exclusion of all other licensees in the company. Even if someone else in the licensee's company represents a Seller of a prospective property, the Designated Agent for the Buyer shall continue to work as an advocate for the best interests of the Buyer. An agency relationship, by law, can only be established by a written agency agreement.
3. **Facilitator/Transaction Broker (not an agent for either party).** The licensee is not working as an agent for either party in this consumer's prospective transaction. A Facilitator may advise either or both of the parties to a transaction but cannot be considered a representative or advocate of either party. By law, any licensee or company who has not entered into a written agency agreement with either party in the transaction is considered a Facilitator or Transaction Broker until such time as an agency agreement is established.
4. **Dual agency.** The licensee has agreements to provide services as an agent to more than one (1) party in a specific transaction and in which the interests of such parties are adverse. This agency status may only be employed upon full disclosure to each party and with each party's informed consent.
5. **Adverse Facts.** "Adverse Facts" means conditions or occurrences generally recognized by competent licensees that have a negative impact on the value of the real estate, significantly reduce the structural integrity of improvements to real property or present a significant health risk to occupants of the property.
6. **Confidentiality.** By law, every licensee is obligated to protect some information as confidential. This includes any information revealed by a consumer which may be helpful to the other party IF it was revealed by the consumer BEFORE the licensee disclosed any agency relationship with that other party. AFTER the licensee discloses that licensee has an agency relationship with another party, any such information which the consumer THEN reveals must be passed on by the licensee to that other party. Buyer understands that there is a possibility that sellers or sellers' representatives may not treat the existence, terms, or conditions of offers as confidential unless confidentiality is required by law, regulation, or by any confidentiality agreement between the parties.

B. Duties owed to all Parties to a Transaction.

Pursuant to the Tennessee Real Estate Broker License Act, every Real Estate Licensee owes the following duties to every Buyer and Seller, Tenant and Landlord (collectively “Buyers” and “Sellers”) unless otherwise provided by law:

1. To diligently exercise reasonable skill and care in providing services to all parties to the transaction;
2. To disclose to each party to the transaction any Adverse Facts of which Licensee has actual notice or knowledge;
3. To maintain for each party in a transaction the confidentiality of any information obtained by a Licensee prior to disclosure to all parties of a written agency agreement entered into by the Licensee to represent either or both parties in the transaction. This duty of confidentiality extends to any information that the party would reasonably expect to be held in confidence, except for information which the party has authorized for disclosure or information required by law to be disclosed;
4. To provide services to each party to the transaction with honesty and good faith;
5. To disclose to each party to the transaction timely and accurate information regarding market conditions that might affect such transaction only when such information is available through public records and when such information is requested by a party;
6. To give timely account for earnest money deposits and all other property received from any party to a transaction; and
7. A. To refrain from engaging in self-dealing or acting on behalf of Licensee’s immediate family, or on behalf of any other individual, organization or business entity in which Licensee has a personal interest without prior disclosure of such personal interest and the timely written consent of all parties to the transaction; and
B. To refrain from recommending to any party to the transaction the use of services of another individual, organization or business entity in which the Licensee has an interest or from whom the Licensee may receive a referral fee or other compensation for the referrals, other than referrals to other Licensees to provide real estate services, without timely disclosing to the party who receives the referral, the Licensee’s interest in such referral or the fact that a referral fee may be received.

C. Duties Owed to Client.

In addition to the above, the Licensee has the following duties to Client if the Licensee has become an agent or Designated Agent in a transaction:

1. Obey all lawful instructions of the Client when such instructions are within the scope of this agency agreement between the Licensee and the Buyer/Client;
2. Be loyal to the interests of the Client. A Licensee must place the interests of the Client before all others in negotiation of a transaction and in other activities, except where such loyalty duty would violate Licensee’s duties to a customer in the transaction; and
3. Unless the following duties are specifically and individually waived in writing by a Client, Licensee shall assist the Client by:
 - A. Scheduling all property showings on behalf of the Client;
 - B. Receiving all offers and counter offers and forwarding them promptly to the Client;
 - C. Answering any questions that the Client may have in negotiation of a successful purchase within the scope of the Licensee’s expertise; and
 - D. Advising the Client as to whatever forms, procedures and steps are needed after execution of the purchase agreement for a successful closing of the transaction.

Upon Waiver of any of the above duties listed under subsection 4.C.3., the Client may not expect or seek assistance from any other licensees in the transaction for the performance of said duties.

D. Agent Disclosure. Pursuant to Tennessee Real Estate Commission Rule 1260-2-.36, Broker must disclose certain things to Client prior to the execution of this Agreement. Client hereby agrees that Broker has disclosed the following and that this Agreement constitutes written confirmation of same:

During the effective period of this Agreement:

1. Client should not contact listing agents directly and should make all arrangements to view and inspect property through Broker;
2. In the event Client comes into contact with a Seller's Agent(s) (for example, at an open house viewing), Client shall immediately inform the Seller's Agent(s) that Client is represented by Broker; and
3. If Client purchases property(ies) covered by this Agreement through another real estate licensee or a Seller's Agent(s) or directly from a Seller, Client understands that Client still owes a commission to the Broker as set forth in this Agreement.

E. Buyer's Authorizations.

1. **Appointment of Designated Agent.** Buyer hereby authorizes Managing Broker to appoint the Buyer Broker Licensee as Designated Agent for the Buyer, to the exclusion of any other licensees associated with Broker. A Designated Agent for the Buyer can and shall continue to advocate Buyer's interests in a transaction even if a Designated Agent for the Seller (other than the Licensee listed below) is also associated with Broker. The Managing Broker hereby appoints Ryan Stonehouse to be the Designated Agent for the Buyer in this transaction.
2. **Appointment of Subsequent Designated Agent.** Buyer hereby authorizes the Managing Broker, if necessary, to appoint a licensee, other than the Licensee named above, as Designated Agent for the Buyer, to the exclusion of any other licensees associated with Broker. This shall be accomplished through an amendment to this Agreement, if necessary.
3. **Default to Facilitator in the event that both parties are represented by the same Designated Agent.** The Designated Agent shall default to Facilitator status for all showings or transactions *involving the same Designated Agent for both the Buyer and a prospective Seller*, immediately notifying (verbally) the Buyer and the Seller of the need to default to this Facilitator status to be confirmed in writing prior to the execution of the contract. Upon any default to Facilitator status, the former Designated Agent must assume a neutral position and shall not be an advocate for either the Buyer or any prospective Seller.
4. **Resumption of Agency Status.** In the event that the Designated Agent defaults to a Facilitator status, this Facilitator status shall only be temporary. The Facilitator status shall only last until any transaction or contemplated transaction in which the parties are all assisted by the same Facilitator is resolved (either because the transaction is closed or the transaction or contemplated transaction is terminated or not accepted and no further negotiations occur between the parties). At that time, the Agent shall immediately revert back to Designated Agency status for the Buyer.

6. CONFIDENTIALITY.

Information which the Buyer authorizes Broker and Broker's affiliated Licensees to disclose which might otherwise be confidential: _____

7. EARNEST MONEY/TRUST MONEY.

Broker is authorized to accept a deposit of earnest money/trust money to be applied to the purchase price for a property. Such deposit is to be held by Broker in an escrow or trustee account or Broker shall direct buyer to send deposit to an authorized third party to hold said funds as set forth in an executed contract for purchase, lease, exchange or option agreement until disbursed in accordance with the terms of said agreement. If a third party is holding earnest money/ trust money, parties can enter into an Escrow Agreement.

8. LIMITATIONS ON BROKER'S AUTHORITY AND RESPONSIBILITY.

Buyer acknowledges and agrees that Broker and Designated Agent:

- A. May show the same properties to other prospective buyers;
- B. Is not an expert with regard to matters that could be revealed through a survey, title search, or inspection; the insurability of the property or cost to insure the property; for the condition of the property, any portion thereof, or any item therein; for any geological issues present on the property; for any issues arising out of the failure to inspect property prior to entering into an agreement to Purchase property and/or closing on property; for the necessity or cost of any repairs to property; hazardous or toxic materials; square footage; acreage; the availability and cost of utilities, septic or community amenities; conditions existing off a property which may affect said property; proposed or pending condemnation actions involving the property; uses and zoning of a property, whether permitted or proposed; for

This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.



applicable boundaries of school districts or other school information; termites and wood destroying organisms; building products, structural conditions, engineering and construction techniques; the tax or legal consequences of a contemplated transaction; matters relating to financing; for the appraised or future value of a property; etc. Buyer acknowledges that Broker is not an expert with respect to the above matters and is hereby advised to seek independent expert advice on any of these or other matters which are of concern to Buyer;

C. If Broker or licensees associated with Broker provide names or sources to Client for such advice or assistance listed above, those services and/or products are not warranted or guaranteed by the Broker or the licensees associated with Broker.

D. Shall owe no duties to Buyer nor have any authority to act on behalf of Buyer other than what is set forth in this Agreement and the duties contained in the Tennessee Real Estate License Act of 1973, as amended, and the Tennessee Real Estate Commission Rules; and

E. May make all disclosures required by law and/or the National Association of Realtors® Code of Ethics.

F. **Hereby advises Buyer of the possibility that some properties may utilize security devices that record physical movements or audio conversations. Therefore, Buyers should limit making comments concerning the value, features, or condition while viewing any property.**

9. PROHIBITED FOREIGN PARTIES.

Buyer is hereby notified that pursuant to Tenn. Code Ann. §66-2-301, et seq., a prohibited foreign party or prohibited foreign-party controlled business shall not acquire by grant, purchase, devise, descent, or otherwise an interest in agricultural land. A prohibited foreign-party business shall not acquire by grant, purchase, devise, descent, or otherwise an interest in non-agricultural land in this state. Tenn. Code Ann. §66-2-308 does include certain exceptions to this part.

Buyer warrants Buyer has reviewed Tenn. Code Ann. Title 66, Chapter 2, Part 3 and is not prohibited from purchasing agricultural or non-agricultural land in Tennessee pursuant to the statute.

10. OTHER PROVISIONS.

A. Binding Effect, Entire Agreement, Modification, and Assignment. This Agreement shall be for the benefit of, and be binding upon, the parties hereto, their heirs, successors, legal representatives and permitted assigns. This Agreement may only be assigned with the written consent of both parties. This Agreement constitutes the sole and entire agreement between the parties hereto and no modification of this Agreement shall be binding unless signed by all parties or assigns to this Agreement. No representation, promise, or inducement not included in this Agreement shall be binding upon any party hereto. Any assignee shall fulfill all the terms and conditions of this Agreement.

B. Governing Law and Venue. This Agreement is intended as a contract for buyer's agency representation and shall be governed by and interpreted in accordance with the laws and in the courts of the state of Tennessee.

C. Terminology. As the context may require in this Agreement: (1) the singular shall mean the plural and vice versa; (2) all pronouns shall mean and include the person, entity, firm or corporation to which they relate; (3) the masculine shall mean the feminine and vice versa; and (4) the term day(s) used throughout this Agreement shall be deemed to be calendar day(s) ending at 11:59 p.m. local time unless otherwise specified in this Agreement. Local time shall be determined by the location of the Firm.

D. Severability. If any portion or provision of this Agreement is held or adjudicated to be invalid or unenforceable for any reason, each such portion or provision shall be severed from the remaining portions or provisions of this Agreement, and the remaining portions or provisions shall be unaffected and remain in full force and effect.

E. Fair Housing. Broker and Designated Agent shall provide services without regard to race, color, creed, religion, sex, handicap, familial status, national origin, sexual orientation or gender identity. A request to observe discriminatory practices in the sale, lease, exchange, or option of property shall not be granted.

11. LEGAL DOCUMENTS. THIS IS AN IMPORTANT LEGAL DOCUMENT CREATING VALUABLE RIGHTS AND OBLIGATIONS. IF YOU HAVE QUESTIONS ABOUT IT, YOU SHOULD REVIEW IT WITH YOUR ATTORNEY. NEITHER THE BROKER NOR ANY AGENT OR FACILITATOR IS AUTHORIZED OR QUALIFIED TO GIVE YOU ANY ADVICE CONCERNING THE ADVISABILITY OR LEGAL EFFECT OF ITS PROVISIONS. BY SIGNING THIS DOCUMENT, YOU ARE CERTIFYING THAT YOU HAVE READ AND ACCEPT THESE TERMS AND ACKNOWLEDGE RECEIPT OF THIS AGREEMENT.

12. EXHIBITS AND ADDENDA. All exhibits and/or addenda attached hereto, listed below, or referenced herein are made a part of this Agreement.

This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.




237 _____
 238 _____
 239 _____
 240 _____
 241 _____
 242 _____


243 **13. SPECIAL STIPULATIONS.** The following Special Stipulations, if conflicting with any preceding section, shall control:

244 Lines 42 & 43 to be null and void of this agreement. Buyer will not owe the difference of any commission not offered by the
 245 seller.
 246 _____
 247 _____
 248 _____
 249 _____

250 The party(ies) below have signed and acknowledge receipt of a copy.

251 	<u>Compass</u>
252 BY: Broker or Licensee Authorized by Broker	BROKER/FIRM
253 07/16/2026 at <u>5:19</u> o'clock ☐ am/ ☒ pm	<u>2206 21st Avenue South, Nashville, TN 37212</u>
254 Date	Address
255 <u>Ryan Stonehouse</u>	Phone: <u>(615) 812-0066</u>
256 Print/Type Name	

257 The party(ies) below have signed and acknowledge receipt of a copy.

258 	
259 BUYER	BUYER
260 <u>Jonathan De Jong</u>	<u>Madisyn De Jong</u>
261 Print/Type Name	Print/Type Name
262 07/16/2026 at <u>5:52</u> o'clock ☐ am/ ☒ pm	07/16/2026 at <u>6:09</u> o'clock ☐ am/ ☒ pm
263 Date	Date
264 _____	_____
265 Address	Address
266 Phone: _____ (H) _____ (Cell)	Phone: _____ (H) _____ (Cell)
267 _____ (W) Email: <u>jdejong@southernstonenashville.com</u>	_____ (W) Email: <u>madisynb17@gmail.com</u>

NOTE: This form is provided by Tennessee REALTORS® to its members for their use in real estate transactions and is to be used as is. By downloading and/or using this form, you agree and covenant not to alter, amend, or edit said form or its contents except as where provided in the blank fields, and agree and acknowledge that any such alteration, amendment or edit of said form is done at your own risk. Use of the Tennessee REALTORS® logo in conjunction with any form other than standardized forms created by Tennessee REALTORS® is strictly prohibited. This form is subject to periodic revision and it is the responsibility of the member to use the most recent available form.

This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.



CONFIRMATION OF AGENCY STATUS

Every real estate licensee is required to disclose licensee's agency status in a real estate transaction to any buyer or seller who is not represented by an agent and with whom the Licensee is working directly in the transaction. The purpose of this Confirmation of Agency Status is to acknowledge that this disclosure occurred. Copies of this confirmation must be provided to any signatory thereof. As used below, "Seller" includes sellers and landlords; "Buyer" includes buyers and tenants. Notice is hereby given that the agency status of this Licensee (or Licensee's company) is as follows in this transaction:

The real estate transaction involving the property located at:
9614 Deer Track Court, Brentwood, TN 37027

PROPERTY ADDRESS

SELLER NAME: Faron Kelsh and Connie Kelsh

LICENSEE NAME: Paula Hinegardner

in this consumer's current or prospective transaction is serving as:

☐ **Transaction Broker or Facilitator.**

(not an agent for either party).

☐ **Seller is Unrepresented.**

☐ **Agent for the Seller.**

☒ **Designated Agent for the Seller.**

☐ **Disclosed Dual Agent (for both parties),**

with the consent of both the Buyer and the Seller in this transaction.

BUYER NAME: Jonathan & Madisyn De Jong

LICENSEE NAME: Ryan Stonehouse

in this consumer's current or prospective transaction is serving as:

☐ **Transaction Broker or Facilitator.**

(not an agent for either party).

☐ **Buyer is Unrepresented.**

☐ **Agent for the Buyer.**

☒ **Designated Agent for the Buyer.**

☐ **Disclosed Dual Agent (for both parties),**

with the consent of both the Buyer and the Seller in this transaction.

This form was delivered in writing, as prescribed by law, to any unrepresented buyer prior to the preparation of any offer to purchase, OR to any unrepresented seller prior to presentation of an offer to purchase; OR (if the Licensee is listing a property without an agency agreement) prior to execution of that listing agreement. This document also serves as confirmation that the Licensee's Agency or Transaction Broker status was communicated orally before any real estate services were provided and also serves as a statement acknowledging that the buyer or seller, as applicable, was informed that any complaints alleging a violation or violations of Tenn. Code Ann. § 62-13-312 must be filed within the applicable statute of limitations for such violation set out in Tenn. Code Ann. § 62-13-313(e) with the Tennessee Real Estate Commission, 710 James Robertson Parkway, 3rd Floor, Nashville, TN 37232, PH: (615) 741-2273. **This notice by itself, however, does not constitute an agency agreement or establish any agency relationship.**

BROKER COMPENSATION IS NOT SET BY LAW AND COMPENSATION RATES ARE FULLY NEGOTIABLE.

By signing below, parties acknowledge receipt of Confirmation of Agency relationship disclosure by Realtor® acting as Agent/Broker OR other status of Seller/Landlord and/or Buyer/Tenant pursuant to the National Association of Realtors® Code of Ethics and Standards of Practice.

Faron Kelsh
dotloop verified
07/02/26 9:24 AM CDT
6CWT-2UBN-C20K-IRLW

Seller Signature

Date

Connie Kelsh
dotloop verified
07/07/26 8:12 AM CDT
NYRY-8VFK-LXHQ-XL3I

Seller Signature

Date

Paula Hinegardner
dotloop verified
07/01/26 10:23 AM BST
VCQR-TMSK-OYX0-TEQV

Listing Licensee

Date

Keller Williams - Nashville - Franklin

Listing Firm

Jonathan De Jong
07/16/2026 05:57 PM CDT

Buyer Signature

Date

Madisyn De Jong
07/16/26 - 06:12 PM CDT

Buyer Signature

Date

Ryan Stonehouse
07/16/26 - 06:25 PM CDT

Buyer Broker Licensee

Date

Compass Tennessee LLC

Buyer Broker Firm

NOTE: This form is provided by Tennessee REALTORS® to its members for their use in real estate transactions and is to be used as is. By downloading and/or using this form, you agree and covenant not to alter, amend, or edit said form or its contents except as where provided in the blank fields, and agree and acknowledge that any such alteration, amendment or edit of said form is done at your own risk. Use of the Tennessee REALTORS® logo in conjunction with any form other than standardized forms created by Tennessee REALTORS® is strictly prohibited. This form is subject to periodic revision and it is the responsibility of the member to use the most recent available form.

TENNESSEE RESIDENTIAL PROPERTY CONDITION DISCLOSURE

1 PROPERTY ADDRESS 9614 Deer Track Court CITY Brentwood
2 SELLER'S NAME(S) Faron Kelsh and Connie Kelsh PROPERTY AGE 26
3 DATE SELLER ACQUIRED THE PROPERTY 2022 DO YOU OCCUPY THE PROPERTY? Yes
4 IF NOT OWNER-OCCUPIED, HOW LONG HAS IT BEEN SINCE THE SELLER OCCUPIED THE PROPERTY? _____
5 (Check the one that applies) The property is a ☒ site-built home ☐ non-site-built home
6 The Tennessee Residential Property Disclosure Act requires sellers of residential real property with one to four dwelling units
7 to furnish to a buyer one of the following: (1) a residential property disclosure statement (the "Disclosure"), or (2) a residential
8 property disclaimer statement (permitted only where the buyer waives the required Disclosure). Some property transfers may
9 be exempt from this requirement (See Tenn. Code Ann. § 66-5-209). The following is a summary of the buyers' and sellers'
10 rights and obligations under the Act. A complete copy of the Act may be found at Tenn. Code Ann. § 66-5-201, et seq.
11 1. Sellers must disclose all known material defects and must answer the questions on the Disclosure form in good faith to the
12 best of the seller's knowledge as of the Disclosure date.
13 2. Sellers must give the buyers the Disclosure form before the acceptance of a purchase contract.
14 3. Sellers must inform the buyers, at or before closing, of any inaccuracies or material changes in the condition that have
15 occurred since the time of the initial Disclosure, or certify that there are no changes.
16 4. Sellers may give the buyers a report or opinion prepared by a professional inspector or other expert(s) or certain information
17 provided by a public agency, in lieu of responding to some or all of the questions on the form (See Tenn. Code Ann. § 66-
18 5-204).
19 5. Sellers are not required to have a home inspection or other investigation in order to complete the Disclosure form.
20 6. Sellers are not required to repair any items listed on the Disclosure form or on any past or future inspection report unless
21 agreed to in the purchase contract.
22 7. Sellers involved in the first sale of a dwelling must disclose the amount of any impact fees or adequate facility taxes paid.
23 8. Sellers are not required to disclose if any occupant was HIV-positive, or had any other disease not likely to be transmitted
24 by occupying a home, or whether the home had been the site of a homicide, suicide or felony, or act or occurrence which
25 had no effect on the physical structure of the property.
26 9. Sellers may provide an "as is", "no representations or warranties" disclaimer statement in lieu of the Disclosure form only
27 if the buyer waives the right to the required disclosure, otherwise the sellers must provide the completed Disclosure form
28 (See Tenn. Code Ann. § 66-5-202).
29 10. Sellers may be exempt from having to complete the Disclosure form in certain limited circumstances (e.g. public auctions,
30 court orders, some foreclosures and bankruptcies, new construction with written warranty or owner has not resided on the
31 property at any time within the prior 3 years). (See Tenn. Code Ann. § 66-5-209).
32 11. Buyers are advised to include home, wood infestation, well, water sources, septic system, lead-based paint, radon, mold,
33 and other appropriate inspection contingencies in the contract, as the Disclosure form is not a warranty of any kind by the
34 seller, and is not a substitute for any warranties or inspections the buyer may desire to purchase.
35 12. Any repair of disclosed defects must be negotiated and addressed in the Purchase and Sale Agreement; otherwise, seller is
36 not required to repair any such items.
37 13. Buyers may, but do not have to, waive their right to receive the Disclosure form from the sellers if the sellers provide a
38 disclaimer statement with no representations or warranties (See Tenn. Code Ann. § 66-5-202).
39 14. Remedies for misrepresentations or nondisclosure in a Property Condition Disclosure statement may be available to buyer
40 and are set out fully in Tenn. Code Ann. § 66-5-208. Buyer should consult with an attorney regarding any such matters.
41 15. Representations in the Disclosure form are those of the sellers only, and not of any real estate licensee, although licensees
42 are required to disclose to all parties adverse facts of which the licensee has actual knowledge or notice.

This form is copyrighted and may only be used in real estate transactions in which Paula Hinegardner is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at (615) 321-1477.



43 16. Pursuant to Tenn. Code Ann. § 47-18-104(b), sellers of newly constructed residences on a septic system are prohibited
 44 from knowingly advertising or marketing a home as having more bedrooms than are permitted by the subsurface sewage
 45 disposal system permit.

46 17. Sellers must disclose the presence of any known exterior injection well, the presence of any known sinkhole(s), the results
 47 of any known percolation test or soil absorption rate performed on the property that is determined or accepted by the
 48 Department of Environment and Conservation, and whether the property is located within a Planned Unit Development as
 49 defined by Tenn. Code Ann. § 66-5-213 and, if requested, provide buyers with a copy of the development's restrictive
 50 covenants, homeowner bylaws and master deed. Sellers must also disclose if they have knowledge that the residence has
 51 ever been moved from an existing foundation to another foundation.

52 The Buyers and Sellers involved in the current or prospective real estate transaction for the property listed above acknowledge
 53 that they were informed of their rights and obligations regarding Residential Property Disclosures, and that this information
 54 was provided by the real estate licensee(s) prior to the completion or reviewing of a Tennessee Residential Property Condition
 55 Disclosure, a Tennessee Residential Property Condition Disclaimer Statement, or a Tennessee Residential Property Condition
 56 Exemption Notification. Buyers and Sellers also acknowledge that they were advised to seek the advice of an attorney on any
 57 legal questions they may have regarding this information or prior to taking any legal actions.

58 The Tennessee Residential Property Disclosure Act states that anyone transferring title to residential real property must
 59 provide information about the condition of the property. This completed form constitutes that disclosure by the Seller. The
 60 information contained in the disclosure is the representation of the owner and not the representation of the real estate licensee
 61 or sales person, if any. This is not a warranty or a substitute for any professional inspections or warranties that the purchasers
 62 may wish to obtain.
 63

64 **Buyers and Sellers should be aware that any sales agreement executed between the parties shall supersede this form**
 65 **as to the terms of sale, property included in the sale and any obligations on the part of the seller to repair items**
 66 **identified below and/or the obligation of the buyer to accept such items "as is."**

67 INSTRUCTIONS TO THE SELLER

68 Complete this form yourself and answer each question to the best of your knowledge. If an answer is an estimate, clearly
 69 label it as such. The Seller hereby authorizes any agent(s) representing any party in this transaction to provide a copy of this
 70 statement to any person or entity in connection with any actual or anticipated sale of the subject property.

71 A. THE SUBJECT PROPERTY INCLUDES THE ITEMS CHECKED BELOW:

- | | | |
|---|---|---|
| 72 ☒ Range | ☐ Wall/Window Air Conditioning | ☒ Garage Door Opener(s) (Number of openers <u>3</u>) |
| 73 ☒ Window Screens | ☒ Oven | ☒ Fireplace(s) (Number) <u>4</u> |
| 74 ☐ Intercom | ☐ Microwave | ☒ Gas Starter for Fireplace |
| 75 ☒ Garbage Disposal | ☒ Gas Fireplace Logs | ☐ TV Antenna/Satellite Dish |
| 76 ☒ Trash Compactor | ☒ Smoke Detector/Fire Alarm | ☒ Central Vacuum System and attachments |
| 77 ☐ Spa/Whirlpool Tub | ☐ Burglar Alarm | ☒ Current Termite contract |
| 78 ☐ Water Softener | ☒ Patio/Decking/Gazebo | ☐ Hot Tub |
| 79 ☐ 220 Volt Wiring | ☐ Installed Outdoor Cooking Grill | ☒ Washer/Dryer Hookups |
| 80 ☐ Sauna | ☐ Irrigation System | ☐ Pool |
| 81 ☒ Dishwasher | ☒ A key to all exterior doors | ☒ Access to Public Streets |
| 82 ☒ Sump Pump | ☒ Rain Gutters | ☒ Heat Pump |
| 83 ☒ Central Heating | ☒ Central Air | |
| 84 ☐ Other _____ | ☐ Other _____ | |

- | | | |
|---|---|--|
| 85 Water Heater: ☐ Electric | ☒ Gas | ☐ Solar |
| 86 Garage: ☒ Attached | ☐ Not Attached | ☐ Carport |
| 87 Water Supply: ☒ City | ☐ Well | ☐ Private ☐ Utility ☐ Other _____ |
| 88 Gas Supply: ☒ Utility | ☐ Bottled | ☐ Other _____ |
| 89 Waste Disposal: ☒ City Sewer | ☐ Septic Tank | ☐ Other _____ |

90 Roof(s): Type Shingle Age (approx): 4 years

91

This form is copyrighted and may only be used in real estate transactions in which Paula Hinegardner is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615-321-1477.



92 Other Items:

93
94

95 To the best of your knowledge, are any of the above NOT in operating condition? ☐ YES ☒ NO

96 If YES, then describe (attach additional sheets if necessary):

97
98
99

100 **B. ARE YOU (SELLER) AWARE OF ANY DEFECTS/MALFUNCTIONS IN ANY OF THE FOLLOWING?**

YES NO UNKNOWN YES NO UNKNOWN

101	Interior Walls	☐	☒	☐	Roof	☐	☒	☐
102	Ceilings	☐	☒	☐	Basement	☐	☒	☐
103	Floors	☐	☒	☐	Foundation	☐	☒	☐
104	Windows	☐	☒	☐	Slab	☐	☒	☐
105	Doors	☐	☒	☐	Driveway	☐	☒	☐
106	Insulation	☐	☒	☐	Sidewalks	☐	☒	☐
107	Plumbing System	☐	☒	☐	Central Heating	☐	☒	☐
108	Sewer/Septic	☐	☒	☐	Heat Pump	☐	☒	☐
109	Electrical System	☐	☒	☐	Central Air Conditioning	☐	☒	☐
110	Exterior Walls	☐	☒	☐				

111 If any of the above is/are marked YES, please explain:

112

113 **C. ARE YOU (SELLER) AWARE OF ANY OF THE FOLLOWING:** YES NO UNKNOWN

114	1. Substances, materials or products which may be environmental hazards	☐	☒	☐
115	such as, but not limited to: asbestos, radon gas, lead-based paint, fuel			
116	or chemical storage tanks, contaminated soil or			
117	water, on the subject			
118	property?			
119	2. Features shared in common with adjoining land owners, such as walls, but	☐	☐	☒
120	not limited to, fences, and/or driveways, with joint rights and obligations			
121	for use and maintenance?			
122	3. Any authorized changes in roads, drainage or utilities affecting the	☐	☒	☐
123	property, or contiguous to the property?			
124	4. Any changes since the most recent survey of the property was done?	☐	☒	☐
125	Most recent survey of the property: 12/05/2022 (Date) (check here if unknown)			☐
126	5. Any encroachments, easements, or similar items that may affect your	☐	☒	☐
127	ownership interest in the property?			
128	6. Room additions, structural modifications or other alterations or	☐	☒	☐
129	repairs made without necessary permits?			
130	7. Room additions, structural modifications or other alterations or	☐	☒	☐
131	repairs not in compliance with building codes?			
132	8. Landfill (compacted or otherwise) on the property or any portion	☐	☒	☐
133	thereof?			
134	9. Any settling from any cause, or slippage, sliding or other soil problems?	☐	☒	☐
135	10. Flooding, drainage or grading problems?	☐	☒	☐
136	11. Any requirement that flood insurance be maintained on the property?	☐	☒	☐

		YES	NO	UNKNOWN
137	12. Property or structural damage from fire, earthquake, floods, or landslides?	☐	☒	☐
138	If yes, please explain (use separate sheet if necessary).			
139				
140				
141	If yes, has said damage been repaired? _____			
142	13. Is the property serviced by a fire department?	☒	☐	☐
143	If yes, in what fire department's service area is the property located? (Fire Dept. Locator can be found:			
144	https://tnmap.tn.gov/fdtn/)			
145				
146	Is the property owner subject to charges or fees for fire protection,	☐	☒	☐
147	such as subscriptions, association dues or utility fees?			
148	14. Any zoning violations, nonconforming uses and/or violations of	☐	☒	☐
149	"setback" requirements?			
150	15. Neighborhood noise problems or other nuisances?	☐	☒	☐
151	16. Subdivision and/or deed restrictions or obligations?	☐	☒	☐
152	17. A Condominium/Homeowners Association (HOA) which has any authority	☒	☐	☐
153	over the subject property?			
154	Name of HOA: <u>Westwood Property</u>			
155	HOA Phone Number: _____			
156	Special Assessments: _____			
157	Management Company: _____			
158	Management Co. Address: _____			
159	18. Is the location of the property within an improvement district that is			
160	subject to special assessment:	☐	☒	☐
161	Rate of special assessment: _____			
162	19. Any "common area" (facilities such as, but not limited to, pools, tennis	☐	☒	☐
163	courts, walkways or other areas co-owned in undivided interest with others)?			
164	20. Any notices of abatement or citations against the property?	☐	☒	☐
165	21. Any lawsuit(s) or proposed lawsuit(s) by or against the seller which affects	☐	☒	☐
166	or shall affect the property?			
167	22. Is any system, equipment or part of the property being leased?	☐	☒	☐
168	If yes, please explain, and include a written statement regarding payment			
169	information.			
170				
171				
172	23. Any exterior wall covering of the structure(s) covered with exterior	☒	☐	☐
173	insulation and finish systems (EIFS), also known as "synthetic stucco"?			
174	If yes, has there been a recent inspection to determine whether the structure	☐	☐	☒
175	has excessive moisture accumulation and/or moisture related damage?			
176	<i>(The Tennessee Real Estate Commission urges any buyer or seller who encounters this product to have a qualified</i>			
177	<i>professional inspect the structure in question for the preceding concern and provide a written report of the professional's</i>			
178	<i>finding.)</i>			
179	If yes, please explain. If necessary, please attach an additional sheet.			
180				
181				
182	24. Is there an exterior injection well anywhere on the property?	☐	☒	☐
183	25. Is seller aware of any percolation tests or soil absorption rates being	☐	☒	☐
184	performed on the property that are determined or accepted by			
185	the Tennessee Department of Environment and Conservation?			
186	If yes, results of test(s) and/or rate(s) are attached.			
187	26. Has any residence on this property ever been moved from its original	☐	☒	☐

YES NO UNKNOWN

189 27. Is this property in a Planned Unit Development? Planned Unit Development ☐ ☒ ☐
 190 is defined pursuant to Tenn. Code Ann. § 66-5-213 as "an area of land,
 191 controlled by one (1) or more landowners, to be developed under unified control
 192 or unified plan of development for a number of dwelling units, commercial,
 193 educational, recreational or industrial uses, or any combination of the
 194 foregoing, the plan for which does not correspond in lot size, bulk or type of
 195 use, density, lot coverage, open space, or other restrictions to the existing land
 196 use regulations." Unknown is not a permissible answer under the statute.

197 28. Is a sinkhole present on the property? A sinkhole is defined pursuant to Tenn. ☐ ☒ ☐
 198 Code Ann. § 66-5-212(c) as "a subterranean void created by the dissolution of
 199 limestone or dolostone strata resulting from groundwater erosion, causing a
 200 surface subsidence of soil, sediment, or rock and is indicated through the
 201 contour lines on the property's recorded plat map." This disclosure is required
 202 regardless of whether the sinkhole is indicated through the contour lines on the
 203 property's recorded plat map.

204 29. Was a permit for a subsurface sewage disposal system for the Property issued ☐ ☒
 205 during a sewer moratorium pursuant to Tenn. Code Ann. § 68-221-409? If
 206 yes, Buyer may have a future obligation to connect to the public sewer system.
 207

208 **D. CERTIFICATION.** I/We certify that the information herein, concerning the
 209 real property located at

210
 211 is true and correct to the best of my/our knowledge as of the date signed. Should any of these conditions change prior to
 212 conveyance of title to this property, these changes shall be disclosed in an addendum to this document.

213 Transferor (Seller) Faron Kelsh dotloop verified 07/07/26 7:51 AM CDT WH1D-ZPJN-LKF0-CY1R Date _____ Time _____
 214 Transferor (Seller) Connie Kelsh dotloop verified 07/07/26 8:12 AM CDT GWHG-C0KU-SBGT-535B Date _____ Time _____
 215

216 Parties may wish to obtain professional advice and/or inspections of the property and to negotiate
 217 appropriate provisions in the purchase agreement regarding advice, inspections or defects.
 218
 219

220 **Transferee/Buyer's Acknowledgment:** I/We understand that this disclosure statement is not intended as a substitute for any
 221 inspection, and that I/we have a responsibility to pay diligent attention to and inquire about those material defects which are
 222 evident by careful observation. **I/We acknowledge receipt of a copy of this disclosure.**

223 Transferee (Buyer) Jonathan De Jong eSign 07/17/26 05:56 PM CDT Date 07/16/2026 Time 5:56
 224 Transferee (Buyer) Madisyn De Jong eSign 07/17/26 02:10 PM CDT Date 07/17/2026 Time 2:10 pm
 225

226 If the property being purchased is a condominium, the transferee/buyer is hereby given notice that the transferee/buyer is
 227 entitled, upon request, to receive certain information regarding the administration of the condominium from the developer or
 the condominium association as applicable, pursuant to Tennessee Code Annotated §66-27-502.

NOTE: This form is provided by Tennessee REALTORS® to its members for their use in real estate transactions and is to be used as is. This form contains language that is in addition to the language mandated by the state of Tennessee pursuant to the disclosure requirements of the "Tennessee Residential Property Disclosure Act". Tennessee Code Annotated § 66-5-201, et seq. By downloading and/or using this form, you agree and covenant not to alter, amend, or edit said form or its contents except as where provided in the blank fields, and agree and acknowledge that any such alteration, amendment or edit of said form is done at your own risk. Use of the Tennessee REALTORS® logo in conjunction with any form other than standardized forms created by Tennessee REALTORS® is strictly prohibited. This form is subject to periodic revision and it is the responsibility of the member to use the most recent available form.

REPAIR/REPLACEMENT PROPOSAL

1

NOTE: This form is for information and/or negotiation purposes only and IS NOT TO BE INCLUDED as part of the Purchase and Sale Agreement. Neither party shall be bound until there is a separate mutual written agreement executed by all parties. The Repair/Replacement Amendment may be used for purposes of the mutual written agreement on repairs/replacements.

Buyer has made any and all inspections available under the Inspection section of the Purchase and Sale Agreement with a Binding Agreement Date of 07/29/2026 ("Agreement") for the purchase of the real property commonly known as: 9614 Deer Track Ct, Brentwood, TN 37027.

The parties hereby understand that they are required to negotiate repairs in good faith during the Resolution Period as set forth in the Agreement. Good faith negotiation includes but is not limited to timely communicating one's position during the Resolution Period regarding any proposed repairs and/or replacements. The undersigned hereby proposes that the following written list of items **be repaired and/or replaced** with like quality or value in a professional and workmanlike manner. Upon request, either party shall submit a copy of any supporting documentation or any portion thereof substantiating any item listed.

LIST OF ITEMS TO BE REPAIRED AND/OR REPLACED (Please be specific about whether the items are to be repaired or replaced): Mold report is outstanding, waiting for lab results

Buyer requests the following, all work to be performed by appropriately licensed and insured contractors at Seller's expense, with invoices, receipts, and any engineering documentation delivered to Buyer no later than three (3) days prior to closing:

1. Structural — Floor Framing and I-Joist (Report Item #36, Page 36)

Seller to retain a licensed Tennessee structural engineer to evaluate the rotted sill framing and the damaged I-joist section located in the front left mechanical room. Seller to complete all repairs specified in the engineer's written report, including any repair detail required for the I-joist. Seller to provide Buyer with a copy of the engineer's evaluation and a post-repair letter or sign-off confirming the repairs were completed in accordance with the engineer's specifications.

2. Moisture Source Investigation (Report Items #36, #37, #45, #56)

The inspection report notes that the source of the decay in the mechanical room could not be determined, and further identifies water staining at the mechanical room subfloor, rust on the gas furnace cabinet, and rust on the water heater tank in the same area. Seller to identify and correct the source of the moisture intrusion prior to or in conjunction with the framing repairs in Item 1 above, and to provide Buyer with written documentation from the performing contractor describing the cause identified and the corrective work performed. Buyer acknowledges additional damage may be discovered during this work; any such related damage to be repaired by Seller.

3. Electrical (Report Items #39, #40, #41)

Seller to have a licensed electrician correct the following and provide a paid invoice itemizing the work:

- Repair damaged wire(s) within the main service panel (#40)
- Correct double-tapped neutrals at the mechanical room and garage distribution panels (#41)

The above matters will be completed by Seller 3 days prior to Closing, (as provided in the Agreement the "Completion of Repairs Deadline"). Buyer and/or buyer's inspectors or representatives shall have the right to re-inspect at that time to confirm that such matters have been repaired and/or replaced in a professional and workmanlike manner. Such inspection shall not limit Buyer's right to conduct a Final Inspection as provided for in section 8 of the Agreement.


Jonathan De Jong
REPRESENTATIVE

Party Proposing Repairs

_____ at _____ o'clock ☐ am/ ☐ pm

Date


Madison De Jong
REPRESENTATIVE

Party Proposing Repairs

_____ at _____ o'clock ☐ am/ ☐ pm

Date

NOTE: This form is provided by Tennessee REALTORS® to its members for their use in real estate transactions and is to be used as is. By downloading and/or using this form, you agree and covenant not to alter, amend, or edit said form or its contents except as where provided in the blank fields, and agree and acknowledge that any such alteration, amendment or edit of said form is done at your own risk. Use of the Tennessee REALTORS® logo in conjunction with any form other than standardized forms created by Tennessee REALTORS® is strictly prohibited. This form is subject to periodic revision and it is the responsibility of the member to use the most recent available form.

This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.



AMENDMENT “1” TO PURCHASE AND SALE AGREEMENT


Buyer: Jonathan De Jong and Madisyn DeJong
Seller: Faron Kelsh and Connie Kelsh
Property: 9614 Deer Track Court, Brentwood, TN 37027

In consideration of the mutual covenants herein and other good and valuable consideration, the receipt and sufficiency of which is hereby acknowledged, the parties agree to amend that certain Purchase and Sale Agreement with a Binding Agreement Date of 07/29/2026 and any incorporated addenda, exhibits or prior amendments (collectively referred to herein as “Agreement”) for the purchase and sale of real property specified above as follows:


Seller title company to be Concord Title located at 3000 Meridian Blvd Ste 140 Franklin TN 37067
Closing date to be Friday, 8/28/2026

This Amendment shall be incorporated into the Agreement and all other terms and conditions of the Purchase and Sale Agreement shall remain in full force and effect.

The party(ies) below have signed and acknowledge receipt of a copy.


BUYER

07/31/2026 at 7:11 o'clock ☒ am/ ☐ pm
Date


BUYER

07/31/2026 at 6:24 o'clock ☒ am/ ☐ pm
Date

The party(ies) below have signed and acknowledge receipt of a copy.


SELLER

dotloop verified
07/30/26 2:14 PM CDT
SLIP-WE PQ-EVGN-KFCL

____ at ____ o'clock ☐ am/ ☐ pm
Date


SELLER

dotloop verified
07/30/26 2:41 PM CDT
CXH1-ES4Y-P4OX-WLID

____ at ____ o'clock ☐ am/ ☐ pm
Date

NOTE: This form is provided by Tennessee REALTORS® to its members for their use in real estate transactions and is to be used as is. By downloading and/or using this form, you agree and covenant not to alter, amend, or edit said form or its contents except as where provided in the blank fields, and agree and acknowledge that any such alteration, amendment or edit of said form is done at your own risk. Use of the Tennessee REALTORS® logo in conjunction with any form other than standardized forms created by Tennessee REALTORS® is strictly prohibited. This form is subject to periodic revision and it is the responsibility of the member to use the most recent available form.

This form is copyrighted and may only be used in real estate transactions in which Paula Hinegardner is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615- 321-1477.



REPAIR/REPLACEMENT AMENDMENT

In consideration of the mutual covenants herein and other good and valuable consideration, the receipt and sufficiency of which is hereby acknowledged, the parties enter into this Repair/Replacement Amendment for purposes of amending the Purchase and Sale Agreement with a Binding Agreement Date of 07/29/2026 ("Agreement") for the purchase and sale of the real property commonly known as:

9614 Deer Track Ct, Brentwood, TN 37027

The Seller shall cause the following items to be replaced or repaired with like quality or value in a professional and workmanlike manner as the parties hereinafter agree. (Please be specific as to whether the items are to be repaired or replaced):

Buyer requests the following, all work to be performed by appropriately licensed and insured contractors at Seller's expense, with invoices, receipts, and any engineering documentation delivered to Buyer no later than three (3) days prior to closing:

1. Structural — Floor Framing and I-Joist (Report Item #36, Page 36)

Seller to retain a licensed Tennessee structural engineer to evaluate the rotted sill framing and the damaged I-joist section located in the front left mechanical room. Seller to complete all repairs specified in the engineer's written report, including any repair detail required for the I-joist. Seller to provide Buyer with a copy of the engineer's evaluation and a post-repair letter or sign-off confirming the repairs were completed in accordance with the engineer's specifications.

2. Moisture Source Investigation (Report Items #36, #37, #45, #56)

The inspection report notes that the source of the decay in the mechanical room could not be determined, and further identifies water staining at the mechanical room subfloor, rust on the gas furnace cabinet, and rust on the water heater tank in the same area. Seller to identify and correct the source of the moisture intrusion prior to or in conjunction with the framing repairs in Item 1 above, and to provide Buyer with written documentation from the performing contractor describing the cause identified and the corrective work performed. Buyer acknowledges additional damage may be discovered during this work; any such related damage to be repaired by Seller.

3. Electrical (Report Items #39, #40, #41)


Seller to have a licensed electrician correct the following and provide a paid invoice itemizing the work:

- Repair damaged wire(s) within the main service panel (#40)
- Correct double-tapped neutrals at the mechanical room and garage distribution panels (#41)


Seller agrees to complete the above matters 3 days prior to Closing as provided in the Agreement ("Completion of Repairs Deadline") at which time Buyer and/or Buyer's inspectors or representatives shall have the right to re-inspect to confirm that such matters have been completed. Such inspection shall not limit Buyer's right to conduct a Final Inspection as provided for in the Agreement.

It is agreed by the parties hereto that all of the other terms and conditions of the aforementioned Agreement shall remain in full force and effect other than as specifically modified herein.

The party(ies) below have signed and acknowledge receipt of a copy.


eSign
Jonathan De Jong
08/11/2026 12:59 PM CDT
BUYER

08/11/2026 at 9:47 o'clock ☒ am/ ☐ pm
Date


eSign
Madelyn De Jong
08/10/2026 1:01 PM CDT
BUYER

08/10/2026 at 9:40 o'clock ☒ am/ ☐ pm
Date

The party(ies) below have signed and acknowledge receipt of a copy.


Faron Kelsh
SELLER

_____ at _____ o'clock ☐ am/ ☐ pm
Date

dotloop verified
08/11/26 12:59 PM CDT
61RE-GMOW-ABAW-EVYG


Connie Kelsh
SELLER

_____ at _____ o'clock ☐ am/ ☐ pm
Date

dotloop verified
08/11/26 1:01 PM CDT
ZKNK-M6DV-XBMU-IQUJ

NOTE: This form is provided by Tennessee REALTORS® to its members for their use in real estate transactions and is to be used as is. By downloading and/or using this form, you agree and covenant not to alter, amend, or edit said form or its contents except as where provided in the blank fields, and agree and acknowledge that any such alteration, amendment or edit of said form is done at your own risk. Use of the Tennessee REALTORS® logo in conjunction with any form other than standardized forms created by Tennessee REALTORS® is strictly prohibited. This form is subject to periodic revision and it is the responsibility of the member to use the most recent available form.

This form is copyrighted and may only be used in real estate transactions in which Ryan Stonehouse is involved as a Tennessee REALTORS® authorized user. Unauthorized use of the form may result in legal sanctions being brought against the user and should be reported to Tennessee REALTORS® at 615-321-1477.



Premier Escrow LLC
ALTA Universal ID 1058033
4301 Hillsboro Pike, Suite 300
Nashville, TN 37215

File No./Escrow No.: MS2026-1061
Print Date & Time: August 24, 2026 at 04:45 PM
Officer/Escrow Officer: Premier Escrow, LLC
Settlement Location: 4301 Hillsboro Pk., Ste. 300, Nashville, TN 37215
Property Address: 9614 Deer Track Ct
 Brentwood, TN 37027
Borrower: Jonathan M. De Jong and Madisyn E. De Jong
Seller: The Faron and Connie Kelsh Family Revocable Trust u/a/d May 23, 2024
Lender: Churchill Mortgage Corporatio
Settlement Date: August 28, 2026
Disbursement Date: August 28, 2026

Seller		Description	Borrower/Buyer	
Debit	Credit		Debit	Credit
Financial				
	\$ 2,250,000.00	Sale Price of Property	\$ 2,250,000.00	
		Deposit		\$ 22,500.00
		Loan Amount		\$ 1,450,000.00
Prorations/Adjustments				
	\$ 225.34	HOA Dues 08/29/26-01/01/27	\$ 225.34	
\$ 551.67		City/Town Taxes 01/01/26 to 08/29/26		\$ 551.67
\$ 3,773.59		County Taxes 01/01/26 to 08/29/26		\$ 3,773.59
Loan Charges to Churchill Mortgage Corporatio				
		Processing Fee	\$ 250.00	
		Underwriting Fee	\$ 250.00	
		Prepaid Interest \$248.2877 per day from 08/28/26 to 09/01/26	\$ 993.15	
Other Loan Charges				
		Appraisal Fee to Clear Capital	\$ 90.00	
		Appraisal Fee to Reggora	\$ 650.00	
		Credit Report to Informative Research	\$ 60.00	
		Technology Bundle Fee to Informative Research	\$ 340.00	
Impounds				
		Homeowner's Insurance	\$ 1,157.10	

ALTA Settlement Statement Combined - Continued

Seller		Borrower/Buyer	
Debit	Credit	Debit	Credit
	3 mo @ \$ 385.70 /mo		
	Property Taxes	\$ 5,260.75	
	11 mo @ \$ 478.25 /mo		
	City/Town Taxes	\$ 769.12	
	11 mo @ \$ 69.92 /mo		
	Aggregate Adjustment	\$ -1,542.80	
Title Charges & Escrow / Settlement Charges			
	Title - Owner's Title Insurance (optional)	\$ 350.00	
	to Premier Escrow LLC		
	Coverage: \$ 2,250,000.00		
	Premium: \$ 6,062.00		
	Title - Lender's Title Insurance	\$ 5,937.00	
	to Premier Escrow LLC		
	Coverage: \$ 1,450,000.00		
	Premium: \$ 225.00		
	Title - Closing Fee	to Premier Escrow LLC	\$ 535.00
	Title - Courier Fee	to Premier Escrow LLC	\$ 85.00
	Title - CPL Fee	to First American Title Insurance Company	\$ 50.00
	Title - Search Fee	to Premier Escrow LLC fbo First American	\$ 125.00
\$ 30.00	Title - Wire Fee	to Premier Escrow LLC	\$ 30.00
Commission			
\$ 67,500.00	Commission	to Keller Williams	
\$ 67,500.00	Commission	to Compass	
Government Recording and Transfer Charges			
	Recording Fees	to Register of Deeds	\$ 106.00
	Deed:\$13.00 Mortgage:\$93.00		
	Transfer Tax	to Register of Deeds	\$ 8,325.00
	Warranty Deed		
	Transfer Tax	to Register of Deeds	\$ 1,665.20
	Deed of Trust		
Payoffs			
\$ 1,338,982.06	Payoff of First Mortgage	to First Bank	
	Loan		
	As of 08/01/26		
	Principal Balance	\$ 1,330,000.00	
	Total Interest	\$ 8,982.06	
	27 Days @ 280.689370 Per Diem/Day	Plus 5 Extra Days	

ALTA Settlement Statement Combined - Continued

Seller		Borrower/Buyer	
Debit	Credit	Debit	Credit
Miscellaneous			
		HOA Transfer Fee to Westwood Management, Inc	\$ 400.00
\$ 625.00		Closing Fee to Concord Title	
\$ 161.95		HOA Statment of Account - to Concord Title Reimbursement	
		HOA Working Capital Contribution to Bonbrook Homeowners Association	\$ 658.00
		Homeowner's Insurance Premium to USAA (12 mo.)	\$ 4,628.36
\$ 1,479,124.27	\$ 2,250,225.34	Subtotals	\$ 2,281,397.22
\$ 771,101.07		Balance Due FROM	\$ 1,476,825.26
\$ 2,250,225.34	\$ 2,250,225.34	Balance Due TO	\$ 804,571.96
		TOTALS	\$ 2,281,397.22



DILIGENT

Home Inspection Report

PROPERTY ADDRESS:

9614 Deer Track Court
Brentwood, TN 37027

PREPARED FOR:

JONATHAN & MADISYN DE JONG

INSPECTION DATE:

Monday, August 3, 2026

INSPECTED BY:

DILIGENT - Brennan Wade



Inspections - Testing - Consulting



DILIGENT
2708 Fortland Drive
Nashville, TN 37206

615.200.8220

www.getdiligent.com



August 3, 2026

Dear Jonathan & Madisyn De Jong,

RE: Report No. 23729
9614 Deer Track Court
Brentwood, TN
37027

Thanks very much for choosing DILIGENT to perform your home inspection and walk with you through this time. We are sensitive to the fact the real estate buying/selling process can be an exciting, but emotional time. Knowing that, first and foremost, we would like to make sure that you have the fullest understanding of the inner-workings of the home. The inspection itself and the attached report comply with the requirements of the TN Standards of Practice, which can be seen at the back of this report, or sourced on the TN.gov website, defines the scope and expectations of a typical home inspection.

Our process is investigative and scientific in nature, but visual and non-invasive. A home inspection can mean different things to different people, and sometimes clients assume that a home inspection will include many things that are beyond the scope. We encourage you to read the TN Standards of Practice and the "What To Expect" letter in the appendix of this report, so that you clearly understand what things are included in the home inspection and report, and that which is not.

The report has been prepared for the exclusive use of our client. No use by third parties is intended. We will not be responsible to any parties for the contents of the report, other than the party named herein .

The report is effectively a snapshot of the house, recording the conditions on a given date and time. Home inspectors cannot predict future behavior, and as such, we cannot be responsible for things that occur after the inspection.

=====

CLUES FOR READING THE REPORT:

- Please read the WHOLE report. Items of importance, and issues needing repair are in the summary section, but helpful information, detailed pictures/diagrams, and other information is in the "body" of the report. The body may even contain some helpful things to monitor or keep an eye on, which may not be an issues currently, but would benefit from home owner vigilance.
- This inspection and this report, at their core purpose, are to find MAJOR defects and issues within the home. Cosmetic issues (paint, staining, nicks, non-structural cracks) are not part of the inspection and will NOT be included in the report. The inspector, however, may choose to point out a few of those things onsite, as a courtesy.
- We attempt to stratify the issues found within the home with a simple 1, 2 or 3 rating system. This is our professional opinion, which carries weight and legitimacy, but is an opinion at the end of the day.

- Level 1's are maintenance items, likely able to be fixed by a home owner or a common handy man and are typically of a lower cost nature.
- Level 2's are medium importance, and often require immediate or nearly immediate attention
- Level 3's are important and/or severe in nature. These items will likely need a construction professional, immediate attention, and will be among the higher costs of home ownership.
- Many of the notes in the report will contain active internet links to 'more information' on a specific issue or system within the house.
- While it may not be expressly mentioned in the report, there are likely MANY things that are RIGHT with the home. The purpose of this report is to isolate the defects and issues within the home, helping the home buyer become educated and getting them into a repaired and healthy home.

=====

The report itself is copyrighted, and licensed to the transacting client, and may not be used in whole or in part without our express written permission. This report is NOT allowed to be given to other parties for their use, without the permission of DILIGENT, and DILIGENT may seek associated fees from any parties that are not the original transacting client.

Again, thanks very much for choosing DILIGENT to perform your home inspection. Our satisfaction guarantee is simple, if you are not happy, we will return your fee, and work to regain your trust.

Sincerely,

DILIGENT - Brennan Wade
on behalf of
DILIGENT

DILIGENT
2708 Fortland Drive
Nashville, TN 37206
615.200.8220
www.getdiligent.com

REPORT SUMMARY

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

This Summary outlines potentially significant issues that should be the main focus during this transaction. Items listed here will include the most important issues found, including issues affecting health and safety. This section is provided as a courtesy and SHOULD NOT be considered a substitute for reading the entire report.

*** Please read the complete document! ***

Some 'minor' issues may not be included in the Summary, but are noted in the full report. The severity of issues and 'defects' is a subjective matter, but at DILIGENT we try to distill what will affect our average client. Additionally, pictures are NOT included in the Summary to streamline the reading of this report, BUT are included in the main body of the report in the corresponding section. Please click the tab at the top of this report to jump to a section.

Also, please feel free to call us at 615.200.8220 or email us if you have any questions, by simply replying to your report email.

[Priority Maintenance Items](#)

Structure

FLOORS \ Sills

Condition: • Rot

Rot was present at the indicated sections of framing materials. Rot and decay are most commonly a symptom of a localized moisture presence, or a poorly ventilated area with high ambient moisture levels. It is recommended that sections of the framing with rot or decay be repaired as the wooden members have been weakened from their original state during installation. Minor amounts of rot may only need small repairs (or monitoring), while larger damage may warrant replacement of the damage wood. Additionally, some damage was noted on a section of the I-joist. As alterations of the i-joist top or bottom chord is not allowed (environmental or mechanical), further evaluation by a structural engineer would be necessary to determine if repair is warranted. If a repair is performed, any related documentation should be acquired and retained by the buyer for future use (e.g. when selling the home).

Note: The definitive source of the decay could not be determined. Further evaluation will be necessary to repair the cause of the deterioration to help deter future damage. Further damage may be found while making repairs.

Location: Front left - mechanical room

Task: Level 2 - Medium

Time: Level 2 - Recommended Repair

Electrical

ELECTRICAL PANELS \ Panel wires

Condition: • Damage

Wire(s) were damaged inside the indicated distribution panel. Damaged wires are potential shock and fire hazards. It is recommended that all damaged electrical components be repaired by a qualified electrician.

Location: Main service panel

Task: Level 2 - Medium

REPORT SUMMARY

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Time: Level 2 - Recommended Repair

DISTRIBUTION SYSTEM \ Outlets (receptacles)

Condition: • Reversed polarity

The polarity was reversed (hot and neutral swapped) on the indicated outlets. This can pose shock hazards to occupants when using certain appliances. It is recommended that the polarity be corrected by a qualified, licensed electrician.

Location: Foyer

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

This concludes the Summary section.

The remainder of the report contains DESCRIPTIONS of each of the home's systems and also details any RECOMMENDATIONS we have for improvements. LIMITATIONS that restricted our inspection are included, as well.

The TASK descriptor outlines our judgement of how 'severe', or what the size/scope of the issue may be, while the TIME comment indicates how quickly the defect should be repaired, or the urgency that it should be dealt with.

Each defect in the body of the report is uniquely numbered, with no repeating numbers, throughout the different sections. Additionally, each picture is separately, but uniquely numbered for easy reference and identification when reading. These number do NOT correspond necessarily, but are useful when referencing areas of the report with other parties or for the purpose of composing the Repair Addendum.

[Home Improvement - ballpark costs](#)

ROOFING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Description

General: • The roof was estimated to be approximately in the middle of its usable service life.

Sloped roofing material: • Asphalt shingles

Limitations

Inspection limited/prevented by: • Lack of access (too high/steep)

Inspection performed:

- By walking on roof
- Back roof
- From the ground

Recommendations

SLOPED ROOFING \ Asphalt shingles


1. Condition: • Exposed fasteners

Exposed fasteners which penetrate roofing materials should be sealed with an appropriate, exterior-grade sealant to lessen the potential for leakage. Applied sealant should be periodically maintained when degradation occurs.

Location: Roof - back ridge near chimney

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

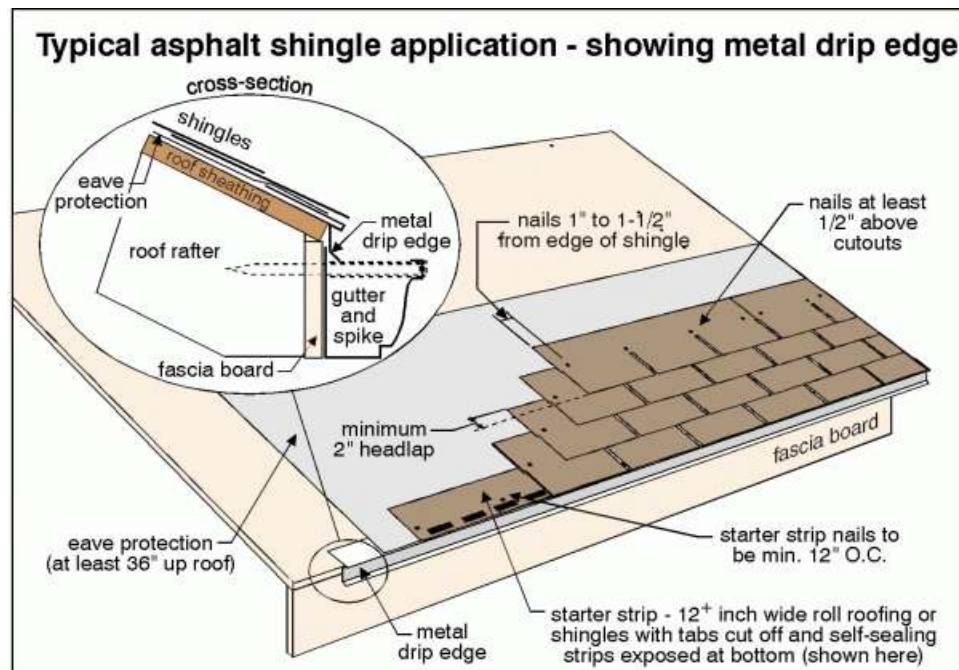

ROOFING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



1. Exposed fasteners

2. Condition: • Moss growth

Moss growth is a symptom and evidence that a portion of the roof is not receiving enough sun to dry out. The presence of moss may allow for additional water to be retained in that area leading to potential water intrusion issues, and heavy moss growth can lead to build up of debris or degradation of the shingles. Moss should be monitored, and/or removed as desired, or as buildup increases.

Location: Roof

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



2. Moss growth

3. Condition: • Minor abrasions

Minor abrasions were found in the shingles at various locations. This can be caused by foot traffic, ladders and cleats used during construction, but can also be a result of minor manufacturing defects. The damage is unlikely to affect the roof's performance but can be repaired if desired.

ROOFING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Location: Roof - Various locations throughout

Task: Level 1 - Minor




3. Minor abrasions

4. Condition: • Granule loss

Granule loss was found in areas of the roof. The amount of granule loss appeared to be consistent with the apparent age of the roof. Loss of granules is a normal part of the aging process of the roof.

Location: Roof

Task: Level 1 - Minor

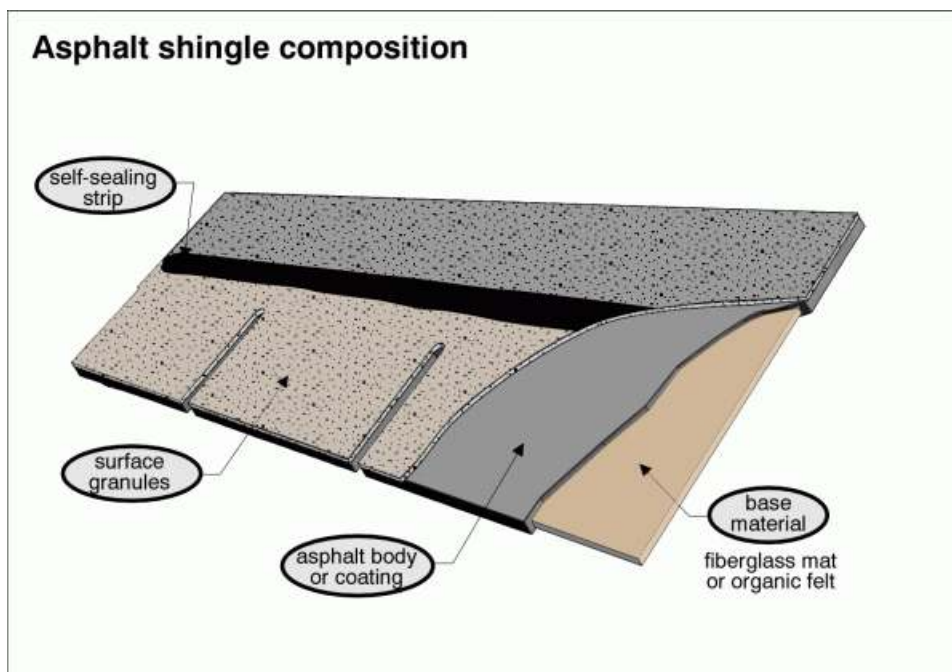

ROOFING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



4. Granule loss

5. Condition: • Withdrawn fasteners

Seasonal expansion and contraction of roofing materials and sheathing can cause fasteners to withdraw. This results in lifting of the shingles above the fastener. It is recommended that withdrawn fasteners be re-driven or replaced to prevent eventual, minor damage to the shingle due to penetration.

Location: Roof - back left above garage area

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



5. Withdrawn fasteners

6. Condition: • Loose

Loose shingles were noted at the indicated areas of the roof. To deter moisture entry/wind damage, it is recommended that the shingles be re-secured.

Location: Above front bay windows - left side

ROOFING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



6. Loose

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Description

Wall surfaces: • Brick veneer

Limitations

Inspection limited/prevented by: • Storage • New finishes/paint/trim • Car/storage in garage • Vines/shrubs/trees against wall • Due to height, location, or other obstructions, inspection of exterior, upper-floor elements, such as siding, windows, dormers, and trim was limited to details observable from ground level. As such, no determination could be made regarding the condition of these elements. • Piping and termination points for submerged downspout extensions cannot be evaluated. • Limited visual access under steps, deck, or porch

Not included as part of a building inspection: • Fences, property markers, and boundary walls are not included as part of a residential home inspection as per the TN Standards of Practices. Any comments on fencing or gates in this report, is provided as a courtesy to the client. • Non-permanent outbuildings and other structures are not part of a residential home inspection. These types of buildings are not governed under modern building code requirements, and may include irregular or atypical construction practices.

Recommendations

ROOF DRAINAGE \ Downspouts

7. Condition: • Discharge too close to building

It is a good practice to extend downspouts to allow them to discharge at least 4 to 6 feet away from the home. Moisture collection near the foundation can result in settlement and/or moisture issues beneath the home. Downspout extensions are available at home/hardware stores.

Location: Downspout - front right

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING


INTERIOR

APPENDIX

Gutter and downspout installation



Downspout extension too short

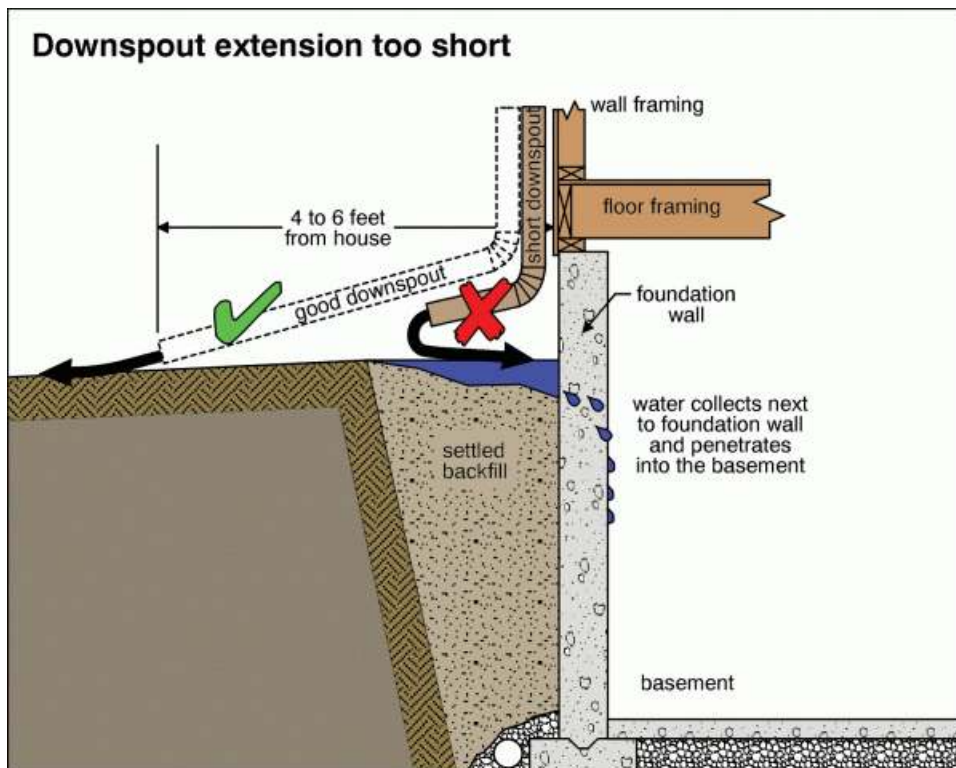

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



7. Discharge too close to building

8. Condition: • Discharge onto roofs

In some cases, downspouts discharging onto a roof can cause accelerated granule loss and shorten the life of shingles by concentrating large amounts of water flow onto a small area.

Note: Overtime, staining and/or moss growth can accumulate in some of the discharge areas.

Location: Roof

Task: Level 1 - Minor



EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



8. Discharge onto roofs

WALLS \ Masonry (brick, stone) and concrete

9. Condition: • Cracked

Minor cracking in the brick veneer was noted at window and door openings. This type of cracking is often indicative of minor settlement which may have occurred at any point in the history of the home. It is recommended that the cracks be filled with an appropriate filler and monitored for further signs of movement.

Note: It is recommended that the cracks be filled with mortar, as it will alert the homeowner to any potential issues, and establishes a time line for movement in the brick veneer. Flexible sealant should not be used, as it obscures movement.

Location: Brick Veneer - multiple locations

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



9. Cracked



10. Cracked

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



11. Cracked




12. Cracked

10. Condition: • Spalling

Spalling of bricks was noted in several areas. Spalling is caused by porous brick absorbing water and cracking when it freezes. This defect is most common in bricks produced in the 1950s through the 1970s, but still a potential issue in modern brick. Superficial spalling of the brick surface is largely cosmetic; however, deeper damage which affects the core of the brick should be repaired by a qualified mason. It is recommended that spalled areas be monitored and repaired, as needed.

Location: Brick Veneer

Task: Level 1 - Minor

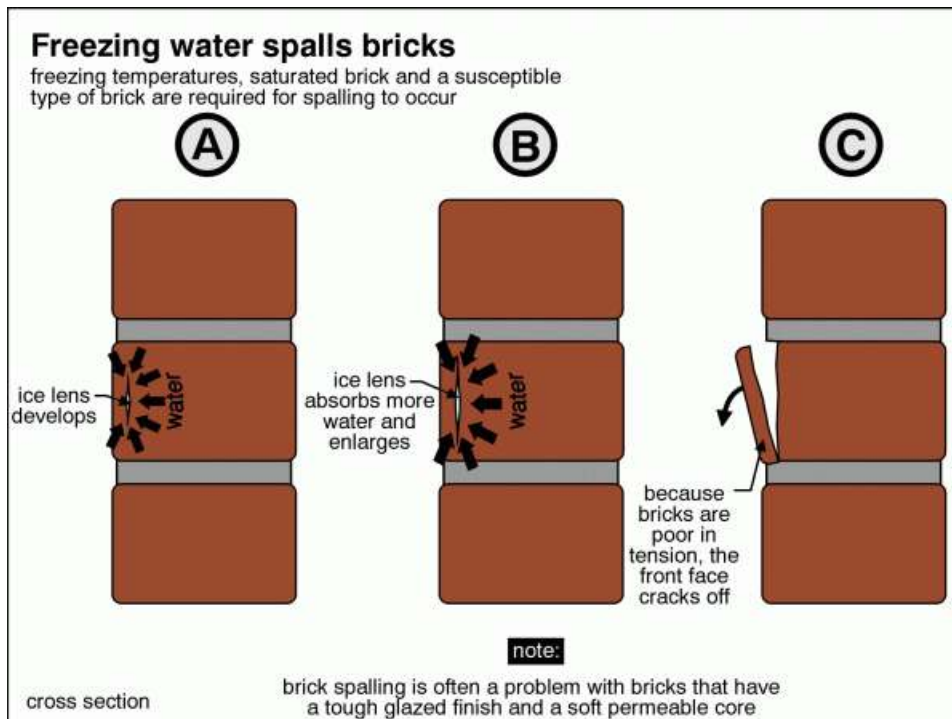

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



13. Spalling



14. Spalling


11. Condition: • Mortar deterioration / missing

Several areas of the mortar were missing or showed signs of deterioration. This issue can be common in older homes, but should be addressed to avoid further damage. It is recommended that the mortar joints be tuck-pointed by a qualified mason.

Location: Brick veneer

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

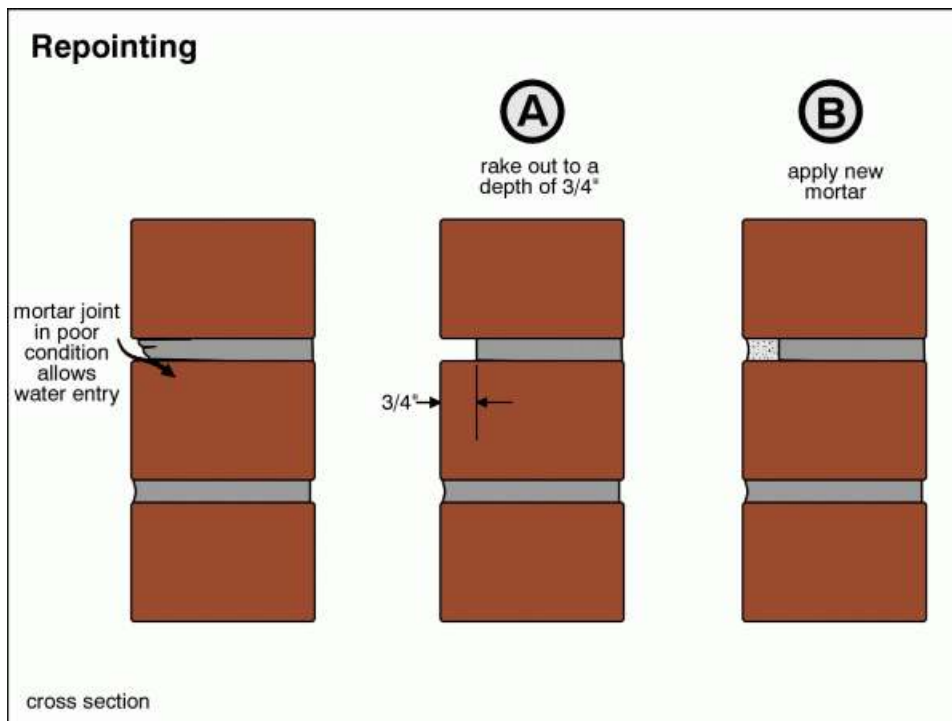

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



15. Mortar deterioration / missing



16. Mortar deterioration / missing

12. Condition: • Mechanical damage

Loose bricks were found in the masonry veneer. Although mainly a cosmetic issue, it is recommended that the loose bricks be re-set and that damaged joints be re-pointed by a qualified mason.

Location: Near garage vehicle doors

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



17. Mechanical damage

13. Condition: • Missing, ineffective weep holes or flashings

Ideally, a brick veneer wall will contain clear and open weep holes or flashings that will allow for diffused or condensed moisture to escape from behind the masonry. Without these weep holes, efflorescence, spalling and mortar deterioration may occur over time. Adding weep holes after construction oftentimes does not produce the desired result. At the time of the inspection, no current moisture accumulation or efflorescence was present, but action may be required in the future, if these issues arise.

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR


APPENDIX

Location: Brick veneer


Task: Level 1 - Minor

Time: Level 0 - No Current Action Recommended

Weep holes below grade

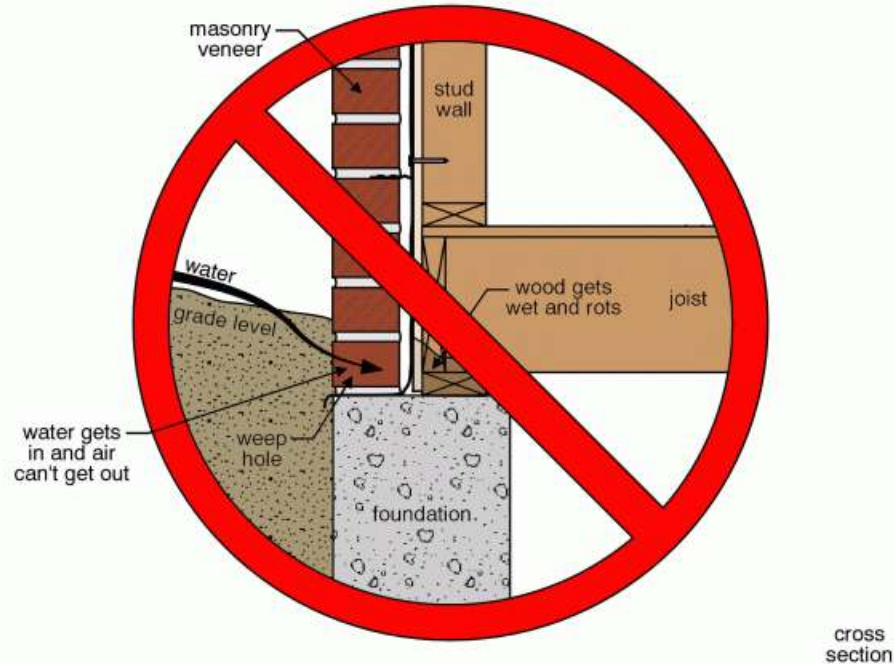

Weep holes - vented rain screen principle

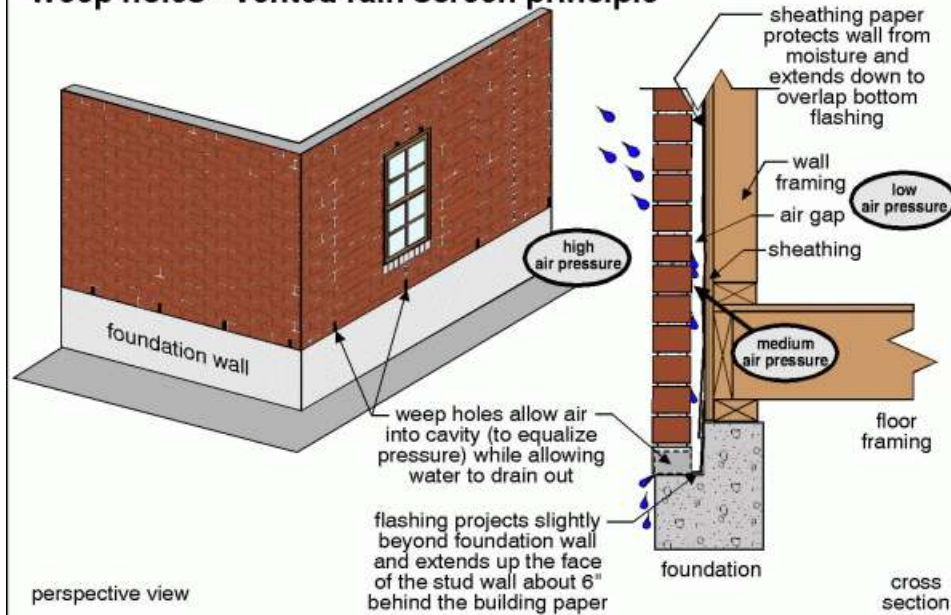

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



18. Missing, ineffective weep holes or flashings



19. Missing, ineffective weep holes or flashings



20. Missing, ineffective weep holes or flashings

14. Condition: • Prior repairs

Prior repairs were noted in areas of the brick veneer. The repaired areas had been sealed with an elastic type sealant. It is recommended that the sealant be removed, due to the fact that sealant can obscure movement, and cracks or damaged areas be tuck pointed (mortar applied). The repairs should be monitored for signs of further cracking or movement. Additionally, any documentation regarding the repairs should be saved for future use (receipts, warranties, structural letter, etc.).

Location: Brick Veneer - right of front porch

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



21. Prior repairs



22. Prior repairs

15. Condition: • Unsealed penetrations in masonry

It is recommended that all sizable openings which penetrate the masonry wall be sealed to deter moisture intrusion.

Location: Back hose bib, gas meter

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



23. Unsealed penetrations in masonry



24. Unsealed penetrations in masonry

WINDOWS \ Exterior trim

16. Condition: • Caulking loose, missing or deteriorated

Maintenance was needed on caulking at the transition between window trim and adjacent materials in multiple locations around the house.

Location: Exterior Window Trim - multiple locations

Task: Level 1 - Minor

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Time: Level 2 - Recommended Repair



25. Caulking loose, missing or deteriorated



26. Caulking loose, missing or deteriorated



27. Caulking loose, missing or deteriorated

DOORS \ Doors and frames

17. Condition: • Door threshold unsealed

Sealant was missing below the exterior door threshold. It is recommended that the threshold be kept well sealed to deter moisture and pest entry, as well as preventing exterior air from blowing under the door.

Location: Basement door, balcony doors

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



28. Door threshold unsealed



29. Door threshold unsealed



30. Door threshold unsealed



31. Door threshold unsealed

DOORS \ Exterior trim

18. Condition: • Caulking missing, deteriorated or loose

Sealant should be maintained between the door trim and adjacent materials to deter moisture entry behind the trim.

Location: Front left door

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



32. Caulking missing, deteriorated or loose

19. Condition: • Rot

Rot and deterioration were found at the base of the door trim. Deterioration is commonly found at this location and when minor, can be repaired by patching and resealing the wood components. It is recommended that the damaged wood components be repaired or replaced as needed, and that the trim be repainted and sealed.

Note: When repairing rotten wood, it is important to remove as much damaged material as possible to prevent re-occurrence. The wood should be treated with a stabilizer or hardener and patched with an epoxy or polyester resin. This provides a long lasting repair that can be shaped to match the profile of the trim.

Location: Door into garage

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



33. Rot

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Columns / Posts

20. Condition: • Column in contact with concrete

Decay can occur more quickly when wood is in constant contact with the concrete. It is recommended that the columns be monitored for decay. Only a minor amount of deterioration was observed and no immediate action is recommended.

Location: Back patio

Task: Level 1 - Minor



34. *Column in contact with concrete*

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Joists

21. Condition: • Ledgerboard problems

A wooden deck should be a free standing structure. Modern building practices indicate that a wooden deck directly connected to a brick (veneer) house via a through-bolted ledgerboard, may cause undue stresses on the brick veneer and may cause cracking or unwanted movement in the deck. It is better to have the deck be fully self supported with the appropriate beams and posts near to the house to avoid potential damage. In this case, there were no signs of associated cracking or movement. Additional support (columns) can be installed near the home to reduce the potential for deck movement.

Location: Deck

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

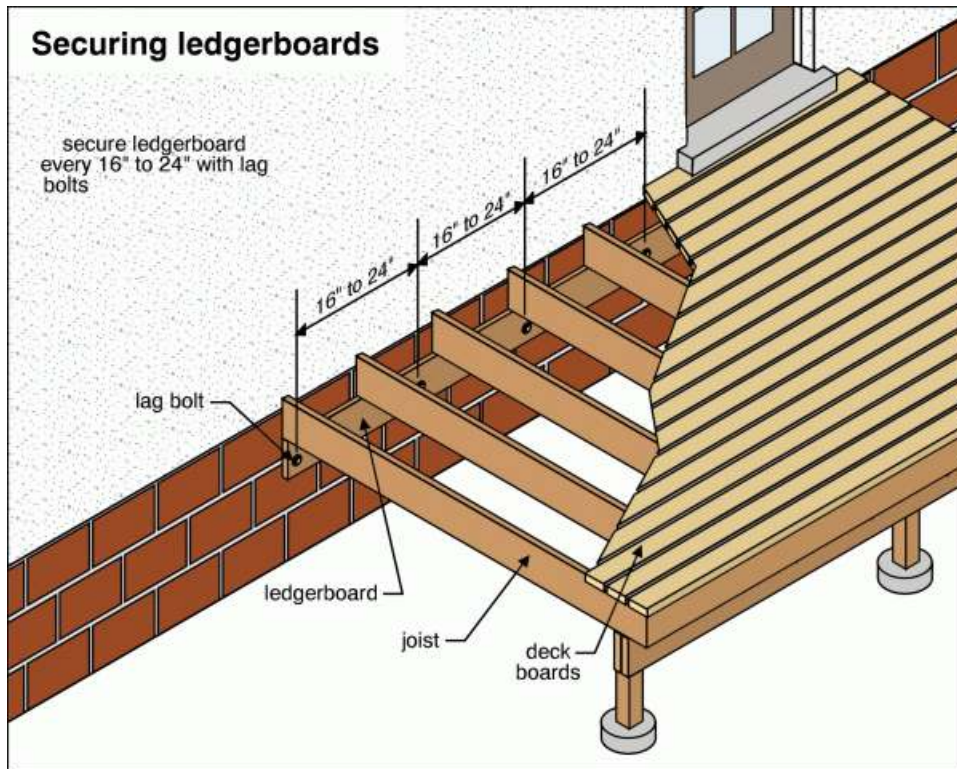

35. Ledgerboard problems

22. Condition: • Fastener problems

The rim joist of the deck does not bear upon the columns of the deck. As a result, support of the rim joist is dependent upon the sheer strength of the fasteners (nails). The installation of through-bolts, lag bolts or metal hangers would provide a more dependable connection.

Location: Deck

Task: Level 1 - Minor

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING


INTERIOR

APPENDIX

Time: Level 2 - Recommended Repair



36. *Fastener problems*

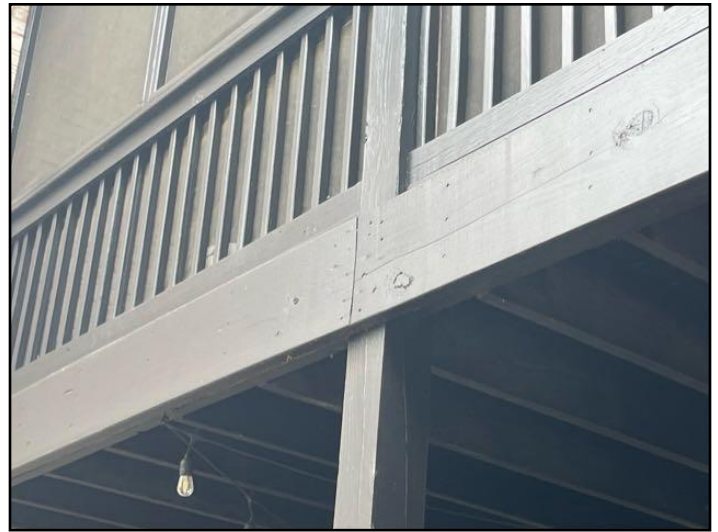

37. *Fastener problems*

23. Condition: • Missing flashing at deck connection

No flashing was installed at the connection of the deck to the structure. The omission of flashing at this location may allow moisture to migrate behind the ledger board, potentially damaging connection points and wall sheathing. No water damage was visible opposite this area; however, it may be advisable to install flashing at the deck connection to reduce the chances of water entry.

Location: Deck

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

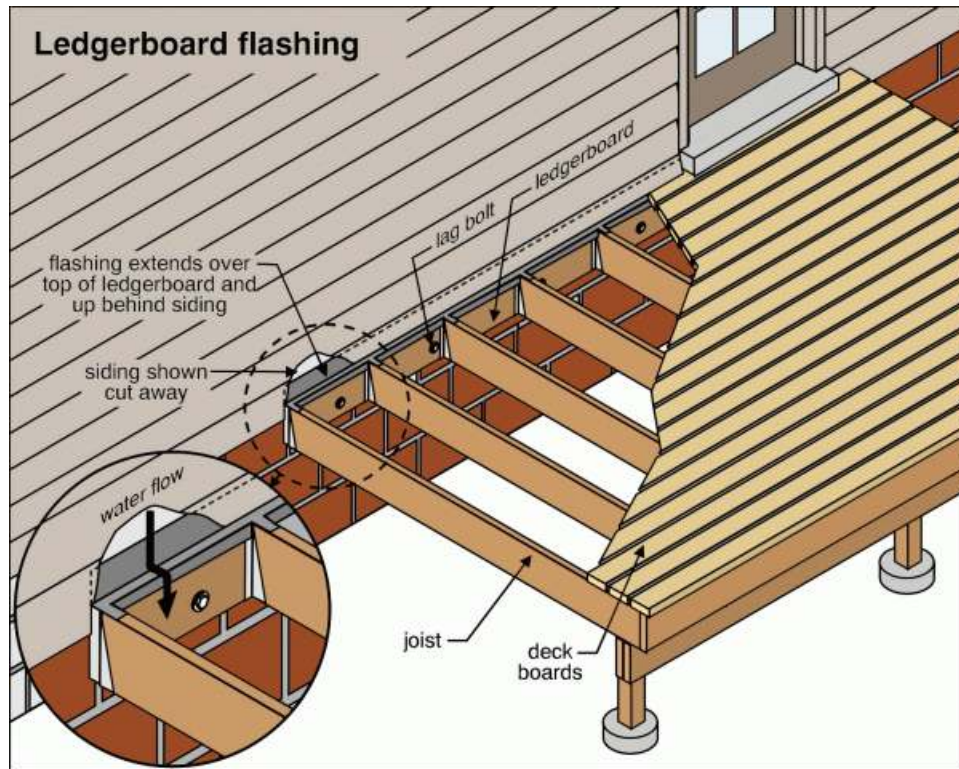

38. Missing flashing at deck connection

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Stairs and landings

24. Condition: • Masonry or concrete spalling

Minor spalling, cracking and mortar deterioration was noted in the masonry steps, patio, and handrails/guardrails. Spalling is caused by porous masonry absorbing water and cracking when it freezes. This is primarily a cosmetic issue and can be repaired by a mason at the discretion of the homeowner.

Location: Front

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION


PLUMBING

INTERIOR

APPENDIX

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

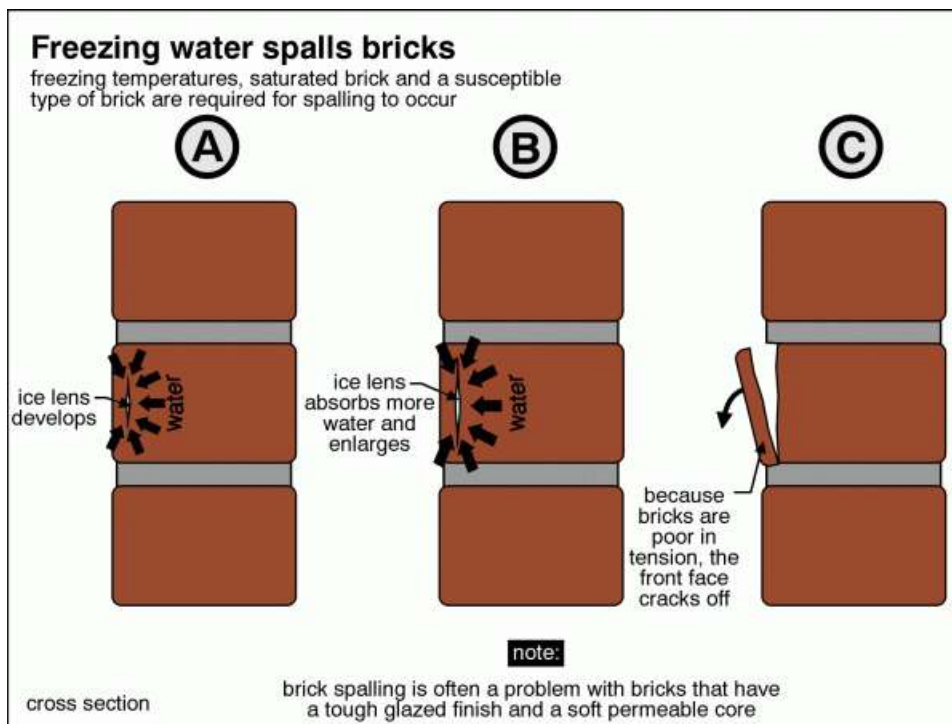

39. Masonry or concrete spalling



40. Masonry or concrete spalling

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR


APPENDIX



41. Masonry or concrete spalling



42. Masonry or concrete spalling

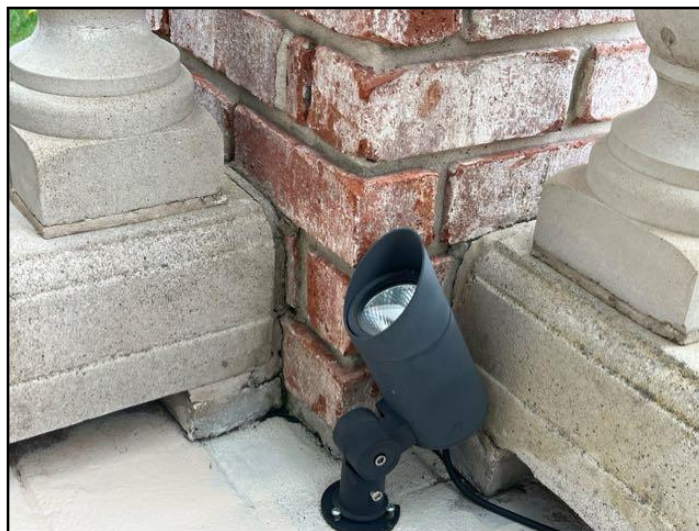

43. Masonry or concrete spalling

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Masonry patios

25. Condition: • Unsealed gap at building

It is recommended that gaps between the home and the patio be sealed with an appropriate exterior sealant to prevent moisture intrusion. Water entry at this location can result in settlement of the foundation or patio slab and, in some instances, cause deterioration of floor framing components.

Location: Back patio

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



44. Unsealed gap at building

26. Condition: • Poor drainage

Patios and other hard scapes should slope away from the home to deter moisture from collecting against the foundation. Without a floor drain, low points in the patios and/or porches can allow water to collect and deteriorate the masonry. Cracking, damage, and settlement can occur over time if the issue is not addressed.

Location: Front porch

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



45. Poor drainage

LANDSCAPING \ General notes

27. Condition: • Vines on building

Vines growing on the exterior of the house can cause material damage and serve as an easy path for insects to enter the home.

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Location: Front left

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



46. Vines on building

LANDSCAPING \ Lot grading

28. Condition: • Improper slope / drainage issues

The indicated grading is improperly sloped, presenting a moisture drainage issue. The grading should be elevated against the house dropping a minimum of 6" over the first 10' to allow water to naturally run away from the home.

Location: Back yard, right side

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



47. Improper slope / drainage issues



48. Improper slope / drainage issues

LANDSCAPING \ Walkway

29. Condition: • Cracked or damaged surfaces

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Minor cracking was observed in the walkway. This is primarily a cosmetic issue. Cracks can be filled and monitored for further movement.

Location: Walkway

Task: Level 1 - Minor

Time: Level 1 - Repair & Monitor



49. Cracked or damaged surfaces



50. Cracked or damaged surfaces

LANDSCAPING \ Driveway

30. Condition: • Cracked or damaged - Concrete

Minor cracking was noted in the concrete driveway. Unsealed cracks should be filled with a proper crack filler and monitored for further movement.

Location: Driveway

Task: Level 1 - Minor

Time: Level 1 - Repair & Monitor



51. Cracked or damaged - Concrete

LANDSCAPING \ Retaining wall

31. Condition: • Cracked


Minor to moderate cracking was noted in the retaining wall. To prevent further damage to the wall due to repeated freeze and thaw cycles, it is recommended that the cracks be sealed.

Note: The cracks should be filled with a non elastic filler, such as mortar. This type of material will re-crack if ongoing movement is present, alerting the homeowner to potential issues.

Location: Retaining wall

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

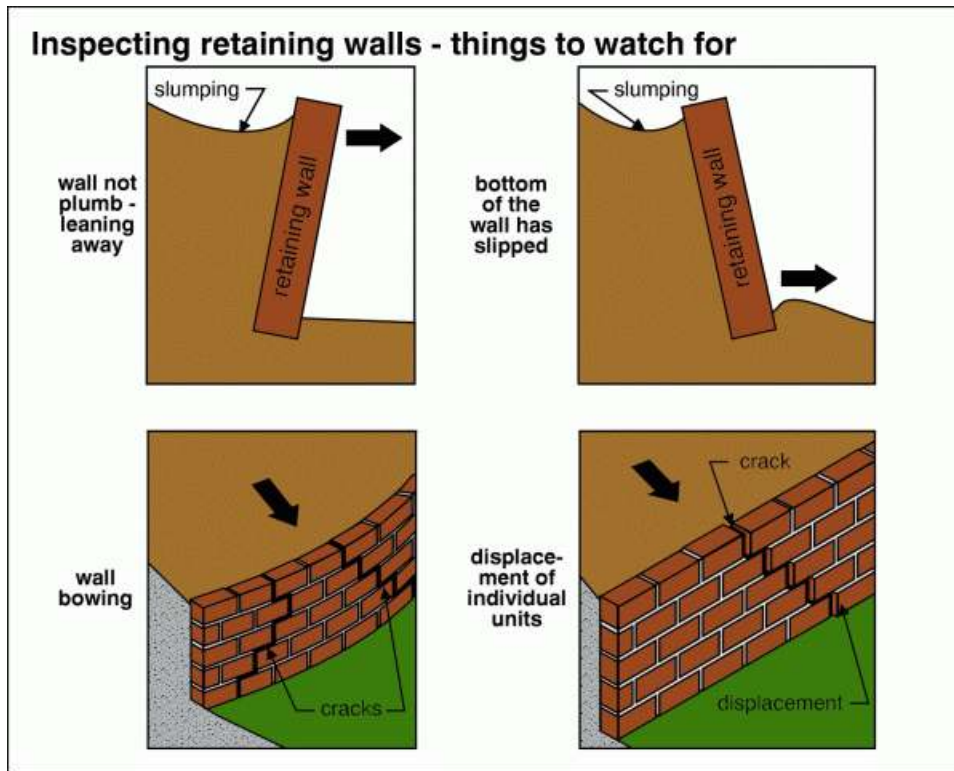

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION


PLUMBING

INTERIOR

APPENDIX



52. Cracked

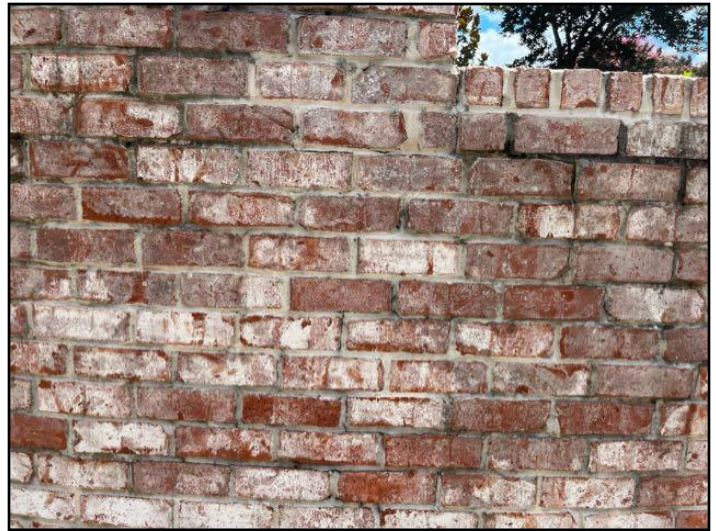


53. Cracked

32. Condition: • Drainage system missing

No visible drainage system was installed on the retaining wall. Generally a drain tile and positive drains are installed to allow water to drain from the base of the wall. This is intended to relieve the pressure exerted against the wall when the soil is saturated. Retaining walls over 4' without out drainage systems are susceptible to cracking and leaning. The wall should only be monitored for movement as no current issues were observed.

Location: Retaining wall

Task: Level 1 - Minor

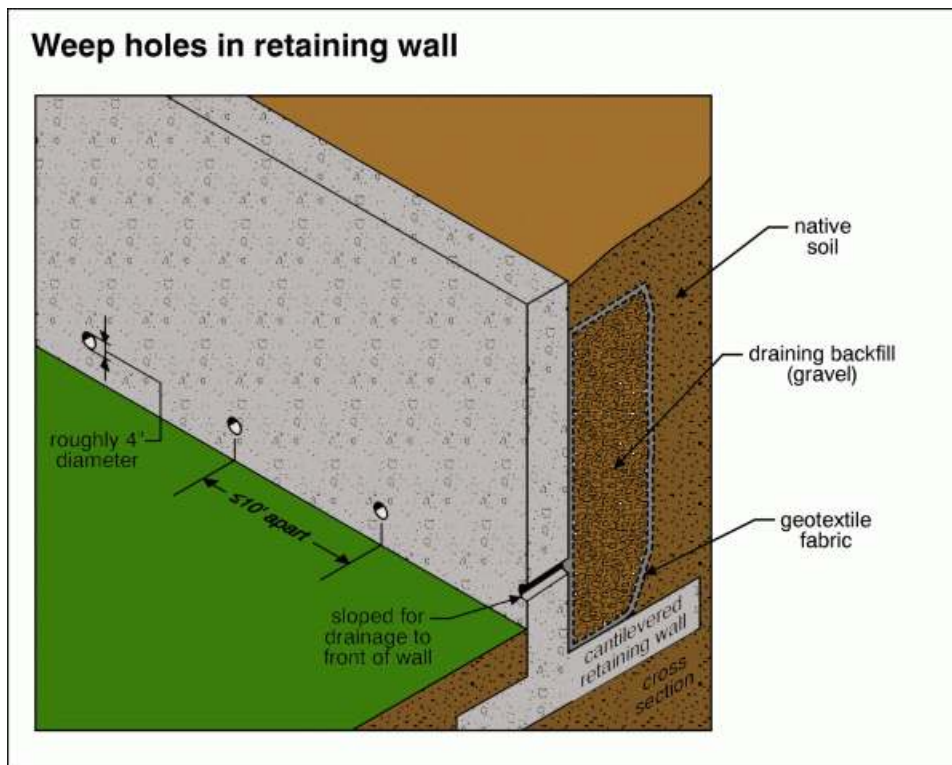

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



54. Drainage system missing

GARAGE \ Ceilings and walls

33. Condition: • Water stains - Currently dry

The indicated moisture stains were tested with a moisture meter and found to be currently dry, suggesting that the staining is the result of past moisture issues, or an intermittent issue that was not present on the day of the inspection. Stained areas should be monitored for evidence of further moisture.

Note: Cosmetics can be improved at the discretion of the homeowner. The use of a stain-blocking primer may be necessary to prevent reappearance of stains.

Location: Garage

Task: Level 1 - Minor



55. Water stains - Currently dry



56. Water stains - Currently dry

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



57. Water stains - Currently dry

34. Condition: • Fire separation between garage and living space not adequate

Fire-rated drywall was not installed at locations adjacent to living areas. Attached garages adjacent to habitable rooms should be separated from all living areas by not less than 5/8-inch Type X gypsum board or equivalent. The purpose of this practice is to slow the spread of a fire, originating in the garage, to allow occupants time to safely evacuate.


Location: Garage

Task: Level 2 - Medium

Time: Level 2 - Recommended Fire Safety Upgrade



58. Fire separation between garage and living...

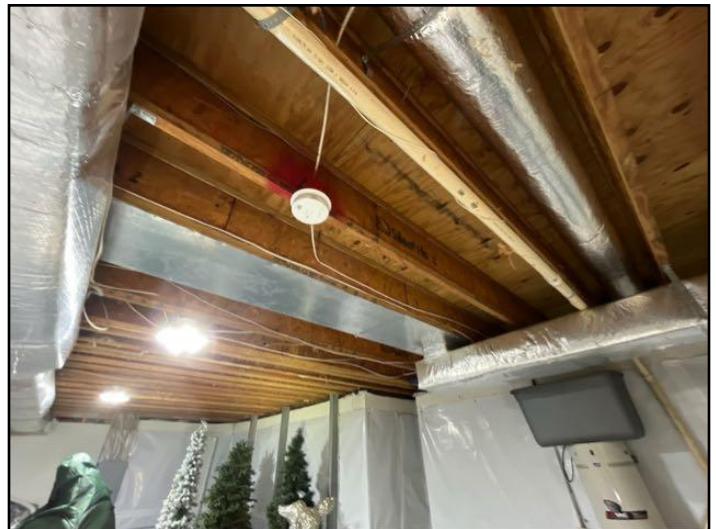

59. Fire separation between garage and living...

GARAGE \ Door into garage from living space (man-door)

35. Condition: • No self-closer

No self-closer was installed on the door leading to the garage from the interior of the home. Although this is not yet required by all municipalities, it is a good safety practice. The purpose of the self-closer is to reduce the spread of fire or harmful gasses (e.g. carbon monoxide) from the garage to the home.

EXTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Location: Garage - door to interior

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



60. No self-closer



61. No self-closer

Description

Configuration: • Basement

Foundation material: • Masonry block

Floor construction: • Wood I-joists • Not visible • Subfloor - OSB (Oriented Strand Board)

Exterior wall construction: • Wood frame / Brick veneer

Roof and ceiling framing: • Rafters/ceiling joists • Plywood sheathing

Limitations

Inspection limited/prevented by:

- Storage
- Insulation
- Ceiling, wall and floor coverings
- New finishes/paint
- The vapor barrier was installed partially (or fully) covering the interior of the foundation wall. This configuration is typical, but greatly reduces the visibility of the interior side of the foundation.



62. The vapor barrier was installed partially...

Attic/roof space: • Entered but access was limited

Knee wall areas: • Entered but access was limited

Not included as part of a building inspection: • An opinion about the adequacy of structural components

Recommendations

FLOORS \ Sills

36. Condition: • Rot

Rot was present at the indicated sections of framing materials. Rot and decay are most commonly a symptom of a localized moisture presence, or a poorly ventilated area with high ambient moisture levels. It is recommended that sections of the framing with rot or decay be repaired as the wooden members have been weakened from their original state during installation. Minor amounts of rot may only need small repairs (or monitoring), while larger damage may warrant replacement of the damage wood. Additionally, some damage was noted on a section of the I-joist. As alterations of the i-joist top or bottom chord is not allowed (environmental or mechanical), further evaluation by a structural engineer would be necessary to determine if repair is warranted. If a repair is performed, any related documentation should be acquired and retained by the buyer for future use (e.g. when selling the home).

Note: The definitive source of the decay could not be determined. Further evaluation will be necessary to repair the cause of the deterioration to help deter future damage. Further damage may be found while making repairs.

Location: Front left - mechanical room

Task: Level 2 - Medium

Time: Level 2 - Recommended Repair



63. Rot



64. Rot



65. Rot



66. Rot


FLOORS \ Sheathing/Subflooring

37. Condition: • Water stains

Moisture stains were tested with a moisture meter and found to be currently dry, suggesting that the staining is the result of past moisture issues. Stained areas can be monitored for evidence of further moisture.

Location: Subfloor - mechanical room

Task: Level 1 - Minor

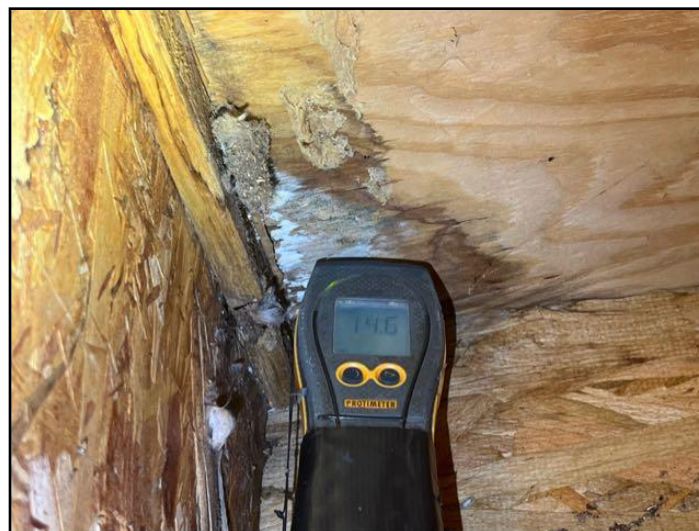

67. Water stains

ROOF FRAMING \ Sheathing (roof/attic)

38. Condition: • Water stains

Moisture stains were tested with a moisture meter and found to be currently dry, suggesting that the staining is the result of past moisture issues. Stained areas can be monitored for evidence of further moisture.

Location: Back Roof - Sheathing

Task: Level 1 - Minor



68. Water stains



69. Water stains

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Description

Service entrance cable and location: • Underground aluminum

Service size: • 2 circuits @ 200 Amps

Main disconnect/service box type and location: • Breakers - exterior wall

Distribution panel type and location: • Breakers - utility room • Breakers - garage

Distribution wire (conductor) material and type: • Copper - non-metallic sheathed • Aluminum to sub-panel

Smoke alarms (detectors): • Smoke alarms were present in all required areas. Modern standards call for smoke alarms in each sleeping area, in hallways outside of sleeping areas and at least one on each level of the home.

Limitations

Inspection limited/prevented by: • AFCIs (Arc Fault Circuit Interrupters) are not tested in a home that is occupied or where testing may cause damage. These should be tested monthly by the homeowner. • Smoke and carbon monoxide alarms are not tested where the system could potentially be monitored by an additional service company. • Smoke alarms are not removed from their mounting base. Analysis is determined by a visual only inspection. Smoke alarms are not evaluated when access is obstructed, could damage the property, or when dangerous or adverse situations are suspected.

Fuse block: • When present, fuse blocks are not removed during a home inspection to avoid accidental damage or shock hazard.

System ground: • Continuity not verified

Circuit labels: • The accuracy of the circuit index (labels) was not verified.

Not included as part of a building inspection: • Low voltage wiring systems and components • Testing of smoke and/or carbon monoxide alarms

Recommendations

ELECTRICAL PANELS \ System grounding



39. Condition: • Box not bonded to ground

The distribution panel box was not bonded to ground. When the bus bar is installed offset of the panel, bonding is commonly achieved with a bonding strap attached to the bus bar and panel enclosure, or the installation of a grounding screw when possible.


Location: Mechanical room, garage, service panel

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

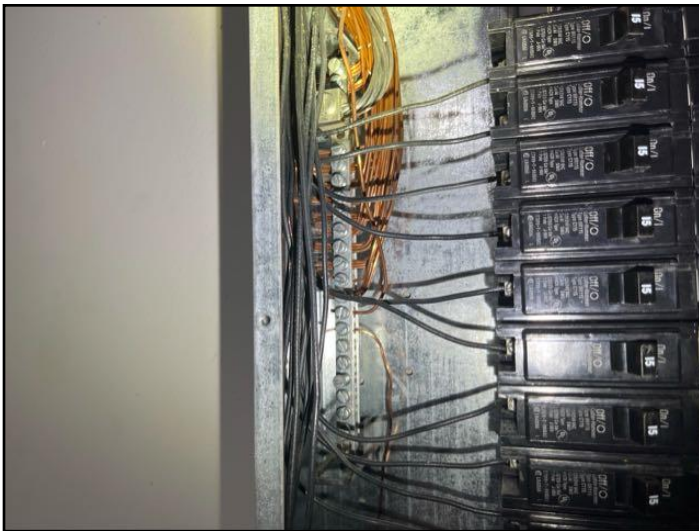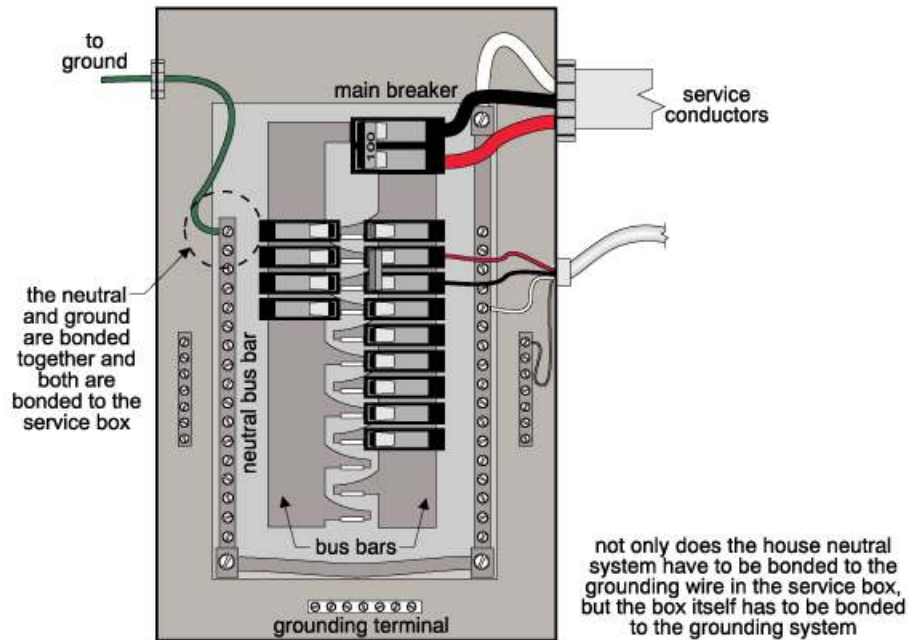Bond service box to ground

70. Box not bonded to ground

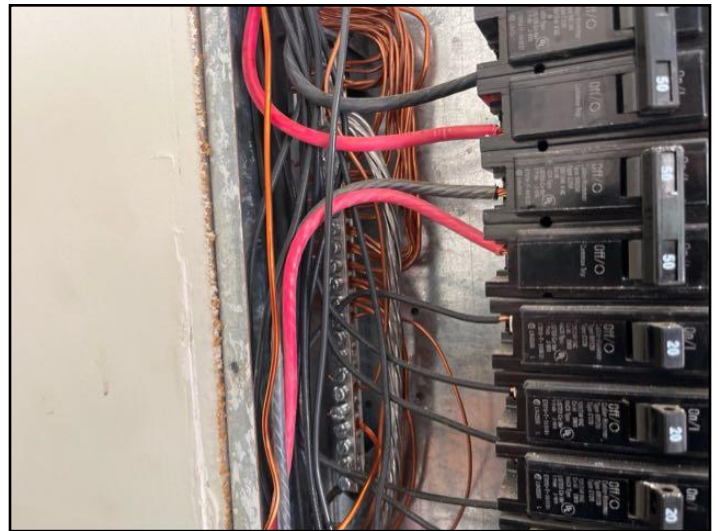

71. Box not bonded to ground



72. Box not bonded to ground



73. Box not bonded to ground

ELECTRICAL PANELS \ Panel wires**40. Condition:** • Damage

Wire(s) were damaged inside the indicated distribution panel. Damaged wires are potential shock and fire hazards. It is recommended that all damaged electrical components be repaired by a qualified electrician.

Location: Main service panel

Task: Level 2 - Medium

Time: Level 2 - Recommended Repair



74. Damage

41. Condition: • Double tapped neutrals


Electrical standards require that each neutral conductor be connected to a separate lug (hole) on the neutral bus. This is a commonly found defect due to a lack of clarity in electrical standards throughout the past few decades; however, this requirement has been in place since the mid-60s. Double tapping of neutrals can result in loose connection which are prone to overheating. Additionally, the incorrect practice of double-tapping neutrals makes it difficult for an electrician to

isolate a circuit. Repair by a licensed, qualified electrician is recommended.


Location: Distribution Panel - mechanical room, garage

Task: Level 2 - Medium

Time: Level 2 - Recommended Repair

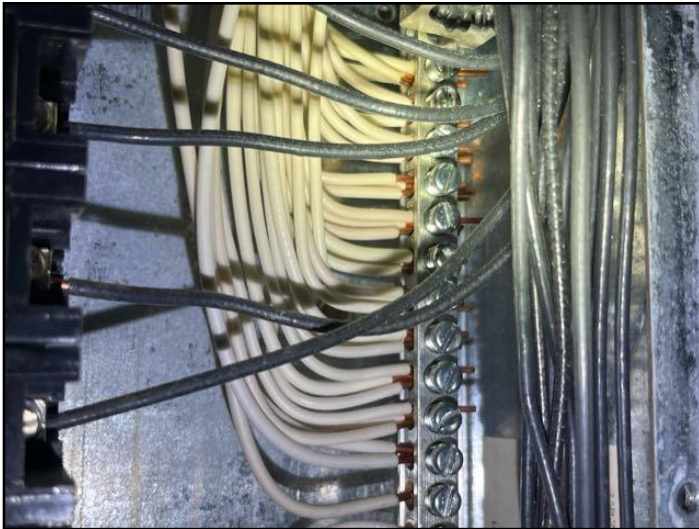

75. Double tapped neutrals

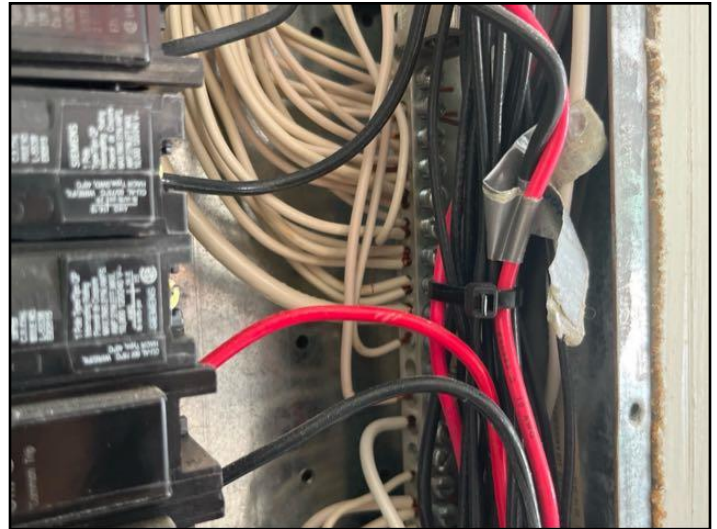

76. Double tapped neutrals

ELECTRICAL PANELS \ Auxiliary panel (subpanel)

42. Condition: • Neutral and ground wires bonded at auxiliary panel

Neutral and grounding conductors were bonded together within the auxiliary panel. Bonding should only occur in the panel which houses the main disconnect. It is recommended that bonding be corrected by a licensed, and qualified electrician.


Location: HVAC panels

Task: Level 2 - Medium

Time: Level 2 - Recommended Repair



77. Neutral and ground wires bonded at auxiliar...

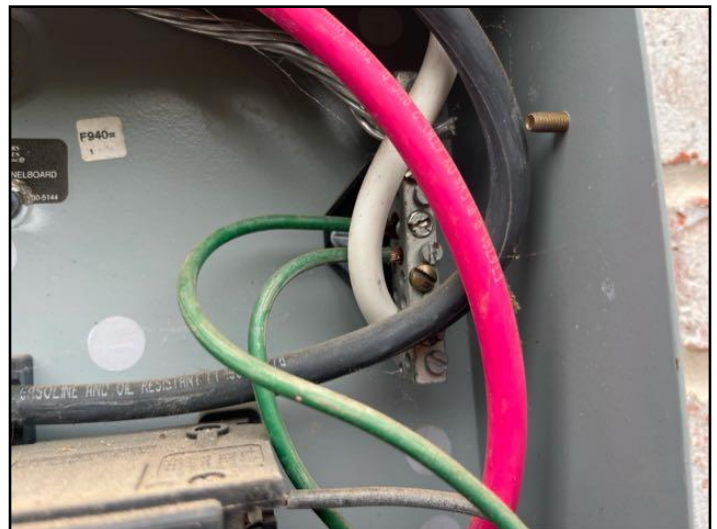

78. Neutral and ground wires bonded at auxiliar...


DISTRIBUTION SYSTEM \ Outlets (receptacles)**43. Condition:** • Reversed polarity

The polarity was reversed (hot and neutral swapped) on the indicated outlets. This can pose shock hazards to occupants when using certain appliances. It is recommended that the polarity be corrected by a qualified, licensed electrician.


Location: Foyer

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

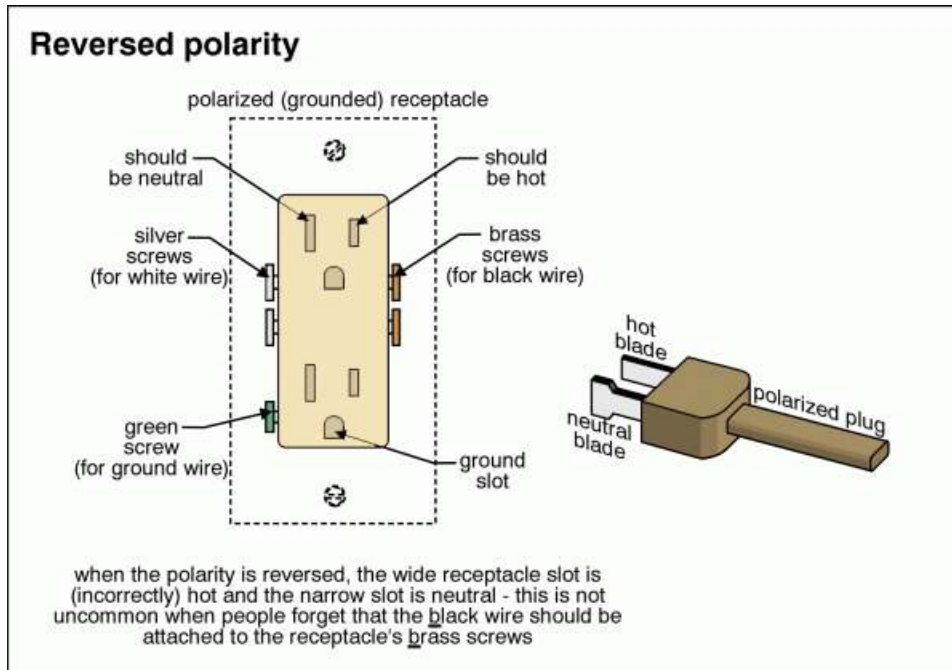

79. Reversed polarity

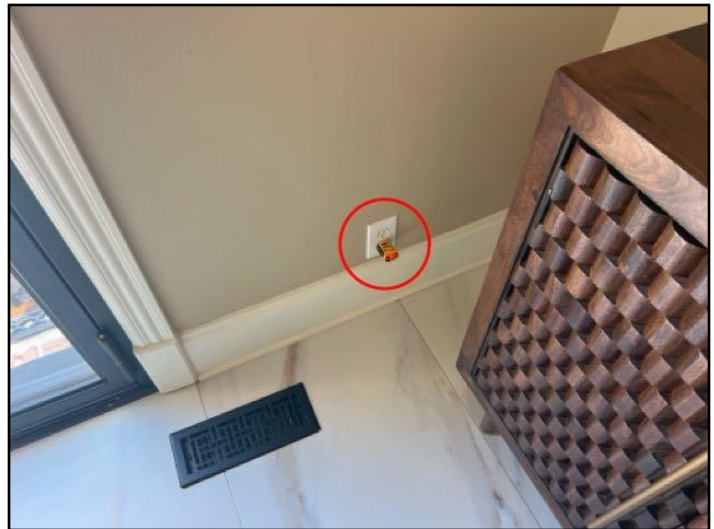

80. Reversed polarity

DISTRIBUTION SYSTEM \ Cover plates**44. Condition:** • Missing

A cover plate was missing from the indicated junction box. To prevent accidental contact with energized conductors, it is recommended that appropriate cover plates be installed.

Location: Basement Closet

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



81. Missing

HEATING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Description

General: • All readily openable access panels were inspected, as present

Furnace manufacturer:


- American Standard
- Manufactured in 2024 - electric air handler - located in the mechanical room



82. American Standard

83. American Standard

- American Standard
- Manufactured in 2023 - mid efficiency gas furnace - located in the mechanical room

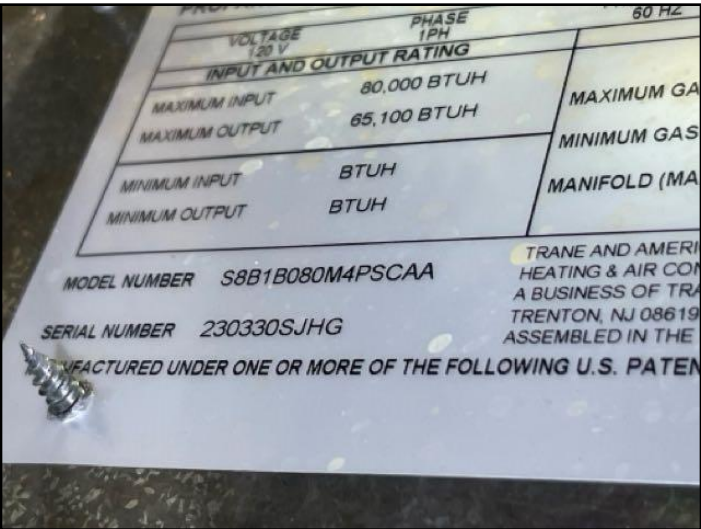

84. American Standard

85. American Standard

Furnace manufacturer: • Manufactured by Allied Air Enterprises - Manufactured in 2014 - Mid Efficiency Gas Furnace - Located in Right Kneewall Attic

HEATING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

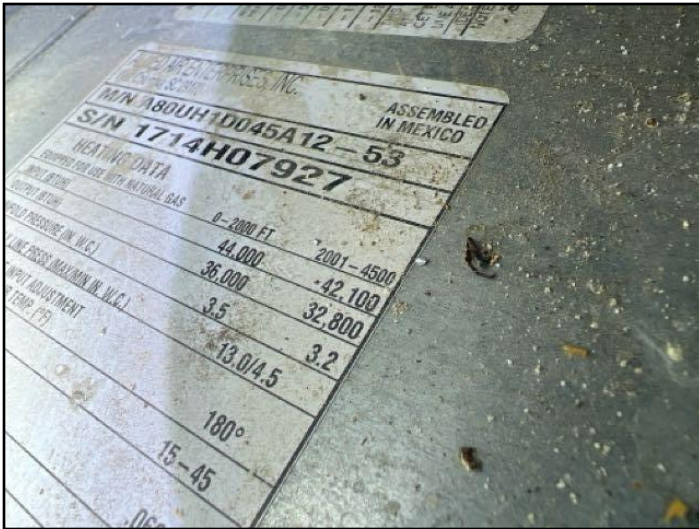


86.



87.

Furnace manufacturer: • Manufactured by Allied Air Enterprises - Manufactured in 2012 - Mid Efficiency Gas Furnace - Located in Upper Attic

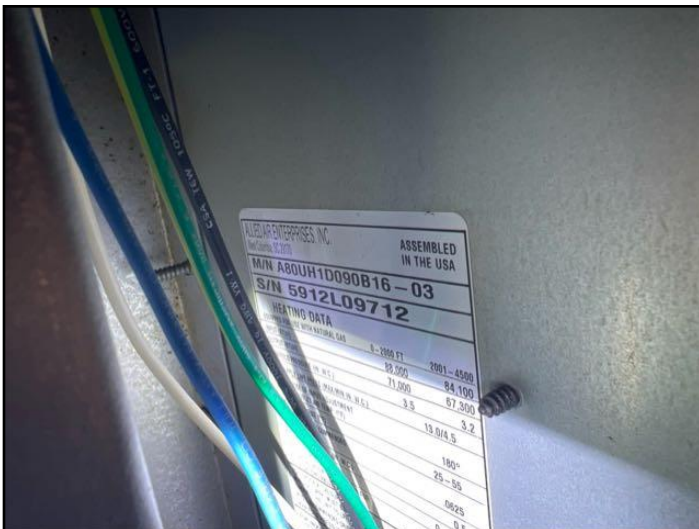

88.



89.

Heat distribution: • Ducts and registers

Supply temperature:

• Supply Temperature

HEATING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION


PLUMBING

INTERIOR

APPENDIX

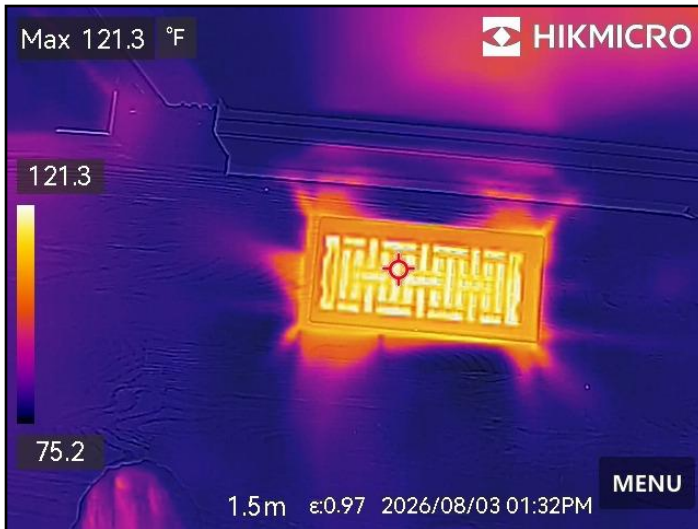


90. Supply Temperature - First Floor

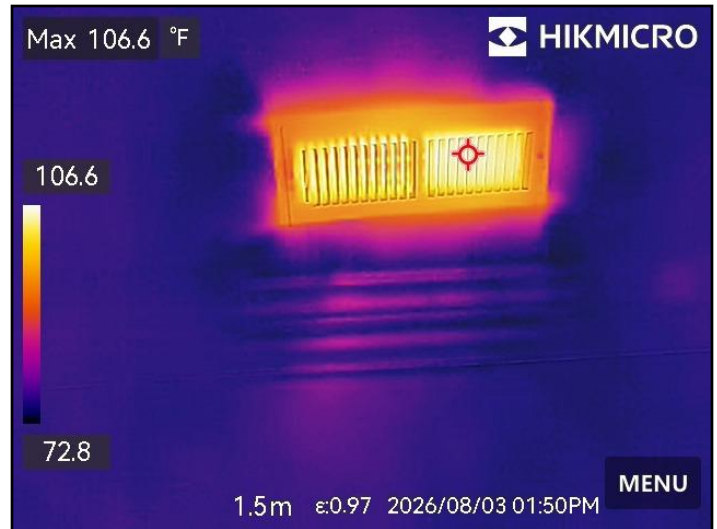

91. Supply Temperature - Primary Suite/Office



92. Supply Temperature - Second Floor

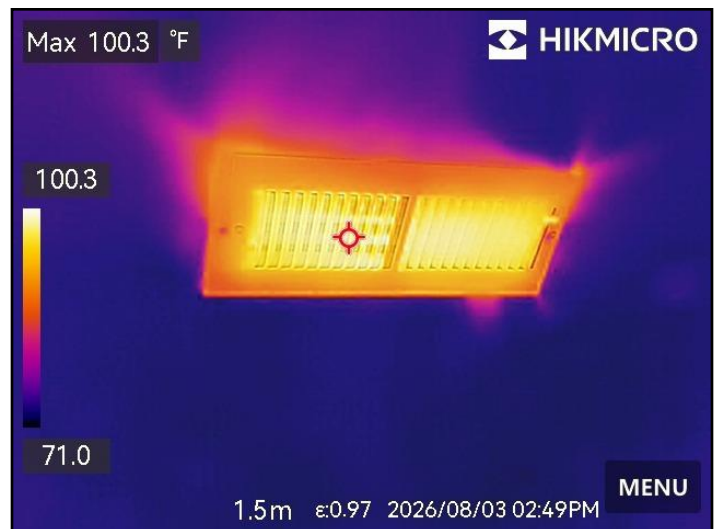

93. Supply Temperature - Basement

Fireplace/stove:

- Gas fireplace
Primary Bedroom

HEATING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



94. Gas fireplace

- Wood-burning fireplace
Family Room



95. Wood-burning fireplace

- Ventless (vent free) gas logs are not intended to be operated for extended periods of time and, therefore, should not be operated while occupants are sleeping. Additionally, ventless gas logs should not be used as a primary source of heat for the home.

Living Room, Basement

HEATING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



96. Ventless (vent free) gas logs are not...



97. Ventless (vent free) gas logs are not...

Chimney/vent: • Metal

Limitations

Inspection prevented/limited by: • Chimney interiors and flues are not inspected • The gas fireplace could not be tested. Inspectors should not operate gas valves, light pilot lights or ignite match-light appliances. The appliance was visually inspected for evidence of functionality issues. Any found defects can be found in the recommendations section. It is recommended that operation of the appliance be verified at the final walkthrough.

Heat exchanger: • Not accessible

Not included as part of a building inspection: • Humidifiers and dehumidifiers

Recommendations

GAS FURNACE \ Cabinet


45. Condition: • Rust

Rust was observed on the gas furnace. Although the area was currently dry, rust is an indication that there was a previous or intermittent moisture issue. It is recommended that the rust be removed and monitored for potential further buildup.


Location: Gas Furnace - mechanical room

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

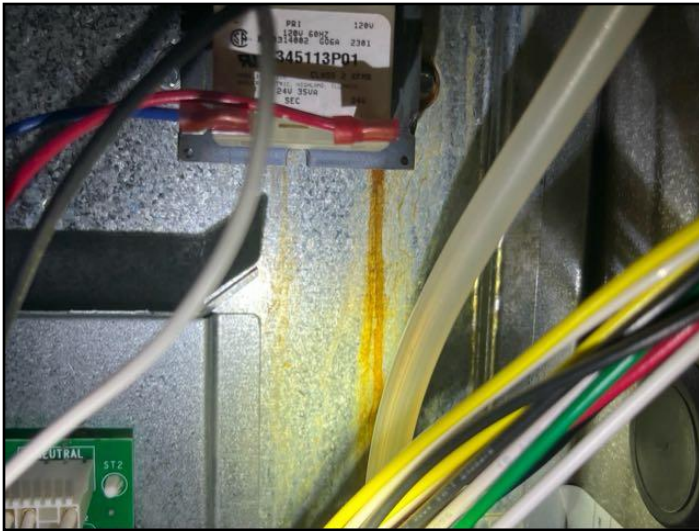

98. Rust

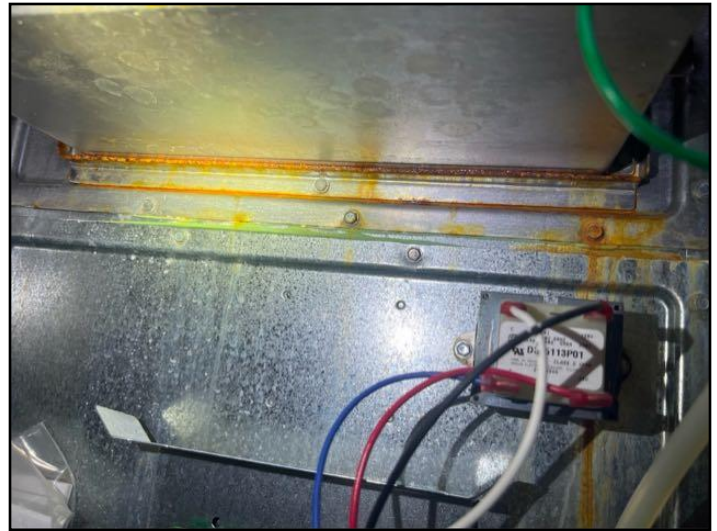

99. Rust

CHIMNEY AND VENT \ Inspect/sweep chimney

46. Condition: • Inspect (and/sweep if needed) before using

If the wood burning fireplace is to be returned to service as a wood burning fireplace, it is recommended to have the chimney inspected and swept, as needed, by a qualified chimney specialist before use. The National Fire Protection Agency (NFPA) recommends that a level II inspection be performed by a qualified chimney specialist prior to all real estate transactions. This inspection often includes video scoping of the interior of the flue to detect defects which would otherwise be hidden from view.

NOTE: Minor to moderate creosote levels were present in visible areas of the firebox, flue, and/or exterior masonry. Excessive creosote within the chimney is a fire safety hazard.

Location: Chimney

Task: Level 2 - Medium

Time: Level 1 - Consult with Chimney Specialist



100. Inspect (and/sweep if needed) before using

HEATING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

FIREPLACE \ Firebox

47. Condition: • Cracked masonry or refractory

Cracking was found in the refractory brick inside the fireplace. It is recommended that the wood burning fireplace be evaluated by a qualified, licensed chimney sweep prior to use.

Location: Family Room Fireplace

Task: Level 2 - Medium

Time: Level 2 - Further Evaluation Needed



101. Cracked masonry or refractory



102. Cracked masonry or refractory

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

- REPORT SUM
- ROOFING
- EXTERIOR
- STRUCTURE
- ELECTRICAL
- HEATING
- COOLING
- INSULATION
- PLUMBING
- INTERIOR
- APPENDIX

Description

General: • All readily openable access panels were inspected, as present

Manufacturer:

- American Standard
- Manufactured in 2024 - 2.5 ton - heat pump



103. American Standard

- American Standard
- Manufactured in 2023 - 4 ton - condensing unit



105. American Standard



104. American Standard



106. American Standard

- Manufactured by Airease - Manufactured in 2016 - 2 ton - condensing unit

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

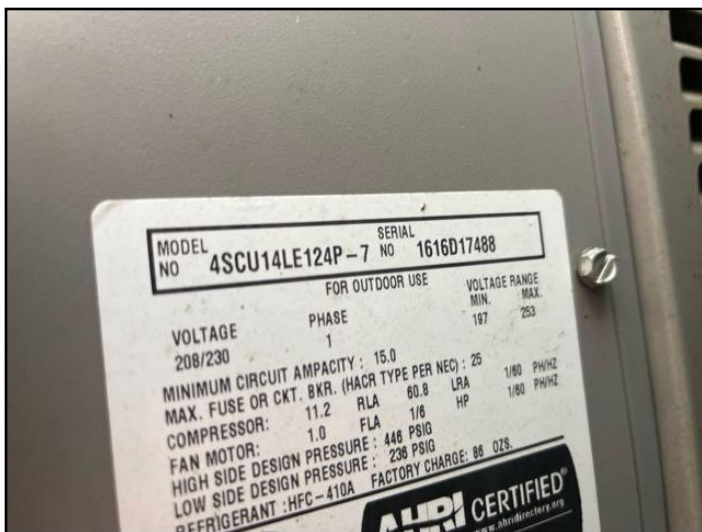

107. Airease



108. Airease

Manufacturer: • Manufactured by Airease - Manufactured in 2012 - 3 ton - condensing unit



109. Airease



110. Airease

Supply temperature:

• Supply Temperature

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION


PLUMBING

INTERIOR


APPENDIX



111. Supply Temperature - First Floor

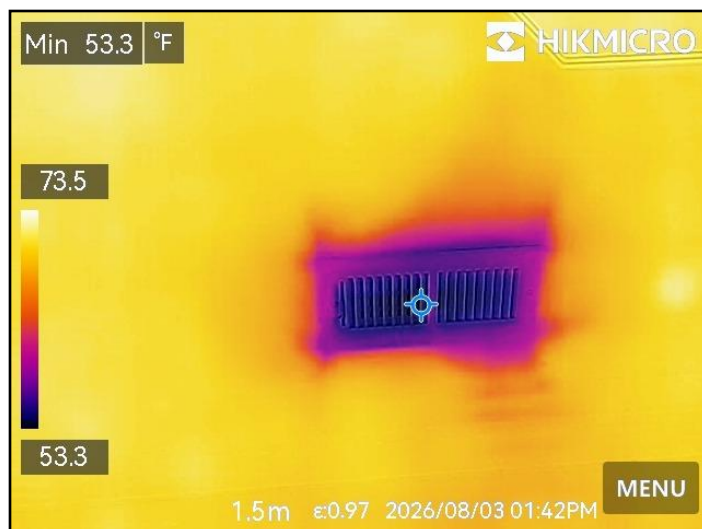

112. Supply Temperature - Primary Suite/Office

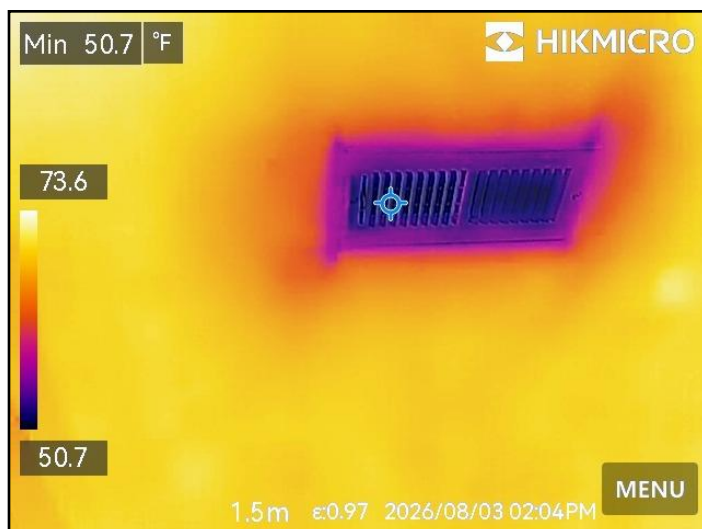

113. Supply Temperature - Second Floor



114. Supply Temperature - Basement

Return temperature:

- Return Temperature

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION


PLUMBING

INTERIOR


APPENDIX

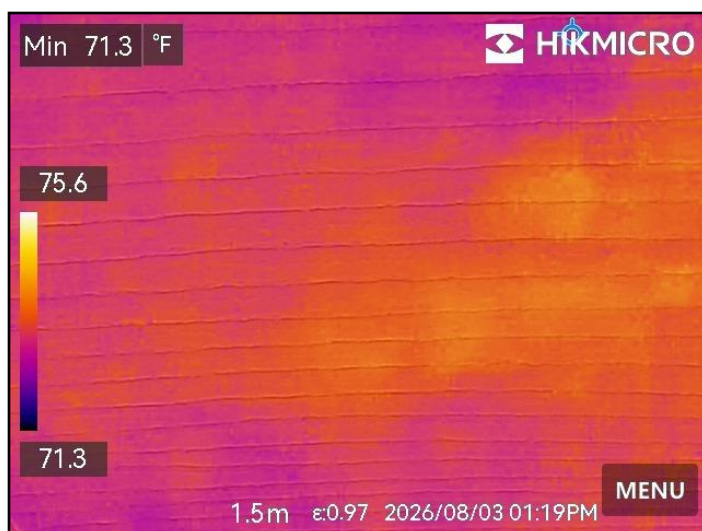


115. Return Temperature - First Floor

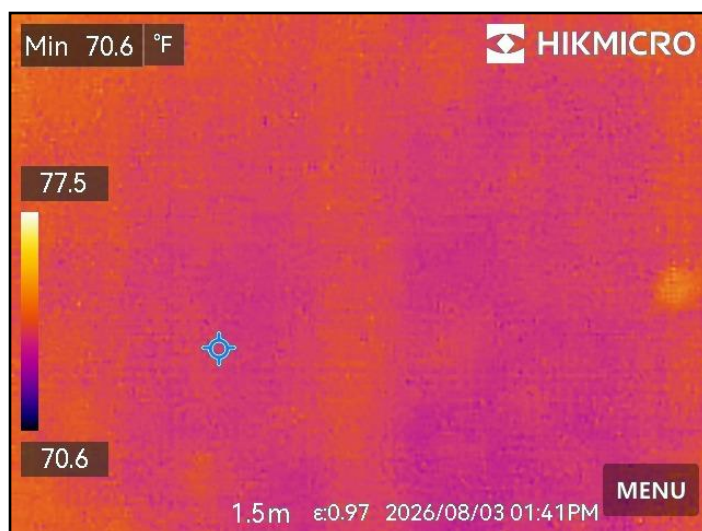

116. Return Temperature - Primary Suite/Office

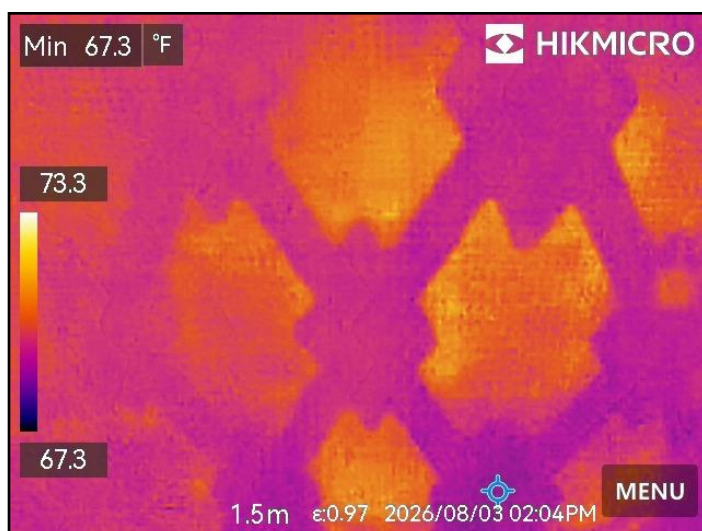

117. Return Temperature - Second Floor

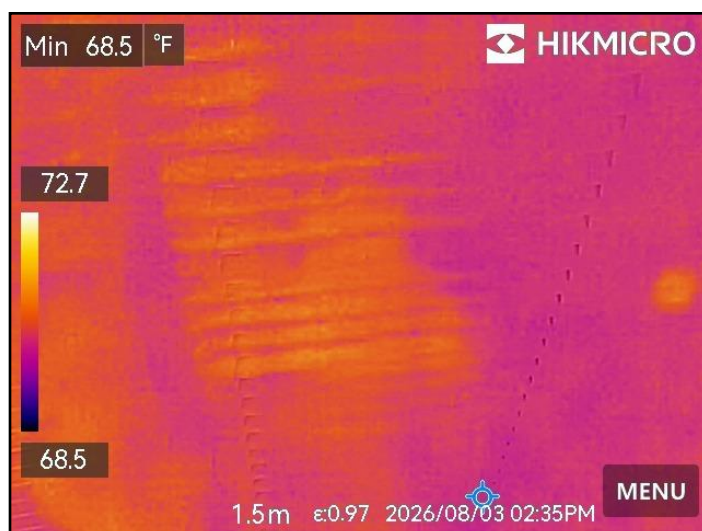

118. Return Temperature - Basement

Temperature difference across cooling coil: • Ideally the temperature difference, between return and supply, on a correctly functioning AC unit is usually between 14° and 22°

Limitations

Not part of a home inspection: • The calculations to verify that the HVAC system(s) are appropriately sized for the house is outside the scope of a home inspection. Further information on capacity requirements should be further evaluated by a qualified HVAC technician.

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Recommendations

COOLING - CONDENSING UNIT/HEAT PUMP \ General notes

48. Condition: • Wrong breaker size

The breakers servicing the HVAC equipment were incorrectly sized. Under-sizing the breakers supplying the condensing units can cause nuisance tripping, while over sized breakers may fail to protect the equipment in the event of a fault. It is recommended that the correct breakers be installed in accordance with the manufacturers recommendations.


Location: American standards

Task: Level 1 - Minor


Time: Level 2 - Recommended Repair



119. Wrong breaker size

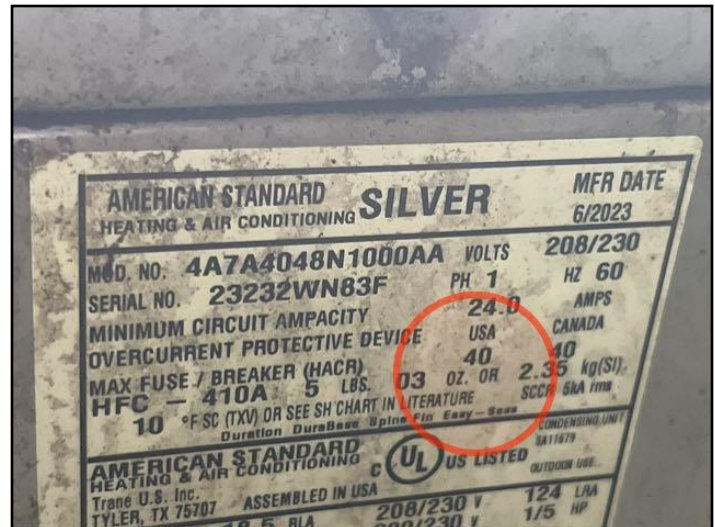

120. Wrong breaker size

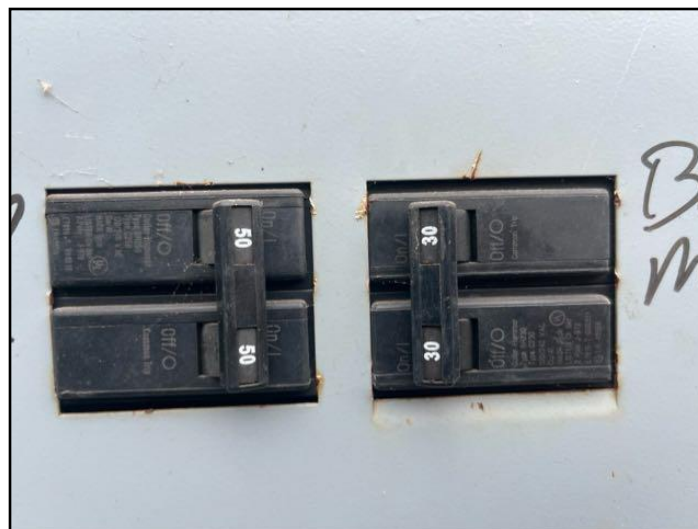

121. Wrong breaker size

COOLING - CONDENSING UNIT/HEAT PUMP \ Outdoor coil

49. Condition: • Dirty

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR


APPENDIX

The coils on the condensing unit were dirty. Coils are typically cleaned as part of annual service. This may indicate that service of the unit is overdue. Cleaning/service by a qualified HVAC technician is recommended.

Location: Condensing Unit

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

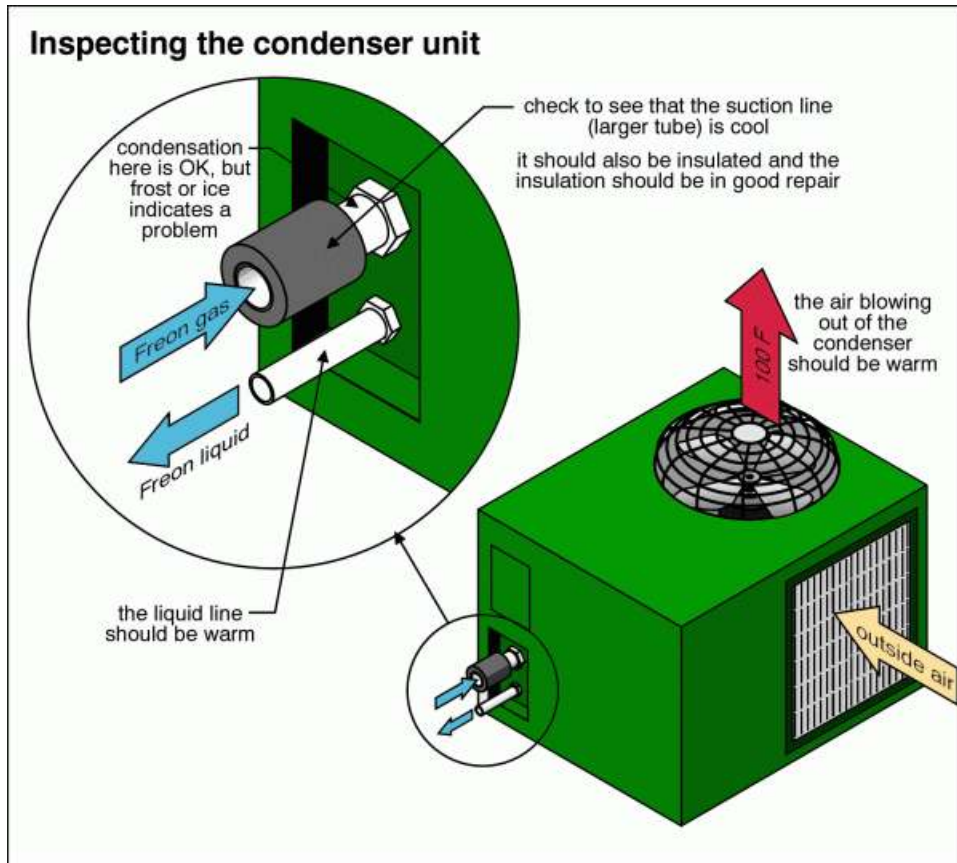

122. Dirty

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

50. Condition: • Poor clearance

Space was limited around the exterior HVAC unit. Clearance distances can vary based on manufacture specifications, but typically 12-24" of clearance is required around exterior units to allow adequate air flow through the coils. It is recommended that the issue be repaired to promote ample air flow.

Note: Lack of airflow can lead to overheating of the unit and reduced performance.

Location: Condensing units

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



123. Poor clearance

COOLING - CONDENSING UNIT/HEAT PUMP \ Condensate drain line

51. Condition: • Trap insulation needed

It is recommended that PVC traps of primary condensate drain lines be insulated in open air attics. Cold, uninsulated traps in unconditioned spaces often sweat during summer months, potentially creating moisture stains and/or drywall damage in nearby areas.

Location: Attic - air handler

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

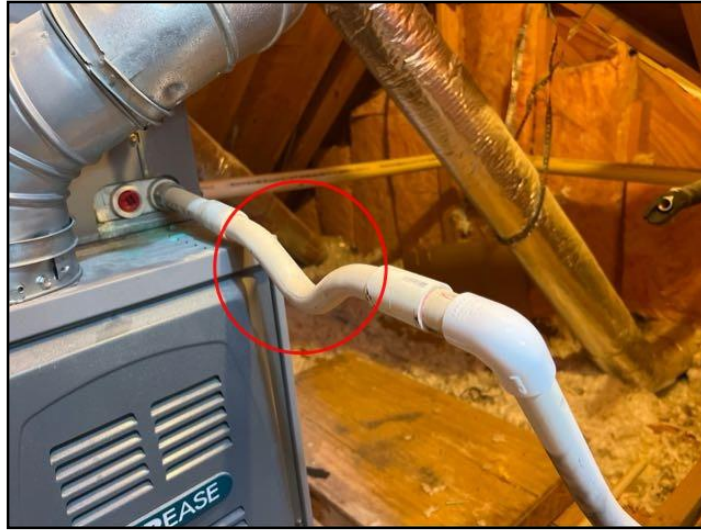

124. Trap insulation needed

52. Condition: • Discharge into waste pipe

Modern standards have specific termination rules for condensate discharge lines. Condensate drains should not directly connect to any plumbing drain, waste or vent pipe as the configuration can allow sewer gases to enter the drain line and appliance.

Note: The following are listed and approved locations for condensate drains; exterior, floor sink, floor drain, trench drain, mop sink, hub drain, standpipe (with air gap and p-trap), utility sink, and laundry sink

Location: Mechanical room

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



125. Discharge into waste pipe

COOLING - CONDENSING UNIT/HEAT PUMP \ Ducts, registers and grilles

53. Condition: • Dirty air filter

COOLING & HEAT PUMP

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

The air filter for the HVAC system was dirty. This can result in a reduction of efficiency of the system and, in extreme cases, cause the evaporator coils to freeze. The useful lifespan of air filters is dependent upon the quality of the filter, as well as the lifestyle of the homeowner. As a general rule, filters should be changed when visibly dirty.

Location: Return Air Plenums

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



126. Dirty air filter

INSULATION AND VENTILATION

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Description

Attic/roof insulation material: • Glass fiber

Attic/roof ventilation: • Roof and soffit vents

Wall insulation material: • Not Visible

Floor above basement/crawlspace insulation material: • Not visible

Mechanical ventilation system for building: • Radon Mitigation - Missing

Limitations

Attic inspection performed: • By entering attic, but access was limited

Roof ventilation system performance: • Not evaluated

Recommendations

ATTIC/ROOF \ Pull-down stairs/ladder


54. Condition: • Not insulated or weather-stripped.

The attic pull-down stairs were not insulated or weatherstripped. Improvements to this area would have a positive effect on energy efficiency.

Location: Attic - pulldown stairs

Task: Level 1 - Minor

Time: Level 0 - Optional Energy Efficiency Upgrade

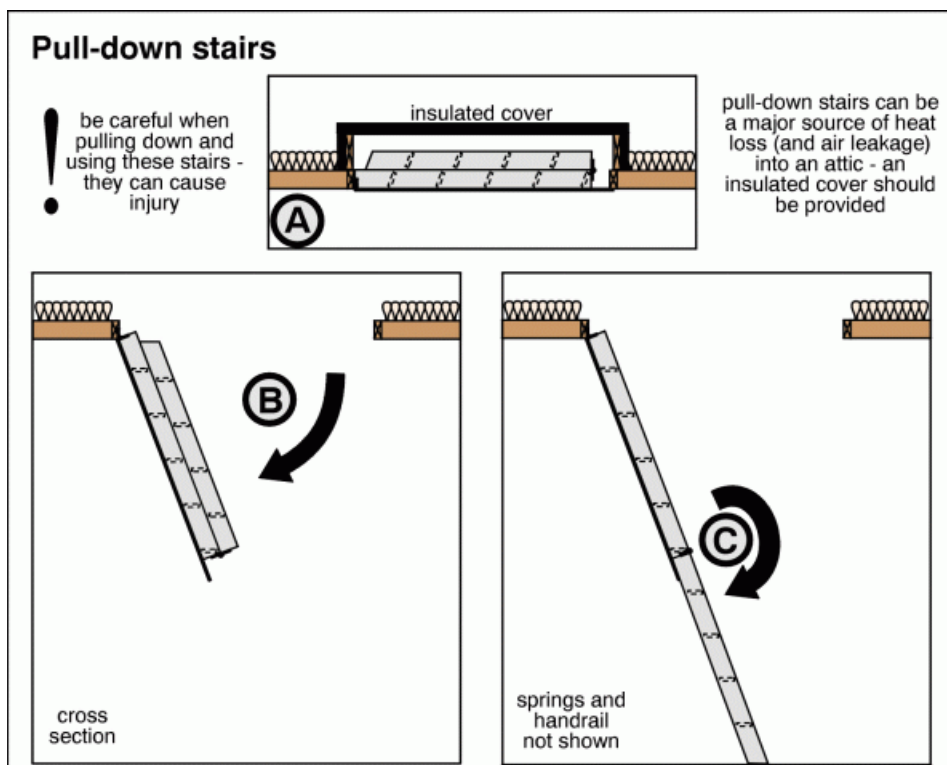

INSULATION AND VENTILATION

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

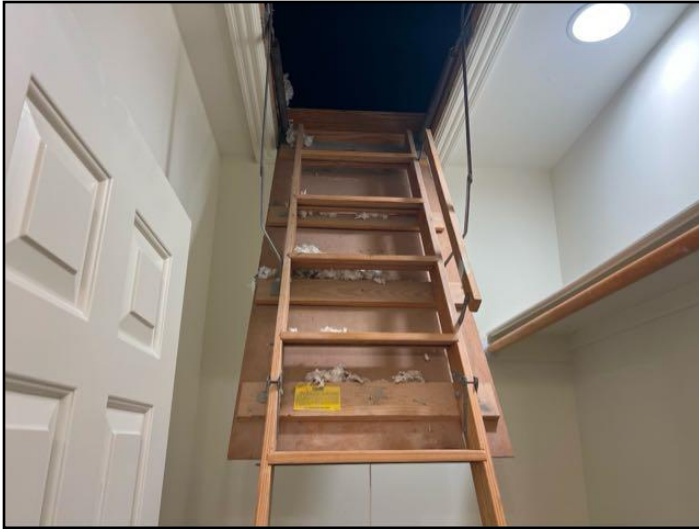

127. Not insulated or weather-stripped.



128. Not insulated or weather-stripped.

FLOORS \ Floors over unheated areas

55. Condition: • No insulation present

No insulation was visible below the flooring in the basement. The insulation of floors may not have been required when the home was originally built, and due to the temperate climate in middle TN, this is often considered an optional energy efficiency upgrade.

Note: The insulation of the rim joist will provide the largest increase in efficiency, while insulating the center, or field of the floor may only provide marginal improvement. In some situations fiberglass insulation may also inhibit air flow in crawlspaces and exacerbate moisture issues under the home.

Location: Basement/garage

Task: Level 2 - Medium



129. No insulation present

Description

General: • Hot Water Temperature




130. Hot Water Temperature

Water supply source (based on observed evidence): • Public

Service piping into building:

• Copper

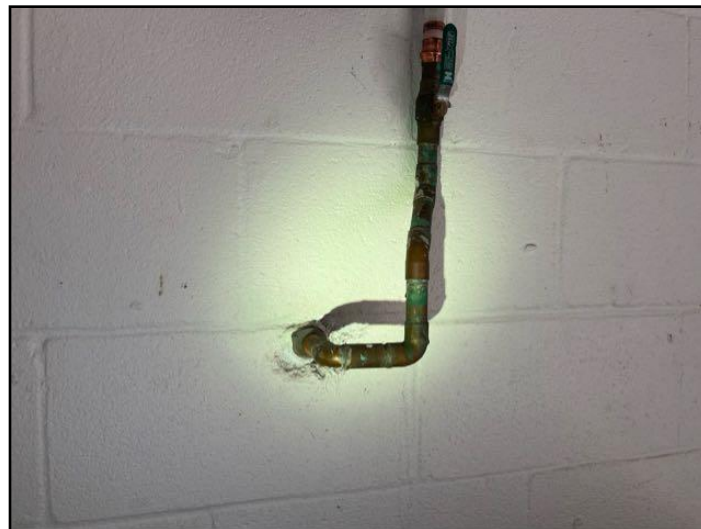

131. Copper

Supply piping in building: • Copper & plastic

Main water shut off valve at the:

• Garage

PLUMBING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING


COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

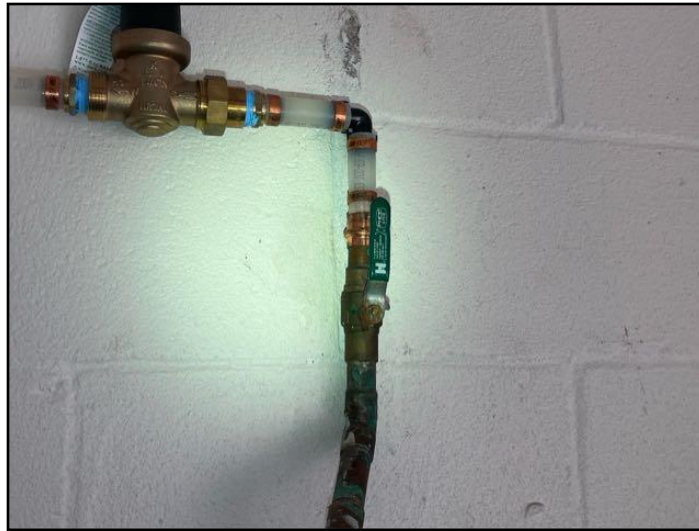

132. Garage

Water flow and pressure: • Functional

Water heater type: • Tank - Gas with natural draft vent

Water heater location: • Mechanical room

Water heater manufacturer:

• Rheem

Manufactured in 2021 - 50 gallon



133. Rheem

• State

Manufactured in 2023 - 50 gallon



134. State

Waste disposal system: • Public

Waste and vent piping in building: • PVC plastic

Pumps: • None found in accessible areas

Gas piping material: • Steel

Limitations

General: • Unable to access inter-wall or inter-floor areas to assess certain plumbing elements • Water heater thermostat not visible

Items excluded from a building inspection: • Water quality • Septic system • Isolating/relief valves & main shut-off valve • Concealed plumbing • Tub/sink overflows • Water heater relief valves are not tested • Landscape irrigation system • In the laundry area, the hot/cold water supply valves for the clothes washing machine were NOT tested or operated, regardless of whether an actual washing machine was present, due to the risk of water damaging interior contents or drywall, or causing incidental damage to the valve itself. We recommend obtaining verification from the current owner that the water supply is present and adequate.

Not included as part of a building inspection: • Washing machine connections • Water conditioning systems • Landscape irrigation systems

Recommendations

WATER HEATER \ Tank

56. Condition: • Rust

Minor rust was observed on the exterior of the tank of the water heater. Although no issues were noted regarding performance of the water heater, this may serve as an indicator that the unit is near the end of its useful lifespan.

Location: Water heater - Rheem

Task: Level 1 - Minor

Time: Level 1 - Budget for Replacement



135. *Rust*

WATER HEATER - GAS BURNER AND VENTING \ Venting system

57. Condition: • Initial vent rise inadequate

The exhaust vent above the water heater should rise a minimum of 12" before changing direction or joining a common vent.

Location: Water heaters

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



136. *Initial vent rise inadequate*

WASTE PLUMBING \ Traps - installation

58. Condition: • Flex pipe not recommended

The use of corrugated flex pipe is not recommended. This type of piping is prone to leakage and clogging. According to modern plumbing standards, drain piping materials should be smooth-walled with a uniform bore.

PLUMBING

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Location: First Floor Hall Bathroom

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



137. Flex pipe not recommended

Description

Major wall and ceiling finishes: • Drywall

Windows: • Fixed • Single/double hung

Glazing: • Double


Appliances:

- Refrigerator
- Cooktop




138. Cooktop

• Wall Oven (or Oven)

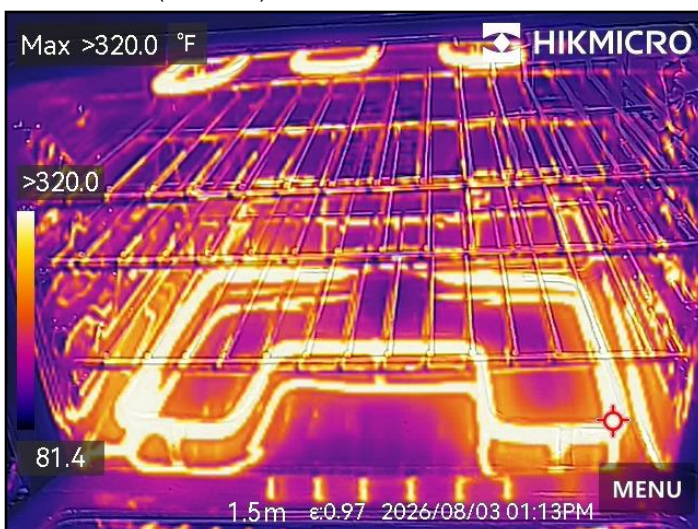

139. Upper Wall Oven

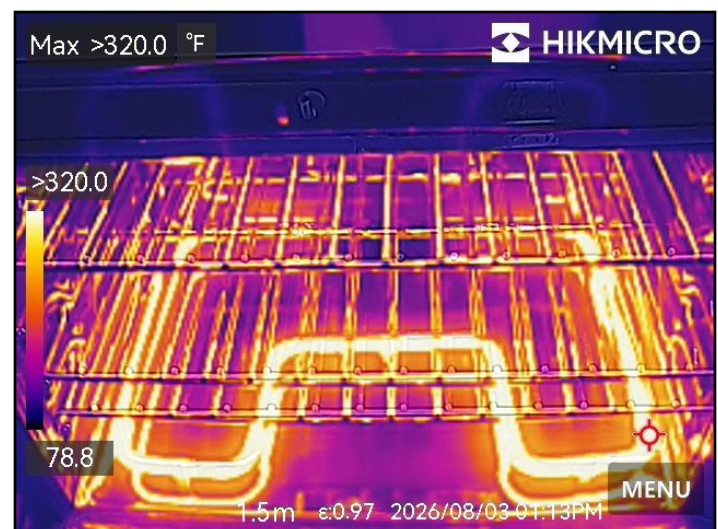

140. Lowere Wall Oven

- Dishwasher
- Waste disposal

Laundry facilities: • Washer • Hot/cold water supply • Dryer • Vented to outside • 120-Volt outlet • 240-Volt outlet •

INTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Waste standpipe

Laundry facilities: • Clothes dryer venting inspected, as present.

Kitchen ventilation: • Exhaust fan - Discharges to the exterior

Limitations

Inspection limited/prevented by: • Storage/furnishings • New finishes/paint • Storage in closets and cabinets / cupboards • Drop ceiling in basement • Finished basement


No access to:

- Areas behind washer / dryer
- Closets and cabinets / cupboards

First Floor Hall Closet



141. Closets and cabinets / cupboards

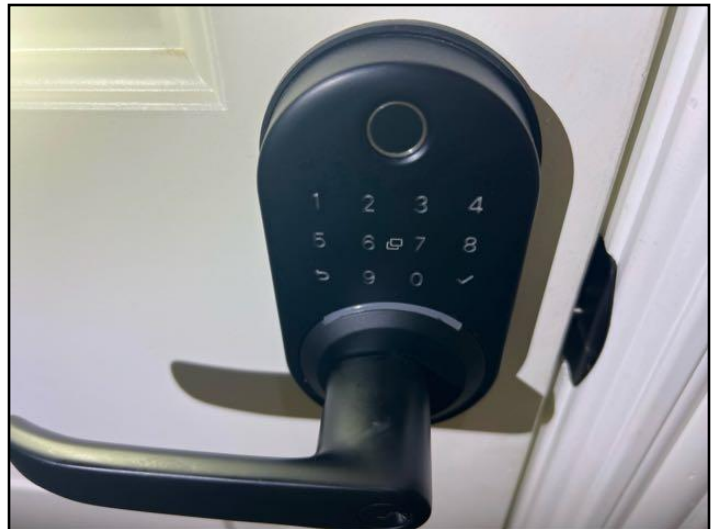

142. Closets and cabinets / cupboards

Not included as part of a building inspection: • Carbon monoxide alarms (detectors), security systems, central vacuum • Security systems and intercoms • Cosmetic issues • Perimeter drainage tile around foundation, if any • Aesthetics or quality of finishes • Floor coverings • Window treatments • Washer / Dryer not tested (moveable appliances are not part of the building inspection) • Refrigeration units (and ice machines) are not included in the standards of practice. Any information about the refrigeration unit(s) are included as a courtesy note.

Appliances: • Self-cleaning features on ovens not tested • Effectiveness of dishwasher drying cycle not tested • Appliances are not moved during an inspection

Recommendations

WINDOWS \ Glass (glazing)

59. Condition: • Lost seal on double or triple glazing

Possible condensation/fogging was present between the panes of windows. This is a cosmetic issue, as well as an energy efficiency issue.

Note: This defect was noted on approximately 1 window. It can be difficult to accurately diagnose the presence of this defect because symptoms only present themselves under certain conditions.

Location: Second Floor Front Right Bedroom

Task: Level 1 - Minor



143. *Lost seal on double or triple glazing*

WINDOWS \ Sashes

60. Condition: • Inoperable - egress present

Some of the windows throughout the home were unable to be opened with reasonable force. This is often due to sashes which have been painted shut, or lack of regular use. Minor repairs to the hardware or removal of the paint between the sashes and frames should restore functionality.

Note: At the time of the inspection, at least one operable window was present in each sleeping area.

Location: Basement

Task: Level 1 - Minor

INTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



144. Inoperable - egress present

WINDOWS \ Storms and screens

61. Condition: • Missing

Window screens were missing from areas of the home. The need for replacement of the screens is dependent upon the homeowner's intended usage of the windows.

Location: Locations Throughout House

Task: Level 1 - Minor



145. Missing

DOORS \ Doors and frames

62. Condition: • Does not latch properly

The indicated door(s) do not fully latch. Adjustment of the hardware should resolve the issue.

Location: Primary Bedroom Closet, Second Floor Front Left Bedroom Closet

Task: Level 1 - Minor

INTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



146. Does not latch properly



147. Does not latch properly

63. Condition: • Racked/out-of-square

The door was out of square inside the jamb. It is recommended that adjustments to the fit or hardware be made to restore normal function.

Location: Second Floor Jack & Jill Bathroom Linen Closet

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair



INTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



148. Racked/out-of-square

DOORS \ Hardware


64. Condition: • Loose

The door hinges on the indicator door were loose causing the door to bind and not latch properly. It is recommended the door be adjusted / repaired as necessary by qualified contractor.

Location: Second Floor Jack & Jill Bathroom

Task: Level 1 - Minor

Time: Level 2 - Recommended Repair

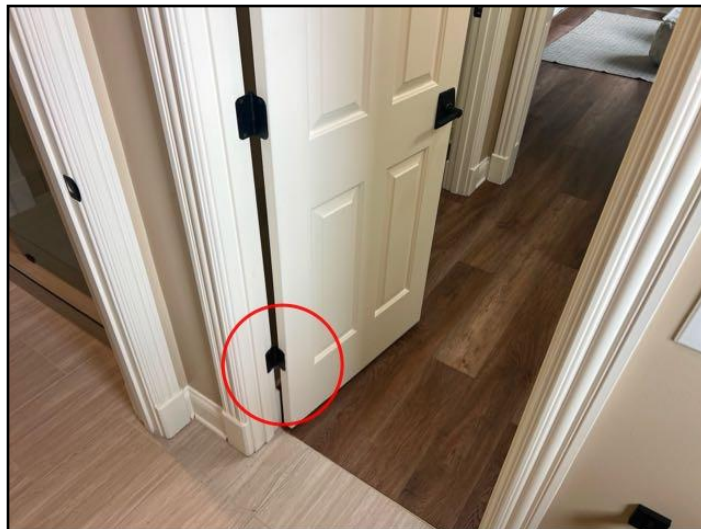

149. Loose

CARPENTRY \ Cabinets

65. Condition: • Damage to base (floor) - Dry

Evidence was present which suggests the occurrence of past moisture issues beneath the basin. The affected areas were tested with a moisture meter and found to be dry. No visible signs of current leakage were found.

INTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

Location: First Floor Hall Bathroom

Task: Level 1 - Minor



150. Damage to base (floor) - Dry



151. Damage to base (floor) - Dry



152. Damage to base (floor) - Dry

APPLIANCES \ Washing machine

66. Condition: • Drip pan missing

Although not required, it is a recommended practice to install drip pans (preferably plumbed to the exterior) beneath clothes washers to decrease the risk of damage to materials in the event of water spillage.

Location: Laundry Area

Task: Level 1 - Minor

INTERIOR

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX



153. Drip pan missing

END OF REPORT



The Human Factor

Dear Future Home-Owner,

Thank you again for bringing us into your home-buying process and letting us help you through this time. We hope as you go over the report and the house during your decision that you will keep a few practical things in mind. Simply, our inspectors are human and do make errors on rare occasion. As you consider the following factors, know that we will seek to make the situation right and your experience with us a successful one.

Intermittent or Concealed Problems:

Some problems can only be discovered by living in a house. They cannot be discovered during the few hours of a home inspection. For example, some shower stalls leak when people are in the shower, but do not leak when you simply turn on the tap. Some roofs and basements only leak when specific conditions exist. Some problems will only be discovered when carpets are lifted, furniture is moved or finishes are removed.

No Clues:

These problems may have existed at the time of the inspection, but there were no clues as to their existence. Our inspections are based on the past performance of the house. If there are no clues of a past problem, it is unfair to assume we should foresee a future problem.

We May Miss Some Minor Things:

It is subjective to say what can be considered a major or minor issue. It might seem inconsistent that some minor problems are identified, but not others. But the truth is that the minor problems that are identified are often discovered while looking for more significant problems. We note them simply as a courtesy. The intent of the inspection is not to find the *\$200 problems*; it is to find the *\$2,000 problems*. These are the things that affect people's decisions to purchase.

Contractor's Advice:

A common source of dissatisfaction with home inspectors comes from comments made by contractors. Contractor's opinions often differ from ours. Don't be surprised when three roofers all say the roof needs replacement, when we said that the roof would last a few more years with some minor repairs.

'Last Man In Theory' & 'Most Recent Advice' Theory:

While our advice represents the most prudent thing to do, many contractors are reluctant to undertake these repairs. This is because of the 'last man in' theory. The contractor fears that if he is the last person to work on the roof, he will get blamed if the roof leaks, regardless of whether or not the roof leak is his fault. Consequently, he won't want to do a minor repair with high liability, when he could re-roof the entire house for more money and reduce the likelihood of a callback. Additionally, it is natural for homeowners to believe the last bit of expert advice they receive, even if it is contrary to previous

DILIGENT, LLC | 6218 Vosswood Dr, Nashville, TN 37205 | 615.200.8220 | info@getdiligent.com



DILIGENT - Home Inspections

'The Human Factor'

advice. As home inspectors, we unfortunately find ourselves in the position of first man in and consequently it is our advice that is often disbelieved.

Most Contractors Do Not Understand the Standards of Practice

All of our inspections are conducted in accordance with the Standards of Practice of The National Association of Certified Home Inspectors. It specifically states what is included and excluded from the standard home inspection and most contractors do not fully realize the scope and limitations of a 'Standard Home Inspection'

Conditions during the Inspection

It is difficult for homeowners to remember the circumstances in the house at the time of the inspection. Homeowners seldom remember that it was snowing, there was storage everywhere or that the furnace could not be turned on because the air conditioning was operating, etc. It's impossible for contractors to know what the circumstances were when the inspection was performed.

The Wisdom of Hindsight

When the problem manifests itself, it is very easy to have 20/20 hindsight. Anybody can say that the basement is wet when there is 2 feet of water on the floor. Predicting the problem is a different story.

A Long Look:

If we spent half an hour under the kitchen sink or 45 minutes disassembling the furnace, we'd find more problems, too. Unfortunately, the inspection would take several days and would cost considerably more.

We're Generalists:

We are generalists; we are not directly specialists. The heating contractor may indeed have more heating expertise than we do. This is because we are expected to have heating expertise and plumbing expertise, structural expertise, electrical expertise, etc.

An Invasive Look:

Problems often become apparent when carpets or plaster are removed, when fixtures or cabinets are pulled out, and so on. A home inspection is a visual examination. We don't perform invasive or destructive tests.

Not Insurance:

In conclusion, a home inspection is designed to better your odds of not purchasing a home with serious issues. It is not designed to eliminate all risk. For that reason, a home inspection should not be considered an insurance policy. The premium that an insurance company would have to charge for a policy with no deductible, no limit and an indefinite policy period would be considerably more than the fee we charge. It would also not include the value added by the inspection.

Tennessee Standards of Practice

Standards of Practice		1
General Exclusions		3
Code of Ethics		14
Appendix A - Definitions		15

(1) Standards of Practice. This rule sets forth the minimum standards of practice required of licensed home inspectors.

(2) Definitions. See Appendix A

(3) Purpose and Scope.

(a) Home inspections performed according to this rule shall provide the client with an understanding of the property conditions at the time of the home inspection.

(b) Home inspectors shall:

1. Provide a written contract, signed by the client or the client's legal representative that shall:

(i) State that the home inspection will be in accordance with the Standards of Practice promulgated by the commissioner;

(ii) Describe what services shall be provided and their cost;

(iii) State that the home inspection report will not address the items set forth in parts (5)(a)4. and 5. of this rule; and

(iv) State, when an inspection is for only one or a limited number of systems or components, that the inspection is limited to only those systems or components.

2. Inspect readily visible and readily accessible installed systems and components listed in this rule; and

3. Submit a written report to the client that shall at a minimum:

(i) Describe those systems and components required to be described in paragraphs (7) through (16) of this rule;

(ii) State which systems and components designated for inspection in this rule have been inspected, and state any systems or components designated for inspection that were not inspected, and the reason for not inspecting;

(iii) State any systems or components so inspected that do not function as intended, allowing for normal wear and tear, or adversely affect the habitability of the dwelling;

(iv) State whether the condition reported requires repair or subsequent observation, or warrants further investigation by a specialist; and

(v) State the name, license number, and signature of the person conducting the inspection.

(c) This rule does not limit home inspectors from:

1. Reporting observations and conditions or rendering opinions of items in addition to those required in paragraphs (7) through (16) of this rule; or
2. Excluding systems and components from the inspection if requested by the client, and so stated in the written contract.

(4) General Limitations.

(a) This rule applies to structures that are intended to be or are in fact used as residences, consisting of from one to four (1-4) family dwelling units and their attached garages or carports.

(5) Required Reporting.

(a) The home inspection report shall include the following:

1. A report on any system or component inspected that, in the opinion of the home inspector, is significantly deficient;
2. A list of any systems or components that were designated for inspection in this rule but that were not inspected;
3. The reason a system or component listed in accordance with part (5)(a)2 was not inspected;
4. A statement that the report does not address environmental hazards, including:
 - (i) Lead-based paint;
 - (ii) Radon;
 - (iii) Asbestos;
 - (iv) Cockroaches;
 - (v) Rodents;
 - (vi) Pesticides;
 - (vii) Treated lumber;

(viii) Fungus;

(ix) Mercury;

(x) Carbon monoxide; or

(xi) Other similar environmental hazards.

5. A statement that the report does not address subterranean systems or system components (operational or nonoperational), including:

(i) Sewage disposal;

(ii) Water supply; or

(iii) Fuel storage or delivery.

(6) General Exclusions.

(a) Home inspectors are not required to report on:

1. Life expectancy of any component or system;
2. The cause(s) of the need for a repair;
3. The methods, materials, and costs of corrections;
4. The suitability of the property for any specialized use;
5. Compliance or non-compliance with adopted codes, ordinances, statutes, regulatory requirements or restrictions;
6. The market value of the property or its marketability;
7. The advisability or inadvisability of purchase of the property;
8. Any component or system that was not inspected;
9. The presence or absence of pests such as wood damaging organisms, rodents, or insects; or
10. Cosmetic damage, underground items, or items not permanently installed.

(b) Home inspectors are not required to:

1. Offer warranties or guarantees of any kind;
2. Calculate the strength, adequacy, or efficiency of any system or component;

3. Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely affect the health or safety of the home inspector or other persons;
4. Operate any system or component that is shut down or otherwise inoperable;
5. Operate any system or component that does not respond to normal operating controls;
6. Move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility;
7. Determine the effectiveness of any system installed to control or remove suspected hazardous substances;
8. Predict future condition, including but not limited to failure of components;
9. Project operating costs of components;
10. Evaluate acoustical characteristics of any system or component; or
11. Inspect special equipment or accessories that are not listed as components to be inspected in this rule.

(c) Home inspectors shall not:

1. Offer or perform any act or service contrary to law; or
2. Offer or perform engineering, architectural, plumbing, electrical or any other job function requiring a license in this state for the same client unless the client is advised thereof and consents thereto.

(7) Heating Systems.

(a) The home inspector shall inspect permanently installed heating systems including:

1. Heating equipment;
2. Normal operating controls;
3. Automatic safety controls;
4. Chimneys, flues, and vents, where readily visible;
5. Solid fuel heating devices;
6. Heat distribution systems including fans, pumps, ducts and piping, insulation, air filters, registers, radiators, fan coil units, convectors; and
7. The presence of an installed heat source in each room.

(b) The home inspector shall describe:

1. The energy source for the system; and
2. The heating equipment and distribution type.

(c) The home inspector shall operate the systems using normal operating controls.

(d) The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance.

(e) The home inspector is not required to:

1. Operate heating systems when weather conditions or other circumstances may cause equipment damage;
2. Operate automatic safety controls;
3. Ignite or extinguish solid fuel fires; or
4. Inspect:
 - (i) The interior of flues;
 - (ii) Fireplace insert flue connections;
 - (iii) Humidifiers;
 - (iv) Electronic air filters; or
 - (v) The uniformity or adequacy of heat supply to the various rooms.

(8) Cooling Systems.

(a) The home inspector shall inspect:

1. Central air conditioning and through-the-wall installed cooling systems including:
 - (i) Cooling and air handling equipment; and
 - (ii) Normal operating controls.
2. Distribution systems including:
 - (i) Fans, pumps, ducts and piping, dampers, insulation, air filters, registers, fan-coil units; and
 - (ii) The presence of an installed cooling source in each room.

(b) The home inspector shall describe:

1. The energy source for the system; and
2. The cooling equipment type.

(c) The home inspector shall operate the systems using normal operating controls.

(d) The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance.

(e) The home inspector is not required to:

1. Operate cooling systems when weather conditions or other circumstances may cause equipment damage;
2. Inspect window air conditioners; or
3. Inspect the uniformity or adequacy of cool-air supply to the various rooms.

(9) Electrical Systems.

(a) The home inspector shall inspect:

1. Service entrance conductors;
2. Service equipment, grounding equipment, main overcurrent device, and main and distribution panels;
3. Amperage and voltage ratings of the service;
4. Branch circuit conductors, their overcurrent devices, and the compatibility of their ampacities and voltages;
5. The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls;
6. The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures;
7. The operation of ground fault circuit interrupters; and
8. Smoke detectors.

(b) The home inspector shall describe:

1. Service amperage and voltage;

2. Service entry conductor materials;

3. The service type as being overhead or underground; and

4. The location of main and distribution panels.

(c) The home inspector shall report the presence of any readily accessible single strand aluminum branch circuit wiring.

(d) The home inspector shall report on the presence or absence of smoke detectors. If the smoke detector is an individual (stand alone) unit, the home inspector shall operate its test function. If the smoke detector is incorporated into an alarm system, the entity that monitors the alarm system should test the smoke detector.

(e) The home inspector is not required to:

1. Insert any tool, probe, or testing device inside the panels;

2. Test or operate any overcurrent device except ground fault circuit interrupters;

3. Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or

4. Inspect:

(i) Low voltage systems;

(ii) Security system devices, heat detectors, or carbon monoxide detectors;

(iii) Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or

(iv) Built-in vacuum equipment.

(10) Plumbing Systems.

(a) The home inspector shall inspect:

1. Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections;

2. Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage;

3. Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; and

4. Sump pumps.

(b) The home inspector shall describe:

1. Water supply and distribution piping materials;
2. Drain, waste, and vent piping materials;
3. Water heating equipment; and
4. The location of any main water supply shutoff device.

(c) The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance.

(d) The home inspector is not required to:

1. State the effectiveness of anti-siphon devices;
2. Determine whether water supply and waste disposal systems are public or private;
3. Operate automatic safety controls;
4. Operate any valve except water closet flush valves, fixture faucets, and hose faucets;
5. Inspect:
 - (i) Water conditioning systems;
 - (ii) Fire and lawn sprinkler systems;
 - (iii) On-site water supply quantity and quality;
 - (iv) On-site waste disposal systems;
 - (v) Foundation irrigation systems;
 - (vi) Bathroom spas, except as to functional flow and functional drainage;
 - (vii) Swimming pools;
 - (viii) Solar water heating equipment; or
6. Inspect the system for proper sizing, design, or use of proper materials.

(11) Structural Components and Foundations.

(a) The home inspector shall inspect structural components including:

APPENDIX

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

1. Foundation;

2. Floors;

3. Walls;

4. Columns or piers;

5. Ceilings; and

6. Roofs.

(b) The home inspector shall describe the type of:

1. Foundation;

2. Floor structure;

3. Wall structure;

4. Columns or piers;

5. Ceiling structure; and

6. Roof structure.

(c) The home inspector shall:

1. Probe structural components where deterioration is suspected;

2. Enter underfloor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected;

3. Report the methods used to inspect underfloor crawl spaces and attics; and

4. Report signs of water penetration into the building or signs of condensation on building components.

(12) Roof Coverings.

(a) The home inspector shall inspect:

1. Roof coverings;

2. Roof drainage systems;

3. Flashings;

4. Skylights, chimneys, and roof penetrations; and
5. Signs of leaks or abnormal condensation on building components.

(b) The home inspector shall:

1. Describe the type of roof covering materials; and
2. Report the methods used to inspect the roofing.

(c) The home inspector is not required to:

1. Walk on the roofing; or
2. Inspect attached accessories including solar systems, antennae, and lightning arrestors.

(13) Exterior Components.

(a) The home inspector shall inspect:

1. Wall cladding, flashings, and trim;
2. Entryway doors and a representative number of windows;
3. Garage door operators;
4. Decks, balconies, stoops, steps, areaways, porches and applicable railings;
5. Eaves, soffits, and fascias; and
6. Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building.

(b) The home inspector shall:

1. Describe wall cladding materials;
2. Operate all entryway doors and a representative number of windows;
3. Operate garage doors manually or by using permanently installed controls for any garage door operator;
4. Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and
5. Probe exterior wood components where deterioration is suspected.

(c) The home inspector is not required to inspect:

1. Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories;
2. Fences;
3. For the presence of safety glazing in doors and windows;
4. Garage door operator remote control transmitters;
5. Geological conditions;
6. Soil conditions;
7. Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities), except as otherwise provided in this rule;
8. Detached buildings or structures; or
9. For the presence or condition of buried fuel storage tanks.

(14) Interior Components.

(a) The home inspector shall inspect:

1. Walls, ceiling, and floors;
2. Steps, stairways, balconies, and railings;
3. Counters and a representative number of built-in cabinets; and
4. A representative number of doors and windows.

(b) The home inspector shall:

1. Operate a representative number of windows and interior doors; and
2. Report signs of water penetration into the building or signs of condensation on building components.

(c) The home inspector is not required to inspect:

1. Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors;
2. Carpeting; or
3. Draperies, blinds, or other window treatments.

(15) Insulation and Ventilation.

(a) The home inspector shall inspect:

1. Insulation and vapor retarders in unfinished spaces;
2. Ventilation of attics and foundation areas;
3. Kitchen, bathroom, and laundry venting systems; and
4. The operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control.

(b) The home inspector shall describe:

1. Insulation in unfinished spaces; and
2. The absence of insulation in unfinished space at conditioned surfaces.

(c) The home inspector is not required to report on:

1. Concealed insulation and vapor retarders; or
2. Venting equipment that is integral with household appliances.

(16) Built-In Kitchen Appliances.

(a) The home inspector shall inspect and operate the basic functions of the following kitchen appliances:

1. Permanently installed, dishwasher(s) through a normal cycle;
2. Range(s), cook top(s), and permanently installed oven(s);
3. Trash compactor(s);
4. Garbage disposal(s);
5. Ventilation equipment or range hood(s); and
6. Permanently installed microwave oven(s).

(b) The home inspector is not required to inspect:

1. Clocks, timers, self-cleaning oven functions, or thermostats for calibration or automatic operation;
2. Non built-in appliances; or

APPENDIX

9614 Deer Track Court, Brentwood, TN August 3, 2026

Report No. 23729

www.getdiligent.com

REPORT SUM

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

APPENDIX

3. Refrigeration units.

(c) The home inspector is not required to operate:

1. Appliances in use; or

2. Any appliance that is shut down or otherwise inoperable.

CODE OF ETHICS

- (1) Licensees shall discharge their duties with fidelity to the public, their clients, and with fairness and impartiality to all.
- (2) Opinions expressed by licensees shall only be based on their education, experience, and honest convictions.
- (3) A licensee shall not disclose any information about the results of an inspection without the approval of the client for whom the inspection was performed, or the client's designated representative.
- (4) No licensee shall accept compensation or any other consideration from more than one interested party for the same service without the consent of all interested parties.
- (5) No licensee shall accept or offer commissions or allowances, directly or indirectly, from other parties dealing with the client in connection with work for which the licensee is responsible.
- (6) No licensee shall express, within the context of an inspection, an appraisal or opinion of the market value of the inspected property.
- (7) Before the execution of a contract to perform a home inspection, a licensee shall disclose to the client any interest in a business that may affect the client. No licensee shall allow his or her interest in any business to affect the quality or results of the inspection work that the licensee may be called upon to perform.
- (8) Licensees shall not engage in false or misleading advertising or otherwise misrepresent any matters to the public.

Appendix A - Definitions.

The following definitions apply to this rule:

- (a) "Automatic safety controls" means devices designed and installed to protect systems and components from excessively high or low pressures and temperatures, excessive electrical current, loss of water, loss of ignition, fuel leaks, fire, freezing, or other unsafe conditions;
- (b) "Central air conditioning" means a system that uses ducts to distribute cooled or dehumidified air to more than one room or uses pipes to distribute chilled water to heat exchangers in more than one room, and that is not plugged into an electrical convenience outlet;
- (c) "Component" means a readily accessible and observable aspect of a system, such as a floor, or wall, but not individual pieces such as boards or nails where many similar pieces make up the component;
- (d) "Cosmetic damage" means superficial blemishes or defects that do not interfere with the functionality of the component or system;
- (e) "Cross connection" means any physical connection or arrangement between potable water and any source of contamination;
- (f) "Dangerous or adverse situations" means situations that pose a threat of injury to the home inspector, or those situations that require the use of special protective clothing or safety equipment;
- (g) "Describe" means report in writing a system or component by its type, or other inspected characteristics, to distinguish it from other systems or components used for the same purpose;
- (h) "Dismantle" means to take apart or remove any component, device or piece of equipment that is bolted, screwed, or fastened by other means and that would not be dismantled by a homeowner in the course of normal household maintenance;
- (i) "Enter" means to go into an area to inspect all visible components;
- (j) "Functional drainage" means a drain is functional when it empties in a reasonable amount of time and does not overflow when another fixture is drained simultaneously;
- (k) "Functional flow" means a reasonable flow at the highest fixture in a dwelling when another fixture is operated simultaneously;
- (l) "Inspect" means the act of making a visual examination;
- (m) "Installed" means attached or connected such that an item requires tools for removal;
- (n) "Normal operating controls" means homeowner operated devices such as a thermostat, wall switch, or safety switch;

(o) "On-site water supply quality" means water quality is based on the bacterial, chemical, mineral, and solids content of the water;

(p) "On-site water supply quantity" means the rate of flow of on-site well water;

(q) "Operate" means to cause systems or equipment to function;

(r) "Readily accessible" means approachable or enterable for visual inspection without the risk of damage to any property or alteration of the accessible space, equipment, or opening;

(s) "Readily openable access panel" means a panel provided for homeowner inspection and maintenance that has removable or operable fasteners or latch devices in order to be lifted off, swung open, or otherwise removed by one person; and its edges and fasteners are not painted in place. This definition is limited to those panels within normal reach or from a four-foot stepladder, and that are not blocked by stored items, furniture, or building components;

(t) "Readily visible" means seen by using natural or artificial light without the use of equipment or tools other than a flashlight;

(u) "Representative number" means, for multiple identical components such as windows and electrical outlets, one such component per room; and, for multiple identical exterior components, one such component on each side of the building;

(v) "Roof drainage systems" means gutters, downspouts, leaders, splashblocks, and similar components used to carry water off a roof and away from a building;

(w) "Shut down" means a piece of equipment or a system which cannot be operated by the device or control that a homeowner should normally use to operate it. If its safety switch or circuit breaker is in the "off" position, or its fuse is missing or blown, the home inspector is not required to reestablish the circuit for the purpose of operating the equipment or system;

(x) "Significantly deficient" means unsafe or not functioning;

(y) "Solid fuel heating device" means any wood, coal, or other similar organic fuel burning device, including but not limited to fireplaces whether masonry or factory built, fireplace inserts and stoves, woodstoves (room heaters), central furnaces, and combinations of these devices;

(z) "Structural component" means a component that supports non-variable forces or weights (dead loads) and variable forces or weights (live loads);

(aa) "System" means a combination of interacting or interdependent components, assembled to carry out one or more functions;

(bb) "Technically exhaustive" means an inspection involving the use of measurements, instruments, testing, calculations, and other means to develop scientific or engineering findings, conclusions, and recommendations;

(cc) "Underfloor crawl space" means the area within the confines of the foundation and between the ground and the underside of the lowest floor structural component.



DILIGENT



Mold Screening Report

PROPERTY ADDRESS:

9614 Deer Track Court
Brentwood, TN 37027

PREPARED FOR:

Jonathan and Madisyn De Jong

INSPECTION DATE:

August 3, 2026



INSPECTIONS - TESTING - CONSULTING



Observations & Conclusions

DILIGENT visited the property on the above listed date for the purposes of conducting a general screening for mold on behalf of the buyer. The testing was provided in conjunction with a home inspection, as the client had expressed concerns and was seeking to better understand any potential mold and/or indoor air quality issues. A set of air samples was collected onsite: (3) indoor air samples were collected within the building, and (1) sample was collected outside for a baseline comparison.

After testing the house, the indoor samples showed mold spores levels below the internal thresholds used by this company to identify potential active mold presence. Common means for identification of a potential mold contamination onsite, such as noting certain “water damage indicator” spores being present, was considered, and these samples did not contain these varieties in elevated levels.

It is the opinion of this inspector that the results and the current conditions do NOT appear to indicate that there is a mold contamination present, even though some mold spores were noted. We classify these sample results as **“Clear”**. An explanation of our classifications can be found later in this report, and an outline of specific recommendations is below.

Recommendations

Our examination of the situation (in light of the mold test results) has not shown anything out of the ordinary within the home and **no further mold testing or action is recommended at this time**. We understand that there is a lot of information here, but please feel free to contact us with any questions regarding the situation or any needed interpretation of the results.

If you have any questions, would like to learn about additional testing, or would like to schedule any services, please contact our office at 615.200.8220.

Chief Environmentalist

Michael Conrad II, CMI, CRT, ACI, EDI-3

A handwritten signature in dark ink, reading "Michael Conrad II", followed by a stylized flourish.

General Mold Screening Information

This mold testing service is being done in conjunction with a real estate home inspection, but ultimately is not a replacement for an in-depth mold investigation or assessment. This report outlines the protocol surrounding the air sampling, an interpretation of the laboratory-based results, and a set of recommendations on how best to proceed, given the results. This report is not intended to solely be representative of the mold presence onsite, but rather is attempting to speak to the invisible spectrum and the overall indoor air quality and condition. Additional commentary on the potential presence of mold in localized areas may be further spoken about in the home inspection report

There are no national, state-level, or local standards or metrics around acceptable levels of mold in the indoor environment. “Normal levels” of an outdoor mold profile vary widely from state to state, and region to region, and the effects of indoor mold presence on individual health has a high level of variability, as well. As such, this test has certain limitations in proving the past or predicting future circumstances, or even connecting issues to occupant health. Additionally, this test and any related visual, non-invasive inspection, may not be able to uncover information around the condition or presence of mold in hidden and unseen areas.

Testing in the colder months where outdoor temperatures may be lower than 32° is not recommended, as frozen sample media will not collect an accurate representation of the outdoor mold presence. Likewise, attempting to test for mold during or within 24hrs of rainfall, will almost certainly result in falsely low outdoor mold levels reflected in the results. During these occurrences, testing should only continue if absolutely necessary, eliminating the outdoor baseline sample in the sample set, and the interpretation of the results is subject to a wide margin for potential error, by no fault of the inspector.

Based on Indoor Environmental Standards Organization (IESO) standards, a significantly high level of mold growth is defined as a factor of ten times higher in a suspect area when compared to a non-suspect area. IESO references the *Bioaerosols: Assessment and Control* book published by the American Conference of Governmental Industrial Hygienists (ACGIH). Additionally, DILIGENT prescribes to the “statistical method” of interpretation, introduced by Dr. Joe Spurgeon, as a way to interpret individual bioaerosol test results. Since the indoor environment is subject to rapidly changing conditions, even with a “clear” diagnosis this report is not a certification or guarantee that the indoor environment is free from mold, moisture, or contributing conditions, but rather an interpretation of the lab results from the samples taken on the specific above date.

All samples were examined by EMSL Analytical, which is a nationally accredited laboratory in microbiology. Internal protocols are based in NIOSH and ASTM standards, consisting of a visual examination of both the affected and non-affected areas of the residence along with the bioaerosol sampling. *Diagnostic Equipment Used - Zefon Bio-Pump Plus Air Sampling Pump, Air-O-Cell Cassettes, FLIR Thermal Imager, and GE Protimeter SurveyMaster Moisture Meter.*

Interpretation Categories for Spore Trap Mold Testing

Clear - The laboratory sample results showed “normal” indoor levels of common molds that are in line with or below the baseline comparison sample, and below the total spore count thresholds commonly used by mold consultants when identifying concerning mold levels. A “Clear” result may likely indicate low presence of xerophilic or “common indoor molds”, and virtually no presence of hydrophilic or “water damage indicator molds” that are commonly present in bulk water problems and advanced mold growth scenarios. The onsite inspection showed little to no areas of concern related to mold or mold-causing-circumstance, and support the sample results. A client should have a high level of confidence that a “Clear” result indicates that the home in question is unlikely to have a current mold contamination onsite.

Borderline Clear - The laboratory sample results showed relatively “normal” levels of common indoor molds, that hover around the baseline comparison sample. Total spore counts (or individual spore counts) may be at or near the threshold of concern, though a certain ambiguity may be present. It is likely that these results contain mostly xerophilic (“common indoor molds”), though a few hydrophilic (“water damage indicator molds”) spore types in low levels may be present. It is possible that these hydrophilic molds may be outliers, as the onsite inspection showed little to no areas of concern related to mold or mold-causing-circumstance, and remove any latent concern in the ambiguity of the results. A client can have confidence that a “Borderline Clear” result indicates that the home in question is unlikely to have a mold contamination onsite, though further testing may be required in certain cases.

Borderline Concerning - The laboratory sample results showed levels in one or more spore categories that were at or above the baseline comparison sample. Additionally, total spore counts (or even individual spore counts) may be at or above the threshold of concern commonly used by mold consultants when identifying concerning mold levels. These results may have high levels of one spore type, or moderate levels of many spore type, or some combination of spore type and quantity that is concerning, however a certain clarity in what is occurring onsite may be absent. The onsite inspection may not fully support the results, or there may be areas in question to the onsite inspector that may or may not be connected. The combination of results and onsite inspection may have ambiguity, but the overall feeling is that there may be a mold related issue onsite. A client should consider the recommendation for further testing, to better clarify whether there is an actual mold issue, and cannot reasonably be completely sure that the house in question is free from an active mold presence.

Concerning - The laboratory sample results may show high levels, either of individual spore counts, of total spore counts, and it is likely that indoor levels are greater than the baseline comparison sample. Hydrophilic (“water damage indicator molds”) are likely present, but extremely high levels of xerophilic molds may indicate a “Concerning” result to the consultant. The onsite inspection may or may not support the sample results, but the levels of spores are likely high enough to warrant concern all on their own. A client may have reasonable confidence that there is a mold related issue onsite, and further testing should be pursued to better understand the exact location and clarify the nature of the potential mold contamination.

Recommended Mold Remediation and PRV Protocol

Though differing opinions and methods may exist in the mold remediation and restoration industry, the *Institute of Inspection, Cleaning and Restoration Certification* (IICRC) is the leading authority on the ideal methods for mold remediation, and the **IICRC S520 guide** written by this organization outlines and gives definition to what must be done before, during, and after a mold contamination.

In short, any “mold remediation” recommended in this report shall refer to Section 4 of the IICRC S520, and shall be defined as **“the physical, abrasive removal of the fungal presence, and the application of a biocide”**. Any companies offering to “treat”, “spray” or “encapsulate” a mold presence shall NOT be considered qualified, and are regarded as unfamiliar or noncompliant with the S520. The presently used phrase, “fungal treatment”, may indicate a wide range of services that should NOT be considered mold remediation. No current chemical, solution, or encapsulant exists that can fully eliminate mold simply by spraying or applying it. In addition, proper moisture management techniques are rarely offered by these companies who are offering false alternatives to true mold remediation.

The action of remediating a mold contamination by a professional is intended to follow five steps, laid out in Section 4:

- **Assessment** *(Preliminary work by an independent Indoor Environmental Professional, or IEP, with no affiliation with the remediator, intended to identify source and cause, and define the proper steps and protocol for cleaning that should be followed.)*
- **Control** *(May include moisture reduction/elimination, as well as containment practice.)*
- **Removal** *(The physical, abrasive removal of the fungal presence, and the application of a biocide.)*
- **Prevention** *(Employing long term moisture management techniques to reduce the likelihood of reoccurrence or recontamination.)*
- **Verification** *(Ensuring remediation work is done properly.)*

This important final step of the mold remediation process is ensuring, by way of a 3rd party IEP, that the remediation and cleaning work has been done correctly. This is done by way of a **Post-Remediation Verification (PRV)** and may or may not be included along with the costs of your remediation. A proper PRV will include a visual examination of the remediated areas, an assessment of cleanliness, lab-based mold sampling, and a commentary on moisture management techniques.

The IICRC S520 Standard defines that an independent IEP must be “qualified by knowledge, skill, education, training, certification, and experience”, and that while a qualified remediator may develop “preliminary determinations or scopes of work”, that same remediator **MUST NOT** perform his own PRV, but rather that a 3rd party IEP should conduct the PRV.

It should be noted that any mold remediation should ALWAYS be coupled with moisture management efforts to ensure that reoccurrence does not occur. Simple mold remediation, subjected to the same prior circumstance will likely result in new mold growth within 18-24 months.

How to Successfully Hire a Mold Remediation Company

This mold screening report may be the result of DILIGENT having been called out to consult or assess around moisture and/or mold issues within (or under) a structure. This inspection or pre-assessment is an important and necessary step to ensure that the situation is properly diagnosed before any action or remediation work is to take place. The ideal scope of work and recommendations provided herein are a prescription or a guide to help ensure that any mold remediation work that follows is done properly to IICRC S520 remediation protocol, creating the highest opportunity for long term success.

In this region, there are many contractors who may offer a similar sounding product/service, or issue assurances that they can remedy the issue. Because there are so many different products, methods, and competing opinions among those that perform the work, it is important to follow the guidance and recommendations of an Independent Environmental Professional (IEP) like our sister company, Riverside Environmental.

Recognizing that the number of contractors who provide this type of proper remediation work are harder to find, we have compiled a list of contractors below who are experienced, qualified, and follow a strict IICRC S520 remediation protocol. Please feel free to contact them, even offering up this report as a proposed scope of work for them to provide a quote.

Blue Chip Restoration

Don Knarr

615.566.2390

don@bluechiprestoration.com

Best Option Restoration

Chris Harrison

615.648.4795

chris@BORofSENashville.com

Remember, a qualified and legitimate remediation company will always recommend that a 3rd party evaluation (a post-remediation verification or PRV) after their remediation work is complete. This is a liability limiting step for them, provides proof that the work has been done correctly, and help enforce the warranty that a company will often provide. Additionally, a trustworthy company can always be recognized by their recommendation of proposed work. Proper mold remediation ALWAYS includes moisture management, and if the water or moisture problem is not remedied, then the mold growth will simply return in a short period of time. Any remediation company or restoration company that does NOT recommend moisture management (which may include invasive repair, crawlspace encapsulation, etc.) is not a qualified or trustworthy resource. Any and all questions, may be directed to DILIGENT at 615.200.8220 for further assistance or consultation.



EMSL Analytical, Inc.

2500 Gateway Centre Blvd., Suite 600 Morrisville, NC 27560

Tel/Fax: (919) 465-3900 / (919) 465-3950

<http://www.EMSL.com> / raleighlab@emsl.com

EMSL Order: 292604147

Customer ID: DLGE34

Customer PO:

Project ID:

Attention: Michael Conrad
Diligent llc
2708 Fortland Dr.
Nashville, TN 37206

Phone: (615) 200-8220

Fax:

Collected Date: 08/03/2026 - 08/04/2026

Received Date: 08/07/2026 03:06 PM

Analyzed Date: 08/07/2026

Project: 9614 Deer Track Court

Test Report: Air-O-Cell™ Analysis of Fungal Spores & Particulates by Optical Microscopy (Methods MICRO-SOP-201, ASTM D7391)

Lab Sample Number: Client Sample ID: Volume (L): Sample Location:	292604147-0001 4243 2257 75			292604147-0002 4243 2250 75			292604147-0003 4243 2268 75		
	Exterior			Living Room			Foyer		
Spore Types	Raw Count†	Count/m³	% of Total	Raw Count†	Count/m³	% of Total	Raw Count†	Count/m³	% of Total
Alternaria (Ulocladium)	-	-	-	-	-	-	-	-	-
Ascospores	45	1900	4.8	2	80	27.6	2	80	5.8
Aspergillus/Penicillium++	4	200	0.5	-	-	-	4	200	14.5
Basidiospores	127(826)	34900	88.3	4	200	69	16	680	49.3
Bipolaris++	2	80	0.2	-	-	-	-	-	-
Chaetomium++	-	-	-	-	-	-	-	-	-
Cladosporium	41	1700	4.3	-	-	-	1	40	2.9
Curvularia	3	100	0.3	1	10*	3.4	3	100	7.2
Epicoccum	-	-	-	-	-	-	-	-	-
Fusarium++	-	-	-	-	-	-	-	-	-
Ganoderma	1	40	0.1	-	-	-	-	-	-
Myxomycetes++	1	10*	0	-	-	-	2	80	5.8
Pithomyces++	-	-	-	-	-	-	-	-	-
Rust	-	-	-	-	-	-	-	-	-
Scopulariopsis/Microascus	-	-	-	-	-	-	-	-	-
Stachybotrys/Memnoniella	-	-	-	-	-	-	-	-	-
Unidentifiable Spores	-	-	-	-	-	-	-	-	-
Blakeslea/Choanephora	11	460	1.2	-	-	-	4	200	14.5
Cercospora++	3	100	0.3	-	-	-	-	-	-
Sporidesmiella	1	10*	0	-	-	-	-	-	-
Zygophiala/Schizothyrium	1	40	0.1	-	-	-	-	-	-
Total Fungi	939	39540	100	7	290	100	32	1380	100
Hyphal Fragment	1	40	-	-	-	-	-	-	-
Insect Fragment	-	-	-	-	-	-	-	-	-
Pollen	-	-	-	-	-	-	-	-	-
Analyt. Sensitivity 600x	-	42	-	-	42	-	-	42	-
Analyt. Sensitivity 300x	-	13*	-	-	13*	-	-	13*	-
Skin Fragments (1-4)	-	1	-	-	2	-	-	3	-
Fibrous Particulate (1-4)	-	1	-	-	1	-	-	1	-
Background (1-5)	-	1	-	-	1	-	-	1	-

† Due to method stopping rules, extrapolated raw counts are reported in parenthesis.

++ Includes other spores with similar morphology; see EMSL's fungal glossary for each specific category.

Billy Barnes, Laboratory Manager
or other Approved Signatory

No discernable field blank was submitted with this group of samples.

EMSL Analytical, Inc. maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL Analytical, Inc. EMSL Analytical, Inc. bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. Skin Fragment and Fibrous Particulate ratings are based on the percent of non-fungal material they represent: 1 (1-25%), 2 (26-50%), 3 (51-75%), or 4 (76-100%). Background ratings are based on the total area covered by non-fungal particles: 1 (1-25%), 2 (26-50%), 3 (51-75%), 4 (76-99%), or 5 (100%; overloaded). High levels of background particulate can obscure spores and other particulates, leading to underestimation. Background levels of 5 indicate an overloading of background particulates, prohibiting accurate detection and quantification. Present = Spores detected on overloaded samples. Results are not blank corrected unless otherwise noted. The detection limit is equal to one fungal spore, structure, pollen, fiber particle or insect fragment. "" Denotes particles found at 300X. "-" Denotes not detected. Due to method stopping rules, raw counts >= 100 are extrapolated based on the percentage analyzed.

Samples analyzed by EMSL Analytical, Inc. Morrisville, NC AIHA LAP, LLC-EMLAP Accredited #173741

Initial report from: 08/10/2026 07:30 AM

For information on the fungi listed in this report, please visit the Resources section at www.emsl.com



EMSL Analytical, Inc.

2500 Gateway Centre Blvd., Suite 600 Morrisville, NC 27560

Tel/Fax: (919) 465-3900 / (919) 465-3950

<http://www.EMSL.com> / raleighlab@emsl.com

EMSL Order: 292604147

Customer ID: DLGE34

Customer PO:

Project ID:

Attention: Michael Conrad
Diligent llc
2708 Fortland Dr.
Nashville, TN 37206

Phone: (615) 200-8220

Fax:

Collected Date: 08/03/2026 - 08/04/2026

Received Date: 08/07/2026 03:06 PM

Analyzed Date: 08/07/2026

Project: 9614 Deer Track Court

Test Report: Air-O-Cell™ Analysis of Fungal Spores & Particulates by Optical Microscopy (Methods MICRO-SOP-201, ASTM D7391)

Lab Sample Number: Client Sample ID: Volume (L): Sample Location:	292604147-0004 4243 2248 75			292604147-0005 4243 2252 75			292604147-0006 4243 2266 75		
	Basement			2nd Floor Front Left			2nd Floor Back Right		
Spore Types	Raw Count†	Count/m³	% of Total	Raw Count†	Count/m³	% of Total	Raw Count†	Count/m³	% of Total
Alternaria (Ulocladium)	-	-	-	-	-	-	-	-	-
Ascospores	-	-	-	-	-	-	-	-	-
Aspergillus/Penicillium++	-	-	-	29	1200	88.2	2	80	14.3
Basidiospores	2	80	50	2	80	5.9	9	400	71.4
Bipolaris++	-	-	-	-	-	-	-	-	-
Chaetomium++	-	-	-	-	-	-	-	-	-
Cladosporium	-	-	-	-	-	-	-	-	-
Curvularia	1	40	25	1	40	2.9	1	40	7.1
Epicoccum	-	-	-	-	-	-	-	-	-
Fusarium++	-	-	-	-	-	-	-	-	-
Ganoderma	-	-	-	-	-	-	-	-	-
Myxomycetes++	-	-	-	-	-	-	-	-	-
Pithomyces++	-	-	-	1	40	2.9	-	-	-
Rust	-	-	-	-	-	-	-	-	-
Scopulariopsis/Microascus	-	-	-	-	-	-	-	-	-
Stachybotrys/Memnoniella	-	-	-	-	-	-	-	-	-
Unidentifiable Spores	-	-	-	-	-	-	-	-	-
Blakeslea/Choanephora	1	40	25	-	-	-	1	40	7.1
Cercospora++	-	-	-	-	-	-	-	-	-
Sporidesmiella	-	-	-	-	-	-	-	-	-
Zygophiala/Schizothyrium	-	-	-	-	-	-	-	-	-
Total Fungi	4	160	100	33	1360	100	13	560	100
Hyphal Fragment	-	-	-	-	-	-	1	40	-
Insect Fragment	-	-	-	-	-	-	-	-	-
Pollen	-	-	-	-	-	-	-	-	-
Analyt. Sensitivity 600x	-	42	-	-	42	-	-	42	-
Analyt. Sensitivity 300x	-	13*	-	-	13*	-	-	13*	-
Skin Fragments (1-4)	-	3	-	-	2	-	-	3	-
Fibrous Particulate (1-4)	-	1	-	-	1	-	-	1	-
Background (1-5)	-	1	-	-	1	-	-	1	-

† Due to method stopping rules, extrapolated raw counts are reported in parenthesis.

++ Includes other spores with similar morphology; see EMSL's fungal glossary for each specific category.

Billy Barnes, Laboratory Manager
or other Approved Signatory

No discernable field blank was submitted with this group of samples.

EMSL Analytical, Inc. maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL Analytical, Inc. EMSL Analytical, Inc. bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. Skin Fragment and Fibrous Particulate ratings are based on the percent of non-fungal material they represent: 1 (1-25%), 2 (26-50%), 3 (51-75%), or 4 (76-100%). Background ratings are based on the total area covered by non-fungal particles: 1 (1-25%), 2 (26-50%), 3 (51-75%), or 4 (76-99%), or 5 (100%; overloaded). High levels of background particulate can obscure spores and other particulates, leading to underestimation. Background levels of 5 indicate an overloading of background particulates, prohibiting accurate detection and quantification. Present = Spores detected on overloaded samples. Results are not blank corrected unless otherwise noted. The detection limit is equal to one fungal spore, structure, pollen, fiber particle or insect fragment. "" Denotes particles found at 300X. "-" Denotes not detected. Due to method stopping rules, raw counts >= 100 are extrapolated based on the percentage analyzed.

Samples analyzed by EMSL Analytical, Inc. Morrisville, NC AIHA LAP, LLC-EMLAP Accredited #173741

Initial report from: 08/10/2026 07:30 AM

For information on the fungi listed in this report, please visit the Resources section at www.emsl.com



DILIGENT



WDI Inspection Report

PROPERTY ADDRESS:

9614 Deer Track Court, Brentwood, TN, 37027

PREPARED FOR:

Jonathan & Madisyn De Jong

INSPECTION DATE:

08/03/2026

INSPECTED BY:

Brennan Wade - Cat7 #148477



INSPECTIONS - TESTING - CONSULTING



615.200.8220
www.getdiligent.com



powered by



Termite Inspection - Results & Recommendations


During our Wood Destroying Insect (WDI) inspection of 9614 Deer Track Court, Brentwood, TN, 37027, we discovered NO readily identifiable visual evidence of termites, other WDI, or related damage.

At this time, we do not recommend treatment.

It is recommended, however, that homes be inspected on an annual basis to avoid any potential issues in the future. Please feel free to call our office if you have any questions, or would like to set up yearly follow-up inspections.

Please read over this whole report including the Scope & Limitations information at the back of this report. This report does not discuss structural matters, so please refer to your original home inspection report regarding that type of information. Additionally, this report is not a guarantee or warranty as to the absence of WDI. There may be obstructed or inaccessible areas that were not inspected. It should be noted that the Tennessee Department of Agriculture no longer considers visual evidence of previous treatment as part of the consideration to whether a house should be treated or not. Ongoing treatment warranties may not be in place or were continuous. If any sort of evidence of past termite activity is present, treatment is recommended, or if proof of a active warranty is in place, we recommend that the warranting company be contacted for assistance.

Inspection Graph

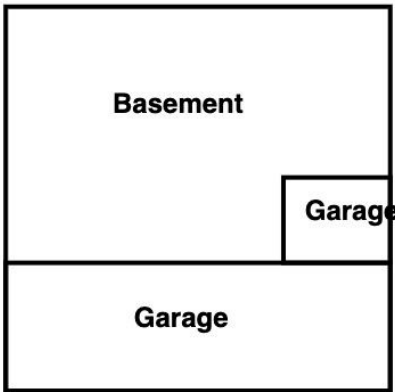

Perimeter: 295 LF

** Estimate from mapping data, not a surveyed measurement.*

(A) = Active Termites, (E) = Evidence of Previous Termite Activity, (D) = Termite Damage
(B) = Carpenter Bee Activity/Damage, (P) = Powder Post Beetle Evidence
(C) = Carpenter Ant Evidence, (X) = No Visual Access

Wood Destroying Insect Inspection Report

Notice: Please read important consumer information on **page 2**.

Section I. General Information

Inspection Company, Address & Phone

2708 Fortland Dr.
Nashville, TN 37206
615.200.8840



Company's Pest Control Business Lic. #

#5715

Date of Inspection

08/03/2026

Address of Property Inspected

9614 Deer Track Court, Brentwood, TN, 37027

Inspector's Name, Signature & Certification, Registration, or Lic. #

Brennan Wade - Cat7 #148477

Structure(s) Inspected

Residential Dwelling

Section II. Inspection Findings This report is indicative of the condition of the above identified structure(s) on the date of inspection and is not to be construed as a guarantee or warranty against latent, concealed, or future infestations or wood destroying insect damage.

Based on a careful visual inspection of the readily accessible areas of the structure(s) inspected:

☒ **A. No visible** evidence of wood destroying insects was observed.

☐ **B. Visible evidence of wood destroying insects was observed as follows:**

☐ 1. Live insects (description and location):

☐ 2. Dead insects, insect parts, frass, shelter tubes, exit holes, or staining (description and location):

☐ 3. Visible damage from wood destroying insects was noted as follows (description and location):

NOTE: This is not a structural damage report. If box B above is checked, it should be understood that some degree of damage, including hidden damage, may be present. If any questions arise regarding damage indicated by this report, it is recommended that the buyer or any interested parties contact a qualified structural professional to determine the extent of damage and the need for repairs.

Section III. Recommendations

☒ No action and/or treatment recommended: (Explain if Box B in Section II is checked)

☐ Recommend action(s) and/or treatment(s) for the control of:

Section IV. Obstructions and Inaccessible Areas

The following areas of the structure(s) inspected were obstructed or inaccessible:

☒ Basement 1, 3, 4, 6, 7, 8, 9, 11, 13, 24

☐ Crawlspace

☒ Main Level 1, 3, 4, 6, 7, 8, 9, 11, 13

☒ Attic 1, 3, 6, 7, 9, 11, 12, 14, 24

☒ Garage 1, 3, 6, 7, 9, 11, 12, 14, 24

☒ Exterior 9, 11, 12, 13, 14, 16, 17, 24

☐ Porch

☐ Addition

☐ Other

The inspector may write out obstructions or use the following optional key:

- | | |
|-------------------------|--|
| 1. Fixed ceiling | 15. Standing water |
| 2. Suspended ceiling | 16. Dense vegetation |
| 3. Fixed wall covering | 17. Exterior siding |
| 4. Floor covering | 18. Window well covers |
| 5. Insulation | 19. Wood pile |
| 6. Cabinets or shelving | 20. Snow |
| 7. Stored items | 21. Unsafe conditions |
| 8. Furnishings | 22. Rigid foam board |
| 9. Appliances | 23. Synthetic stucco |
| 10. No access or entry | 24. Duct work, plumbing and /or wiring |
| 11. Limited access | 25. Spray foam insulation |
| 12. No access beneath | 26. Equipment |
| 13. Only visual access | |
| 14. Cluttered condition | |

Section V. Additional Comments and Attachments (these are an integral part of the report)

Attachments:

Signature of Seller(s) or Owner(s) if refinancing. Seller discloses to the buyer all information, to their knowledge, regarding W.D.I. infestation, damage, repair, and treatment history.

X

Signature of Buyer. The undersigned hereby acknowledges receipt of a copy of both page 1 and page 2 of this report and understands the information reported.

X

Important Consumer Information

Regarding the Scope and Limitations of the Inspection

Please read this entire page as it is part of this report. Please refer to the NPMA Suggested Guidelines for instructions on completing this report. This report is not a guarantee or warranty as to the absence of wood destroying insects nor is it a structural integrity report. The inspector's training and experience do not qualify the inspector in damage evaluation or any other building construction technology and/or repair.

- 1. About the Inspection:** A visual inspection was conducted in the readily accessible areas of the structure(s) indicated (see Page 1) including attics and crawlspaces which permitted entry during the inspection. The inspection included probing and/or sounding of unobstructed and accessible areas to determine the presence or absence of visual evidence of wood destroying insects. The WDI inspection firm is not responsible to repair any damage or treat any infestation at the structure(s) inspected, except as may be provided by separate contract. Also, wood destroying insect infestation and/or damage may exist in concealed or inaccessible areas. The inspection firm cannot guarantee that any wood destroying insect infestation and/or damage disclosed by this inspection represents all of the wood destroying insect infestation and/or damage which may exist as of the date of the inspection. **For purposes of this inspection, wood destroying insects include: termites, carpenter ants, carpenter bees, and reinfesting wood boring beetles. This inspection does not include mold, mildew or noninsect wood destroying organisms.** This report shall be considered invalid for purposes of securing a mortgage and/or settlement of property transfer if not used within ninety (90) days from the date of inspection. **This shall not be construed as a 90-day warranty.** There is no warranty, express or implied, related to this report unless disclosed as required by state regulations or a written warranty or service agreement is attached.
- 2. Treatment Recommendation Guidelines Regarding Subterranean Termites:** Treatment or corrective action should be recommended if live termites are found. If no evidence of a previous treatment is documented and evidence of infestation is found, even if no live termites are observed, treatment or corrective action by a licensed pest control company should be recommended. Treatment or corrective action may be recommended if evidence of infestation is observed, and a documented treatment occurred previously, unless the structure is under warranty or covered by a service agreement with a licensed pest control company. **For other Wood Destroying Insects, please refer to the NPMA suggested guidelines for added guidance on actions and or treatment.**
- 3. Obstructions and Inaccessible Areas:** No inspection was made in areas which required the breaking apart or into, dismantling, removal of any object, including but not limited to: moldings, floor coverings, wall coverings, siding, fixed ceilings, insulation, furniture, appliances, and/or personal possessions; nor were areas inspected which were obstructed or inaccessible for physical access on the date of inspection. Your inspector may write out inaccessible areas or use the key in Section IV. Crawl spaces, attics, and/or other areas may be deemed inaccessible if the opening to the area is not large enough to provide physical access for the inspector or if a ladder was required for access. Crawl spaces (or portions thereof) may also be deemed inaccessible if there is less than 24 inches of clearance from the bottom of the floor joists to the surface below. If any area which has been reported as inaccessible is made accessible, the inspection company may be contacted for another inspection. An additional fee may apply.
- 4. Consumer Maintenance Advisory Regarding Integrated Pest Management for Prevention of Wood Destroying Insects.** Any structure can be attacked by wood destroying insects. Homeowners should be aware of and try to eliminate conditions which promote insect infestation in and around their structure(s). Factors which may lead to wood destroying insect infestation include: earth to wood contact, foam insulation at foundation in contact with soil, faulty grade, improper drainage, firewood against structure(s), insufficient ventilation, moisture, wood debris in crawlspace, wood mulch or ground cover in contact with the structure, tree branches touching structure(s), landscape timbers and wood decay. Should these or other conditions exist, corrective measures should be taken in order to reduce the chances of infestation of wood destroying insects and the need for treatment.
- 5. Neither the inspecting company nor the inspector has had, presently has, or contemplates having any interest in the property inspected.**



RIVERSIDE

ENVIRONMENTAL

Radon Testing Report

PROPERTY ADDRESS:

9614 Deer Track Court, Brentwood, TN, 37027

PREPARED FOR:

Jonathan & Madisyn De Jong

INSPECTION DATE:
Aug 3, 2026



Diagnostics - Mitigation - Encapsulation



Mold - Moisture - Crawlspace - Radon



Testing Results

EPA avg: 2.4pCi/L = CLEAR!

Start/End = 8.03.26, 3:58 pm --> 8.05.26, 11:58 am


Total Testing Time: 1d, 20hr

Recommendations

The radon test results came back BELOW the EPA action level of 4.0pCi/L. And we are pleased to report that no mitigation action is required at this time. It should be noted that the EPA does recommend that you consider installing a mitigation fan if the level is above 2.0pCi/L but below 4.0, and that regardless, you should annually test for radon to ensure occupant safety.

We hope these results will be used to create a better and healthier living environment. For more information, call Riverside Environmental at 615.200.8708 for all things radon.

Graph of Results

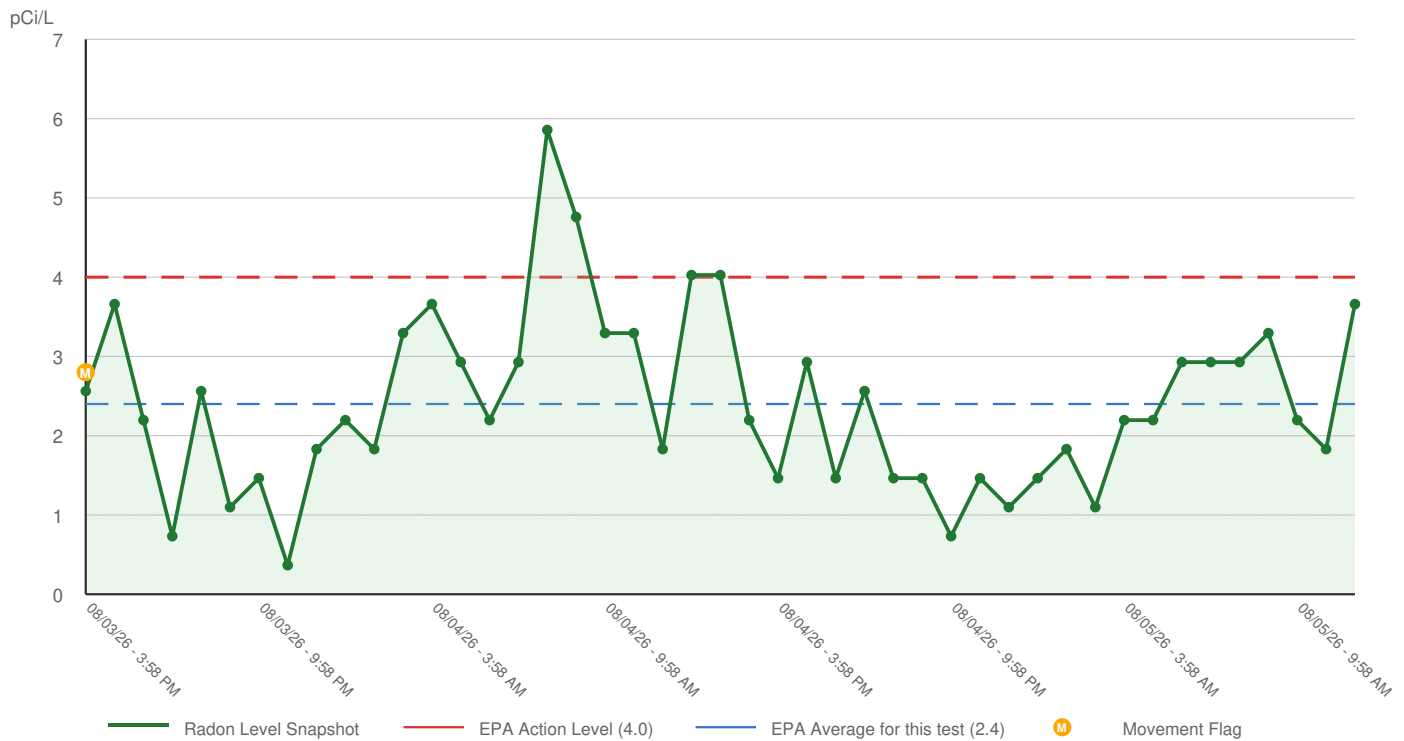

Equipment Model: SunNuclear 1028

Last Calibration Date: 07/16/2026

CRM Serial Number: 59237075

Testing Company: DILIGENT

Testing Limitations

Continuous Radon Monitors use complex calculations to measure each individual hourly reading, and there is some element of uncertainty in isolated measurements due to statistical variations and other factors, such as daily and seasonal radon concentrations. Hourly readings are NOT useful for measuring or understanding exposure in the building. Actual exposure can only be understood as a time-based measurement, where readings are averaged over the length of the test. Levels that appear to be uniquely over or under the EPA action level should not be given more weight than the EPA Average. If a more precise understanding of exposure is desired, a long term (~90 days) testing service can be provided at a later date. Please contact the office for more information.

General Radon Risk Information

<2.0 pCi/L =

No Action Required

2.0 pCi/L - 4.0 pCi/L =

Consider Installing a Mitigation System

>4.0 pCi/L =

Install a Mitigation System

In the US, radon is the leading cause of lung cancer amongst non-smokers and the EPA and the Surgeon General strongly recommend taking further action when test results are 4.0 pCi/L or greater. However, the EPA believes that any radon exposure carries some risk, and no level of radon is safe. Even radon levels below 4 pCi/L pose some risk, and you can reduce your risk of lung cancer by lowering your radon levels.

The concentration of radon in the home is measured in picoCuries per liter of air (pCi/L), and if levels are high, a home owner can have a radon mitigation system installed to reduce the levels down to reasonable levels. If the radon level in the home is between 2.0 and 4.0 pCi/L, the EPA still recommends that you consider fixing the home. The average indoor radon level is estimated to be about 1.3 pCi/L, and roughly 0.4 pCi/L of radon is normally found in the outside air.



Your Next Radon Test

Present this coupon when scheduling your next radon test to receive \$50 off the standard testing rate. Protect your family — test annually!

Coupon Valid After July 3, 2027

Cannot be combined with other offers. One coupon per household.

W. L. JOHANAN P.E.
303 SAM DAVIS DR.
SMYRNA, TENNESSEE 37167
(937) 286-2664

August 24, 2026

Mr. and Mrs. Faron Kelsh
c/o Paula Hinegardner
Keller Williams Realty
Franklin, Tenn.

Subject: STRUCTURAL INSPECTION OF REPAIRS MADE TO FLOOR JOIST AT 9614 DEER
TRACK CT., BRENTWOOD, TENN.


Dear Faron and Connie,

At your request we made an onsite inspection of the REPAIRS made to the damaged joist in the mechanical room; as required in my Inspection letter dated August 12, 2026 (SEE ATTACHED). The repair was properly completed as per our letter. The structure now appears to be STRUCTURALLY SOUND as of this date.


This professional opinion is based on an onsite inspection of the repaired joist in the mechanical room as of this date only; and is limited by low lit or limited visual areas. No guarantee or warranty of the structural condition of the structure is expressed or implied at this time. Receipt of this report and payment thereby shall constitute a release from the Home Owner of this inspector, William L. Johanan P.E., from any, and all liability and limit the amount for claims against this inspector to amount of the inspection cost. This waiver shall survive any transfer of ownership.

Please call with any questions that you may have. Thank you for your payment.

Sincerely,



William L. Johanan P.E.
cc. letter dated August 12, 2026

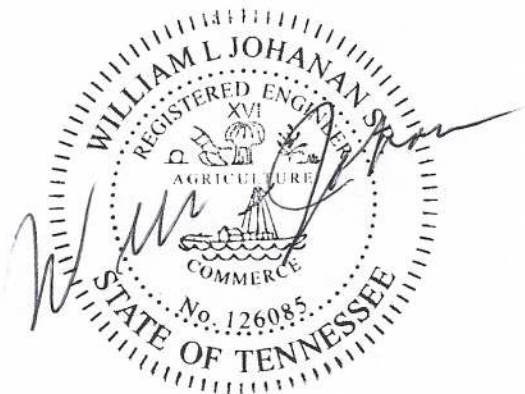

W. L. JOHANAN P.E.
303 SAM DAVIS DR.
SMYRNA, TENNESSEE 37167
(937)-286-2664

August 12, 2026

Mr. and Mrs. Faron Kelsh
c/o Paula Hinegardner
Keller Williams Realty
Franklin, Tenn.

Subject: STRUCTURAL EVALUATION OF DAMAGED FLOOR JOIST IN BASEMENT AT 9614
DEER TRACK CT., BRENTWOOD, TENN.

Dear Faron and Connie,


At your request we performed a structural evaluation of the above home's floor joist system (I joists) due to a damaged floor joist in the basement mechanical room. The one joist was damaged due to a past water leak which has been resolved; in accordance with the home owner. However, the one joist will need to be repaired at the damaged end. (SEE ATTACHED REPAIR DRAWING). The other joists and sill appear to be SOUND at this time and no other major structural repairs to the floor framing, in that area, are needed at this time.


This professional opinion is based on an observation of ONLY the VISIBLE structural components inspected, listed above, and as of this date only; and is limited by low lit or limited visual areas (i.e. crawl spaces, basements, etc.). No guarantee or warranty of the structural condition of the floor framing is expressed or implied at this time. All structures require regular maintenance, i.e., maintenance of proper drainage, etc. Receipt of this Report and payment thereby shall constitute a release from the Buyer and/or Owner of this Inspector from any and all liability arising out of inaction or action on any contents of this Report; and shall limit the liability amount for any claims against this Inspector to the amount of this Inspection Cost. This waiver shall survive any transfer of ownership. Please call with any questions. Thank you for your payment.

Sincerely,




William L. Johanan P.E.
cc. Paula Hinegardner, Keller Williams Realty
1-attached drawing

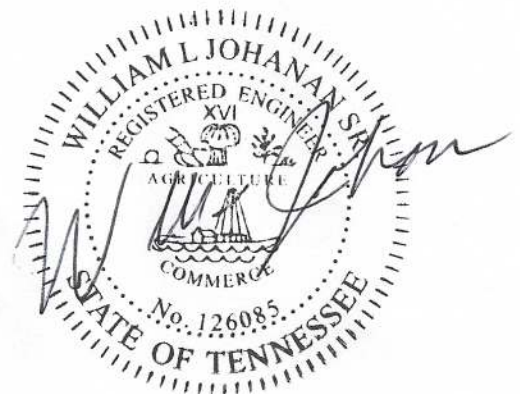

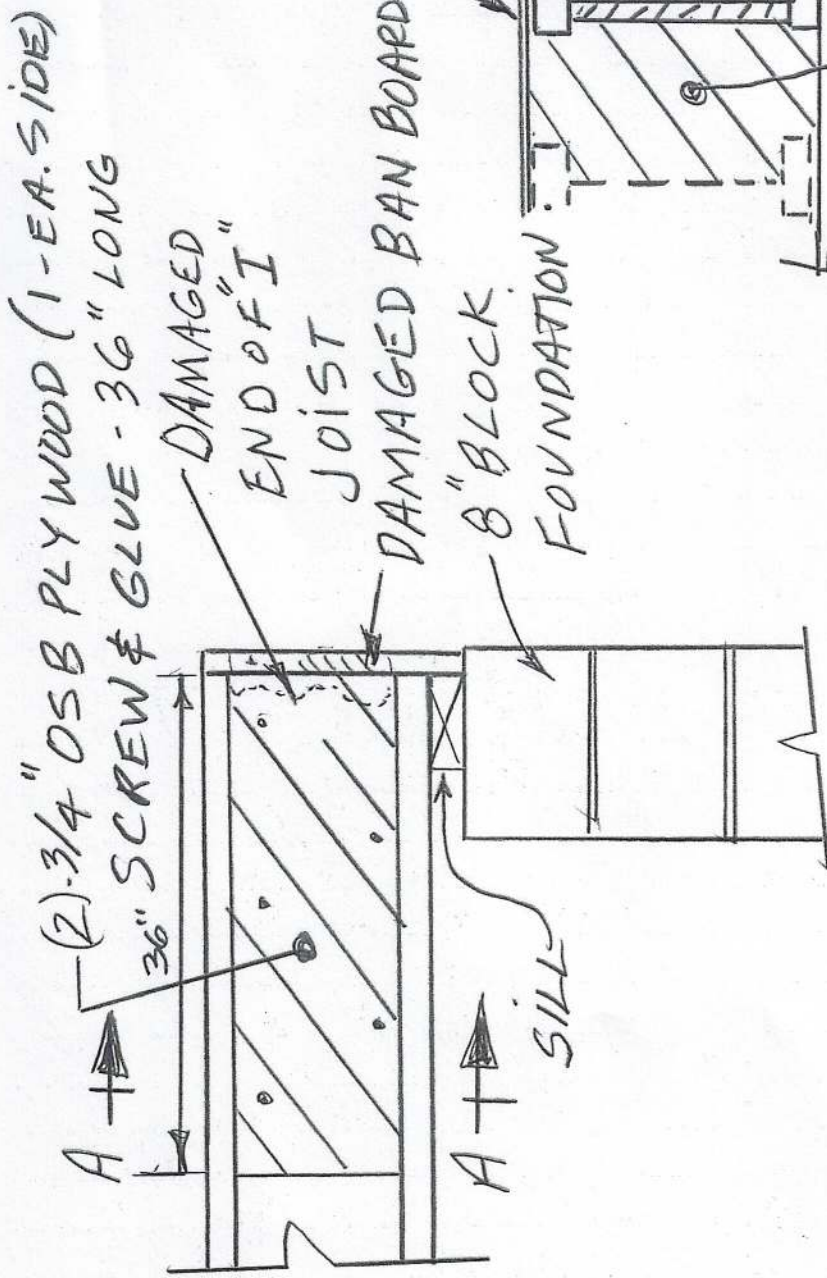

ELEVATION VIEW
REPAIR TO JOIST

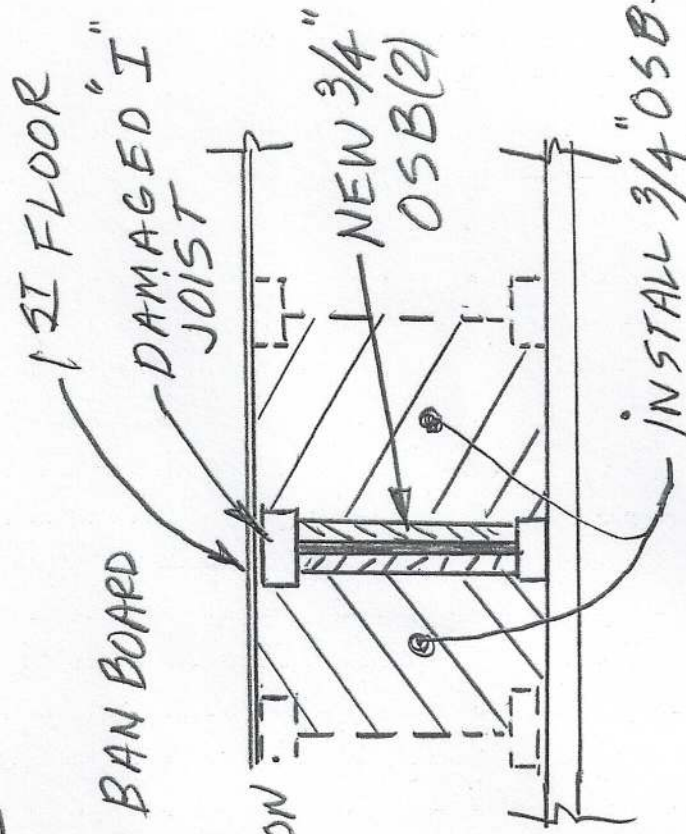

SECTION A-A (END VIEW)
OVER - BAN BOARD (DAMAGED)
INSTALL 3/4\"/>

W. L. JOHANAN P.E.

8-12-26



Jeremy Woodson

DATE 8/18/2026

SHIP TO

TERMS Due on receipt

[illegible]

STATEMENT

WILLIAM L. JOHANAN P.E.

303 Sam Davis Dr.
Smyrna, TN. 37167
(937) 286-2664

DATE 8-12-26

FRANK & CONNIE KELSH
c/o PAULA HIEGARDER
KELLEN - WILLIAMS
FRANKLIN, TENN

PLEASE DETACH AND RETURN WITH YOUR REMITTANCE \$

DATE	CHARGES AND CREDITS	BALANCE
	BALANCE FORWARD	
	STRUCTURAL EVAL. OF DAMAGED FLOOR JOIST AT 9614 DEER TRACK CR. BRENTWOOD, TENN	
		600
	3249	

WILLIAM L. JOHANAN P.E.

PAY LAST AMOUNT
IN THIS COLUMN

Thank You!

STATEMENT

WILLIAM L. JOHANAN P.E.

303 Sam Davis Dr.
Smyrna, TN. 37167
(937) 286-2664

DATE

8-24-26

PAULA HINEGARDEN
c/o FARON KELSEY
9614 DEERTRACK
BRENTWOOD, TENN

PLEASE DETACH AND RETURN WITH YOUR REMITTANCE \$

DATE	CHARGES AND CREDITS	BALANCE
	BALANCE FORWARD	
	RE-INSPECTION OF REPAIRS TO DAMAGED JOIST AT 9614 DEERTRACK, BRENTWOOD TENN	\$ 300
	pd d # 3250 wp	

WILLIAM L. JOHANAN P.E.

PAY LAST AMOUNT
IN THIS COLUMN



FLAME SPREAD
25 (Max)
50 (Max)
R-5.0 at 1 1/2" thickness
R-6.2 (based on average installed thickness
of 1 1/2")

1 1/2" Type 75

floor
370
1 1/2" Type 75
DEC
14
1990
50

**Superior
All Service
Faced Duct Wire
1 1/2" Type 75**

R-4.2 (based on average installed thickness
of 1 1/2")

R-5.0 at 1 1/2" thickness



Fwd: Receipt for electrical

1 message

Sarah Shepherd <sarah.shepherd@kw.com>
To: Sarah Shepherd <sarah.shepherd@kw.com>

Fri, Aug 21, 2026 at 9:18 AM

----- Forwarded message -----
From: **Paula Hinegardner** <phinegardner@me.com>
Date: Fri, Aug 21, 2026 at 6:36 AM
Subject: Re: Receipt for electrical
To: Faron Kelsh <[REDACTED]>
Cc: Sarah Shepherd <Sarah.Shepherd@kw.com>, Jennifer Bisceglia <jbisceglia@kw.com>

Thank you!

Sara, here is a receipt for repairs...

On Aug 20, 2026, at 8:10 PM, Faron Kelsh <[REDACTED]> wrote:

Paula,
Please see receipt and pictures from the electrician.

935606

8-20-2026

NAME: Faron Kelsh
ADDRESS: 9614 Deer Track Ct.
CITY/STATE/ZIP: Brentwood, TN 37027

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	Repaired Neutral Feeder in MAIN Service Panel		
2	Separated Neutrals in basement sub-panel		
3	Separated neutrals in Garage sub-panel		
			475.00
	PPED Low Voltage on 8-20-26		
			475.00

Signature: [Signature]
KEEP THIS RIF FOR REFERENCE







Many thanks,

Faron Kelsh



Appraiser and/or Data Collector Independence Certification

The Lender certifies that the above referenced appraisal has been completed in compliance with all current appraisal independence requirements as defined by the Dodd-Frank Wall Street Reform and Consumer Protection Act, the Interagency Appraisal and Evaluation Guidelines, Fannie Mae, Freddie Mac and the Federal Housing Administration, in strict adherence to our non-influence policy and process:

Borrower Name: Jonathan De Jong
Property Address: 9614 Deer Track Ct Brentwood TN 37027
Loan number: BRE26001923
Date: 2026-08-06

- No employee, director, officer or agent of the lender or any other third party acting as joint venture partner, independent contractor, appraisal company, appraisal management company or partner on behalf of the lender has influenced or attempted to influence the development, reporting, result, or review of the appraisal in any manner.
- The Lender/Client named on the appraisal report submitted the appraisal order through a secure self-managed appraisal software platform, or through approved and compliant 3rd party integration.
- Appraiser selection was performed by a non-compensated member of the Lender. Appraiser selection was performed utilizing a selection methodology of management-approved policies based on the location of the subject property, appraiser availability and historical quality and performance metrics.
- The appraiser's compensation was not in any way dependent on the value arrived at or the closing of the loan. The appraiser was compensated directly by the Lender and not by a Lender staff member that receives compensation based on loan sales.
- The terms and conditions of the engagement contract between the Lender and the appraiser prohibit the appraiser from inappropriate communication with the Lender origination staff or attempting to obtain value/loan information from the borrower/property owner.
- No estimate regarding the Subject Property's value, proposed loan amount or proposed loan-to-value ratio was provided or communicated by the Lender to the appraiser.
- For all transactions: By proper use of a secure self-managed appraisal software platform, the Lender's loan production staff is unaware of the identity of the appraiser until the final appraisal report is delivered. Likewise the appraiser is provided with only the Lender's company name and address for inclusion in the appraisal report and is never provided with the identity or contact information of the originator of the loan. For purchase transactions, the purchase agreement was provided to the appraiser as required by USPAP Standards Rule 1-5(a).
- All communication between the selected appraiser and The Lender was conducted through the Lender's Appraisal Department. The Lender is unaware of any communication to the appraiser for this appraisal assignment made by anyone that is in violation of the terms of current Appraiser Independence Requirements.

RESIDENTIAL APPRAISAL REPORT



Property Location:	9614 Deer Track Ct Brentwood, TN 37027 Subd Bonbrook The Est Of Ph 4 Pb 27 Pg 96 Lot 0094
Borrower:	Jonathan De Jong & Madisyn De Jong
Lender:	Churchill Mortgage Corporation 1749 Mallory Lane, Suite 100 Brentwood, TN 37027
Opinion of Value:	2,275,000
Effective Date:	08/06/2026
Prepared By:	Matthew Blevins 615-955-3947 MatthewBlevins@ARKAppraisals.com

1045 Lonesome Pine Rd
Kingston Springs, TN 37082

Uniform Residential Appraisal Report

File # BRE26001923

SALES COMPARISON APPROACH

There are 102 comparable properties currently offered for sale in the subject neighborhood ranging in price from \$ 1,042,000 to \$ 4,999,999 .														
There are 209 comparable sales in the subject neighborhood within the past twelve months ranging in sale price from \$ 1,275,000 to \$ 6,800,000 .														
FEATURE			SUBJECT			COMPARABLE SALE # 1			COMPARABLE SALE # 2			COMPARABLE SALE # 3		
Address 9614 Deer Track Ct Brentwood, TN 37027						9717 Turquoise Ln Brentwood, TN 37027			1245 Monarch Way Brentwood, TN 37027			9540 Sunbeam Ct Brentwood, TN 37027		
Proximity to Subject						1.67 miles SE			2.57 miles W			1.34 miles W		
Sale Price			\$ 2,250,000			\$ 2,250,000			\$ 2,139,000			\$ 2,370,000		
Sale Price/Gross Liv. Area			\$ 443.09 sq.ft.			\$ 517.36 sq.ft.			\$ 473.02 sq.ft.			\$ 447.09 sq.ft.		
Data Source(s)						MLS#3018224;DOM 28			MLS#3164897;DOM 0			MLS#3030781;DOM 48		
Verification Source(s)						Drive By/Tax Records			Drive By/Tax Records			Drive By/Tax Records		
VALUE ADJUSTMENTS			DESCRIPTION			DESCRIPTION			DESCRIPTION			DESCRIPTION		
						+ (-) \$ Adjustment			+ (-) \$ Adjustment			+ (-) \$ Adjustment		
Sales or Financing Concessions						ArmLth Conv;0			ArmLth Conv;0			ArmLth Cash;0		
Date of Sale/Time						s01/26;c11/25			s05/26;c03/26			s01/26;c12/25		
Location			N;Res;			N;Res;			N;Res;			B;Res;Gated		
Leasehold/Fee Simple			Fee Simple			Fee Simple			Fee Simple			Fee Simple		
Site			1.0 ac			23522 sf			30928 sf			26136 sf		
View			N;Res;			N;Res;			N;Res;			N;Res;		
Design (Style)			DT2;Traditional			DT2;Traditional			DT2;Traditional			DT2;Traditional		
Quality of Construction			Q3			Q3			Q3			Q3		
Actual Age			26			20			22			7		
Condition			C3			C3			C3			C3		
Above Grade			Total	Bdrms.	Baths	Total	Bdrms.	Baths	Total	Bdrms.	Baths	Total	Bdrms.	Baths
Room Count			10	4	3.1	10	4	4.1	10	4	3.1	10	4	4.2
Gross Living Area			5,078 sq.ft.			4,349 sq.ft.			4,522 sq.ft.			5,301 sq.ft.		
Basement & Finished Rooms Below Grade			2270sf1793sfwo1rr0br1.0ba2o			2167sf2167sfwo1rr1br1.0ba2o			2142sf2142sfwo1rr0br1.0ba2o			1224sf1224sfwo1rr1br1.0ba1o		
Functional Utility			Average			Average			Average			Average		
Heating/Cooling			FAU/CAC			FAU/CAC			FAU/CAC			FAU/CAC		
Energy Efficient Items			None			None			None			None		
Garage/Carport			4gbi4dw			3gbi3dw			3gbi3dw			3gbi3dw		
Porch/Patio/Deck			Prch/ScrDeck/Patio			Prch/2 CvDeck/Patio			Prch/ScrDeck/Patio			Prch/ScrPatio/Patio		
FP / Fence			4 FP / Fence			1 FP / Fence			1 FP / Fence			2 FP / Fence		
Other Features			None			Pool/BBQ			None			None		
Net Adjustment (Total)						⊗ + ⊠ - \$ 18,576			⊗ + ⊠ - \$ 94,664			⊠ + ⊗ - \$ -84,928		
Adjusted Sale Price of Comparables						Net Adj. 0.8 % Gross Adj. 13.9 % \$ 2,268,576			Net Adj. 4.4 % Gross Adj. 7.7 % \$ 2,233,664			Net Adj. 3.6 % Gross Adj. 15.3 % \$ 2,285,072		

I ☒ did ☐ did not research the sale or transfer history of the subject property and comparable sales. If not, explain

My research ☒ did ☐ did not reveal any prior sales or transfers of the subject property for the three years prior to the effective date of this appraisal.

Data Source(s) Assessor Records

My research ☐ did ☒ did not reveal any prior sales or transfers of the comparable sales for the year prior to the date of sale of the comparable sale.

Data Source(s) Assessor Records

Report the results of the research and analysis of the prior sale or transfer history of the subject property and comparable sales (report additional prior sales on page 3).

ITEM	SUBJECT	COMPARABLE SALE #1	COMPARABLE SALE #2	COMPARABLE SALE #3
Date of Prior Sale/Transfer	05/23/2024			
Price of Prior Sale/Transfer	\$0			
Data Source(s)	Assessor Records	Assessor Records	Assessor Records	Assessor Records
Effective Date of Data Source(s)	08/06/2026	08/06/2026	08/06/2026	08/06/2026

Analysis of prior sale or transfer history of the subject property and comparable sales The subject's prior transfer was a quit claim deed transfer for no value reported. The comparable sales have not transferred in the year preceding their respective settlement dates.

Summary of Sales Comparison Approach Comparable search was made within the neighborhood boundaries for comparables with similar proximity to the Subject and GLA within 25% and built within 20 years of the subject. Comparable selection is based on recent date of sale, proximity, subdivision, lot size, condition, quality of construction, bedroom and bathroom count and design. Every attempt has been made to demonstrate all subject property characteristics. Sale(s) 1, 2, & 3 are the strongest indicator of value for its most similar design, condition, and finishes to the subject.

See attached addenda for additional summary of Sales Comparison.

Indicated Value by Sales Comparison Approach \$ 2,275,000

RECONCILIATION

Indicated Value by: Sales Comparison Approach \$ 2,275,000 Cost Approach (if developed) \$ 2,236,022 Income Approach (if developed) \$

The sales comparison has the most available and highest quality data and is considered the strongest indicator of value. The cost approach has more limited data available and is considered the second strongest indicator. The income approach has limited and low-quality data available and is not considered in the appraisal.

This appraisal is made ☒ "as is", ☐ subject to completion per plans and specifications on the basis of a hypothetical condition that the improvements have been completed, ☐ subject to the following repairs or alterations on the basis of a hypothetical condition that the repairs or alterations have been completed, or ☐ subject to the following required inspection based on the extraordinary assumption that the condition or deficiency does not require alteration or repair: Appraisal has been completed "as is" with no conditions applied.

Based on a complete visual inspection of the interior and exterior areas of the subject property, defined scope of work, statement of assumptions and limiting conditions, and appraiser's certification, my (our) opinion of the market value, as defined, of the real property that is the subject of this report is \$ 2,275,000 , as of 08/06/2026 , which is the date of inspection and the effective date of this appraisal.

File # BRE26001923

ANALYSIS / COMMENTS

Uniform Residential Appraisal Report

File # BRE26001923

ADDITIONAL COMMENTS

INTENDED USE:
The intended use is to evaluate the property that is the subject of this appraisal for a mortgage finance transaction, subject to the stated Scope of Work, purpose of the appraisal, reporting requirements of this appraisal report form and definition of Market Value.

INTENDED USER:
The client and any other party as identified by name or type, as users of the appraisal report, by the appraiser based on communication with the client at the time of the assignment. The intended user for this residential appraisal report is the client/lender. No additional intended users are identified by the appraiser. Although Certification 23 permits the borrower to rely on this appraisal for a mortgage finance transaction, the borrower must not rely on this appraisal for any other use. The appraiser has not identified any purchaser, or seller as an intended user of this appraisal, and no such party should rely on this appraisal for any purpose. Such parties are advised to obtain an appraisal from an appraiser of their choosing if the require an appraisal for their own use. Any references to or use of this appraisal report by a purchaser, borrower or seller for their own purposes, including without limitation for the purposes of a property purchase decision or an appraisal contingency in a purchase agreement, is at such party's own risk and is not intended or authorized by the appraiser.

SCOPE OF THE APPRAISAL:
The scope of the assignment represents a Residential Appraisal Report. The subject property has been physically inspected on the exterior and interior in order to determine the physical characteristics of the property. The inspection of the subject property and any improvements is for the purpose of determining fair market value of the property. An appraisal is not a home inspection. No liability is assumed for structural or mechanical elements of the subject property. See limiting conditions attached. Comparable properties have been researched and those presented herein are considered the best indicators of value and have been inspected from the exterior. Adjustments have been made to all value influencing factors and have been developed based on market reaction. The value has been developed considering the strengths and weakness' of the data and approaches to value.

The subject was physically measured to the nearest tenth of a foot using the ANSI Z765-2021 Square Footage Method for Calculating finished living area (GLA).

HIGHEST AND BEST USE:
The subject is a legally permissible use based on its current zoning. Also, the lot size, shape and land-to-building ratio allow the present structure and indicate a good utilization of the improvements. Based on current market conditions, the existing use is its financially feasible and maximally productive use. The highest and best use, as if vacant, would be to construct a residential dwelling. Therefore, its current use is considered to be its highest and best use.

***The subject's HOA includes grounds maintenance and deemed similar to that of competing PUDs in the subject's market.

***Although the subject's actual age is not bracketed with an older home, comparables chosen feature similar effective age to the subject, and are deemed the best representation of value for the subject property.

COST APPROACH

COST APPROACH TO VALUE (not required by Fannie Mae)

Provide adequate information for the lender/client to replicate the below cost figures and calculations.

Support for the opinion of site value (summary of comparable land sales or other methods for estimating site value)Land value estimates were derived through extraction and reflects only contributory value towards the subject's improvements. The actual value may vary from this estimate. It is not uncommon for site values within Williamson county to be 30-75% of the total value estimate. The cost approach has been completed at the request of the lender/client. The cost approach should not be relied upon by any third party for any reason, insurance or otherwise, outside of making a lending decision.

ESTIMATED ☐ REPRODUCTION OR ☒ REPLACEMENT COST NEW	OPINION OF SITE VALUE _____ =\$ 500,000			
Source of cost data National Building Cost Estimator	DWELLING	5,078	Sq.Ft. @ \$ 300.00	=\$ 1,523,400
Quality rating from cost service Class 4 Effective date of cost data 2025	Basemen	2,270	Sq.Ft. @ \$ 200.00	=\$ 454,000
Comments on Cost Approach (gross living area calculations, depreciation, etc.)	_____ =\$			
The Cost Approach is considered; however, the subject's market is mostly built out with limited competition from new construction. The quantity and quality of data available to develop a credible Cost Approach is secondary to the sales comparison approach. The market dictates the Cost Approach is not necessary for credible assignment results.	Garage/Carport	1,397	Sq.Ft. @ \$ 100.00	=\$ 139,700
	Total Estimate of Cost-New			=\$ 2,117,100
	Less	Physical	Functional	External
	Depreciation	381,078		=\$ (381,078)
	Depreciated Cost of Improvements			=\$ 1,736,022
	"As-is" Value of Site Improvements			=\$
Estimated Remaining Economic Life (HUD and VA only) 82 Years	INDICATED VALUE BY COST APPROACH			=\$ 2,236,022

INCOME

INCOME APPROACH TO VALUE (not required by Fannie Mae)

Estimated Monthly Market Rent \$ X Gross Rent Multiplier = \$ Indicated Value by Income Approach

Summary of Income Approach (including support for market rent and GRM)The Income Approach is considered for credible assignment results. The subject's market is primarily owner occupied which limits the quantity and quality of rental data available for analysis.

PUD INFORMATION

PROJECT INFORMATION FOR PUDs (if applicable)

Is the developer/builder in control of the Homeowners' Association (HOA)? ☐ Yes ☒ No Unit type(s) ☒ Detached ☐ Attached

Provide the following information for PUDs ONLY if the developer/builder is in control of the HOA and the subject property is an attached dwelling unit.

Legal Name of Project

Total number of phases	Total number of units	Total number of units sold
Total number of units rented	Total number of units for sale	Data source(s)

Was the project created by the conversion of existing building(s) into a PUD? ☐ Yes ☐ No If Yes, date of conversion.

Does the project contain any multi-dwelling units? ☐ Yes ☐ No Data Source

Are the units, common elements, and recreation facilities complete? ☐ Yes ☐ No If No, describe the status of completion.

Are the common elements leased to or by the Homeowners' Association? ☐ Yes ☐ No If Yes, describe the rental terms and options.

Describe common elements and recreational facilities.

Uniform Residential Appraisal Report

File # BRE26001923

This report form is designed to report an appraisal of a one-unit property or a one-unit property with an accessory unit; including a unit in a planned unit development (PUD). This report form is not designed to report an appraisal of a manufactured home or a unit in a condominium or cooperative project.

This appraisal report is subject to the following scope of work, intended use, intended user, definition of market value, statement of assumptions and limiting conditions, and certifications. Modifications, additions, or deletions to the intended use, intended user, definition of market value, or assumptions and limiting conditions are not permitted. The appraiser may expand the scope of work to include any additional research or analysis necessary based on the complexity of this appraisal assignment. Modifications or deletions to the certifications are also not permitted. However, additional certifications that do not constitute material alterations to this appraisal report, such as those required by law or those related to the appraiser's continuing education or membership in an appraisal organization, are permitted.

SCOPE OF WORK: The scope of work for this appraisal is defined by the complexity of this appraisal assignment and the reporting requirements of this appraisal report form, including the following definition of market value, statement of assumptions and limiting conditions, and certifications. The appraiser must, at a minimum: (1) perform a complete visual inspection of the interior and exterior areas of the subject property, (2) inspect the neighborhood, (3) inspect each of the comparable sales from at least the street, (4) research, verify, and analyze data from reliable public and/or private sources, and (5) report his or her analysis, opinions, and conclusions in this appraisal report.

INTENDED USE: The intended use of this appraisal report is for the lender/client to evaluate the property that is the subject of this appraisal for a mortgage finance transaction.

INTENDED USER: The intended user of this appraisal report is the lender/client.

DEFINITION OF MARKET VALUE: The most probable price which a property should bring in a competitive and open market under all conditions requisite to a fair sale, the buyer and seller, each acting prudently, knowledgeably and assuming the price is not affected by undue stimulus. Implicit in this definition is the consummation of a sale as of a specified date and the passing of title from seller to buyer under conditions whereby: (1) buyer and seller are typically motivated; (2) both parties are well informed or well advised, and each acting in what he or she considers his or her own best interest; (3) a reasonable time is allowed for exposure in the open market; (4) payment is made in terms of cash in U. S. dollars or in terms of financial arrangements comparable thereto; and (5) the price represents the normal consideration for the property sold unaffected by special or creative financing or sales concessions* granted by anyone associated with the sale.

*Adjustments to the comparables must be made for special or creative financing or sales concessions. No adjustments are necessary for those costs which are normally paid by sellers as a result of tradition or law in a market area; these costs are readily identifiable since the seller pays these costs in virtually all sales transactions. Special or creative financing adjustments can be made to the comparable property by comparisons to financing terms offered by a third party institutional lender that is not already involved in the property or transaction. Any adjustment should not be calculated on a mechanical dollar for dollar cost of the financing or concession but the dollar amount of any adjustment should approximate the market's reaction to the financing or concessions based on the appraiser's judgment.

STATEMENT OF ASSUMPTIONS AND LIMITING CONDITIONS: The appraiser's certification in this report is subject to the following assumptions and limiting conditions:

1. The appraiser will not be responsible for matters of a legal nature that affect either the property being appraised or the title to it, except for information that he or she became aware of during the research involved in performing this appraisal. The appraiser assumes that the title is good and marketable and will not render any opinions about the title.
2. The appraiser has provided a sketch in this appraisal report to show the approximate dimensions of the improvements. The sketch is included only to assist the reader in visualizing the property and understanding the appraiser's determination of its size.
3. The appraiser has examined the available flood maps that are provided by the Federal Emergency Management Agency (or other data sources) and has noted in this appraisal report whether any portion of the subject site is located in an identified Special Flood Hazard Area. Because the appraiser is not a surveyor, he or she makes no guarantees, express or implied, regarding this determination.
4. The appraiser will not give testimony or appear in court because he or she made an appraisal of the property in question, unless specific arrangements to do so have been made beforehand, or as otherwise required by law.
5. The appraiser has noted in this appraisal report any adverse conditions (such as needed repairs, deterioration, the presence of hazardous wastes, toxic substances, etc.) observed during the inspection of the subject property or that he or she became aware of during the research involved in performing the appraisal. Unless otherwise stated in this appraisal report, the appraiser has no knowledge of any hidden or unapparent physical deficiencies or adverse conditions of the property (such as, but not limited to, needed repairs, deterioration, the presence of hazardous wastes, toxic substances, adverse environmental conditions, etc.) that would make the property less valuable, and has assumed that there are no such conditions and makes no guarantees or warranties, express or implied. The appraiser will not be responsible for any such conditions that do exist or for any engineering or testing that might be required to discover whether such conditions exist. Because the appraiser is not an expert in the field of environmental hazards, this appraisal report must not be considered as an environmental assessment of the property.
6. The appraiser has based his or her appraisal report and valuation conclusion for an appraisal that is subject to satisfactory completion, repairs, or alterations on the assumption that the completion, repairs, or alterations of the subject property will be performed in a professional manner.

Uniform Residential Appraisal Report

File # BRE26001923

APPRAISER'S CERTIFICATION: The Appraiser certifies and agrees that:

1. I have, at a minimum, developed and reported this appraisal in accordance with the scope of work requirements stated in this appraisal report.
2. I performed a complete visual inspection of the interior and exterior areas of the subject property. I reported the condition of the improvements in factual, specific terms. I identified and reported the physical deficiencies that could affect the livability, soundness, or structural integrity of the property.
3. I performed this appraisal in accordance with the requirements of the Uniform Standards of Professional Appraisal Practice that were adopted and promulgated by the Appraisal Standards Board of The Appraisal Foundation and that were in place at the time this appraisal report was prepared.
4. I developed my opinion of the market value of the real property that is the subject of this report based on the sales comparison approach to value. I have adequate comparable market data to develop a reliable sales comparison approach for this appraisal assignment. I further certify that I considered the cost and income approaches to value but did not develop them, unless otherwise indicated in this report.
5. I researched, verified, analyzed, and reported on any current agreement for sale for the subject property, any offering for sale of the subject property in the twelve months prior to the effective date of this appraisal, and the prior sales of the subject property for a minimum of three years prior to the effective date of this appraisal, unless otherwise indicated in this report.
6. I researched, verified, analyzed, and reported on the prior sales of the comparable sales for a minimum of one year prior to the date of sale of the comparable sale, unless otherwise indicated in this report.
7. I selected and used comparable sales that are locationally, physically, and functionally the most similar to the subject property.
8. I have not used comparable sales that were the result of combining a land sale with the contract purchase price of a home that has been built or will be built on the land.
9. I have reported adjustments to the comparable sales that reflect the market's reaction to the differences between the subject property and the comparable sales.
10. I verified, from a disinterested source, all information in this report that was provided by parties who have a financial interest in the sale or financing of the subject property.
11. I have knowledge and experience in appraising this type of property in this market area.
12. I am aware of, and have access to, the necessary and appropriate public and private data sources, such as multiple listing services, tax assessment records, public land records and other such data sources for the area in which the property is located.
13. I obtained the information, estimates, and opinions furnished by other parties and expressed in this appraisal report from reliable sources that I believe to be true and correct.
14. I have taken into consideration the factors that have an impact on value with respect to the subject neighborhood, subject property, and the proximity of the subject property to adverse influences in the development of my opinion of market value. I have noted in this appraisal report any adverse conditions (such as, but not limited to, needed repairs, deterioration, the presence of hazardous wastes, toxic substances, adverse environmental conditions, etc.) observed during the inspection of the subject property or that I became aware of during the research involved in performing this appraisal. I have considered these adverse conditions in my analysis of the property value, and have reported on the effect of the conditions on the value and marketability of the subject property.
15. I have not knowingly withheld any significant information from this appraisal report and, to the best of my knowledge, all statements and information in this appraisal report are true and correct.
16. I stated in this appraisal report my own personal, unbiased, and professional analysis, opinions, and conclusions, which are subject only to the assumptions and limiting conditions in this appraisal report.
17. I have no present or prospective interest in the property that is the subject of this report, and I have no present or prospective personal interest or bias with respect to the participants in the transaction. I did not base, either partially or completely, my analysis and/or opinion of market value in this appraisal report on the race, color, religion, sex, age, marital status, handicap, familial status, or national origin of either the prospective owners or occupants of the subject property or of the present owners or occupants of the properties in the vicinity of the subject property or on any other basis prohibited by law.
18. My employment and/or compensation for performing this appraisal or any future or anticipated appraisals was not conditioned on any agreement or understanding, written or otherwise, that I would report (or present analysis supporting) a predetermined specific value, a predetermined minimum value, a range or direction in value, a value that favors the cause of any party, or the attainment of a specific result or occurrence of a specific subsequent event (such as approval of a pending mortgage loan application).
19. I personally prepared all conclusions and opinions about the real estate that were set forth in this appraisal report. If I relied on significant real property appraisal assistance from any individual or individuals in the performance of this appraisal or the preparation of this appraisal report, I have named such individual(s) and disclosed the specific tasks performed in this appraisal report. I certify that any individual so named is qualified to perform the tasks. I have not authorized anyone to make a change to any item in this appraisal report; therefore, any change made to this appraisal is unauthorized and I will take no responsibility for it.
20. I identified the lender/client in this appraisal report who is the individual, organization, or agent for the organization that ordered and will receive this appraisal report.

Uniform Residential Appraisal Report

File # BRE26001923

21. The lender/client may disclose or distribute this appraisal report to: the borrower; another lender at the request of the borrower; the mortgagee or its successors and assigns; mortgage insurers; government sponsored enterprises; other secondary market participants; data collection or reporting services; professional appraisal organizations; any department, agency, or instrumentality of the United States; and any state, the District of Columbia, or other jurisdictions; without having to obtain the appraiser's or supervisory appraiser's (if applicable) consent. Such consent must be obtained before this appraisal report may be disclosed or distributed to any other party (including, but not limited to, the public through advertising, public relations, news, sales, or other media).
22. I am aware that any disclosure or distribution of this appraisal report by me or the lender/client may be subject to certain laws and regulations. Further, I am also subject to the provisions of the Uniform Standards of Professional Appraisal Practice that pertain to disclosure or distribution by me.
23. The borrower, another lender at the request of the borrower, the mortgagee or its successors and assigns, mortgage insurers, government sponsored enterprises, and other secondary market participants may rely on this appraisal report as part of any mortgage finance transaction that involves any one or more of these parties.
24. If this appraisal report was transmitted as an "electronic record" containing my "electronic signature," as those terms are defined in applicable federal and/or state laws (excluding audio and video recordings), or a facsimile transmission of this appraisal report containing a copy or representation of my signature, the appraisal report shall be as effective, enforceable and valid as if a paper version of this appraisal report were delivered containing my original hand written signature.
25. Any intentional or negligent misrepresentation(s) contained in this appraisal report may result in civil liability and/or criminal penalties including, but not limited to, fine or imprisonment or both under the provisions of Title 18, United States Code, Section 1001, et seq., or similar state laws.

SUPERVISORY APPRAISER'S CERTIFICATION: The Supervisory Appraiser certifies and agrees that:

1. I directly supervised the appraiser for this appraisal assignment, have read the appraisal report, and agree with the appraiser's analysis, opinions, statements, conclusions, and the appraiser's certification.
2. I accept full responsibility for the contents of this appraisal report including, but not limited to, the appraiser's analysis, opinions, statements, conclusions, and the appraiser's certification.
3. The appraiser identified in this appraisal report is either a sub-contractor or an employee of the supervisory appraiser (or the appraisal firm), is qualified to perform this appraisal, and is acceptable to perform this appraisal under the applicable state law.
4. This appraisal report complies with the Uniform Standards of Professional Appraisal Practice that were adopted and promulgated by the Appraisal Standards Board of The Appraisal Foundation and that were in place at the time this appraisal report was prepared.
5. If this appraisal report was transmitted as an "electronic record" containing my "electronic signature," as those terms are defined in applicable federal and/or state laws (excluding audio and video recordings), or a facsimile transmission of this appraisal report containing a copy or representation of my signature, the appraisal report shall be as effective, enforceable and valid as if a paper version of this appraisal report were delivered containing my original hand written signature.

APPRAISER

Signature Matthew Blevins
Name Matthew Blevins
Company Name ARK Appraisals, LLC
Company Address 1045 Lonesome Pine Rd
Kingston Springs, TN 37082
Telephone Number 615-955-3947
Email Address MatthewBlevins@ARKAppraisals.com
Date of Signature and Report 08/09/2026
Effective Date of Appraisal 08/06/2026
State Certification # 6235
or State License # _____
or Other (describe) _____ State # _____
State TN
Expiration Date of Certification or License 06/13/2028

ADDRESS OF PROPERTY APPRAISED

9614 Deer Track Ct
Brentwood, TN 37027
APPRAISED VALUE OF SUBJECT PROPERTY \$ 2,275,000

LENDER/CLIENT

Name Appraisal Marketplace LLC
Company Name Churchill Mortgage Corporation
Company Address 1749 Mallory Lane, Suite 100, Brentwood, TN
37027
Email Address N/A

SUPERVISORY APPRAISER (ONLY IF REQUIRED)

Signature _____
Name _____
Company Name _____
Company Address _____
Telephone Number _____
Email Address _____
Date of Signature _____
State Certification # _____
or State License # _____
State _____
Expiration Date of Certification or License _____

SUBJECT PROPERTY

- ☐ Did not inspect subject property
☐ Did inspect exterior of subject property from street
Date of Inspection _____
☐ Did inspect interior and exterior of subject property
Date of Inspection _____

COMPARABLE SALES

- ☐ Did not inspect exterior of comparable sales from street
☐ Did inspect exterior of comparable sales from street
Date of Inspection _____

UNIFORM APPRAISAL DATASET (UAD) DEFINITIONS ADDENDUM
(Source: Fannie Mae UAD Appendix D: UAD Field-Specific Standardization Requirements)

Condition Ratings and Definitions

C1

The improvements have been recently constructed and have not been previously occupied. The entire structure and all components are new and the dwelling features no physical depreciation.

Note: Newly constructed improvements that feature recycled or previously used materials and/or components can be considered new dwellings provided that the dwelling is placed on a 100 percent new foundation and the recycled materials and the recycled components have been rehabilitated/remanufactured into like-new condition. Improvements that have not been previously occupied are not considered “new” if they have any significant physical depreciation (that is, newly constructed dwellings that have been vacant for an extended period of time without adequate maintenance or upkeep).

C2

The improvements feature no deferred maintenance, little or no physical depreciation, and require no repairs. Virtually all building components are new or have been recently repaired, refinished, or rehabilitated. All outdated components and finishes have been updated and/or replaced with components that meet current standards. Dwellings in this category are either almost new or have been recently completely renovated and are similar in condition to new construction.

Note: The improvements represent a relatively new property that is well maintained with no deferred maintenance and little or no physical depreciation, or an older property that has been recently completely renovated.

C3

The improvements are well maintained and feature limited physical depreciation due to normal wear and tear. Some components, but not every major building component, may be updated or recently rehabilitated. The structure has been well maintained.

Note: The improvement is in its first-cycle of replacing short-lived building components (appliances, floor coverings, HVAC, etc.) and is being well maintained. Its estimated effective age is less than its actual age. It also may reflect a property in which the majority of short-lived building components have been replaced but not to the level of a complete renovation.

C4

The improvements feature some minor deferred maintenance and physical deterioration due to normal wear and tear. The dwelling has been adequately maintained and requires only minimal repairs to building components/mechanical systems and cosmetic repairs. All major building components have been adequately maintained and are functionally adequate.

Note: The estimated effective age may be close to or equal to its actual age. It reflects a property in which some of the short-lived building components have been replaced, and some short-lived building components are at or near the end of their physical life expectancy; however, they still function adequately. Most minor repairs have been addressed on an ongoing basis resulting in an adequately maintained property.

C5

The improvements feature obvious deferred maintenance and are in need of some significant repairs. Some building components need repairs, rehabilitation, or updating. The functional utility and overall livability is somewhat diminished due to condition, but the dwelling remains useable and functional as a residence.

Note: Some significant repairs are needed to the improvements due to the lack of adequate maintenance. It reflects a property in which many of its short-lived building components are at the end of or have exceeded their physical life expectancy but remain functional.

C6

The improvements have substantial damage or deferred maintenance with deficiencies or defects that are severe enough to affect the safety, soundness, or structural integrity of the improvements. The improvements are in need of substantial repairs and rehabilitation, including many or most major components.

Note: Substantial repairs are needed to the improvements due to the lack of adequate maintenance or property damage. It reflects a property with conditions severe enough to affect the safety, soundness, or structural integrity of the improvements.

Quality Ratings and Definitions

Q1

Dwellings with this quality rating are usually unique structures that are individually designed by an architect for a specified user. Such residences typically are constructed from detailed architectural plans and specifications and feature an exceptionally high level of workmanship and exceptionally high-grade materials throughout the interior and exterior of the structure. The design features exceptionally high-quality exterior refinements and ornamentation, and exceptionally high-quality interior refinements. The workmanship, materials, and finishes throughout the dwelling are of exceptionally high quality.

Q2

Dwellings with this quality rating are often custom designed for construction on an individual property owner’s site. However, dwellings in this quality grade are also found in high-quality tract developments featuring residence constructed from individual plans or from highly modified or upgraded plans. The design features detailed, high quality exterior ornamentation, high-quality interior refinements, and detail. The workmanship, materials, and finishes throughout the dwelling are generally of high or very high quality.

UNIFORM APPRAISAL DATASET (UAD) DEFINITIONS ADDENDUM

(Source: Fannie Mae UAD Appendix D: UAD Field-Specific Standardization Requirements)

Quality Ratings and Definitions (continued)

Q3

Dwellings with this quality rating are residences of higher quality built from individual or readily available designer plans in above-standard residential tract developments or on an individual property owner’s site. The design includes significant exterior ornamentation and interiors that are well finished. The workmanship exceeds acceptable standards and many materials and finishes throughout the dwelling have been upgraded from “stock” standards.

Q4

Dwellings with this quality rating meet or exceed the requirements of applicable building codes. Standard or modified standard building plans are utilized and the design includes adequate fenestration and some exterior ornamentation and interior refinements. Materials, workmanship, finish, and equipment are of stock or builder grade and may feature some upgrades.

Q5

Dwellings with this quality rating feature economy of construction and basic functionality as main considerations. Such dwellings feature a plain design using readily available or basic floor plans featuring minimal fenestration and basic finishes with minimal exterior ornamentation and limited interior detail. These dwellings meet minimum building codes and are constructed with inexpensive, stock materials with limited refinements and upgrades.

Q6

Dwellings with this quality rating are of basic quality and lower cost; some may not be suitable for year-round occupancy. Such dwellings are often built with simple plans or without plans, often utilizing the lowest quality building materials. Such dwellings are often built or expanded by persons who are professionally unskilled or possess only minimal construction skills. Electrical, plumbing, and other mechanical systems and equipment may be minimal or non-existent. Older dwellings may feature one or more substandard or non-conforming additions to the original structure

Definitions of Not Updated, Updated, and Remodeled

Not Updated

Little or no updating or modernization. This description includes, but is not limited to, new homes. Residential properties of fifteen years of age or less often reflect an original condition with no updating, if no major components have been replaced or updated. Those over fifteen years of age are also considered not updated if the appliances, fixtures, and finishes are predominantly dated. An area that is ‘Not Updated’ may still be well maintained and fully functional, and this rating does not necessarily imply deferred maintenance or physical/functional deterioration.

Updated

The area of the home has been modified to meet current market expectations. These modifications are limited in terms of both scope and cost. An updated area of the home should have an improved look and feel, or functional utility. Changes that constitute updates include refurbishment and/or replacing components to meet existing market expectations. Updates do not include significant alterations to the existing structure.

Remodeled

Significant finish and/or structural changes have been made that increase utility and appeal through complete replacement and/or expansion. A remodeled area reflects fundamental changes that include multiple alterations. These alterations may include some or all of the following: replacement of a major component (cabinet(s), bathtub, or bathroom tile), relocation of plumbing/gas fixtures/appliances, significant structural alterations (relocating walls, and/or the addition of) square footage). This would include a complete gutting and rebuild.

Explanation of Bathroom Count

Three-quarter baths are counted as a full bath in all cases. Quarter baths (baths that feature only a toilet) are not included in the bathroom count. The number of full and half baths is reported by separating the two values using a period, where the full bath count is represented to the left of the period and the half bath count is represented to the right of the period.

Example:
3.2 indicates three full baths and two half baths.

UNIFORM APPRAISAL DATASET (UAD) DEFINITIONS ADDENDUM

(Source: Fannie Mae UAD Appendix D: UAD Field-Specific Standardization Requirements)

Abbreviations Used in Data Standardization Text

Abbreviation	Full Name	Fields Where This Abbreviation May Appear
ac	Acres	Area, Site
AdjPrk	Adjacent to Park	Location
AdjPwr	Adjacent to Power Lines	Location
A	Adverse	Location & View
ArmLth	Arms Length Sale	Sale or Financing Concessions
ba	Bathroom(s)	Basement & Finished Rooms Below Grade
br	Bedroom	Basement & Finished Rooms Below Grade
B	Beneficial	Location & View
Cash	Cash	Sale or Financing Concessions
CtySky	City View Skyline View	View
CtyStr	City Street View	View
Comm	Commercial Influence	Location
c	Contracted Date	Date of Sale/Time
Conv	Conventional	Sale or Financing Concessions
CrtOrd	Court Ordered Sale	Sale or Financing Concessions
DOM	Days On Market	Data Sources
e	Expiration Date	Date of Sale/Time
Estate	Estate Sale	Sale or Financing Concessions
FHA	Federal Housing Authority	Sale or Financing Concessions
GlfCse	Golf Course	Location
Glfvw	Golf Course View	View
Ind	Industrial	Location & View
in	Interior Only Stairs	Basement & Finished Rooms Below Grade
Lndfl	Landfill	Location
LtdSght	Limited Sight	View
Listing	Listing	Sale or Financing Concessions
Mtn	Mountain View	View
N	Neutral	Location & View
NonArm	Non-Arms Length Sale	Sale or Financing Concessions
BsyRd	Busy Road	Location
o	Other	Basement & Finished Rooms Below Grade
Prk	Park View	View
Pstrl	Pastoral View	View
PwrLn	Power Lines	View
PubTrn	Public Transportation	Location
rr	Recreational (Rec) Room	Basement & Finished Rooms Below Grade
Relo	Relocation Sale	Sale or Financing Concessions
REO	REO Sale	Sale or Financing Concessions
Res	Residential	Location & View
RH	USDA - Rural Housing	Sale or Financing Concessions
s	Settlement Date	Date of Sale/Time
Short	Short Sale	Sale or Financing Concessions
sf	Square Feet	Area, Site, Basement
sqm	Square Meters	Area, Site
Unk	Unknown	Date of Sale/Time
VA	Veterans Administration	Sale or Financing Concessions
w	Withdrawn Date	Date of Sale/Time
wo	Walk Out Basement	Basement & Finished Rooms Below Grade
wu	Walk Up Basement	Basement & Finished Rooms Below Grade
WtrFr	Water Frontage	Location
Wtr	Water View	View
Woods	Woods View	View

Other Appraiser-Defined Abbreviations

[illegible]

Supplemental Addendum

File No. BRE26001923

Borrower	Jonathan De Jong & Madisyn De Jong					
Property Address	9614 Deer Track Ct					
City	Brentwood	County	Williamson	State	TN	Zip Code 37027
Lender/Client	Churchill Mortgage Corporation					

- **URAR: Neighborhood - Description :** The subject is located in Bonbrook The Est Of Ph 4 neighborhood, a (tract and semi-custom home development) with Q5 to Q1 quality homes located in Brentwood, TN . Construction began approximately 168 years ago and was built out approximately 00 years ago. Typical conforming properties range from 3000 SF to 8000 SF including one-story, two-story or multi-level designs.
- **URAR: Neighborhood - Predominant Sale Price:** The neighborhood predominant price of \$2,150 ,000 is the mode and not necessarily representative of properties competitive with the subject. The subject's GLA of 5,078 is similar to the predominant GLA of One-Unit Housing in the neighborhood.
- **URAR: Neighborhood - Land Use:** 30% Other Land Use includes undeveloped public & private land, rivers, parks, and other non-residential land uses.

• **URAR: Neighborhood - Market Conditions**

General market conditions continued : Property values in the market area are currently **stable** with supply and demand **in balance**. The median price in the past year was \$2,150,000 with 209 sales with 18 days on market. There were 102 listings in the prior 3 months with a median list price of \$2,299,450 with 3.8 months of supply.

Neighborhood competitive property market conditions: Property values of competitive properties to the subject in the neighborhood are currently **stable** with supply and demand in **balance**. The median price of competitive properties in the past year was \$2,150,000 with 209 sales with 18 days on market. There are currently 102 competitive listings with a median list price of \$2,299,450 with 3.8 months of supply.

Sales Concessions: It is common for the typical buyer to seek out seller paid financing assistance including but not limited to seller paid closing costs, lender pre-paid items, and/or discount points. While this is common, not all sellers agree to such incentives, and this activity is not necessary to attract a ready, willing, and able buyer. The presence of sales concessions and the level of contributions has remained stable over the prior 12 months. Seller contributions when present are typically 3% or less of the sales price or loan amount.

• **URAR: Sales Comparison Analysis - Summary of Sales Comparison Approach**

Comparable sale search parameters

Within the market boundaries of Old Hickory Blvd to the north, the 840 freeway to the south, Nolensville Rd to the east and the 65 freeway to the west.

***Due to the spread out nature of the subject's market, and the lack of recent and relevant closed comparables with a similar age, lot size, quality of construction, and finished basement level to the subject, it was necessary to extend the search out 3 miles and back 12 months. All comparables chosen are from within the same county, city, and school district with no location adjustments necessary per MLS analysis.

Comparable sale selection

- Comp 1** - Similar design, condition, and finished basement level to the subject. Adjustments made due to superior lot size, above grade GLA, car storage, and fireplace count in the subject, as well as superior below grade GLA, 2nd covered patio, pool, and built-in BBQ in comp 1.
- Comp 2** - Similar in design, condition, and finished basement space to the subject. Adjustments made due to superior lot size, above grade GLA, car storage, and fireplace count in the subject, as well as below grade finished GLA in comp 2.
- Comp 3** - Brackets the upper end of value and has a similar design and finished basement level. A 5% adjustment was made to the condition line due to superior condition of finishes in comp 3's kitchen, baths, and exterior. Additional adjustments made due to superior lot size, below grade finished GLA, car storage, and fireplace count in the subject, as well as location (gated community), above grade GLA & bath count in comp 3.
- Comp 4** - Similar in design, location, and total living area. Although comp 4 does not feature a finished basement space, it brackets the upper end of lot size and car storage. A 5% adjustment was made to the condition line due to superior condition of finishes in the subject's kitchen, baths, and flooring. Additional adjustments made due to superior above grade GLA & bath count in comp 4, as well as below grade finished GLA & bath count, screened-in deck, and fireplace count in the subject.
- Comp 5** - Closed comparable with similar design, condition, and finished basement space to the subject. Adjustments made due to superior lot size, below grade GLA, car storage, and fireplace count in the subject, as well as above grade GLA & bath count, elevator, and built-in BBQ in comp 5.
- Comp 6** - Active listing comparable with similar location to the subject, located on the same street as the subject and features a similar design and basement level. A 5% adjustment was made to the condition line due to recent updating in the subject's kitchen and bathrooms. Additional adjustments made due to superior lot size and below grade GLA in the subject, as well as for elevator in comp 6.

Adjustments summary

Market Conditions: Market conditions have generally **improved** over time with some segments of the market increasing at different rates than others based on supply and demand within various markets. Efforts are made to select recent sales with market condition adjustments applied where it looks like there has been a material change in prices over time as a result of changing market condition. **Per the included market trend analysis the market has remained stable over the past 12 months with no time adjustments deemed necessary.**

Location: Every effort is made to find comparable sales with similar physical features in similar competing neighborhoods. Usually the neighborhoods are generally competitive with each other and are considered to be similar enough that a typical buyer would consider properties in both neighborhoods, even though there may be some distances between the neighborhoods and there may be some differences in subdivision amenities. Location considerations include predominant values, location and access to both public and common area private amenities that affect either the subdivision or the competing neighborhood. Location adjustments are made where there is a clear influence on price due to locational differences. **A 2% adjustment was made for beneficial locations such as in gated communities per paired sales analysis.**

Site: Adjustments in this section of the grid reflect differences in the value of the site due to size and physical features such as terrain and/or off site improvements. Residential lots generally have diminishing returns where marginal lot size is concerned. Additional yard and buffer from adjoining properties contributes to the overall value, but at a lower rate than the primary building pad for the house. As a result, the difference in marginal lot size is adjusted at a lower rate than the overall site value per square foot or per acre. **Site adjustments made at \$2 per sf for differences greater than 5,000 sf per paired sales analysis.**

Supplemental Addendum					File No. BRE26001923	
Borrower	Jonathan De Jong & Madisyn De Jong					
Property Address	9614 Deer Track Ct					
City	Brentwood	County	Williamson	State	TN	Zip Code 37027
Lender/Client	Churchill Mortgage Corporation					

View: Adjustments are made based on the direct influence attributed to the site view or setting. View adjustments can be subjective, but can have a significant impact on value. **The subject and all comparables feature similar residential views with no views adjustments deemed necessary.**

Design (Style): **No quantifiable value difference indicated per MLS data analysis for different style homes or stories & no adjustments deemed warranted.**

Quality of Construction: Adjustments for quality take into consideration both the exterior and interior quality of workmanship and materials. As the adjustment is a lump adjustment that considers overall quality characteristics of the property. Homes within the same quality class may have some differences in overall quality where adjustments are made to reflect material differences based on market preferences for differences in quality characteristics. Small differences within the same quality class are usually adjusted within the "Upgrades/Features" section of the grid with large adjustments made to reflect significant quality class differences. Cost data is used as a guide in developing the quality adjustments as measured by market activity reflected in the comparable sales that are provided. **A 5% adjustment was made to the quality of construction line due to superior quality of interior finishes or exterior finishes where necessary and described in the above sales comparable selection section where necessary,**

Age/Condition: No year built parameters set as all year built differences reflected on condition line of grid as effective age. **A 10% adjustment to C4 condition properties and a 5% adjustment within the C3 condition rating where necessary and described in the above 'Comparable Sales Selection' section. Adjustments determined per paired sales analysis.**

Room Count/Bathrooms: Bedroom or Total Room count adjustments are only applied when the room count has a material impact on the value of the property. In most cases the Gross Living Area adjustment adequately reflects differences in room count. Often a buyer will prefer fewer rooms that are larger where the total rooms or bedrooms have a minimal impact on value. While there can be variation depending on the quality and extent of the bathroom improvements, typically the market will pay a premium for additional bathrooms. Half bathrooms are adjusted accordingly. **Bedroom count adjustment included in the GLA adjustment and bathrooms adjusted at \$20,000 per full bath and \$10,000 per half bath per paired sales analysis.**

Gross Living Area (GLA): GLA is adjusted on the basis of the square footage difference of the above-grade living area. The GLA adjustment is applied based on the estimated replacement cost new of the subject property less all forms of depreciation. Above-grade area is adjusted where there is more than 100 square foot difference in GLA. The allocated size adjustments are generally consistent with **paired sales with a sensitivity or depreciated cost analysis** used to insure the adjustments are consistent with market activity. **Per paired sales analysis, above grade GLA adjusted at \$125 per sf and below grade finished GLA adjusted at \$100 per sf for differences greater than 100 sf.**

Garage/Carport: Adjustments for garages and/or carports take into consideration two factors; the size of the garage and the number of cars the facility can park. Typically a garage will contribute more per car depending on the size, finish, and quality. Carports tend to be between 50% - 60% of the garage cost. Tandem garages are rated as inferior when compared to side by side 3-Car garages. Typical garage bays are from 200 to 300 square feet per car. **Per paired sales analysis additional garage stalls adjusted at \$20,000 each. and carport spaces at \$10,000 each.**

Porches/Patios/Decks: Adjustments in this section of the grid consider porches, patios, decks, and related improvements that are part of the structure, but not considered in the GLA, Basement, or Garage/Carport adjustments. This adjustment is made on a net basis considering condition, quality, and size. **The subject and all comparables feature similar quality and size porch, patios, and decks. Adjustments made as follows: \$10,000 per porch/patio/deck and \$20,000 for covered or screened-in patio/deck.**

Other Improvements: This section of the grid takes into consideration improvements such as landscaping, sprinkler systems, fences/walls, pools, etc. While this adjustment can be rather subjective in nature, on site improvements can make a significant difference in the overall value of the property. **Paired sales have been** analyzed to determine contributory values of site improvements. Typically yard improvements do not contribute more than about 10% to 15% of the total value of the property. Pools typically contribute between about **\$10,000 and \$100,000** depending on the age, condition and quality of the pool and the segment of the market that the property is in. **Additional adjustments made per paired sales analysis as follows: \$5,000 per fireplace, \$10,000 for elevator or built-in BBQ, \$60,000 for in-ground pool and \$10,000 for fenced yard**

Value Ranges & Reconciled Values

My opinion of value of the Fee Simple Interest of the Subject is \$2,275,000 as of the effective date of 08/06/2026. This value is based exclusively in the results from the Sales Comparison Approach. The opinion of value is consistent with the results of the Cost Approach (within the limits of precision of that method) and the prior sales data.

*****Subject Description & Finishes*****

The subject property is an all brick construction 2-story home featuring 4 bedrooms and 3.1 bathrooms above grade, as well as a finished basement level. The main level features hardwood flooring throughout. The kitchen includes updated quartz countertops and high-end stainless steel appliances. The primary bath features separate vanities with granite countertops, updated tile flooring, and a separate soaker tub and tile wainscoted shower. The 2nd level includes 3 bedrooms with 2 full baths. Both bathrooms include tile flooring and updated tile wainscoted showers. The basement level includes a rec room with fireplace, 3 additional rooms, and a full bath with LVP flooring and tile wainscoted shower. The subject also features a built-in 4 car garage, screened-in deck, and patio off the basement level. All finishes are in average to good condition with normal signs of wear and tear for their age.

*The appraiser reserves the right to amend this report if any undisclosed information is given to him after its completion.

*For purpose of report, new major systems like electrical, plumbing, HVAC, roof & windows will be reflected on quality of construction line of grid.

*This appraisal was completed in compliance with AIR and the Dodd Frank Act.

*This specific market area of 37027 has a large range of single family homes with a variety of styles, year built, lot sizes, GLA,

Supplemental Addendum

File No. BRE26001923

Borrower	Jonathan De Jong & Madisyn De Jong					
Property Address	9614 Deer Track Ct					
City	Brentwood	County	Williamson	State	TN	Zip Code 37027
Lender/Client	Churchill Mortgage Corporation					

condition, additional features. A multitude of comparables were examined and omitted for a variety of reasons. All comparables chosen for one or more reasons be it to satisfy 1 or multiple typical requirements including bracketing the high and low end of the subjects GLA, lot size, age, condition, view, upgrades, quality of construction, additional features & location.

*When assessor data differs from MLS listings, additional research conducted with the Dept. of Building & Safety & all available channels with the most legitimately supported GLA data given priority. Greatest weight given to primary value contributing factors such as GLA, condition, upgrades, location & lot size. In some cases across the board adjustments for some secondary value contributing characteristics such as garage count & additional features might be necessary and if so were unavoidable.

*Final reconciliation adequately bracketed and supported.

*No quantifiable value difference indicated per MLS data analysis for different style homes or stories & no adjustments deemed warranted.

*If across the board adjustments are present, they were unavoidable and do not notably effect value, marketability or transferability.

*Appraiser aware of typically accepted line, net and gross adjustments and feels a broadening is warranted if an overall lack of similar data exists.

*The best available comparables were used in this report.

*Age differences reflected on the condition line of grid when applicable.

*Although subject property is within 10 miles of an airport. (Regional/Municipal/International); there is no negative effect on the marketability of the subject property due to noise and hazards of low flying aircraft.

*No effect on subject or market from any recent FEMA declarations. This includes recent FEMA declaration in January of 2026. method) and the prior sales data

Supplemental Addendum					File No. BRE26001923	
Borrower	Jonathan De Jong & Madisyn De Jong					
Property Address	9614 Deer Track Ct					
City	Brentwood	County	Williamson	State	TN	Zip Code 37027
Lender/Client	Churchill Mortgage Corporation					

EXPOSURE PERIOD

By studying the sales of similar comparable residential properties with value ranges as identified in the Neighborhood section of this report and discussions with individuals knowledgeable of current neighborhood trends in the subject area, this appraiser feels that the exposure time for the subject property is equal to the marketing time identified in the Neighborhood section of this report.

URAR: SALE COMPARISON COMMENTS

This appraiser used the best and most recent comparables available at the time of this reports date. This appraiser is aware that the most recent sales in the subject's subdivision are the best indicators of value for the subject property. If comparable sales sold within 30-60 days of the effective date of this report were not available, then this appraiser used the most recent and relevant comparables available at the time and date of this report. This appraiser used comparables sold within similar market conditions and times and feel that they reflect the indicated value of the subject property.

All comparables and the subject property are similar in age, location, general design and construction. The subject's value per square foot is within an acceptable range established by the market data unless otherwise noted.

All line item adjustments are either extracted from market data and represent what informed buyers are willing to pay for these items, or, when ideal matched pairs are not available and therefore market extraction is not possible, adjustments are derived from the cost of the line item new, less all forms of depreciation. No value has been given to any personal property or any unattached fixtures.

THE PREDOMINANT RANGE

The statistics for the predominate ranges are taken from a (+/-) three mile radius around the subject property and include all single family homes within this radius. Within this area, there are numerous single family homes that vary greatly in value as well as size. Therefore, the predominant value does not represent the predominant value of the single family residences within the subject's subdivision, and the predominant value does not affect the marketability of the subject property.

URAR: SQUARE FOOTAGE ANALYSIS

The gross living area calculations and room counts for the subject and comparables may vary from those figures indicated by county records due to this appraiser using the measured square footage for the subject property. This report reflects figures either from MLS, county records, or appraiser files which may indicate a different figure than those reported by other agencies. The calculations considered the most reliable were used in this report.

SUBJECT NEIGHBORHOOD

The neighborhood analysis is based upon, the neighborhood boundaries, market conditions and trends, employment, school, and shopping accessibility, public and, or private restrictions. The subject neighborhood mainly consists of one and two story single family homes, showing similar age and quality, all being conforming for a residential neighborhood. The accessibility of shopping, transportation, employment centers and freeway access is within 5 miles.

SUBJECT SITE

The subject site appears to be very typical and conforming in size and topography unless noted, landscaping, and maintenance, to the surrounding properties in the neighborhood. The subject site is level and is typical in size, completely landscaped in the front and rear and is accessed from a publicly maintained road. There were no adversities noted.

COST APPROACH

The Cost approach is based upon the present replacement cost to replace the building with another building having the same utility. Physical depreciation, functional and external obsolescence will be considered in the valuation process. The effective age of the property will be considered in correlation with the years remaining economic life. The Cost Approach should be considered supportive to the Market Approach.

MARKET APPROACH

The Market approach is the main supporter of value. It is primarily based on the sales of similar type properties in the subjects area and is known as the Principle of Substitution. The adjustments being made for the differences in the comparables, compared to the subject property, is based upon an extensive research of Paired Sales Analysis. This determines what the market would return in value of that particular difference or possible amenity to the subject property. Most weight given to the most comparable sale or sales as noted in the report.

FINAL RECONCILIATION

After reviewing and analyzing all three approaches, The Market Approach, The Cost Approach and the Income Approach, The Market Approach was determined to be the strongest supporter of value. The Cost Approach was not considered and the Income Approach was considered to be not applicable for this type of property due to predominant owner occupancy and lack of rental data.

HYPOTHETICAL CONDITION

None Noted.

EXTRAORDINARY ASSUMPTION

It is assumed that all structures given value in this report are permitted unless otherwise noted. There are assumed to be no geological or environmental adversities. The lot is assumed to have no known easements. The type of utilities are assumed to be as stated and are assumed to be in good working order. This home is assumed to be owner occupied. The cost figures in the cost approach are assumed to be as stated. Although verified through city/county records, the zoning is assumed to be as stated. Any estimated cost to cure is assumed to be as stated. The physical characteristics of the comparables were either verified by city/county records, the MLS and/or homeowner verification/drive by inspection. It is assumed there are no sales concessions on the comparables unless noted. The use of these extraordinary assumptions might have affected the assignment results. If any of these items are found to be not true and or correct, I reserve the right to change my appraisal.

SCOPE OF WORK

The scope of work for this appraisal is defined by the complexity of this appraisal assignment and the reporting requirements of this appraisal report form, including the following definition of market value, statement of assumptions and limiting conditions, and certifications. The appraiser must, at a minimum: (1) perform a complete visual inspection of the interior and exterior areas of the subject property, (2) inspect the neighborhood, (3) inspect each of the comparables sales from at least the street, (4) research, verify, and analyze data from reliable public and/or private sources, and (5) report his or her analysis, opinions, and conclusions in this appraisal report.

JURISDICTIONAL EXCEPTION RULE

If any applicable law or regulation precludes compliance with any part of USPAP, only that part of USPAP becomes void for that assignment.

HIGHEST AND BEST USE ANALYSIS

The subject as improved is a legally permissible use based on it's current zoning. Also, the lot size, shape, physical condition and land to building ratio allow present structure and indicate a good utilization of the improvements. Based on current market conditions, its financial feasibility and maximum productive use is the present use and its structure as a single family residence.

****If any information in this appraisal is found to be untrue or incorrect, I reserve the right to change or amend at any time.****

Statement of Assumptions and Limiting Conditions: The appraiser's certification in this report is subject to the following assumptions and limiting conditions:

Supplemental Addendum

File No. BRE26001923

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				

- 1) The appraiser will not be responsible for matters of a legal nature that affect either the property being appraised or the title to it, except for information that he or she became aware of during the research involved in performing this appraisal. The appraiser assumes that the title is good and marketable and will not render any opinions about the title.
- 2) The appraiser has provided a sketch in this appraisal report to show the approximate dimensions of the improvements. The sketch is included only to assist the reader in visualizing the property & understanding the appraiser's determination of its size.
- 3) The appraiser has examined the available flood maps that are provided by the Federal Emergency Management Agency (or other data sources) and has noted in this appraisal report whether any portion of the subject site is located in an identified Special Flood Hazard Area. Because the appraiser is not a surveyor, he or she makes no guarantees, express or implied, regarding this determination.
- 4) The appraiser will not give testimony or appear in court because he or she made an appraisal of the property in question, unless specific arrangements to do so have been made beforehand, or as otherwise required by law.
- 5) The appraiser has based his or her appraisal report and valuation conclusion for an appraisal that is subject to satisfactory completion, repairs, or alterations on the assumption that the completion of the subject property will be performed in a professional manner.
- 6) The appraiser has noted in this appraisal report any adverse conditions (such as needed repairs, deterioration, the presence of hazardous wastes, toxic substances, etc.) observed during the inspection of the subject property or that he or she became aware of during the research involved in performing this appraisal. Unless otherwise stated in this appraisal report, the appraiser has no knowledge of any hidden or unapparent physical deficiencies or adverse conditions of the property (such as, but not limited to, needed repairs, deterioration, the presence of hazardous wastes, toxic substances, adverse environmental conditions, etc.) that would make the property less valuable, and has assumed that there are no such conditions and makes no guarantees or warranties, express or implied. The appraiser will not be responsible for any such conditions that do exist or for any engineering or testing that might be required to discover whether such conditions exist. Because the appraiser is not an expert in the field of environmental hazards, this appraisal report must not be considered as an environmental assessment of the property.

*This appraisal has a password protected secured digital electronic signature and can be edited only by the signatory appraiser.

*The intended use of this appraisal does not include issues of property insurance coverage.

*Reproduction or Replacement cost figures used in the cost approach are for valuation purposes only, given the intended use of the assignment.

*The Definition of Value used in this assignment is not consistent with the definition of Insurable Value for property insurance coverage. For these reasons, the cost approach is not considered valid as a basis for determining insurance coverage, and is null and void if so utilized.

*For the purposes of this report, an indication of "None or 0" with regard to the financing concessions of the comparables utilized in the sales comparison approach, may mean that they were not present, or their qualification or quantification was not possible.

*An estimate of a reasonable time for exposure in the open market is a condition in the definition of market value. The exposure time associated with the estimate of market value for the subject property is consistent with the marketing time noted in the Neighborhood section of this report. The marketing period concluded for the subject property at the estimated market value is also consistent with the marketing time noted in the Neighborhood section.

*If a purchase transaction, personal property which may have been included in the sale received no value for the purposes of this report. The appraiser specializes in the valuation of real property and is not a home inspector, building contractor, structural engineer, or similar expert, unless otherwise noted.

*The appraiser did not conduct the intensive type of field observations of the kind intended to seek and discover property defects. The viewing of the property and any improvements is for the purposes of developing an opinion of the defined value of the property, given the intended use of this assignment. Statements regarding condition are based on surface observations only.

*The appraiser claims no special expertise regarding issues including, but not limited to: foundation settlement, basement moisture problems, wood destroying(or other) insects, pest infestation, radon gas, lead based paint, mold or environmental issues. Unless otherwise indicated, mechanical systems were not activated or tested. This appraisal report should not be used to disclose the condition to the property as it relates to the presence/absence of defects. The client is invited and encouraged to employ qualified experts to inspect and address areas of concern. If negative conditions are discovered, the opinion of value may be affected.

*Unless otherwise noted, the appraiser assumes the components that constitute the subject property improvement(s) are fundamentally sound and in working order. Any viewing of the property by the appraiser was limited to readily observable areas. Unless otherwise noted, attics and crawl space areas were not accessed. The appraiser did not move furniture, floor coverings or other items that may restrict the viewing of the property.

*It is not considered unusual for the gross living area of the improvements as observed and measured by the appraiser at the time of inspection to differ from those noted by the assessor, title records, or other profile sources. Although the probability of discrepancies tends to be directly proportional to the age of the improvements as the general quality of record keeping decreases over time, discrepancies may also occur in newer construction when plan variations occur without assessor notification by responsible building departments or agencies. An extraordinary assumption is made that areas considered to be living area are legally such. The value may change should this not be true, and the appraiser reserves the right to change the appraisal.

*If this appraisal is used for lending or any purpose at all, at any time by any person or organization, the appraiser cannot be sued/litigated against for any reason, at any time.

*If this appraisal was performed for HUD/FHA, a "head & shoulders" inspection of the attic (if any) and an inspection of the crawl space (if any) from its exterior access point were performed, and unless otherwise noted the utilities are turned on and are in proper working order. *Second or third party defect or improvement disclosures, if incorporated into this report, were done so as extraordinary assumptions.

*If performed for a conventional loan, the appraiser has complied with the AIR in the preparation of this report. *Unless otherwise noted, no services regarding the subject property have been performed by the appraiser within the three year period immediately preceding the acceptance of this assignment, as an appraiser or in any other capacity.

*If performed for a conventional loan, adequate utilities were available and in service at the time of the inspection, unless otherwise noted.

*The distances between the subject property and comparables are approximate, and although comparable sale proximities were shown to two decimals to comply with UAD formatting requirements, they were in fact rounded to one decimal place.

****The appraiser reserves the right to amend this report if any undisclosed information is given to him after its completion.***

Market Conditions Addendum to the Appraisal Report

File No. BRE26001923

MARKET RESEARCH & ANALYSIS

The purpose of this addendum is to provide the lender/client with a clear and accurate understanding of the market trends and conditions prevalent in the subject neighborhood. This is a required addendum for all appraisal reports with an effective date on or after April 1, 2009.

Property Address	9614 Deer Track Ct	City	Brentwood	State	TN	ZIP Code	37027
Borrower	Jonathan De Jong & Madisyn De Jong						
Instructions: The appraiser must use the information required on this form as the basis for his/her conclusions, and must provide support for those conclusions, regarding housing trends and overall market conditions as reported in the Neighborhood section of the appraisal report form. The appraiser must fill in all the information to the extent it is available and reliable and must provide analysis as indicated below. If any required data is unavailable or is considered unreliable, the appraiser must provide an explanation. It is recognized that not all data sources will be able to provide data for the shaded areas below; if it is available, however, the appraiser must include the data in the analysis. If data sources provide the required information as an average instead of the median, the appraiser should report the available figure and identify it as an average. Sales and listings must be properties that compete with the subject property, determined by applying the criteria that would be used by a prospective buyer of the subject property. The appraiser must explain any anomalies in the data, such as seasonal markets, new construction, foreclosures, etc.							
Inventory Analysis	Prior 7–12 Months	Prior 4–6 Months	Current – 3 Months	Overall Trend			
Total # of Comparable Sales (Settled)	95	34	80	☐ Increasing	☒ Stable	☐ Declining	
Absorption Rate (Total Sales/Months)	15.83	11.33	26.67	☐ Increasing	☒ Stable	☐ Declining	
Total # of Comparable Active Listings	39	69	102	☐ Declining	☒ Stable	☐ Increasing	
Months of Housing Supply (Total Listings/Ab.Rate)	2.5	6.1	3.8	☐ Declining	☒ Stable	☐ Increasing	
Median Sale & List Price, DOM, Sale/List %	Prior 7–12 Months	Prior 4–6 Months	Current – 3 Months	Overall Trend			
Median Comparable Sale Price	\$2,100,000	\$2,212,495	\$2,100,000	☐ Increasing	☒ Stable	☐ Declining	
Median Comparable Sales Days on Market	24	25	12	☐ Declining	☒ Stable	☐ Increasing	
Median Comparable List Price	\$2,299,000	\$2,269,900	\$2,299,450	☐ Increasing	☒ Stable	☐ Declining	
Median Comparable Listings Days on Market	40	34	48	☐ Declining	☒ Stable	☐ Increasing	
Median Sale Price as % of List Price	98%	98%	100%	☐ Increasing	☒ Stable	☐ Declining	
Seller-(developer, builder, etc.)paid financial assistance prevalent?				☐ Yes	☒ No	☐ Declining ☒ Stable ☐ Increasing	
Explain in detail the seller concessions trends for the past 12 months (e.g., seller contributions increased from 3% to 5%, increasing use of buydowns, closing costs, condo fees, options, etc.). An analysis was performed on 209 competing sales over the past 12 months. For those sales, a total of 5.7% were reported to have seller concessions. This analysis shows a change of +999% per month.							
Are foreclosure sales (REO sales) a factor in the market? ☐ Yes ☒ No If yes, explain (including the trends in listings and sales of foreclosed properties).							
An analysis was performed on 209 competing sales over the past 12 months. For those sales, a total of 0.0% were reported to be REO.							
Cite data sources for above information. Information reported in the RealTracs system (using an effective date of 08/06/2026) was utilized to arrive at the results noted on this addendum. Any percent change results noted in these comments are based on simple regression.							
Summarize the above information as support for your conclusions in the Neighborhood section of the appraisal report form. If you used any additional information, such as an analysis of pending sales and/or expired and withdrawn listings, to formulate your conclusions, provide both an explanation and support for your conclusions.							
An analysis was performed on 209 competing sales (which excluded REO and short sales) over the past 12 months. The sales within this group had a median sale price of \$2,150,000. This analysis shows a change of 0% per month. In addition, an analysis was performed on 209 sales plus all active listings that are competing properties, over the past 12 months. Based on this entire set of data there is a 5.9 month supply. This analysis shows a change of +34% per month. These sales had a median DOM of 18. This analysis shows a change of -1% per month.							

CONDO/CO-OP PROJECTS

If the subject is a unit in a condominium or cooperative project , complete the following:


Subject Project Data	Prior 7–12 Months	Prior 4–6 Months	Current – 3 Months	Overall Trend		
Total # of Comparable Sales (Settled)				☐ Increasing	☐ Stable	☐ Declining
Absorption Rate (Total Sales/Months)				☐ Increasing	☐ Stable	☐ Declining
Total # of Active Comparable Listings				☐ Declining	☐ Stable	☐ Increasing
Months of Unit Supply (Total Listings/Ab.Rate)				☐ Declining	☐ Stable	☐ Increasing
Are foreclosure sales (REO sales) a factor in the project? ☐ Yes ☐ No If yes, indicate the number of REO listings and explain the trends in listings and sales of foreclosed properties.						
Summarize the above trends and address the impact on the subject unit and project.						

APPRaiser


Signature		Signature	
Appraiser Name	Matthew Blevins	Supervisory Appraiser Name	
Company Name	ARK Appraisals, LLC	Company Name	
Company Address	1045 Lonesome Pine Rd, Kingston Springs, TN 370	Company Address	
State License/Certification #	6235 State TN	State License/Certification #	State
Email Address	MatthewBlevins@ARKAppraisals.com	Email Address	

Photograph Addendum


Borrower	Jonathan De Jong & Madisyn De Jong					
Property Address	9614 Deer Track Ct					
City	Brentwood	County	Williamson	State	TN	Zip Code 37027
Lender/Client	Churchill Mortgage Corporation					

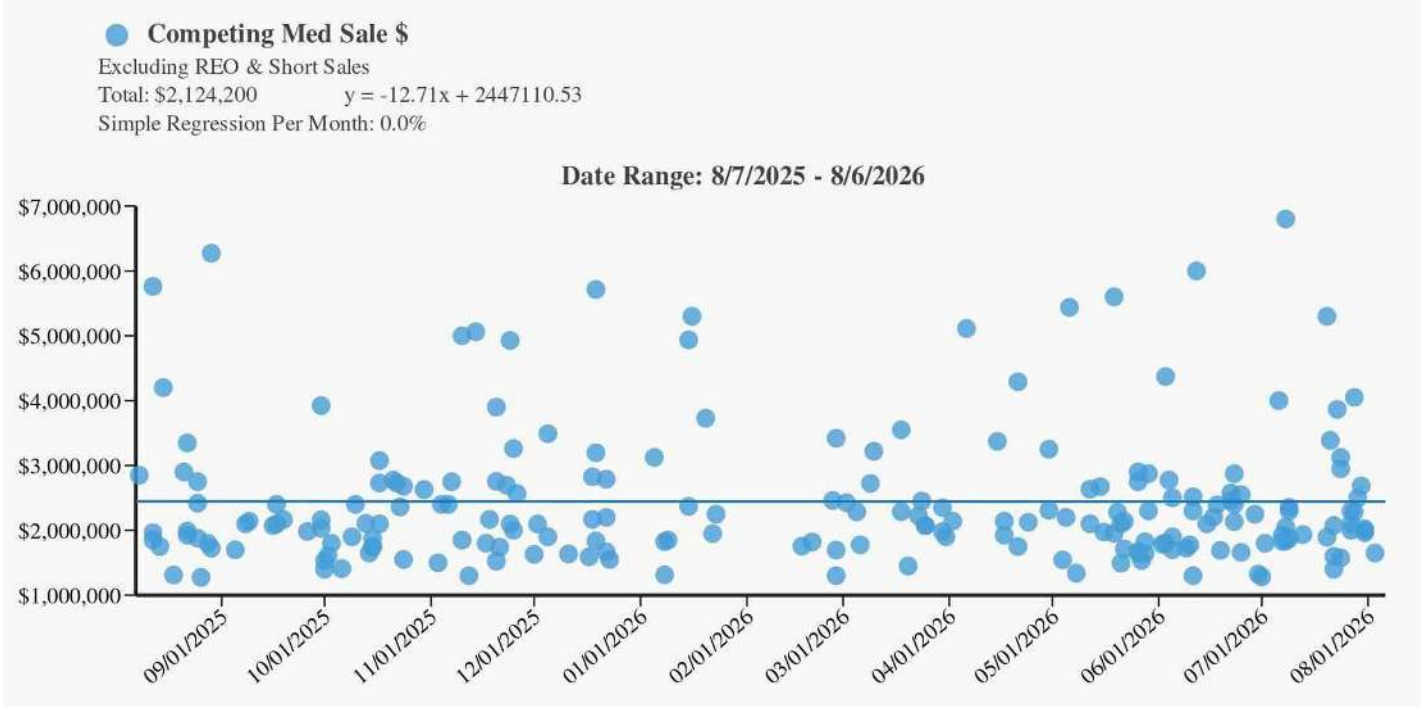

Median \$

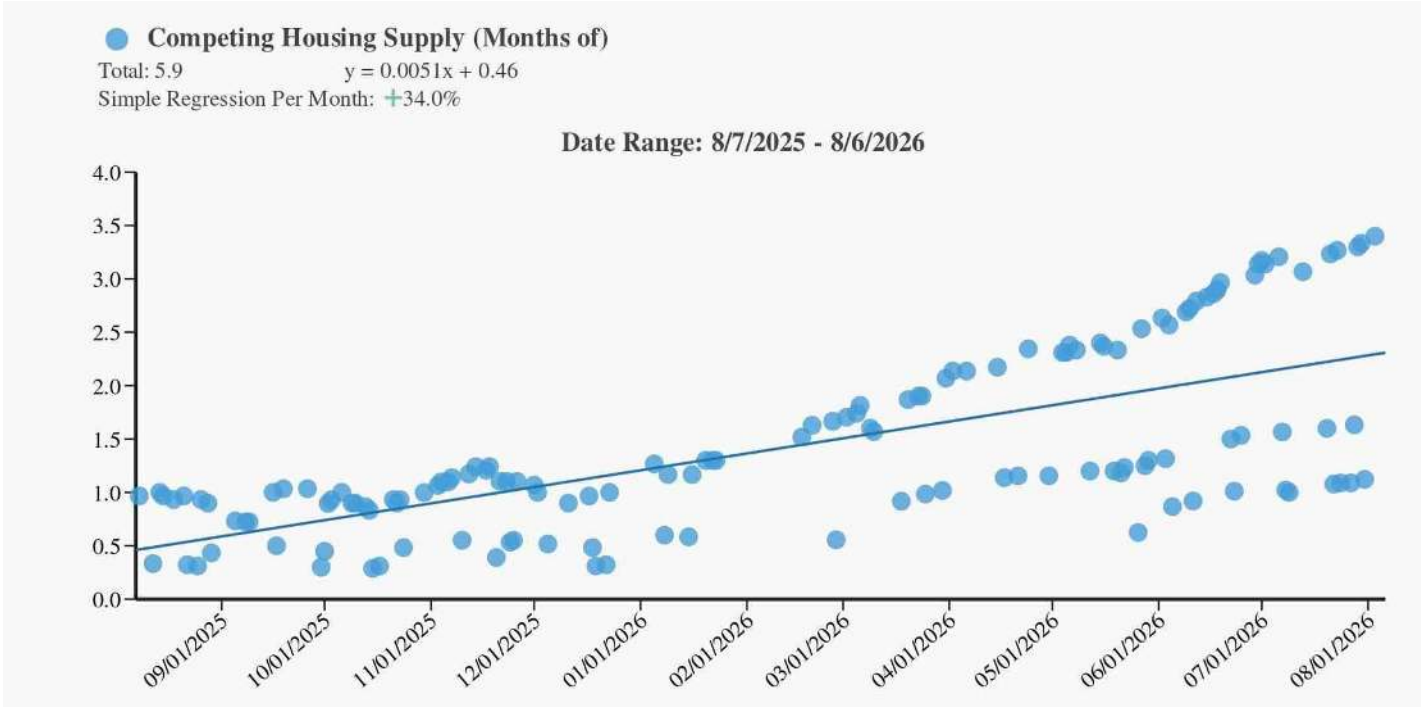

Housing Supply

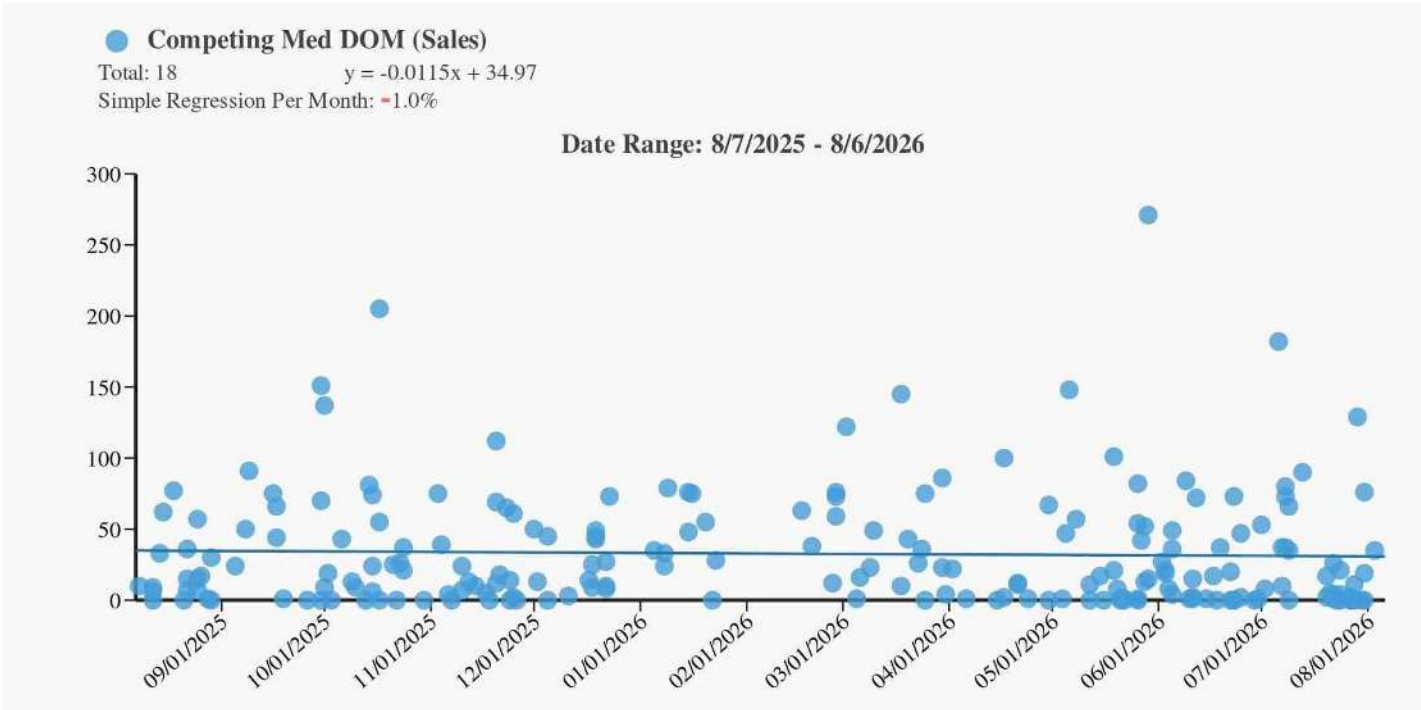

Sales DOM

Reconciliation Addendum

File No. BRE26001923

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				

• Comparable Summary

Comparables Summary & Estimated Indicated Value

	Sale Price	Net Adj %	Grs Adj %	Ind Value	Weight
Comp #1:	2,250,000	0.8	13.9	2,268,576	35
Comp #2:	2,139,000	4.4	7.7	2,233,664	25
Comp #3:	2,370,000	3.6	15.3	2,285,072	20
Comp #4:	1,975,000	10.4	22.9	2,179,750	10
Comp #5:	2,500,000	0.9	9.7	2,477,788	10
Comp #6:	2,100,000	6.4	7.3	2,234,182	0

ESTIMATED INDICATED VALUE OF THE SUBJECT: 2,275,000

• Indicated Weight Value

Estimated indicated value is determined by using the Gross Adjustment of sale price for each comparable as a measure of the relative quality of the comp. The Indicated Value is derived by multiplying the weight of each comp by the Adjusted Sale Price of that comp, repeating for each property, then adding them all together. This weighted average is used as the indicated value of the subject.

As with any method, this technique is not perfect. However, it does do a very good job of giving more weight to the most similar comps while at the same time minimizing values near the extremes of the indicated value range.

Subject Photo Page

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Subject Front

9614 Deer Track Ct	
Sales Price	2,250,000
Gross Living Area	5,078
Total Rooms	10
Total Bedrooms	4
Total Bathrooms	3.1
Location	N;Res;
View	N;Res;
Site	1.0 ac
Quality	Q3
Age	26



Subject Rear



Subject Street

Comparable Photo Page						
Borrower	Jonathan De Jong & Madisyn De Jong					
Property Address	9614 Deer Track Ct					
City	Brentwood	County	Williamson	State	TN	Zip Code 37027
Lender/Client	Churchill Mortgage Corporation					



Comparable 1

9717 Turquoise Ln	
Prox. to Subject	1.67 miles SE
Sale Price	2,250,000
Gross Living Area	4,349
Total Rooms	10
Total Bedrooms	4
Total Bathrooms	4.1
Location	N;Res;
View	N;Res;
Site	23522 sf
Quality	Q3
Age	20



Comparable 2

1245 Monarch Way	
Prox. to Subject	2.57 miles W
Sale Price	2,139,000
Gross Living Area	4,522
Total Rooms	10
Total Bedrooms	4
Total Bathrooms	3.1
Location	N;Res;
View	N;Res;
Site	30928 sf
Quality	Q3
Age	22



Comparable 3

9540 Sunbeam Ct	
Prox. to Subject	1.34 miles W
Sale Price	2,370,000
Gross Living Area	5,301
Total Rooms	10
Total Bedrooms	4
Total Bathrooms	4.2
Location	B;Res;Gated
View	N;Res;
Site	26136 sf
Quality	Q3
Age	7

Comparable Photo Page						
Borrower	Jonathan De Jong & Madisyn De Jong					
Property Address	9614 Deer Track Ct					
City	Brentwood	County	Williamson	State	TN	Zip Code 37027
Lender/Client	Churchill Mortgage Corporation					



Comparable 4

1058 Sunset Rd	
Prox. to Subject	0.49 miles N
Sale Price	1,975,000
Gross Living Area	5,904
Total Rooms	10
Total Bedrooms	4
Total Bathrooms	4.1
Location	N;Res;
View	N;Res;
Site	1.0 ac
Quality	Q3
Age	20



Comparable 5

9559 Hampton Reserve Dr	
Prox. to Subject	1.13 miles W
Sale Price	2,500,000
Gross Living Area	5,819
Total Rooms	10
Total Bedrooms	5
Total Bathrooms	4.1
Location	N;Res;
View	N;Res;
Site	22216 sf
Quality	Q3
Age	9



Comparable 6

9619 Deer Track Ct	
Prox. to Subject	0.08 miles SE
Sale Price	2,100,000
Gross Living Area	5,164
Total Rooms	10
Total Bedrooms	4
Total Bathrooms	3.1
Location	N;Res;
View	N;Res;
Site	35719 sf
Quality	Q3
Age	25

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Left Side



Right Side



View from Front



View from Rear



Front Porch



Foyer

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Family Room



Living Room



Dining Room



Kitchen



Kitchen



Pantry

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Breakfast Area



Den



Office



1/2 Bath



Bedroom 1



Bedroom 1

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Bedroom 1 - Walk In



Bathroom 1



Bathroom 1



Bathroom 1



Laundry



Stairway

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Bedroom 2



Bedroom 2



Bedroom 3



Bedroom 3



Bathroom 2



Bathroom 2

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Bathroom 2



Bedroom 4



Bedroom 4



Bathroom 3



Bathroom 3



Bathroom 3

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Stairway to Basement Level



Finished Basement - Rec Room



Finished Basement - Bonus Room



Finished Basement - Theater Room



Finished Basement - Gym



Finished Basement - Bathroom

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Unfinished Basement



Inside Garage



Patio



Screened-In Deck



Smoke Alarm / Carbon Monoxide Monitor



HVAC

Photograph Addendum

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Water Heater

No Photo


No Photo

No Photo

No Photo

No Photo

Building Sketch (Page - 1)					
Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				

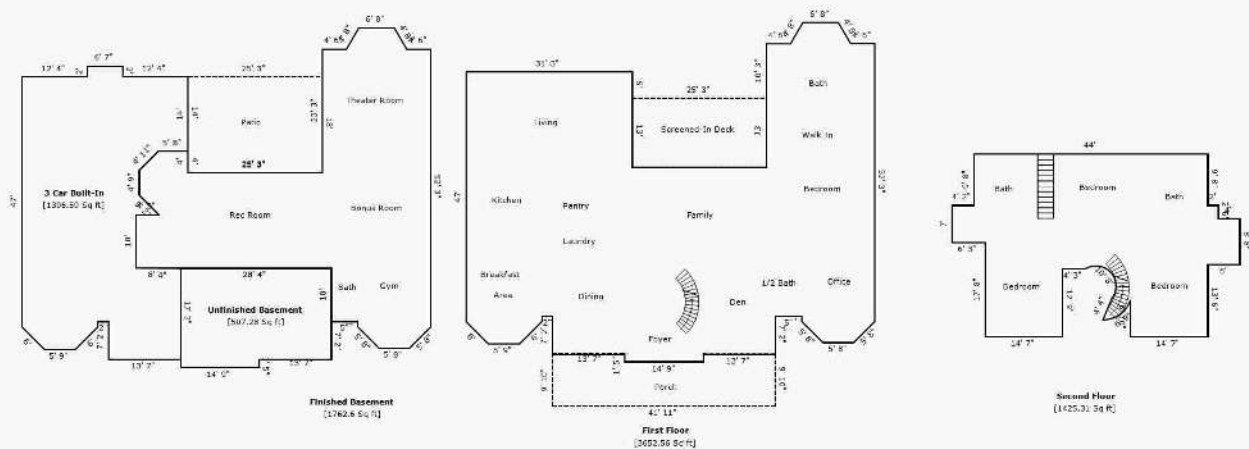

TOTAL Sketch by a la mode


Building Sketch (Page - 2)

Borrower	Jonathan De Jong & Madisyn De Jong					
Property Address	9614 Deer Track Ct					
City	Brentwood	County	Williamson	State	TN	Zip Code 37027
Lender/Client	Churchill Mortgage Corporation					

TOTAL Sketch by a la mode		Area Calculations Summary			
Living Area		Calculation Details			
First Floor	3652.56 Sq ft	14.75 × 1.42	=	20.9	
		0.5 × 2.33 × 4	=	4.67	
		0.5 × 4 × 2.33	=	4.67	
		6.67 × 4	=	26.67	
		0.5 × 4.5 × 0.01	=	0.01	
		15.83 × 0.01	=	0.1	
		20.33 × 23.25	=	472.75	
		31.25 × 18	=	562.5	
		76.83 × 27.99	=	2150.81	
		14.25 × 1	=	14.25	
		0.5 × 4.25 × 4.25	=	9.03	
		0.5 × 4.25 × 4.25	=	9.03	
		5.75 × 4.25	=	24.44	
		41.92 × 7.17	=	300.4	
		13.67 × 1	=	13.67	
		0.5 × 4 × 4	=	8	
		0.5 × 4 × 4	=	8	
		5.67 × 4	=	22.67	
Second Floor	1425.31 Sq ft	7 × 4.17	=	29.17	
		16.67 × 2.08	=	34.72	
		34.33 × 14.58	=	500.69	
		21.58 × 4.25	=	91.73	
		0.5 × 5.58 × 5	=	13.96	
		21.58 × 5	=	107.92	
		0.5 × 2.82 × 1.67	=	2.35	
		0.5 × 3.5 × 2.48	=	4.35	
		27.5 × 3.5	=	96.25	
		34.33 × 14.58	=	500.7	
		11.17 × 2	=	22.33	
		8.67 × 4	=	34.67	
		Negative Arc	=	4.29	
		Arc	=	17.81	
Total Living Area (Rounded):		5078 Sq ft			
Non-living Area					
Porch	391.28 Sq ft	9.83 × 13.58	=	133.57	
		8.42 × 14.75	=	124.14	
		9.83 × 13.58	=	133.57	
Deck	328.25 Sq ft	25.25 × 13	=	328.25	
3 Car Built-In	1396.59 Sq ft	6.58 × 2	=	13.17	
		13.58 × 7.17	=	97.35	
		31.25 × 14	=	437.5	
		33 × 4.25	=	140.25	
		0.5 × 4.25 × 4.25	=	9.03	
		37.25 × 5.75	=	214.19	
		33 × 4.25	=	140.25	
		0.5 × 4.25 × 4.25	=	9.03	
		15.58 × 10.08	=	157.13	
		7.25 × 10	=	72.5	
		11.92 × 7.83	=	93.35	
		0.5 × 3.5 × 3.5	=	6.12	
		0.5 × 3.67 × 3.67	=	6.72	
Patio	454.5 Sq ft	18 × 25.25	=	454.5	
Unfinished Basement	507.28 Sq ft	18.58 × 14.75	=	274.1	
		13.58 × 17.17	=	233.18	
Finished Basement	1762.6 Sq ft	0.5 × 2.33 × 4	=	4.67	
		0.5 × 4 × 2.33	=	4.67	
		6.67 × 4	=	26.67	
		0.5 × 4 × 4	=	8	
		0.5 × 4 × 4	=	8	
		5.67 × 4	=	22.67	
		13.67 × 1	=	13.67	
		18.67 × 10	=	186.67	
		0.5 × 0.08 × 8.33	=	0.35	
		47 × 0.08	=	3.92	
		55.33 × 10	=	553.33	
		0.5 × 3.67 × 3.67	=	6.72	
		51.08 × 3.67	=	187.31	
		54.75 × 4.25	=	232.69	
		20.33 × 23.25	=	472.75	
		9.17 × 0.5	=	4.58	
		0.5 × 3.5 × 3.5	=	6.12	
		5.67 × 3.5	=	19.83	

Location Map

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				

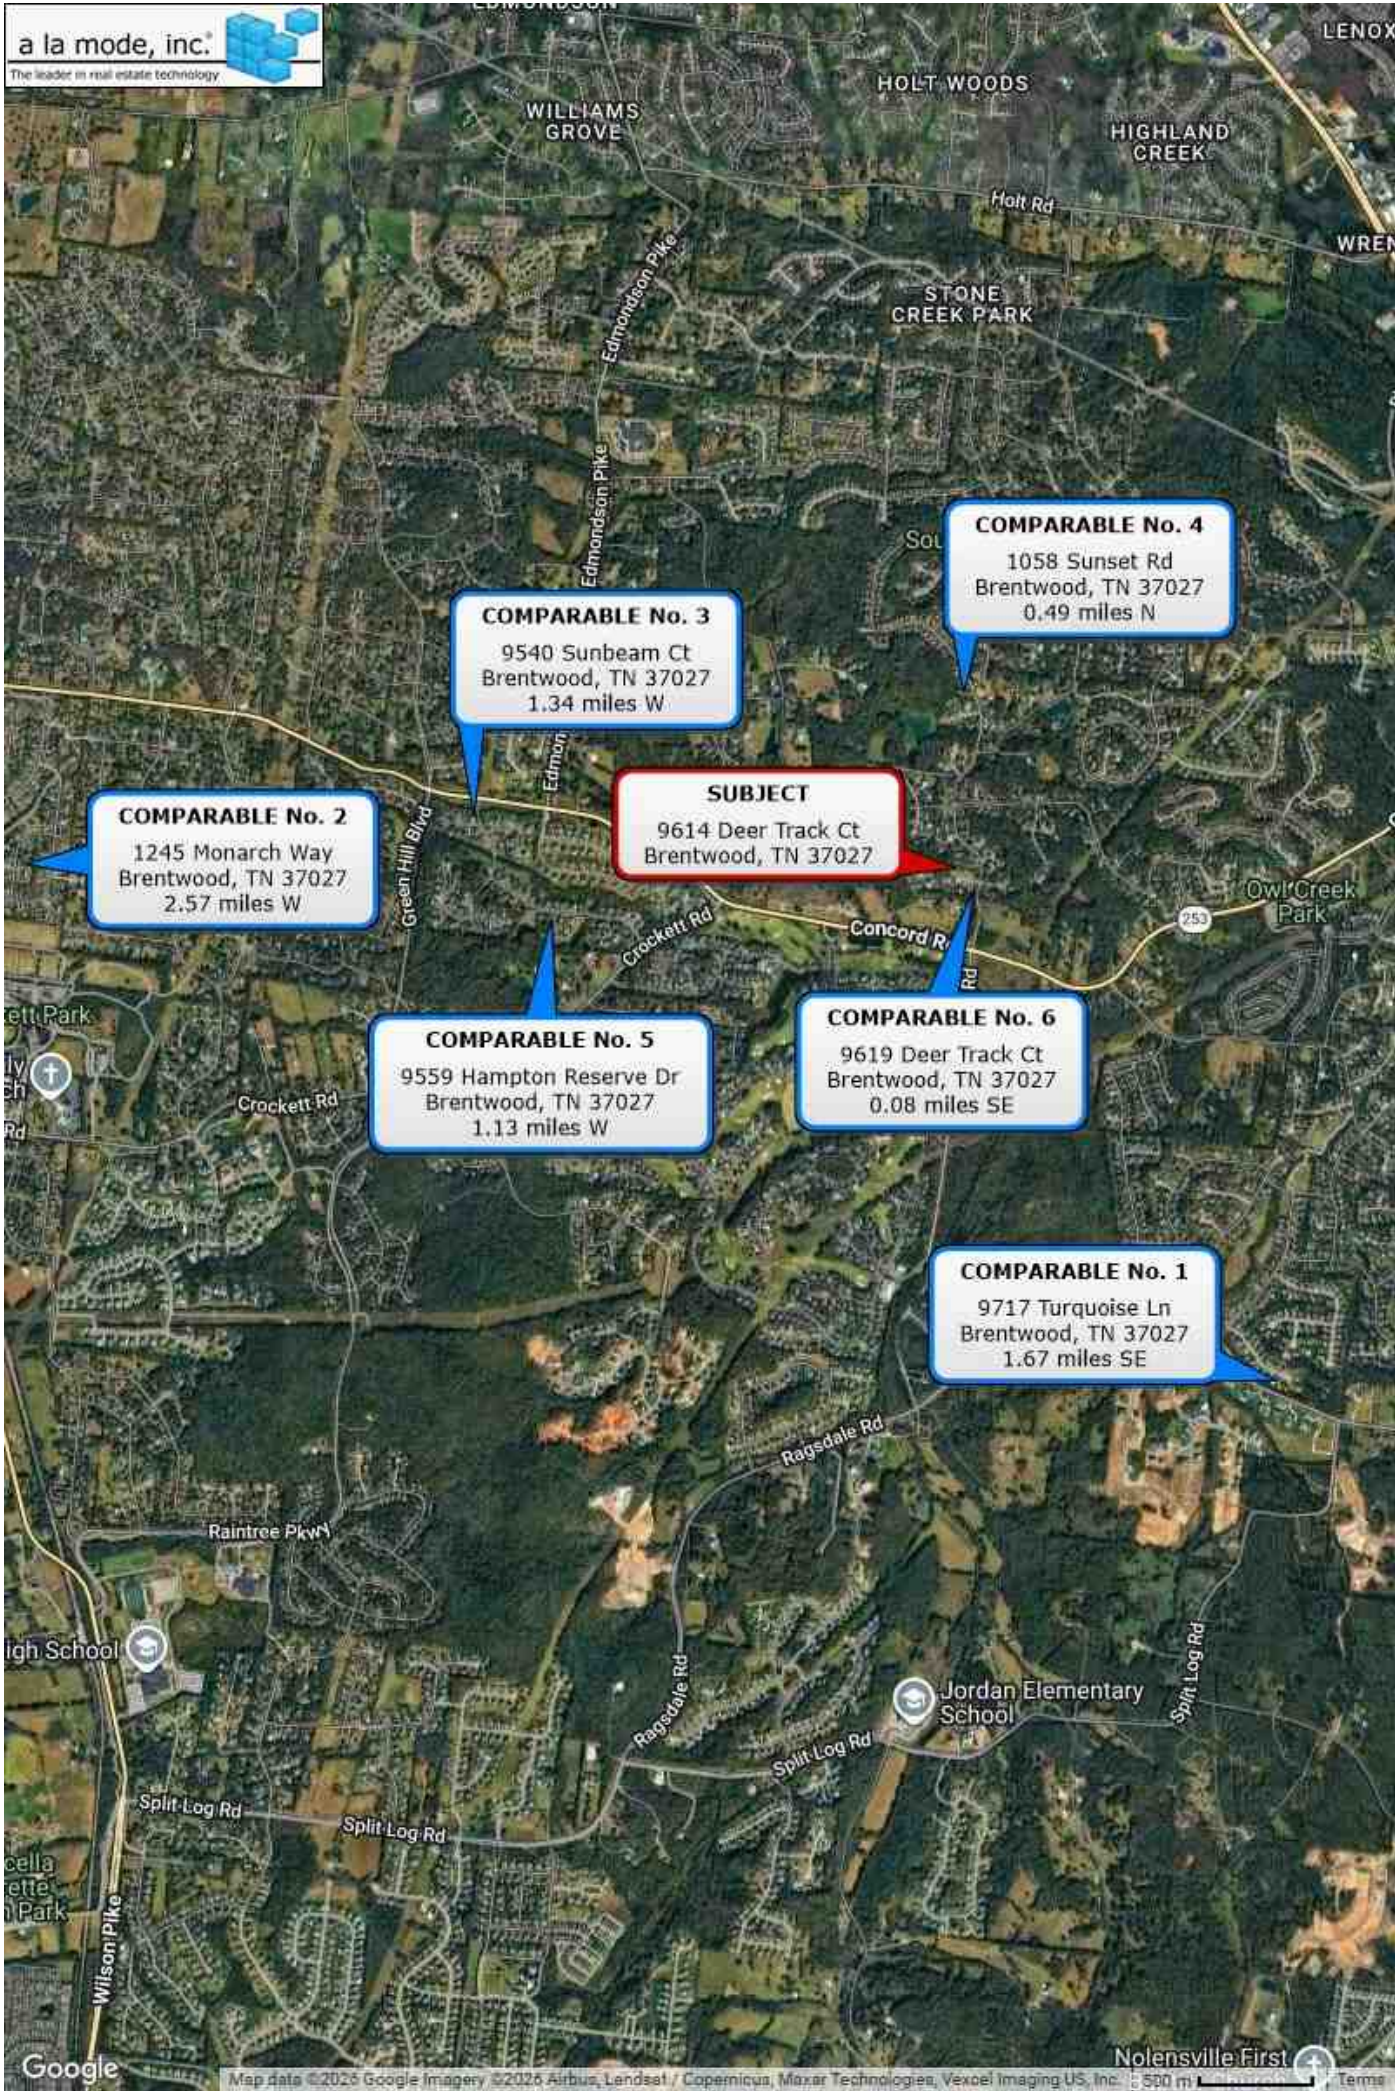


Aerial Map

Borrower	Jonathan De Jong & Madisyn De Jong				
Property Address	9614 Deer Track Ct				
City	Brentwood	County	Williamson	State	TN Zip Code 37027
Lender/Client	Churchill Mortgage Corporation				



Plat Map

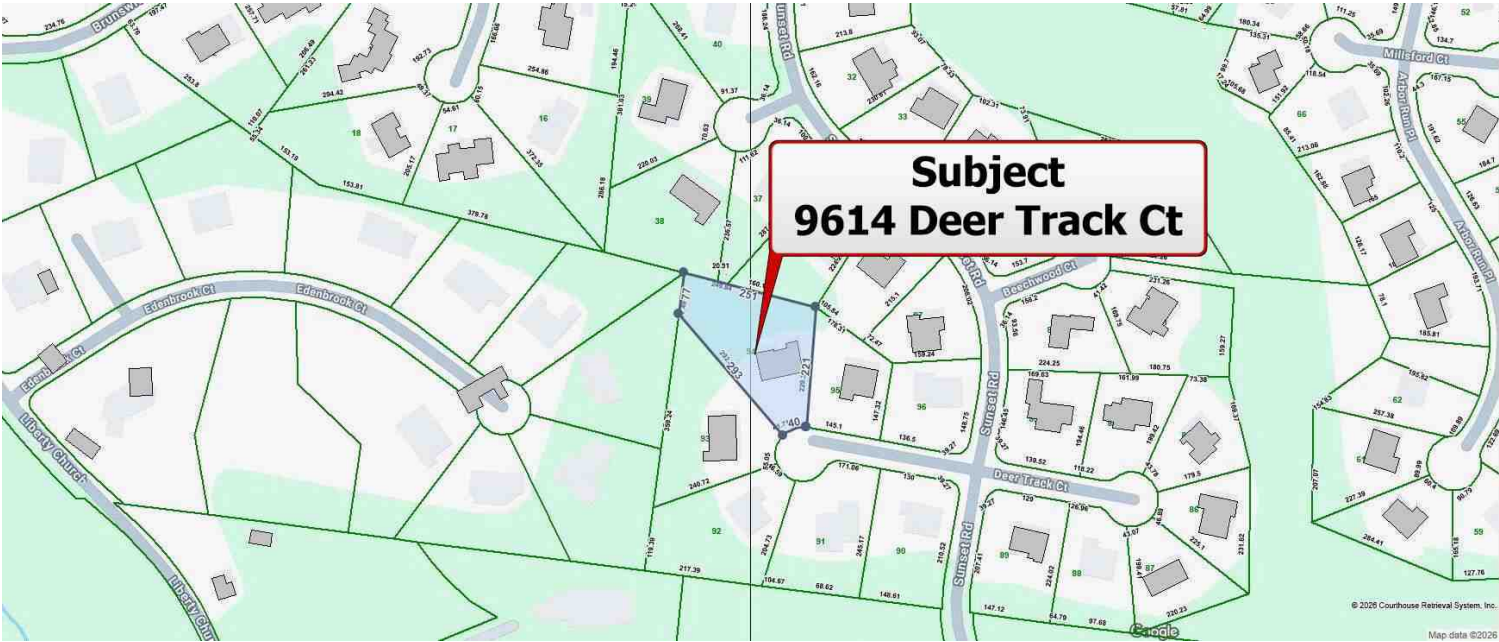



Wednesday, August 05, 2026

LOCATION

Property Address	9614 Deer Track Ct Brentwood, TN 37027-8287
Subdivision	Bonbrook The Est Of Ph 4
County	Williamson County, TN

PROPERTY SUMMARY

Property Type	Residential
Land Use	Residential
Improvement Type	Single Family
Square Feet	4899

GENERAL PARCEL INFORMATION

Parcel ID/Tax ID	034F A 008.00 000
Special Int	000
Alternate Parcel ID	
Land Map	034F
District/Ward	Brentwood
2020 Census Trct/Blk	502.04/2
Assessor Roll Year	2026



CURRENT OWNER

Name	Kelsh Faron & Connie Fam Rev Trust
Mailing Address	9614 Deer Track Ct Brentwood, TN 37027-8287

SCHOOL ZONE INFORMATION

Edmondson Elementary School	1.5 mi
Elementary: K to 5	Distance
Brentwood Middle School	5.7 mi
Middle: 6 to 8	Distance
Brentwood High School	5.4 mi
High: 9 to 12	Distance

SALES HISTORY THROUGH 07/15/2026

Date	Amount	Buyer/Owners	Seller	Instrument	No. Parcels	Book/Page Or Document#
5/23/2024		Kelsh Faron And Connie Family Revocable Trust	Kelsh Faron & Kelsh Connie	Quit Claim Deed		9485/893 24015082
12/13/2022	\$1,425,000	Kelsh Faron & Kelsh Connie	Charles Manilay M	Warranty Deed		9164/143 22049724
12/5/2022		Charles Manilay Mae	Manivong Jeremy	Quit Claim Deed		9164/140 22049723
12/5/2022		Charles Manilay Mae	Saysanadasy Phonsalith	Quit Claim Deed		9164/136 22049722
12/5/2022		Charles Manilay Mae Etal	Charles Manilay M			
12/10/2019		Charles Manilay M	Manivong Sengsouvanh	Quit Claim Deed		9114/563 22041169
9/29/2000	\$745,000	Manivong Sengsouvanh	Hulen Steve Construction	Accepted Waranty Deed Sale		2061/463
2/5/1999	\$133,900	Hulen Steve Construction	C K Development LLC	Accepted Waranty Deed Sale		1798/379
4/14/1998		C K Development LLC			20	1653/939

TAX ASSESSMENT

COPYRIGHT © 2026 COURTHOUSE RETRIEVAL SYSTEM, INC. ALL RIGHTS RESERVED.
Information Deemed Reliable But Not Guaranteed.

Tax & Assessors Data - Page 2

Property Report for 9614 DEER TRACK CT, cont.

Appraisal	Amount	Assessment	Amount	Jurisdiction	Rate
Appraisal Year	2025	Assessment Year	2025	Brentwood	0.19
Appraised Land	\$420,000	Assessed Land	\$105,000	Williamson	1.3
Appraised Improvements	\$1,345,700	Assessed Improvements	\$336,425		
Total Tax Appraisal	\$1,765,700	Total Assessment	\$441,425		
		Exempt Amount			
		Exempt Reason			

TAXES

Tax Year	City Taxes	County Taxes	SSD Taxes	Total Taxes
2025	\$838.71	\$5,738.53	\$0	\$6,577.23
2024	\$863.98	\$5,600.99	\$0	\$6,464.97
2023	\$863.98	\$5,600.99	\$0	\$6,464.97
2022	\$863.98	\$5,600.99	\$0	\$6,464.97
2021	\$863.98	\$5,600.99	\$0	\$6,464.97
2020	\$779.13	\$4,804.64	\$0	\$5,583.77
2019	\$779.13	\$4,804.64	\$0	\$5,583.77
2018	\$779.13	\$4,653.14	\$0	\$5,432.27
2017	\$779.13	\$4,609.85	\$0	\$5,388.98
2016	\$779.13	\$4,544.93	\$0	\$5,324.06
2015	\$818.51	\$4,204.17	\$0	\$5,022.68
2014	\$818.51	\$4,204.17	\$0	\$5,022.68
2013	\$818.51	\$4,204.17	\$0	\$5,022.68

MORTGAGE HISTORY

Date	Loan Amount	Borrower	Lender	Book/Page or Document#
03/31/2023	\$300,000	Kelsh Faron Kelsh Connie	Pinnacle Bank	9229/205 23009645
12/13/2022	\$300,000	Kelsh Faron D Kelsh Connie S	F&M Bank	9164/146 22049725
12/20/2004	\$57,500	Manivong Onesey S Manivang Sengsouvanh	Citi Group	3442/325 04059533
12/17/2004	\$750,000	Manivong Onsey S Manivong Sengsouvanh	Poplar Financial Services	3442/332 04059534
10/19/2004	\$650,000	Manivong Sengsouvanh Manivong Onesy	Accredited Home Lenders	3396/38 04051286
09/29/2000	\$596,000	Manivong Sengsouvanh Manivong Onesy	Greenpoint Mortgage	2061/0463
02/05/1999	\$133,900	Steve Hulen Construction LLC	Regions Bank	1798/0379

PROPERTY CHARACTERISTICS: BUILDING

Building # 1					
Type	Single Family	Condition			Units
Year Built	2000	Effective Year	2000		Stories 2
BRs		Baths	F	H	Rooms
Total Sq. Ft.		4,899			
Building Square Feet (Living Space)			Building Square Feet (Other)		
			Basement Finished 1163		
			Basement Unfinished 1199		

COPYRIGHT © 2026 COURTHOUSE RETRIEVAL SYSTEM, INC. ALL RIGHTS RESERVED.
Information Deemed Reliable But Not Guaranteed.

Tax & Assessors Data - Page 3

Property Report for 9614 DEER TRACK CT, cont.

				Patio 575	
- CONSTRUCTION					
Quality			Roof Framing		
Shape			Roof Cover Deck		Asphalt Shingles
Partitions			Cabinet Millwork		
Common Wall			Floor Finish		
Foundation		Full Crawl Space	Interior Finish		
Floor System			Air Conditioning		Central
Exterior Wall			Heat Type		Central
Structural Framing			Bathroom Tile		
Fireplace		Y	Plumbing Fixtures		19
- OTHER					
Occupancy			Building Data Source		
PROPERTY CHARACTERISTICS: EXTRA FEATURES					
Feature		Size or Description		Year Built	Condition
Driveway		1		2000	AVERAGE
PROPERTY CHARACTERISTICS: LOT					
Land Use		Residential		Lot Dimensions	41 X 292
Block/Lot		/94		Lot Square Feet	
Latitude/Longitude		35.987720°/-86.725319°		Acreage	
PROPERTY CHARACTERISTICS: UTILITIES/AREA					
Gas Source			Road Type		
Electric Source			Topography		
Water Source			District Trend		
Sewer Source			Special School District 1		
Zoning Code		OSRD	Special School District 2		
Owner Type					
LEGAL DESCRIPTION					
Subdivision		Bonbrook The Est Of Ph 4		Plat Book/Page	27/96
Block/Lot		/94		District/Ward	Brentwood
Description		Subd Bonbrook The Est Of Ph 4 Pb 27 Pg 96 Lot 0094			
INTERNET ACCESS					
courtesy of Fiberhomes.com					
Provider	Type	Confirmed	Advertised Top Download Speed		Advertised Top Upload Speed
United Communications	FIBER	Yes	2 Gig		1 Gig
Xfinity	CABLE	No	1200 Mbps		
Starlink	MOBILE WIRELESS	No	280 Mbps		
Viasat Inc	SATELLITE	No	150 Mbps		
FEMA FLOOD ZONES					
Zone Code	Flood Risk	BFE	Description	FIRM Panel ID	FIRM Panel Eff. Date
X	Minimal		Area of minimal flood hazard, usually depicted on FIRMs as above the 500-year flood level.	47187C0230G	02/26/2021

COPYRIGHT © 2026 COURTHOUSE RETRIEVAL SYSTEM, INC. ALL RIGHTS RESERVED.
Information Deemed Reliable But Not Guaranteed.

Property Report for 9614 DEER TRACK CT, cont.

License/ Certification

15237380

State of Tennessee

TENNESSEE REAL ESTATE APPRAISER COMMISSION
CERTIFIED RESIDENTIAL REAL ESTATE APPRAISER
MATTHEW BLEVINS

This is to certify that all requirements of the State of Tennessee have been met.



ID NUMBER: 6235
LIC STATUS: ACTIVE
EXPIRATION DATE: June 13, 2028

IN-1313
DEPARTMENT OF
COMMERCE AND INSURANCE

E & O Insurance

Accelerant National Insurance Company
(A Stock Company)
400 Northridge Road, Suite 800
Sandy Springs, GA 30350

REAL ESTATE APPRAISERS ERRORS AND OMISSIONS INSURANCE POLICY DECLARATIONS

NOTICE: THIS IS A "CLAIMS MADE AND REPORTED" POLICY. THIS POLICY REQUIRES THAT A CLAIM BE MADE AGAINST THE INSURED DURING THE POLICY PERIOD AND REPORTED TO THE INSURER, IN WRITING, DURING THE POLICY PERIOD OR EXTENDED REPORTING PERIOD.

PLEASE READ YOUR POLICY CAREFULLY.

Policy Number: NAX40PL107822-02

Renewal of: NAX40PL107822-01

1. Named Insured: Matthew Blevins

2. Address: 1045 Lonesome Pine Rd
Kingston Springs, TN 37082

3. Policy Period: From: February 13, 2026 To: February 13, 2027
12:01 A.M. Standard Time at the address of the **Named Insured** as stated in item 2. Above.

4. Limit of Liability:	Each Claim	Policy Aggregate
Damages Limit of Liability	4A. \$ 1,000,000	4C. \$ 1,000,000
Claim Expenses Limit of Liability	4B. \$ 1,000,000	4D. \$ 1,000,000

5. Deductible (Inclusive of Claims Expenses):	Each Claim	Aggregate
	5A. \$500	5B. \$1,000

6. Policy Premium: \$ 515

7. Retroactive Date: February 13, 2022

8. Notice to Company: Notice of a **Claim** or Potential **Claim** should be sent to:
OREP Insurance Services: info@orep.org
6353 El Cajon Blvd, Suite 124-605
San Diego, CA 92115

9. Program Administrator: OREP Insurance Services, LLC – appraisers@orep.org

10. Forms and Endorsements Attached at Policy Inception: See Schedule of Forms

If required by state law, this policy will be countersigned by an authorized representative of the Company.

Date: January 26, 2026

By: _____

Isaac Peck

Authorized Representative

Appraisal Notification Letter

Reconsideration of Value (ROV) Disclosure Notice

We sincerely appreciate your trust in Churchill Mortgage to assist with your home financing needs. If you have any questions regarding your appraisal or the loan process, please contact your Home Loan Specialist directly. Attached, please send a copy of your **appraisal** report. This appraisal will be reviewed by our underwriting team for completeness, accuracy, and consistency to help ensure the appraised value reflects current market conditions for your property.

We are notifying you about the process and requirements for requesting a Reconsideration of Value (ROV) on the appraisal of the property once the appraisal has been received by us and a copy is provided to you. This process is in accordance with the guidelines established by Fannie Mae, Freddie Mac, and FHA to ensure fairness and accuracy in property valuations.

What is an appraisal?

An appraisal is a report completed by a state licensed individual that provides the appraiser's professional opinion of current market value as of the date of the report. It considers many factors, especially what other comparable homes sold for recently.

What is a Reconsideration of Value (ROV)?

A Reconsideration of Value (ROV) is a request made to the appraiser to reevaluate the analysis and conclusions of the initial appraisal using new information that the borrower believes is relevant to the appraiser's value determination. You have the right to request a Reconsideration of Value (ROV) if after reviewing the appraisal report you have evidence that the appraised value is unsupported, inaccurate, or the appraisal report contains prohibited discriminatory language.

There are three primary reasons why an ROV may be warranted, and more than one reason may be applicable.

Factual Errors within the Appraisal Report

If there are errors in the appraisal report it may negatively impact the appraised value. Examples of such errors include incorrect Gross Living Area (GLA), # of bedrooms, # of bathrooms, options, and upgrades. If there are factual errors in the report, please provide specific details on which data is incorrect. Note that minor deviations in GLA are not uncommon. The appraiser's measurements may differ from Lender's and thus the GLA calculations will be different.

Additional Comparable Sales

Appraisers use recent sales of homes with comparable characteristics and that are located near the subject to help determine the appraised value. The appraiser is responsible for selecting which comparable sales are the most reflective of the current market value of the subject property. However, there may be other comparable sales that the appraiser did not use that may help in determining the subject's appraised value.

For an appraiser to use a new comparable sale:

- The comparable must be a sale that closed prior to the appraisal effective date. The effective date is found next to the appraised value on the report.
- Comparable sales should generally be recent sales, though older sales from 6 to 12 months may still be appropriate if the more recent sales do not have as many similar characteristics as the subject.

- The comparable should have similar characteristics (GLA, # bedrooms, # bathrooms, age, and other features as the subject). The comparable does not need to be identical to the subject, but the more similar features the better.
- The comparable should be geographically near the subject. Ideally, the comparable is in the same community or in a nearby, competing community.

Potential Appraiser Bias or Discrimination

The Fair Housing Act does not permit any form of discrimination on the basis of the applicant's race, color, national origin, religion, sex (including gender identity or sexual orientation), marital status, military status, or disability. In addition, the Equal Credit Opportunity Act further protects applicants on the basis of their age, or receipt of public assistance. Should you have any concerns that your appraisal was in any way impacted by appraiser bias or discrimination, please provide those details in your ROV Request Form.

Appraiser Independence Requirements

The Appraiser Independence Requirements prohibit anyone from influencing or trying to influence an appraiser's value opinion through coercion, collusion, compensation or intimidation. To avoid any appearance of influence please:

- Do not give your value opinion or provide an expected range of values.
- Do not provide a prior appraisal report; however, you may include comparable sales from that report if they are still timely.
- Please be respectful in providing your concerns about the appraisal.
- We may ask you to resubmit the ROV Request Form if these guidelines are not followed.

When to Request an ROV

First you must receive the copy of the appraisal we will provide to you once the appraisal has been received by us. You will receive this same disclosure again at that time copy of the property appraisal is provided to you. Once you have received and reviewed the copy of the appraisal, you may consider requesting an ROV if:

- You have identified any factual errors in the appraisal report.
- You have located other comparable properties that were not included in the initial appraisal (up to five additional comparables can be submitted).
- You have identified changes in the market that might affect the property's value.
- You suspect appraiser bias or discrimination.

How You Can Request an ROV

If you believe any of the above circumstances has occurred, then to request an ROV, please follow these steps:

1. **Gather Supporting Evidence:** Collect any relevant information or documents that support your request. This may include:
 - Additional comparable sales that were not considered in the appraisal (a maximum of five);
 - Documentation of factual errors in the appraisal report; and/or
 - Evidence of significant market changes since the initial appraisal.
2. **Request the ROV Request Form** Contact your Home Loan Specialist to request a copy of the Churchill Mortgage Corporation Reconsideration of Value (ROV) form.

3. **Complete the ROV Request Form:** Fill out the ROV Request Form provided with the appraisal copy, providing detailed explanations and attaching all supporting documentation.
4. **Submit Your Request:** Send the completed form as instructed on the ROV Request form and all supporting documents, no later than the ROV Request Deadline date that will be indicated on the disclosure you will receive with the ROV Request Form and the appraisal.

What Happens Next?

Once received, Churchill Mortgage's appraisal department will review your ROV to ensure it is completed correctly, provides sufficient information for the appraiser to consider, and does not violate Appraiser Independence Requirements. If the form is acceptable, Churchill will forward it to the appraiser for reconsideration. If the form is not acceptable, we will contact you and let you know why the form was deficient. You may be able to correct the deficiencies, and we will reevaluate the ROV request.

Appraisers will typically respond to ROV requests within 3 business days. The appraiser may or may not make any changes to the appraised value after evaluating the ROV. Churchill Mortgage will notify you once we have received the appraiser's response. Only one ROV may be submitted per appraisal.

Timing

Please note that while we will make every effort to review your request and provide a decision within **10 calendar days**, after receiving your ROV request, the final decision timing will involve the original appraiser which we will notify of our expected response time when the request is provided to the appraiser, we will make every effort to keep the processing time for the ROV analysis to the 10 days or less because the **ROV process must be completed prior to your loan closing**.

Contact Information

If you have any questions or need further assistance understanding this request process or to obtain a copy of the ROV Request Form, please contact your Home Loan Specialist. You may also email us at BorrowerROV@churchillmortgage.com.

We are here to help you through this process.