# M-07 FEED-NODE HARDWARE

TAPE MEASURE SATELLITE YAGI | TM-YAGI-01

**DRAWING REV A**

FOR REVIEW - SOURCE O3-O6 REV L

## VIEW A | 2 m FEED NODES

PLAN / NTS

**2M-DE | X = 13.500 FROM FRONT | ONE HOLE PER HALF**

OPPOSITE STEEL TIPS AND 0.250 GAP ARE HIDDEN IN PVC.

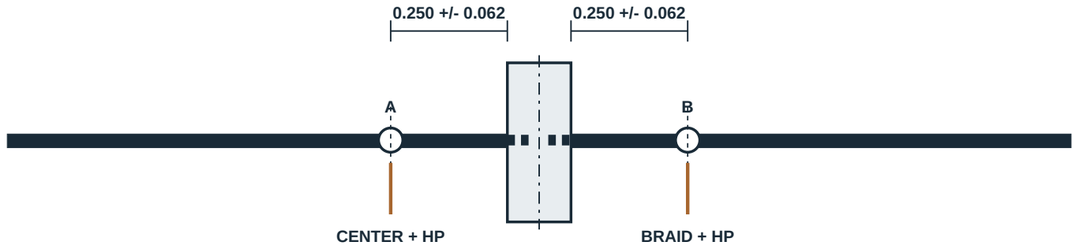


**HP ENDS ARE SHOWN; U-SHAPE / TUNING GEOMETRY ARE O7/O8.**

MEASURE ACTUAL NODE CENTER SPACING; IT IS NOT THE STEEL-TIP GAP.

## VIEW B | 70 cm FEED NODES

PLAN / NTS

**70-DE | X = 18.500 FROM FRONT | ONE HOLE PER HALF**

OPPOSITE STEEL TIPS AND 0.250 GAP ARE HIDDEN IN PVC.

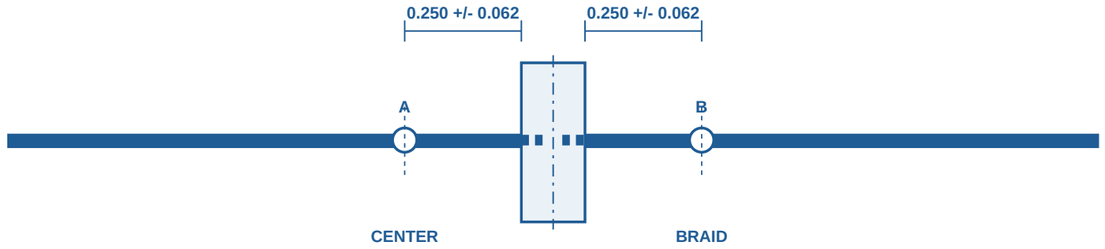


**DIRECT FEED; NO HAIRPIN OR INTENTIONAL DC BRIDGE.**

MEASURE ACTUAL NODE CENTER SPACING; IT IS NOT THE STEEL-TIP GAP.

## DETAIL C | EACH FEED-NODE STACK

SCHEMATIC / NTS

FROM SCREW HEAD TOWARD NUT; ONE SCREW / NUT PER NODE, FOUR TOTAL.

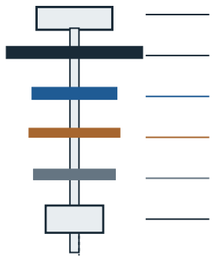

1. #6-32 STAINLESS PAN-HEAD SCREW
2. CLEAN, BARE TAPE-STEEL CONTACT PAD
3. COAX RING LUG: CENTER OR BRAID
4. BARE #12 HAIRPIN HOOK - 2 m ONLY
5. #6 STAINLESS FLAT WASHER
6. #6-32 STAINLESS NUT

**70 cm: OMIT LAYER 4; KEEP THE SAME REMAINING ORDER.**

LOCAL BARE PAD ONLY. DO NOT TIN ANY CLAMPED CONTACT SURFACE.

## DRILL / HARDWARE CONTROL

O5 SEC. 9 / O6 STEP 12

1. M-06 GAP / SPAN MUST PASS WITH TEMPORARY HOLDS.
2. **MARK 0.250 +/- 0.062 OUTBOARD OF EACH PVC SURFACE.**
3. CENTER ACROSS ACTUAL ~3/8 BLADE; MIRROR HOLES.
4. **COUPON-APPROVED ~5/32 #6 CLEARANCE; TAPE ONLY.**
5. DEBURR BOTH FACES; PREPARE ONLY LOCAL BARE PAD.
6. START 1/2 SCREW; 3/4 ONLY IF ENGAGEMENT FAILS.
7. **SHORTEST USABLE; >=2 FULL THREADS PAST NUT.**
8. **CLEAR OTHER HALF / BOOM / TIE / HP ROUTE (EXCEPT HOOK).**
9. RECORD 4 OFFSETS + 4 DIAMETERS + 2 NODE SPACINGS.

## NODE ASSIGNMENT / ELECTRICAL INTENT

AS LABELED

| BAND | NODE A \| LEFT HALF | NODE B \| RIGHT HALF |
|---|---|---|
| **2 m** | COAX CENTER + ONE HAIRPIN END | COAX BRAID + OTHER HAIRPIN END |
| **70 cm** | COAX CENTER; NO MATCHING WIRE | COAX BRAID; NO DC BRIDGE |

LEFT/RIGHT MAY REVERSE BEFORE ASSEMBLY IF CONSISTENTLY LABELED / RECORDED.

## ASSEMBLY STAGE

O6 -> O7

1. DRILL ONE HALF AT A TIME; REFIT / RECHECK M-06 GAP.
2. FINAL STATION / ST-2 END TIES FOLLOW ALL FOUR HOLES.
3. **O6: BARE SCREW / WASHER / NUT FOR FIT ONLY.**
4. **O7: ADD LABELED COAX LUGS + 2 m HAIRPIN.**

### GENERAL NOTES

1. ALL DIMENSIONS IN INCHES. NODE PLANS / STACK ARE SCHEMATIC; COUPON FIT CONTROLS.
2. DO NOT DRILL PVC FOR FEED SCREWS; EACH SCREW CONTACTS ITS ASSIGNED HALF ONLY.
3. 2 m HAIRPIN STARTS FROM 8.500 in BARE #12 BLANK; FINAL SHAPE / TUNE BY O7/O8.

**SOURCE BASELINE**
**O3/O4/O5/O6 REV L**
COMMIT 186c773

**SCALE AT 100% PRINT**
**ALL DETAILS NTS**

**ISSUE / DATE**
**REV A - FOR REVIEW**
2026-10-12

**SHEET M-07**