Issue	**1**
Factory ID	**25130**
Date of Issue	**24-Jun-2026**

Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park

Bypass Khurrianwala Jaranwala Road,Khurrianwala,Tehsil Jaranwala,District Faisalabad
38000 Faisalabad
Punjab Pakistan

Latitude: [31.452469], longitude: [73.281943]
Date of inspection: 06-Apr-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Muhammad Asim**
Reviewed by	**Qaseem Uz Zaman Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 06-04-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 5
2. Building Extents 11
   2.1 Structural System 30
3. Documentation 38
4. Structural Safety Measures 42
5. Remediation Support 46
   5.1 Engineering Support 46
6. Potential Overstress 47
   6.1 Highly stressed columns 47
7. Structural System 48
   7.1 Lack of local stability 48
   7.2 Lack of local stability 50
   7.3 Connection details 51
8. Other Damage/Defects 52
   8.1 Corrosion of reinforcement 52
9. Structural Documentation 53
   9.1 Documentation unavailable 53
   9.2 Lack of safe load plans 54
10. Assessment Limitations and Assumptions 55

1. Executive Summary

On 06-Apr-2026, Muhammad Asim and Owais Raza on behalf of the Pakistan Accord carried out an initial structural inspection for Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park, a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Zaheer Ahmed (Civil representative), Mr. Ikram (Civil representative), and other staff members of Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park.
The factory operates in total five shifts. Approximately 7000 workers operate during a single general shift at peak occupancy. Factory employs 13000 workers with 1600 workers being females.
The factory comprises of 26 buildings and 33 ancillary structures owned by Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park. During the inspection, the areas highlighted in Figure 1.1 were inspected, with the site boundary indicated in red.

- **Hosiery Division 5 -** It consists of five main buildings and five ancillary structures details of which are given below:
    - **Value stream unit 1** is a single storey (Ground only) building having braced steel portal frame shed. The building is used for electronic lab, red tag 1 area, control room, AHU, LT room, store, offices, knitting, finishing, metal free zone finish good store, spare store, red tag 2 area, charging point, chemical store (ground floor). The building was constructed in 2021.
    - **Value stream unit 2** is a single storey (Ground only) building having braced steel portal frame shed. The building is used for electronic lab, control room, AHU, LT room, store, offices, knitting, finishing, metal free zone finish good store, accessory store (ground floor). The building was constructed in 2021.
    - **Office Block** is a two storey (Ground+1) building having RC moment resisting frame system. The building is used for offices meeting room (first floor), offices, meeting room and kitchen (ground floor). The building was constructed in 2021.
    - **Canteen** is a two storey (Ground+1) building having RC moment resisting frame system. The building is used for dining area (first floor), dining (differently abled), prayer area-male, prayer area- female and kitchen (ground floor). The building was constructed in 2021.
    - **Processing labs** is a single storey (Ground only) building having braced steel portal frame shed. The building is used for accessory stores, sampling area, waste management area, processing area, labs, offices and chemical storage (ground floor). The building was constructed in 2021.
    - **Engineering offices** is a single storey (Ground only) structure having RC moment resisting frame system. The structure is used for offices (ground floor). The structure was constructed in 2021.
    - **Utility 1** is a single storey (Ground only) structure having braced steel portal frame shed. The structure is used for chillers, compressors and workshops (ground floor). The structure was constructed in 2021.

- **Utility 2** is a single storey (Ground only) structure having braced steel portal frame shed. The structure is used for RO plant and workshop (ground floor). The structure was constructed in 2021.
- **Storage areas** is a single storey (Ground only) structure having load bearing brick masonry wall supporting precast double tee slab. The structure is used for storage (ground floor). The structure was constructed in 2021.
- **Carpenter and fire boost workshop** is a single storey (Ground only) structure having load bearing brick masonry wall supporting precast girders and slab panels. The structure is used for workshop and fire equipment store (ground floor). The structure was constructed in 2021.

- **Hosiery Division 6 -** It consists of two main buildings and one ancillary structure details of which are given below:

  - **Value stream unit 1 – HD-06** is a single storey (Ground only) building having RC moment resisting frame system with inverted RC beams. The building is used for AHU, LT room, store, finishing, offices, electronic lab, finish good store, office, prayer area, sampling and accessory store (ground floor). The building was constructed in 2025.
  - **Value stream unit 2 – HD-06** is a single storey (Ground only) building RC moment resisting frame system with inverted RC beams. The building is used for AHU, LT room, store, finishing, offices, electronic lab, finish good store, office, prayer area, sampling, dining, kitchen and store (ground floor). The building was constructed in 2025.
  - **Time office** is a single storey (Ground only) structure having RC moment resisting frame system. The structure is used for offices (ground floor). The structure was constructed in 2025.

- **Yarn dyeing area -** It consists of two main buildings details of which are given below:

  - **Yarn dyeing** is mainly a single storey (Ground only) building and locally three storey (Ground + mezzanine + 1) building having RC moment resisting frame system. The building is used for lab, office, dying machines (mezzanine), yarn dying, store, AHU, prayer area, LT room and RO plant (ground floor). The building was constructed in 2025.
  - **Yarn dyeing chemical store** is a single storey (Ground only) building having RC moment resisting frame systemn with inverted RC beams. The building is used for yarn dyeing store and workshop (ground floor). The building was constructed in 2025.

- **Apparel plant 2 -** It consists of four main buildings and two ancillary structures details of which are given below:

  - **Garment block** is a three storey (Ground + 2) building having RC moment resisting frame system. The building is used for stitching, packing, recovery area, workshops, canteen, kitchen, mosques, storage, offices (second floor), packing, inspection room, stitching, canteen, kitchen, mosques, storage, offices (first floor), sitting area, cutting, store, embroidery and offices (ground floor). The building was constructed in 2023.

- **Dye house** is a two storey (Ground + mezzanine) building having braced steel portal frame shed. The building is used for lab, offices (mezzanine), dying, finishing, washing, chemical, dispensing and storage, LT rooms and thermal oil heaters (ground floor). The building was constructed in 2023.
- **Utility area apparel** is a two storey (Ground + 1) building having RC moment resisting frame system. The building is used for offices (first floor), chiller, compressor area, electric panels, RO plant, electrical workshop, mechanical workshops, waste store, leftover store, HVAC workshop (ground floor). The building was constructed in 2023.
- **Marketing block** is a two storey (Ground + 1) building having RC moment resisting frame system. The building is used for sampling, embroidery, offices (first floor) and under-renovation (ground floor). The building was constructed in 2025.
- **Wastewater treatment plant** is a single storey (Ground only) structure having braced steel portal frame shed and underground tanks. The structure is used MBR, lab, electric panels and blower area (ground floor). The structure was constructed in 2023.
- **Chemical store apparel** is a single storey (Ground only) structure having braced steel portal frame shed. The structure is used for chemical store, scrap store and hazardous material store (ground floor). The structure was constructed in 2023.

- **Common area -** It consists of three main buildings and nine ancillary structures details of which are given below:

  - **Technical training school** is a four storey (Ground + 3) building having RC moment resisting frame system. The building is used for unoccupied (third floor), training halls, dining area, rest area, offices, storage (second floor), training halls, dining area, rest area, offices, storage (first floor), workshops, and store (ground floor). The building was constructed in 2021.
  - **Workshops** is a two storey (Ground + 1) building having RC moment resisting frame system. The building is used offices (first floor) and storage (ground floor). The building was constructed in 2021.
  - **Main gate office** is a two storey (Ground + 1) building having RC moment resisting frame system. The building is used offices (first floor), control room, offices, driver sitting, rest area and TUC shop (ground floor). The building was constructed in 2021.
  - **Apparel gate office** is a single storey (Ground only) structure having combination of RC moment resisting frame system and load bearing brick masonry wall system supporting RC slab. The structure is used offices (ground floor). The structure was constructed in 2023.
  - **Fair price shop** is a single storey (Ground only) structure having RC moment resisting frame system. The structure is used for shop and atm (ground floor). The structure was constructed in 2021.
  - **Dispensary** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for medical health unit (ground floor). The structure was constructed in 2021.
  - **Storage/Lockers room** is a single storey (Ground only) structure having RC moment resisting frame system. The structure is used for storage (ground floor). The structure was constructed in 2024.
  - **Masjid** is a single storey (Ground only) structure having RC moment resisting frame system. The structure is used for prayer area (ground floor). The structure was constructed in 2021.
  - **Daycare** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for daycare activities (ground floor). The structure was constructed in 2021.

- **LT room and OHWT** is an elevated structure having RC moment resisting frame system. The structure is used for water storage (roof), and LT panels (ground floor). The structure was constructed in 2021.
- **Hydrant room** is a single storey (Ground only) structure having RC moment resisting frame system. The structure is used for pumping system (ground floor). The building was constructed in 2021.
- **Hosiery gate office** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for offices (ground floor). The structure was constructed in 2021.

- **Club and hostel area -** It consists of ten main buildings and eight ancillary structures details of which are given below:

  - **Central block 1 and central block 2** are three storey (Ground + 2) buildings having RC moment resisting frame system. The buildings are used for solar (roof), dormitories (second and first floor), dormitories, kitchen and dining (ground floor). The buildings were constructed in 2025.
  - **Outer block 1, outer block 2, outer block 3, outer block 4 and outer block 5** are three storey (Ground + 2) buildings having RC moment resisting frame system. The buildings are used for solar (roof) and dormitories (all typical floors). The buildings were constructed in 2025.
  - **Male Executive hostel and female executive hostel** are three storey (Ground + 2) buildings having RC moment resisting frame system. The buildings are used for dormitories (all typical floors). The buildings were constructed in 2025.
  - **Club** is a two storey (Ground +1) building having RC moment resisting frame system. The building is used for gym, rest room (first floor), dining and sitting (ground floor). The building was constructed in 2025.
  - **Colony gate office** is a single storey (Ground only) structure having RC moment resisting frame system. The structure is used for offices (ground floor). The structure was constructed in 2023.
  - **Security office and ATM** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for offices and atm (ground floor). The structure was constructed in 2024.
  - **Colony workshops** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for workshops and LT room (ground floor). The structure was constructed in 2024.
  - **Drivers room** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for waiting area (ground floor). The structure was constructed in 2024.
  - **Colony OHWT** is an elevated structure having RC moment resisting frame system. The structure is used for water storage (roof) and RO plant (ground floor). The structure was constructed in 2024.
  - **Colony masjid** is a single storey (Ground only) structure having RC moment resisting frame system. The structure is used for prayer area (ground floor). The structure was constructed in 2024.
  - **Cafeteria and squash** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for canteen, dining and squash court (ground floor). The structure was constructed in 2026.
  - **Apartments** is a two storey (Ground +1) structure having RC moment resisting frame system. The structure is used for water storage (roof), sleeping area (first floor and ground floor). The structure was constructed in 2026.

- **Utilities -** It consists of eight ancillary structures details of which are given below:

    - **Parking shed** is a single storey (Ground only) structure having braced steel portal frame shed. The structure is used for solar (roof) and car parking (ground floor). The structure was constructed in 2021.
    - **Boiler gate office** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for offices (ground floor). The construction year of structure is unknown.
    - **Generator room 1 and generator room 2** are two different single storey (Ground only) structures having load bearing brick masonry wall system supporting RC slab. The structure is used for generators (ground floor). The structure construction year of structure is unknown.
    - **Transformer room** is a single storey (Ground only) structure having load bearing brick masonry wall system supporting RC slab. The structure is used for generators (ground floor). The construction year of structure is unknown.
    - **Gas boiler area** is a two storey (Ground + mezzanine) structure having braced steel portal frame shed. The structure is used for storage (mezzanine), gas boilers and control room (ground floor). The structure was constructed in 2023.
    - **Biomass boiler area** is mainly an elevated structure but locally two storey (Ground + 1) structure having braced steel portal frame shed. The structure is used for control room (first floor), boiler and electric panels (ground floor). The structure was constructed in 2023.
    - **Storage shed** is a one storey (Ground only) structure having braced steel portal frame shed. The structure is used for biomass storage (ground floor). The construction year of structure is unknown

An approved site layout plan, architectural and structural drawings were presented. For further details, refer to Table 2 of the documentation.
A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Internal columns of technical training school are observed to be highly overstressed at ground floor.
- Bolt connection in column is missing at ground level in value stream unit 2 - HD-05.
- Corrosion of dowel reinforcement at roof level of office block.
- Cross bracing was found to be missing at the wall of the braced steel portal shed for the gas boiler at ground level, which may compromise the lateral stability of the structure.
- Cross bracing was found to be missing in the front stairs of biomass boiler at ground level which may compromise the lateral stability of the stairs.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.
Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Hosiery Division 5					
Value Stream Unit 1	Electronic lab, control rm, AHU, LT rm, store, offices, knitting, finishing, MFZ, stores, chemical store	G	2021	Braced portal steel shed	-
Value Stream Unit 2	Electronic lab, control rm, AHU, LT rm, store, offices, knitting, finishing, MFZ, stores, chemical store	G	2021	Braced portal steel shed	-
Office Block	Meeting rooms, offices, kitchen	G+1	2021	RC moment resisting frame	-
Canteen	Dining, prayer areas (M/F), kitchen	G+1	2021	RC moment resisting frame	-
Processing Labs	Accessory stores, sampling, waste mgmt, processing, labs, offices, chemical storage	G	2021	Braced portal steel shed	-
Engineering Offices	Offices	G	2021	RC moment resisting frame	-
Utility 1	Chillers, compressors, workshops	G	2021	Braced portal steel shed	-
Utility 2	RO plant, workshop	G	2021	Braced portal steel shed	-
Storage Areas	Storage	G	2021	LB brick masonry + precast double tee slab	-
Carpenter & Fire Boost Workshop	Workshop, fire equipment store	G	2021	LB brick masonry + precast double tee slab	-
Hosiery Division 6					

Value Stream Unit 1 – HD-06	AHU, LT rm, store, finishing, offices, e-lab, FG store, prayer, sampling, accessory store	G	2025	RC moment resisting frame	-
Value Stream Unit 2 – HD-06	AHU, LT rm, store, finishing, offices, e-lab, FG store, prayer, sampling, dining, kitchen	G	2025	RC moment resisting frame	-
Time Office	Offices	G	2025	RC moment resisting frame	-
Yarn Dyeing Area					
Yarn Dyeing	Lab, office, dying machines (mezz.), yarn dyeing, store, AHU, prayer, LT rm, RO plant	G+mezz.+1	2025	RC moment resisting frame	-
Yarn Dyeing Chemical Store	Store, workshop	G	2025	RC moment resisting frame	-
Apparel Plant 2					
Garment Block	Stitching, packing, recovery, workshops, canteen, kitchen, mosque, storage, offices, cutting, embroidery	G+2	2023	RC moment resisting frame	-
Dye House	Lab, offices (mezz.), dying, finishing, washing, chemical dispensing, storage, LT rms	G+mezz.	2023	Braced steel portal shed	-
Utility Area Apparel	Offices, chiller, compressor, panels, RO plant, workshops, waste/leftover store, HVAC workshop	G+1	2023	RC moment resisting frame	-
Marketing Block	Sampling, embroidery, offices (1F); under-renovation (GF)	G+1	2025	RC moment resisting frame	-
Wastewater Treatment Plant	MBR, lab, electric panels, blower area	G	2023	Braced steel portal shed + underground tanks	-

Chemical Store Apparel	Chemical, scrap, and hazardous material store	G	2023	Braced steel portal shed	-
Common Area					
Technical Training School	Training halls, dining, rest area, offices, storage (under const. 3F), workshops	G+3	2021	RC moment resisting frame	-
Workshops	Offices (1F); under construction (GF)	G+1	2021	RC moment resisting frame	-
Main Gate Office	Offices, control room, driver sitting, rest area, TUC shop	G+1	2021	RC moment resisting frame	-
Apparel Gate Office	Offices	G	2023	RC frame + LB brick masonry	-
Fair Price Shop	Shop, ATM	G	2021	RC moment resisting frame	-
Dispensary	Medical health unit	G	2021	LB brick masonry wall	-
Storage / Lockers Room	Storage	G	2024	RC moment resisting frame	-
Masjid	Prayer area	G	2021	RC moment resisting frame	-
Daycare	Daycare activities	G	2021	LB brick masonry wall	-
LT Room and OHWT	Water storage (roof), LT panels	Elevated	2021	RC moment resisting frame	-
Hosiery Gate Office	Offices	G	2021	LB brick masonry wall	-
Club & Hostel Area					
Central Block 1 & 2	Solar (roof), dormitories, kitchen, dining	G+2	2025	RC moment resisting frame	-
Outer Blocks 1–5	Solar (roof), dormitories (all floors)	G+2	2025	RC moment resisting frame	-
Male & Female Executive Hostel	Dormitories	G+2	2025	RC moment resisting frame	-

Club	Gym, rest room (1F); dining, sitting (GF)	G+1	2025	RC moment resisting frame	-
Colony Gate Office	Offices	G	2023	RC moment resisting frame	-
Security Office & ATM	Offices, ATM	G	2024	LB brick masonry wall	-
Colony Workshops	Workshops, LT room	G	2024	LB brick masonry wall	-
Drivers Room	Waiting area	G	2024	LB brick masonry wall	-
Colony OHWT	Water storage (roof), RO plant	Elevated	2024	RC moment resisting frame	-
Colony Masjid	Prayer area	G	2024	RC moment resisting frame	-
Cafeteria & Squash	Canteen, dining, squash court	G	2026	LB brick masonry wall	-
Apartments	Water storage (roof), sleeping area	G+1	2026	RC moment resisting frame	-
Utilities					
Parking Shed	Solar (roof), car parking	G	2021	Braced steel portal shed	-
Boiler Gate Office	Offices	G	Unknown	LB brick masonry wall	-
Generator Room 1 & 2	Generators	G	Unknown	LB brick masonry wall	-
Transformer Room	Generators	G	Unknown	LB brick masonry wall	-
Gas Boiler Area	Storage (mezz.), gas boilers, control room	G+mezz.	2023	Braced steel portal shed	-
Biomass Boiler Area	Control room (mezz.), boiler, electric panels	G+1 (elevated)	2023	Braced steel portal shed	-
Storage Shed	Biomass storage	G	Unknown	Braced steel portal shed	-

G = Ground only | G+1 = Ground + 1 floor | Mezz. = Mezzanine | LB = Load bearing | RC = Reinforced concrete | MFZ = Metal free zone | FG = Finished goods



Figure 1.1. Site plan (Satellite View) – Red dashed line indicates site boundary, highlighted blocks indicates areas inspected

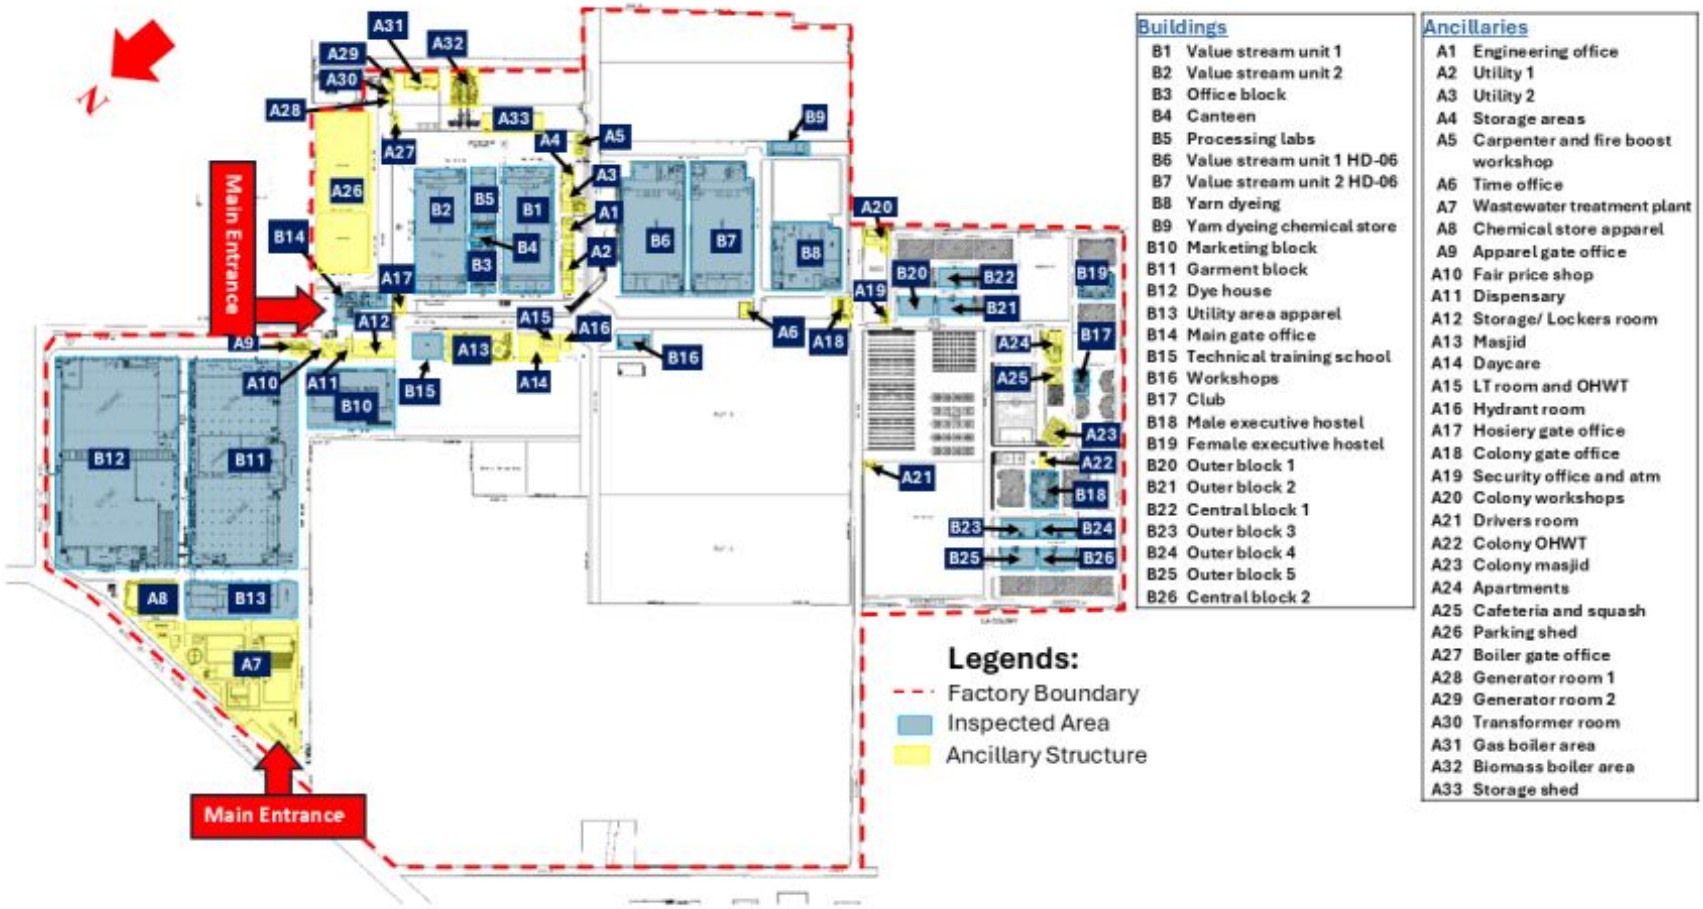


Figure 1.2. Site plan (Satellite View) – Red dashed line indicates site boundary, highlighted area indicates buildings inspected



Figure 1.3. Front elevation of value stream unit 1 - HD-06



Figure 1.4. Front elevation of value stream unit 2 - HD-06



Figure 1.5. Front elevation of yarn dyeing



Figure 1.6. Front elevation of yarn dyeing chemical store



Figure 1.7. Front elevation of garment block



Figure 1.8. Front elevation of marketing block



Figure 1.9. Top view of dye house



Figure 1.10. Front elevation of utility apparel area



Figure 1.11. Front elevation of main gate office



Figure 1.12. Front elevation of technical training school



Figure 1.13. Front elevation of workshops



Figure 1.14. Front elevation of club



Figure 1.15. Front elevation of male executive hostel



Figure 1.16. Front elevation of female executive hostel



Figure 1.17. Front elevation of outer block 1 and outer block 2



Figure 1.18. Front elevation of central block 1



Figure 1.19. Front elevation of central block 2 and outer block 5



Figure 1.20. Front elevation of outer block 3 and outer block 4


Figure 1.21. Value stream unit 1 - Typical activity at ground floor


Figure 1.22. Value stream unit 2 - Typical activity at ground floor



Figure 1.23. Office block - Office at first floor



Figure 1.24. Office block - Office at ground floor



Figure 1.25. Canteen - Mess area at first floor



Figure 1.26. Canteen - Typical activity at ground floor



Figure 1.27. Processing lab - Typical activity at ground floor



Figure 1.28. Value stream unit 1 - HD-06 - Typical activity at ground floor



Figure 1.29. Value stream unit 2 - HD-06 - Typical activity at ground floor



Figure 1.30. Yarn dyeing - Typical activity at first floor



Figure 1.31. Yarn dyeing - Typical activity at mezzanine floor



Figure 1.32. Yarn dyeing - Typical activity at ground floor



Figure 1.33. Garment block - Typical activity at second floor



Figure 1.34. Garment block - Typical activity at first floor



Figure 1.35. Garment block - Typical activity at ground floor



Figure 1.36. Dye house - Typical activity at mezzanine floor



Figure 1.37. Dye house - Typical activity at ground floor



Figure 1.38. Utility area apparel - Typical activity at first floor



Figure 1.39. Utility area apparel - Typical activity at ground floor



Figure 1.40. Marketing block - Typical activity at first floor



Figure 1.41. Marketing block - Unoccupied ground floor



Figure 1.42. Technical traning school - Unoccupied third floor



Figure 1.43. Technical traning school - Typical activity at second floor



Figure 1.44. Technical traning school - Typical activity at first floor



Figure 1.45. Technical traning school - Typical activity at ground floor



Figure 1.46. Workshops - Offices at first floor



Figure 1.47. Workshops - Typical activity at ground floor



Figure 1.48. Main gate office - Offices at ground floor



Figure 1.49. Central block 2 - Dinning area at ground floor



Figure 1.50. Club - Typical activity at first floor



Figure 1.51. Club - Typical activity at ground floor

2.1 Structural System

Building	Technical training school
Stability System	RC moment resisting frame system
Column Size (m)	0.70x1.00
Grid (m)	4.50x19.9
Primary Beam Size (m)	0.50x1.10
Secondary Beam Size (m)	0.35x0.32
Slab Depth (m)	0.15
Finishes Depth (m)	0.1 (typical)
Floor to Ceiling Height (m)	5.0 (Ground) 5.2 (Typical)

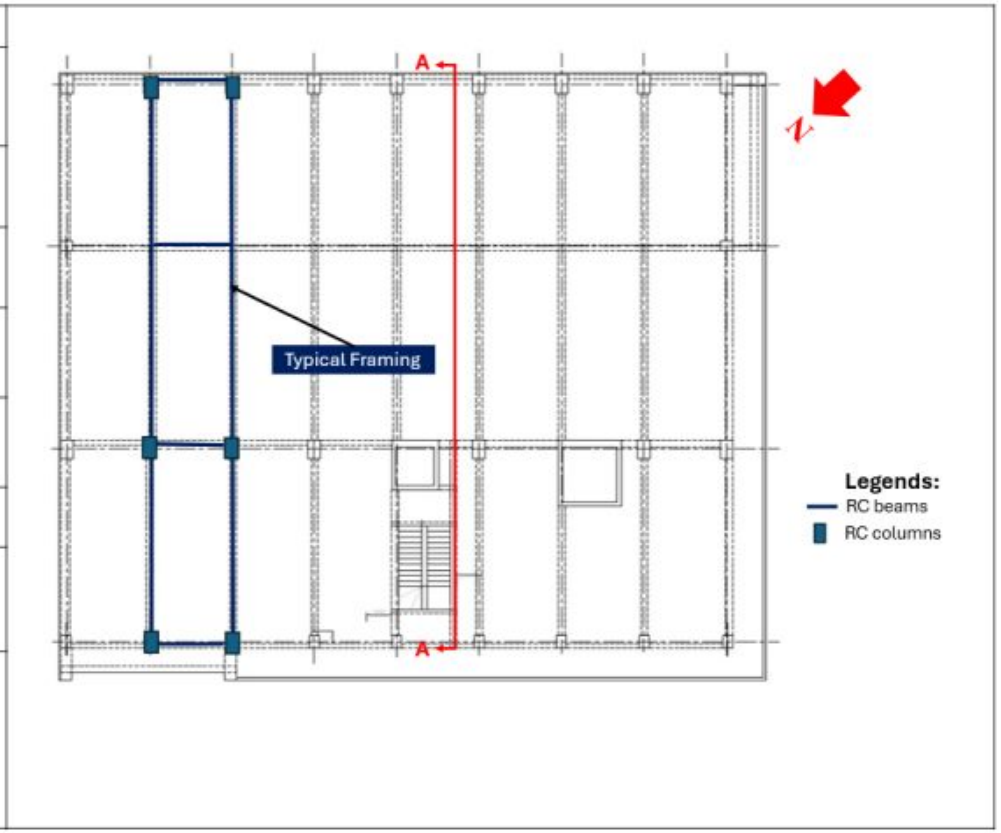


Figure 1.52. Typical floor framing plan detail of technical training school

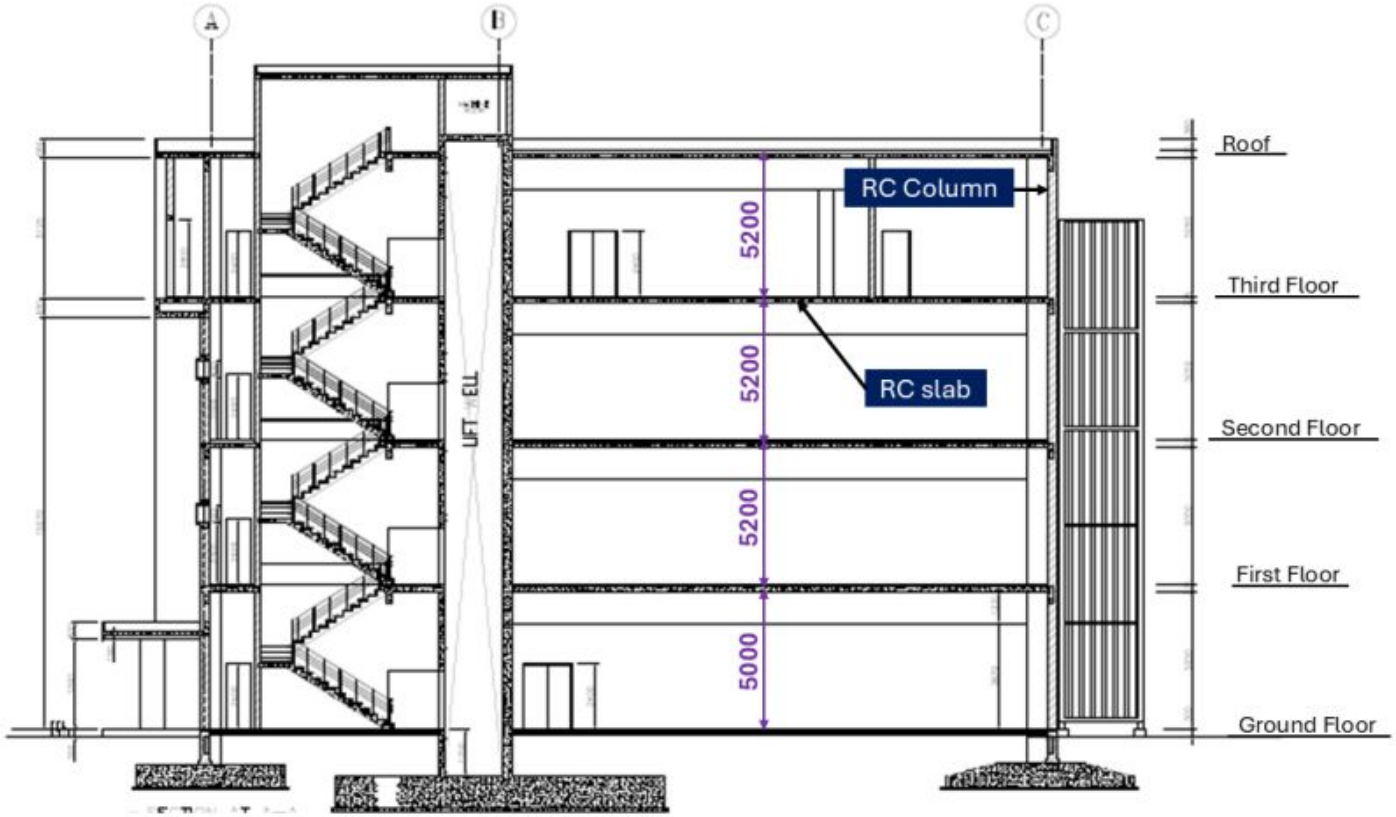


Figure 1.53. Section A-A of technical training school

Building	Garment block
Stability System	RC moment resisting frame system
Column Size (m)	0.90x0.90
Grid (m)	13.7x9.00
Primary Beam Size (m)	0.60x1.00
Secondary Beam Size (m)	0.20x1.00
Slab Depth (m)	0.15
Finishes Depth (m)	0.100 (typical)
Floor to Ceiling Height (m)	6.1 (Typical)

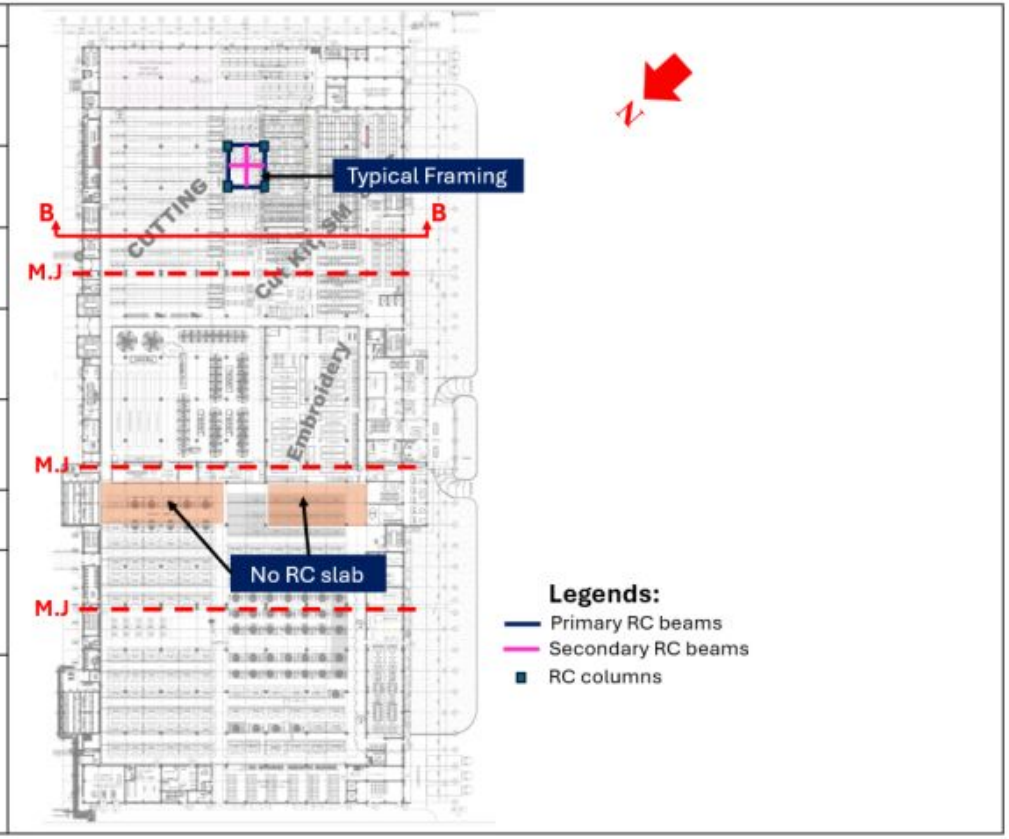


Figure 1.54. Typical floor framing plan detail of garment block

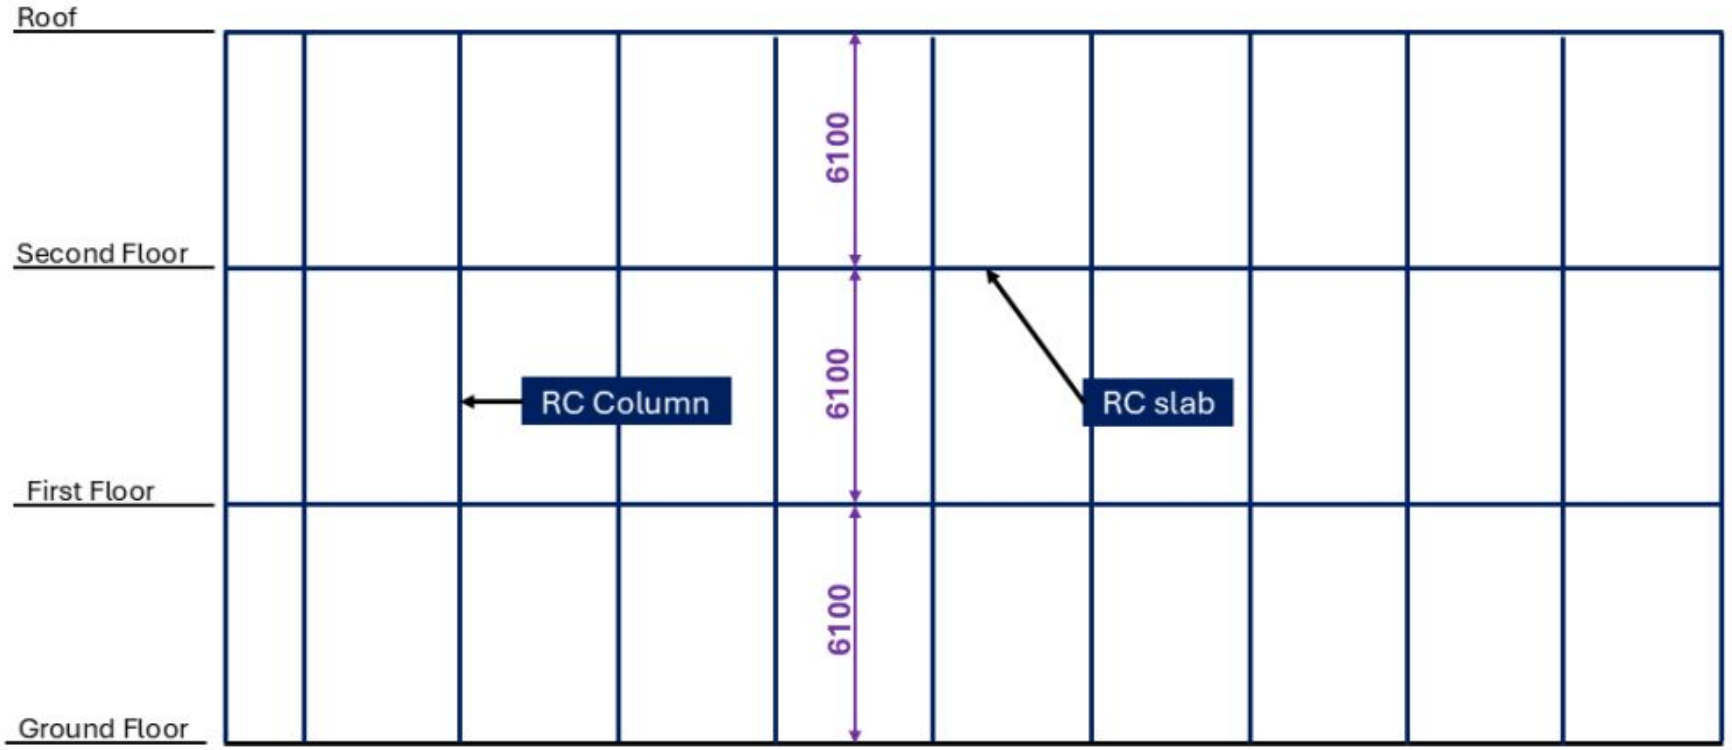


Figure 1.55. Section B-B of garment block

Building	Yarn Dyeing
Stability System	RC moment resisting frame system
Column Size (m)	0.68x0.68
Grid (m)	9.58x16.48
Primary Beam Size (m)	0.40x1.00
Secondary Beam Size (m)	0.40x1.00
Slab Depth (m)	0.15
Finishes Depth (m)	0.100 (typical)
Floor to Ceiling Height (m)	6.6 (Ground - roof) 4.6 (Ground - first) 3.0 (Ground - mezzanine) 3.35 (mezzanine - roof) 1.75 (1st - roof)

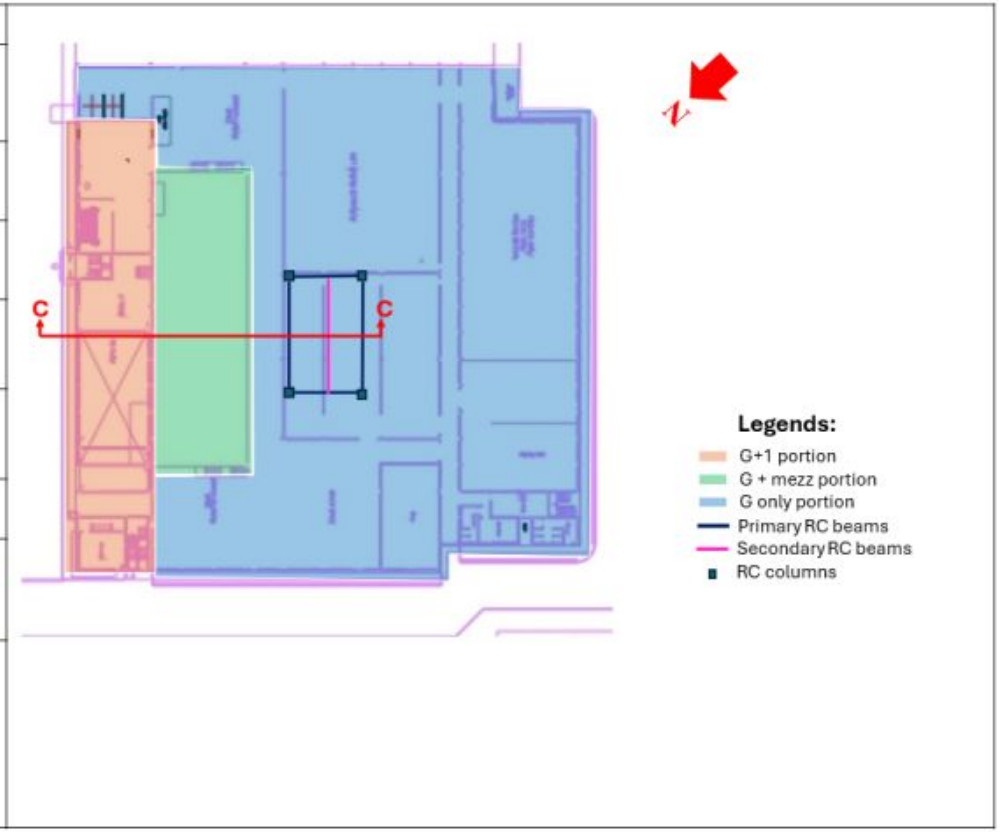


Figure 1.56. Typical floor framing plan detail of yarn dyeing

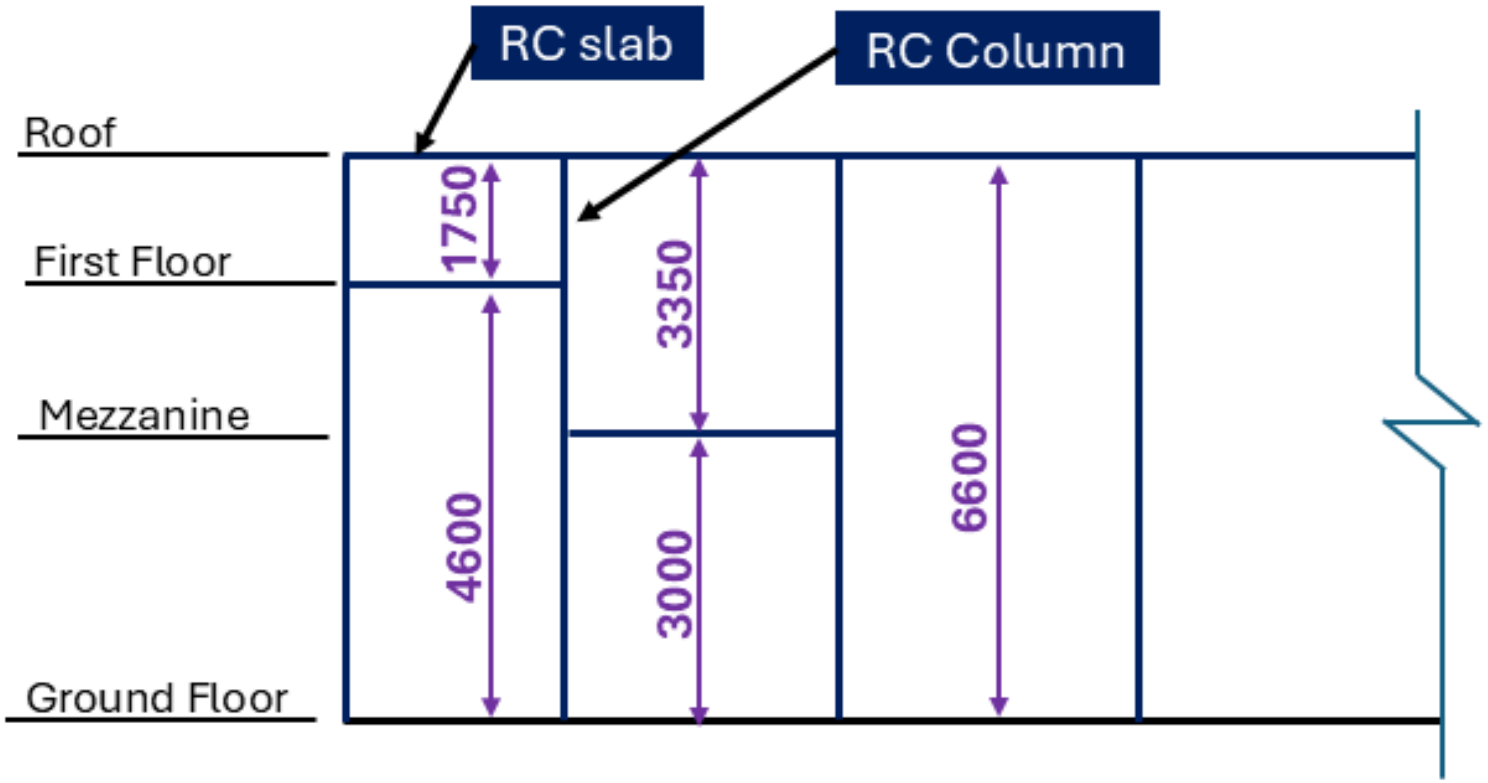


Figure 1.57. Section C-C of yarn dyeing

Building	Outer blocks
Stability System	RC moment resisting frame system
Column Size (m)	0.38x0.38
Grid (m)	7.28x5.48
Primary Beam Size (m)	0.30x0.30
Secondary Beam Size (m)	-
Slab Depth (m)	0.15
Finishes Depth (m)	0.100 (typical)
Floor to Ceiling Height (m)	3.7 (Typical)

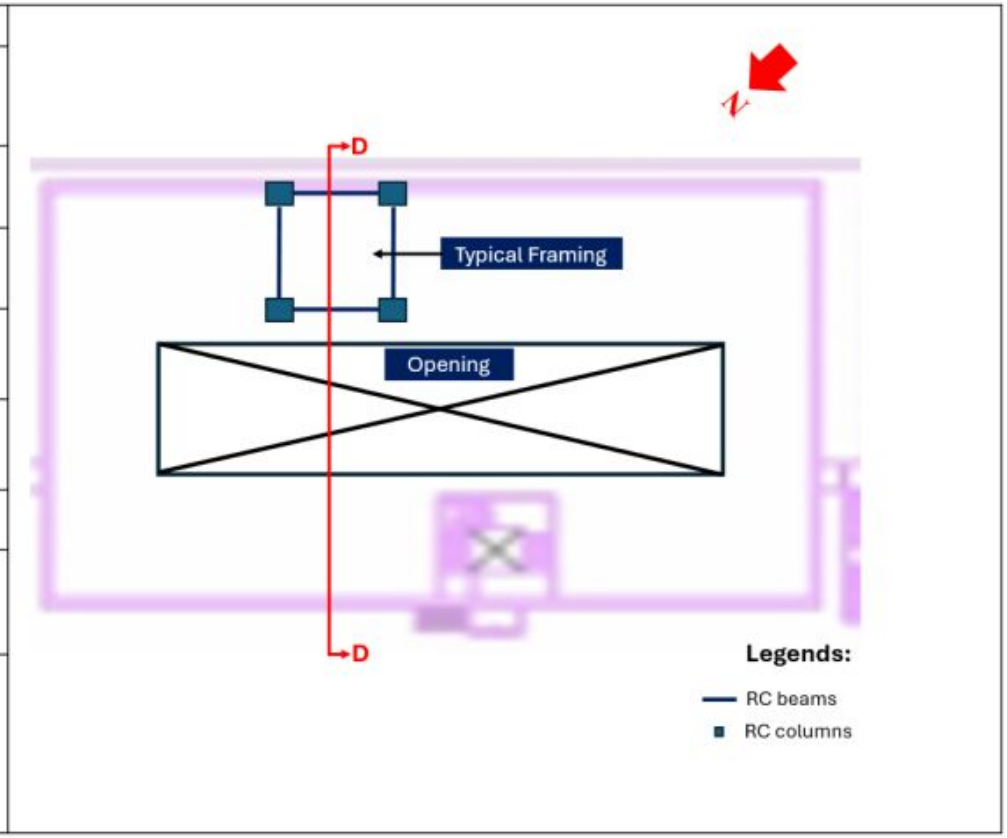


Figure 1.58. Typical floor framing plan detail of outer blocks

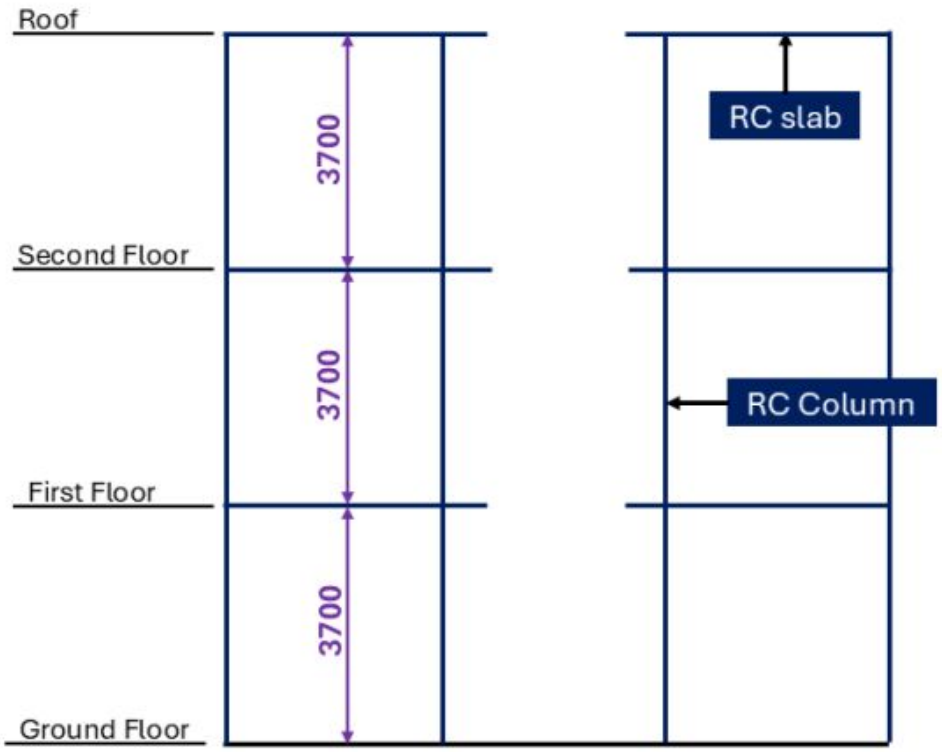


Figure 1.59. Section D-D of outer blocks

3. Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Hosiery Division 5									
Value stream unit 1	Yes	Yes	Yes	No	Yes (Architectural only. Not readable)	-	No	No	No
Value stream unit 2						-			
Office Block						No			
Canteen						No			
Processing labs						-			
Engineering offices									
Utility 1						-			
Utility 2						-			
Storage areas						-			
Carpenter and fire boost workshop						-			
Hosiery Division 6									
Value stream unit 1 – HD-06	Yes	Yes	Yes		Yes (Not readable)	-	No	No	No
Value stream unit 2 – HD-06						-			
Time office				Yes		-			

Yarn dyeing area									
Yarn dyeing	Yes	Yes	Yes	Yes (Not readable)	Yes (Not readable)	No	No	No	No
Yarn dyeing chemical store	Yes	Yes	Yes			-	No	No	No
Apparel plant 2									
Garment block	Yes	Yes	Yes	Yes	Yes	No	No	No	No
Dye house				Yes	Yes (Not readable)	-			
Utility area apparel				Yes	No	No			
Marketing block				Yes	Yes	-			
Wastewater treatment plant				Yes	No	-			
Chemical store apparel				Yes (Incomplete)	No	-			
Common area									
Technical training school	Yes	Yes	Yes	Yes	Yes	No	No	No	No
Workshops	Yes	Yes	Yes	No	No	-	No	No	No
Main gate office				No	No	-			
Apparel gate office				No	No	-			
Fair price shop				No	No	-			
Dispensary				No	No	-			
Storage/Lockers room				Yes	No	-			
Masjid				No	No	-			

Daycare				No	No	-			
LT room and OHWT				No	No	-			
Hosiery gate office				No	No	-			
Club and hostel area									
Central block 1 and central block 2	Yes	Yes	Yes	No	No	-	No	No	No
Outer block 1, outer block 2, outer block 3, outer block 4 and outer block 5				No	No	-			
Male Executive hostel and female executive hostel.				No	No	-			
Club				No	No	-			
Colony gate office				No	No	-			
Security office and ATM				No	No	-			
Colony workshops				No	No	-			
Drivers room	Yes	Yes	Yes	No	No	-	No	No	No
Colony OHWT				No	No	-			
Colony masjid				No	No	-			

Cafeteria and squash				No	No	-			
Apartments				No	No	-			
Utilities									
Parking shed	Yes	Yes	Yes	No	No	-	No	No	No
Boiler gate office				No	No	-			
Generator room 1 and generator room 2				No	No	-			
Transformer room				No	No	-			
Gas boiler area				No	No	-			
Biomass boiler area				No	No	-			
Storage shed				No	No	-			

4. Structural Safety Measures

During our structural site inspection of Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park, a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Interloop Ltd. (HD05) co-located w/Interloop Ltd. Apparel Park. Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Building	Overstress	Struct. system	Cracking	Loading	Damage/defects	Struct. docs
HD5						
VSU1	-	-	-	-	-	-
VSU2	-	Connection details	-	-	-	-
Office Block	-	-	-	-	Dowel corrosion	-
Canteen	-	-	-	-	-	-
Proc. labs	-	-	-	-	-	-
Eng. offices	-	-	-	-	-	-
Utility 1	-	-	-	-	-	-

Utility 2	-	-	-	-	-	-
Storage areas	-	-	-	-	-	-
Carpenter/fire boost workshop	-	-	-	-	-	-
HD6						
VSU1-HD06	-	-	-	-	-	-
VSU2-HD06	-	-	-	-	-	-
Time office	-	-	-	-	-	-
Yarn dyeing						
Yarn dyeing	-	-	-	-	-	-
Yarn dye chem. store	-	-	-	-	-	-
Apparel plant 2						
Garment block	-	-	-	-	-	-
Dye house	-	-	-	-	-	-
Utility area apparel	-	-	-	-	-	-
Marketing block	-	-	-	-	-	-
WWTP	-	-	-	-	-	-
Chem. store apparel	-	-	-	-	-	-
Common area						
Tech. training school	High column stress	-	-	-	Health and safety issues – lack of edge protection.	-
Workshops	-	-	-	-	-	-
Main gate office	-	-	-	-	-	-
Apparel gate	-	-	-	-	-	-
Fair price shop	-	-	-	-	-	-
Dispensary	-	-	-	-	-	-
Storage/Lockers	-	-	-	-	-	-

Masjid	-	-	-	-	-	-
Daycare	-	-	-	-	-	-
LT rm & OHWT	-	-	-	-	-	-
Hosiery gate office	-	-	-	-	-	-
Club & hostel area						
Central blocks 1 & 2	-	-	-	-	-	-
Outer blocks 1–5	-	-	-	-	-	-
Male & female exec. hostels	-	-	-	-	-	-
Club	-	-	-	-	-	-
Colony gate office	-	-	-	-	-	-
Security office & ATM	-	-	-	-	-	-
Colony workshops	-	-	-	-	-	-
Drivers room	-	-	-	-	-	-
Colony OHWT	-	-	-	-	-	-
Colony masjid	-	-	-	-	-	-
Cafeteria & squash	-	-	-	-	-	-
Apartments	-	-	-	-	-	-
Utilities						
Parking shed	-	-	-	-	-	-
Boiler gate	-	-	-	-	-	-
Generator rooms 1 & 2	-	-	-	-	-	-
Transformer rm	-	-	-	-	-	-
Gas boiler	-	Local stability issue	-	-	-	-
Biomass boiler	-	Local stability issue	-	-	-	-
Storage shed	-	-	-	-	-	-

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the remediation plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-066089

Timeline	Remediation Plan
Medium Term CAP-0078695	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Potential Overstress

6.1 Highly stressed columns

The internal ground-floor columns of the technical training school are overstressed due the greater number of storeys(G+3) ,relatively large grid spacing(19.90mx4.50m) in proportion to their section sizes(0.70mx1.00m) and unavailablity of concrete and steel reinforcement data. F-202605-067037

Timeline	Remediation Plan
Medium Term CAP-0080122	Verify in-situ reinforcement by removing cover and confirming no. and diameter of bars and submit results to Pakistan Accord.
Medium Term CAP-0080123	Verify in-situ concrete strength for the identified columns either by 100mm dia. cores from at least 4 columns or existing cylinder strength data and submit results to Pakistan Accord.
Medium Term CAP-0080124	Factory engineer to review design, loads and stresses in area identified above.
Longer Term CAP-0080125	Produce and actively manage a loading plan for all plates within the factory giving consideration to floor capacity and column capacity.

7. Structural System

7.1 Lack of local stability

This issue refers to the gas boiler area.
The vertical cross bracing were missing at the wall of gas boiler area at ground floor, which compromises its lateral load resistance and overall structural stability.F-202604-066066

Timeline	Remediation Plan
Longer Term CAP-0079865	Implement the remediation as required.
Medium Term CAP-0078647	Building engineer to review the design of structure and propose any strengthening measures as required.

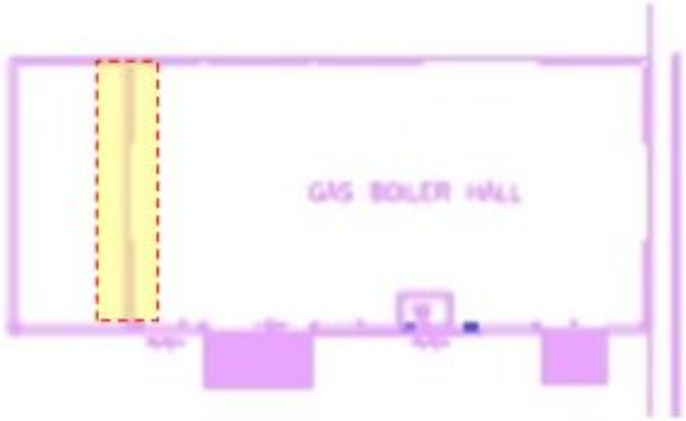


Figure 2.1 - Gas boiler area - Identified location of missing cross bracing at wall at ground level



Figure 2.2 - Gas boiler area - Location of missing cross bracing at wall at ground level

7.2 Lack of local stability

This issue refers to the biomass boiler area.
The vertical cross bracing were missing at the stair of biomass boiler area , which compromises its lateral load resistance and overall structural stability.F-202604-066069

Timeline	Remediation Plan
Medium Term CAP-0078650	Building engineer to review the design of structure and propose any strengthening measures as required.
Longer Term CAP-0079866	Implement the remediation as required.

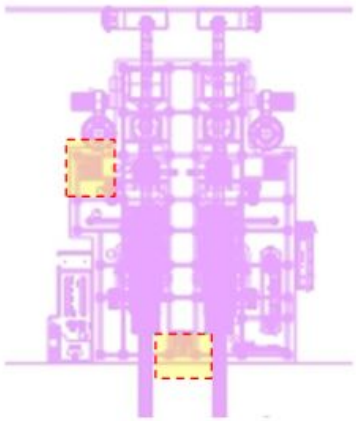


Figure 2.3 - Biomass boiler area - Identified location of missing cross bracing at stairs



Figure 2.4 - Biomass boiler area - Location of missing cross bracing at stairs

7.3 Connection details

This issue referes to value stream unit 2 - HD-05
A connection bolt was found missing at the ground floor column supporting the bracing, which may compromise the lateral stability of the structure.F-202604-066070

Timeline	Remediation Plan
Medium Term CAP-0078651	Provide adequate bolt connection, at the column or any other part of the factory with the same issue.

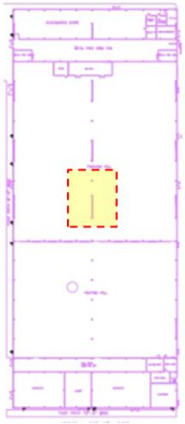


Figure 2.5 - Value stream unit 2 - Approximate location of missing bolt connection at the column at ground level



Figure 2.6 - Value stream unit 2 - Location of missing bolt connection at the column at ground level

8. Other Damage/Defects

8.1 Corrosion of reinforcement

This refers to the exposed rebars on the roof level of office block where the rebars were corroded because of being exposed to the atmosphere. This corrosion can lead to reduction in the capacity of the rebars over time F-202604-066046

Timeline	Remediation Plan
Medium Term CAP-0078643	Propose the remedial measure to protect the dowel reinforcement from future atmospheric corrosion and submit to Pakistan Accord for review.
Longer Term CAP-0078644	Implement the required remedial work.

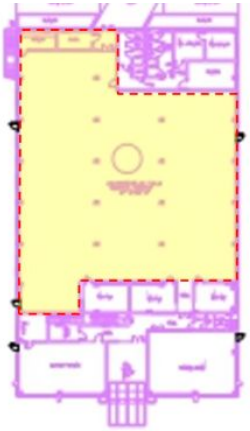


Figure 2.7 - Office block - Identified location of corrosion of dowel reinforcemetn at roof level



Figure 2.8 - Office block - Location of corrosion of dowel reinforcemetn at roof level

9. Structural Documentation

9.1 Documentation unavailable

The list of buildings for which as-built drawings have not been provided is given below:

Workshops, main gate office, apparel gate office, fair price shop, dispensary, storage/lockers room, masjid, LT room and OHWT, hosiery gate office, central block 1 and central block 2, outer block 1, outer block 2, outer block 3, outer block 4 and outer block 5, male executive hostel and female executive hostel, club, colony gate office, security office and ATM, colony workshops, drivers room, colony OHWT, colony masjid, cafeteria and squash, apartments, parking shed, boiler gate office, generator room 1 and generator room 2, transformer room, gas boiler area, biomass boiler area and storage shed

The list of buildings for which the submitted drawings are not readable is given below:

Value stream unit 1, value stream unit 2, office block, canteen, processing labs, engineering offices, utility 1, utility 2, storage areas, carpenter and fire boost workshop, value stream unit 1 – HD-06, value stream unit 2 – HD-06 , time office, yarn dyeing, yarn dyeing chemical store and dye house.F-202605-066510

Timeline	Remediation Plan
Medium Term CAP-0079365	Submit complete as-built architectural and structural drawings that are available, in readable form.
Longer Term CAP-0079366	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as built documentation for drawings not available.

9.2 Lack of safe load plans

No safe load plans were posted on any floor of the following buildings:

- Yarn dyeing
- Garment block
- Utility area apparel
- Technical training school
- Marketing blockF-202605-066511

Timeline	Remediation Plan
Longer Term CAP-0079367	Building structural engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0079368	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0079369	Factory to post safe load plans on each floor.

10. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.