Issue	**1**
Factory ID	**920037**
Date of Issue	**28-May-2026**

M/S Stylers International Ltd. - Unit 2 (Raiwind)

Village Buchoke Majha Raiwind Bypass 3 Km Off Raiwind Manga Road, Tehsil Raiwind
55150 Lahore
Punjab Pakistan

Latitude: [31.228723], longitude: [74.176596]
Date of inspection: 30-Mar-2026

Structural Safety Inspection Report

Observations & Actions



Authors	**Ali Javed**
Reviewed by	**Talha Akram Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 30-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 14
3. Documentation 18
4. Structural Safety Measures 20
5. Remediation Support 22
   5.1 Engineering Support 22
6. Other Damage/Defects 23
   6.1 Column impact damage 23
7. Structural Documentation 25
   7.1 Documentation unavailable 25
   7.2 Lack of safe load plans 26
8. Assessment Limitations and Assumptions 27

1. Executive Summary

On 30-Mar-2026, Owais Raza, Muhammad Asim and Ali Javed on behalf of the Pakistan Accord carried out an initial structural inspection for M/S Stylers International Ltd. - Unit 2 (Raiwind), a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with factory management representative Mr. Najam-us-Saqlain (Project Head), Mr. Imran Shahid (Manager Compliance), Mr. Zubair Umar (Civil Engineer) and other staff members of M/S Stylers International Ltd. – Unit 2 (Raiwind). The assessment was conducted as a part of an overall Structural, Fire, and Electrical initial inspection.

The factory operates in total four shifts. Approximately 2000 workers operate in the factory with 7% of the workers being females.

The factory comprises of four buildings and four ancillary structures owned by M/S Stylers International Ltd. – Unit 2 (Raiwind). During the inspection, the areas highlighted in blue in Figure 1.1 were inspected.

- **Mill Building** is a four storeys (Ground+Mezzanine+2) building. The structural system of the building consists of a RC moment-resisting frame system. The building is used for solar panels (roof), cutting, canteen, storage, masjid (second floor), sewing, stitching (first floor), unoccupied (mezzanine floor), and washing, finishing, offices (ground floor). The construction year of the building is 2024.
- **Utility Building 01** is mainly a single storey (Ground only) structure having a structural system of braced steel portal frame shed with part mezzanine floor having a structural system of RC moment-resisting frame. The building is used for offices (mezzanine floor), and biomass fuel storage, boiler operation (ground floor). The construction year of the building is 2024.
- **Utility Building 02** is a three storeys (Ground+Mezzanine+1) building. The structural system of the building consists of a RC moment-resisting frame. The roof structural system consists of a braced steel portal frame shed. The building is used for chiller room (first floor), offices (mezzanine floor), and workshops, chemical storage (ground floor). The construction year of the building is 2024.
- **Admin Building** is a two storeys (Ground+1) building. The structural system of the building consists of RC Moment resisting frame system. The building is used for offices on all floors (first and ground). The construction year of the building is 2024.
- **Ancillary Structures** comprises of four structures, the details of which are given below
  - **Gate Office 01** is a single storey (ground only) structure consists of load bearing brick masonry walls supporting RC slab. The structure is used for offices (ground floor). The construction year of the structure is unknown.
  - **Gate Office 02** is a single storey (ground only) structure consists of load bearing brick masonry walls supporting RC slab. The structure is used for offices (ground floor). The construction year of the structure is unknown.
  - **ETP** is a two storeys (Ground+1) structure with underground/ground tanks. The structural system consists of load bearing brick masonry walls supporting RC slab for building and RC retaining wall for tanks. The structure is used for offices (first floor), and

operation building (ground floor). The construction year of the structure is unknown.

- **Scrap Yard:** It is a single storey (ground only) structure consisting of a braced steel portal frame shed. It is used for storage purpose (ground floor). The construction year of this structure is unknown.

We were provided with approved site layout, design drawings, and structural stability certificate. Further detail on documentation is provided in Table 2.

A summary of concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Impact damage was observed on multiple columns within the mill building.

We see no reason to suspend operations in the facility due to these concerns, subject to the actions identified being addressed within the specified timeframes.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1 - Building Summary

Building	Use	No. of stories	Year of construction	Structural System	Roof structure system	Any extension/Modification	Engineer access issue
Mill Building	Solar panels (roof), cutting, canteen, storage, masjid (second floor), sewing, stitching (first floor), unoccupied (mezzanine floor), and washing, finishing, offices (ground floor)	Four storeys (G+M+2)	2024	RC moment resisting frame system	-	-	-

Utility Building 01	Offices (mezzanine floor), and biomass fuel storage, boiler operation (ground floor)	Mainly single-storey (Ground only) structure with part mezzanine floor	2024	Braced steel portal frame shed with part mezzanine floor having a structural system of RC moment-resisting frame	-	-	-
Utility Building 02	Chiller room (first floor), offices (mezzanine floor), and workshops, chemical storage (ground floor)	Three storeys (G+M+1)	2024	RC moment resisting frame system	Braced steel portal frame shed	-	-
Admin Building	Offices (first and ground floor)	Two storeys (G+1)	2024	RC Moment resisting frame system	-	-	-
Ancillary Structures							
Gate Office 01	Offices (ground floor)	Single storey (Ground only)	Unknown	Load bearing brick masonry walls supporting RC slab	-	-	-

Gate Office 02	Offices (ground floor)	Single storey (Ground only)	Unknown	Load bearing brick masonry walls supporting RC slab	-	-	-
ETP	Offices (first floor), and operation building (ground floor)	Two storeys (G+1) with underground/ground tanks	Unknown	Load bearing brick masonry walls supporting RC slab for building and RC retaining wall of tanks	-	-	-
Scrap Yard	Storage purpose (ground floor)	Single storey (Ground only)	Unknown	Braced steel portal frame shed	-	-	-

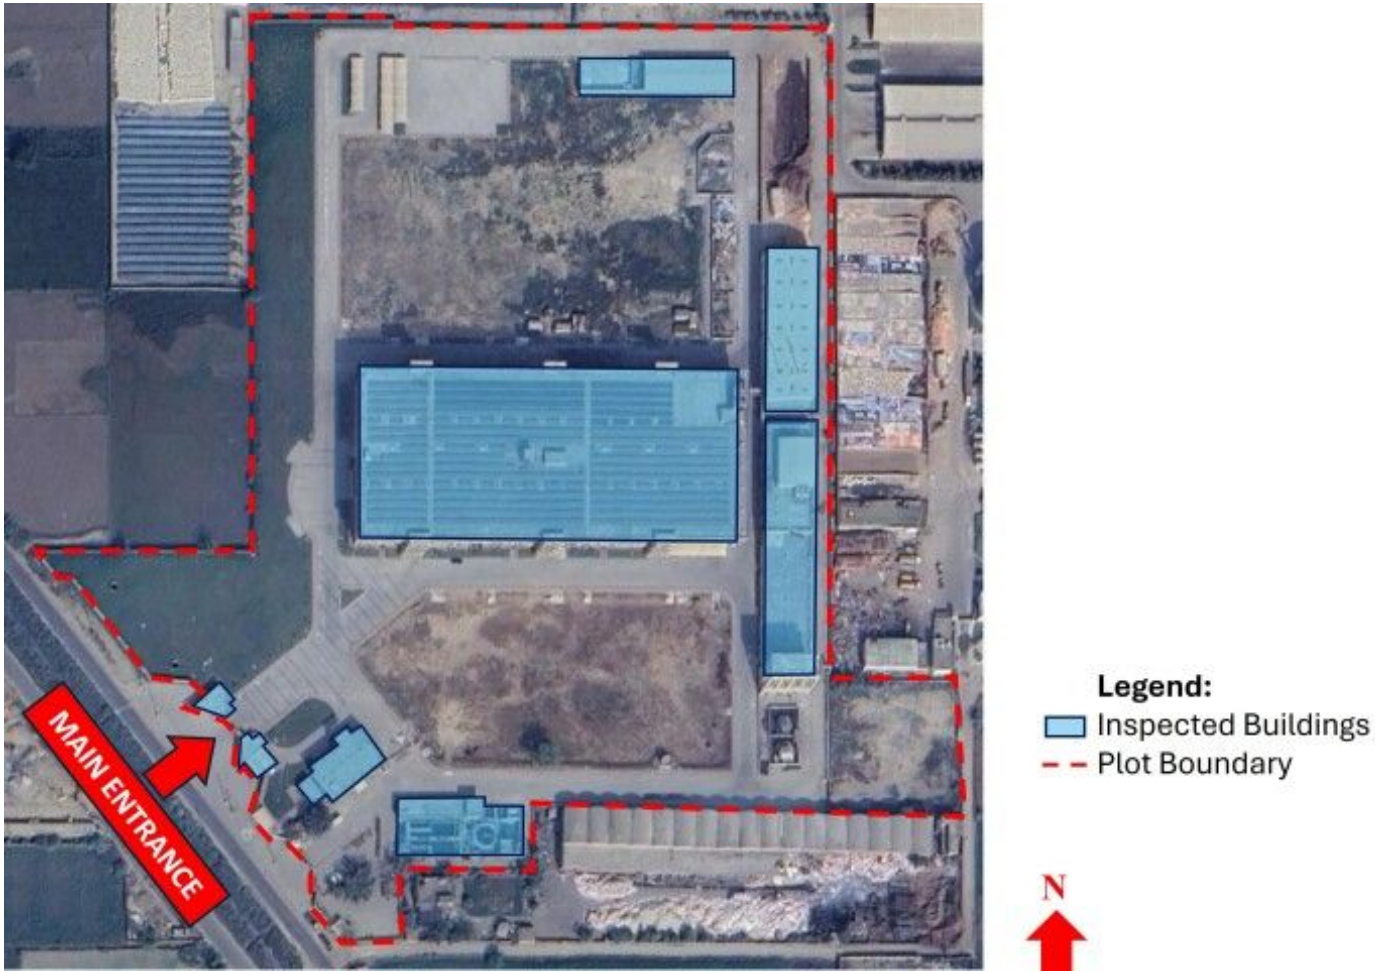


Figure 1.1. Site plan (Satellite view) - Red dashed line indicates site boundary

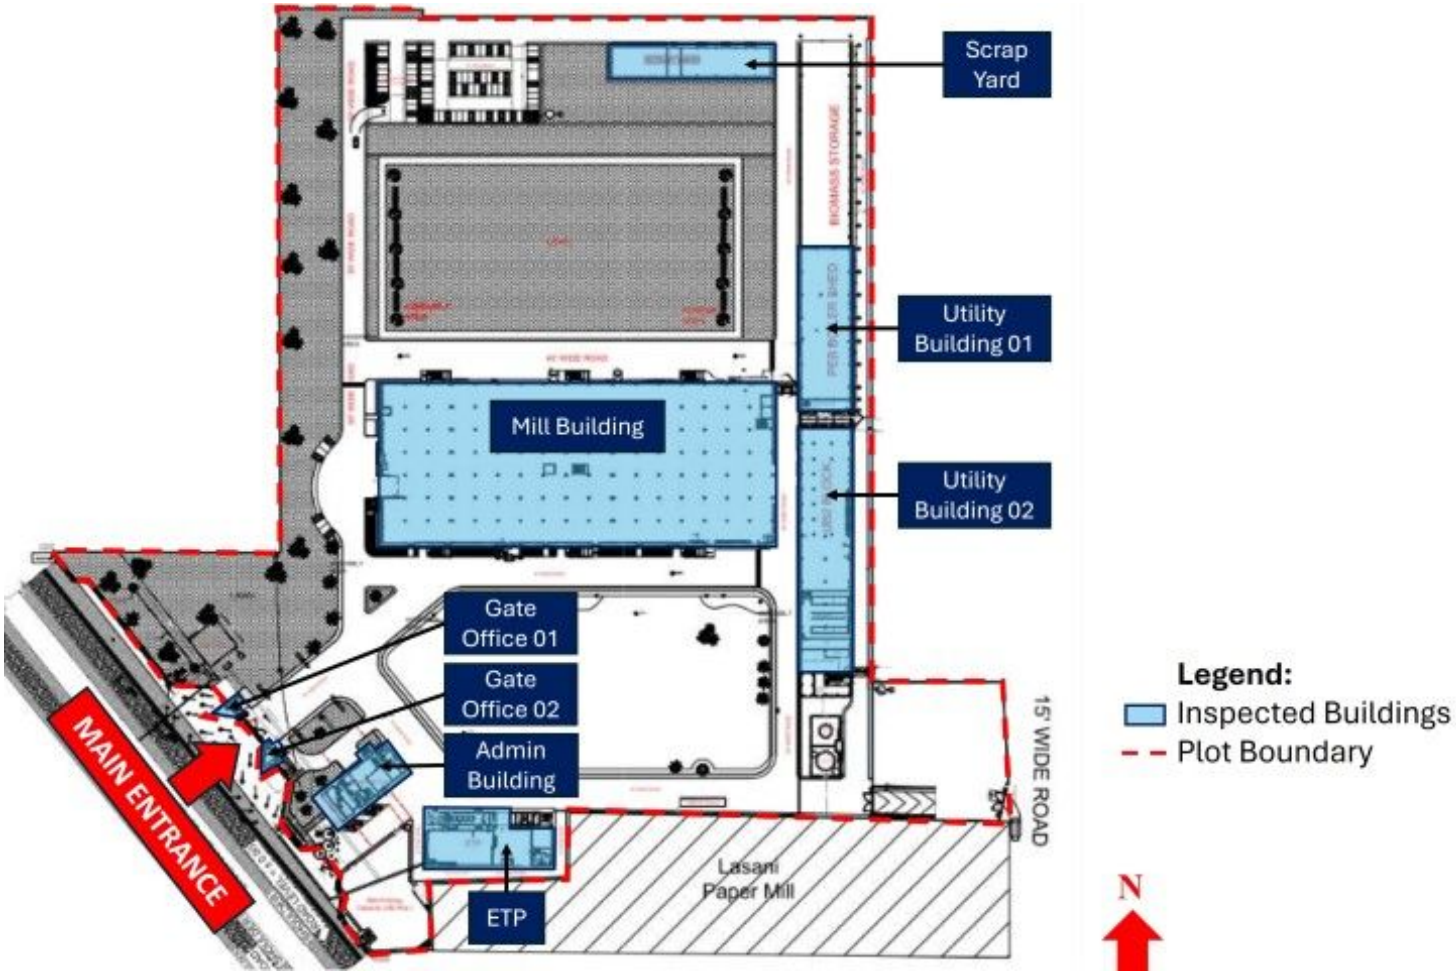


Figure 1.2. Site layout - Red dashed line indicates site boundary, highlighted area (blue) indicates buildings inspected



Figure 1.3. South Elevation of Mill Building



Figure 1.4. Southwest Elevation of Utility Building 01



Figure 1.5. Southwest Elevation of Utility Building 02



Figure 1.6. Southwest Elevation of Admin Building



Figure 1.7. North Elevation of ETP



Figure 1.8. Solar Panels at Roof of Mill Building



Figure 1.9. Typical Activity at Second Floor of Mill Building



Figure 1.10. Typical Activity at First Floor of Mill Building



Figure 1.11. Unoccupied Mezzanine Floor of Mill Building



Figure 1.12. Typical Activity at Ground Floor of Mill Building

2.1 Structural System

Building	Mill Building
Stability System	RC moment resisting frame
Column Size (m)	0.76 x 0.76 (Square Column) 0.923 Diameter (Circular Column)
Grid (m)	9.32 x 9.32 (max)
Primary Beam Size (m)	0.45 x 0.63
Secondary Beam Size (m)	0.15 x 0.63
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	4.8 (Second to Roof) 3.8 (Mezz. to First) 7.75 (Ground to First)

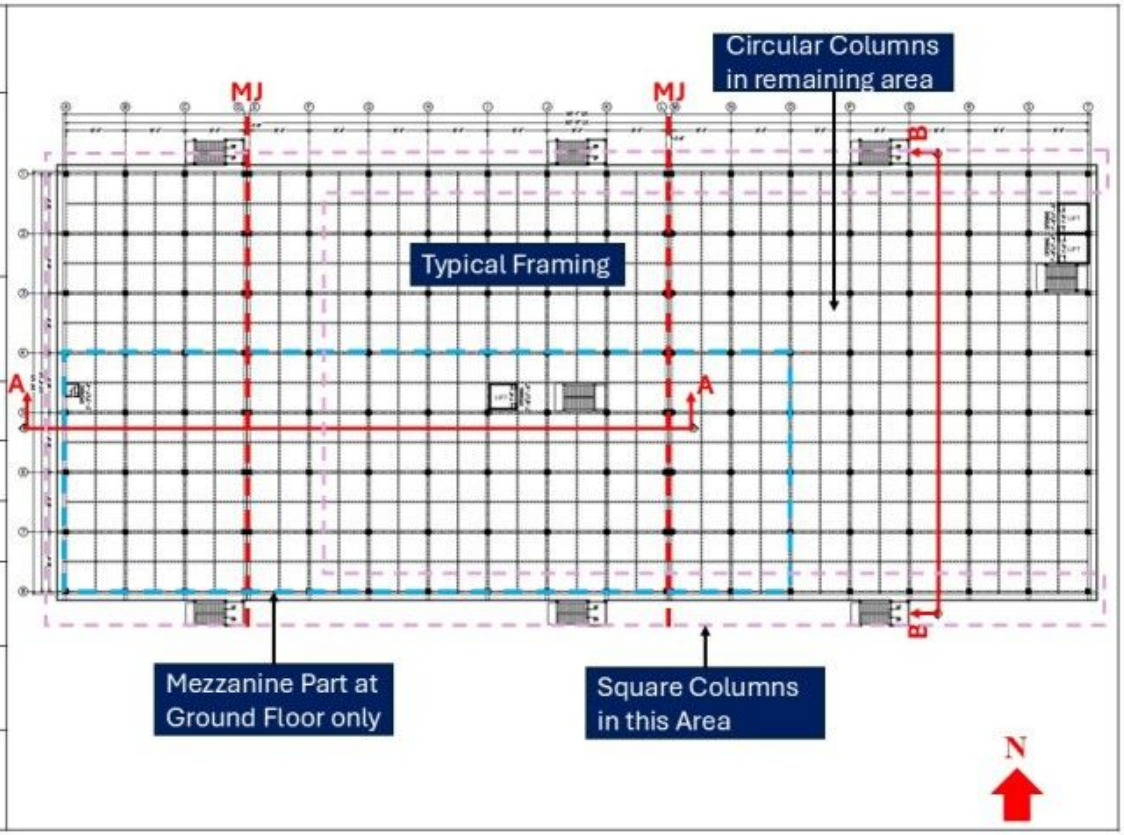


Figure 1.13. Mill Building - Mezzanine, First and Roof Floor Framing

Building	Mill Building
Stability System	RC moment resisting frame
Column Size (m)	0.76 x 0.76 (Square Column) 0.923 Diameter (Circular Column)
Grid (m)	9.32 x 9.32 (max)
Primary Beam Size (m)	0.45 x 0.63
Secondary Beam Size (m)	0.15 x 0.63
Slab Depth (m)	0.15
Finishes Depth (m)	0.1
Floor to Ceiling Height (m)	4.8 (First to Second)

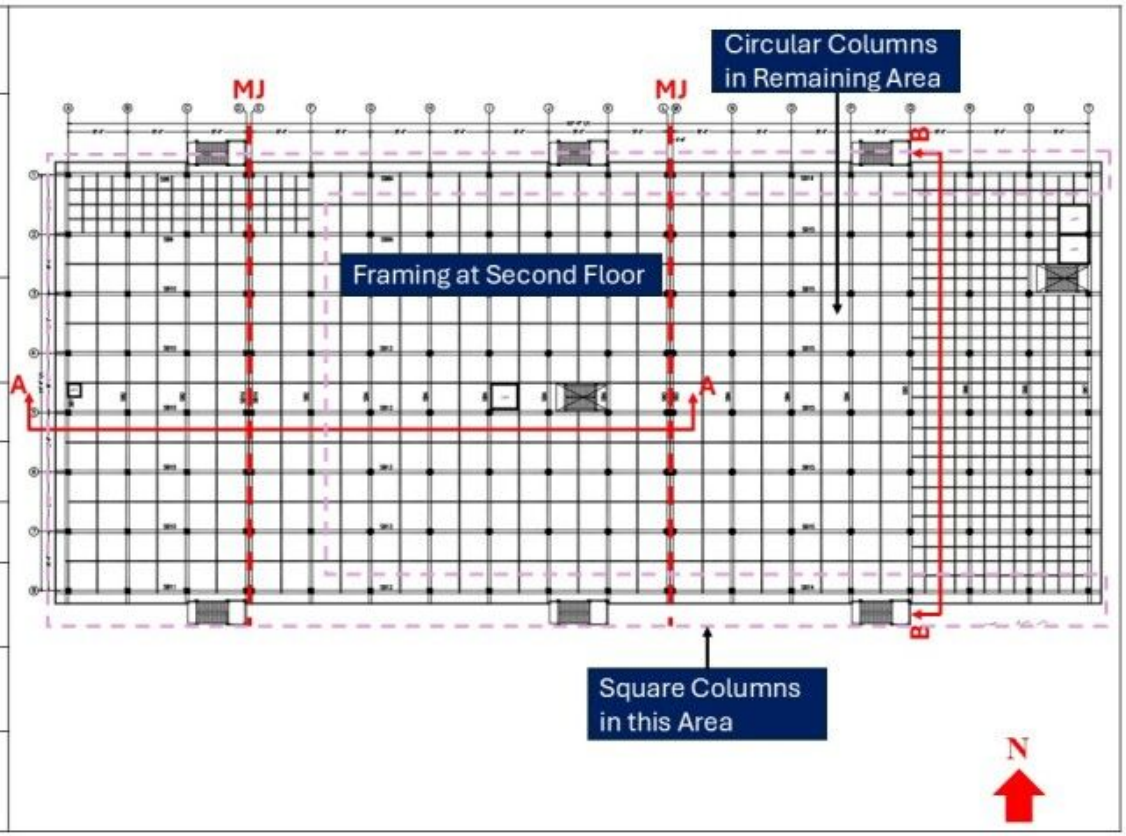


Figure 1.14. Mill Building - Second Floor Framing


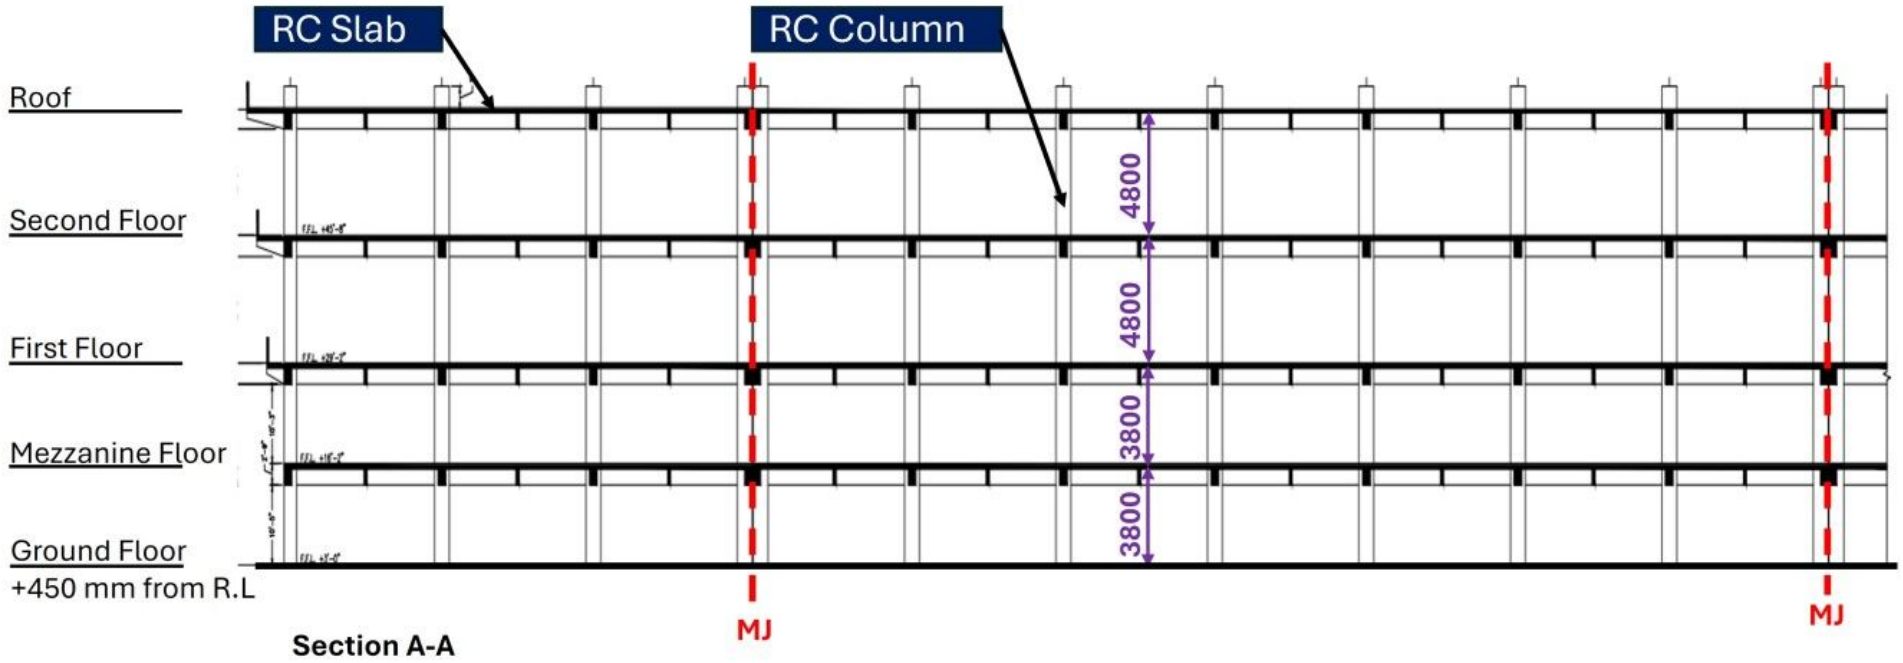


Figure 1.15. Section A-A of Mill Building

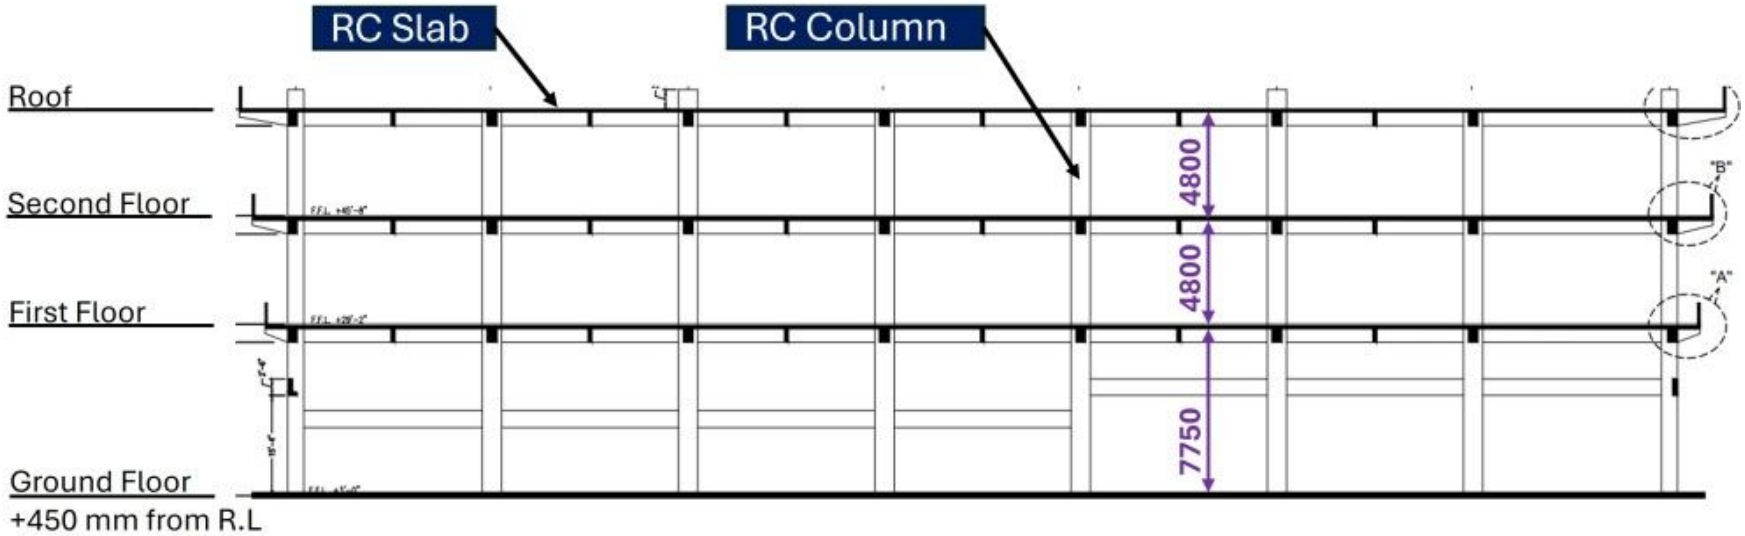

Section B-B

Structural System Notes

Column size includes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.16. Section B-B of Mill Building

3. Documentation

We were presented with the following documentation.

Table 2 – Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Mill Building	Yes	Yes	Yes	Yes (only architectural plans are not available)	No	Yes (non-confirming)	Yes	No	No
Utility Building 01	Yes	Yes	Yes	Yes (only architectural plans are not available)	No	Yes (non-confirming)	Yes	No	No
Utility Building 02	Yes	Yes	Yes	Yes (only architectural plans are not available)	No	Yes (non-confirming)	Yes	No	No
Admin Building	Yes	Yes	Yes	Yes (only architectural plans are not available)	No	Yes (non-confirming)	Yes	No	No
Ancillary Structures									

Gate Office 01	Yes	Yes	Yes	Yes (only architectural plans are not available)	No	Yes (non-confirming)	Yes	No	No
Gate Office 02	Yes	Yes	Yes	Yes (only architectural plans are not available)	No	Yes (non-confirming)	Yes	No	No
ETP	Yes	Yes	Yes	Yes (only architectural plans are not available)	No	Yes (non-confirming)	Yes	No	No
Scrap Yard	Yes	Yes	Yes	Yes (only architectural plans are not available)	No	Yes (non-confirming)	Yes	No	No

4. Structural Safety Measures

During our structural site inspection of M/S Stylers International Ltd. - Unit 2 (Raiwind), a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within M/S Stylers International Ltd. - Unit 2 (Raiwind). Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3: Summary of issues by building

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage & defects	Structural documentation
Mill Building	-	-	-	-	Column impact damage	Lack of safe load plans Documentation unavailable
Utility Building 01	-	-	-	-	-	Documentation unavailable
Utility Building 02	-	-	-	-	-	Lack of safe load plans Documentation unavailable
Admin	-	-	-	-	-	Documentation unavailable

Building						
Ancillary structures						
Gate Office 01	-	-	-	-	-	Documentation unavailable
Gate Office 02	-	-	-	-	-	Documentation unavailable
ETP	-	-	-	-	-	Documentation unavailable
Scrap Yard	-	-	-	-	-	Documentation unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-065045

Timeline	Remediation Plan
Medium Term CAP-0076964	Factories should begin remediation of CAP items—such as surface cracks or non-structural repairs—using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Other Damage/Defects

6.1 Column impact damage

This issue refers to the ground floor washing area of the mill building.
Impact damage was observed on multiple columns within the washing area, likely due to the trolley movement. The damage is limited to minor surface abrasion of the concrete, with no significant depth or exposure of reinforcement noted. At present, the issue is of low structural severity; however, continued impact may lead to progressive deterioration.F-202604-064932

Timeline	Remediation Plan
Medium Term CAP-0076858	Repair damage to column corners and external faces.
Medium Term CAP-0076859	Install protective measures to prevent damage recurring, particularly in areas subjected to trolley and machinery movement within the factory.
Longer Term CAP-0076860	Continue to monitor condition of columns in highly trafficked areas.



Figure 2.1 - Impact Damage on Columns at Ground Floor of the Mill Building

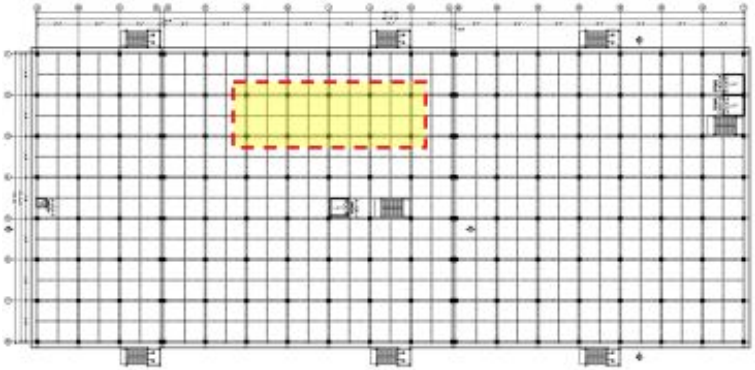


Figure 2.2 - Location of Impact Damage on Columns at Ground Floor of the Mill Building

7. Structural Documentation

7.1 Documentation unavailable

Architectural plans are not available for any building in the data provided. F-202605-066444

Timeline	Remediation Plan
Longer Term CAP-0079352	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as-built documentation.

7.2 Lack of safe load plans

No safe loading plans were posted on any floor of the mill building and utility building 2.
Furthermore, the load plans provided by the factory management in soft copy do not meet the required standards due to absence of pictorial evidence, load description, operational loading and general arrangement of floor.F-202604-064906

Timeline	Remediation Plan
Longer Term CAP-0076799	Building structural engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0076796	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0076797	Factory to post safe load plans on each floor.

8. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.