Issue	**1**
Factory ID	**25797**
Date of Issue	**28-May-2026**


Magna Manufacturing (New Site)

13 Km Daska Road
Sialkot
Punjab Pakistan

Latitude: [32.39948], longitude: [74.44158]
Date of inspection: 17-Mar-2026

Structural Safety Inspection Report

Observations & Actions

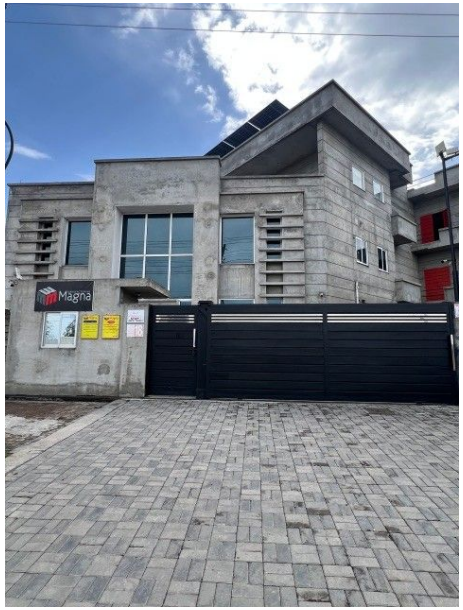

Authors	**Owais Raza**
Reviewed by	**Talha Akram Khan**
Approved by	**Colm Quinn**

Pakistan Accord Initial Safety Inspection Report

About this report:

This report has been prepared by the Health and Safety Accord Pvt Ltd after visiting the factory on 17-03-2026 as part of the inspection and remediation program of the Pakistan Accord on Health and Safety in the Textile and Garment Industry. The purpose of the report is to provide key findings and identify related safety improvements needed at the inspected factories. This inspection report may not identify minor deficiencies, which may be further addressed as part of follow-up inspections.

In addition, while this round of initial inspections covers fire, electrical and structural safety, the Pakistan Accord intends to include inspections on boiler safety and hazardous material in later rounds.

This report will serve to facilitate discussions between the Pakistan Accord, the factories and the responsible brands that source from this facility about the remediation requirements. An implementation schedule shall be developed by the factory in the form of a Corrective Action Plan (CAP) to remediate each of the findings identified in the inspection report, including timelines and cost estimates, for approval by the Chief Safety Officer (CSO).

Applied Standards:

This safety assessment was conducted by the Pakistan Accord with reference to the Pakistan Accord Building Standard.

Contents

1. Executive Summary 4
2. Building Extents 6
   2.1 Structural System 14
3. Documentation 17
4. Structural Safety Measures 18
5. Remediation Support 20
   5.1 Engineering Support 20
6. Structural System 21
   6.1 Connection details 21
7. Other Damage/Defects 22
   7.1 Health and Safety 22
8. Structural Documentation 23
   8.1 Documentation unavailable 23
   8.2 Differs from as-built structure 24
   8.3 Lack of safe load plans 25
9. Assessment Limitations and Assumptions 26

1. Executive Summary

On 17-Mar-2026, Haris Mahmood and Owais Raza on behalf of the Pakistan Accord carried out an initial structural inspection for Magna Manufacturing (New Site), a factory at the address and coordinates given on the cover page of this report. The inspection was carried out in accordance with the Pakistan Accord Building standards.

We met with Humza Mahmood (Director), Umar Mahmood (Director) and other staff members of Magna Manufacturing (New Site). The assessment was conducted as part of an overall Structural, Fire, and Electrical initial inspection.
The factory operates in single shift. Approximately 47 workers operate in the factory with 1 worker being female.
The factory consists of one main building and two ancillary structures owned by Magna Manufacturing (New Site). During the inspection, the areas highlighted in Figure 1.1 were surveyed, with the site boundary indicated in red dashed line.

- **Main Building** is a four storey (Ground + 3) building having a RC moment resisting frame system. The roof's structural system of the building consists of braced steel portal frame shed. The building is used for cutting, storage, shipment, raw material inspection, sampling, offices, (Ground Floor), sewing, packing, checking, sleeping area, offices (First Floor), dining and prayer area (Second Floor), solar panels and overhead water tank (Third Floor). The third floor of the main building is currently vacant but planned for future production use. The building was constructed in 2022.
- **Electrical Room** is a single storey (Ground only) structure having a load bearing brick masonry wall system supporting RC slab. The building is used for electrical panels (Ground Floor). The structure was constructed in 2022.
- **Gate Office** is a single storey (Ground only) structure having a load bearing brick masonry wall system supporting RC slab. The building is used for office (Ground Floor). The structure was constructed in 2022.

A site layout plan, structural and architectural drawings and stability certificate were presented. For further details, refer to Table 2 of the documentation.
There is a health and safety concern including the lack of edge protection at the first and second floor projection of Main Building which should be addressed immediately. For Further details refer to section 7 of this report.
A summary of main concerns identified on-site during the assessment (non-exhaustive) that should be actioned are as follows:

- Cross bracings in the steel shed at the third floor of the main building were observed to be loose.

We see no reason to suspend operations in the facility due to these concerns.

Our Limitations and Assumptions are also noted at the end of this report.

For detailed analysis of the above, please refer to the full inspection report below, which further details each issue, and also includes photographs. Further actions with associated priorities and timeframes are also detailed with each issue. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

2. Building Extents

Table 1: Building Summary

Building	Use	No. of stories	Year of construction	Structural system	Roof structural system	Any Extension / modifications	Engineer access issues
Main Building	Cutting, storage, shipment, raw material inspection, sampling, offices, (Ground Floor) Sewing, packing, checking, sleeping area, offices (First Floor) Dining, prayer area (Second Floor) Solar panels (Third Floor)	Four storey (Ground + 3)	2022	RC moment resisting frame system	Braced steel portal frame shed	-	-

Electrical Room	Electrical panels (Ground Floor)	Single storey (Ground only)	2022	Load bearing brick masonry wall system supporting RC slab	-	-	-
Gate office	Office (Ground Floor)	Single storey (Ground only)	2022	Load bearing brick masonry wall system supporting RC slab	-	-	-



Figure 1.1. Satellite View of the Factory Premises; Red Dashed Line Indicates Site Boundary and Highlighted Area Indicates Buildings Inspected

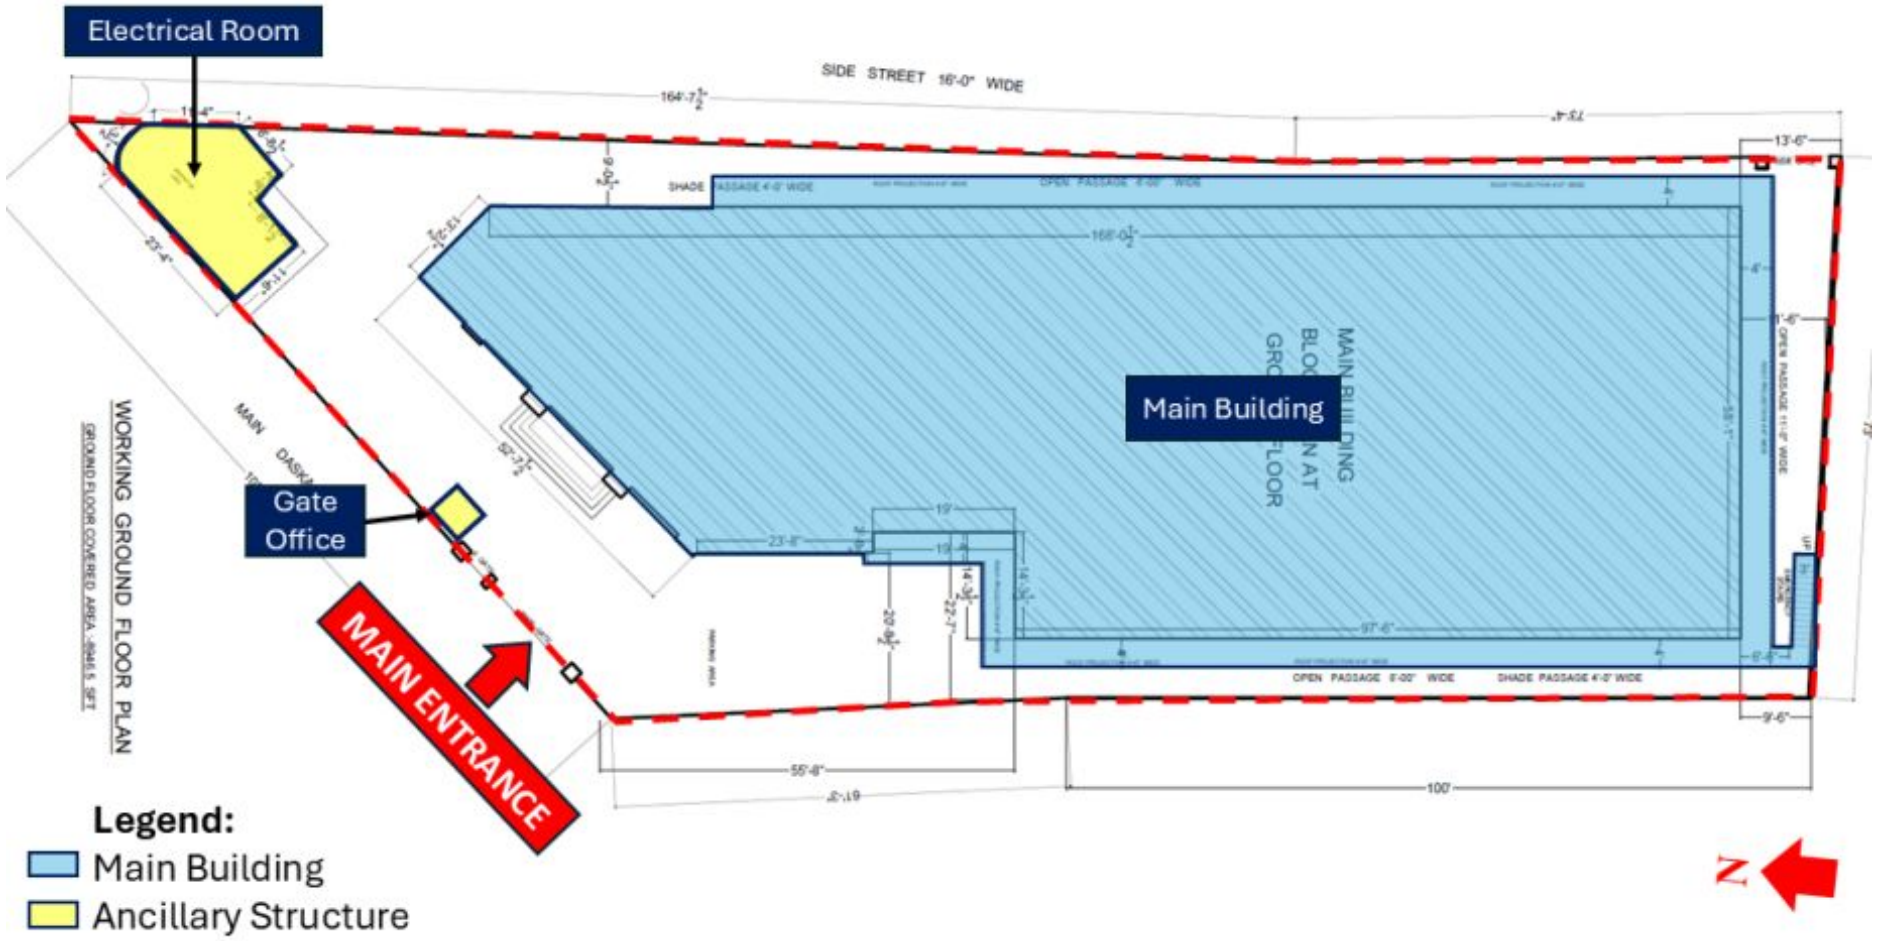


Figure 1.2. Site Layout Plan of the Factory Premises; Red Dashed Line Indicates Site Boundary and Highlighted Area Indicates Buildings Inspected



Figure 1.3. Main Building - Front Elevation



Figure 1.4. Electrical Room - Front Elevation



Figure 1.5. Gate Office - Front Elevation



Figure 1.6. Cutting at Ground Floor - Main Building



Figure 1.7. Storage at Ground Floor- Main Building



Figure 1.8. Sampling at Ground Floor - Main Building



Figure 1.9. Offices at Ground Floor - Main Building



Figure 1.10. Sewing at First Floor - Main Building



Figure 1.11. Finishing and Packing at First Floor - Main Building



Figure 1.12. Offices at First Floor - Main Building



Figure 1.13. Sleeping Area at First Floor - Main Building



Figure 1.14. Prayer Area at Second Floor - Main Building



Figure 1.15. Dining Area at Second Floor - Main Building



Figure 1.16. Solar Panels at Third Floor - Main Building



Figure 1.17. Vacant at Third Floor - Main Building

2.1 Structural System

Building	Main Building
Stability System	RC moment resisting frame
Column Size (m)	0.48 x 0.48
Grid (m)	7.18 x 6.28 (Max.)
Primary Beam Size (m)	0.3 x 0.35
Secondary Beam Size (m)	0.3 x 0.25
Slab Depth (m)	0.15
Finishes Depth (m)	0.15
Floor to Ceiling Height (m)	3.6 (Typical)

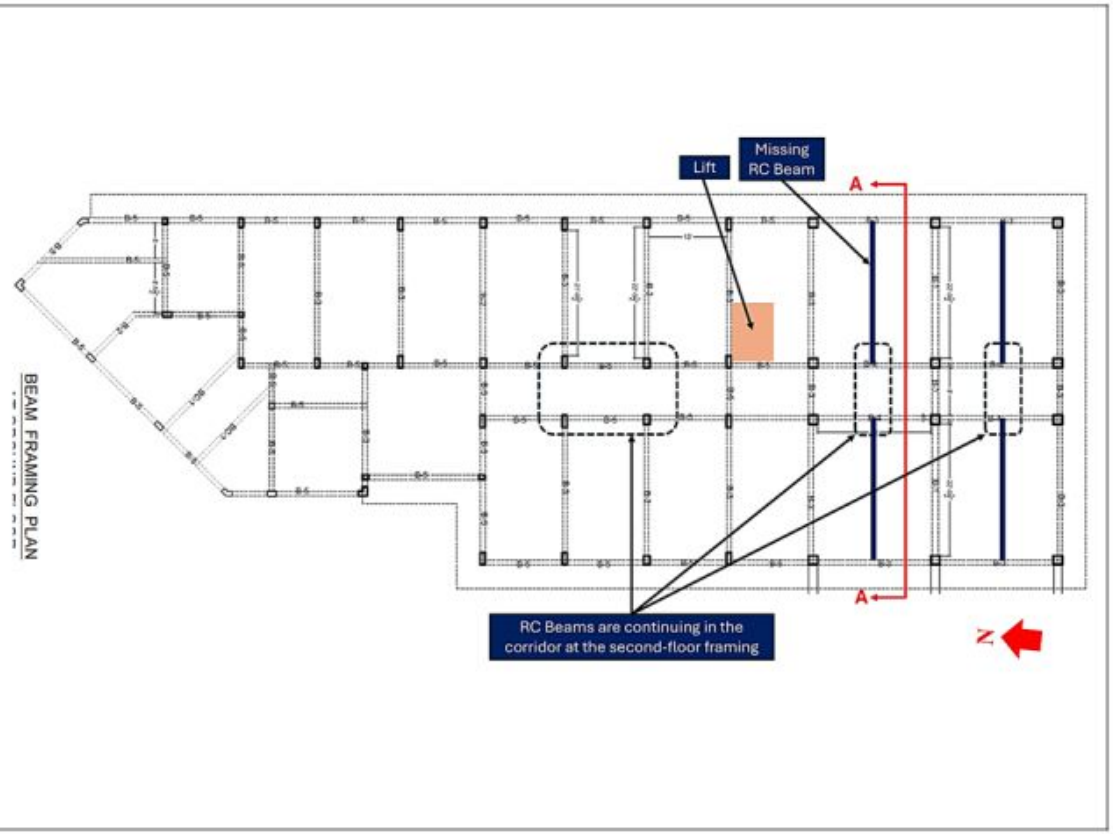


Figure 1.18. First and Second Floor Framing Plan of Main Building

Building	Main Building
Stability System	RC moment resisting frame and braced steel portal frame shed at roof level
Column Size (m)	0.48 x 0.48
Grid (m)	7.18 x 6.28 (Max.)
Primary Beam Size (m)	0.3 x 0.35
Secondary Beam Size (m)	0.3 x 0.25
Slab Depth (m)	0.15
Finishes Depth (m)	0.15
Floor to Ceiling Height (m)	3.6 (Typical) 5.3 (Third Floor to Roof)


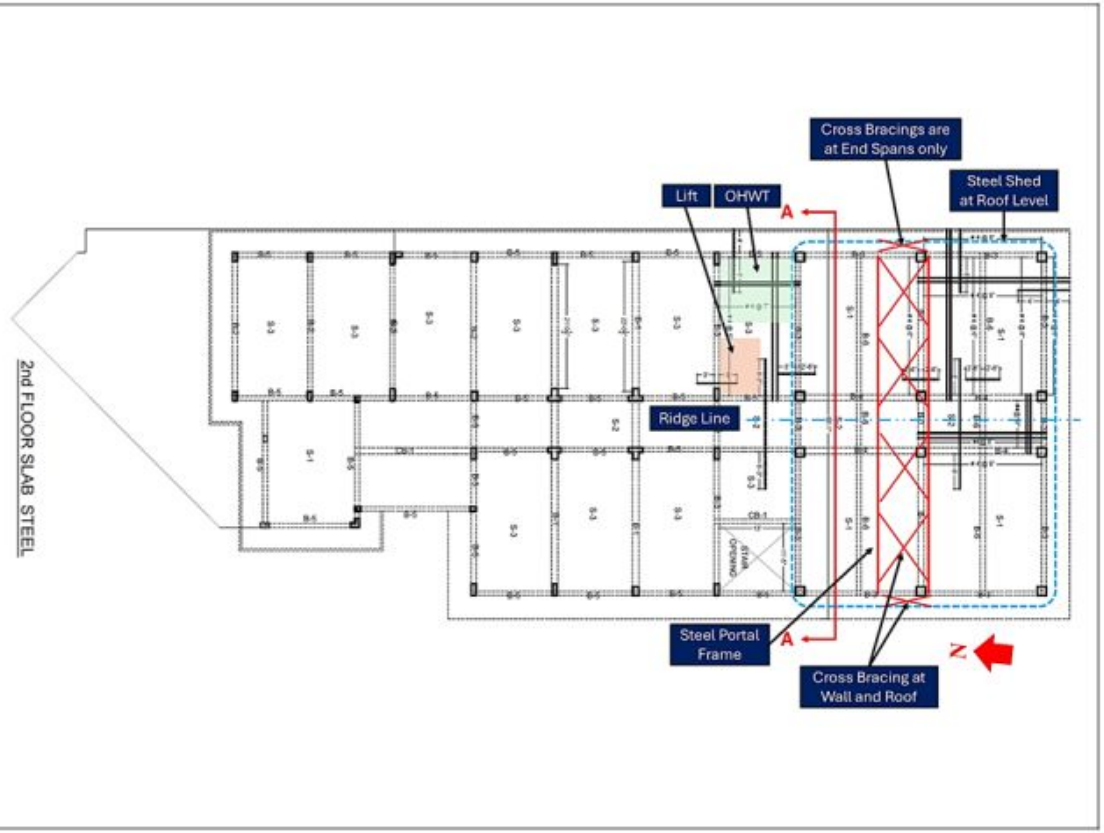


Figure 1.19. Third Floor and Roof Framing Plan of Main Building

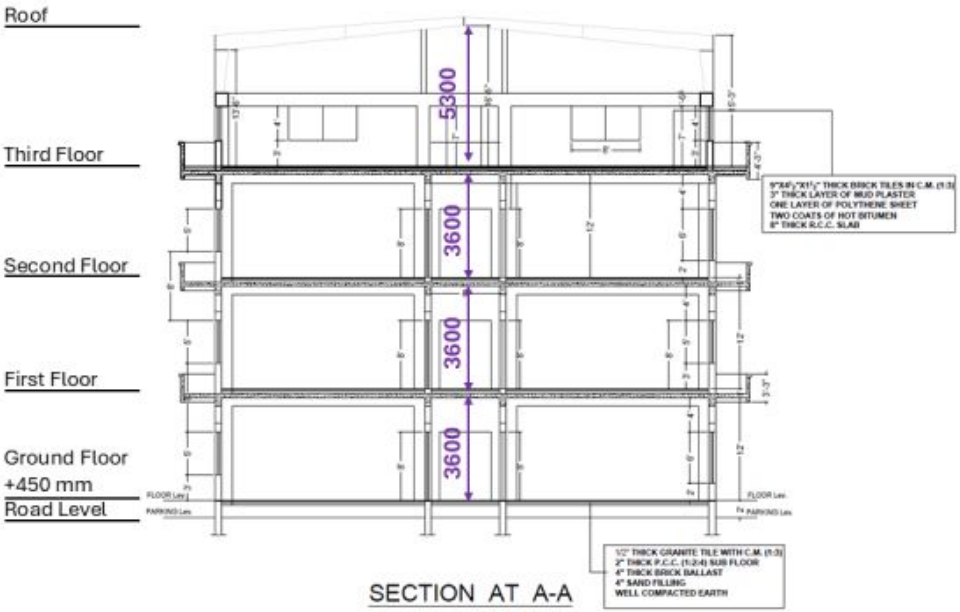

Structural System Notes

Column size includes the render thickness.

Grid measurements are from centre of column to centre of column.

Beam sizes do not include slab depth.

Figure 1.20. Section A-A Detail of Main Building

3. Documentation

This table outlines the documentation details provided by the factory.

Table 2 - Documentation

Building	Site layout	Approved layout / permit	Geotech report	Design drawings	As-built drawings	Loading plans	Stability certificate	Inspection reports	Materials testing
Main Building	Yes	No	No	Yes (Incomplete and Non-conforming)	Yes (Incomplete and Non-conforming)	No	Yes (non-conforming)	No	No
Electrical Room			No	No	No	No	No	No	No
Gate office			No	No	No	No	No	No	No

4. Structural Safety Measures

During our structural site inspection of Magna Manufacturing (New Site), a number of structural issues were identified.

It is essential to address these structural safety issues promptly to enhance safety and compliance within Magna Manufacturing (New Site). Each issue should be carefully evaluated, and the recommendations provided in this report should be followed diligently to rectify these concerns. The safety and well-being of the factory's employees depend on these corrective actions. Where issues are identified in the report, they are grouped by topic, not in order of importance. Please note that these actions should be completed as soon as practically possible and certainly within the timeframe noted.

Recommendations in this report are prioritized as follows:

Immediate: These recommendations address safety and compliance concerns that require immediate attention.

Medium term (within approx. 6-weeks): Recommendations of high importance but needing slightly more time to implement.

Longer term (within approx. 6-months): Important recommendations that require a longer period to fully implement or that enhance long-term safety and efficiency.

Table 3 Summary of issues by building:

Building	Potential Overstress	Structural system	Cracking	Loading	Other damage and defects	Structural documentation
Main Building	-	Connection Detail	-	-	Health and Safety – Lack of Edge Protection	Documentation Unavailable Differ from as-built structure Lack of Safe Load Plan
Electrical Room	-	-	-	-	-	Documentation Unavailable
Gate office	-	-	-	-	-	Documentation Unavailable

5. Remediation Support

5.1 Engineering Support

Some items in the Corrective Action Plan (CAP) will require remediation by a qualified engineer. Please refer to the Remediation Plan for guidance on which tasks can be completed using internal resources and which require engineering support. F-202604-064819

Timeline	Remediation Plan
Medium Term CAP-0076842	Factories should begin remediation of CAP items such as surface cracks or non-structural repairs using internal resources, where available. For remediation based on engineering assessments, detailed engineering assessments, or structural strengthening, engagement of a qualified Structural Engineer is required.

6. Structural System

6.1 Connection details

This issue refers to the steel shed at the third floor of the Main Building, where the cross bracing provided for lateral load resistance was observed to be loose, which may compromise the structural stability of the shed. F-202604-064820

Timeline	Remediation Plan
Medium Term CAP-0076857	The cross bracing shall be properly tightened in accordance with the specifications provided in the structural drawings.



Figure 2.1 - Location of Steel Shed on the Third Floor Plan of Main Building



Figure 2.2 - Loose Cross Bracing of Steel Shed on the Third Floor of Main Building

7. Other Damage/Defects

7.1 Health and Safety

This issue relates to the absence of edge protection on the projection at the first and second floor of the Main Building. This condition presents a potential risk of slip, trip, or fall during service and maintenance, posing a Health & Safety concern. F-202604-064824

Timeline	Remediation Plan
Immediate CAP-0076861	Provide adequate edge protection on the projection, and on any other part of the factory with the same issue.



Figure 2.3 - Location of Missing Edge Protection at the Projection of First and Second Floor of Main Building



Figure 2.4 - Missing Edge Protection on the First and Second Floor Projection of Main Building

8. Structural Documentation

8.1 Documentation unavailable

The approved site layout plan was not available. The first-floor framing plan and relevant details were not available, and no structural details for the lift and stairs were provided in the drawings. F-202604-064821

Timeline	Remediation Plan
Longer Term CAP-0076847	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as built documentation.

8.2 Differs from as-built structure

The lift was not shown in the architectural layout plan of the second floor of the Main Building; however, it was observed to be constructed on site. F-202604-064822

Timeline	Remediation Plan
Longer Term CAP-0076863	Building Structural Engineer to carry out on-site survey, collect information and produce accurate and complete as built documentation.



Figure 2.5 - Lift Location Not Indicated on the Second Floor Plan of the Main Building



Figure 2.6 - Lift Opening at the Second Floor of Main Building

8.3 Lack of safe load plans

No safe load plans posted in the main building. F-202604-064823

Timeline	Remediation Plan
Longer Term CAP-0076844	Building structural engineer to review design documentation to confirm load capacity of the structure.
Longer Term CAP-0076845	Develop safe load plans and submit to Pakistan Accord for review.
Longer Term CAP-0076846	Factory to post safe load plans on each floor.

9. Assessment Limitations and Assumptions

The information in this report was obtained during an inspection of the facility and based on information provided by factory management. It has not been possible to provide independent verification for all the information and data collected, and therefore, the Accord cannot accept general responsibility for omissions or errors arising from inaccuracies in this report from the information obtained.

The findings and recommendations in this report are not intended to imply, guarantee, ensure or warrant compliance with any government regulations. Additionally, the results do not imply in any way that compliance with the findings or recommendations as stated in this report will eliminate all hazards, risks or exposures or that hazards, risks or exposures not referred to in this report do not exist. Compliance with the findings and recommendations stated in this report does not relieve the factory owner from obligation to comply with specific project requirements, industry standards, or the provisions of any local government regulations.

Except as otherwise noted within this report, other systems or services were not viewed or tested during the assessment and are therefore similarly excluded from this report. We have not assessed any parts of the structure / building fabric / services which are covered, unexposed or inaccessible and we are therefore unable to report that any such part of the property is free from defect.

The observations in this report are based on the engineering judgement of the engineer at the time of the inspection.