

OMDB/DXB
DUBAI INTL

 **JEPPESEN**
15 MAY 20 **10-3** **Eff 21 May**

DUBAI, UAE
DEPARTURE

SID INSTRUCTIONS

Unless explicitly cancelled or amended by ATC, the pilot must follow the vertical and lateral profile of the SID and comply with any published speed restrictions.

A level restriction depicted on a SID chart does not authorise a pilot to climb to meet that restriction. ATC will issue climb clearance to permit compliance with vertical navigation restrictions. Pilots must inform ATC if a level restriction cannot be met. Do not climb above ATC cleared level.

When conducting a SID, the priority is to meet the vertical navigation restrictions of the SID. When speed restrictions do not enable the aircraft to meet a SID level restriction, the pilot must advise ATC of any speed deviation requirement prior to departure or as soon as the situation is identified. Pilots must advise ATC when able to resume the SID speed restrictions.

Operators or pilots should establish procedures to ensure compliance with the SID. The application of a performance margin on the published climb requirements is at the operator's/pilot's discretion taking into account the achievable climb performance of the aircraft and the means of monitoring the gradient achieved.


Flight crews are expected to strictly adhere to SID speed restrictions unless otherwise approved or instructed by ATC.


Pilots must advise ATC if a speed adjustment is considered excessive or contrary to ACFT operating specifications.

OMDB/DXB
DUBAI INTL

JEPPESSEN
30 MAY 25 10-3A Eff 12 Jun

DUBAI, UAE
RNAV SID

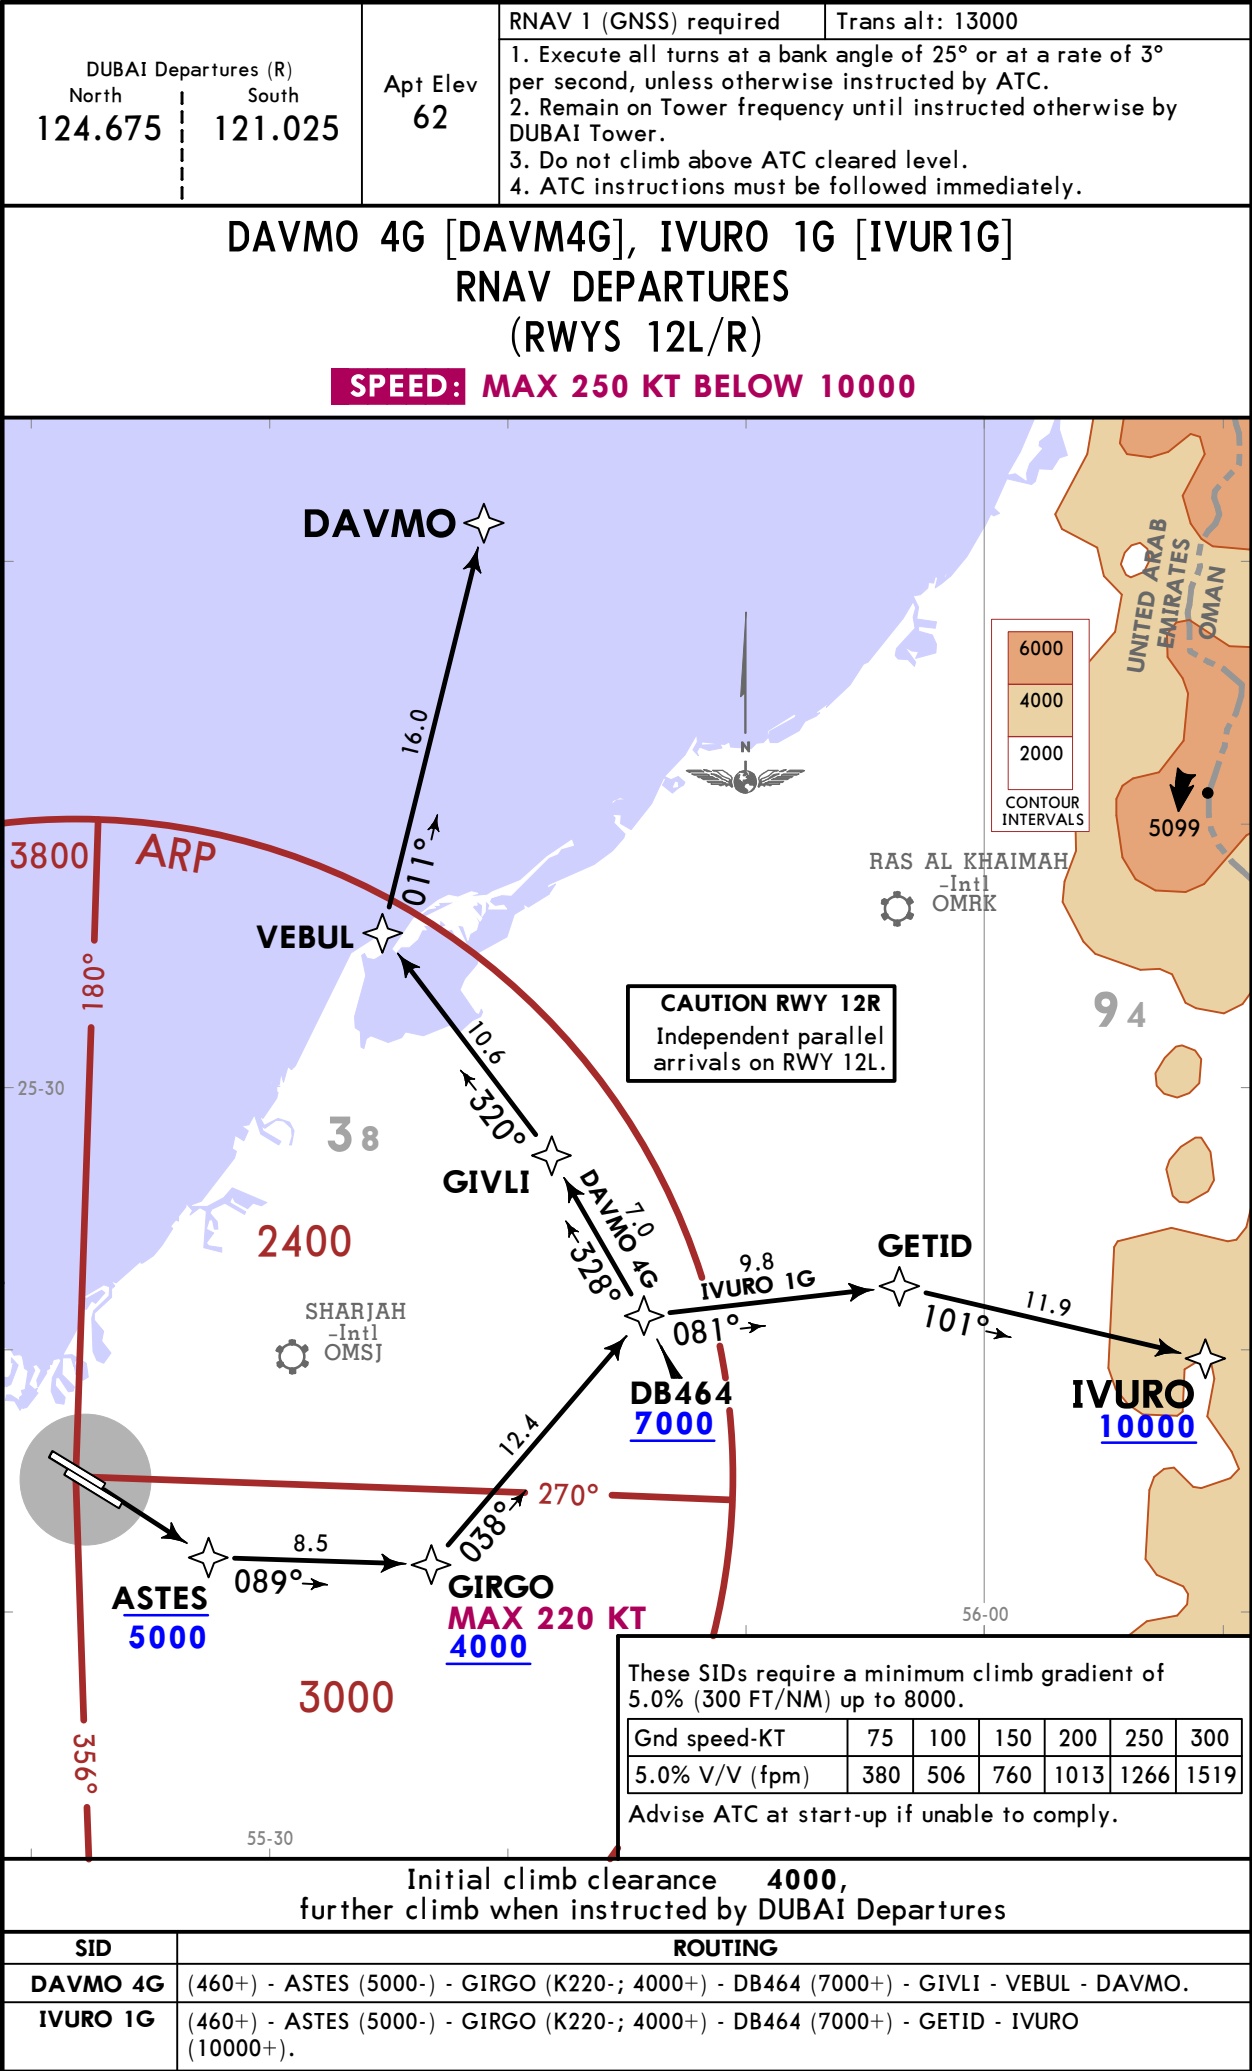




OMDB/DXB
DUBAI INTL

JEPPESSEN
30 MAY 25 10-3C Eff 12 Jun


DUBAI, UAE
RNAV SID

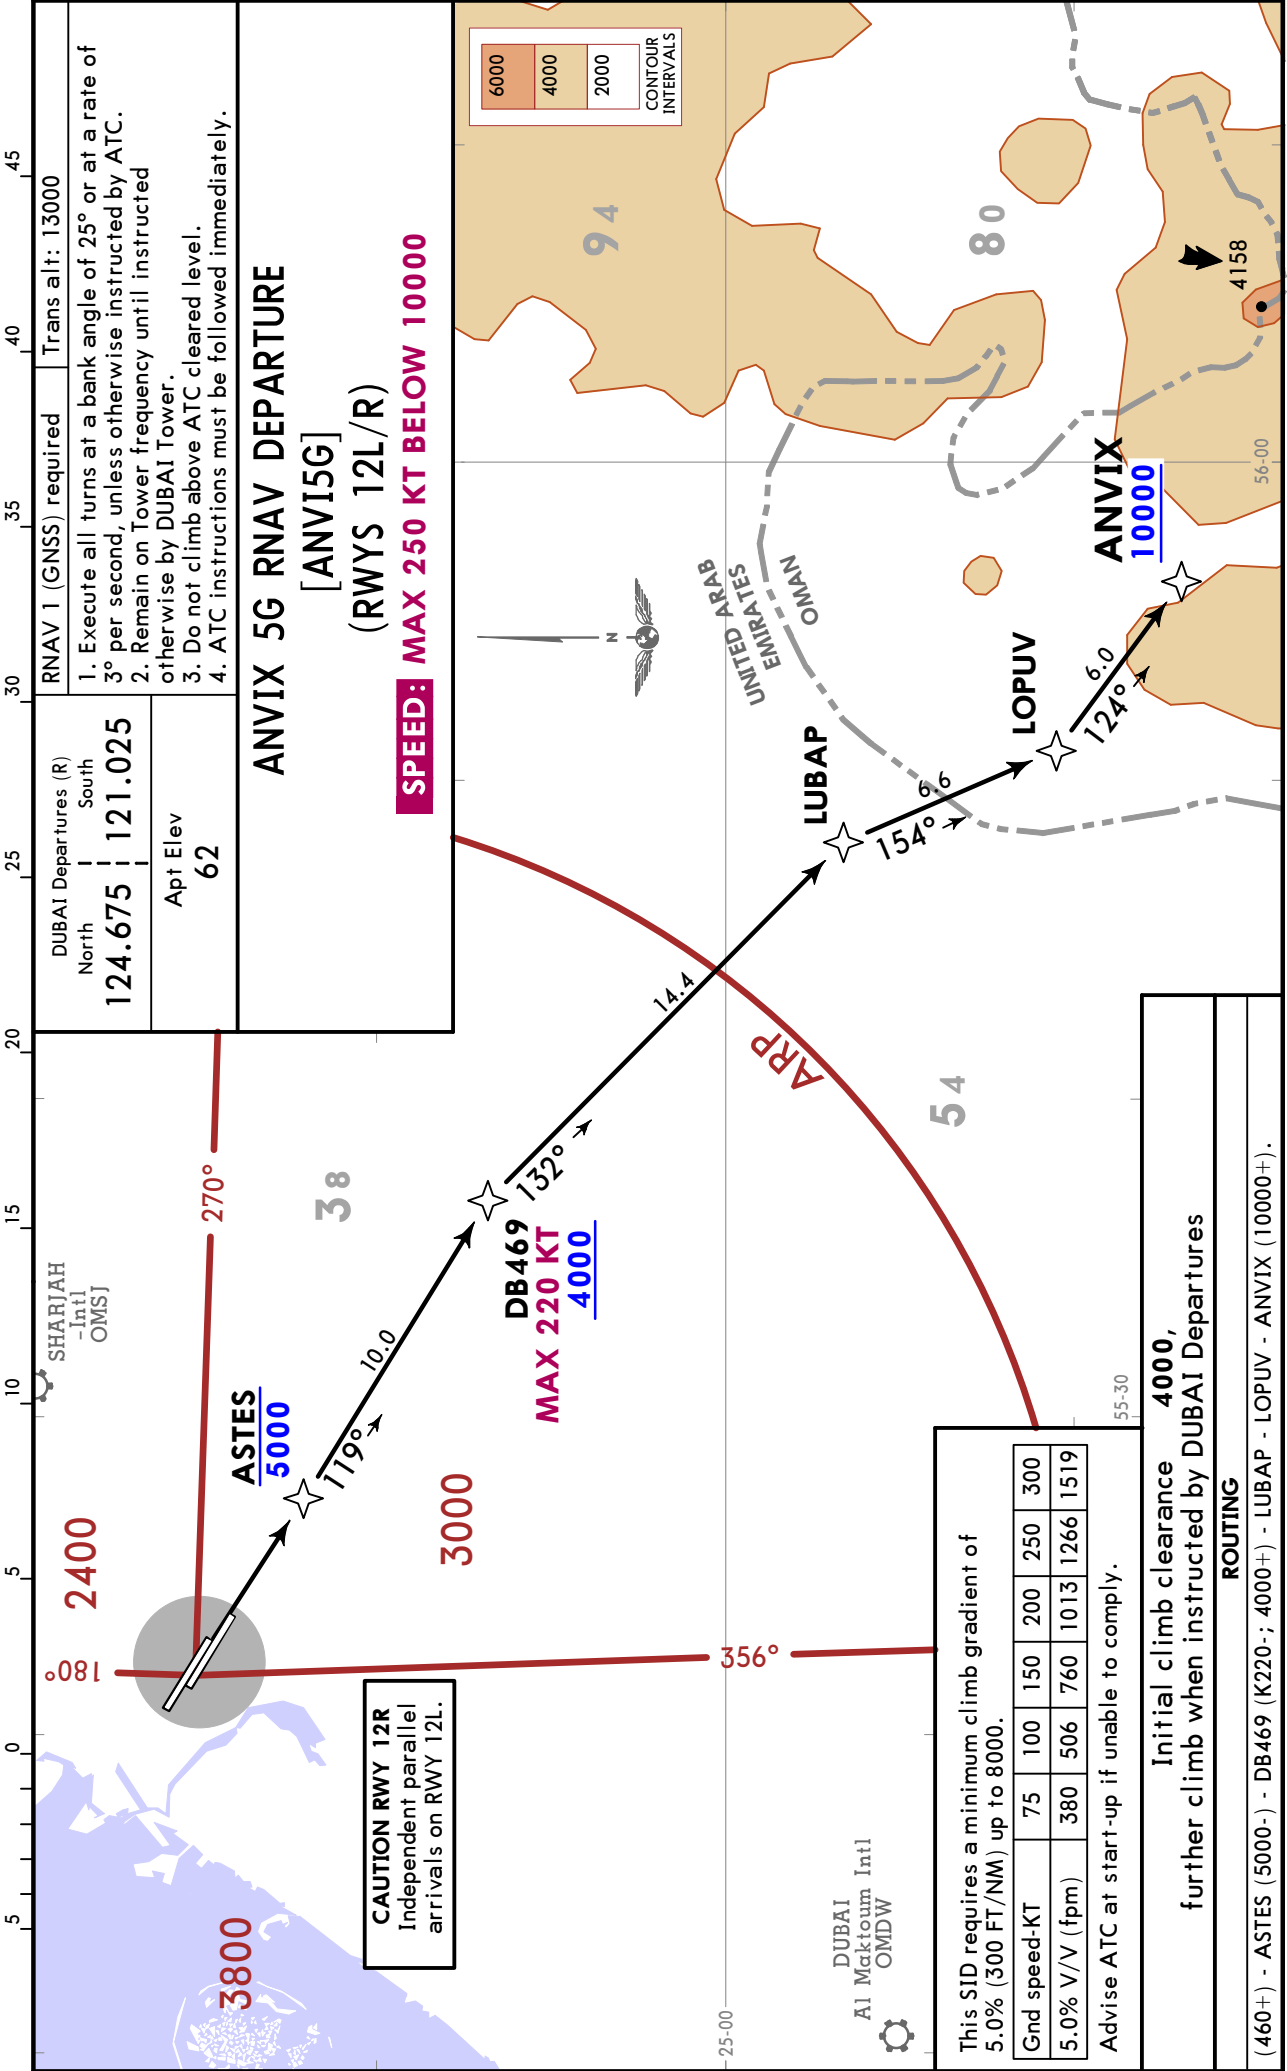



OMDB/DXB
DUBAI INTL


JEPPESSEN
30 MAY 25 10-3D Eff 12 Jun

DUBAI, UAE
RNAV SID

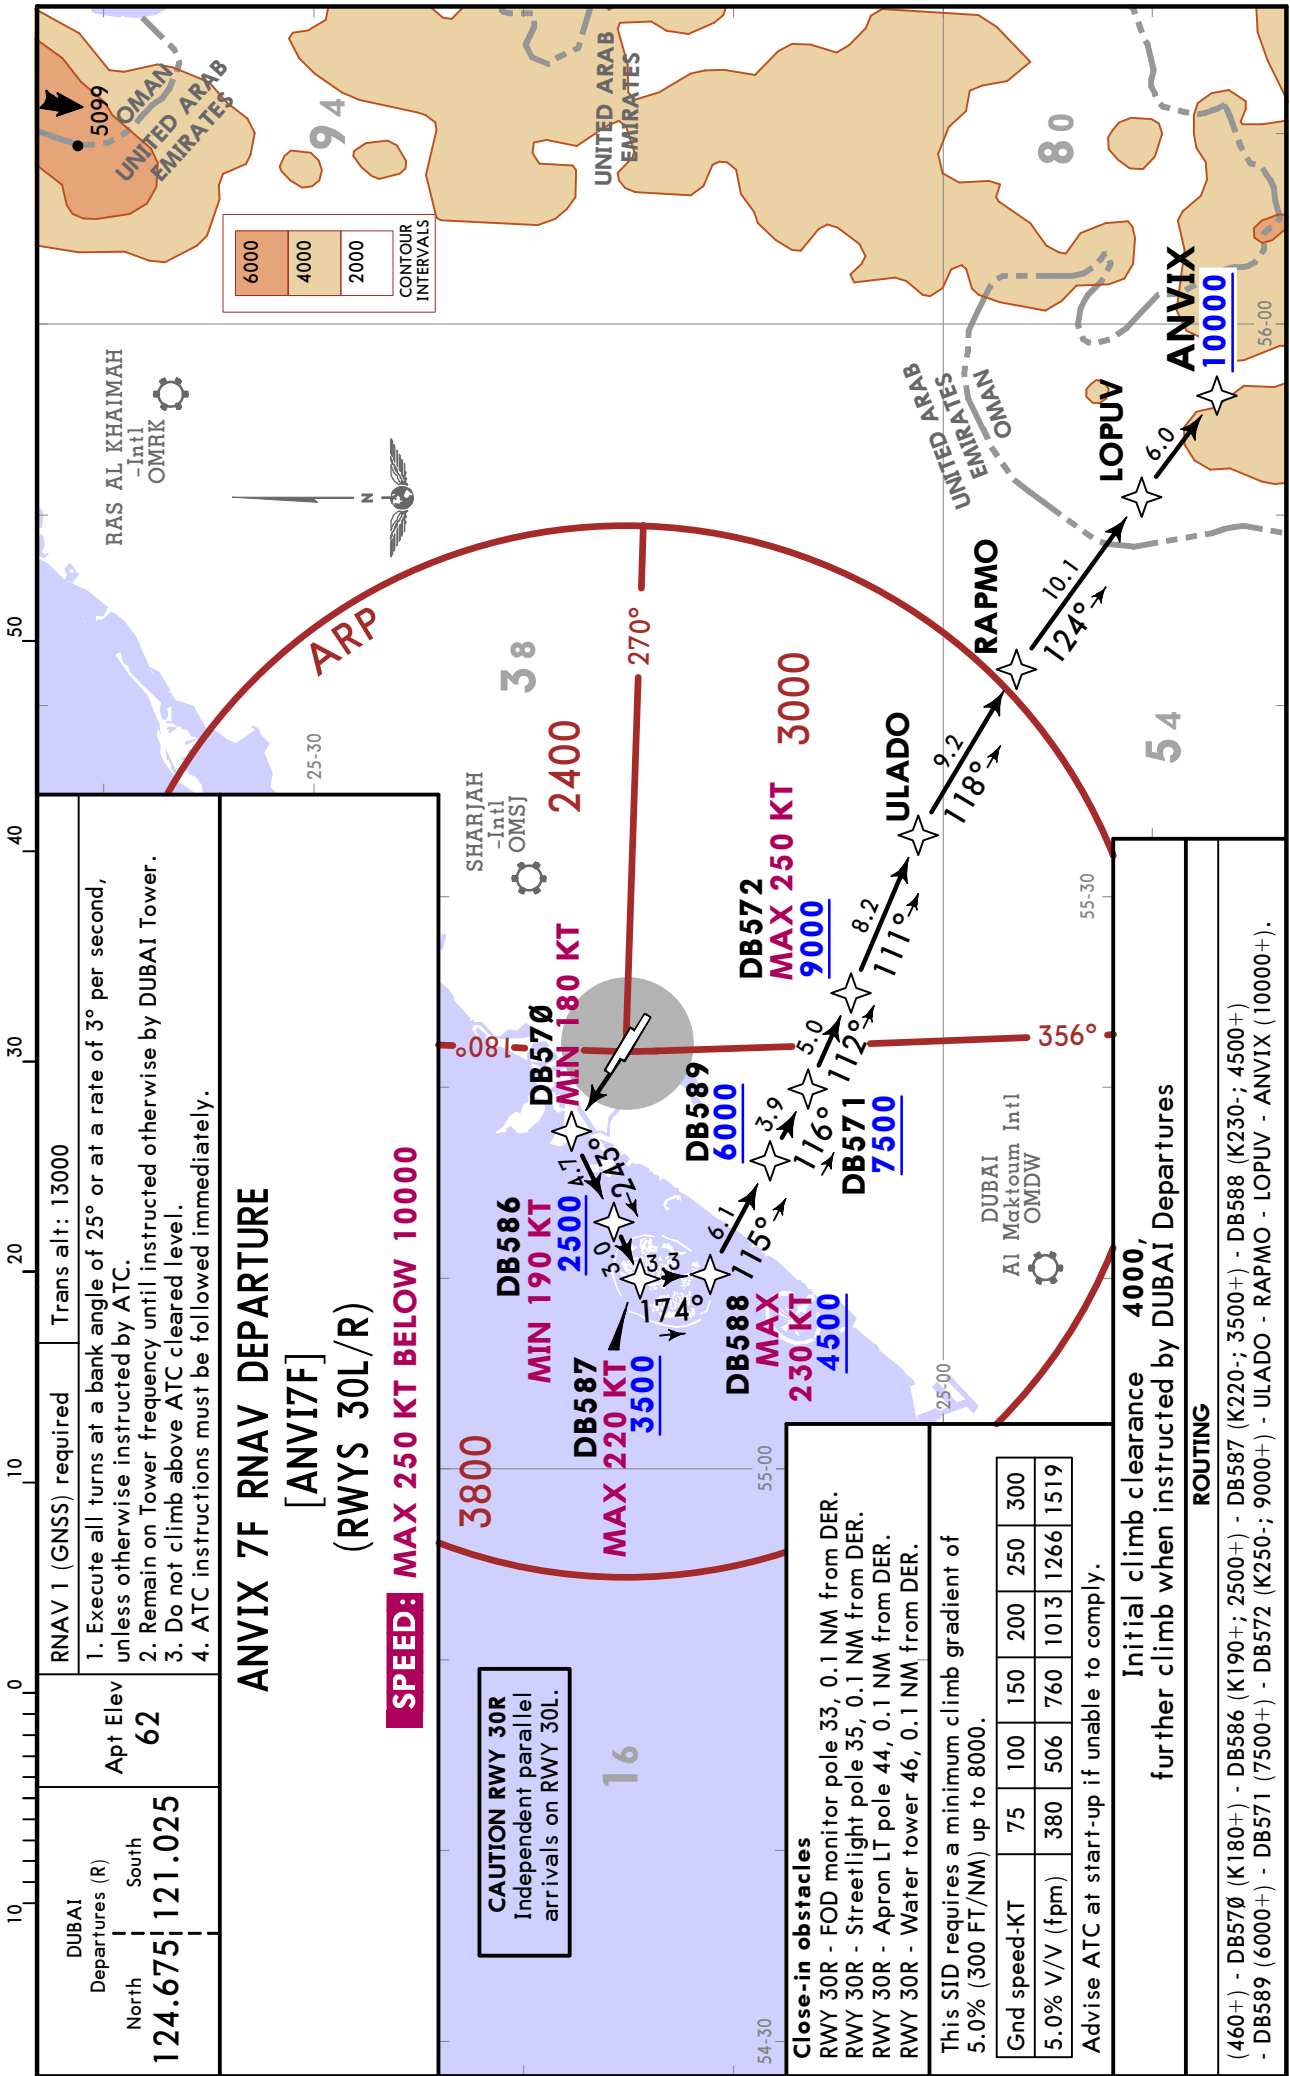

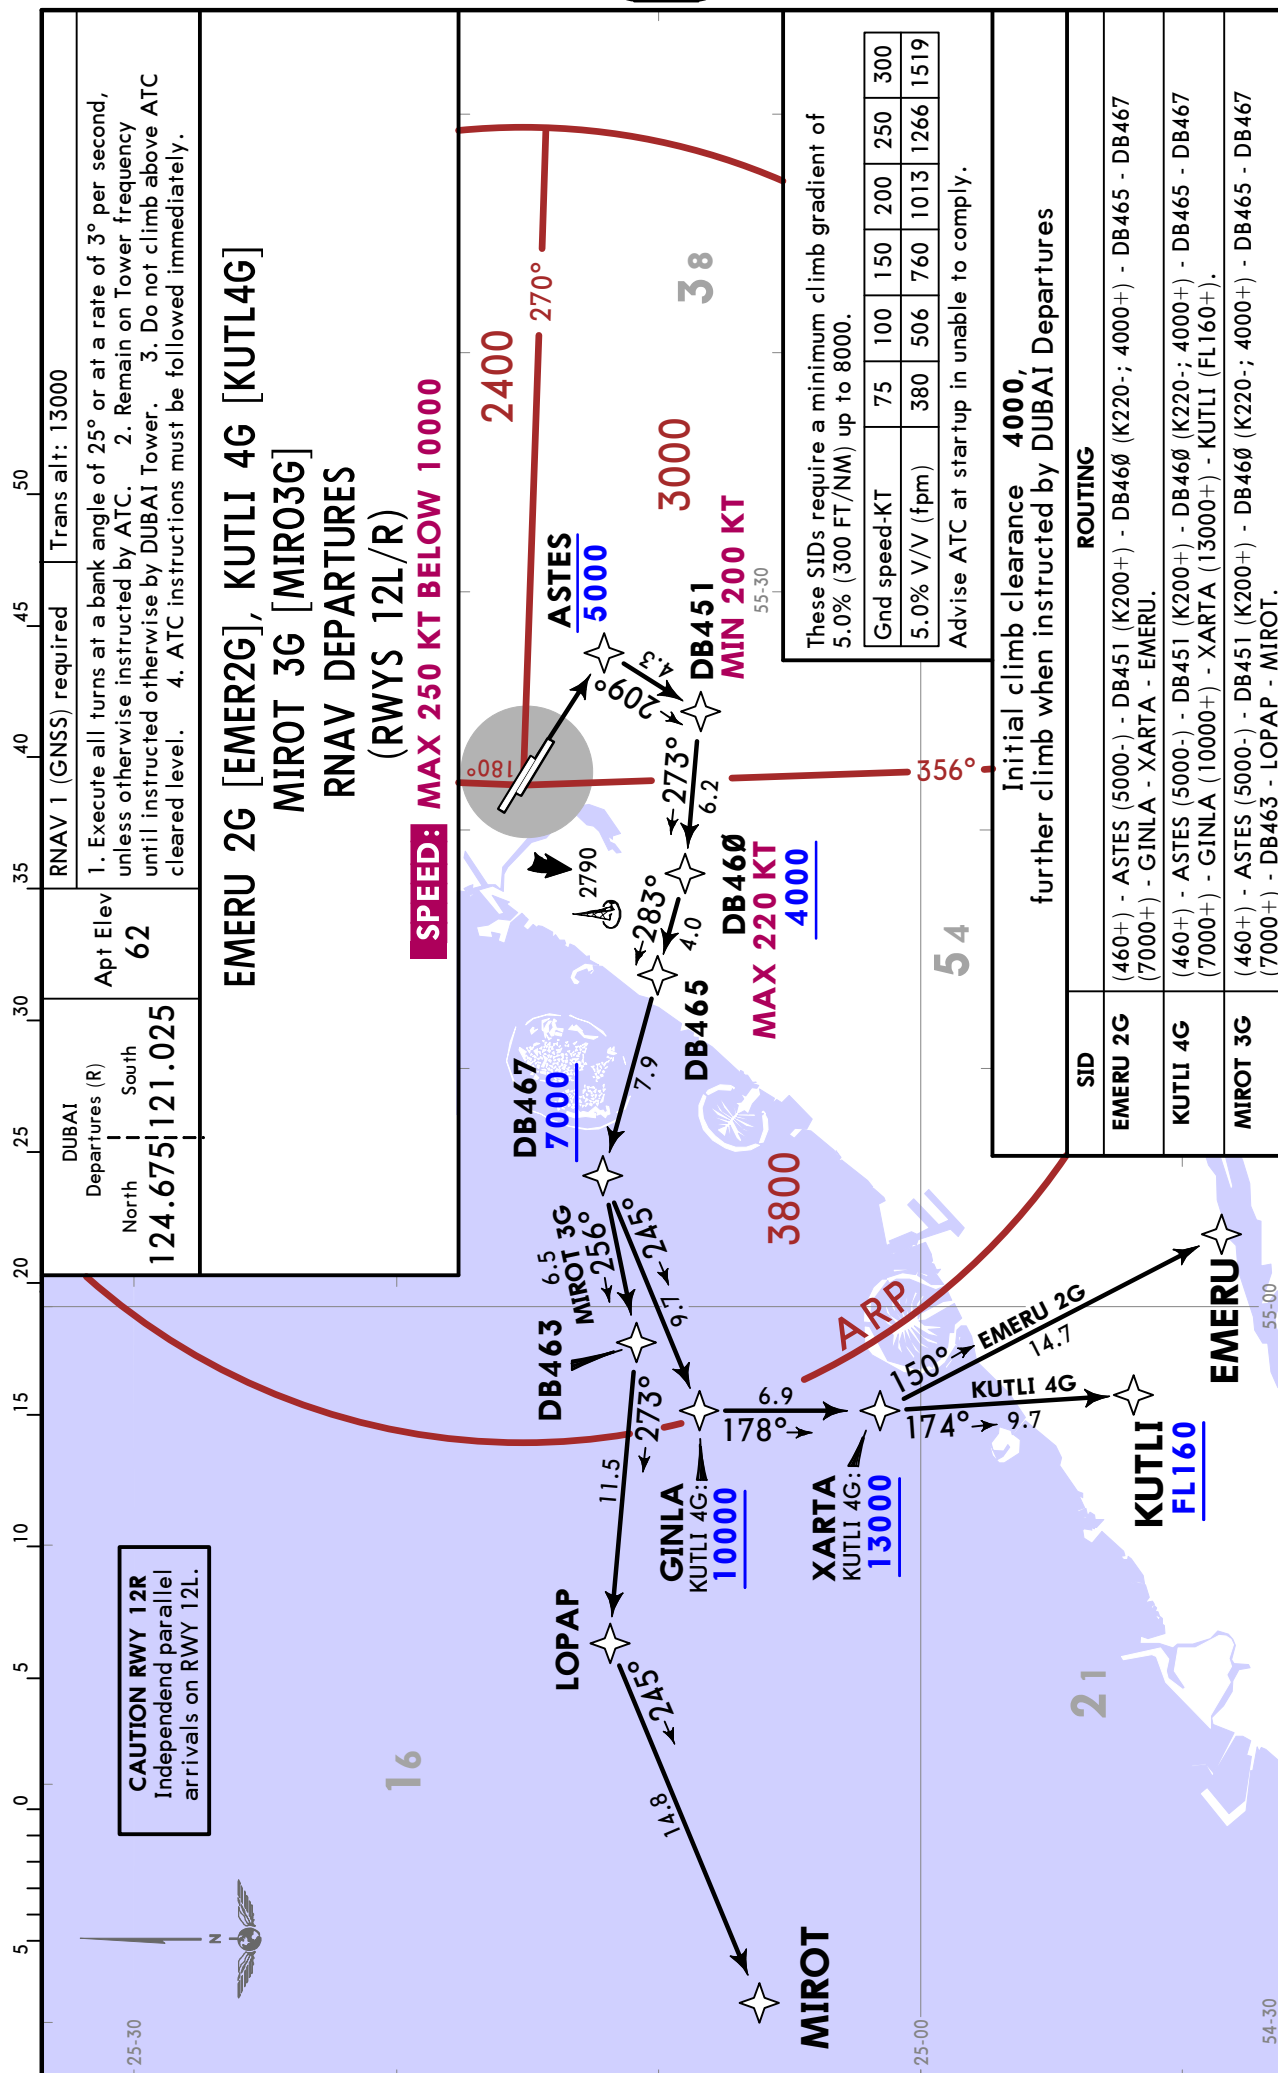

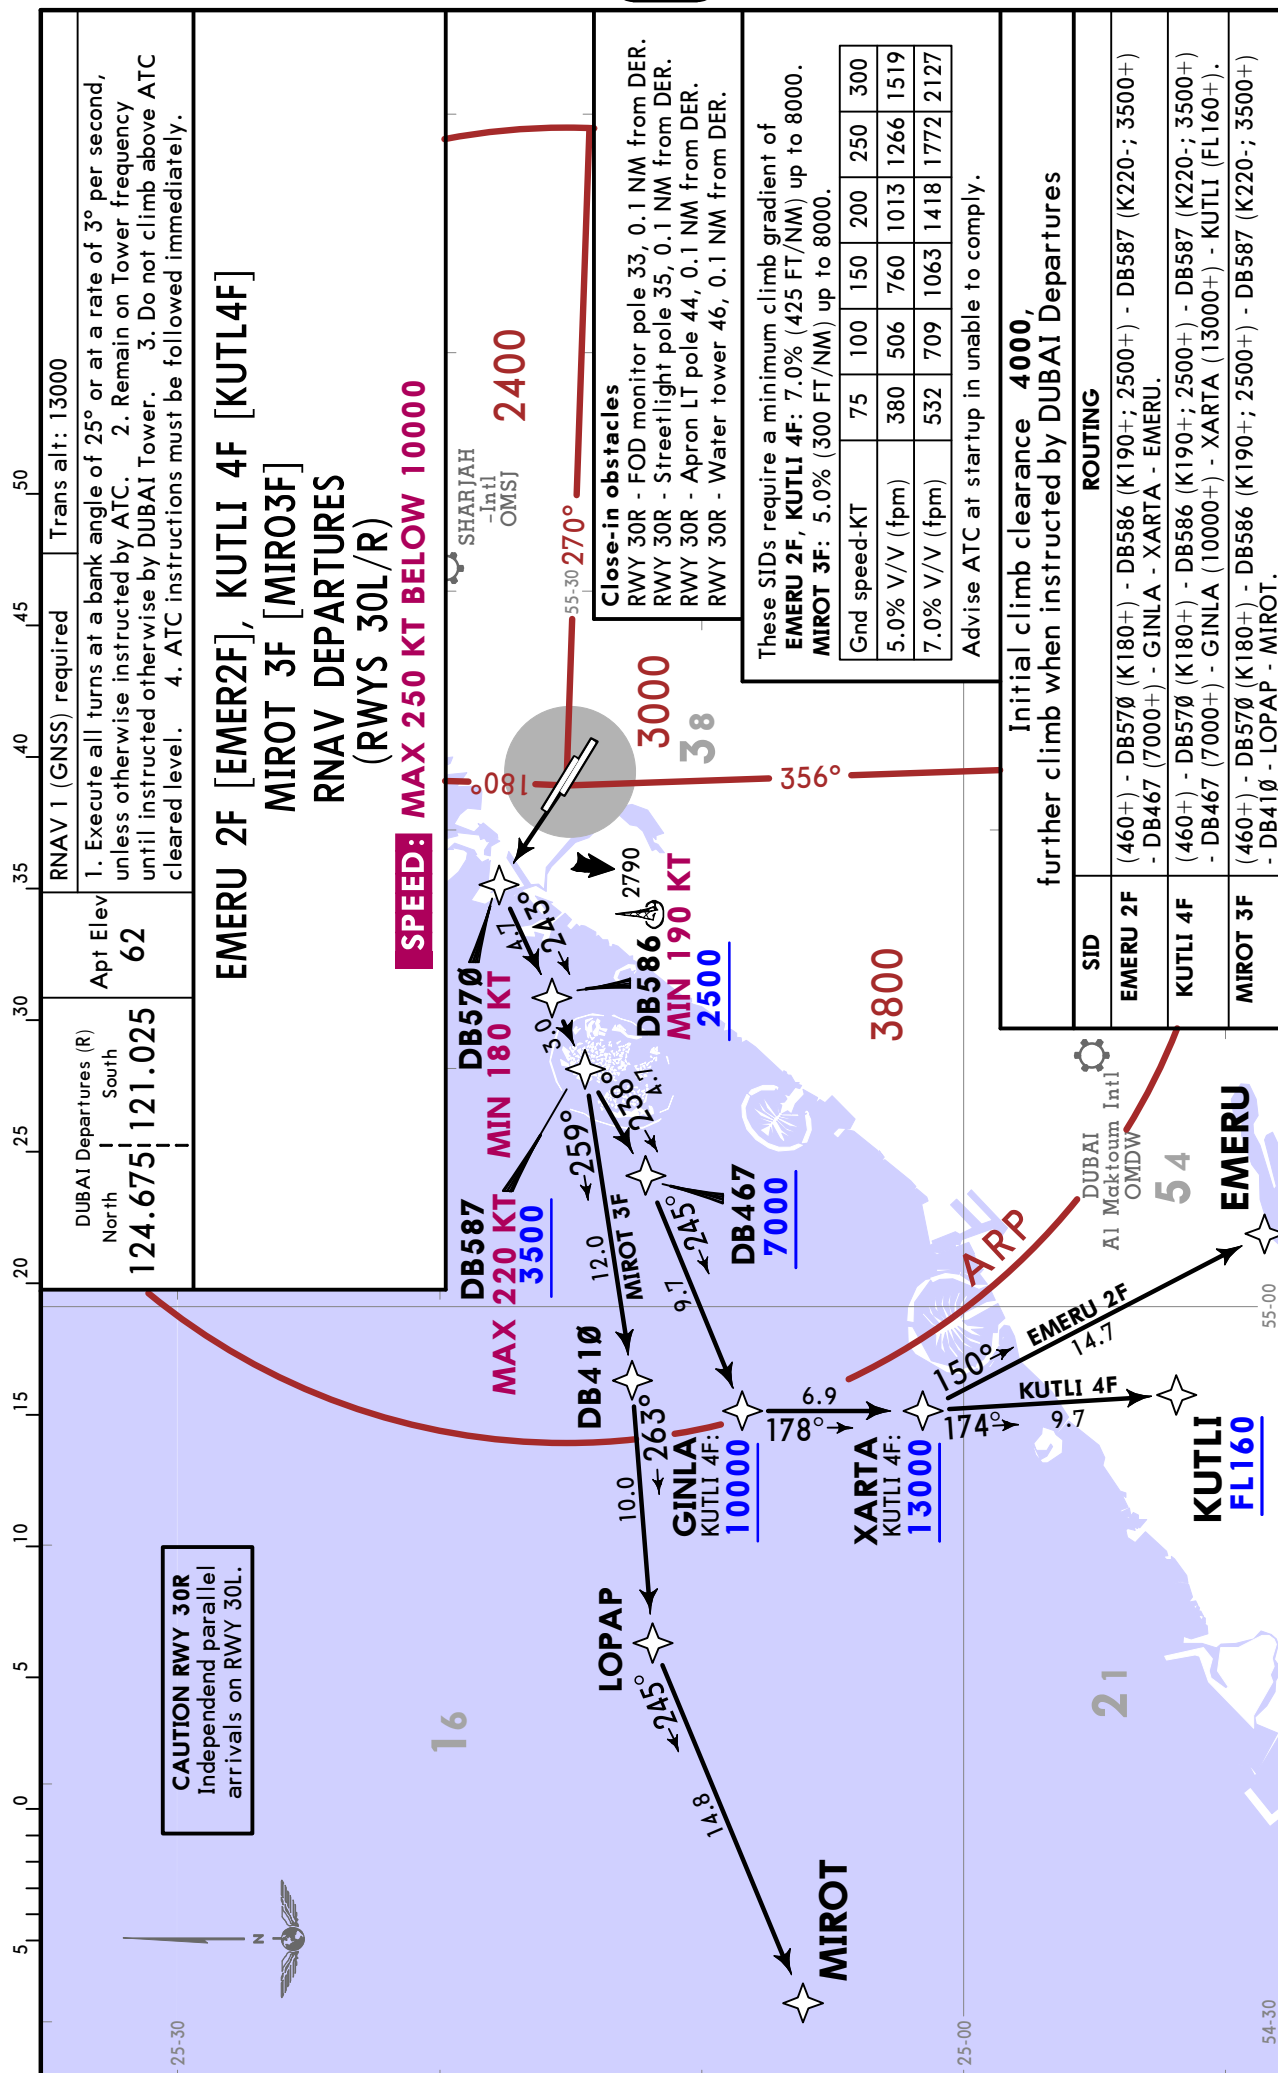


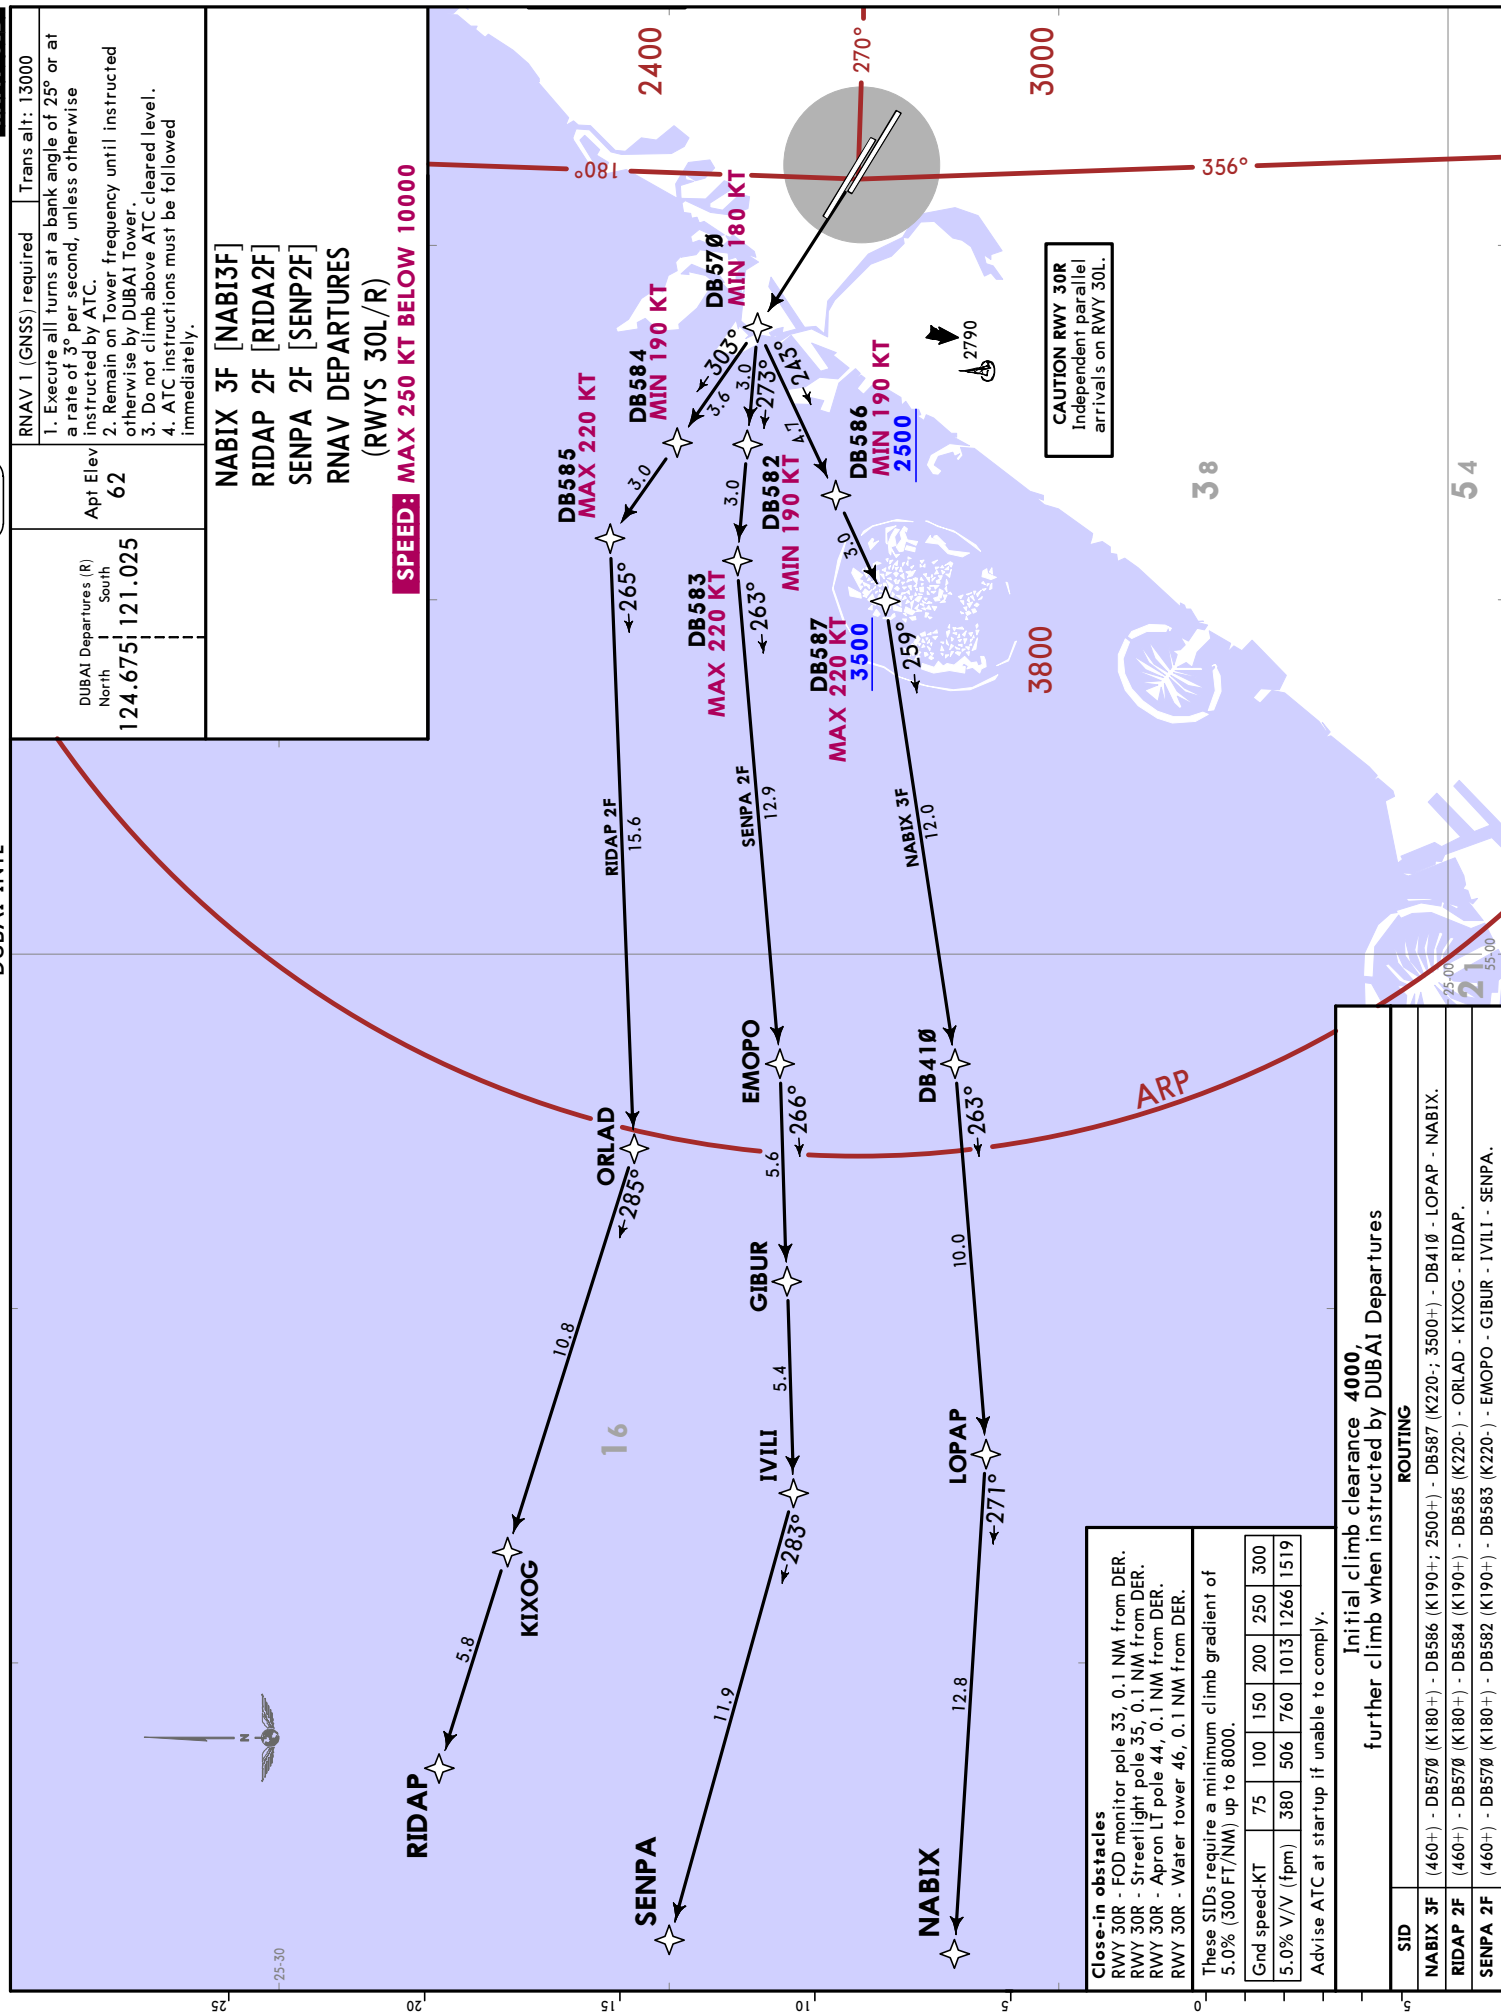

OMDB/DXB
DUBAI INTL

JEPPESSEN
12 APR 24 10-3J Eff 18 Apr

DUBAI, UAE
DEPARTURE

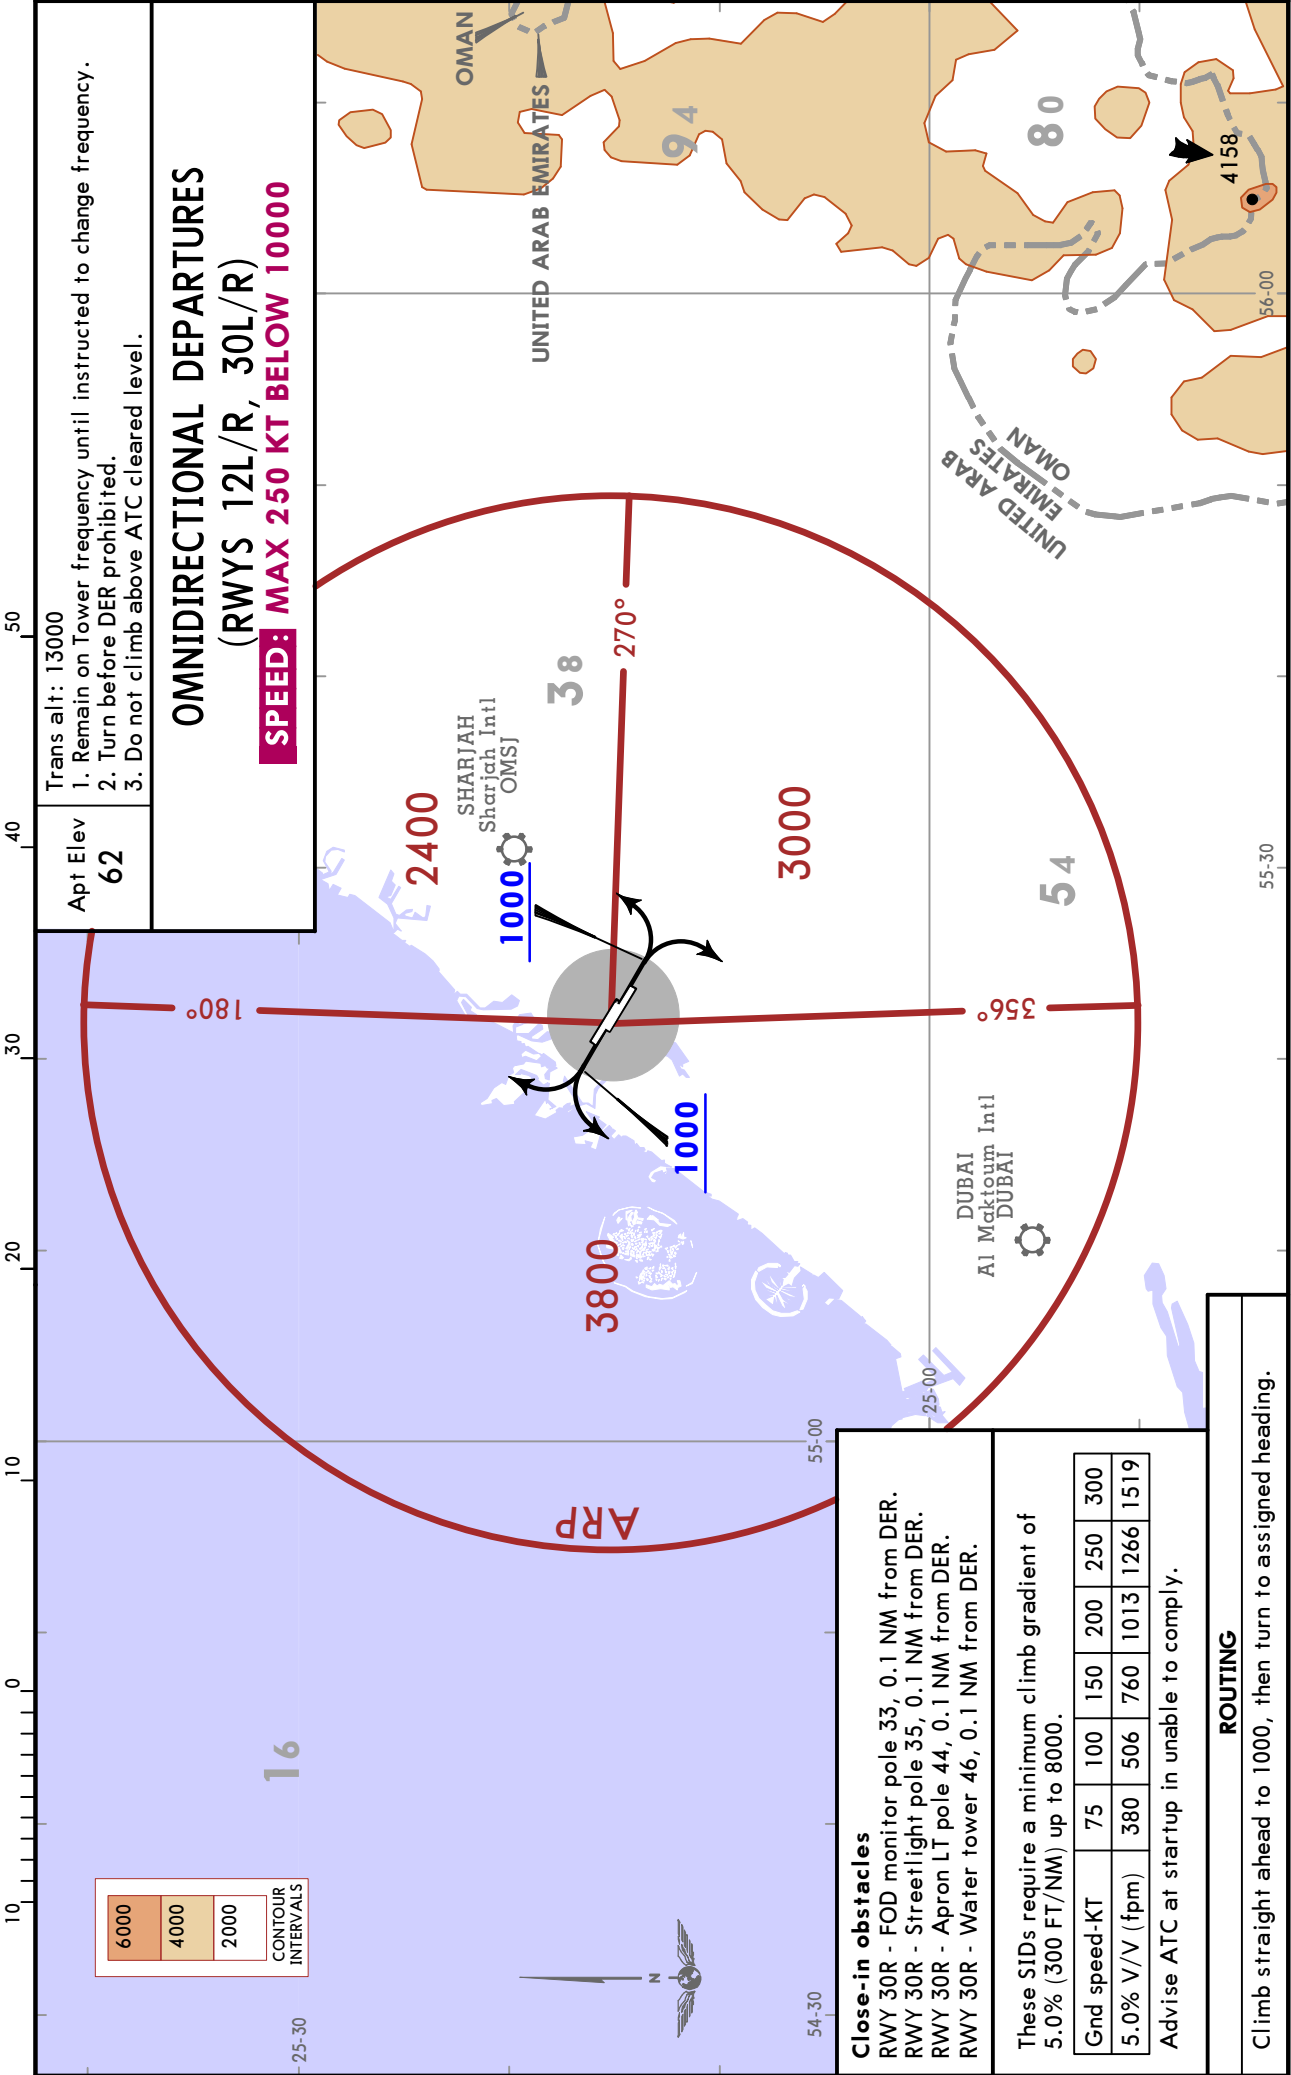

OMDB/DXB

 **JEPPESSEN**
16 MAY 25 (10-8)

DUBAI, UAE
DUBAI INTL

TEMPORARY CLOSURE OF TAXIWAYS (SUP 16/25)

REFER ALSO TO LATEST NOTAMS

Work is planned in various phases as indicated below.

Note: The work/closure phases listed below are not in any particular order.

AREA C02

Section of taxilane Z between taxiway Z5 and taxiway Y closed.

Sections of taxilane J1 and taxiway Y North of taxilane Z closed.

Taxiway Z5 closed.

Taxiway Y East link onto taxilane Z temporarily relocated to the East. Taxiway centreline installed with green reflectors instead of centreline lights. Temporary centreline will be available for unrestricted movements up to Code F in CAT I conditions. In CAT II/III conditions, movements may be allowed under "Follow-Me" guidance; to be confirmed via NOTAM and/or ATC.

AREA C03

Section of taxilane Y South of taxilane Z closed.

Taxiway Y1 closed.

Temporary crossover taxiway U1A implemented between IHP JA and stand B4. Taxiway centreline installed with green reflectors. No centreline lights are available. Temporary crossover will be available for unrestricted movements up to Code F in CAT I conditions. In CAT II/III conditions movements may be allowed under "Follow-Me" guidance; to be confirmed via NOTAM and/or ATC.

AREA C04

Section of taxilane J between taxiway U3 and taxiway U6 closed.

Taxiway U4 and taxiway U5 closed.

Section of taxilane U between stands B12 and B23 temporarily relocated marginally to the South to provide Code F clearance. There are no centreline lights. Instead, taxiway centreline will be installed with green reflectors with separation of 25'/7.5m.

Temporary Arrival Procedures / Restrictions:

Code F arrivals to stands B18R and B21R will be via relocated taxilane U.

Code E arrivals to stands abeam the relocated taxilane U will be via relocated taxilane U.

Temporary Pushback Procedures / Restrictions:

Code F departures from stands B18R and B21R will be via relocated taxilane U.

Code E departures from stands abeam the relocated taxilane U will be onto the relocated taxilane U.

In "Follow the Greens" (FTG):

a. For Code F: "Follow-Me" guidance will be provided for ACFT movement on the relocated taxilane U section:

- Between 1400 - 1700 UTC in CAT I.
- At all times in CAT II/III conditions.

Reporting points will be IHPs JB (Eastbound) and JF (Westbound).

b. For Code E and below: "Follow-Me" will be provided for ACFT movement on the relocated taxilane U section in CAT II/III conditions only; reporting points will be IHPs UB (Eastbound) and UF (Westbound).

Risk of inadvertent Code F (A380) movement on non-Code F section of taxilane U:

To mitigate the risk of Code F on the relocated taxilane U section continuing straight onto non-Code F taxilane U sections, below will be applied:

a. In CAT I conditions outside of FTG, ATC will provide sequential taxi clearance - initially until IHP UD and subsequently onto crossover taxiway U3 / taxiway U6.

b. Additional "Keep Left" ↖ A380 or "Keep Right" ↗ A380 guidance marking will be provided on relocated taxilane U just before the crossover taxiway U3 and taxiway U6 respectively to caution the pilots.

OMDB/DXB



DUBAI, UAE
DUBAI INTL

TEMPORARY CLOSURE OF TAXIWAYS (CONTD)
REFER ALSO TO LATEST NOTAMS

AREA J1

Section of taxilane J between stands C63 and B3 closed.
Temporary crossover taxiway U2A implemented between stands B1 and B3. Taxiway centerline installed with green reflectors. No centerline lights available. Temporary crossover will be available for unrestricted movements up to Code F in CAT I conditions. In CAT II/III conditions movements may be allowed under "Follow-Me" guidance; to be informed via NOTAM and/or ATC.
Code F movement permitted on section of taxilane U between temporary crossover taxiway U2A and taxiway Y1.
Aircraft turning/moving on taxiway Y1:

- Must use minimum power to prevent jet blast onto the stands behind.
- Must continue movement under constant power setting without coming to a full stop.
- If the aircraft has to stop for any reason on taxiway Y1, report to ATC for Airside assistance to assess jet blast impact before re-commencing movement.

If Code F aircraft inadvertently enters the Code E section of taxilane Y North of taxiway Y1, aircraft must hold position and report ATC for Airside/ Follow-Me assistance to continue taxi.