

RKSI/ICN
INCHEON INTL

 **JEPPESEN**
20 JAN 23

20-2

Eff 25 Jan 1600Z

STAR

SEOUL/INCHEON, KOREA

RADIO COMMUNICATION FAILURE PROCEDURE

In VMCs:

- 1) Squawk 7600.
- 2) Continue to fly in VMC.
- 3) Land at nearest suitable aerodrome.

Procedure for VFR flights

VFR flight which has encountered radio communication failure shall:

- 1) Squawk 7600, and
- 2) If able to see the light gun signal from control tower, follow that instruction.
- 3) If unable to see the light gun signal from control tower, hold over downwind for RWY 16R/34L, 15L/33R until ETA or for 10 minutes, whichever is longer; then
- 4) Land on RWY 16R/34L, 15L/33R or H in use as appropriate.

In IMCs or when conditions are such that it does not appear likely that the pilot will complete the flight in accordance with the paragraph above:

ARRIVAL AIRCRAFT

- 1) Squawk 7600.
- 2) Follow the STAR issued by ATC. When being vectored or having been directed by ATC, proceed in the most direct manner possible to join the STAR (see 20-1P for Assignment of STAR) no later than the next significant point. Then commence descent as filed.
- 3) Start approach to the assigned runway without delay.
- 4) If no specific runway for landing has been assigned, start approach to runway 15L/33R without delay. If runway 15L/33R is closed, start approach to runway 15R/33L or runway 16R/34L.

No fly area:


Aircraft shall not fly NORTH of YJU R-271, except for simultaneous approaches to RWYs 15L/R.

AIRSPACE RESTRICTIONS

WARNING RK(P)-73


If an aircraft is seen flying through RK(P)-73 without proper clearance, a tracer warning shot will be fired. If the aircraft continues into RK(P)-73 it will be shot down without further warning. An exception to this will be civilian aircraft which has been identified as friendly.

RNAV STAR





D-ATIS 128.4 128.2	Apt Elev 23	Alt set: hPa Trans level: FL140	RNAV 1 operation GNSS or DME/DME/IRU required	1. ATIS surveillance service required. 2. For runways 15L/R, 16L/R pilots are required to set the appropriate speed to avoid unintentional deviations (ex. Route Discontinuity on Flight Management System (FMS)), especially under strong wind conditions aloft. And the pilot shall report to the controller immediately when the aircraft deviate from the route.
OLMEN 2H (OLMEN 2H) [OLME2H] REBIT 2H (REBIT 2H) [REBI2H] RNAV ARRIVALS (RWYS 15L/R, 16L/R)				SPEED RESTRICTION From POMIM to DH017: All turns should be flown at 210 KT. If unable to comply with flight restriction, advise ATC.

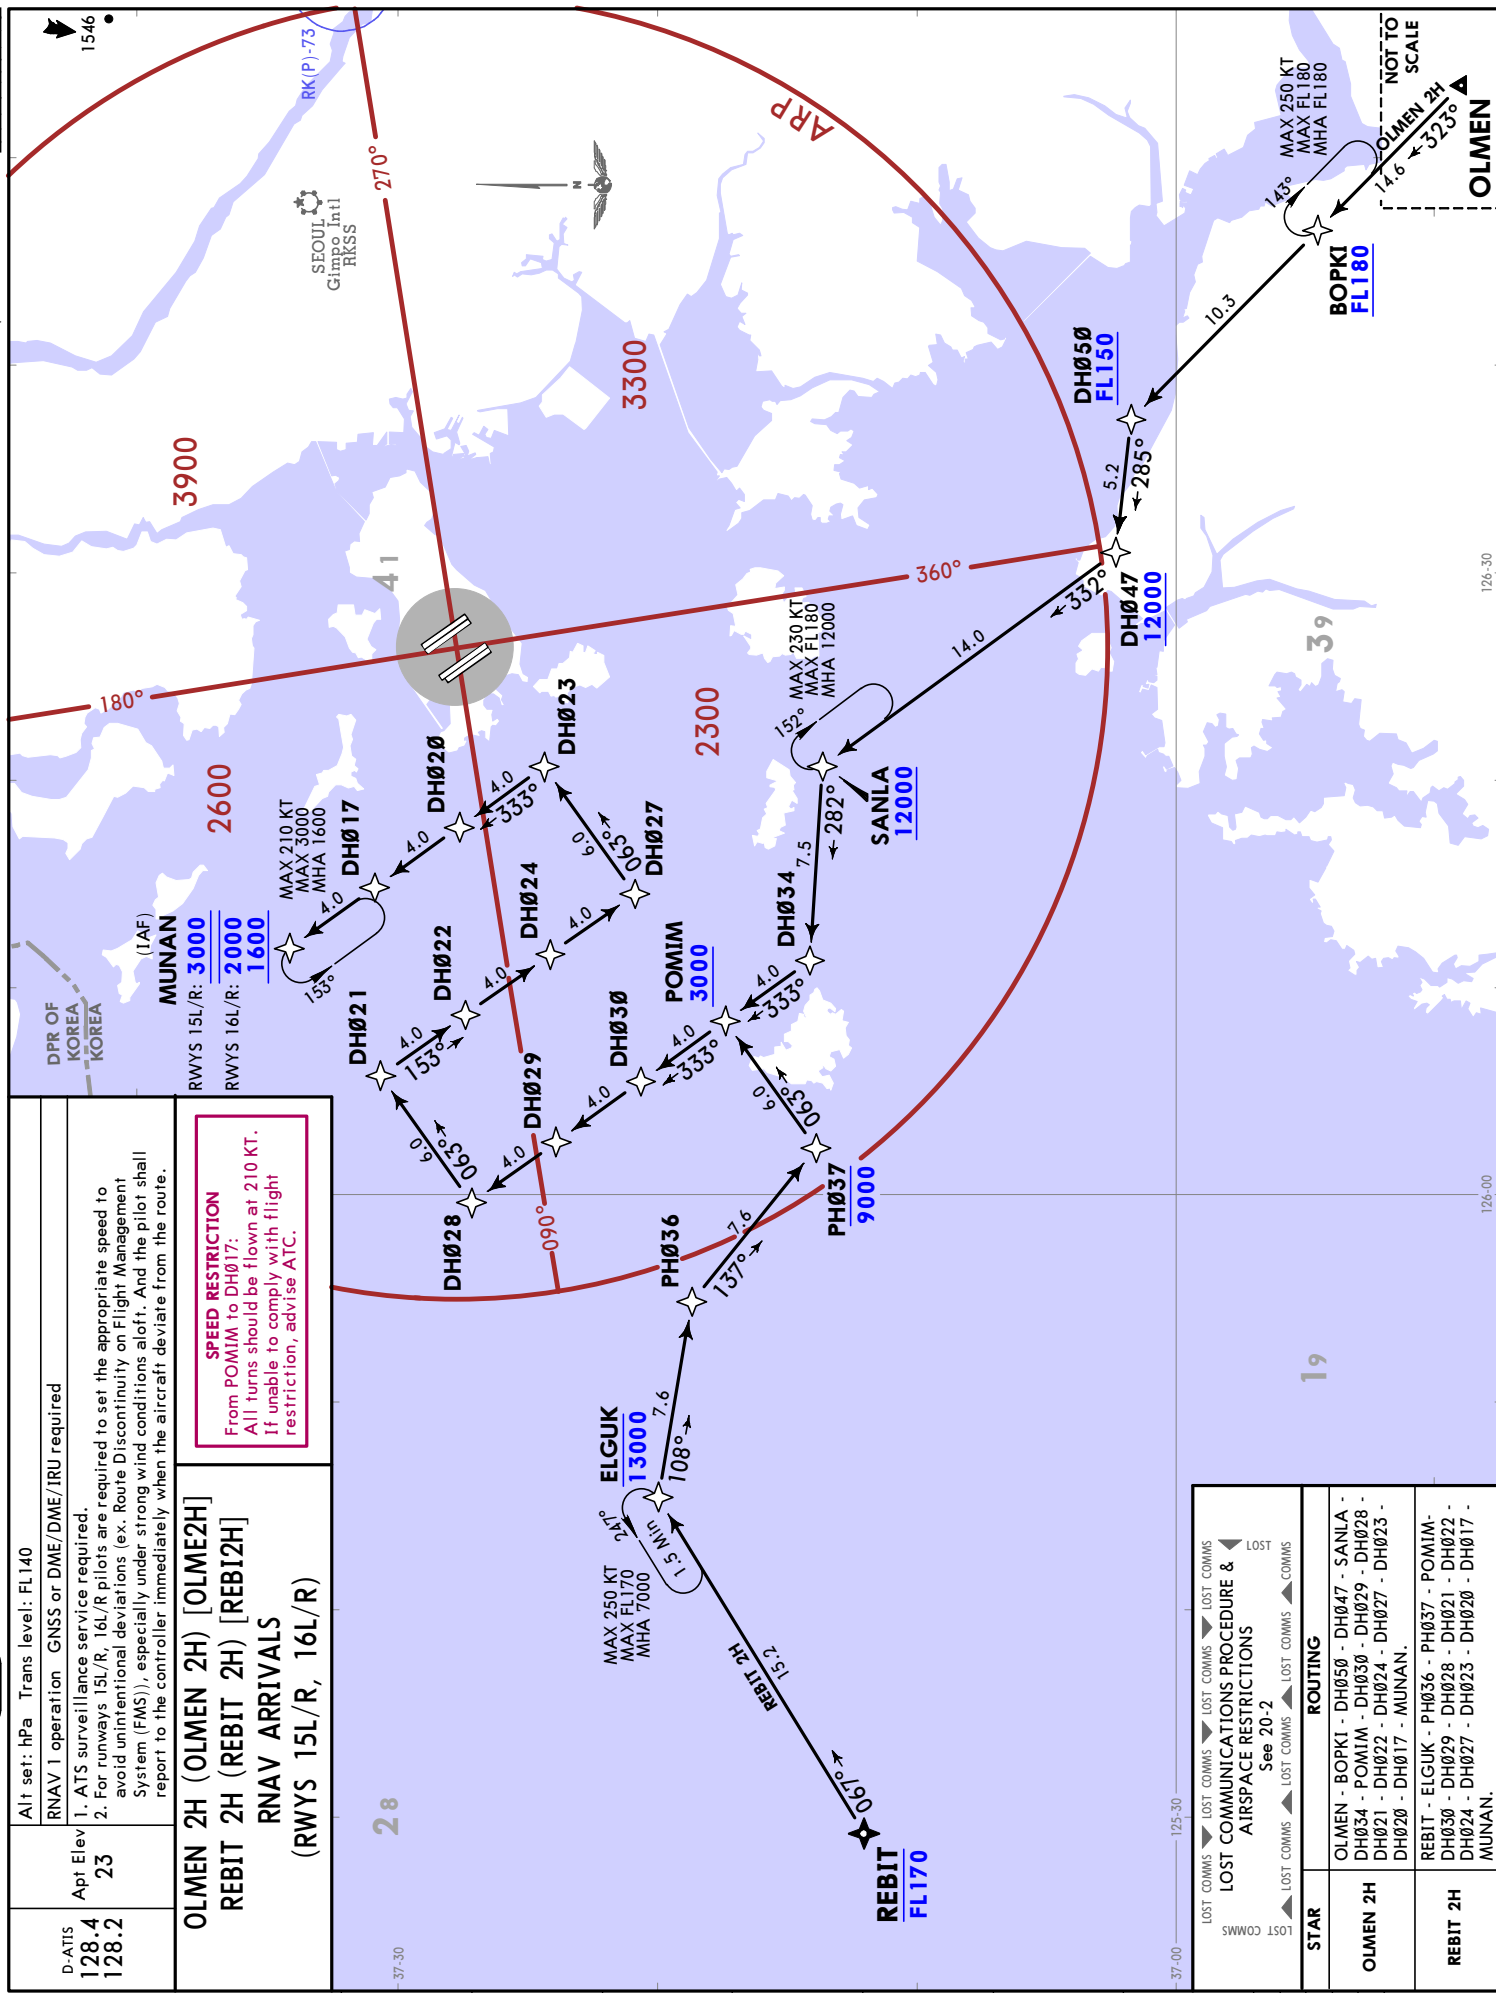[illegible]

CHANGES: OLWEN and REBIT change to reporting point.
© JEPPESEN, 2021, 2024. ALL RIGHTS RESERVED.

