Formula B
15:50
Kelly / Harwood

CRS
CharlesRussell
Speechlys

DATED 29 June 2021

(1) **THE GOVERNOR AND COMPANY OF THE BANK OF ENGLAND**

(2) **THE ALL ENGLAND LAWN TENNIS GROUND plc**

(3) **THE ALL ENGLAND LAWN TENNIS CLUB (CHAMPIONSHIPS) LIMITED**

AGREEMENT FOR LEASE

relating to

THE SPORTS CENTRE AND SPORTS GROUNDS, BANK LANE, OFF PRIORY LANE, ROEHAMPTON SW15

---

5 Fleet Place London EC4M 7RD
Tel: +44 (0)20 7203 5000 • Fax: +44 (0)20 7203 0200 • DX: 19 London/Chancery Lane
www.charlesrussellspeechlys.com

CONTENTS

1	INTERPRETATION	1
2	AGREEMENT FOR LEASE	3
3	EXCLUSION OF SECURITY OF TENURE	4
4	CONDITIONS	4
5	CONDITION OF THE PROPERTY	5
6	VACANT POSSESSION	5
7	DEDUCING TITLE	5
8	TITLE GUARANTEE	5
9	MATTERS AFFECTING THE PROPERTY	6
10	VAT	7
11	COMPLETION	7
12	EQUIPMENT	7
13	AELTC CONTRACT	8
14	ENTIRE AGREEMENT	8
15	JOINT AND SEVERAL LIABILITY	9
16	NOTICES	9
17	CONTAINERS	10
18	THIRD PARTY RIGHTS	10
19	GOVERNING LAW	10
20	JURISDICTION	10
APPENDIX 1 AGREED FORM OF LEASE		13
APPENDIX 2 EQUIPMENT SCHEDULE		14
	Part 1 Grounds Equipment	14
	Part 2 Gym Equipment	15

THIS AGREEMENT is made the 29 day of June 2021

PARTIES:

(1) **THE GOVERNOR AND COMPANY OF THE BANK OF ENGLAND** of Threadneedle Street London EC2R 8AH (the **Landlord**);

(2) **THE ALL ENGLAND LAWN TENNIS GROUND plc**, a company incorporated and registered in England and Wales with company number 00168491, whose registered office is at Church Road, Wimbledon, London SW19 5AE (the **Tenant**); and

(3) **THE ALL ENGLAND LAWN TENNIS CLUB (CHAMPIONSHIPS) LIMITED**, a company incorporated and registered in England and Wales with company number 7546773, whose registered office is at Church Road, Wimbledon, London SW19 5AE (**AELTC**).

BACKGROUND:

(A) The Landlord owns the freehold of the Property and has agreed to grant the Tenant a lease of the Property on the terms contained in this Agreement.

(B) The Lease will contain an agreement between the Landlord and the Tenant that the provisions of sections 24-28 of the Landlord and Tenant Act 1954 will be excluded in relation to the tenancy to be created by the Lease.

(C) AELTC has the benefit of the AELTC Contract. The Landlord and the AELTC have agreed that on completion of the Lease the AELTC Contract will be terminated and AELTC is a party to this Agreement to give effect to such termination.

IT IS AGREED as follows:

1 **INTERPRETATION**

The following definitions and rules of interpretation apply in this Agreement.

1.1 Definitions:

AELTC Contract	an agreement dated 16 June 2005 and made between the Seller (1) and the All England Lawn Tennis and Croquet Club (2) (as novated to AELTC on 18 January 2012)
Completion Date	29 June 2021
Condition	any one of the Part 1 Conditions
Contract Rate	interest at the higher of 3.00% and 3.00% above the base rate from time to time of the Bank of England
Database	the datasite managed by Gerald Eve LLP as at 22 June 2021

Equipment	the grounds equipment detailed in the Asset List appended at Appendix 2
Landlord's Conveyancer	Charles Russell Speechlys LLP of 5 Fleet Place London EC4M 7RD, reference: MTS/163084-00059
Lease	the lease in the agreed form of the draft annexed to this Agreement at Appendix 1
LTA 1954	Landlord and Tenant Act 1954
Part 1 Conditions	the conditions in Part 1 of the Standard Commercial Property Conditions (Second Edition)
Part 2 Conditions	the conditions in Part 2 of the Standard Commercial Property Conditions (Second Edition)
Property	the property at The Sports Centre and Sports Grounds, Bank Lane, off Priory Lane, Roehampton SW15 as more particularly defined in the Lease
Rent	the initial rent of £350,000 payable from and including the Rent Commencement Date to and including 31 July 2022 and thereafter from and including 1 August 2022 the sum of £350,000 per annum (subject to review) exclusive of VAT

Rent Commencement Date the Completion Date.

Tenant's Conveyancer	CMS LLP of Cannon Place, 78 Cannon Street, London EC4N 6AF, reference: LZG/JUN/122198.00056
TSA	a transitional services agreement of today's date made between (1) the Landlord (2) the Tenant and (3) AELTC
VAT	value added tax or any equivalent tax chargeable in the UK

1.2 Clause, Schedule and paragraph headings shall not affect the interpretation of this Agreement.

1.3 A **person** includes a natural person, corporate or unincorporated body (whether or not having separate legal personality).

1.4 The Schedules form part of this Agreement and shall have effect as if set out in full in the body of this Agreement. Any reference to this Agreement includes the Schedules.

1.5 A reference to a **company** shall include any company, corporation or other body corporate, wherever and however incorporated or established.

1.6 Unless the context otherwise requires, words in the singular shall include the plural and in the plural shall include the singular.

1.7 Unless the context otherwise requires, a reference to one gender shall include a reference to the other genders.

1.8 A reference to a statute or statutory provision is a reference to it as amended, extended or re-enacted from time to time.

1.9 A reference to a statute or statutory provision shall include all subordinate legislation made from time to time under that statute or statutory provision.

1.10 Subject to clause 14.3, a reference to **writing** or **written** includes fax but not email.

1.11 A reference to this **Agreement** or to any other agreement or document referred to in this Agreement is a reference to this Agreement or such other agreement or document as varied or novated (in each case, other than in breach of the provisions of this Agreement) from time to time.

1.12 Unless the context otherwise requires, references to clauses, Schedules and Annexes are to the clauses, Schedules and Annexes of this Agreement and references to paragraphs are to paragraphs of the relevant Schedule.

1.13 Any words following the terms **including**, **include**, **in particular**, **for example** or any similar expression shall be construed as illustrative and shall not limit the sense of the words, description, definition, phrase or term preceding those terms.

1.14 Any obligation on a party not to do something includes an obligation not to allow that thing to be done.

1.15 Unless this Agreement otherwise expressly provides, a reference to the **Property** is to the whole and any part of the Property.

1.16 Any reference to the Landlord's consent or approval being required is to a consent or approval in writing which must be obtained before the relevant act is taken or event occurs.

1.17 **Landlord** includes the Landlord's successors in title and any other person who is or becomes entitled to the reversion (whether immediate or not) expectant on the term to be created by the Lease.

1.18 **Tenant** does not include the Tenant's successors in title.

2 AGREEMENT FOR LEASE

2.1 In consideration of the Tenant's obligations under this Agreement, the Landlord will grant to the Tenant and the Tenant will accept from the Landlord the Lease on the terms set out in this Agreement. No purchase price, premium or deposit is payable.

2.2 The Tenant cannot require the Landlord to grant the Lease to any person other than the Tenant (here meaning The All England Lawn Tennis Ground plc, incorporated and registered in England and Wales with company number 00168491, only).

2.3 The Tenant cannot assign, sublet, charge, or otherwise share or part with the benefit of this Agreement whether in relation to the whole or any part of the Property.

3 EXCLUSION OF SECURITY OF TENURE

3.1 The parties confirm that:

3.1.1 the Landlord served a notice on the Tenant, as required by section 38A(3)(a) of the LTA 1954 and which applies to the tenancy to be created by the Lease, before this Agreement was entered into; and

3.1.2 Mary Elizabeth Kelly, who was duly authorised by the Tenant to do so, made a statutory declaration dated 29 June 2021 in accordance with the requirements of section 38A(3)(b) of the LTA 1954.

4 CONDITIONS

4.1 The Part 1 Conditions are incorporated in this Agreement, in so far as they:

4.1.1 are applicable to the grant of a lease;

4.1.2 are not inconsistent with the other clauses in this Agreement; and

4.1.3 have not been modified or excluded by any of the other clauses in this Agreement.

4.2 The Part 2 Conditions are not incorporated in this Agreement.

4.3 Condition 1.1.1(e) is amended so that reference to the contract rate in Condition 1.1.1(e) refers instead to the Contract Rate as defined in this Agreement.

4.4 Condition 6.6.3 is amended so that reference to condition 3.1.2 is reference to Clause 10.1.

4.5 Condition 8.7 is amended to read: "The Tenant is to pay the money due on completion to the Landlord's Conveyancer by a method that gives immediately available funds."

4.6 Condition 9.1.1 is varied to read: "If any plan or statement in the agreement or in written replies which the Landlord's Conveyancer has given to any written enquiries raised by the Tenant's Conveyancer before the date of the agreement, is or was misleading or inaccurate due to an error or omission, the remedies available are as follows."

4.7 The following Part 1 Conditions do not apply to this Agreement:

4.7.1 Conditions 1.1.4(a), 1.2, 1.3, 1.4 and 1.5;

4.7.2 Condition 2.2;

4.7.3 Conditions 3.1.1, 3.1.2, 3.1.3 and 3.3;

4.7.4 Conditions 6.1, 6.2, 6.3, 6.4.2 and 6.6.2;

4.7.5 Conditions 7.1.1, 7.1.2, 7.1.3 and 7.1.4(b);

4.7.6 Condition 9.3; and

4.7.7 Condition 10.2.4.

5 CONDITION OF THE PROPERTY

5.1 The Tenant acknowledges that, prior to the date of this Agreement, the Landlord has given the Tenant and those authorised by the Tenant, the opportunity to inspect, survey and carry out investigations as to the condition of the Property and the Tenant accepts the condition of the Property as evidenced by the schedule of condition annexed to the Lease.

5.2 No representation or warranty is given by the Landlord that the Property may lawfully be used for the uses permitted by the Lease and the Tenant confirms that it has made all necessary enquiries to satisfy itself on this point.

5.3 The Tenant will not be entitled to refuse to complete or to delay completion of the grant of the Lease due to any event occurring after the date of this Agreement that results in:

5.3.1 any damage to the Property or any part of it;

5.3.2 any damage to the means of access to the Property; or

5.3.3 any deterioration in the Property's condition.

6 VACANT POSSESSION

6.1 The Landlord will give the Tenant vacant possession of the Property on completion of the grant of the Lease.

6.2 The Tenant is not entitled to and will not be permitted to take occupation or possession of the Property or of any part of it prior to completion of the grant of the Lease and this Agreement does not operate as a demise.

7 DEDUCING TITLE

7.1 The Landlord's freehold title to the Property has been deduced to the Tenant's Conveyancer before the date of this Agreement.

7.2 The Tenant is deemed to have full knowledge of the Landlord's title and is not entitled to raise any enquiry, objection or requisition in relation to it save for any matters revealed by the usual pre-completion searches

8 TITLE GUARANTEE

8.1 The Landlord will grant the Lease with full title guarantee.

8.2 The implied covenants for title are modified so that:

8.2.1 the covenant set out in section 2(1)(b) of the Law of Property (Miscellaneous Provisions) Act 1994 shall not extend to costs arising from the Tenant's failure to:

(a) make proper searches; or

(b) raise requisitions on title or on the results of the Tenant's searches, and

the covenant set out in section 3(3) of the Law of Property (Miscellaneous Provisions) Act 1994 shall extend only to charges or encumbrances created by the Landlord.

9 MATTERS AFFECTING THE PROPERTY

9.1 The Landlord will grant the Lease to the Tenant free from encumbrances other than:

9.1.1 any matters, other than financial charges, contained or referred to in the entries or records made in registers maintained by HM Land Registry under title numbers 139884 (as at 21 June 2021 and timed at 15:49:39), 239100 (as at 21 June 2021 and timed at 15:53:40), 396768 (as at 2 July 2019 and timed at 16:25:48);

9.1.2 all matters contained or referred to in the Lease;

9.1.3 any matters discoverable by inspection of the Property before the date of this Agreement;

9.1.4 any matters which the Landlord does not and could not reasonably know about;

9.1.5 any matters, other than financial charges, disclosed or which would have been disclosed by the searches and enquiries that a prudent tenant would have made before entering into this Agreement;

9.1.6 public requirements; and

9.1.7 any matters which are, or (where the Lease will not be registered) would be, unregistered interests which override first registration under Schedule 1 to the Land Registration Act 2002.

9.2 The Tenant is deemed to have full knowledge of the matters referred to in clause 9.1 and will not raise any enquiry, objection, requisition or claim in respect of any of them save that:

9.2.1 the Tenant may raise requisitions in respect of any matters revealed by the usual pre-completion searches;

9.2.2 the Landlord warrants that it has prior to the date of this Agreement disclosed to the Tenant all such matters of which it is aware.

10 VAT

10.1 Each amount stated to be payable by the Tenant to the Landlord under or pursuant to this Agreement is exclusive of VAT (if any).

10.2 If any VAT is chargeable on any supply made by the Landlord under or pursuant to this Agreement, the Tenant will pay the Landlord an amount equal to that VAT as additional consideration on completion.

11 COMPLETION

11.1 Completion will take place on the Completion Date.

11.2 On the Completion Date the Landlord shall grant and the Tenant shall accept the Lease and complete the Lease in counterpart on the Completion Date.

11.3 On completion, the Tenant will pay to the Landlord the Rent due for the period from the Rent Commencement Date to the day before the next rent payment day (as provided for in the Lease), apportioned as follows:

$$\frac{A \times B}{Y}$$

where:

A is the Rent,

B is the number of days from and including the Rent Commencement Date to but excluding the next rent payment date (as provided for in the Lease),

Y is the number of days from and including the Rent Commencement Date to and including 31 July 2022

11.4 If completion is delayed due to the Tenant's default or the Tenant fails to pay any sum due under this Agreement in full on completion, the Tenant will pay interest in addition to damages for losses incurred by the Landlord as a result of the delayed completion. The interest will be payable at the Contract Rate on any unpaid amount for the period from the Completion Date to the date of actual payment.

12 EQUIPMENT

In consideration of the payment of Thirty Five Thousand Pounds (£35,000) exclusive of VAT by the Tenant to the Landlord on the date hereof (receipt of which is acknowledged) for the grounds equipment detailed at Part 1 of Appendix 2 (with the gym equipment detailed at Part 2 of Appendix 2 being left behind at no cost), the Landlord's interest in the Equipment is transferred to the Tenant free from any charge, lien or other incumbrance (and the Landlord shall indemnify the Tenant for all costs, fees and expenses incurred as a result of the Equipment not being free from any third

party claim, lien or right), but it is transferred without any warranty as to its condition or suitability. The Tenant acknowledges that it acquires the Equipment "as is" and is responsible for assessing its suitability or otherwise for use, and compliance with all statutory and other requirements.

13 AELTC CONTRACT

13.1 The Landlord and AELTC hereby record that the AELTC Contract has determined absolutely with immediate effect on today's date.

13.2 The Landlord releases AELTC from the obligations on AELTC contained in the AELTC Contract and from all liability claims and demands arising under them or in respect of any breach of them including any claim in respect of any liability arising before on or after the date of this Agreement and but without prejudice to any costs incurred by the Landlord pursuant to the AELTC Contract which AELTC shall remain liable for until the TSA is completed.

13.3 AELTC releases the Landlord from the obligations on the Landlord (known as the Bank under the AELTC Contract) contained in the AELTC Contract and from all liability claims and demands arising under them or in respect of any breach of them including any claim in respect of any liability arising before on or after the date of this Agreement.

14 ENTIRE AGREEMENT

14.1 This Agreement and the documents annexed to it constitute the whole agreement between the parties and supersede all previous discussions, correspondence, negotiations, arrangements, understandings and agreements between them relating to their subject matter.

14.2 The Tenant acknowledges that in entering into this Agreement and any documents annexed to it the Tenant does not rely on, and shall have no remedies in respect of, any representation or warranty (whether made innocently or negligently) other than those:

14.2.1 set out in this Agreement or the documents annexed to it; or

14.2.2 contained in any written replies that the Landlord's Conveyancer has given to any written enquiries raised by the Tenant's Conveyancer before the date of this Agreement.

14.3 For the purposes of Clause 14.2 *and Condition 9.1.1 (as amended by Clause 5.6)*, **written enquiries** and **written replies** include:

14.3.1 any pre-contract enquiries and any replies to pre-contract enquiries that are requested or given by reference to the Property and include enquiries or replies so requested or given by email; and

14.3.2 the information and documents contained in the Database.

14.4 Nothing in this clause shall limit or exclude any liability for fraud.

15 JOINT AND SEVERAL LIABILITY

Where the Tenant comprises more than one person, those persons shall be jointly and severally liable for the obligations and liabilities of the Tenant arising under this Agreement. The Landlord may take action against, or release or compromise the liability of, or grant time or other indulgence to, any one of those persons without affecting the liability of any other of them.

16 NOTICES

16.1 Any notice given under this Agreement must be in writing and signed by or on behalf of the party giving it.

16.2 Any notice or document to be given or delivered under this Agreement may be:

16.2.1 delivered by hand; or

16.2.2 sent by pre-paid first class post or other next working day delivery service.

16.3 Any notice or document to be given or delivered under this Agreement must be sent to the relevant party as follows:

16.3.1 to the Landlord at:

Threadneedle Street, London EC2R 8AH

marked for the attention of: Dominic Whittle, Head of Property, Procurement, Security Division

with a copy to the Landlord's Conveyancer, quoting the reference MTS/163084-00059;

16.3.2 to the Tenant at:

Church Road, Wimbledon, London SW19 5AE

marked for the attention of: Alex Scudamore, Head of Legal

or at the Tenant's Conveyancer, quoting the reference LZG/JUN/122198.00056;

or as otherwise specified by the relevant party by notice in writing to each other party.

16.4 Any change of the details in Clause 16.3 specified in accordance with that clause shall take effect for the party notified of the change at 9.00 am on the later of:

16.4.1 the date, if any, specified in the notice as the effective date for the change; or

16.4.2 the date five working days after deemed receipt of the notice.

16.5 Giving or delivering a notice or a document to a party's conveyancer has the same effect as giving or delivering it to that party.

16.6 Any notice or document given or delivered in accordance with clause 16.1, clause 16.2 and clause 16.3 will be deemed to have been received:

16.6.1 if delivered by hand, on signature of a delivery receipt or at the time the notice or document is left at the address provided that if delivery occurs before 9.00 am on a working day, the notice will be deemed to have been received at 9.00 am on that day, and if delivery occurs after 5.00 pm on a working day, or on a day which is not a working day, the notice will be deemed to have been received at 9.00 am on the next working day; or

16.6.2 if sent by pre-paid first class post or other next working day delivery service, at 9.00 am on the second working day after posting.

16.7 In proving delivery of a notice or document, it will be sufficient to prove that:

16.7.1 a delivery receipt was signed or that the notice or document was left at the address; or

16.7.2 the envelope containing the notice or document was properly addressed and posted by pre-paid first class post or other next working day delivery service.

16.8 A notice or document given or delivered under this Agreement shall not be validly given or delivered if sent by email.

16.9 This clause does not apply to the service of any proceedings or other documents in any legal action or, where applicable, any arbitration or other method of dispute resolution.

17 CONTAINERS

The Landlord and the Tenant agree that the containers that they presently have on the Property/the Landlord's adjoining land respectively are there on licence, and on reasonable request and reasonable notice from the other party they will arrange for their containers to be relocated off the other party's land.

18 THIRD PARTY RIGHTS

A person who is not a party to this Agreement shall not have any rights under the Contracts (Rights of Third Parties) Act 1999 to enforce any term of this Agreement.

19 GOVERNING LAW

This Agreement and any dispute or claim arising out of or in connection with it or its subject matter or formation (including non-contractual disputes or claims) shall be governed by and construed in accordance with the law of England and Wales.

20 JURISDICTION

Each party irrevocably agrees that the courts of England and Wales shall have exclusive jurisdiction to settle any dispute or claim arising out of or in connection with this Agreement or its subject matter or formation (including non-contractual disputes or claims).

SIGNED for and on behalf of **THE GOVERNOR AND COMPANY OF THE BANK OF ENGLAND**)
)
)

Signature

Name (Print)

Position

SIGNED by **THE ALL ENGLAND LAWN TENNIS GROUND PLC**)
)
)

acting by Ian Hewitt

a director, in the presence of:

I. L. Hewitt

Witness Signature:

Name: ROBERT DEATKER

Address: AELTC, CHURCH ROAD
WIMBLEDON, LONDON, SW19 5AE

Occupation: CHARTERED ENGINEER

SIGNED by **THE ALL ENGLAND LAWN TENNIS CLUB (CHAMPIONSHIPS) LIMITED**)
)
)

acting by Ian Hewitt

a director, in the presence of:

I. L. Hewitt

Witness Signature:

Name: ROBERT DEATKER

Address: AELTC, CHURCH ROAD, WIMBLEDON, LONDON, SW19 5AE

Occupation: CHARTERED ENGINEER

APPENDIX 1
Agreed form of Lease

CharlesRussell Speechlys

DATED 2021

(1) **THE GOVERNOR AND COMPANY OF THE BANK OF ENGLAND**

(2) **THE ALL ENGLAND LAWN TENNIS GROUND plc**

LEASE OF THE SPORTS CENTRE AND SPORTS GROUND, BANK LANE, OFF PRIORY LANE, ROEHAMPTON SW15

---

5 Fleet Place London EC4M 7RD
Tel: +44 (0)20 7203 5000 • **Fax:** +44 (0)20 7203 0200 • **DX:** 19 London/Chancery Lane
www.charlesrussellspeechlys.com

CONTENTS

1	DEFINITIONS	1
2	INTERPRETATION	9
3	DEMISE	11
4	BREAK RIGHT	12
5	THIRD PARTY RIGHTS OVER THE PREMISES	13
6	PAYMENT OF RENTS	13
7	OTHER FINANCIAL MATTERS	14
8	STATE AND CONDITION OF THE PREMISES	16
9	USE OF THE PREMISES	18
10	DEALINGS	19
11	LEGAL REQUIREMENTS AND REGULATIONS	22
12	COMMUNITY INFRASTRUCTURE LEVY	24
13	LANDLORD'S COVENANT FOR QUIET ENJOYMENT	24
14	LANDLORD'S RELEASE ON ASSIGNMENT OF THE REVERSION	24
15	FORFEITURE	24
16	OBLIGATIONS IN SCHEDULES TO THIS LEASE	26
17	MISCELLANEOUS	26
18	SEVERABILITY	28
19	GOVERNING LAW AND JURISDICTION	28
20	CONTRACTS (RIGHTS OF THIRD PARTIES) ACT 1999	28
21	EXCLUSION OF THE 1954 ACT	28
22	NEW OR OLD LEASE	29
23	THE QUALIFYING COMPETITION	29
24	WAYLEAVES	29
SCHEDULE 1 RIGHTS GRANTED		30
SCHEDULE 2 EXCEPTIONS AND RESERVATIONS		31
SCHEDULE 3 INSURANCE PROVISIONS		32
SCHEDULE 4 RENT REVIEW PROVISIONS		36
SCHEDULE 5 SERVICES AND THE SERVICE CHARGE		39
ANNEXURE 1 SURVEY REPORT		48
ANNEXURE 2		49

LAND REGISTRY PRESCRIBED CLAUSES

LR1. Date of the lease	2021
LR2. Title Number(s)	**LR2.1 Landlords title number(s)** 139884, 239100 and 396768. **LR2.2 Other title numbers** None.
LR3. Parties to this lease	**Landlord** **THE GOVERNOR AND COMPANY OF THE BANK OF ENGLAND** of Threadneedle Street London EC2R 8AH. **Tenant** **THE ALL ENGLAND LAWN TENNIS GROUND plc** (incorporated and registered in England and Wales under company number 00168491) whose registered office is Church Road, Wimbledon, London SW19 5AE. **Other parties** None.
LR4. Property	**In the case of a conflict between this clause and the remainder of this lease then, for the purposes of registration, this clause shall prevail.** The premises as defined in clause 1. The Property is let without the benefit of any existing easements other than those which are expressly referred to in in this Lease.
LR5. Prescribed statements	**LR5.1 Statements prescribed under rules 179 (dispositions in favour of a charity), 180 (dispositions by a charity) or 196 (leases under the Leasehold Reform, Housing and Urban Development Act 1993) of the Land Registration Rules 2003** None.

	LR5.2 This lease is made under, or by reference to, provisions of: None.
LR6. Term for which the Property is leased	The term as specified in this Lease in the definition of "Term" at clause 1.
LR7. Premium	None
LR8. Prohibitions or restrictions on disposing of the lease	This lease contains a provision that prohibits or restricts dispositions.
LR9. Rights of acquisition etc.	**LR9.1 Tenant's contractual rights to renew this lease, to acquire the reversion or another lease of the Property, or to acquire an interest in other land**
	None. **LR9.2 Tenant's covenant to (or offer to) surrender this lease** None. **LR9.3 Landlord's contractual rights to acquire this lease** None.
LR10. Restrictive covenants given in this lease by the Landlord in respect of land other than the Property	None.
LR11. Easements	**LR11.1 Easements granted by this lease for the benefit of the Property** The easements granted by clause 3.2 and set out in Schedule 1. **LR11.2 Easements granted or reserved by this lease over the Property for the benefit of other property** The rights reserved by clause 3.3 and set out in Schedule 2.
LR12. Estate rentcharge burdening the Property	None.
LR13. Application for	None.

standard form of restriction	
LR14. Declaration of trust where there is more than one person comprising the Tenant	None.

LEASE

DATE: **2021**

PARTIES

(1) **THE GOVERNOR AND COMPANY OF THE BANK OF ENGLAND** of Threadneedle Street London EC2R 8AH (the **Landlord**)

(2) **THE ALL ENGLAND LAWN TENNIS GROUND plc** (incorporated and registered in England and Wales under company number 00168491) whose registered office is at Church Road, Wimbledon, London SW19 5AE (the **Tenant**)

IT IS AGREED AS FOLLOWS:

1 DEFINITIONS

In this Lease the following words and expressions shall have the following meanings:

1954 Act	the Landlord and Tenant Act 1954
CIL	community infrastructure levy under the Planning act 2008 and any charge, tax or levy substituted for it and including related interest, penalties, surcharges and liabilities
Common Parts	the Estate Roads, car parking areas, landscaped areas and other external areas of the Estate other than the Premises and the buildings or areas on the Estate which are let or are intended for letting, and all Service Media on, over or under such land
Contamination	any Hazardous Material or Waste present at, in or under the Premises and/or the Estate
Contaminative Use	any use resulting in the presence of Contamination
Designated Person	a person as defined in the Sanctions and Anti-Money Laundering Act 2018 (or equivalent or similar definitions in equivalent or similar legislation in other jurisdictions as appropriate)
Due Date	in respect of:

(a) the Rent and the Service Charge Estimate and VAT payable on them, the Quarter Day they fall due; and

(b) any other rents or sums and VAT on them payable under this Lease, within 14 days of written demand

EPC an Energy Performance Certificate and Recommendation report (as defined in the Energy Performance of Buildings (England and Wales) Regulations 2012)

Entry Safeguards means the person exercising rights of entry or access to the Premises shall:

(a) give the Tenant (and any undertenant or other lawful occupier) reasonable prior written notice (except in the case of emergency, when the Landlord must give as much notice as may be reasonably practicable);

(b) observe the Tenant's (and any undertenant or other lawful occupier's) reasonable requirements (including being accompanied by the Tenant's (and any undertenant or other lawful occupier's) representative where the Tenant reasonably requires);

(c) observe any specific pre-conditions to the entry set out in this Lease;

(d) use reasonable endeavours not to cause any damage to the Premises or the Tenant's fixtures, fittings or chattels;

(e) to the extent any damage is caused to the Premises or the Tenant's fixtures, fittings or chattels make good such damage as quickly as reasonably possible;

(f) cause as little nuisance or disturbance to the Tenant its undertenants or any other lawful occupiers as reasonably practicable and use all reasonable endeavours not to adversely

affect the Tenant's (and any undertenant or other lawful occupier's) occupation, use and enjoyment of the Premises;

(g) exercise the right in a reasonable manner;

(h) where entering to carry out works to the Premises or any parts of the Estate which will interfere with the rights the Tenant has over those parts, to first agree in writing with the Tenant with details on the location, method and proposed time or times of working and any other material matter (both parties acting reasonably and without delay) relating to the preparation for, and execution of, the works;

(i) remain upon the Premises for as short a period and only access such part of the Demised Premises as is reasonably necessary;

(j) use reasonable endeavours where practicable and economic, to only exercise the right outside the Usual Business Hours but otherwise only at reasonable times; and

(k) not exercise any right of entry during the Qualifying Competition Period except in the case of any emergency or necessity (where as much notice as possible of the need access will be given),

Environment all or any of the following media namely the air (including the air within buildings and within other natural or man-made structures), water and land and any living organisms or eco-systems supported by those media

Estate the land (of which the Premises forms part) known as the Sports Centre, Priory Lane, Roehampton and shown edged red on Plan 1 and includes every building from time to time on that land

Estate Car Park the car parking area forming part of the Common Parts or such amended or alternative within the Estate (but which shall not be materially less

commodious or inconvenient)

Gate 2 the perimeter gate identified as such on the Plan

Group Company a member of the same group within the meaning of section 42 of the 1954 Act

Hazardous Material any substance whether in solid, liquid or gaseous form, which is capable of causing harm to human health or to the Environment whether on its own or in combination with any other substance

Insurance Rent

(a) the cost to the Landlord (before any commission) of insuring:

(i) the Premises against the Insured Risks for their full reinstatement cost, including the costs of demolition, shoring up and site clearance, temporary works, compliance with local authority requirements in connection with any works of repair or reinstatement, architects', surveyors' and other professional fees and other incidental expenses, and in each case with due allowance for inflation and VAT

(ii) against loss of the Rent from the Premises (having regard to the provisions for the review of the Rent) for a period of three years and

(iii) against public liability of the Landlord in connection with any matter relating to the Premises, their occupation or their use and

(b) a fair proportion of the cost to the Landlord (before any commission) of insuring:

(i) the Common Parts against the Insured Risks for their full reinstatement cost, including the costs of demolition, shoring up and site clearance, temporary works, compliance with local authority requirements in connection with any works of repair or reinstatement, architects', surveyors' and other professional fees and other incidental expenses, and in each case with due allowance for inflation and VAT and

(ii) against public liability of the Landlord in connection with any matter relating to the Common Parts, their occupation or use

Insured Damage damage to or destruction of the Premises or the Common Parts or any part of them by any of the Insured Risks so as to render the Premises unfit for use and occupation or inaccessible but excluding:

(a) any Uninsured Damage and

(b) any damage in respect of which the Landlord's insurance is vitiated by the Tenant (unless, within 15 Working Days of the date of such damage occurring, the Tenant pays to the Landlord the amount of insurance monies rendered irrecoverable)

Insured Risks fire, explosion, act of terrorism, lightning, earthquake, flood, storm, bursting or overflowing of water tanks, pipes, or other water or heating apparatus, impact, aircraft (other than hostile aircraft) and things dropped from such aircraft, riot, civil commotion and malicious damage and such other risks as the Landlord may from time to time reasonably insure against (whether at its own discretion or at the request of the Tenant)

Interest	interest at the Interest Rate (both before and after judgement) calculated on a daily basis from the Due Date until the date on which payment is made, such interest to be compounded on the Quarter Days
Interest Rate	the higher of three per cent, and three per cent over the base rate from time to time of the Bank of England (or if that rate is no longer published then four per cent above the rate of interest which the Landlord reasonably considers to be most closely comparable to minimum lending rates generally applicable in the UK from time to time)
Landlord	the first party to this Lease and its successors in title and persons entitled to the reversion immediately expectant on the termination of this Lease
Landlord's Surveyor	a surveyor appointed by the Landlord, who may be an individual, or a firm or company of chartered surveyors, or an employee of the Landlord or of a company which is in the same group as the Landlord
this Lease	this deed as varied or supplemented by any document which is supplemental to or collateral with this deed
Permitted Use	Sport, leisure and recreational uses (and any other use required for the Qualifying Competition and for community sports facilities) and related ancillary activities within Class D2 of the Town and Country Planning (Use Classes) Order 1987 as at 31 August 2020
Plan	the plan annexed to this Lease at Annexure 1
Policy Exclusions	any condition, exclusion or limitation which may be imposed by the Landlord's insurers, but does not include any excess
Premises	The Sports Centre and Sports Grounds shown coloured pink on the Plan and the whole or any part

	of them as altered or added to including: (a) all Landlord's fixtures and fittings from time to time at the Premises, but if those fixtures are Service Media, then only if they fall within paragraph (b) below (b) Service Media within and from time to time exclusively serving those Premises and which are owned by the Landlord (c) all boundary walls, fences, and other structures but excluding any Service Media within such Premises but which do not serve such Premises exclusively, or which are not owned by the Landlord
Qualifying Competition	the annual qualification tournament for the Wimbledon Championships which shall include the annual qualification for the Junior Championships and the LTA Junior International tournament.
Qualifying Competition Period	means the duration of the Qualifying Competition including the preceding build and post-event derig period (which period in any event shall not begin prior to 1st May nor end after 31st July in any year)
Quarter Days	25 March, 24 June, 29 September and 25 December and the expression **Quarter Day** shall be construed accordingly
Rent	£350,000 per annum as reviewed under this Lease, and then from and including 1 August 2031 for the remainder of the Term £675,000 per annum save that from and including the Rent Commencement Date to and including 31 July 2022 the rent shall be £350,000
Rent Commencement Date	the Term Commencement Date

Review Date	1 August 2026 and every anniversary of that date until and including 1 August 2030 and any other date when the Rent may be reviewed under this Lease
Schedule of Condition	the photographic schedule of condition prepared by MSA which is annexed to this Lease at Annexure 3
Service Charge	a fair proportion of the total cost of the Landlord's Expenses in relation to the relevant Service Charge Year (as those terms are defined in Schedule 5)
"Service Charge Code"	the Royal Institution of Chartered Surveyors professional statement "Service Charges in Commercial Property" (1st Edition, September 2018)
Service Charge Estimate	a fair proportion of the amount which the Landlord, or the Landlord's Surveyor or its accountant, reasonably estimates will be the total cost of the Landlord's Expenses in any Service Charge Year (as those terms are defined in Schedule 5)
Service Media	conduits and equipment used for the reception, generation, passage and/or storage of Utilities
Survey Report	the Lighthouse survey report dated 23 August 2020 a copy of which is annexed as Annexure 2
Tenant	the second party to this Lease and its successors in title save where otherwise expressly provided
Term	a term of years from and including today's date and expiring on and including 31 July 2036
Uninsured Damage	damage or destruction to or destruction of the whole or any part of the Premises or the Common Parts by: (a) any risks expressly specified in the definition of the Insured Risks which renders the Premises unfit for occupation and use or inaccessible and which:

(i) is not insured because insurance is not available in the London insurance market or because insurance is not available in the London insurance market at economic rates and on terms which in the Landlord's reasonable discretion are acceptable or

(ii) is not insured or fully insured by reason of a Policy Exclusion,

(b) any other risk whatsoever which is not specified in the definition of Insured Risks

such that the full cost of reinstatement is not recoverable by the Landlord under the Landlord's building insurance but excluding any damage in respect of which the insurance is vitiated by the Tenant (unless, within 15 Working Days of the date of such damage occurring, the Tenant pays to the Landlord the amount of insurance monies rendered irrecoverable)

Usual Business Hours 8am to 6pm Monday to Friday

Utilities electricity, gas, water, foul water and surface drainage, heating, ventilation and air-conditioning, smoke and fumes, signals, telecommunications, satellite and data communications and all other utilities

VAT value added tax payable by virtue of the Value Added Tax Act 1994 (or any tax similar or equivalent to value added tax)

Waste any discarded surplus or unwanted material irrespective of whether it is capable of being recycled or has any value

Working Day a day (other than a Saturday or Sunday) on which clearing banks are open for business in the City of

2 INTERPRETATION

2.1 The table of contents, the Land Registry prescribed clauses and the clause headings are for reference only and do not affect the construction of this Lease.

2.2 The Schedules form part of this Lease and shall have effect as if set out in full in the body of this Lease. Any reference to this Lease includes the Schedules.

2.3 A person includes a natural person, corporate or unincorporated body (whether or not having separate legal personality).

2.4 A reference to a company shall include any company, corporation or other body corporate.

2.5 Obligations owed by or to more than one person are owed by or to them jointly and severally.

2.6 The words **include**, **includes** and **including** are deemed to be followed by the words **without limitation**.

2.7 An obligation of the Tenant not to do something includes an obligation not to cause or allow that thing to be done.

2.8 A reference to any act or to any act or omission of the Tenant includes any act or any act or omission of any other person at the Premises or the Estate with the Tenant's express or implied authority.

2.9 A reference to the consent or approval of the Landlord means the prior consent in writing (to be contained in a formal deed) of the Landlord, and, where required, of any superior landlord or mortgagee of the Landlord.

2.10 References to any adjoining or nearby property of the Landlord include any property adjoining or near the Premises or the Estate which is owned, leased or occupied by the Landlord from time to time.

2.11 References to the end of the Term are to the expiry or sooner determination of the Term however and whenever it determines.

2.12 References to a **fair proportion** of any sum are to the whole or a proportion of that sum which is fair and reasonable in the circumstances as determined by the Landlord's Surveyor whose decision shall be final and binding (save in case of manifest error or injustice).

2.13 The expression **tenant covenants** has the meaning given to it by the Landlord and Tenant (Covenants) Act 1995.

2.14 Unless otherwise specified:

2.14.1 references to the Premises, the Common Parts and the Estate include any part of the Premises, the Common Parts or the Estate;

2.14.2 a reference to legislation in general is to all local, national and directly applicable supra-national laws in force for the time being in the United Kingdom, taking account of any amendment, extension, application or re-enactment and includes any subordinate legislations for the time being in force made under them and all orders, notices, codes of practice and guidance made under them;

2.14.3 a reference to particular legislation is a reference to that legislation as amended, consolidated or re-enacted from time to time and all subordinate legislation made under it from time to time; and

2.14.4 a reference to a clause or a schedule is a reference to a clause or sub-clause or schedule of this Lease and a reference to a paragraph is a reference to a paragraph or a sub-paragraph of the schedule in which it appears.

2.15 All rights of access or entry into or onto the Premises shall be subject to the relevant person complying with the Entry Safeguards and the Landlord will procure such person complies with the Entry Safeguards where it is not the Landlord itself accessing or entering the Premises.

3 DEMISE

3.1 Term

The Landlord demises the Premises with full title guarantee and vacant possession to the Tenant for the Term.

3.2 Rights granted

3.2.1 The Landlord grants to the Tenant the rights and easements set out in Schedule 1.

3.2.2 The rights and easements set out in Schedule 1:

(a) unless otherwise specified, are not granted to the Tenant exclusively, but are to be used in common with the Landlord, any superior landlord, any other tenants and lawful occupiers of the Estate, and other persons authorised by them;

(b) may be temporarily interrupted or varied for the purposes of any works of maintenance, repair, alteration or the replacement of any land, building, or Service Media in connection with which the rights are exercised save that no such interruption or variation shall take place or have effect during the Qualifying Competition Period unless absolutely necessary and PROVIDED ALWAYS that the Landlord will use all reasonable endeavours to minimise the impact on the

Tenant's use of the Premises and ability to operate the Qualifying Competition without inconvenience or interruption; and

(c) are to be exercised by the Tenant and the occupiers and other bona fide users of the Premises in accordance with any reasonable regulations (which have been made available to the Tenant) which the Landlord may make for the proper management of the Estate.

3.2.3 Nothing contained or referred to in this Lease will confer on, or grant to, the Tenant any right, easement or privilege other than those which are set out in Schedule 1, and section 62 of the Law of Property Act 1925 will not apply to this Lease.

3.2.4 Nothing contained or referred to in this Lease entitles the Tenant to the benefit of, or the right to enforce or to prevent the release or modification of, any agreement entered into by any other tenant or occupier of the Estate with the Landlord.

3.3 Rights excepted and reserved

The rights set out in Schedule 2 are excepted and reserved in favour of the Landlord and any superior landlord or mortgagee, and may be exercised by anyone authorised by them.

4 BREAK RIGHT

4.1 Definitions

In this clause the following definitions apply:

Break Date 31July 2031

4.2 Exercise of break right

The Tenant may terminate this Lease by serving written notice on the Landlord at least two years before the Break Date.

4.3 Conditions

Subject to the provisions of clause 4.4.2 a break notice shall be of no effect if, at the Break Date:

4.3.1 the Tenant has not paid any part of the Rent, or any VAT in respect of such sums, which was due to have been paid; or

4.3.2 occupation of the whole of the Premises has not been given up leaving behind no subsisting underleases.

4.4 Termination

4.4.1 Subject to the provisions of clause 4.3, following service of a break notice this Lease shall terminate on the Break Date.

4.4.2 The Landlord may at its discretion any time after a notice is served pursuant to clause 4.2 waive either or both of the conditions in clause 4.3.

4.4.3 Termination of this Lease on the Break Date shall not affect any other right or remedy that either party may have in relation to any earlier breach of this Lease.

4.4.4 If this Lease terminates in accordance with clause 4.4.1 then, within 20 Working Days after the Break Date the Landlord shall refund to the Tenant the proportion of the Rent, the Insurance Rent and the Service Charge Estimate paid in advance for any period after (but excluding) the Break Date, calculated on a daily basis.

5 THIRD PARTY RIGHTS OVER THE PREMISES

5.1 This Lease is granted subject to the matters contained or referred to in registered title numbers 139884, 239100 and 396768 (except any financial charges and any personal covenants) as at the date of this Lease which remain enforceable, and the Tenant shall indemnify the Landlord against any breach of the same in so far as they relate to the Premises and the rights granted by this Lease.

5.2 The Tenant shall not:

5.2.1 permit any third party to acquire any right over or in respect of the Premises or to encroach upon the Premises and shall give the Landlord written notice as soon as reasonably practicable of any attempt to do this; and

5.2.2 grant any right or licence to a third party relating to the air space at the Premises.

5.3 The Tenant shall:

5.3.1 take any steps (at the Landlord's cost) which the Landlord may reasonably require to prevent the acquisition of any right over or in respect of the Premises or any encroachment on the Premises but not where such steps would be against the commercial interests of the Tenant or the Qualifying Competition; and

5.3.2 preserve for the benefit of the Premises and the Landlord's interest in them all existing rights which belong to the Premises and are enjoyed over adjoining or neighbouring property.

6 PAYMENT OF RENTS

6.1 The Tenant agrees with the Landlord to pay the following rents without deduction or set off unless required for law (whether legal or equitable):

6.1.1 the Rent and any VAT on it in four equal payments in advance on the Quarter Days, the first payment being a proportionate amount for the period from and including the Rent Commencement Date and ending on the day immediately preceding the next Quarter Day;

6.1.2 the Service Charge in accordance with the provisions of Schedule 5;

6.1.3 the Insurance Rent and any VAT on it on demand;

6.1.4 any VAT chargeable on sums payable by the Tenant from time to time on demand; and

6.1.5 Interest and all other sums payable by the Tenant to the Landlord under the terms of this Lease on demand.

6.2 If required by the Landlord, the Tenant shall pay the Rent and the Service Charge Estimate and any VAT on them by direct debit or credit transfer to a bank account in the United Kingdom which the Landlord has notified in writing to the Tenant.

7 OTHER FINANCIAL MATTERS

7.1 Utilities

The Tenant shall:

7.1.1 pay on demand all charges, including connection and hire charges, relating to the supply of Utilities to the Premises; and

7.1.2 comply with all present or future requirements and reasonable recommendations of the suppliers of Utilities to the Premises.

7.2 Rates and taxes

The Tenant shall pay and indemnify the Landlord against all present and future rates, taxes, duties, levies, costs, charges and assessments and other impositions of whatever nature charged on or payable in respect of the Premises, its use and occupation and any works carried out there (except any tax imposed on the Landlord in respect of the receipt of rents reserved by this Lease or any dealing with or disposition of the Landlord's interest in the Premises).

7.3 Payments relating to the Premises and other property

Where any of the charges payable under clauses 7.1, 7.2 or 7.3 relates to other property as well as the Premises, the amount to be paid by the Tenant will be a fair proportion of the whole of the amount charged or payable.

7.4 **Landlord's costs**

The Tenant shall pay to the Landlord on demand the fees, costs and expenses properly charged, incurred or payable (and in the case of clause of 7.4.5 reasonable and proper) by the Landlord in relation to the following:

7.4.1 the enforcement of the tenant covenants of this Lease;

7.4.2 any steps taken in contemplation of, or in relation to, any proceedings under section 146 or 147 of the Law of Property Act 1925 or the Leasehold Property (Repairs) Act 1938, including the preparation and service of all notices, and even if forfeiture is avoided (unless it is avoided by relief granted by the court);

7.4.3 preparing and serving schedules of dilapidations at any time during the Term (or within 6 months after the end of the Term in respect of dilapidations arising during the Term), and supervising any works undertaken to remedy such dilapidations;

7.4.4 recovering (or attempting to recover) any arrears of Rent or other sums due to the Landlord under this Lease, including the costs of preparing and serving any notice under section 17 of the Landlord and Tenant (Covenants) Act 1995 and any costs associated with the Landlord's remedies of commercial rent arrears recovery or execution; and

7.4.5 any application for a consent or approval of the Landlord (including the preparation of any documents) which is needed by virtue of this Lease (whether or not such consent is granted or such approval is given and whether or not the application is withdrawn except in cases where the Landlord is obliged not to unreasonably withhold its consent and the withholding of consent is unreasonably offered with unreasonable conditions and where the Landlord is obliged to act reasonably the costs shall be reasonable and proper).

7.5 **VAT**

7.5.1 Where the Tenant is to pay the Landlord for any supply made to the Tenant by the Landlord, the Tenant shall also pay any VAT which may be payable in connection with that supply (subject to receipt of a valid and properly addressed VAT invoice).

7.5.2 Where the Tenant is to reimburse the Landlord for any payment made by the Landlord under or in connection with this Lease, then the Tenant shall also reimburse the Landlord for any VAT payable on such payment, except to the extent that the Landlord is able to obtain an input credit for the VAT from HM Revenue & Customs.

7.5.3 The Landlord hereby confirms that as at the date of this Lease it has not opted to tax the Premises for the purposes of VAT and further confirms

that it (or any successor landlord) shall promptly notify the Tenant of any option to tax made in relation to the Premises for the purposes of VAT.

7.6 **Interest**

Without prejudice to any other remedy of the Landlord, to pay Interest on so much of the Rent and Service Charge Estimate payable under clause 6 as remain unpaid after 7 Working Days and all other rents as remain unpaid after the Due Date, whether or not any such sums have been refused by the Landlord so as not to waive any breach of covenant.

7.7 **Exclusion of statutory compensation**

Any statutory right of the Tenant, or any undertenant, to claim compensation from the Landlord or any superior landlord on leaving the Premises is excluded to the extent that the law allows.

8 **STATE AND CONDITION OF THE PREMISES**

8.1 **Repair**

8.1.1 The Tenant shall repair the Premises and keep them in good and substantial repair and condition and shall keep all plant and equipment within or forming part of the Premises in good working order.

8.1.2 The Tenant shall replace with articles of similar kind and quality any fixtures, fittings, plant or equipment (other than Tenant's or trade fixtures and fittings) within or forming part of the Premises which are beyond economic repair (damage by fair wear and tear excepted).

8.1.3 The Tenant shall keep any outside parts of the Premises clean and tidy, any landscaped areas properly weeded and any unbuilt on areas adequately surfaced and shall regularly clean the inside and outside of the windows at the Premises.

8.1.4 The Tenant will not be liable under this clause 8.1 to the extent that:

(a) the Landlord is obliged to carry out the relevant repair works under paragraph 3 of Schedule 3 (Reinstatement); or

(b) Uninsured Damage occurs to the Premises.

8.1.5 At the end of the Term the Tenant will yield up the Premises with vacant possession decorated and repaired in accordance with and in the condition required by this Lease.

PROVIDED THAT for the purposes of this clause 8.1 the Tenant shall not be obliged to (a) put the Premises into any better state of repair and condition than it was in at the date of this Lease as evidenced by the Schedule of Condition; (b) carry out any improvements or resolve any historical repair or maintenance issues as identified by the Survey Report; nor (c) repair, maintain or keep in good working

order any of the mechanical and/or electrical equipment or systems serving the swimming pool or any equipment within the sports hall.

8.2 **Redecoration**

8.2.1 The Tenant shall redecorate the inside of the Premises every five years and the outside every three years and both in the last six months before the end of the Term (but not more than once in any 18 month period and in both cases the Tenant shall not be required to redecorate the Premises to put into a better state of decoration as evidenced by the Schedule of Condition.

8.2.2 All decoration shall be carried out in a good and proper manner using good quality materials, and shall include all appropriate preparatory work.

8.2.3 All redecoration in the last six months of the Term is to be carried out in colours and materials approved by the Landlord (acting reasonably) and to the reasonable satisfaction of the Landlord.

8.3 **Alterations**

8.3.1 Save as permitted by clause 8.3.2, the Tenant shall not make any alterations or additions to the Premises without obtaining the written consent of the Landlord, such consent not to be unreasonably withheld or delayed and the Landlord confirms and acknowledges that it shall have specific regard to the Qualifying Competition when considering any application for consent.

8.3.2 The Tenant may make non-structural alterations to the Premises that do not affect its functional use without the consent of the Landlord provided that the Tenant provides to the Landlord a plan showing the Premises as altered within 15 Working Days of completion of the works.

8.3.3 The Tenant shall not make any alteration or addition to any of the Landlord's fixtures or to any of the Service Media in the Premises (without the Landlord's consent, such consent not to be unreasonably withheld or delayed);

8.3.4 Unless and to the extent otherwise required by the Landlord and notified to the Tenant at least 6 months' prior to the end of the Term, the Tenant shall at the end of the Term:

(a) remove any alterations or additions made to the Premises (other than works permitted under clause 8.3.2 hereof unless the works permitted under clause 8.3.2 would on determination of the Term have a material adverse effect on the value of the reversion);

(b) remove and make good any damage caused by the installation of any temporary structures;

(c) make good any damage caused by that removal to the reasonable satisfaction of the Landlord; and

(d) reinstate the Premises to their original layout and condition.

8.3.5 The Tenant shall meet the Landlord's reasonable costs and enter into such covenants as the Landlord may reasonably require regarding the execution of any works to which the Landlord consents under this clause.

8.4 **Signs and re-letting notices**

8.4.1 The Tenant shall not erect or display any flag, mast, advertisement or other sign or notice at the Premises which can be seen from outside the Premises, except one external sign giving the name and business of the Tenant (or other authorised occupier) which has been approved by the Landlord acting reasonably (save that no consent shall be required where the signage and branding is in the Tenant's usual colours and branding), and reasonable temporary signage and branding in the Tenant's usual colours and branding, and at the end of the Term the Tenant shall remove any such sign and make good any damage caused by that removal to the reasonable satisfaction of the Landlord.

8.4.2 Subject to the Entry Safeguards, the Tenant shall permit the Landlord to place a sign on the Premises at any time advertising the sale of the Landlord's interest (or any superior interest) in the Premises and during the last six months of the Term for the re-letting of the Premises save that no such signage shall be erected during the Qualifying Competition.

8.5 **Aerials and satellite dishes**

8.5.1 The Tenant shall not erect any aerials or satellite dishes on the exterior of the Premises without the consent of the Landlord, such consent not to be unreasonably withheld or delayed.

8.5.2 At the end of the Term the Tenant shall remove any such aerials and satellite dishes and make good any damage caused by their removal to the reasonable satisfaction of the Landlord.

9 **USE OF THE PREMISES**

9.1 **Permitted Use**

9.1.1 The Tenant will not use the Premises except for the Permitted Use.

9.1.2 During the Qualifying Competition Period only the right to park vehicles anywhere on the Premises (including temporary parking on grassed areas) subject to complying with all other relevant provisions in this Lease.

9.1.3 The Tenant will operate a community sports facility throughout the term providing access to the outdoor sports facilities and the changing rooms but the Tenant shall not be obliged to undertake or accommodate any community uses which would materially interfere with the Tenant's beneficial use and enjoyment of the Premises and it is acknowledged by the parties that the overriding purpose for the Tenant entering into this Lease is for the purpose of the Qualifying Competition.

9.2 **Obstructions**

The Tenant shall not obstruct the Common Parts and shall not park or allow to be parked any vehicles on the Estate Roads unless specifically authorised by the Landlord in its absolute discretion.

9.3 **Restrictions on use**

The Tenant shall not:

9.3.1 leave the Premises unoccupied for a period of more than three months without the consent of the Landlord, but the Tenant will not by virtue of this clause be required to trade from the Premises;

9.3.2 do anything on the Premises which is illegal or immoral or offensive or which would cause a nuisance or inconvenience or any damage or disturbance to the Landlord or any of the other occupiers of the Estate or any owner or occupier of any other property adjoining or near the Premises;

9.3.3 carry out any acts at the Premises which are noisy, noxious, dangerous or which amount to a Contaminative Use;

9.3.4 store Hazardous Materials or Waste at the Premises;

9.3.5 allow rubbish to accumulate at the Premises nor allow any material which is deleterious, polluting or dangerous (to persons or property) to enter any Service Media or any adjoining property;

9.3.6 overload any structural parts of the Premises; nor

9.3.7 overload or obstruct any Service Media which serve the Premises.

9.3.8 not to use or permit to be used the name "The Bank of England", "The Old Lady", "The Old Lady of Threadneedle Street" or any other name which might reasonably be construed as referring to The Bank of England in connection with the Premises.

9.4 **Fire and security precautions**

The Tenant shall comply with:

9.4.1 the requirements of the fire authority;

9.4.2 any reasonable requirements of the Landlord relating to fire prevention and the provision of fire fighting equipment at the Premises.

9.5 **Exclusion of warranty**

The Landlord does not warrant or represent that the Premises are fit for or may be used for the Permitted Use or for any other purpose.

10 **DEALINGS**

10.1 **General restrictions**

The Tenant shall not part with nor agree to part with possession of the whole or part of the Premises or this Lease, nor allow any other person to occupy the whole or any part of the Premises, except as permitted by the remainder of this clause 10.

10.2 **Assignment**

The Tenant shall not assign the whole or any part of this Lease.

10.3 **Underlettings**

10.3.1 The Tenant shall not underlet the whole or part of the Premises prior to the Break Date.

10.3.2 The Tenant shall not underlet the whole or part of the Premises, except in accordance with the remainder of this clause 10.3 and clause 10.4 and then only with the consent of the Landlord, such consent not to be unreasonably withheld or delayed.

10.3.3 The Tenant shall not allow any undertenant to enter into occupation or possession of the whole or part of the underlet premises prior to completion of the underlease.

10.3.4 Any underlease shall contain a valid and enforceable agreement between the Tenant and the undertenant that sections 24 to 28 (inclusive) of the 1954 Act be excluded from the tenancy to be created by the underlease and the Tenant shall provide:

(a) a certified copy of the notice served on the undertenant, as required by section 38(A)(3)(a) of the 1954 Act, applying to the tenancy to be created by the underlease; and

(b) a certified copy of the declaration or statutory declaration made by the undertenant in accordance with the requirements of section 38(A)(3)(b) of the 1954 Act.

10.3.5 The Tenant shall not grant any underlease without first obtaining a covenant by the undertenant with the Landlord to comply with:

(a) the tenant covenants contained in this Lease, except in so far as they do not relate to the underlet premises and other than as to payment of any Rent or other sums reserved as rent by this Lease; and

(b) the tenant covenants to be contained in the underlease,

at all times when it is bound by the tenant covenants of the underlease.

10.3.6 The Tenant shall not grant any underlease without first obtaining a further covenant by the undertenant with the Landlord to:

(a) make an application to the Land Registry (the **Application**) to cancel any notice of the underlease and close any registered title of the underlease and cancel registration of any easements or rights granted or reserved by the underlease within one month of the end of the term of the underlease;

(b) ensure that any requisitions raised by the Land Registry in connection with the Application are dealt with promptly and properly; and

keep the Landlord informed of the progress and completion of the Application.

10.3.7 Not to underlet the whole or any part of the Premises to a proposed undertenant which is:

(a) debarred by any of the World Bank, Asian Development Bank, European Bank for Reconstruction and Development, Inter-American Development Bank, and/or African Development Bank or is under investigation to be debarred and/or cross-debarred by the same;

(b) is sanctioned by the World Bank or is under investigation to be sanctioned by the same;

(c) is on any United Kingdom, European Union, United Nations or Office of Foreign Assets Control sanctions lists;

(d) is subject to the mandatory or discretionary grounds set out in Regulation 23 of the Public Contract Regulations 2006; or

(e) dealing with funds or economic resources belonging to, or owned held or controlled by, a Designated Person.

10.4 **Terms to be contained in any underlease**

Any underlease shall be granted on terms which are consistent with and no more favourable to the underlessee than those contained in this Lease (insofar as they

relate to the underlet premises) and provide that any further underletting is prohibited; and

10.5 **Further provisions relating to underleases**

10.5.1 The Tenant shall enforce the tenant covenants contained in any underlease and not release any of them nor waive any breach of them.

10.5.2 The Tenant shall exercise its rights under the agreements made between it and the undertenant for the purposes of section 19(1A) of the Landlord and Tenant Act 1927.

10.5.3 The Tenant shall not vary the terms of any underlease without the prior approval of the Landlord (such approval not to be unreasonably withheld or delayed).

10.5.4 The Tenant shall not give or enter into any side letter or collateral agreement in respect of the terms of any underlease without the prior approval of the Landlord (such approval not to be unreasonably withheld or delayed).

10.6 **Charging**

The Tenant shall not charge or agree to charge any part of the Premises (as distinct from the whole) and shall not charge the whole of the Premises without the consent of the Landlord such consent not to be unreasonably withheld or delayed.

10.7 **Declarations of trust**

The Tenant shall not execute any declaration of trust of the whole or any part of its interest in the Premises or this Lease.

10.8 **Group sharing of occupation**

10.8.1 Nothing in this clause 10 shall prevent the Tenant from sharing occupation of the Premises or granting licences to use or agreements in connection with the Premises with:

(a) a Group Company (if and so long as that other member remains a member of the group); or

(b) service providers or third parties that are providing services to support the Tenant's main operations at the Premises (which for the avoidance of doubt includes the Qualifying Competition); and

(c) third parties using the Premises in accordance with the Permitted Use and clause 9.1.3

provided in all cases that no relationship of landlord and tenant subsists between the Tenant and that other party.

10.8.2 The Tenant must keep the Landlord informed of the identities of all occupiers and of the basis upon which they are occupying the Premises.

10.9 **Registration of dealings**

10.9.1 In this clause **Dealing** means any underlease, charge or any other dealing or devolution affecting this Lease or any interest deriving title under it.

10.9.2 No later than 20 Working Days after any dealing, the Tenant shall:

(a) give the Landlord written notice of the Dealing together with a certified copy of any document effecting or evidencing it (and a certified copy for any superior landlord); and

(b) pay the Landlord a reasonable registration fee of £50 and the registration fee of any superior landlord plus VAT thereon.

11 LEGAL REQUIREMENTS AND REGULATIONS

11.1 Legislation and planning

The Tenant shall:

11.1.1 comply with all legislation affecting the Premises, their use and occupation and the health and safety of persons working at or visiting the Premises, whether the legislation requires the owner, landlord, tenant or occupier to comply;

11.1.2 give the Landlord written notice of any defect in the Premises which may make the Landlord liable to do, or not to do, any act to comply with the duty of care imposed by the Defective Premises Act 1972, and shall display any notices at the Premises needed to enable the Landlord to comply with the Defective Premises Act 1972;

11.1.3 not apply for planning permission without the consent of the Landlord, whose consent shall not be unreasonably withheld or delayed, and shall pay any charge imposed under legislation relating to town and country planning in respect of the use of the Premises, or any works carried out at the Premises; and

11.1.4 at the end of the Term pay the Landlord a fair proportion of any compensation which the Tenant has received or which is receivable by the Tenant because of any restriction placed on the use of the Premises under any legislation.

11.2 Notices relating to the Premises

11.2.1 The Tenant shall give the Landlord a copy of any notice received by the Tenant, relating to the Premises or the Estate or any occupier of them,

or to the Landlord's interest in them, and take any steps which the Landlord may reasonably require in connection with such notice.

11.2.2 The Tenant shall not give any notice or counter-notice under the Party Wall etc. Act 1996 without the consent of the Landlord.

11.3 **Regulations**

The Tenant shall comply with any regulations concerning the Estate reasonably made by the Landlord and communicated to the Tenant in writing (to the extent there is any inconsistency or conflict between such regulations and the terms of this Lease the terms of this Lease will prevail).

12 COMMUNITY INFRASTRUCTURE LEVY

12.1 If any liability to pay CIL arises (whether before, during, or after the Term) in relation to any addition to or alteration or change of use of the Premises made by or at the request of the Tenant or its undertenants or licensees during the Term or as a result of any Tenant works, the Tenant shall:

12.1.1 assume liability for the CIL;

12.1.2 serve all notices and take all steps required by law to give effect to that assumption of liability and promptly provide to the Landlord reasonable evidence that it has done so;

12.1.3 not withdraw or transfer that assumption of liability; and

12.1.4 pay the CIL by the due date and indemnify the Landlord against any liability on the part of the Landlord to pay such CIL.

13 LANDLORD'S COVENANT FOR QUIET ENJOYMENT

The Landlord shall permit the Tenant to hold and use the Premises during the Term without any interruption (except as authorised by this Lease) by the Landlord or any person lawfully claiming under or in trust for the Landlord.

14 LANDLORD'S RELEASE ON ASSIGNMENT OF THE REVERSION

The obligations on the Landlord which are contained or implied in this Lease will not be binding on or enforceable against a person after that person has parted with the whole of its interest in the reversion.

15 FORFEITURE

15.1 Landlord's right of re-entry

If any event set out in clause 15.2 occurs, the Landlord may forfeit this Lease and re-enter the Premises. The Term will then end, but without prejudice to any claim which the Landlord may have against the Tenant for any failure to comply with the terms of this Lease save that the Landlord agrees that it will not seek to re-enter (other than

pursuant to clause 15.2.1 and only there for non-payment of the Rent) during the Qualifying Competition Period.

15.2 **Events giving rise to the Landlord's right of re-entry**

15.2.1 The rent or any other sum payable under this Lease remains unpaid 15 Working Days after it becomes due (whether in the case of Rent formally demanded or not).

15.2.2 The Tenant fails to materially comply with the terms of this Lease and (if capable of remedy) fails to remedy within a reasonable period (being in any event no longer than 6 months – unless the Tenant can demonstrate to the Landlord that it has been, and is, actively seeking to address the breach in which case a further period commensurate with the nature of the breach will be allowed by the Landlord acting reasonably) following written notice from the Landlord.

15.2.3 Where the Tenant is an individual:

(a) the presentation of a petition for a bankruptcy order against the Tenant, including an application by the Tenant to the adjudicator for a debtor led bankruptcy order;

(b) the application for an interim order against the Tenant under Part VIII of the Insolvency Act 1986;

(c) the making of a petition for a bankruptcy order against the Tenant; or

(d) the entering into of any composition, moratorium or other arrangement with the creditors of the Tenant whether or not in connection with any proceedings under the Insolvency Act 1986.

15.2.4 A receiver (including a receiver under section 101 of the Law of Property Act 1925) or manager or administrative receiver of the Tenant's property or income (or part of it) is appointed.

15.2.5 Where the Tenant is a body corporate (or if more than one body corporate then any one of them):

(a) the taking of any step in connection with any voluntary arrangement or any other compromise or arrangement for the benefit of any creditors of the Tenant;

(b) the making of an administration order in relation to the Tenant;

(c) the filing at court of the prescribed documents in connection with the appointment of an administrator, or the appointment of an administrator, in any case in relation to the Tenant;

(d) a resolution for a voluntary winding-up is passed or a meeting of creditors is called for the purpose of considering that there be a voluntary winding-up, in either case in relation to the Tenant and, in either case, other than a voluntary winding up whilst solvent for the purposes of and followed by a solvent reconstruction or amalgamation;

(e) the making of a petition for a winding-up order or the making of a winding-up order in respect of the Tenant;

(f) an application is made under Part 26 of the Companies Act 2006 or a proposal is made which could result in such an application in relation to the Tenant;

(g) the Tenant enters into any arrangement, moratorium or composition (other than any referred to above) with its creditors; or

(h) the Tenant is dissolved, or is removed from the Register of Companies, or ceases to exist (whether or not capable of reinstatement or reconstitution).

16 OBLIGATIONS IN SCHEDULES TO THIS LEASE

The Landlord and the Tenant mutually covenant to observe and perform their respective obligations and conditions in the schedules.

17 MISCELLANEOUS

17.1 Notices

17.1.1 Section 196 of the Law of Property Act 1925 shall apply to all notices served under this Lease but such provisions shall be extended so that any notice or demand in connection with this Lease may be sent by first class post or special or recorded delivery (or other "proof of delivery" or "proof of posting" service that Royal Mail may from time to time offer) and if so sent from within the UK and properly stamped and correctly addressed will be conclusively treated as having been delivered two Working Days after posting.

17.1.2 The Tenant shall give the Landlord both verbal and written notice of any matter affecting the Premises where emergency action is needed.

17.2 Landlord's rights to remedy default by the Tenant

If the Tenant fails to comply with any of its obligations in this Lease, the Landlord may give the Tenant written notice of that failure and the Tenant shall remedy the failure within the time specified by the Landlord. If the Tenant fails to do this, the Landlord may enter the Premises and carry out any works or do anything else which may be needed to remedy the Tenant's failure to comply with its obligations under this Lease,

and any costs incurred by the Landlord will be a debt due from the Tenant payable on demand and may be recovered by the Landlord as if it were additional rent.

17.3 **Tenant to provide information**

The Tenant shall give the Landlord any information or documents which the Landlord reasonably requests to show that the Tenant is complying with its obligations in this Lease and shall give the Landlord written notice of any matter in connection with the Premises which may make the Landlord liable to any third party.

17.4 **Tenant's indemnity**

The Tenant agrees to indemnify the Landlord at all times (both during and after the Term) against all liabilities, damages, costs and expenses arising from any breach of any of the Tenant's obligations in this Lease, or any act or omission of the Tenant provided that the Landlord shall:

(a) as soon as reasonably practicable give the Tenant written notice and full details of any claim;

(b) provide to the Tenant on reasonable request such reasonable information in relation to the claim;

(c) consider and have due regard to (but will not be bound by) written reasonable representations made by the Tenant relating to any claim;

(d) not settle or compromise any claim without the prior consent of the Tenant such consent not to be unreasonably withheld or delayed; and

(e) (at the Tenant's cost) the Landlord shall mitigate its liability to which this indemnity relates.

17.5 **Tenant's acknowledgement**

The Tenant acknowledges that it has not entered into this Lease in reliance on any representation made by or on behalf of the Landlord except any statements or representations expressly made by this Lease and any written replies to enquiries (which shall include email) given prior to the grant of this Lease by the Landlord's solicitors.

17.6 **Qualification of Landlord's liability**

The Landlord will not be liable to the Tenant or any other person for any failure to perform any obligation in this Lease unless the Landlord knows that it has failed to perform the obligation (or reasonably should have known) and has not remedied that failure within a reasonable time.

17.7 **Removal of goods after end of Term**

The Tenant shall remove all its fittings, goods and other possessions at the end of the Term and the Landlord may dispose of any such items left at the Premises more than 10 Working Days after the end of the Term as the Landlord sees fit.

17.8 **Application to the Land Registry to close registered title**

Within one month following the end of the Term, the Tenant shall:

17.8.1 make an application to the Land Registry (the "**Application**") to cancel any notice of the Lease and close the registered title of this Lease and cancel registration of any easements or rights granted or reserved by this Lease;

17.8.2 ensure that any requisitions raised by the Land Registry in connection with the Application are dealt with promptly and properly; and

17.8.3 keep the Landlord informed of the progress and completion of the Application.

18 SEVERABILITY

Each of the provisions of this Lease is separate and severable from the others. If at any time one or more of the provisions is or becomes illegal, invalid or unenforceable (whether wholly or to any extent), the legality, validity or enforceability of the remaining provisions (or the same provision to any other extent) will not be affected or impaired.

19 GOVERNING LAW AND JURISDICTION

19.1 This Lease and any dispute or claim arising out of or in connection with it or its subject matter or formation (including non-contractual disputes or claims) shall be governed by and construed in accordance with the law of England and Wales.

19.2 The parties to this Lease irrevocably agree that the courts of England and Wales shall have exclusive jurisdiction to settle any dispute or claim arising out of or in connection with this Lease or its subject matter or formation (including non-contractual disputes or claims).

20 CONTRACTS (RIGHTS OF THIRD PARTIES) ACT 1999

Unless expressly stated nothing in this Lease will create any rights in favour of any person pursuant to the Contracts (Rights of Third Parties) Act 1999.

21 EXCLUSION OF THE 1954 ACT

21.1 The Landlord and Tenant confirm that before the lease and the agreement for lease was entered into:

21.1.1 the Landlord served on the Tenant a notice (the **Notice**) dated in relation to the tenancy created by this lease in a form complying with Schedule 1 to the Regulatory Reform (Business Tenancies) (England and Wales) Order 2003 (the "**Order**"); and

21.1.2 a statutory declaration (the **Declaration**) dated complying with paragraph 8 of Schedule 2 to the Order was made by Mary Elizabeth Kelly whom the Tenant confirms was duly authorised by the Tenant to make the statutory declaration on its behalf.

21.2 The parties agree to exclude the provisions of sections 24 to 28 (inclusive) of the 1954 Act in relation to the tenancy created by this lease.

22 NEW OR OLD LEASE

This Lease is a new tenancy for the purposes of section 1 of the Landlord and Tenant (Covenants) Act 1995.

23 QUALIFYING COMPETITION

The Landlord hereby acknowledges and agrees that the overriding purpose for the Tenant entering into this Lease is for the purpose of the Qualifying Competition and further confirms that it will work with the Tenant and use all reasonable endeavours to minimise any impact or adverse effect to the Qualifying Competition, provided that where there is a conflict between this clause 23 and any other provision in this Lease, the Lease provision shall take precedence over this clause 23.

24 WAYLEAVES

The Landlord will at the Tenant's request and reasonable cost enter into such wayleave agreement or agreements with utility, telecoms providers and other suppliers as are required by the Tenant in connection with the Tenant's use of the Premises for the Qualifying Competition in such form agreed between the parties (in all cases as approved by the Tenant and the Landlord acting reasonably and without delay) but which shall in any event terminate at the expiry or sooner determination of this Lease subject to any rights which the operator may have under statutory protections.

IN WITNESS of which this deed has been duly executed and is delivered on the date written at the beginning of this deed.

SCHEDULE 1
RIGHTS GRANTED

2 The Landlord grants the following rights to the Tenant at all times and for all proper purposes 24 hours a day, 365 days a year (unless restricted to the Qualifying Competition Period as detailed below):

2.1 the right to use the Estate Roads for vehicular and pedestrian access and egress and deliveries and despatches to and from the Premises and to and from the Common Parts referred to in paragraphs 2.4 and 2.6;

2.2 the right to use the Service Media forming part of the Estate at the date of this deed which serve, but do not form part of, the Premises;

2.3 the right of support and protection from the rest of the Estate to the extent existing at the date of this Lease;

2.4 the non-exclusive right (on a first come basis) for the Tenant and the occupiers and other bona fide users of the Premises to use the car parking spaces as may be designated by the Landlord from time to time in the Estate Car Park for the parking of roadworthy private cars and/or motorbikes vehicles but only outside Usual Business Hours;

2.5 the right to have the Tenant's name displayed on the signboard(s) for the Estate in a form previously approved by the Landlord; and

2.6 During the Qualifying Competition Period only the exclusive right to use Gate 2 for vehicular exit and entry.

SCHEDULE 2
EXCEPTIONS AND RESERVATIONS

1 There are excepted and reserved from this Lease the following rights:

1.1 the right, even if it affects the passage of light and air to the Premises, to alter, extend, raise the height of the exterior of buildings or structures on the Estate, or erect any new buildings or structures on the Estate (or on any adjoining or nearby property of the Landlord) in such manner as the Landlord thinks fit, and it is hereby agreed that the enjoyment of light and air by the Tenant and the occupiers of the Premises is by consent provided that the Landlord shall comply with the following provisions:

(a) the Landlord shall provide the Tenant with at least two months' prior written notice of any such new building or structure works to the Estate, and one month's prior written notice of other such works to the Estate as contemplated by paragraph 1.1 and

(b) the parties shall work together (both acting reasonably) to agree a method statement for such works which shall include, amongst other things, details of how access to the Premises shall be maintained, the hours in which the works will be undertaken, and protection provisions for the continued use and enjoyment of the Premises during those works and in particular the Landlord shall use all reasonable endeavours to minimise; any impact on the Tenant's use and occupation of the Premises, any interference or nuisance to the Qualifying Competition, and noise, dust and vibration affecting the Premises at all times during the Qualifying Competition

and if the method statement has not been agreed within three months of the Landlord providing a first draft statement, the matter shall be referred to alternative dispute resolution

1.2 the right to Utilities from and to the Estate through the Service Media which are now or may during the Term be at the Premises;

1.3 subject to compliance with the Entry Safeguards, the right to enter the Premises to maintain and connect into the Services Media at the Premises and to construct Service Media at the Premises for the provision of Utilities from and to the remainder of the Estate;

1.4 subject to compliance with the Entry Safeguards, the right to enter the Premises to view the condition of the Service Media and to carry out works to the Service Media;

1.5 subject to compliance with the Entry Safeguards, the right to erect scaffolding for repairing, altering, decorating or cleaning any neighbouring building on the Estate or other neighbouring property of the Landlord;

1.6 the right of support and protection from the Premises for the rest of the Estate; and

1.7 the right to enter the Premises to exercise any other right excepted and reserved to the Landlord by this Lease, or for any other reasonable purpose connected with this Lease or with the Landlord's interest in the Premises or any adjoining property of the Landlord.

1.8 the right to use at all times and for all purposes the roadways pavements and other open areas on the Premises for vehicular and pedestrian access and egress and deliveries and despatches to and from any adjoining property of the Landlord and to and from the Common Parts.

SCHEDULE 3
INSURANCE PROVISIONS

1 TENANT'S OBLIGATIONS RELATING TO INSURANCE

The Tenant shall:

1.1 pay the Insurance Rent in accordance with this Lease;

1.2 comply with the requirements of the insurers relating to the Premises (subject to such requirements being provided to the Tenant) and not do or omit to do anything which would make any insurance of the Premises, the Estate or of any adjoining property of the Landlord taken out by the Landlord or any superior landlord void or voidable, or which would result in an increase in the premiums for such insurance;

1.3 give the Landlord written notice as soon as reasonably practicable of any damage to or destruction of the Premises by an Insured Risk;

1.4 pay the Landlord on demand a sum equal to any amount which the insurers refuse to pay following damage or destruction by an Insured Risk to any part of the Premises, the Estate or any adjoining property of the Landlord because of any act or omission of the Tenant;

1.5 pay the Landlord on demand a fair proportion of any amount that is deducted or disallowed by the insurers pursuant to any excess provision in the insurance policy;

1.6 meet any reasonable additional insurance or other reasonable costs properly incurred by the Landlord if the Tenant declines to comply with any reasonable recommendations of the fire authority and/or any reasonable requirements of the Landlord in relation to the security of the Premises and the Estate;

1.7 not take out any buildings insurance of the Premises against the Insured Risks in its own name other than in respect of any part of the Premises installed by or on behalf of the Tenant or any undertenant, and if the Tenant has the benefit of any such insurance then the Tenant shall hold all money receivable under that insurance upon trust for the Landlord; and

1.8 if requested by the Landlord, remove its fixtures and effects from the Premises to allow the Landlord to repair or reinstate the Premises following damage or destruction by an Insured Risk.

2 LANDLORD'S OBLIGATION TO INSURE

2.1 Subject to paragraph 2.2 the Landlord shall insure the Premises, other than any part of the Premises installed by the Tenant or any other occupier, and the Common Parts for their full reinstatement cost against the Insured Risks through a reputable insurer chosen by the Landlord.

2.2 The Landlord's obligation to insure is subject to:

2.2.1 any Policy Exclusions; and

2.2.2 insurance being available in the London insurance market at economic rates and on terms which in the Landlord's reasonable discretion are acceptable.

2.3 The Landlord shall as soon as reasonably practicable notify the Tenant of any material change to the risks covered by the insurance policy or the terms of the insurance policy from time to time.

2.4 The Landlord shall notify the Tenant of any material changes to exclusions, excesses, limitations, and terms and conditions of the insurance policy as soon as reasonably practicable after each renewal of such insurance policy.

2.5 At the request of the Tenant (not more than once in any year) the Landlord shall produce to the Tenant reasonable evidence of the terms of the insurance policies which the Landlord is obliged to place pursuant to this Lease and the fact that the policies are subsisting and in effect and the Landlord has paid the premium.

2.6 The Landlord shall procure that the Tenant's interest in the Premises is noted either specifically or generally on the policy; and the policy contains a waiver of rights of subrogation against the Tenant or persons occupying or enjoying use of the Premises and contains a non-invalidation clauses providing that the insurance policies shall not be avoided by any act or omission, or by any alteration by which the risk of destruction or damage is increased, unknown to, or beyond the control of, the Landlord.

3 REINSTATEMENT FOLLOWING INSURED DAMAGE

If the Estate or the means of access to it or any part thereof shall be damaged or destroyed by any of the Insured Risks so as to render the Premises unfit for use and occupation or inaccessible, then:

3.1 unless payment of any insurance moneys is refused because of any act or omission of the Tenant and the Tenant has failed to comply with paragraph 1.4; and

3.2 subject to the Landlord being able to obtain any necessary consents (and the Landlord shall be obliged to use all reasonable endeavours to obtain such consents) and to the necessary labour and materials being and remaining available,

the Landlord shall use the insurance moneys it receives, except moneys received for loss of rent, in repairing and reinstating the parts of the Premises and/or the means of access to them it is damaged or destroyed substantially as they were prior to any such damage or destruction (other than any part which the Landlord is not obliged to insure) or in building reasonably comparable premises as soon as reasonably practicable and the Landlord shall make any good any shortfall from its own proceeds.

4 SUSPENSION OF RENT

4.1 If the Estate or the means of access to the Premises are damaged or destroyed by an Insured Risk so as to make the Premises unfit for occupation and use or inaccessible,

then the Rent (or a due proportion of it determined by the Landlord according to the nature and extent of the damage) will be suspended from the date of damage or destruction for a period of three years, or, if sooner, until the Premises have been made fit for occupation and use and accessible.

4.2 The Rent will not be suspended to the extent that any loss of rent insurance has been made ineffective, or payment of it has been refused by the insurers because of any act or omission by the Tenant.

5 INSURANCE MONIES

All insurance monies payable will belong to the Landlord.

6 REINSTATEMENT PREVENTED AND DETERMINATION

6.1 If at the date which is three years from the date of damage or destruction the destruction or damage by an Insured Risk to the Estate or the means of access to them have not been substantially made good and the Premises remain unfit for occupation and use or inaccessible, the Landlord or the Tenant may, by written notice to the other, given at any time within six months after such date and whilst the Premises remain unfit for occupation and use or inaccessible, determine the Term with immediate effect.

7 UNINSURED DAMAGE

7.1 If there is Uninsured Damage:

7.1.1 paragraph 4 shall apply as if there had been Insured Damage; and

7.1.2 the Landlord may, by service of notice in writing (an **Election Notice**) on the Tenant following the date on which Uninsured Damage occurs, elect to reinstate or rebuild the Premises and the means of access to them.

7.2 If the Landlord serves an Election Notice:

7.2.1 the Landlord shall, subject to being able to obtain any necessary consents and to the necessary labour and materials being and remaining available, reinstate or rebuild the Premises and the means of access to them substantially as they were prior to the Uninsured Damage (other than any part which the Landlord is not obliged to insure) as soon as reasonably practicable; and

7.2.2 if at the third anniversary of the date of the Election Notice all Uninsured Damage to the Premises and the means of access to them has not been substantially made good and the Premises remain substantially unfit for occupation and use or inaccessible, the Landlord or the Tenant may, by written notice to the other given at any time within six months after such date and whilst the Premises remain unfit for occupation and use or inaccessible, determine the Term with immediate effect.

7.3 If the Landlord has not served an Election Notice within 12 months following the date on which the Uninsured Damage occurred (time being of the essence) in accordance with paragraph 7.1.2, either the Landlord or the Tenant may at any time thereafter (unless in the meantime the Landlord serves an Election Notice) determine this Lease with immediate effect.

8 DETERMINATION WITHOUT PREJUDICE TO CLAIMS

Any determination of the Term under paragraphs 6 or 7 will be without prejudice to any claim in respect of any antecedent breach of the obligations under this Lease.

SCHEDULE 4
RENT REVIEW PROVISIONS

1 DEFINED TERMS

This Schedule 4 uses the following terms:

Base Figure	(a) on the first Review Date, the Index figure for the month fourteen months preceding the first Review Date (b) on each succeeding Review Date, the Current Figure for the preceding Review Date
Current Figure	the Index figure for the month two months preceding the Review Date
Index	the "all items" figure of the Index of Consumer Prices published by the Office for National Statistics or any successor Ministry, Department or Government Agency
Indexed Rent	the rent determined in accordance with paragraph 2.1
Maximum Rent	103% of the Annual Rent payable immediately before a Review Date
Minimum Rent	101% of the Annual Rent payable immediately before a Review Date
Revised Rent	the rent determined in accordance with paragraph 2.2

2 RENT REVIEW

2.1 On each Review Date, the Annual Rent is to be reviewed to the Indexed Rent being the higher of:

2.1.1 the Annual Rent reserved by this Lease immediately before that Review Date; and

2.1.2 the revised Annual Rent (rounded up to the nearest £10) calculated in accordance with the following formula:

$$R = A \times \frac{C}{B}$$

Where:

R is the revised Annual Rent;

A is the Annual Rent reserved immediately before the relevant review date;

C is the Current Figure; and

B is the Base Figure.

2.2 The Revised Rent at a Review Date shall be the Indexed Rent unless:

(a) the Indexed Rent is less than the Minimum Rent, in which case the Revised Rent shall be the Minimum Rent; or

(b) the Indexed Rent is greater than the Maximum Rent, in which case the Revised Rent shall be the Maximum Rent.

3 NOTICE OF ANNUAL RENT

If the Annual Rent is increased, the Landlord must notify the Tenant in writing promptly after the Review Date.

4 EFFECT OF DELAY IN NOTIFYING THE REVISED RENT

4.1 Following any Review Date until the Landlord has notified the Tenant of the Revised Rent:

4.1.1 the Annual Rent payable under this Lease immediately before that Review Date will continue to be payable until the Revised Rent has been notified to the Tenant;

4.1.2 following the notification of the Revised Rent, the Landlord will demand in writing the difference (if any) between the amount the Tenant has actually paid and the amount that would have been payable had the Revised Rent been notified before the Review Date; and

4.1.3 the Tenant must pay that difference to the Landlord within 10 Working Days after that written demand and interest at three per cent below the Interest Rate calculated on a daily basis on each instalment of that difference from the date on which such instalment would have become payable to the date of payment. If not paid such sums will be treated as rent in arrear.

5 CHANGES IN THE INDEX

5.1 If the Index is no longer published or if there is any material change in the way it is compiled or the date from which it commences then a new arrangement for indexation or a rebasing (the "Revised Indexation") will be substituted for the calculation of the Annual Rent to reflect increases in the cost of living on a similar basis to that originally set out in this Lease.

5.2 If the parties are unable to agree a basis for the Revised Indexation then either of them may at any time request that the President of the Institute of Chartered Accountants in England and Wales appoints an arbitrator to do so. The arbitration must be conducted in accordance with the Arbitration Act 1996.

6 TIME NOT OF THE ESSENCE

For the purpose of this Schedule 4 time is not of the essence.

SCHEDULE 5
SERVICES AND THE SERVICE CHARGE

1 DEFINITIONS

In this schedule the following definitions apply:

Certificate — a statement certified by the Landlord's Surveyor or its accountant, which shows the Service Charge Estimate, the Landlord's Expenses, the Service Charge and the Service Charge Balance for the relevant Service Charge Year;

Landlord's Expenses — the costs (including any VAT charged on such costs to the extent that the Landlord is not able to obtain a credit for such VAT from HM Revenue & Customs) incurred or provided for by or on behalf of the Landlord in connection with the provision of the Services and of all or any of the following items:

(a) inspecting, altering, renewing, rebuilding and replacing where necessary the Common Parts;

(b) providing, operating, inspecting, maintaining, cleaning, repairing and replacing Service Media (other than Service Media which form part of the Premises);

(c) removing any obstruction on the Common Parts;

(d) providing, operating, inspecting, insuring and maintaining, repairing and replacing any equipment, plant and machinery and other materials which are used in providing the matters listed in this definition;

(e) fuel and Utilities used in providing the matters listed in this definition;

(f) maintenance and other contracts entered into for the provision of

the matters listed in this definition;

(g) providing, maintaining, repairing, cleaning and, when reasonably necessary, replacing signage for the Common Parts;

(h) providing, maintaining, repairing, cleaning and, when reasonably necessary, replacing a signboard showing the names and logos of the tenants and other authorised occupiers at the entrance to the Estate;

(i) operating car parking areas for occupiers of the Estate and their visitors;

(j) maintaining the landscaped and grassed areas of the Common Parts;

(k) providing, maintaining and, when reasonably necessary, replacing or altering such security systems for the benefit of the whole (or substantially the whole) of the Estate which the Landlord (in the interests of good estate management) reasonably considers appropriate and which may include the provision of alarms, closed circuit television, barriers and other equipment, and security guards and patrols (whether employed by the Landlord or engaged as contractors);

(l) employing or arranging for the employment (and the termination of employment) of staff in connection with the provision of

the matters listed in this definition, including the costs of insurance, pension and welfare contributions, and the provision of clothing, tools and equipment and the provision of residential and other accommodation and a notional rent for that accommodation reasonably determined by the Landlord incurred in connection with such employment;

(m) all present and future rates, taxes, duties, levies, costs, charges, assessments and other impositions (of whatever nature) charged on or payable in respect of the Common Parts or the Estate as a whole and their use and occupation and any works carried out there;

(n) any costs, charges or other expenses incurred in securing statutory compliance in relation to or in connection with the Common Parts or the Estate as a whole;

(o) complying with or, where the Landlord reasonably considers it appropriate, contesting the requirements or proposals of the local or any other competent authority in respect of the Common Parts or the Estate as a whole;

(p) complying with the matters referred to in clause 5.1 in so far as they relate to the Common Parts or the Estate as a whole;

(q) abating any nuisance to the Estate;

(r) leasing any item used in providing the matters listed in this definition;

(s) the fees of managing agents retained by the Landlord for the management of the Estate, the provision of the matters listed in this definition and the collection of all rents and service charges (including the Rent, the Service Charge Estimate and the Service Charge Balance) due from the Tenant and the other occupiers of the Estate (or where any of those tasks is carried out by the Landlord a reasonable charge of the Landlord for that task), but not any such costs arising by reason of those rents or service charges being in arrears;

(t) preparing the Certificate (whether by the Landlord or the Landlord's Surveyor or its accountants); and

(u) any other works, services or facilities which the Landlord from time to time reasonably considers desirable for the purpose of maintaining, improving or modernising the services or facilities in or for the Estate, and which are for the general benefit of all, or substantially all, of the occupiers of the Estate and are in accordance with the principles of good estate management,

but excluding any cost which the Landlord recovers under any other clause, or from any insurance taken out by the Landlord where the Tenant is obliged to refund the Landlord the whole or any part of the premium;

Service Charge Balance	the shortfall, if any, between the Service Charge Estimate and the Service Charge;
Service Charge Commencement Date	the first day of the Term;
Service Charge Year	the year from and including 1 March in each year or such other date which the Landlord chooses from time to time;
Services	(a) maintaining, repairing, decorating (where applicable), treating, lighting and cleaning the Common Parts; (b) security at the main vehicular gate to the Estate not less than 7am to 7pm every day; and (c) any of the other items referred to in the definition of Landlord's Expenses which the Landlord in its discretion, acting in accordance with the principles of good estate management and from time to time, provides for the benefit of the tenants and occupiers of the Estate.

2 LANDLORD'S OBLIGATIONS

2.1 The Landlord shall provide the Services in a manner which is consistent with good estate management for the Estate.

2.2 The Landlord will have no liability for any failure or interruption of any Service:

2.2.1 during the proper inspection, maintenance, repair or replacement of any relevant Service Media or equipment;

2.2.2 resulting from a shortage of fuel, water, materials or labour; or

2.2.3 resulting from a breakdown of any equipment used in connection with the provision of the Services,

or for any other reason beyond the reasonable control of the Landlord provided that the Landlord shall be required to use all reasonable endeavours to ensure that the failure or interruption is for as short as time as possible and provided further that the

Landlord shall take reasonable steps and action to ensure there is no interruption to the Services during the Qualifying Competition Period provided that this shall not include matters which are reasonably outside the Landlord's control.

2.3 The Landlord shall produce the Certificate to the Tenant as soon as practicable (but in any event within 4 months) after the end of the Service Charge Year.

2.4 The Landlord shall, but at the cost of the Tenant, allow the Tenant to inspect any invoices and receipts for the Services as long as the Tenant has given the Landlord reasonable written notice or at the Landlord's option supply copies of any invoices and receipts for the Services within a reasonable time of the Tenant's written request for such copies.

2.5 If any lettable unit on the Estate is unlet for any period, the Landlord shall bear a fair proportion of the Landlord's Expenses in respect of that lettable unit but otherwise the intention is for all of the Landlord's Expenses incurred in accordance with these provisions to be recoverable from the occupiers on the Estate.

3 TENANT'S OBLIGATIONS

3.1 The Tenant shall pay:

3.1.1 the Service Charge Estimate and any VAT on it in four equal instalments in advance on the Quarter Days, the first payment being a proportionate amount for the period from and including the Service Charge Commencement Date until the next Quarter Day; and

3.1.2 the Service Charge Balance and any VAT on it on demand (whether such demand is received before or after the end of the Term).

3.2 If the Service Charge Commencement Date does not coincide with the beginning of a Service Charge Year, the Service Charge due from the Tenant for the part of that Service Charge Year which is within the Term will be reduced by the proportion which the part of that Service Charge Year which is before the beginning of the Term bears to one year, and the Service Charge Estimate for that part of that Service Charge Year will be adjusted accordingly.

3.3 If the end of the Term does not coincide with the end of a Service Charge Year, the Service Charge due from the Tenant for the part of that Service Charge Year which is within the Term will be reduced by the proportion which the part of that Service Charge Year which is after the end of the Term bears to one year.

3.4 It is hereby agreed that the end of the Term (for whatever reason) shall not prejudice the Landlord's entitlement to demand nor the Tenant's liability to pay the Service Charge Balance for the Service Charge Year then current, apportioned in accordance with paragraph 3.3.

3.5 If the Tenant requests a variation or addition to the Services and if the Landlord agrees to such change (at its discretion) the Tenant shall bear the full associated

costs and expenses save where the other occupiers of the Estate benefit from (and are obliged to contribute toward) the change.

4 ESTIMATING AND REVISING THE SERVICE CHARGE

4.1 The Landlord shall give the Tenant a statement of the Service Charge Estimate for each Service Charge Year at least one month before the beginning of each Service Charge Year. Until the statement has been given, the Service Charge Estimate shall be payable at the rate of the Service Charge Estimate for the previous Service Charge Year. Once the statement has been given, the remaining instalments of the Service Charge Estimate and any VAT on them will be adjusted so as to provide for the whole Service Charge Estimate for that Service Charge Year to be paid during that year.

4.2 If, during a Service Charge Year, the Landlord reasonably expects the Landlord's Expenses to increase materially above its previous estimate of the Landlord's Expenses for that Service Charge Year, the Landlord may revise its estimate of the Landlord's Expenses and the Service Charge Estimate will be based on that revised estimate and the remaining instalments of the Service Charge Estimate adjusted so that the revised Service Charge Estimate will have been paid by the end of that Service Charge Year. The Landlord may revise the Service Charge Estimate more than once in a Service Charge Year.

5 OMISSIONS

Any omission by the Landlord to include in the Certificate any sum or liability incurred in that Service Charge Year will not preclude the Landlord from including such sum or the amount of such liability in a Certificate for next Service Charge Year as the Landlord shall determine.

6 GENERAL PROVISIONS

6.1 In the absence of manifest error, the Certificate will be conclusive as to the amount of the Service Charge.

6.2 The Landlord shall notify the Tenant in writing of any change in the date of the beginning of the Service Charge Year.

6.3 If the Service Charge for any Service Charge Year is less than the Service Charge Estimate (as and if revised), the balance will be credited against the instalments of the Service Charge Estimate due from the Tenant in the following Service Charge Year, or, at the end of the Term, set off against any sums due from the Tenant to the Landlord with any balance being repaid to the Tenant.

6.4 The Landlord's Expenses for the Service Charge Year in which the beginning of the Term falls may include costs incurred by or provided for or on behalf of the Landlord before the beginning of the Term so far as they relate to Services which are to be provided during the Term. The Landlord's Expenses in any Service Charge Year may include provisions for expenses to be made after the end of the Term so far as such

provisions are reasonable having regard to the Services which are provided during the Term.

6.5 Where there is reference to costs or fees, the Landlord will endeavour to ensure that such costs or fees are reasonable and proper (but not necessarily the cheapest).

6.6 In this Schedule 5 references to "replace" shall mean only where beyond economic repair.

6.7 The Landlord will take into consideration the administrative, accounting, procurement, management and operational provisions of the Service Charge Code.

6.8 If any dispute arises in connection with the Service Charge, the Landlord and the Tenant must attempt to resolve it by appropriate alternative means and in event that the parties are unable to resolve it either party shall be entitled to refer such dispute to alternative dispute resolution.

6.9 Except in relation to obvious errors, the Tenant must not raise any dispute in connection with the Service Charge Statement more than four months after the Service Charge Statement has been delivered to the Tenant.

6.10 The Tenant shall be permitted to make representations to the Landlord about any disrepair or lack of fitness of the Common Parts in the period leading up to the Qualifying Competition Period and the Landlord shall have due regard to such representations.

6.11 There shall be excluded from the Landlord's Expenses:

(a) any costs, liabilities or expenses properly attributable to any lettable parts of the Estate which are for the time being unlet;

(b) any expenditure, costs or fees that are specified in this Lease as being at the cost or expense of the Landlord;

(c) any expenditure, costs or fees incurred as a result of a breach by the Landlord of this Lease, or as a result of any breach by the Landlord of any statute or requirement of any competent authority;

(d) any cost which shall have already been included under any other head of expenditure, to the intent that no expenditure, fees or expenses shall be charged under more than one head;

(e) costs of administering applications for consent to assign, sublet or alter by tenants or occupiers of the Estate;

(f) costs for which the Tenant or other tenants or occupiers of the Estate are individually responsible under the terms of their tenancy (or other arrangement by which they use or occupy the Estate) and relate to matters they exclusively enjoy;

(g) capital costs of the construction, redevelopment or extension of the any building on the Estate;

(h) costs of upgrading, innovation or improvement resulting from any renewal, rebuilding or replacement, but this will not prevent the Landlord including costs where they arise:

(i) from advances in technology or quality or specification from that which was previously there;

(ii) where an item is to be renewed, rebuilt, or replaced by way of repair and the replacement is broadly the modern day or up-to-date equivalent of what was there previously;

(iii) where the renewal, rebuild, or replacement is in the Landlord's reasonable opinion more economical than repair (and the Landlord is entitled to take into consideration the medium/long-term benefits of replacement);

(iv) where an item has to be replaced, renewed or rebuilt to comply with regulatory requirements;

(v) where replacement, rebuild, or renewal is reasonable and cost-effective;

(vi) where replacement, rebuild or renewal will reduce operating costs for the benefit of the tenants of the Estate, or

(vii) from a requirement of the insurers or a requirement of any act of Parliament and any delegated law made under it;

(i) costs incurred in respect of the collection of rents or enforcing covenants for the payment of rent;

(j) costs due from another tenant of the Estate that are not recovered;

(k) any special concession, service charge cap or weighting provision granted to any other tenant or occupier of any part of the Estate;

(l) costs attributable to any sinking or reserve fund (or similar fund);

(m) any management fee exceeding 10% of the Landlord's Expenses;

(n) any costs which solely benefit the other buildings on the Estate known as the Grange and the Cottages;

(o) chancel repair costs; and

(p) any sums due pursuant to rent charges registered in the charges registers of title numbers 139884, 239100 and 396768.

The **COMMON SEAL** of **THE GOVERNOR AND COMPANY OF THE BANK OF ENGLAND** was affixed to this **DEED** in the presence of:)
)
)

The Common Seal of The Governor and Company of The Bank of England

.....

Authorised signatory

.....

Authorised signatory

EXECUTED as a **DEED** by **THE ALL ENGLAND LAWN TENNIS GROUND plc** acting by a director in the presence of:)
)
)
)

.....

Director

Witness's signature: .....

Witness's name: .....

Address: .....

Occupation: .....

ANNEXURE 1
LEASE PLAN



NORTH

0 100m

KEY:


Lease Demise

Title: Lease Demise
Date 23 06 2021

ANNEXURE 2
SURVEY REPORT

LIGHTHOUSE REPORT

TITLE	Building Survey Report
AT	Bank of England Sports Centre, Priory Lane London SW15 5JQ
REPORT DATE	23rd August 2019
REPORT NO.	01

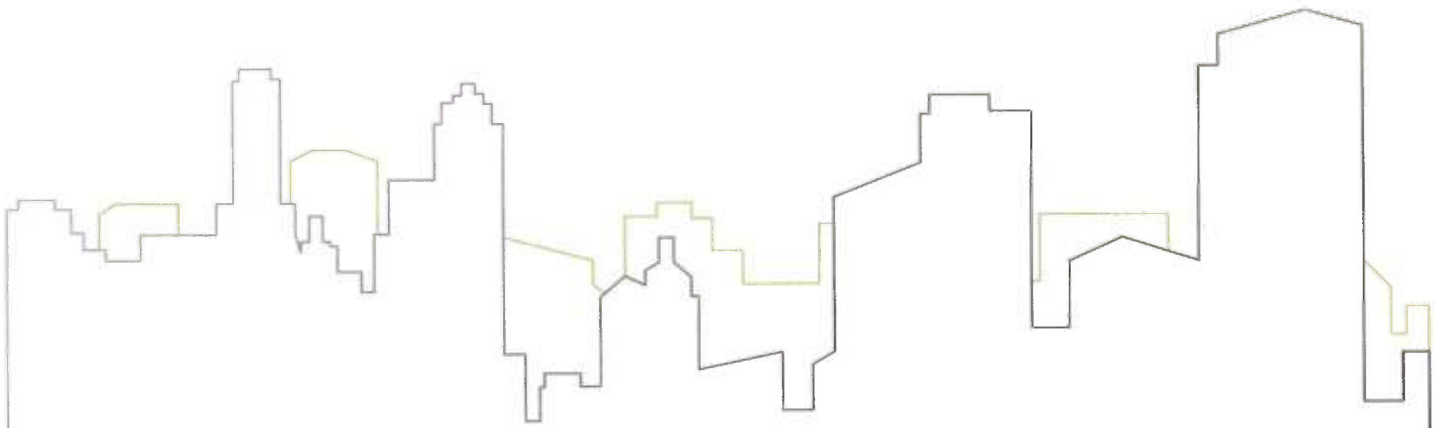

Registered Office | The Old Church, Quicks Road, London SW19 1EX. Registered in England and Wales. Registration No.7576812

RICS

Project preface

Client name:	Bank of England Sports Centre
	C/o Gerald Eve LLP
Client address:	72 Welbeck Street,
	London
	W1G 0AY

Prepared at:	Lighthouse Surveyors Ltd
	The Old Church
	Quicks Road
	London
	SW19 1EX
Document prepared by:	Spencer Carroll BSc. Hons MRICS

Job reference:	1903

Reviewed by:	Edward Turner BSc. Hons MRICS

Identification photographs



The Grange



Squash Courts



Sports Hall and swimming pool



Permanent marquee



Pavilion



1 and 2 Bank Lane Cottages



Priory Lane Cottage

Executive summary

The table below sets out our principal findings and comments. For ease, the following colour coded identification flag has been utilised to draw attention to important comments:

1	Serious or critical issue; requires action or resolution prior to completion.
2	Important issue; may not require action or resolution prior to completion.
3	Information only, no action required or routine maintenance or repair.
	Health and safety issue requiring urgent attention
?	Information or further investigation required

The Bank of England Sports Centre (the subject of this report) comprises a 32 acre site that was acquired by the Bank of England in 1908 for the purpose of a paper records storage and private sport and leisure facility. The use of the site now extends to ancillary office, training, fitness, crèche, bar and restaurant areas and generally includes the following principal buildings which we have been asked to inspect:

- Pavilion (clubhouse) and attached permanent marquee;
- Sports hall and swimming pool;
- Squash Courts;
- The Grange (Records Centre);
- Bank Lane cottages;
- Priory Lane cottage.

The site and buildings present themselves with a significant immediate – short term backlog maintenance burden as follows:

Pavilion (clubhouse)	£4,180,000.00
Permanent marquee	£15,000.00
Sports hall and swimming pool	£4,665,000.00
Squash Courts	£477,000.00
The Grange (Records Centre)	£3,795,000.00
Bank Lane cottages	£176,000.00
Priory Lane cottage	£242,000.00
External works	£300,000.00
TOTAL	**£13,850,000.00**

See section 7 for detailed cost exclusions.

At the same time the group of buildings appears to have received very little capital investment over the intervening years with the exception of The Grange which is now mostly tenanted and the Bank Lane cottages.

Any acquisition and investment programme will require a detailed and co-ordinated approach to its procurement and delivery. This building condition and high level cost report must not be considered as a substitute for any option appraisal or feasibility study.

We strongly recommend you appoint the relevant suitably experienced and qualified specialists to undertake the additional technical due diligence advised in this report.

We recognise that your decision to proceed with this acquisition is dependent on professional advice from a number of sources and not just our comments alone. From a building surveyor's viewpoint, with the exception of our comments above, we have no reason to caution you against proceeding with the transaction proposed, but you should do so having first considered carefully, and reflected on, all the comments, recommendations and suggested action points in this report.

The following table summarises our key findings:

1	Risk of potential concrete frame corrosion and failure to Sports Hall and further investigative work required.
1	Risk of potential embedded steel frame corrosion and failure to The Grange and further investigative work required.
1	Obtain fire risk assessment for the site.
1	Obtain asbestos register for the site.
1	The overall condition of the site and buildings is now generally quite poor and unmodernised. Major capital programmes of replacement door, window, roof covering, cladding, M&E and internal fit out work are now required to all buildings.
1	Priory Lane Cottage is derelict and requires modernisation.
1	The west boundary and fields adjacent to the Beverly Brook is at risk of flooding.
1	This building condition and high level costings report must not be considered as a substitute for an option appraisal or feasibility study.
1	Additional recommended technical due diligence not include within the scope of this report is -, structural engineering, lead paint, vermin, bats, woodwool slabs, basement water proofing, DDA Access audit, environmental / geotechnical, topographical / measured survey, EPC, CCTV drainage, sports equipment, sports surfacing, swimming pool /spa, cladding and utilities searches / investigations.
?	This report has not made an assessment of any likely dilapidations dispute (whether by the landlord or the tenant) that has or may arise to currently occupied and tenanted areas and in particular to the Grange Building. We have not been asked to provide any landlord and tenant / dilapidations advice as part of our service.
2	Boundary security is generally quite poor and in need of repair. The open boundary at the junction with the adjacent (separately demised Lawn Tennis Association) is a security risk.
3	Extensive opportunity presents itself for the introduction of low carbon technologies, enhanced thermal insulation and increased site biodiversity and particularly so when the above backlog maintenance and capital improvement work is undertaken.
1	Carry out an audit to ensure that all building regulation and planning approval certification is in place and particularly with reference to the marquee structure.

2	The sloping nature of the site means that many areas are graded or terraced with earth retaining walls. Many of these walls and structurers are built to a budget standard and now require extensive repair, the cumulative cost of which will be high.
3	A number of mature trees across the site (and adjacent to buildings) present an enhanced risk of tree root related damage.
2	Consideration should be given to establishing the precise size, location, capacity and suitability for separation, modification and sub metering of all utilities.
3	The marquee is generally in an acceptable condition and appears sufficient for it purpose presently. For the avoidance of doubt however this marquee can only be deemed a temporary solution over the next 5-10 years for providing such accommodation.
?	Make legal enquires to establish any history, severity (and cost of repair) associated with subsidence, flooding (river, surface and ground water), insect attack, dampness (rising or penetrating), nickel sulphide inclusion and vermin along with all other matters flagged up in this report.
1	Principal basement areas to the Pavilion, Sports Centre and the Grange all exhibit signs of penetrating dampness and in the worst case (of the Sports centre) flooding. Ongoing expenditure to repair and mitigate the risk of water ingress to basements will be necessary. Penetrating dampness will (and may already) ultimately result in failure of the basement structure and interior fabric over time.
?	The grange appears to have undergone extensive internal fit out and refurbishment work in the past. You should make enquires as to the extent of any work undertaken and the availability of record drawings and statutory approvals.

N.B. The above summary highlights the main points only of this report. We advise you read this report in full for a detailed understanding of our findings, opinions and advice.

Table of contents

Project preface i

Identification photographs ii

Executive summary iii

1 Introduction 3

1.1 Instructions and brief 3
1.2 Site inspection 3
1.3 Identification and Terminology 3

2 General description of property 5

2.1 Generally 5
2.2 External fabric 7
2.3 Internal fabric 11
2.4 Land and Boundaries 12

3 General condition of property 14

3.1 Structural condition 14
3.2 Condition of External Fabric 15
3.3 Condition of Internal Fabric 18
3.4 Comments on Land and Boundaries 20

4 Sustainability 21

4.1 Environmental labelling and management 21
4.2 Climate and climate change 21
4.3 Energy performance 21
4.4 Biodiversity, landscaping and visual aspects 22
4.5 Land use and contamination 22
4.6 Flooding risk 22
4.7 Mining subsidence, erosion or similar hazards 23
4.8 Noise, pollution and disturbance 23
4.9 Crime and security 23
4.10 Trees and invasive vegetation 23
4.11 Radon and radiation in various forms 25
4.12 Vermin and protected species 26
4.13 Building regulations, planning and cultural heritage 26
4.14 Health, safety and wellbeing 27
4.15 Travel 28

Table of contents

	4.16	Fire precautions and means of escape	28
	4.17	Social inclusion (disability)	29
	4.18	Use of materials	29
5	**Problematic materials**		**30**
6	**Legal and technical issues**		**32**
	6.1	Legal Interest	32
	6.2	Enquiries of the legal team	32
	6.3	Technical enquiries	32
	6.4	Review of documents	33
7	**Approximate costings**		**34**
8	**Conclusion**		**36**

Appendices

1. **Lighthouse fee and service proposal of 25th July 2019, terms and conditions of business and limitations applying to our professional service proposal.**
2. **Photographs**
3. **Available Plans**
4. **Mechanical and electrical services report**

1 Introduction

1.1 Instructions and brief

We refer to our fee and service proposal of 25th July 2019 (and attached in Appendix 1) to carry out a vendor's survey (building fabric and mechanical and electrical services) of the Bank of England Sports Centre and comprising the following buildings which we have been asked to inspect:

- Pavilion and attached now permanent marquee;
- Sports hall and swimming pool;
- Squash Courts;
- The Grange;
- 1 & 2 Bank Lane cottages;
- Priory Lane cottage.

We refer to Emily Greenway's (of Gerald Eve on behalf of the Bank of England) email instruction on the 26th July 2019 to proceed with the above survey.

Appendix 3 drawings most usefully indicate the general extent and a layout (in part) of the above buildings. We are advised that these drawings (and any areas or dimensions given) are not an up-to-date or complete set and must not be relied upon for any measurement or layout purposes whatsoever.

Our scope of service and the brief excluded the vehicle and tool stores located close to the west boundary of the site.

We are also advised that the north east quadrant of the site is currently occupied by the Lawn Tennis Association (LTA). All land and buildings associated with the LTA are excluded from this survey report.

1.2 Site inspection

The survey was undertaken by Spencer Carroll BSc. Hons MRICS of Lighthouse Surveyors Ltd (building fabric) and Ian Andrews of Troup Bywaters and Ander (mechanical and electrical services).

The survey was undertaken over the following periods:

Building fabric - 29th July 2019 – 2nd August 2019;

Mechanical and electrical services – 5th August 2019 – 9th August 2019.

The weather was a mix of sunshine, cloud and rain showers over the two week survey period.

1.3 Identification and Terminology

Descriptions such as "left" and "right" are given as if facing the particular element in question.

Where the expressions immediate, short term, medium term, long term and very long term are used they generally mean the following:

- Immediate: within 1 year
- Short Term: within the next 1 to 3 years
- Medium Term: within the next 4 to 10 years
- Long Term: within 11 to 20 years
- Very Long term: over 20 years

2 General description of property

2.1 Generally

The site and buildings generally	The 32 acre site was acquired by the Bank of England in 1908 for the purpose of a paper records storage and private sport and leisure facility. The use of the site now extends to ancillary (and tenanted) office, training, fitness, nursery, bar and restaurant areas and generally includes the following principal buildings: ➢ Pavilion (clubhouse) and attached permanent marquee; ➢ Sports hall and swimming pool; ➢ Squash Courts; ➢ The Grange (Records Centre); ➢ Bank Lane cottages; ➢ Priory Lane cottage. The drawings in Appendix 3 usefully indicate the general extent and a layout (in part) of the above buildings. We are advised that these drawings (and any areas or dimensions given) are not an up-to-date or complete set and must not therefore be relied upon for any measurement or layout purposes whatsoever.
Pavilion	The original Bank of England Sports Centre clubhouse was destroyed by an incendiary bomb in November 1940, and a new two storey pavilion was built between 1955 and 1956. The Pavilion is a two storey detached structure that overlooks the principal green space (and cricket pitches) of the site. The building has been significantly altered and extended in the intervening years and from our visual inspection appears to utilise structural timber, reinforced concrete, steel and masonry in its super structure. Much of the building is clad externally in sawn timber cladding. The building is topped with a mix of traditionally cut timber pitched roofs clad in concrete interlocking pantiles and flat roofs covered in asphalt, mineral felt and sundry sheet metal sections.
Permanent marquee	The open plan polyethylene (or similar) roof and UPVC clad marquee structure is circa 5-10 years old. The building is topped with a mid-span side to side pitched roof and front to back ridge. Although described as permanent, the marquee is in fact a temporary marquee that has been installed and left on a permanent basis.
Sports hall and swimming pool	The sports hall is a circa 1970's concrete framed building comprising a covered and heated swimming pool, sports hall, gym, fitness studio, offices, changing facilities and Crèche. A single storey flat roof extension houses a sauna, Jacuzzi and steam room. The building is set out over 4 floors. The main building is topped with a mansard style flat felt roof more recently overlaid with a seamless coating and painted with solar reflective paint. A copper cored felt

	covering is laid over the slopped perimeter of the mansard roof. Elevations are finished in a mix of glass curtain walling, facing brickwork, timber and glass fibre reinforced plastic cladding.
Squash Courts	Three squash courts are formed in loadbearing masonry facing brickwork and topped with mono-pitched powder coated corrugated aluminium roof slopes with a central mineral felt flat roof.
Bank Lane cottages	1 and 2 Bank Lane comprise a pair of three and four bedroom semi-detached two storey cottages built in circa 1930. The cottages are formed in loadbearing masonry and facing brickwork and topped with pitched roofs clad in interlocking tiles.
Priory Lane cottage	Priory Lane Cottage is a detached (circa 1900) cottage formed over two storeys (and part one storey) along with a single storey attached garage. The cottage and garage are formed in loadbearing masonry and facing brickwork and topped with a pitched roof clad in natural slate.
The Grange / Records centre	The Grange is a detached basement and five storey period building built in circa 1908. The building has been significantly altered and extended (with additional north and south wings and more recent rear infill extensions) in the intervening years and from our visual inspection appears to utilise, reinforced concrete, steel and load bearing masonry in its super structure. The building is clad externally is cut limestone and facing brickwork. The building is topped with a mansard style asphalt flat roof, a concrete tiled perimeter.
Location	The Bank of England Sports Centre is located close to the north east corner of Richmond Park and is accessed via Bank Lane. The site notably slopes down from Priory Lane to the Beverley Brook running along the north west boundary of the site.
Locality	The Bank of England Sports Centre is located within a predominantly residential area on the edge of Richmond Park.
Transport Links	The Bank of England Sports Centre is not easily accessed by Public transport and Richmond Station (British Rail and London Underground), Putney Station (British Rail), East Putney Station (London Underground) Mortlake Station (British Rail) or Barnes Station (British Rail) would all require further taxi or bus travel.
Access and parking	The site benefits from large car parking provision with circa 200 spaces.
Previous building on the site	Not known.
Archival research	The following link provides information regarding WWII bomb strikes near or on the site http://bombsight.org/#17/51.45918/-0.25241 and highlights the potential risk of encountering an unexploded bomb when developing this site. No other archival information has been provided.

Approximate area	We have been advised of the following floor areas by Gerald Eve (email reference Emily Greenway to Mike Bayliss of 24th July 2019): **Approx. GIA (sqft)** ➢ Pavilion - 25,800 ➢ Permanent Marquee - 3,900 ➢ Sports Hall & Swimming Pool - 25,600 ➢ Squash Courts - 3,200 ➢ The Grange (Offices) - 41,000 ➢ 1 x 3 bed cottage - Unknown ➢ 1 x 4 bed cottage - Unknown ➢ 1 x 1 bed cottage – Unknown

2.2 External fabric

Pavilion	***Roofs*** The building is topped with a mix of traditionally cut timber pitched and hipped roofs clad in concrete interlocking pantiles and numerous areas of flat, entrance canopy and balcony roofs covered in asphalt, mineral felt and sundry sheet metal sections. Sundry sections of flat and balcony roofs are topped with pedestrian tiled walkways and metal rail edge protection. Flat roofs are penetrated by numerous single glazed Georgian wired roof and lantern lights. GRP roof lights are also utilised in sundry locations. Three brick built chimney stacks penetrate the main pitched roofs. The Pavilion pitched roofs incorporate flat roof dormer window projections mostly topped with sheet metal or mineral felt. ***Elevations*** Principal elevations are mostly finished in sawn timber cladding. Elsewhere sundry extensions and alterations to the Pavilion are presented in what appears to be cavity facing brickwork. Ramped level access is afforded to the principal front elevation of the Pavilion. The building deploys externally visible solid timber and reinforced concrete posts throughout both to support entrance canopies and covered walkways around the perimeter of the building and as an integral aspect of the structural solution used within the principal external walls and elevations. The eaves and verges of pitched and flat roofs are terminated with painted timber fascia and soffit boards and provide a fixing for rainwater goods. ***Rainwater goods and soil and waste pipework*** External pipework is predominantly formed in replacement UPVC sections. ***Doors and windows*** The majority of external doors throughout the building are formed in timber and partially single glazed. The majority of the original windows remain and

	comprise single glazed timber and metal framed casements. Elsewhere sundry replacement upvc double glazed casement windows have been fitted. The principal front entrance / reception door is a power assisted double glazed powder coated aluminium unit. ***Other features*** The Pavilion is linked to the Sports Centre at first floor level via a link bridge clad in powder coated profile metal sheeting and topped with a mineral felt flat roof with grp roof lights.
Permanent marquee	***Roofs*** The permanent marquee roof is metal framed and pitched from side to side with a central mid span ridge line running from front to back. The roof covering is finished in polyethylene sheet. ***Elevations*** Front and rear gables are also formed in polyethylene sheet and side elevations in UPVC moulded cladding panels all set within a metal structural frame. ***Rainwater goods and soil and waste pipework*** Gutters are formed in pressed aluminium sections. No rainwater downpipes were noted to the building. ***Doors and windows*** Entrance doors, fire exits and windows are formed in a mix of UPVC and metal framed double glazed casements.
Sports hall and swimming pool	***Roofs*** The main building is topped with a mansard style flat felt roof more recently overlaid with a seamless coating and painted with solar reflective paint. A copper cored felt covering is laid over the slopped perimeter of the mansard roof. The roof is framed using structural steel sections and trusses (and timber rafters to the mansard perimeter) and the sub-base for the main roof coverings uses woodwool slabs as viewed from their underside. There is a section of multi- pitched felt roof over the front elevation glass curtain walling. Sundry flat roofs are also used for entrance canopies and external walkways and are finished in a mix of felt and asphalt and topped with concrete paviours in areas. Flat roof and walkway edge protection is provided by metal guard rails. Sundry flat roofs are penetrated by polycarbonate roof lights. The main roof is finished with boarded (and part plastic) clad eaves and fascia boards. ***Elevations*** Elevations are finished in a mix of glass curtain walling to the principal swimming pool elevation, painted render, timber cladding, facing brickwork, glass fibre reinforced plastic cladding (to the sports hall) and resin bound shingle over exposed reinforced concrete framing. A large felt flat roofed reinforced concrete entrance canopy is provided over the principal entrance.

	A covered walkway area is provided directly outside the Crèche. Stepped access is provided to the principal entrance. ***Rainwater goods and soil and waste pipework*** Sundry sections of upvc pipework were noted but the majority of collected flat roof rainwater is via internally routed rainwater pipes. ***Doors and windows*** Windows are mostly formed in upvc double glazed casements. Doors are mix of timber and metal framed units.
Squash Courts	***Roofs*** Three squash courts are topped with mono-pitched powder coated corrugated aluminium roof slopes with a central mineral felt flat roof. Access to the main central flat roof is via an external metal ladder. ***Elevations*** The building is mostly clad in facing brickwork albeit powder coated aluminium roof slopes are extended down to high level elevations. This cladding is also used to form a parapet wall around the flat roof on three sides. ***Rainwater goods and soil and waste pipework*** Rainwater box gutters and downpipes are formed in matching aluminium sections throughout. We noted a upvc soil and waste pipe to the rear elevation. ***Doors and windows*** The entrance door and double glazed casement windows are formed in timber.
1 & 2 Bank Lane Cottages	***Roofs*** Bank Lane Cottage (1 and 2) are topped with pitched roofs clad in interlocking tiles. A flat roof single storey extension to 1 Bank Lane Cottages is clad in mineral felt as is a front elevation dormer window projection and front entrance canopy. A brick built chimney stack penetrates the front roof slope just under ridge level. ***Elevations*** Elevations are assumed to be formed in cavity facing brickwork and are embellished with render and decorative soldier brickwork bands at first floor level. ***Rainwater goods and soil and waste pipework*** Rainwater goods and soil and waste pipework are formed in replacement upvc sections as are facia and soffit boards.

	Doors and windows The principal front entrance door is formed in panelled timber with a high level vision panel. Windows and the rear door are formed in replacement upvc double glazed sections.
Priory Lane cottage	***Roofs*** Pitched (and hipped over the garage) roofs are clad in natural slate and penetrated by two brick built chimney stacks to the main building. Fascia and soffit boards are formed in painted timber. ***Elevations*** Elevations are formed in nine inch solid (London Stock) brickwork. The main left hand side flank wall and Priory Lane elevation (in part) is finished in sand and cement render. The front elevation of the cottage on Priory Lane is part earth retaining. ***Rainwater goods and soil and waste pipework*** Rainwater goods and soil and waste pipework are formed in a mix of painted metal sections and sundry replacement upvc sections. ***Doors and windows*** Doors and windows are formed in new replacement upvc double glazed casements throughout and sit above concrete sub-cills. A metal up and over door provides vehicular access to the garage.
The Grange / Records centre	***Roofs*** The building is topped with a mansard style flat roof with a concrete tiled pitched perimeter and main asphalt flat roof over. The asphalt roof covering is finished with insulation backed concrete paving slabs. A large clock tower at roof level over the portico is clad in sheet lead work. The sloping sections of the mansard roof are penetrated by dormer windows and clad in sheet metal work. Main flat roof edge protection is provided with metal railings. Small plant rooms at main roof level are finished with concrete tiled elevations, roller shutter entrance doors and topped with asphalt flat roofs. Main roof secret gutters behind elevation parapet walls are lined in sheet metal. Numerous later rear extensions are topped with a variety of roof coverings – pitched roof tiles, Georgian wired single glazed mono-pitch and lantern lights, flat felt and asphalt roofs and profiled metal sheeting. ***Elevations*** The building is finished externally in cut limestone quoins, corbels, parapets, balusters, plinths and facing brickwork. The front elevation stone portico (supported off of stone columns) is topped with an asphalt flat roof. Ramped level access is provided to the main front entrance. Window openings are ornamented with soft red brick surrounds and stone sub-cills. UPVC cladding is also fitted to the rear elevation of the former "Fives Courts".

	Rainwater goods and soil and waste pipework Rainwater goods and soil and waste pipework are formed in painted cast iron. ***Doors and windows*** The majority of windows are metal framed single glazed casements and some are set within painted timber sub-frames. Elsewhere timber casement windows are provided. The principal front entrance door leafs are formed in solid panelled timber. Elsewhere rear doors comprise timber (part glazed) and metal flush panel and louvered doors. The doors and windows to the rear elevation "Fives Courts" are formed in double glazed UPVC.

2.3 Internal fabric

Pavilion	The pavilion is fitted out in a traditional manner with a variety of floor coverings and decorative finishes (albeit mostly emulsion to walls and ceilings and gloss paint to joinery) to each area of the building. Structural floors (and ceilings) comprise a mix of both cast in-situ concrete and timber suspended areas. Ceilings present a variety of painted plaster boarded and commercial style suspended ceiling systems. Internal partitions and walls appear to be a mix of lightweight timber studwork clad in plasterboard and solid loadbearing masonry finished in wet plaster and emulsion. There is a notable high vaulted ceiling to the restaurant. Public area (fire door style) doors are mostly formed in modern / replacement veneered leafs with metal ironmongery and utilise vision panels in sundry locations. Doors elsewhere (to basement and office areas) are more budget paint grade or original stained and sometimes glazed flush panels leafs. Changing areas are generally fitted out with modern specialist benching and locker furniture. WC's, changing and shower areas (including wheelchair accessible ones) are generally fitted out with modern cubicles, sanitary fittings, mirrors and hand dryers etc. Bespoke / specialist joinery and furniture is utilised for reception, bar, restaurant and café counter areas and the commercial kitchen.
Permanent marquee	The permanent marquee is of a simple open plan design and interconnected to the main Pavilion building. The external walls internally are finished in a modular factory finished panel system. A carpeted raised access floor is laid throughout the marquee.
Sports hall and swimming pool	The overall standard of fit out of the Sports hall and swimming pool is that of a traditional 1970's sports centre. There are a variety of floor coverings and decorative finishes (albeit mostly emulsion to walls and ceilings and gloss paint to joinery) to each area of the building. Structural floors (and ceilings) comprise reinforced concrete. There is a sprung floor to the main sports hall. Ceilings present a variety of painted plaster boarded and commercial style suspended ceiling systems. The main sports hall and top floor gym and studio reveal the underside of the main roof wood wool slab decking. A specialist feature /

	panelled ceiling is hung over the swimming pool. Internal partitions and walls appear to be a mix of lightweight timber studwork clad in plasterboard and solid loadbearing masonry finished in wet plaster and emulsion. Public area (fire door style) doors are mostly formed in modern / replacement veneered leafs with metal ironmongery and utilise vision panels in sundry locations. Changing areas are generally fitted out with modern specialist benching and locker furniture. WC's, changing and shower areas (including wheelchair accessible ones) are generally fitted out with modern cubicles, sanitary fittings, mirrors and hand dryers etc. As you would expect the fit out at ground floor plant room area is of a more serviceable presentation and is mostly exposed reinforced concrete. Metal framed glass balustrading is utilised throughout the main swimming pool viewing areas.
Squash Courts	Squash courts present themselves with timber floors, plastered and painted walls and suspended ceiling grid and inlaid panel ceilings. Circulation areas are traditionally fitted out with painted plaster walls (part exposed brickwork) and ceilings, carpeted floors and timber panel doors.
1 & 2 Bank Lane Cottages	Bank Lane are traditionally fitted out residential properties with modern, kitchens, bathrooms, fixtures, fittings and finishes.
Priory Lane cottage	Priory Lane cottage is currently moth balled in a derelict condition throughout.
The Grange / Records centre	Originally a records office, the Grange has now been extensively refurbished and sub-divided and fitted out for mostly commercial office occupation by four tenants. The standard of fit out is to a basic commercial office specification with suspended panel ceilings, carpeted raised access floors, veneered (fire door style) doors, matching joinery, fitted kitchen, WC sanitary fittings and cubicles and plaster and painted sundry cellular office partitioning. In some locations what appears to be permanent metal shutting is visible at ceiling level to the underside of concrete floor slabs. Further Category B tenant fit out work has been undertaken to each demise such as reception desks and further sub-division of space with glazed partitions etc. Sundry floor space on the ground floor and basement is retained for use (ground floor fitness studio, administration / facilities and office space and Fives Courts storage areas etc.) by the Bank of England Sports Centre albeit much of this space is currently unoccupied. Many (but not all) of the metal framed windows to tenant occupied space benefit from secondary glazing. The building benefits from a central stair and lift core and additional north and south wing secondary means of escape fire masonry staircases.

2.4 Land and Boundaries

Characteristics of Site	The site notably slopes from Priory Lane down toward to the Beverley Brook along the north west boundary of the site. The site is generally enclosed by a mix of metal chain link or timber fencing with a barbed wire trellis over. The

	sloping nature of the site means that many areas are graded or terraced with the use of earth retaining walls. The principal site entrance is formed with double metal entrance gates hung off of large brick piers. There is no formal boundary delineation between the Bank of England Sports Centre and LTA demise. There is a large brick built and pitched metal trussed roof machinery store located on the north west boundary of the site. There is a similar steel framed pitched roof store adjacent. The site is extensively hard landscaped with access roads, car parking, footpaths and garden / yard areas.

3 General condition of property

The following section details our observations and opinions on the condition of the building. A flag system has been used to identify points which need urgent attention or which are significant in terms of the proposed transaction. For an explanation of the flag system please refer to the executive summary.

3.1 Structural condition

Observation	Recommendation	Photo
The Grange 1 The Grange building shows potential signs of structural movement most notably to the (assumed) later addition north and south wings. Historic evidence of crack monitoring tell tales are also present. Regular centred circular cut-outs to stone coins suggest a past or ongoing regime of possible steel frame corrosion inspection or repair and or the replacement of fixings for stone panels. Elsewhere sundry <5mm wide cracking and bulging elevation brickwork presents itself. On balance however there are currently no obvious signs of progressive building movement or failure. However the potential risk for embedded steel corrosion or the failure of the metal fixings used to secure stonework in place is present and the cost to remedy and repair such a defect can be very significant.	Monitor for building movement and steel frame corrosion. See section 6.3 - Establish any records of past or ongoing movement and steel frame corrosion monitoring, repair and any associated insurance claims. Carryout opening up work of stonework / brickwork to inspect for corrosion to structural frame. Consider the appointment of an appropriately qualified and experienced structural engineer to support any further survey and investigative work.	1, 2
The Pavilion 2 This period building shows minors signs of building movement and deflection with uneven floors and distorted door opening. On balance however there are currently no obvious signs however of progressive building movement or failure.		
The Sports Centre 1 There is slight cracking <1mm wide to exposed area of the concrete frame. The resin coating overlaying the majority of the reinforced concrete frame is spalled and defective in numerous areas and we are concerned this is potentially concealing a past and or present problem of concrete carbonation and failure.	Monitor for concrete carbonation failure. See section 6.3 - Establish any records of past or ongoing concrete carbonation and repair. Carryout detailed cherry picker / hammer test inspection / opening up work of concrete to check for carbonation of concrete.	

	Consider the appointment of an appropriately qualified and experienced structural engineer to support any further survey and investigative work.	
Squash Courts 2 Albeit much of the elevation brickwork was concealed by climbing vegetation circa 10-20mmmm wide vertical brickwork cracking was noted at yard level to a rear elevation attached planter.	Carryout monitoring and geotechnical investigations and stitch repair fractured elevation brickwork and make allowance for mass concrete underpinning if necessary.	
Basements to The Grange, Sports Centre and Pavilion 1 Principle basement areas are not designed or intended to be habitable and numerous areas exhibit significant damp ingress and in some cases flooding.	Ongoing expenditure to repair and mitigate the risk of water ingress to basements will be necessary and penetrating dampness will (and may already) ultimately result in failure of the basement structure and interior fabric over time. The detailed and accurate cost of basement repair and improvement work is beyond the scope of this report and further specialist advice should be sought. Ground water levels can change dramatically over time and as such basement level fit out and M&E plant can potentially be at risk in this instance.	39A

3.2 Condition of External Fabric

Observation	Recommendation	Photo
The Grange 2 This impressive period building appears to have been the subject of quite recent cosmetic external elevation repair. With the exception of those structural concerns to stonework and brickwork above, masonry is generally presented in a good condition.		
None the less and elsewhere, a significant amount of external back log maintenance is noted.	Carryout a single fully co-ordinated and scaffolded external repair and redecoration project comprising those items listed below.	
Original single glazed metal framed Crittal windows have now reached the end of their useful life and are corroded and enwind. North and south wing windows in particular are set within timber sub-frames and present a constant	Erect scaffolding and replace all windows in double glazed counterparts.	3, 4

repair and redecoration liability. Associated cyclical redecoration scaffolding costs will be significant.		
Original pitched and flat roof coverings have now reached the end of their useful. Insulation backed roof level paving slabs are brittle, broken and asphalt under is seriously cracked and crazed. The extent of water ingress to the internal demise supports this finding	Utilise above scaffolding and replace all pitched and flat roof coverings. Upgrade roof level insulation in conjunction.	5, 6, 7
Rear extension single storey / single glazed, Georgian wired roof and lantern lights along with sundry flat roofs elsewhere are also in poor condition with numerous incidents of cracked and defective glazing	Erect scaffolding to replace all single storey / single glazed, Georgian wired roof and lantern lights along with sundry pitched and flat roof repairs elsewhere	8
There are numerous other high level external repair and redecoration / backlog maintenance items that would benefit from being undertaken in conjunction with the main scaffold dependent works above. These works range from the repair and or replacement of joinery, pigeon netting and spikes, lead flashings, lead covered dormer window projections, parapet walls and gutter linings, brickwork and stonework, severely corroded perimeter metal balustrading, plant room enclosures and supports, rainwater goods, flat roof drainage provision and general cleaning and redecoration etc.	Utilise above scaffolding to carry out associated repair and redecoration of all other high level building components.	
The Sports centre and swimming pool 2 The external fabric of this building appears to have been largely neglected over the last 40 or so years and significant backlog maintenance is noted.		
The majority of windows and doors are circa 50 years old and have reached the end of their useful life and require complete replacement.	Erect scaffolding and replace all windows (and doors) in double glazed counterparts.	9, 10
The majority of flat roof coverings are circa 50 years old and have reached the end of their useful life and require complete replacement.	Utilise above scaffolding and replace all pitched and flat roof coverings. Upgrade roof level insulation in conjunction.	11, 12
Timber cladding is rotten and detached, GRP cladding is damaged, vandalised and UV light degraded and the resin coating overlaying the reinforced concrete frame is spalled and defective in numerous areas.	External elevation cladding and finishes now require comprehensive repair / replacement. Allowance should be made for unforeseen concrete repairs once all resin coatings and cladding are removed.	13, 14, 15, 16

There are numerous other high level external repair and redecoration / backlog maintenance items that would benefit from being undertaken in conjunction with the main scaffold dependent works above. These works range from the repair and or replacement of brickwork, joinery, pigeon netting and spikes, lead flashings, gutter linings, eaves/ fascia cladding, rainwater goods, flat roof drainage provision and general cleaning and redecoration etc.	Utilise above scaffolding to carry out associated repair and redecoration of all other high level building components.	17, 18, 19
Pavilion 2 The external fabric of this building appears to have been largely neglected over the last 50 or so years and significant backlog maintenance is noted.		
The majority of windows and doors are circa 50 years old and have reached the end of their useful life and require complete replacement.	Erect scaffolding and replace all windows (and doors) in double glazed counterparts.	20
The majority of flat roof coverings and numerous roof lights are circa 50 years old and have reached the end of their useful life and require complete replacement.	Utilise above scaffolding and replace all pitched and flat roof coverings. Upgrade roof level insulation in conjunction. Include also to replace numerous single glazed, Georgian wired (and sundry GRP) roof and lantern lights and an assortment of vents and louvres.	21
Timber cladding is rotten and detached, GRP cladding is damaged, vandalised and UV light degraded and the resin coating overlaying the reinforced concrete frame is spalled and defective in numerous areas.	External elevation timber cladding now requires comprehensive repair / replacement. Allowance should be made for unforeseen repairs to backing masonry / structure once exposed.	22
There are numerous other high level external repair and redecoration / backlog maintenance items that would benefit from being undertaken in conjunction with the main scaffold dependent works above. These works range from the repair and or replacement of brickwork, render, joinery, pigeon netting and spikes, lead flashings, gutter linings, eaves/ fascia cladding, rainwater goods, flat roof drainage provision and general cleaning and redecoration etc.	Utilise above scaffolding to carry out associated repair and redecoration of all other high level building components.	
Squash Courts 2 The roof coverings exhibit extensive patch repair and no doubt issues of past water ingress.	We recommend all pitched roof coverings, edge and parapet wall trim and all high level matching elevation cladding is now completely	23, 24, 25

	replaced. It would be prudent to replace the central felt flat roof at the same time as scaffold access is provided for the work above.	
The paint system to the windows is dated and has now failed.	Redecorate doors and windows.	
Albeit much of the elevation brickwork was concealed by climbing vegetation circa 10-20mmmm wide vertical brickwork cracking was noted at yard level to a rear elevation attached planter.	Carryout monitoring and geotechnical investigations and stitch repair fractured elevation brickwork and make allowance for mass concrete underpinning if necessary.	26
1 and 2 Bank Lane Cottages 2 The cottages are presented in an acceptable external condition and no immediate back log maintenance was recorded with the possible exception of some slightly cracked render plinths	Consideration should now be given to replacing the pitched roof coverings.	
Priory Lane cottage 2 This cottage is presented in a completely derelict, damp and unmodernised condition	A comprehensive regime of external refurbishment is now required and to include not least: - replacement roof coverings and flashings, repair and repointing of external brickwork and render and the replacement of all rainwater goods and external pipework and full external redecoration of all previously painted surfaces.	
Permanent marquee 2 The marquee is generally in an acceptable condition and appears sufficient for it purpose presently. For the avoidance of doubt this marquee can only be deemed a temporary solution over the next 5-10 years for providing such accommodation.	Consideration should be given to the installation of rainwater pipework where presently missing.	

3.3 Condition of Internal Fabric

Observation	Recommendation	Photo
The Grange 2 As previously stated much of The Grange is let to tenants. The general standard of landlord and tenant fit out is to an acceptable condition and		27, 28

any necessary improvement works to these areas are excluded from our section 7 costs.		
Basement and ground floor areas demised to the Bank of England Sports Centre are now quite tired and worn.	Our section 7 costs make a notional allowance for sundry repair, redecoration and improvement work.	29
Numerous areas of rainwater ingress were noted to this building under pitched and flat roofs.	Re-roofing work recommended above.	30
The sports centre and swimming pool 2 The internal fit out of this space is virtually unchanged from construction with the possible exception of more recently upgraded changing and WC facilities and the more recent health spa area. In summary the overall presentation the sports hall and swimming pool is now quite dated and poor.	Our section 7 costs make a notional allowance for sundry repair, redecoration and improvement work.	31, 32
Pavilion This space is virtually unchanged from construction with the possible exception of more recently upgraded changing and WC facilities. In summary the overall presentation the Pavilion is now quite dated and poor.	Our section 7 costs make a notional allowance for sundry repair, redecoration and improvement work.	33, 34
Permanent marquee 2 The marquee is generally in an acceptable condition and appears sufficient for it purpose presently. For the avoidance of doubt this marquee can only be deemed a temporary solution over the next 5-10 years for providing such accommodation.	Our section 7 costs make a notional allowance for sundry repair, redecoration and improvement work.	35
Squash Courts 2 This space is virtually unchanged from construction. In summary the overall presentation the sports hall and swimming pool is now quite dated and poor and the roofs are leaking.	Our section 7 costs make a notional allowance for sundry repair, redecoration and improvement work.	36
1 and 2 Bank Lane Cottages 2 The standard of internal fit out is to an acceptable condition albeit a little dated and unmodernised. Sundry back log repair and maintenance work is now required.	Our section 7 costs make a notional allowance for sundry repair, redecoration and improvement work.	

Roof leaks were noted and replacement roof coverings are recommended elsewhere.		37
Sundry slight <5mm wide structural cracking was noted to wall and ceiling plaster. This is not uncommon in a period property and especially one in close proximity to trees where a risk of tree root related damage exists.	These cracks should be monitored for any deterioration or for signs of progressive structural movement.	38
Wasps nests were noted to roof voids	Remove wasps nest.	39
Where these flats were occupied we were only able to gain access to one bedroom within each cottage. This was a limitation of our survey.		
Priory Lane cottage 2 This cottage is left in a completely derelict and dilapidated condition	Carryout full refurbishment.	

3.4 Comments on Land and Boundaries

Observation	Recommendation	Photo
Roads, paths and hard landscaped yards 2 Boundary fencing is generally in quite poor condition. Thermoplastic coloured road lining is now quite faded. Road, path and yard surfacing is uneven, presents numerous trip hazards and would benefit from repair and relevelling in numerous areas.		40, 41, 42, 44,
The sloping nature of the site dictates the use of numerous earth retaining walls. Many of these walls are of a domestic standard in their construction and are now cracked and defective. Elsewhere more formally designed concrete or structural timber earth retaining walls are in varying degrees of failure and now require repair.	Repair and or renew defective earth retaining walls.	43
Roads, paths and hard landscaped yards are generally in an acceptable condition albeit sundry repair and improvement work is now required.	Repair and or renew defective road surfaces, paths and hard landscaped yards. Renew faded thermoplastic lining.	

4 Sustainability

Sustainability involves topics that extend beyond the environment to include human, social and financial issues at the same time.

Please note that the comments are based upon general observations rather than detailed studies and are not intended to be exhaustive. Several of the sections involve legislative issues which are often based upon audit or risk assessment, something that is beyond the scope of this report.

4.1 Environmental labelling and management

	Item	Observation and recommendation
3	Environment labelling and management	There was no evidence of (and we have not been provided with) any building / estate environmental labelling and management accreditation or compliance information.

4.2 Climate and climate change

	Item	Observation and recommendation
3	Building management	We are not in receipt of any building management plan or system.
3	Water use	There are no provisions at the building for the use of harvested water, however, these could be practically introduced.
3	Thermal performance	The standards of thermal insulation employed during the construction of the buildings are extremely poor compared to current standards. There are numerous practical measures for improving the thermal performance of the building beyond its current provision (double glazing, roof insulation etc.) and especially when carried out with the significant programme of repair and refurbishment recommended above.

4.3 Energy performance

	Item	Observation and recommendation
3	Energy performance certificate (EPC)	We are not in receipt of any EPC for this property. This should be requested.
3	Lighting and controls	Lighting controls are mostly dated and not designed to promote energy efficiency.
3	Renewable Energy	There are numerous practical measures for introducing renewable energy systems to the site and especially when carried out with the significant programme of repair and refurbishment recommended above. Extensive flat roof areas (subject to structural loading

	Item	Observation and recommendation
		assessment) present an excellent opportunity for solar panels to deployed and extensive grounds lend themselves to ground or air source heat pump use for hot water and heating.
3	Renewable energy tariff	We are not aware of any renewable energy tariffs in use by the estate.

4.4 Biodiversity, landscaping and visual aspects

	Item	Observation and recommendation
3	Building biodiversity	No consideration or measures have been installed or introduced to encourage building biodiversity. Flat roof improvement work provides an excellent opportunity to consider the use of green roofs. Other considerations would be living walls, ponds, and wild insect, bat and bird promoting measures.

4.5 Land use and contamination

	Item	Observation and recommendation
3	Land use and contamination	We are not aware of or have been advised of any land use and contamination issues.

4.6 Flooding risk

	Item	Observation and recommendation
3	Analysis of published data	According to data published by The Environment Agency, the bottom west end of the site adjacent to the Beverley Brook is located within an area (flood zone 3) that is susceptible to flooding. 

4.7 Mining subsidence, erosion or similar hazards

	Item	Observation and recommendation
3	Risk of building on landfill	Not known. We have not been instructed to undertake an environmental / geotechnical investigation, desk top or otherwise.
3	Risk of subsidence arising from erosion, mineral extraction or dilution etc.	Not known. We have not been instructed to undertake an environmental / geotechnical investigation, desk top or otherwise.

4.8 Noise, pollution and disturbance

	Item	Observation and recommendation
3	Noise	Just north of the site is the principal east to west Heathrow flight path and associated aircraft noise was noted.

4.9 Crime and security

	Item	Observation and recommendation
3	Crime	Crime statistics for the local area can be found at https://www.police.uk/metropolitan/E05000621/crime/stats/
3	Security	The site is currently manned with full time security. The site boundary with the adjacent Lawn Tennis Club is currently undefined and poses a potential threat from unwanted intruders.

4.10 Trees and invasive vegetation

	Item	Observation and recommendation
3	Tree proximity	The proximity of trees to buildings can give rise to concern because structural damage can be caused by root systems growing around, under and sometimes through foundations. The risk of damage caused by tree roots depends on; • the proximity of the tree to the building concerned • the height, age and species of tree • the design and depth of a building's foundations • the type of sub-soil. Following periods of drought, there is usually a dramatic increase in the number of subsidence claims involving residential low-rise buildings, especially if the foundations are shallow and particularly in areas of shrinkable clay soils. Much of London is covered with shrinkable London Clay. Due to their demand for water, trees can contribute to soil

	Item	Observation and recommendation
		desiccation which, when effecting one part of a building more than others, can cause differential movement to the foundations. This buildings foundation movement can then manifest itself in movement or cracking of the superstructure. The causes of differential movement to buildings and the reasons for cracks in buildings are very complex and varied. To properly determine if trees are contributing to the problems of subsidence, detailed investigations are required. The mere presence of trees near to buildings does not mean that they are inevitably responsible. In order to ascertain the extent to which trees are contributing, there needs to be evidence of the following through a regime of detailed site investigations which are beyond the scope of this report; • Shrinkable clay sub soil • Seasonal soil moisture deficits • Seasonal buildings foundation level fluctuations • Presence of tree roots under or near to buildings foundations • Damage to the property that may be attributable to the previous factors. • The absence of other factors that may have a bearing on foundation movement, internal cracking or structural damage. There are presently mature and well established trees and large bushes across the estate and in close proximity to some of the buildings. We consider that a significant risk of root-related structural damage exists to those trees adjacent to: • Bank Lane Cottages; • Priory Lane Cottage; • Sports Centre. However no such damage is recorded presently that requires any further action other than sundry repair and re-pointing of slightly cracked masonry discussed above. We suggest that with a thorough and diligent regime of pollarding and crown reduction to these tree and bushes you will hopefully be able to maintain the status quo. Very often removal of large trees can also result in building movement or cracking.
3	Japanese Knotweed and Giant Hogweed.	None noted. Further guidance can be obtained at: https://www.gov.uk/guidance/prevent-japanese-knotweed-from-spreading

4.11 Radon and radiation in various forms

	Item	Observation and recommendation
3	Radon	According to the radon maps produced by the National Radiological Protection Board, the area is not located in an area that is thought to have high radon risks.
3	Electromagnetic fields (overhead and buried cables)	No overhead power lines were noted in the vicinity of the buildings although it is possible that power cables extends below ground in locations that we could not identify. Further guidance can be obtained at: https://www.gov.uk/government/publications/electric-and-magnetic-fields-health-effects-of-exposure/electric-and-magnetic-fields-assessment-of-health-risks
3	Microwave exposure	Base stations transmit and receive radio waves to connect the users of mobile phones and other devices to mobile communications networks. The strength of the radio waves from base-station antennas reduces rapidly with increasing distance and the levels at locations where the public can be exposed tend to be small. The health effects of exposure to radio waves have been researched extensively over several decades, and very many publications can be found in scientific journals and elsewhere. Coordinated research around the world has addressed concerns about rapidly proliferating mobile communications technologies from around the year 2000. Independent expert groups in the UK and at international level have examined the accumulated body of research evidence. Their conclusions support the view that health effects are unlikely to occur if exposures are below international guideline levels. We have not been able to establish the presence of base stations either near or on the site and we recommend you appoint a specialist in this regard. Further guidance can be obtained at: https://www.gov.uk/government/publications/mobile-phone-base-stations-radio-waves-and-health/mobile-phone-base-stations-radio-waves-and-health

4.12 Vermin and protected species

	Item	Observation and recommendation
3	Birds	Principal buildings are protected with an array of old and now defective netting and spike systems and we recommend you obtain specialist advice in relation to their repair and renewal.
3	Mammals	We did not record the presence of any mice or rats at the property. We strongly recommend you appoint a specialist in this regard to advise of their costed recommendations
3	Insects	We did not record the presence of any wood boring insects or otherwise (with the exception of sundry wasps nests) at the property. You may wish to consider appointing a specialist in this regard to advise of their costed recommendations.
3	Protected species	We did not record the presence of any bats during our survey. We strongly recommend you appoint a specialist in this regard to advise their costed recommendations and especially before you embark on any external building and roofing work.

4.13 Building regulations, planning and cultural heritage

	Item	Observation and recommendation
	Building Regulations	The buildings should satisfy the standards of construction and performance criteria set out in the Building Regulations current at the time of their construction. There have been amendments to these regulations since that time and the buildings may not fully satisfy contemporary standards. The statute under which the Building Regulations are made in the UK is the Building Act 1994. Neither this Act, nor the Regulations themselves, are applicable retrospectively. This avoids the need for constant improvement of properties to satisfy current standards. You should obtain copies of the necessary building control approval documentation for all new build, extension and structural alteration work carried out at the site for file completeness. Particular effort should be made to establish the building control status of the permanent marquee. We are concerned this marquee has transitioned from temporary to permanent status without consideration for building regulation compliance (where applicable).
3	Planning Consent	You should obtain copies of the necessary planning approval documentation for all new build and extension work at the site for completeness. Particular effort should be made to establish the planning status of the permanent marquee.

	Item	Observation and recommendation
3	Listed Building Consent	Wordsworth Councils Listed Building map does not list any of the buildings at the Bank of England Sports Centre as being Listed.
3	Conservation area Consent	The property is not located within a conservation area.
3	Other heritage issues	None known

4.14 Health, safety and wellbeing

	Item	Observation and recommendation
3	Temperatures in indoor workplaces and work in hot and cold environments	Temperatures in the workplace appear to be adequate controlled.
3	Lighting	Lighting levels appear to be sufficient for the use of the building.
3	Cleanliness and waste materials	Appropriate standards of cleanliness are being observed throughout although some improvements could be made within the Pavilion kitchen area and sports centre changing rooms.
3	Room Dimensions and Space	Appears adequate.
3	Maintenance of the workplace	Limited and essential / reactive maintenance is being undertaken to an acceptable standard within the main buildings.
3	Floors and traffic routes	We do not have any concerns in this regard.
3	Working at Height	We do not have any concerns in this regard.
3	Transparent or translucent doors, gates walls and windows	Sundry instances of clear glass that is at risk of impact does not appear to be suitably protected. Manifestation is recommended.
3	Windows doors and gates	We do not have any concerns in this regard.
3	Sanitary conveniences and washing facilities	Sanitary facilities within the building appear to be suitable and sufficient.
3	Drinking water	An adequate supply of drinking water is provided.
3	Accommodation for clothing and facilities for changing	Changing facilities are provided.

4.15 Travel

	Item	Observation and recommendation
3	Public Transport	The building is served (albeit not particularly well) in terms of public transport connections.
3	Cycling	Secure cycle parking is available to sundry locations across the estate.
3	Green Travel	At present, there is no Green Travel plan in place.
3	Car Policy	Similarly, there is no car sharing policy.

4.16 Fire precautions and means of escape

	Item	Observation and recommendation
1	Fire Risk Assessment and or Fire Certificate	We are not in receipt of any fire risk assessment and we strongly recommend this is obtained and reviewed immediately. Further information can be obtained here: https://www.gov.uk/workplace-fire-safety-your-responsibilities/fire-risk-assessments The fire risk assessment is essential in assessing the detailed adequacy of any fire compartmentation (walls, doors and floors) between demises and safe means of escape generally. Our general findings indicate that assumed fire doors are found wanting in terms of their general condition, design and the adequacy to which self-closing mechanisms operate. We witnessed numerous unprotected services route and voids between floors and adjacent spaces which require fire proofing. As previously discussed and below, careful consideration should also be given to the use of the external timber cladding (Pavilion and Sports Centre) GRP cladding (Sports Centre) and the polyethylene and upvc (Marquee) cladding in relation to its combustibility and the risk of the surface spread of fire.
1	Timber cladding to the Pavilion and Sports Centre	We are concerned of the potential risk of fire spread from timber cladding. Further specialist advice and testing should be sought as part of procuring or reviewing the above fire risk assessment.
3	Access for the Fire Brigade	Sufficient tender access is provided to the front of the building.

4.17 Social inclusion (disability)

Unless otherwise instructed we have not carried out a full disability audit; the following observations are based upon cursory review and are not exhaustive.

	Item	Observation and recommendation
3	Generally	Provision for disabled access to the premises generally appears acceptable (with the exception of the sports hall with stepped access), although manifestation improvements should be considered during any future refurbishment works.
3	Vertical circulation within the building	Lift access is available to the principal floors of the Sports Hall and The Grange but not the Pavilion.
3	Toilet facilities	Unisex disabled toilet facilities are provided in sundry locations.

4.18 Use of materials

	Item	Observation and recommendation
3	Environmental Impact[1]	At life end, structural steel elements, timber cladding components, glass and to a certain extent, concrete and masonry could all be recycled. Similarly, Roofing materials have a finite life and are likely to require replacement several times throughout the life of the building. The opportunity should be taken to select materials with a low environmental impact, or possibly, sedum roof coverings to enhance site biodiversity and reduce rainwater run-off rates.

5 Problematic materials

Certain materials are considered by the construction industry to be deleterious or problematic. Unless stated otherwise, this section contains comments that are based upon visual inspection only as opposed to physical testing.

	Material	Location	Recommendation
	Concrete additives	Not known	N/A
1	Wood wool slab	Sports Hall roof deck	Wood wool is a man-made board material about 50 to 75mm thick comprising shredded timber bound together in a cement paste. It was used generally during the 1960s to provide insulation often at roof level and as a permanent shutter to in-situ concrete. Unfortunately, when woodwool was incorporated as a permanent shutter, unless great care was taken when placing concrete against the woodwool soffit shutters, inadequate compaction of the concrete could occur due to the compressible nature of the board. This lack of compaction resulted in voids and honeycombing on the soffit of the slab sometimes leaving no cover to the reinforcing steel. As the woodwool boards were left in place these defects then remained undetected. Woodwool boards were used both as a permanent shuttering to flat slabs but also as a void former between concrete ribs. Further investigations are recommended.
3	Calcium Silicate Brickwork	Not suspected.	N/A
1	Asbestos	Not known	A copy of the asbestos register and management plan should be obtained, reviewed, updated, and implemented immediately. The risk of known and concealed asbestos at the site is considered very high. Where possible any asbestos register (and management plan) should be informed by an as

	Material	Location	Recommendation
			obtrusive, invasive and fully costed survey as can be accommodated. Please note that prior to any building work being undertaken you must carry out a fully invasive survey. It is beyond the scope of this report to advise on the likely cost for the removal of any known or foreseeable asbestos without sight of any existing asbestos register. This is considered a serious limitation of this survey report. Further guidance can be found at: https://www.hse.gov.uk/asbestos/
3	Machine Made Mineral Fibre	Not suspected.	N/A
3	Nickel Sulphide Inclusions in Toughened Glass	Sports hall curtain walling.	Nickel Sulphide (NiS) inclusions are a known issue for toughened glass, resulting from the presence of nickel contaminants in the glass melt reacting with sulphur, most likely from the furnace fuel. During thermal toughening, these inclusions undergo a crystalline phase change to a smaller form and are fixed in place within the glass upon cooling. Over time the inclusions grow and can eventually impart enough stress in the glass to cause spontaneous failure. Monitor for potential risk of glass failure.
1	Composite panels / cladding	Sports hall, marquee and squash courts	Further specialist investigation and opening up is recommended to establish the presence and type of any composite cladding (timber or otherwise) that may be a fire risk.
1	Masonry encased steel	Pavilion and The Granges	Carryout selective investigative and opening up work to check for concealed and corroded structural steel work.
3	Urea Formaldehyde Foam	Not suspected.	N/A
1	Lead in Paint and Plumbing	Assume present	Carryout specialist testing to ascertain presence of lead in paint and plumbing.

6 Legal and technical issues

6.1 Legal Interest

	Issue	Recommendation
	Interest under consideration	We are not party to any land registry searches or title deeds associated with the sale of this property.

6.2 Enquiries of the legal team

We recommend that the following points be referred to the legal team:

	Issue	Recommendation
?	Dilapidations	This report has not made an assessment of any likely dilapidations disputes (whether by the landlord or the tenant) that has or may have arisen to currently occupied and tenanted areas and in particular to The Grange Building. For the purposes of our section 7 costs we have assumed the responsibility to maintain and repair the external fabric (windows, roofs etc.) is by the Bank of England Sports Centre. We have not had sight of any lease documentation, appended plans and schedules of condition or been asked to provide any landlord and tenant advice.

6.3 Technical enquiries

We recommend that the following technical enquiries be made prior to contract:

	Issue	Recommendation
1	Structural movement and steel frame corrosion to the Granges building.	Establish any records of past or ongoing movement and corrosion monitoring, repair and any associated insurance claims.
1	Concrete failure to Sports Centre	Establish any records of past or ongoing concrete corrosion monitoring and repair.
1	Additional recommended technical due diligence reports not include within the scope of this report – Fire risk assessment, asbestos register and	Brief and instruct the appropriate, suitably qualified and experienced professionals to undertake these investigations and report their costed findings and recommendations.

	management plan, lead paint, vermin, bats, structural engineering, woodwool slabs, basement water-proofing, DDA Access audit, environmental / geotechnical, topographical / measured survey, EPC, CCTV drainage, sports equipment, sports surfacing, swimming pool /spa, cladding and utilities searches / investigations.	
?	The Grange	We understand this building has undergone extensive internal fit out and refurbishment work in the past. You should make enquires as to the extent of any work undertaken and the availability of record drawings and statutory approvals. Site staff and anecdotal evidence suggest that substantial structural alteration and improvement work has been undertaken, particularly to structural floor slabs.
?	Deleterious materials	Make legal enquires to establish any history, severity (and cost of repair) associated with subsidence, flooding (river, surface and ground water), insect attack, steel and concrete corrosion, dampness (rising or penetrating), nickel sulphide inclusion and vermin along with all other matters flagged up in this report.
1	Utilities	Consideration should be given to establishing the precise size, location, capacity and suitability for separation, modification and sub metering of all utilities.

6.4 Review of documents

	Item	Observation and recommendation
3	Operation and maintenance documentation	We are not in receipt of any operation and maintenance manuals for the property. These should be obtained. Establish the presence of and review any existing guarantees or servicing agreements (and associated costs)for significant building and M&E plant components

7 Approximate costings

This section summarises the various defects that we have identified together with the approximate cost of rectification.

The schedule is intended to illustrate the approximate cost of placing the building into repair including the future cost of repair or replacements where reasonably foreseeable, but it should not be taken as a planned maintenance schedule.

Immediate / short term outline backlog maintenance assessment Bank of England Sports Centre		
Ref	**Work item**	**Cost £**
A	***Pavilion (clubhouse)***	
1	Full height scaffolding to all elevations and including roof structures	2,500,000.00
2	Install replacement double glazed windows throughout	
3	Install replacement flat, pitched, polycarbonate and glazed roof coverings throughout	
4	Repair / upgrade external cladding	
5	Carryout all other consequential and external fabric repair and redecoration work	
6	Internal fabric improvements	
7	Mechanical and electrical services	1,680,000.00
8	Subtotal	**4,180,000.00**
B	***Permanent marquee***	
1	External fabric improvements (rainwater goods)	15,000.00
2	Internal fabric improvements	
3	Mechanical and electrical services (included in Pavilion)	
4	Subtotal	**15,000.00**
C	***Sports hall and swimming pool***	
1	Full height scaffolding to all elevations and including roof structures	3,000,000.00
2	Install replacement double glazed windows throughout	
3	Install replacement flat, pitched, polycarbonate and glazed roof coverings throughout	
4	Repair / upgrade external cladding	
5	Concrete carbonation corrosion investigations, opening up and provisional allowance for repair	
6	Carryout all other consequential and external fabric repair and redecoration work	
7	Internal fabric improvements	
8	Mechanical and electrical services	1,665,000.00
9	**Subtotal**	**4,665,000.00**
D	***Squash Courts***	
1	Full height scaffolding to all elevations and including roof structures	450,000.00
2	Replace all flat and pitched roofs and high level cladding throughout	
3	Carryout all other consequential and external fabric repair work	
4	Carryout monitoring and geotechnical investigations and stitch repair fractured elevation brickwork and make allowance for mass concrete underpinning if necessary	
5	Internal fabric improvements	
6	Mechanical and electrical services	27,000.00
E	**Subtotal**	**477,000.00**
1	***The Grange (records centre)***	
2	Full height scaffolding to all elevations and including roof structures	

3	Steel frame corrosion investigations, opening up and provisional allowance for repair	2,500,000.00
4	Install replacement double glazed windows throughout	
5	Install replacement flat, pitched and glazed roof coverings throughout	
6	Carryout all other consequential and external fabric repair and redecoration work	
7	Allowance for sundry repair and improvement work to the common parts internal demise currently occupied by the Bank of England Sports Centre	
8	Internal fabric improvements	
9	Mechanical and electrical services	1,295,000.00
10	**Subtotal**	**3,795,000.00**
F	***Bank Lane cottages***	
1	Replacement pitched roof coverings	140,000.00
2	Sundry internal fabric repairs	
3	Mechanical and electrical services	36,000.00
4	**Subtotal**	**176,000.00**
G	***Priory Lane cottage***	
1	Replacement roof coverings and lead flashings, rainwater goods, soil and waste pipework, brickwork and render repairs and full external redecoration of all previously painted surfaces.	223,500.00
2	Internal fabric improvements	
3	Mechanical and electrical services	18,500.00
4	**Subtotal**	**242,000.00**
H	***Boundaries, roads, paths and yards***	
1	Sundry repair to boundary fencing, earth retaining walls, roads, paths, yards and white lining	**300,000.00**
J		
K	**GRAND TOTAL**	**13,850,000.00**

FOOTNOTES TO COSTS

With regard to each of the figures contained in the attached schedules please note that the costings are based upon the notes listed below.

1. The figures include allowances for preliminaries, main contractor's overhead costs and profit.

2. The figures are based on approximate quantities estimated from the visual inspection we carried out on the day of our inspection and are not based on detailed measurements.

3. We have not corroborated any of the figures by comparison with tenders from the marketplace and it should be noted that market conditions and tender factors are likely to produce figures which might differ from those given hereafter;

4. The figures have been prepared on the basis of general rates prevailing in the marketplace at present and are exclusive of:

- Financing Charges, if any;
- Value Added Tax;
- Professional Fees / additional survey costs;
- Statutory Fees;
- Fit out / repair and improvement works to any currently occupied tenant demise;
- Contingency sums;
- Major mechanical, electrical and public health services diversion or upgrade work.

5. We have assumed that all building work will be undertaken to similar details and using materials similar to those existing;

6. We have assumed that each item of work will be carried out under separate building contracts with appropriate contractors and at different times. It should be noted however that, if some works are carried out together under a single building contract, certain savings might accrue due to economies of scale. However where a set of works under a particular cost column all necessitate access scaffolding it is assumed that all items in the set of works will be undertaken simultaneously using the same scaffolding;

7. We have not included costings for those items of repair, cleaning, gardening, tree works or maintenance etc., which are currently being carried out;

8. Where our costs include for internal quasi fit out and repair and refurbishment work this is largely due to them being a consequential requirement of external repair (to roofs, doors and windows etc.) or mechanical and electrical works. Our costs our only intended to be a very high level assessment of internal "repair" work only. A detailed cost analysis of the full fit out and refurbishment of the estate is beyond the scope of this report and is subject to detailed design and specification. As such these costs are very sensitive to change.

8 Conclusion

The site and buildings present themselves with a significant immediate – short term backlog maintenance burden of £13,850,000.00 (thirteen million eight hundred and fifty thousand pounds). At the same time the group of buildings has received very little capital investment over the intervening years with the exception of The Grange which is now mostly tenanted and the Bank Lane cottages.

Ongoing repair and maintenance of older property is to be expected as the various building components become dilapidated and reach the end of their service lives.

We recommend you consider carefully whether this level of repair work is cost effective in relation to the asking price, future asking price once the works are complete and your long term plans for the use and ownership of this property.

Any acquisition, investment and development programme will require a detailed and co-ordinated approach. This building condition report and high level costings report must not be considered as a substitute for an option appraisal or feasibility study.

We strongly recommend you appoint the relevant suitably experienced and qualified specialists to undertake the additional technical due diligence advised in this report.

We recognise that your decision to proceed with this acquisition is dependent on professional advice from a number of sources and not just our comments alone. From a building surveyor's viewpoint, with the exception of our comments above, we have no reason to caution you against proceeding with the transaction proposed, but you should do so having first considered carefully, and reflected on, all the comments, recommendations and suggested action points in this report.

Appendix 1


Lighthouse fee and service proposal of 25th July 2019, terms and conditions of business and limitations applying to our professional service proposal.

Please note that for brevity case studies, brochures and CV's are omitted here.

THE BANK OF ENGLAND SPORTS CENTRE

LIGHTHOUSE REPORT

TITLE	Vendors Survey Fee Proposal
AT	The Bank of England Sports Centre
DATE	25 July 2019
VERSION	01

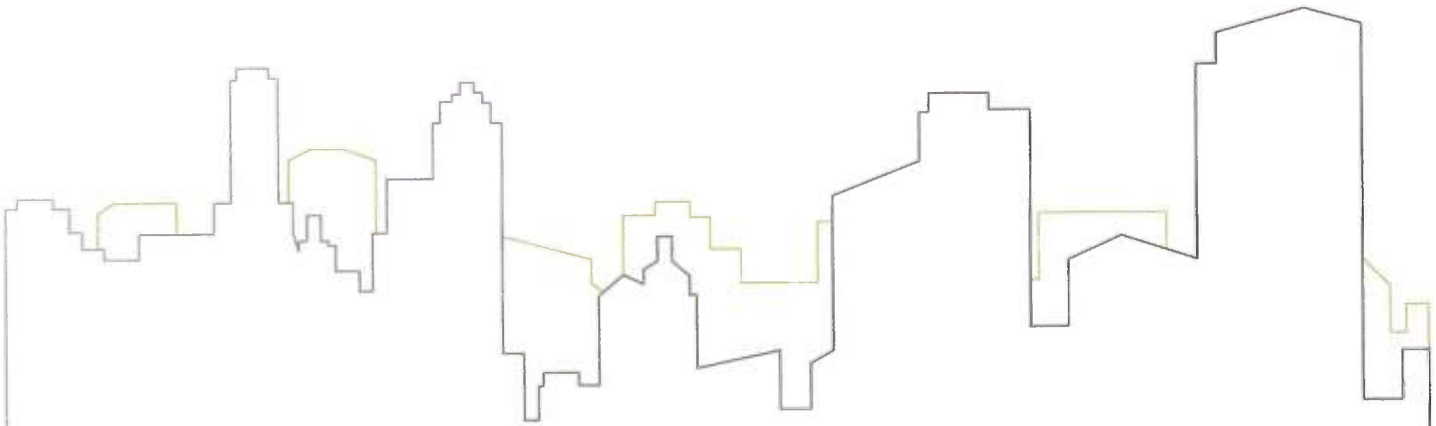

Registered Office | The Old Church, Quicks Road, London SW19 1EX. Registered in England and Wales. Registration No.7576812

RICS

Contents

Section 1	Confirmation of brief
Section 2	Why Lighthouse?
Section 3	Fee proposal
Section 4	Survey limitations and exclusions

Appendix

Appendix A	CV's
Appendix B	Case Studies
Appendix C	Company Brochure
Appendix D	Terms and Conditions of Business
Appendix E	Mechanical and electrical services consultant quotation

1 Confirmation of brief

We refer to your email request for a fee and service proposal to carry out a vendor's survey of the Bank of England Sports Centre on 24 July 2019.

The property is The Bank of England Sports Centre, Priory Lane, London SW15 5JQ. It comprises a variety of sports facilities, a separate five storey listed office building (The Grange), and three cottages. The site measures approximately 32 acres, and estimates of the floor areas are below:

Approx. GIA (sqft)

Pavilion - 25,800
Permanent Marquee - 3,900
Sports Hall & Swimming Pool - 25,600
Squash Courts - 3,200
The Grange (Offices) - 41,000
1 x 3 bed cottage - Unknown
1 x 4 bed cottage - Unknown
1 x 1 bed cottage – Unknown



2 Why Lighthouse?

Lighthouse is a niche, RICS regulated and Director lead firm of Chartered Building Surveyors based in London and operating throughout the United Kingdom.

We have over 20 years' experience across all building types, periods and market sectors:

- Heritage
- Residential
- Retail
- Office
- Education
- Healthcare
- Community
- Occupiers
- Hotels

Lighthouse comes with all the advantages of a niche business - competitive, efficient, friendly, jargon free, approachable and flexible.

Recent clients include:

3 Fee proposal

Our fixed fee breakdown is as follows:

Building survey	£13,500.00
Mechanical and electrical survey*	£8,500.00
Total	**£22,000.00**

All costs exclude VAT

Additional services if required:

Cherry picker	£1,000.00 per day

We note and confirm compliance with your requirement for the survey and report to be completed within 3-4 weeks of instruction.

*Our proposed mechanical and electrical services consultant who we routinely work with is Troup Bywaters + Anders Engineering Partnership. Please refer to their quotation Appendix E for more detail.

4 Survey limitations and exclusions:

- We will not carry out any opening up works or intrusive investigations.
- We will survey with the aid of surveyors ladders and binoculars from all reasonably accessible areas only. Rest assured we will use our best endeavours to gain access to all areas and if we have any concerns about the completeness of our survey and possible defects in relation to this we will advise accordingly.
- We have not allowed to carry out any testing, provide any specialist planning, environmental, passenger lift, acoustic, asbestos, conservation, swimming pool, sports surface or thermal modelling advice.
- We will not carry out a measured survey or produce any drawings.
- We will not provide a market valuation or fire re-insurance valuation.

TROUP BYWATERS + ANDERS
CELEBRATING 60 YEARS

183 Eversholt Street
London
NW1 1BU
T: +44 (0)207 504 1400
www.tbanda.com

Mike Bayliss

Director
The Old Church
Quicks Road
London
SW19 1EX

25 July 2019

Dear Mike,

RE: Bank of England Sports Centre – Vendor Report

We have pleasure in providing our response to your request for a proposal to prepare a vendor report for the above property. This email (the "Proposal") sets out the basis on which we will provide services to you in respect of the Project.

Services

We offer to carry out the following services (the "Services") on the terms set out in this Proposal:

- To undertake a visual, non-intrusive survey of the mechanical, electrical and public health installations within the property.
- Prepare a Vendor's Report to include:
  - A description of the extent of each system;
  - An assessment of existing condition, age, remaining service life and suitability.
- Record documentation made available will be will be reviewed to inform the inspection.
- A review of statutory compliance will be undertaken.

Clarifications

- All costs are exclusive of VAT
- Asbestos register is available and will be reviewed before works commence. Any issues identified that may impact the works will be highlighted to the client team.
- Surveys are visual, non-intrusive only.
- All costing by others.
- Safe access to all areas is to be afforded by the Client.
- Services included:
  - HV/LV distribution (Mains switchgear to distribution boards)
  - Sub Main Distribution (Distribution Boards)
  - Small power distribution (cabling and outlets)
  - Fixed Fire extinguishing systems
  - Ventilation and A/C systems
  - Cooling systems
  - Heating systems

INVESTORS IN PEOPLE | Platinum Until 2019
UK GREEN BUILDING COUNCIL Member
Apprenticeships National Awards 2016 Winner
PRINCESS ROYAL TRAINING AWARD 2017
construction INVESTING IN TALENT awards 2017 Winner

Partners Neil Weller Peter Anderson Paul Monaghan Terry Canty Neil Panton Kevin Killoran Rob Cargill Stephen Wood Andrew Hixson Alan Newman Tom Smith David Arnold John Crane Allan Cross Paul Bradley Adrian Wordsworth Stephen Ogden Tony Crow Kevin Searle Mark Bateman James Campbell **Associates** John Gallen Chris Neophytou Stewart Cue Kevin Critchell Robin Kemmish Martin Goswell Ian Hubbard Andrew Campbell Martin Ingram Dean O'Flynn Danny Pattle Derek Hutchings Naddy Parperi Robert Robinson Tony Atkinson Brian Doran Steven Dunn David McAuley Gareth Davies **Partnership Secretary** Clive Healey **Offices** Belfast Cardiff Edinburgh Glasgow Leeds London Manchester Reading **MERGE Associated Offices** Austria Belgium Czech Republic Denmark Finland Germany Italy Norway Poland Portugal Spain Sweden Switzerland The Netherlands Turkey

  - Domestic water systems
  - Fuel systems
  - BMS and controls
  - Lighting and emergency lighting
  - UPS systems
  - Fire alarm system
  - Diesel generator
  - Lifts (visual inspection only)

- Specific exclusions at this stage are:
  - BT/Telecoms
  - Security installations
  - IT installations
  - TV/AV systems
  - Below ground drainage
  - Specialist lift surveys
  - Specialist equipment

- Provision of ladders and other access equipment is excluded.
- CCTV surveys are excluded.
- Preparation of an asset register.
- Preparation of a life cycle model.
- Removal and reinstatement of access panels which require lifting of weights greater than 10kg, are above 2m from level floor, or are greater than 1m x 1m in size or require tools to remove are excluded.
- Provision of remedial works to affect any equipment repairs, reinstatements, etc.
- Functional and operational testing of systems is excluded.
- Access to roofs were safe access is provided by the Client.
- Drone surveys are excluded.
- Environmental surveys and assessments are excluded.
- Energy assessment, review, EPC and DEC are excluded.

Fee

We offer to provide the Services in accordance with the fee basis provided in Appendix 1 (the "Fee"). If Appendix 1 is not complete or not provided, the Fee payable to TB+A shall be calculated in accordance with the hourly rates of Partner £123, Associate £108, Senior Engineer £95, Intermediate Engineer £81, Technician/CAD £70, BIM/3D Drafter £85, each plus VAT (subject to adjustment as may be notified by TB+A after the start of each calendar year) and all expenses and disbursements incurred.

TROUP
BYWATERS
+ ANDERS

Conditions

We will provide the Services in accordance with the terms of this Proposal and Conditions provided at Appendix 2 attached, which are hereby incorporated into this Proposal.

Your continuing instructions in relation to the Project will amount to your acceptance of this Proposal on the terms set out, but please confirm your agreement to this Proposal and the Conditions by return.

We hope this proposal is of interest to you.

Yours sincerely,

James Campbell
Partner

Troup Bywaters + Anders
Bringing buildings to life
T: 0207 504 1400
M: 07429 181746
E: j.campbell@tbanda.com

Belfast | Cardiff | Edinburgh | Glasgow | Leeds | London | Manchester | Reading

TROUP
BYWATERS
+ ANDERS

Appendix 1 - Schedule of fees

Fees and expenses payable hereunder shall be paid by instalments at the following intervals:

To complete the services listed within this proposal:-

£8,500.00 exc VAT

Time-based fees shall be based on the following rates:

Level/Grade	Rate per hour / day
Partner	£140.00;
Associate	£116.00;
Senior Engineer	£103.00;
Intermediate Engineer	£89.00;
Technician/CAD	£79.00;
BIM/3D Drafter	£93.00.

TROUP
BYWATERS
+ ANDERS

Appendix 2 - Conditions

1. Definitions

1.1. In this Agreement (unless the context otherwise requires):

1.1.1. **"Agreement"** means the Proposal (including any documentation attached to or referred to therein) together with these Conditions;

1.1.2. **"Client"** means as stated in the Proposal to which the Proposal is addressed;

1.1.3. **"TB+A"** means Troup, Bywaters + Anders, a partnership whose principal place of business is at 183 Eversholt Street, London, NW1 1BU;

1.1.4. **"Fee"** is as defined in the Proposal;

1.1.5. **"Parties"** means the Client and TB+A;

1.1.6. **"Project"** is the project stated in the Proposal;

1.1.7 **"Proposal"** is the email to which these Conditions relate and where details of the Fee, Project, Services and other particular requirements are set out;

1.1.8. **"Services"** are as defined in the Proposal.

2. Services

2.1. TB+A shall exercise reasonable skill and care in the performance of the Services. Notwithstanding any other provision of this Agreement, TB+A shall have no greater obligation in respect of the Services than to exercise the level of skill and care required by this clause 2.1. Nothing in this Agreement or otherwise shall impose any obligation, warranty or guarantee (whether express or implied) on or from TB+A that the Services shall be fit for any particular purpose or suitable for use

2.2. TB+A shall comply with the Client's reasonable written instructions in connection with the Services. Where the Client gives instructions changing the Services (which shall include any addition, alteration or variation thereto and any abortive work), the Client and TB+A shall acting reasonably agree a fair and reasonable adjustment to the Fee. Where such agreement cannot be reached, the Fee shall be adjusted on a fair and reasonable basis having regard to the Fee.

2.3. Any timescale provided in the Proposal for completion of the Services are estimates only. Where any programme is agreed by the Client and TB+A from time to time, TB+A shall use reasonable endeavours to comply with such programme.

2.4. Where for reasons beyond TB+A's reasonable control TB+A is delayed in performing the Services and/or is required to carry out any additional services or, altered or varied Services, TB+A shall be entitled to additional time to perform the Services to the extent of such delay and/or for a reasonable time commensurate with the additional services or altered or varied Services, and shall not be in breach of this Agreement as a result of such delay. In such circumstances TB+A shall also be entitled to additional Fee calculated on the same basis as in clause 2.2.

3. Client obligations

3.1 The Client shall:

3.1.1 provide all data, information and materials, obtain and maintain any necessary licences, permits, consents and other approvals, give all access and give any decisions, approvals, confirmations or instructions, as TB+A may reasonably require and/or are necessary for the performance of the Services in a timely manner; and

3.1.2 comply with its duties, and ensure that the principal designer and all other designers engaged in respect of the Project shall comply with their respective duties, under the Construction (Design and Management) Regulations 2015. TB+A is not appointed as principal designer under or in connection with this Agreement. The Client shall ensure that a third party performs the role of principal designer on the Project until the Services are complete.

4. Documents

4.1 The intellectual property rights in all drawings and/or other documents produced by TB+A pursuant to this Agreement ("Documents") shall vest in or remain vested in TB+A. The Client shall have a licence to use the Documents produced for delivery to the Client for any purpose connected with the Project (other than the reproduction of any designs contained in the Documents in any extension to the Project)

5. Fee

5.1. TB+A shall be paid the Fee in performing the Services subject to VAT at the rate prevailing at the date of any invoice.

5.2 TB+A shall submit invoices on a monthly basis or as otherwise specified in the Proposal. The Fee will become due on the date of submission of TB+A's invoice, which shall specify the sum TB+A considers is due on the payment due date and the basis on which that sum is calculated. The final date for payment of any sum due under this Agreement shall be 30 days after the due date.

5.3. The sum stated as being due in TB+A's invoice shall be paid by the final date for payment unless the Client has not later than seven days before the final date for payment given notice that it intends to pay less specifying the sum that the Client considers to be due on the date the notice is served and the basis on which the sum is calculated. The amount stated as due in any valid pay less notice shall be paid by the Client on or before the final date for payment.

5.4. All amounts due and payable to TB+A shall be paid in full without any set-off, counterclaim, deduction or withholding (other than any deduction or withholding of tax as required by law). If any amount due and payable is not paid by the final date for payment (without prejudice to any other right or remedy) TB+A is entitled to interest in accordance with the Late Payment of Commercial Debts (Interest) Act 1998

6. Suspension and termination

6.1 TB+A may suspend performance of all or part of the Services by giving 7 days' notice in writing if payment of any amount due and payable to TB+A is not received by the final date for payment or if as a result of any circumstances for which TB+A is not responsible, TB+A considers that it is impossible or irresponsible for it to perform all or part of the Services. If such suspension continues for 14 days and the event giving rise to suspension has not been remedied by the Client, TB+A may terminate by immediate notice

6.2 TB+A may serve 14 days' written notice of its intention to terminate if the Client is in material breach of its obligations in this Agreement or payment of any amount due and payable to TB+A is not received within 14 days of the final date for payment. If the Client fails to rectify the circumstances this clause in such 14 day period, TB+A may at the expiry of that period give further written notice terminating its employment hereunder with immediate effect. In the event of the Client's insolvency as defined by section 113, Housing Grants, Construction and Regeneration Act 1996, or any breach by the Client of the Bribery Act 2010, TB+A shall be entitled to immediately terminate the Agreement.

6.3. If for any reason TB+A's employment is suspended or terminated, TB+A shall be paid any Fee due and payable at the date of termination or suspension, any reasonable [illegible] expenses and/or losses incurred by TB+A as a result of such suspension or termination, and a fair and reasonable proportion of any Fee instalments in respect of which the Services are part-performed at the date of termination.

7. Insurance

7.1. Provided such insurance is available on commercially reasonable rates TB+A shall maintain professional indemnity insurance with such limit of indemnity as is sufficient to cover TB+A's total liability under this Agreement in accordance with clause 8.1 from commencement of the Services until 3 years after the completion of the Services or termination of this Agreement, whichever is earlier.

7.2. Without prejudice to the generality of the foregoing, TB+A shall not be obliged to take out or maintain insurance against liability in respect of terrorism, pollution or contamination or arising out of or resulting from or associated in any way with asbestos or any structure, building, product waste or other material that contains asbestos.

8. Liability

8.1. Notwithstanding anything to the contrary contained in this Agreement and without prejudice to any other provision in this Agreement whereby TB+A's liability is excluded or limited to a lesser amount, TB+A's total aggregate liability under or in connection with this Agreement shall not exceed the lesser of 10 times the total Fee payable to TB+A or £1,000,000.00 (One Million Pounds) howsoever that liability arises including, without limitation, in contract, in tort, in negligence, for breach of statutory duty or otherwise, provided that this clause 8.1 shall not exclude or limit TB+A's liability for death or personal injury caused by TB+A's negligence or for fraud or fraudulent misrepresentation.

8.2. Notwithstanding any other provision of this Agreement:

8.2.1. TB+A shall not be liable for any loss of income, loss of actual or anticipated profits, loss of business, loss of contracts, loss of goodwill or reputation, wasted management time, loss of anticipated savings, loss of, damage to or corruption of data, or for any special, indirect or consequential loss or damage of any kind, in each case howsoever arising, whether foreseeable or in the contemplation of the Parties and whether arising in or for breach of contract, tort (including negligence), breach of statutory duty, indemnity or otherwise;

8.2.2. TB+A's liability to the Client under or in connection with this Agreement shall not exceed such sum as it would be just and equitable for TB+A to pay, having regard to the extent of TB+A's responsibility for the loss and/or damage and on the assumption that all other consultants, contractors, sub-contractors and other persons involved in the Project have paid to the Client such sums as it would be just and equitable for them to pay; and

8.2.3. TB+A shall have no liability whatsoever and however so arising out of or in connection with asbestos and/or pollution and contamination in relation to the Project. The Client shall indemnify and keep indemnified TB+A against any losses, claims, costs, damages, or expenses arising out of or in connection with asbestos and/or pollution and contamination in relation to the Project.

8.3. The Client agrees not to pursue any claims in contract, tort or for breach of statutory duty (including negligence) against any individuals working or employees who work for TB+A in their personal capacity at any time. The Client acknowledges that such individuals are entitled to enforce this term pursuant to the Contracts (Rights of Third Parties) Act 1999.

8.4 Without prejudice to any shorter statutory limitation period, no action, claim or proceedings arising out of or in connection with this Agreement (howsoever arising) shall be commenced after the expiry of a period of 3 years from the completion of the Services or termination of this Agreement, whichever is earlier

8.5. Building information models produced in performing the Services ("Models") are for TB+A's use only. The Client shall indemnify and keep indemnified TB+A against any losses, claims, costs, damages, or expenses arising out of or in connection with the use and or reliance on any Models by the Client or any third party

9. Third party rights, assignment and sub-contracting

9.1 Save as provided in clause 8.3, nothing in this Agreement confers any rights or benefit on any third party to enforce any term of this Agreement pursuant to the Contracts (Rights of Third Parties) Act 1999. TB+A will not provide any collateral warranties under or in connection with this Agreement.

9.2. Neither the Client nor TB+A shall assign or transfer any benefit or interest under this Agreement without the prior written consent of the other

9.3. TB+A reserves the right to employ such sub-consultants and specialists as it deems necessary to carry the Services. Where any other person or persons are engaged by TB+A on the Client's behalf, TB+A shall have no liability whatsoever for any act, omission or otherwise of such person or persons

10. General

10.1 This Agreement constitutes the entire agreement between the Parties and supersedes any previous arrangement, understanding or agreement between them relating to or connected with this Agreement and/or the Services (whether oral or in writing) and any terms and conditions submitted by the Client (whether before or after the date of the Proposal) or contained in any letter, purchase order. For the avoidance of doubt, unless expressly stated in the Proposal this Agreement does not require TB+A to comply with, and TB+A shall have no additional obligations and/or liabilities arising out of or in connection with, any agreement between the Client and any third party

10.2. This Agreement sets out the full extent of TB+A's obligations and liabilities arising out of or in connection with the Services and there are no conditions, warranties, representations or terms, express or implied, that are binding on TB+A, except as specifically stated in this Agreement. Any condition, warranty, representation or term which might otherwise be implied into or incorporated in this Agreement whether by statute, common law or otherwise, is hereby expressly excluded

10.3. This Agreement shall be governed by English law and the English courts shall have jurisdiction with regard to all matters arising under it. If a dispute or indifference arises under this Agreement which either party wishes to refer to adjudication then Part 1 of the Scheme for Construction Contracts Regulations in force at the date of the referral shall apply and the nominating body shall be the Construction Industry Council

LIGHTHOUSE

TERMS AND CONDITIONS OF BUSINESS

General

1. These terms and conditions together with the terms of our appointment letter to you, sets out the terms on which we accept your appointment. These terms will apply to all our work for you unless expressly amended in writing. The expression "we", "us" or "the company" means the member of Lighthouse Surveyors stated in the appointment letter.

2. We will rely on you to supply in a timely manner, all instructions and information needed by us to act on your behalf. We will rely on you to inform us of any changes to those instructions or that information and to any other relevant circumstances. We are not under any obligation to check the accuracy of information you supply unless it is agreed in writing that we should do so.

3. Unless otherwise agreed in writing the services we provide are for the benefit only of the party to whom these terms and conditions are sent and as specified in the accompanying appointment letter. A person who is not a party to our appointment has no right under the Contracts (Rights of Third Parties) Act 1999 to enforce any term of our appointment.

Fee Basis

4. The basis of our fees for individual instructions will be confirmed in our appointment letter.

5. Where work can be precisely defined, we will quote a fixed fee, fixed fees are typically expressed either as simple 'lump sums' or as a percentage of final construction cost (in building projects).

6. Unless agreed otherwise, where a fixed fee has been identified and work is required that falls outside the agreed scope of services, the fees for the additional work will be calculated on a time charge basis. Time-charging means that our fee is determined by the time spent by those who deal with the instruction. The hourly rates that will apply to the instruction are confirmed in our appointment letter.

7. Unless stated otherwise, fees are quoted exclusive of Value Added Tax, which shall be added to our charges at the rate in force at the date the fees are rendered.

8. Our fee invoices will be submitted at appropriate stages of our work regardless of whether or not the matter proceeds to completion. For building inspections and other reports, this will typically be with or immediately after submission of the report. For on-going instructions interim fees will normally be submitted on a monthly basis.

Disbursements

9. We will agree with you whether or not disbursements will be added to our quoted fees or whether they are included. Unless otherwise stated, our quoted fees will usually include disbursements for internal expenses incurred in discharging the instruction, such as travel, subsistence, photography, printing, copying, binding, postage. Where disbursements will be charged in addition to the fee, for example for specialist testing, specialist equipment hire, bulk printing, couriers, HM Land Registry searches, OS digital maps, etc, this will be confirmed in writing and the expenses will be charged at cost as disbursements. Value Added Tax is payable on certain disbursements and expenses.

Other Costs

10. Unless otherwise agreed we expect the appointment of specialist consultants when required to be made direct by our clients. Where we undertake to co-ordinate and integrate specialist consultants' work subsequent to our initial instruction our additional fees for doing so will usually be calculated on a time-charge basis.

11. Unless otherwise stated we generally expect costs of consultants working under our control, planning applications and Building Regulation applications to be met directly by our clients.

12. Where access to premises is arranged but is not available at the confirmed time and date, resulting in an abortive visit, we reserve the right to charge for any additional time spent and expenses incurred.

Suspending and Terminating Instructions

13. A surveyor appointed under section 10 of the Party Wall etc. Act 1996 holds thereafter a statutory appointment, which may not be rescinded. For all other appointments you may terminate or suspend our services by giving seven days written notice by post or facsimile addressed to the Client Director with whom you are dealing. Notification by e-mail cannot be accepted.

14. If either party becomes insolvent the other may terminate the appointment forthwith by giving written notice to the other.

15. In the event that you default in payment we may, on giving seven days written notice, suspend performance of our services. Performance will be resumed upon payment unless the suspension exceeds 6 months.

16. We may terminate the appointment if:

- you materially breach your obligations and have failed to remedy the breach within 14 days following written notice given by us and/or.
- without good reason you fail to give us information or instructions in a timely manner and/or.
- there is a serious breakdown in confidence between you and us and/or
- any other circumstances arise, which as a matter of law or practice, entitle us to terminate our appointment and/or
- our services are suspended for more than six months.

17. Within 21 days following suspension or termination you shall pay all fees and expenses due, commensurate with the services performed, up to the date of suspension or termination including time spent in the seven day period following any termination in closing down the instruction.

Payment Terms

18. Our fee invoices are due for payment in full on presentation, in sterling and without any deduction, set off abatement or counterclaim. In accordance with the Late Payment of Commercial Debts (Interest) Act 1998, we reserve the right to charge interest at 8% above the Bank of England's

base rate on any fee invoices that are not paid within 21 days from the date of issue.

19. If you disagree with, or have queries about a fee invoice we request that you notify us within 14 days from the invoice date, after which time we will assume that you have agreed its content. If you do dispute any part of the invoice and so notify us you shall nonetheless pay all items which you do not dispute pending resolution of the balance.

20. We will be entitled to keep all your papers and documents while there is any money properly owing to us for our fees and expenses.

Exclusions and Limitations on Liability

21. Where you have a number of advisers including the Company advising on a matter, our liability shall be limited to that proportion of any loss or damage suffered by you as it would be just for us to pay having regard to our responsibility for it and on the basis that all other advisers liable for the same loss or damage shall be deemed to have paid you such proportion which it is just for them to pay having regard to the extent of their responsibility.

22. Unless otherwise agreed our maximum aggregate liability to you for any breach of contract, negligence or breach of statutory duty or otherwise is limited to five million pounds (£5,000,000.00) except that nothing in these terms and conditions shall exclude or limit our liability in respect of fraud or death or personal injury caused by us.

Asbestos

23.1. If we undertake any services in relation to a building or structure containing **asbestos or asbestos containing materials** in addition to the limitations on liability set out in paragraphs 21 and 22 our liability is limited to the direct result of our negligence or breach of contract and to the cost of re-performance of our services and/or rectification or remediation (as appropriate) or the diminution in value of any buildings or structures we survey.

23.2. We shall not be liable for:

- any damage to property other than the building/or structure or any part thereof which requires re-performance of our services and/or rectification and/or remediation;
- death, injury, illness or disease whether physical or mental;
- physical impairment or damage to any ecological system;
- consequential indirect, economic or financial loss;
- any analysis and/or testing undertaken by asbestos testing organisations on your behalf whether instructed by you or us;

due to or arising from the presence or release of asbestos or asbestos containing materials.

Complaints

24. We operate a Complaints Handling Procedure, a copy of which is available upon request.

Data Protection Act 1998 ("the Act")

25. Any personal data which we obtain from you for the purposes of or in performing our services will not be disclosed to third parties without your consent or as required by law.

26. Your name and contact details will be placed on our contacts database which we use for the purpose of sending mailings by post and email which you have requested or which we believe may be of interest to you. If you have any objection to your details being held on our database please inform us (email spencer@lighthousesurveyors.com) and we will arrange for your details to be removed from our database.

Insurance Mediation Activities

27. This company is not authorised by the Financial Services Authority. Lighthouse Surveyors is regulated by the Royal Institution of Chartered Surveyors (RICS).

Copyright

28. Copyright in all documents produced or used by us in connection with any appointment shall remain with us but subject to the payment of our fees in accordance with these terms and conditions we grant you a licence to copy and use the documents in connection with the subject matter of the appointment.

Health and Safety

29. The promotion of health, safety and welfare measures is an essential objective and so all reasonably practicable measures are taken to minimise risk to anyone else who may be affected by our operations.

30. We will rely upon you to advise us if you are aware of any particular risks to the safety and health of our employees who may be inspecting or visiting properties under your instructions.

31. We will also ask you to supply, in a timely fashion, the contact details of the person responsible for the property so that we may discuss particular or unusual risks with them and plan accordingly.

Jurisdiction and Disputes

32. These Terms and Conditions and our appointments are governed by English law.

33. Any dispute arising from or under these Terms and Conditions and/or any appointment shall be referred to and determined by an arbitrator to be agreed between you and us or in default of agreement, shall be appointed upon the application of either party by on behalf of the Vice President or President for the time being of the Royal Institution of Chartered Surveyors.

Appendix 2

Photographs



Photo 1 – The Grange. Cracking to stone work and regular circular cut outs indicative of past or current steel frame corrosion monitoring or repair.



Photo 2 – The Grange. Bulging south wing flank wall masonry.



Photo 3 – The Grange. Original Crittal window in timber sub frame.



Photo 4 – The Grange. Original Crittal window.



Photo 5 – The Grange. The main flat roof.



Photo 6 – The Grange. Main flat roof.



Photo 7 – The Grange. Main flat roof and pitched roofs to plant rooms.



Photo 8 – The Grange. Georgian wired glazed roofs at rear.



Photo 9 – The Sports Centre. Single glazed upvc windows.



Photo 10 - The Sports Centre. Single glazed upvc windows.



Photo 11 - The Sports Centre. Main flat roof.



Photo 12 - The Sports Centre. Main flat roof perimeter.



Photo 13 - The Sports Centre. Spalling resin coating to concrete frame.



Photo 14 - The Sports Centre. Damaged and faded GRP cladding.



Photo 15 - The Sports Centre. Damaged and faded GRP cladding.



Photo 16 - The Sports Centre. Timber cladding.



Photo 17 - The Sports Centre. Rainwater pipework.



Photo 18 - The Sports Centre. Asphalt walkway.



Photo 19 – Sports Hall. Cracked resin coating over concrete.



Photo 20 – Pavilion. Typical window.

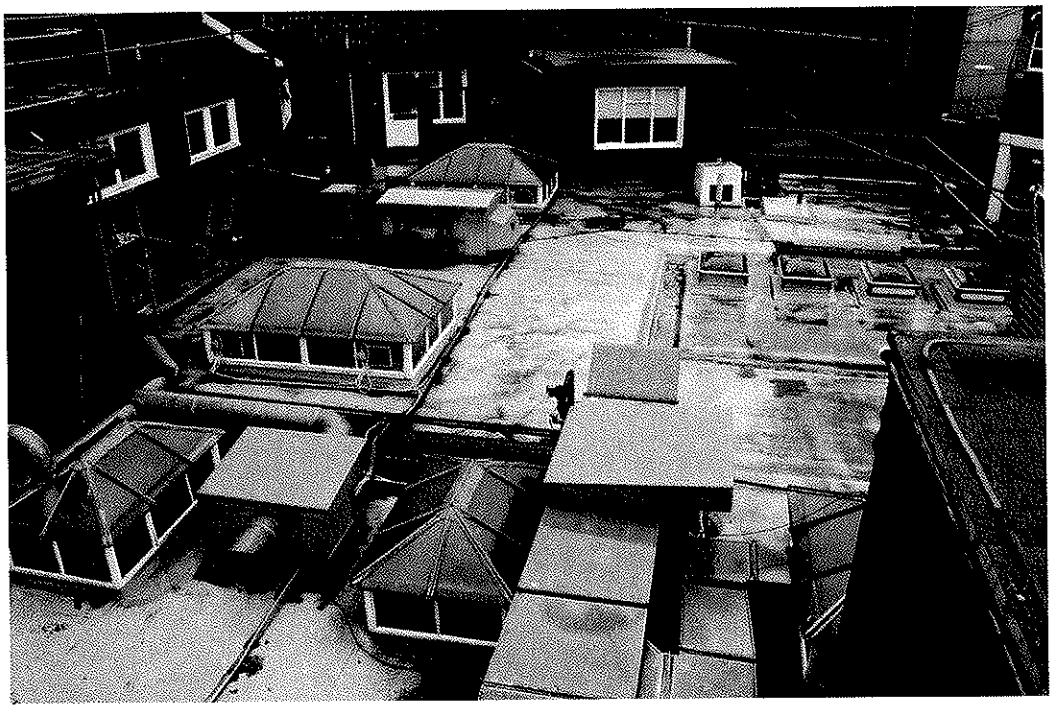


Photo 21 – Pavilion. Typical flat roof.

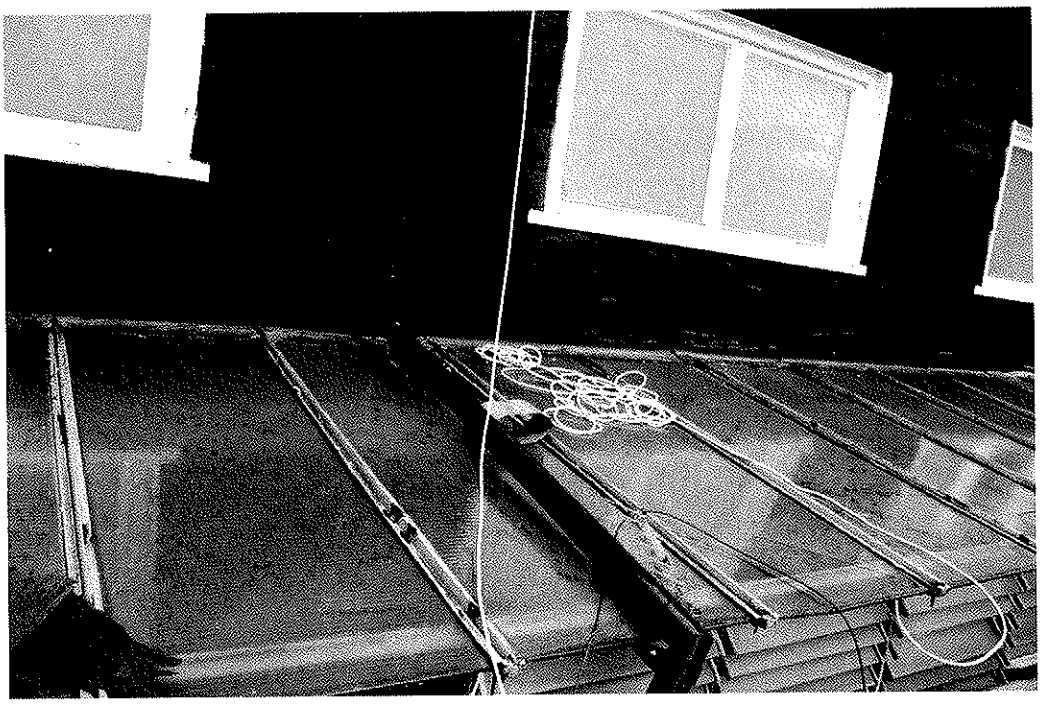


Photo 22 – Pavilion. Cladding.



Photo 23 – Squash Court. Pitched roof.



Photo 24 – Squash Court. Pitched roof.



Photo 25 – Squash Courts. Flat roof.



Photo 26 – Squash Courts. Rear elevation yard level planter brickwork cracking.



Photo 27 – The Grange. Ground floor reception. North Wing.



Photo 28 – The Grange. Central stairwell.



Photo 29 – The Grange. South stairwell.



Photo 30 – The Grange. South stairwell.



Photo 31 – Sports centre swimming pool.



Photo 32 – Sports centre swimming pool. Changing area.



Photo 33 – Pavilion. Restaurant.



Photo 34 – Pavilion. Kitchen.



Photo 35 – Marquee.



Photo 36 – Squash Courts.



Photo 37 – 2 Bank Lane cottage. Roof leak.



Photo 38 – 1 Bank Lane cottage. Slight structural cracking.



Photo 39 – 2 Bank Lane cottage. Wasps nest.



Photo 39A – Swimming pool plant area / basement.



Photo 40 – Defective boundary fencing.



Photo 41 – Defective boundary fencing.



Photo 42 – Faded white lining.



Photo 43 – Defective earth retaining wall.



Photo 44 – Cracked, defective and uneven paving.



Photo 45 – Worn / perished road wearing surface.


Appendix 3


Available Plans

- The Grange – South Wing only – basement, ground – to fourth floor level (June 2004);
- Site (sketch) plan (August 2019);
- Priory Lane cottage – ground and first floor plan (November 2007);
- Pavilion – Basement, ground and first floor level (December 2009);
- Bank Lane cottages – ground and first floor level (February 1998);
- Sports Hall and Swimming Pool - ground, first, second and third floor level (January 2010).


These drawings usefully indicate the general extent and a layout (in part) of the above buildings. We are advised these drawings (and any areas or dimensions given) are not an up-to-date or complete set and most not be relied upon for any measurement or layout purposes whatsoever.

We have recommended elsewhere a full measured / topographical survey of the site.



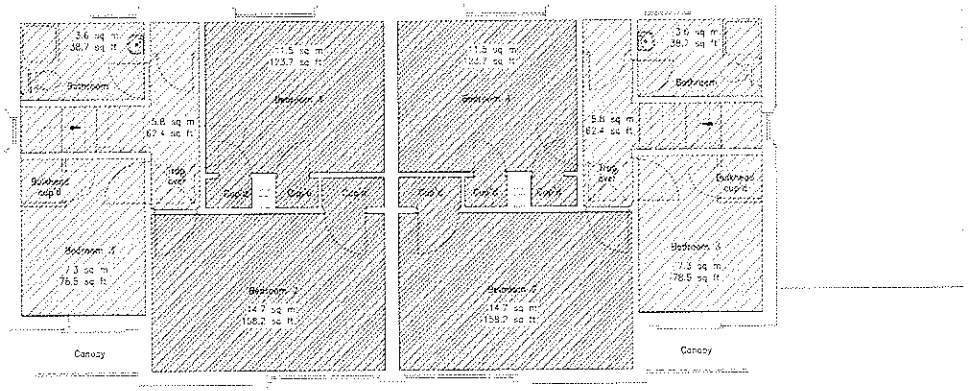

FIRST FLOOR PLAN

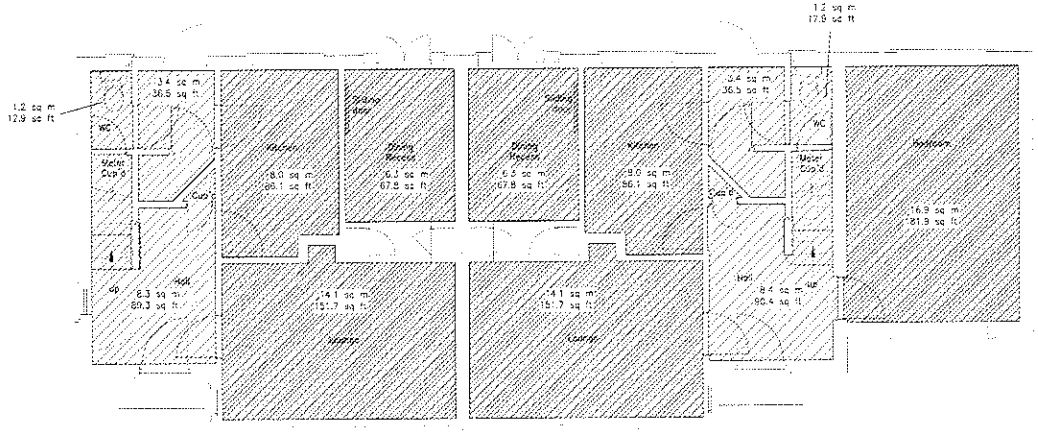

GROUND FLOOR PLAN





Project:

Title: ROEHAMPTON SPORTS CLUB
RECORD OFFICE COTTAGES


Dept/Team: Date: Feb 1998 Scale: 1:50 @ A1

Floor	Zone	Project No.	Dwg Stage	Dwg No.	Rev
G					G



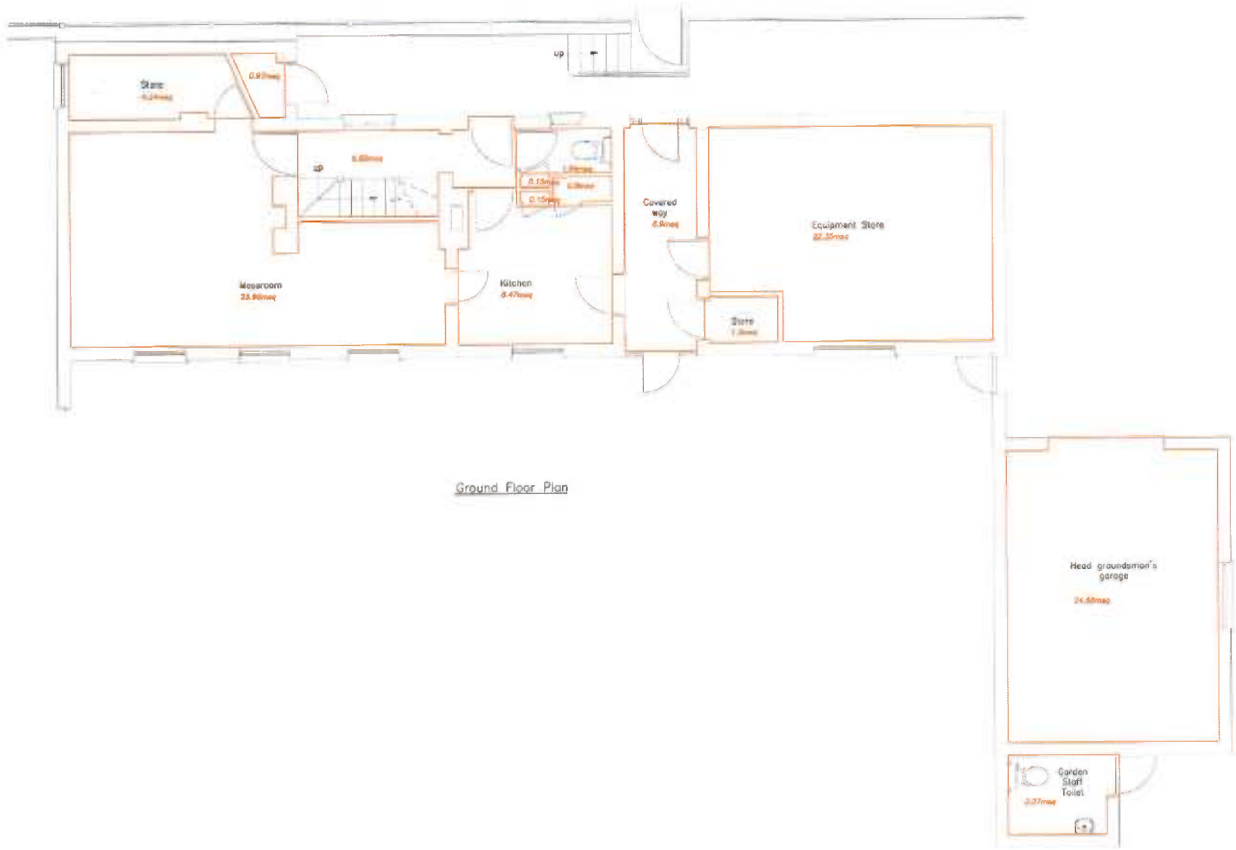

Ground Floor Plan

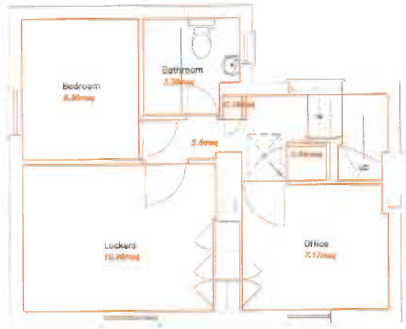

First Floor Plan



Project:

Title: CLARENCE FARM
ROEHAMPTON

Dept/Team: Date: Nov. 07 Scale: 1:50 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

G&1


Project:

Title: THE GRANGE ROEHAMPTON

Date: 21 JUNE 0[illegible] Scale: 1:50 @ A1

Dwg/Team:

Floor Zone Project No. Dwg Stage Dwg No. Rev

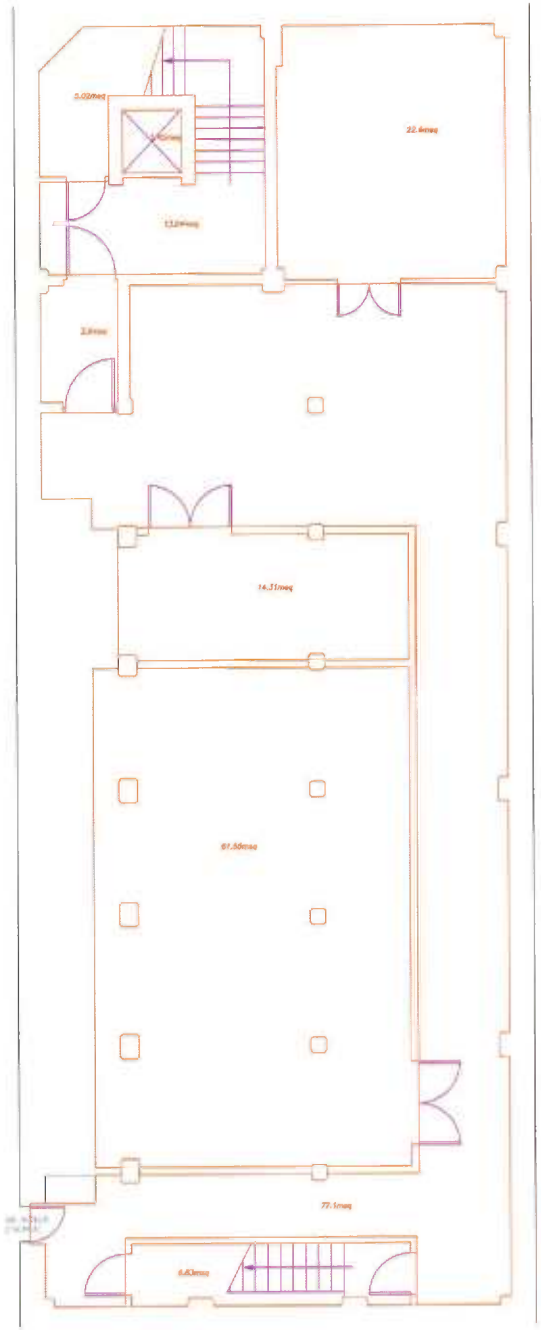


Project:

Title: THE GRANGE
ROEHAMPTON

Dept/Team: Date: 21 JUNE 0 Scale: 1:50 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

B

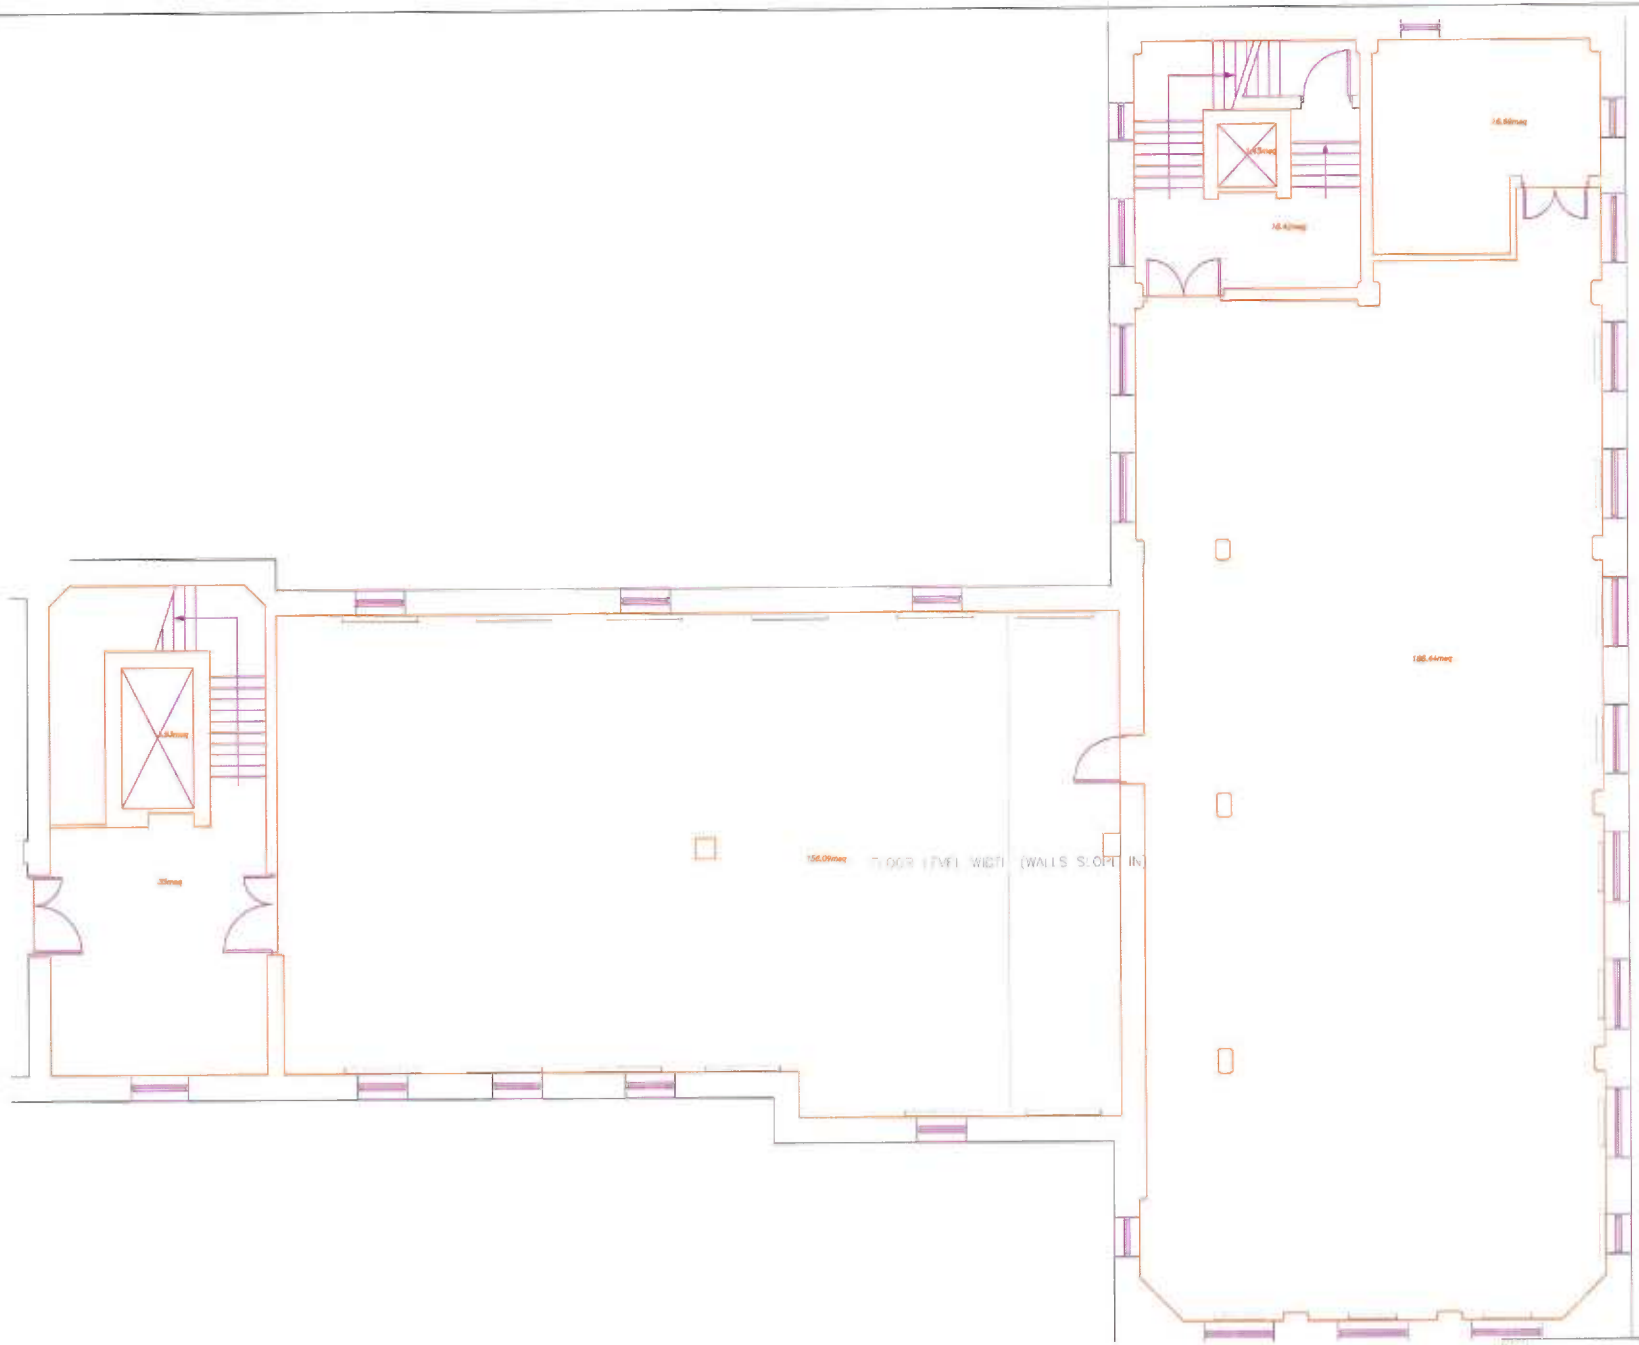

Project

Title: THE GRANGE
ROEHAMPTON

Dept/Team: Date: 21/06/04 Scale: 1:50 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

4

Project:


Title: THE GRANGE ROEHAMPTON

Dept/Team:

Date: 21/06/04 Scale: 1:50 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

3

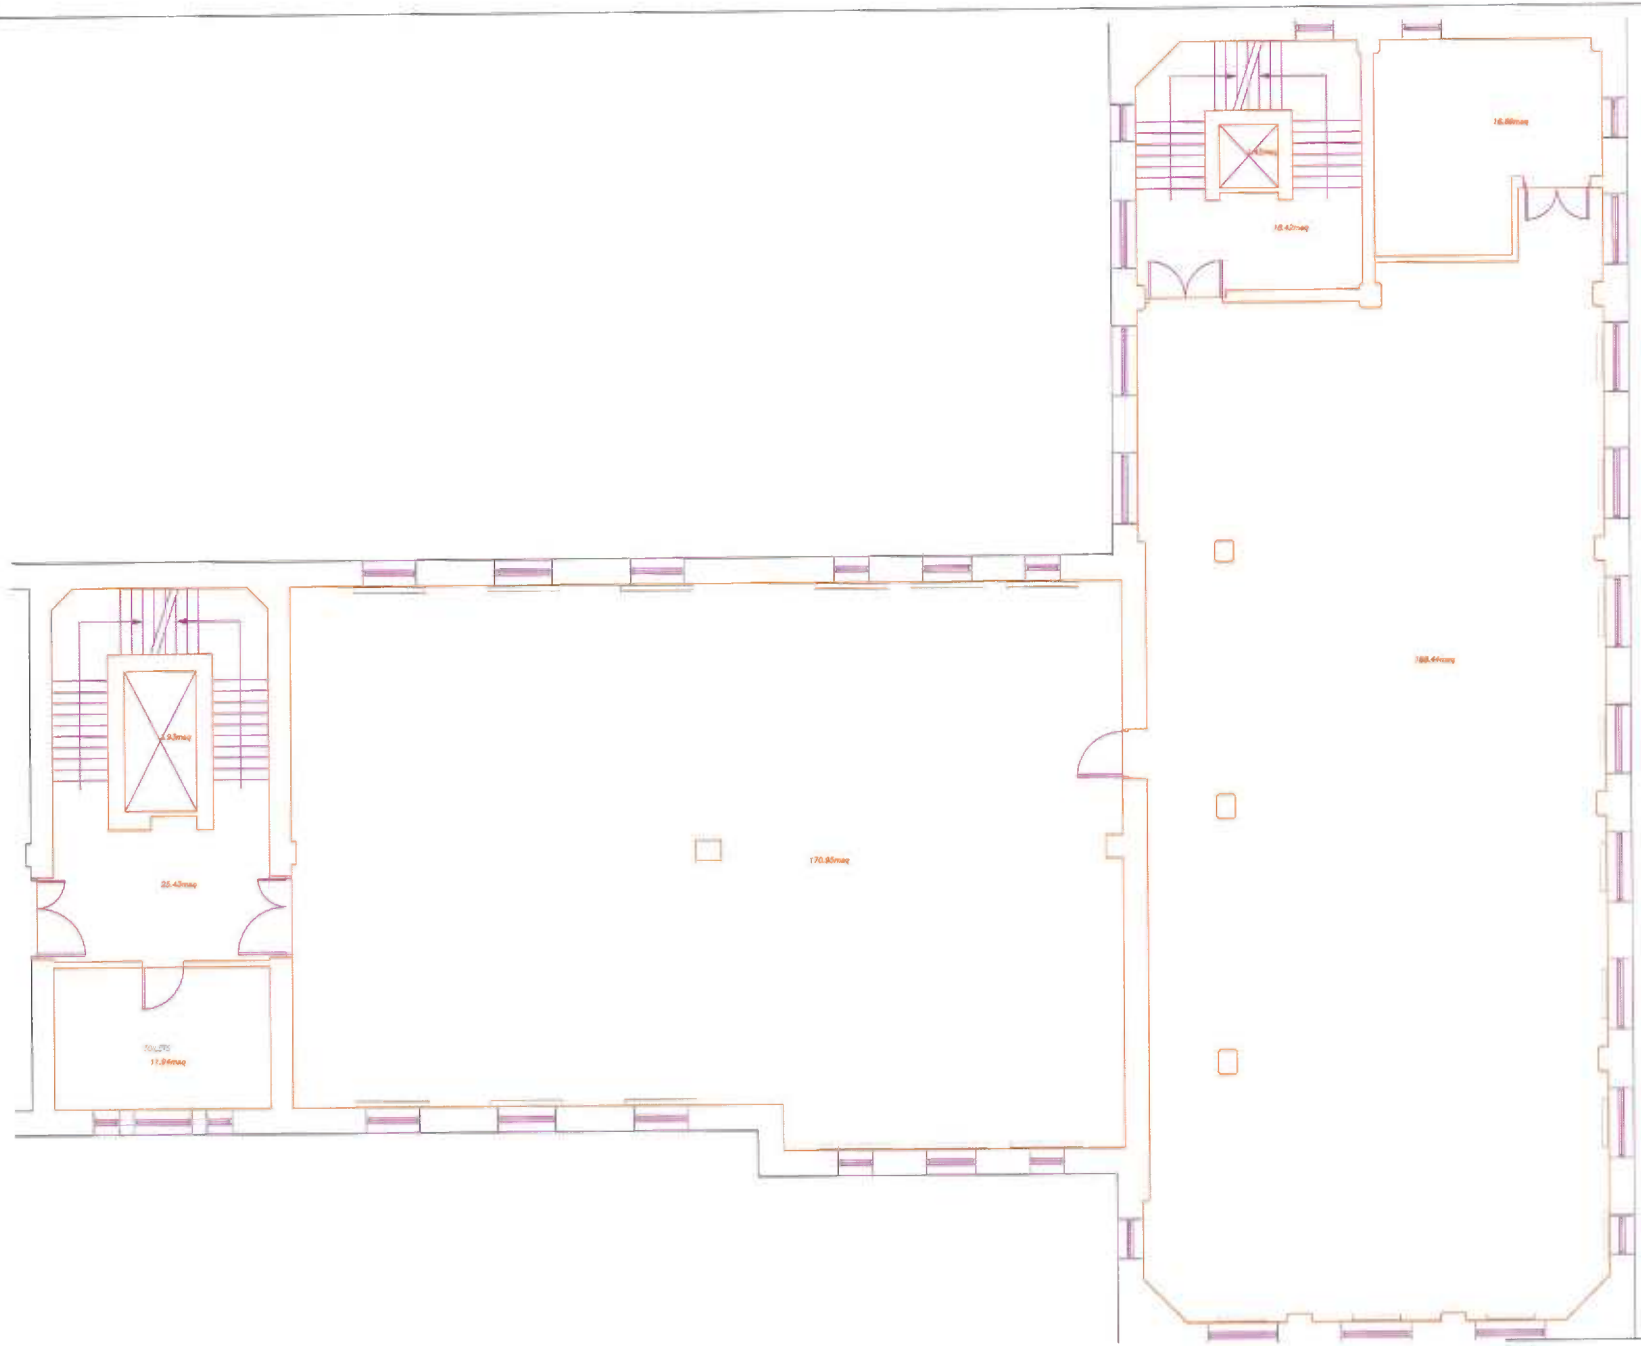

Project:


Title: THE GRANGE
ROEHAMPTON

Dept/Team: Date: 21/06/04 Scale: 1:50 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

2

THE GRANGE
ROEHAMPTON

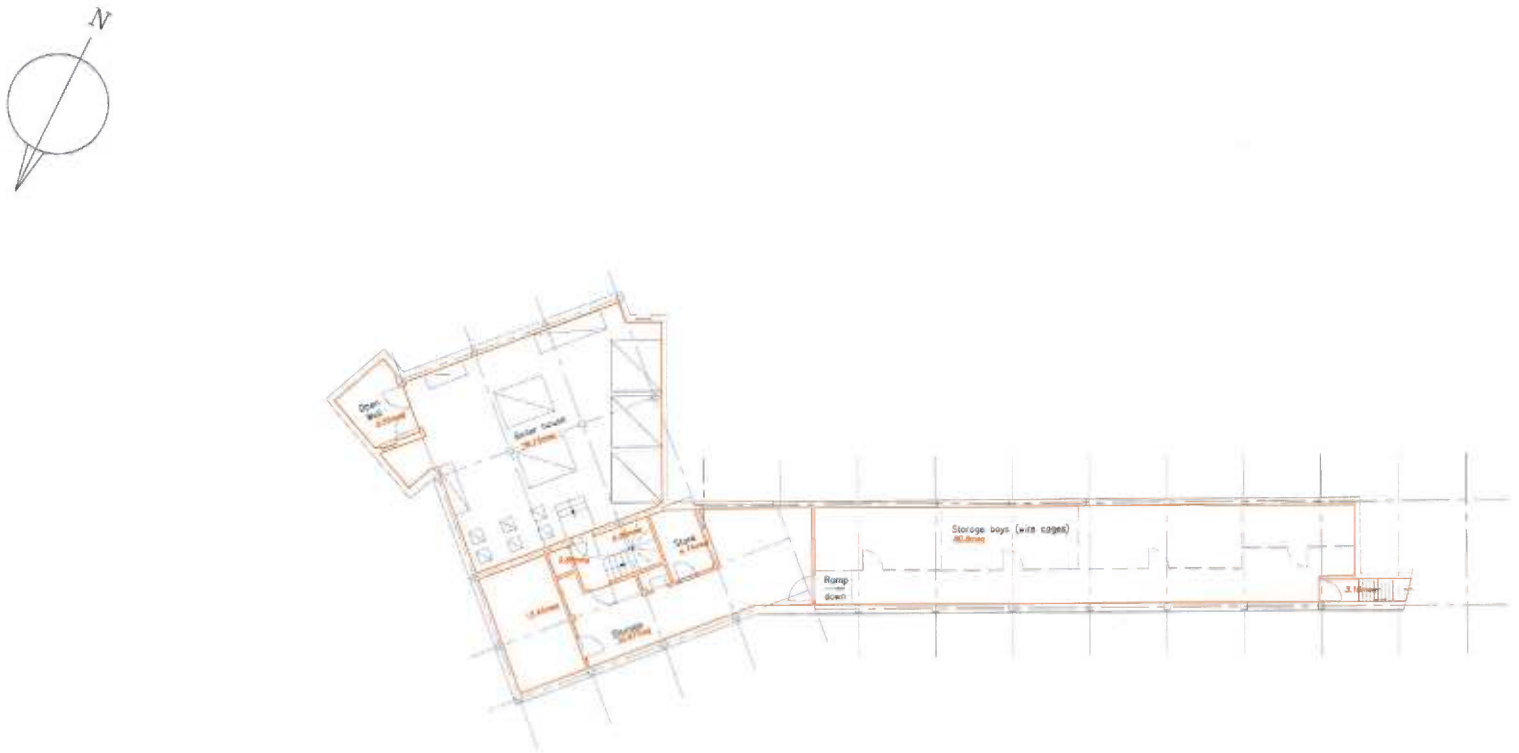




Project:

Title: ROEHAMPTON SPORTS CLUB
PAVILION

Dept/Team: Date: Dec 09 Scale: 1:100 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

B

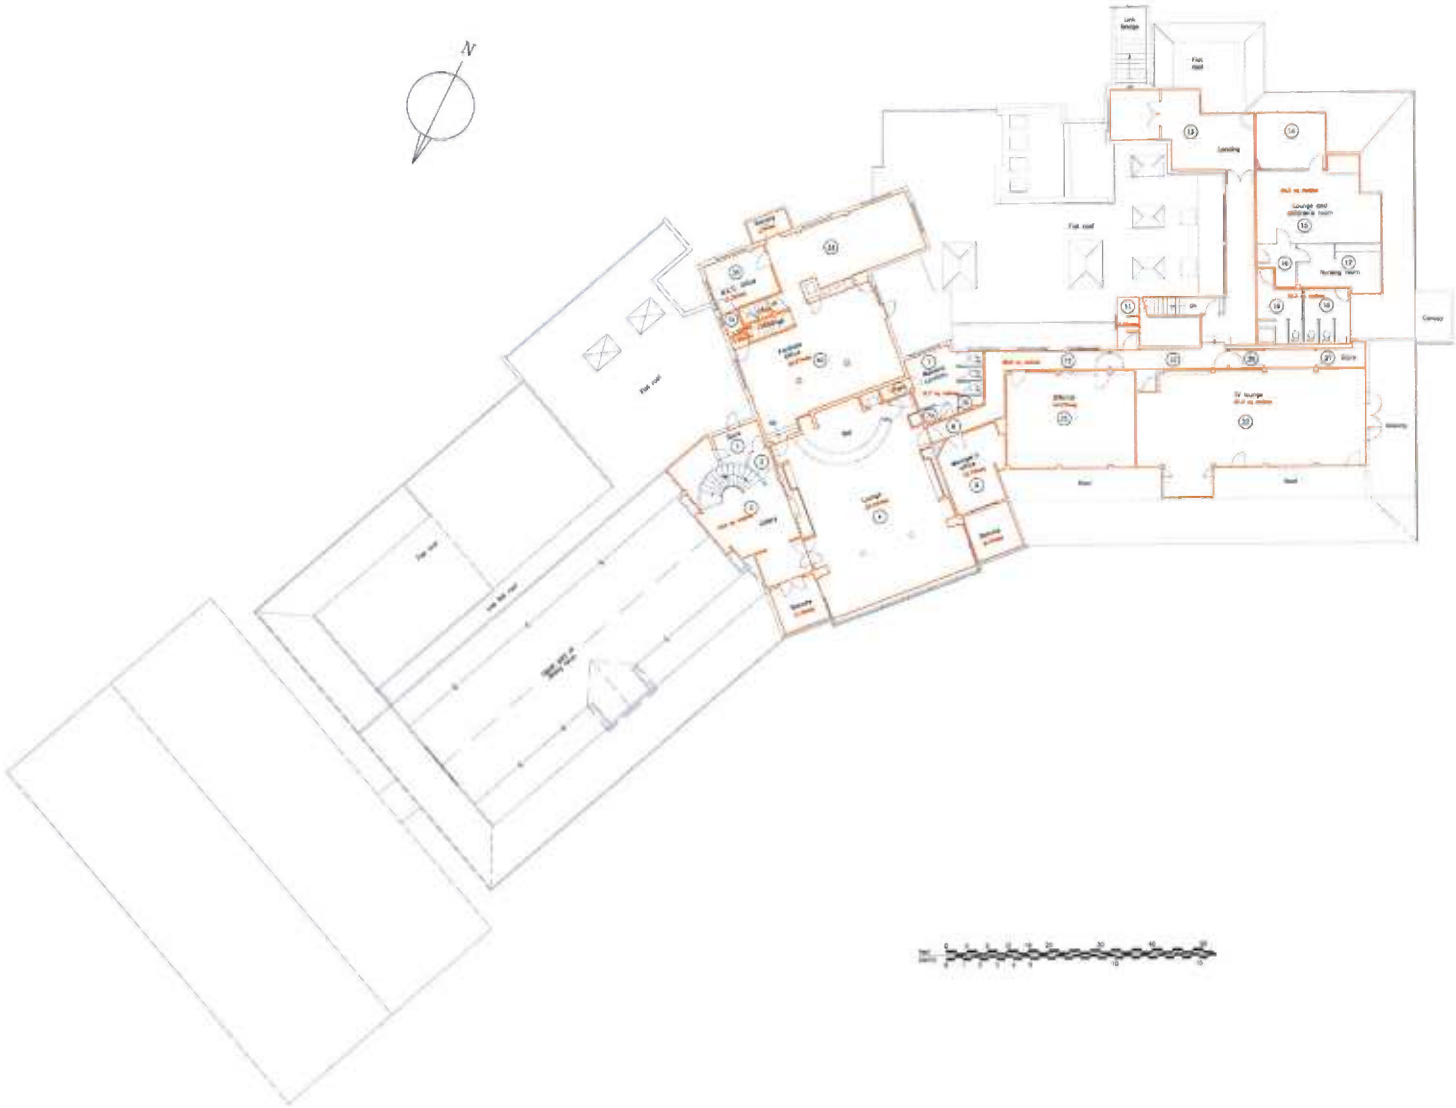

Project:

Title: ROEHAMPTON SPORTS CLUB
PAVILION

Dept/Team: Date: Dec 09 Scale: 1:150 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

1




Project:

Title: ROEHAMPTON SPORTS CLUB
PAVILION

Dept/Team: Date: Dec 09 Scale: 1:150 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

G

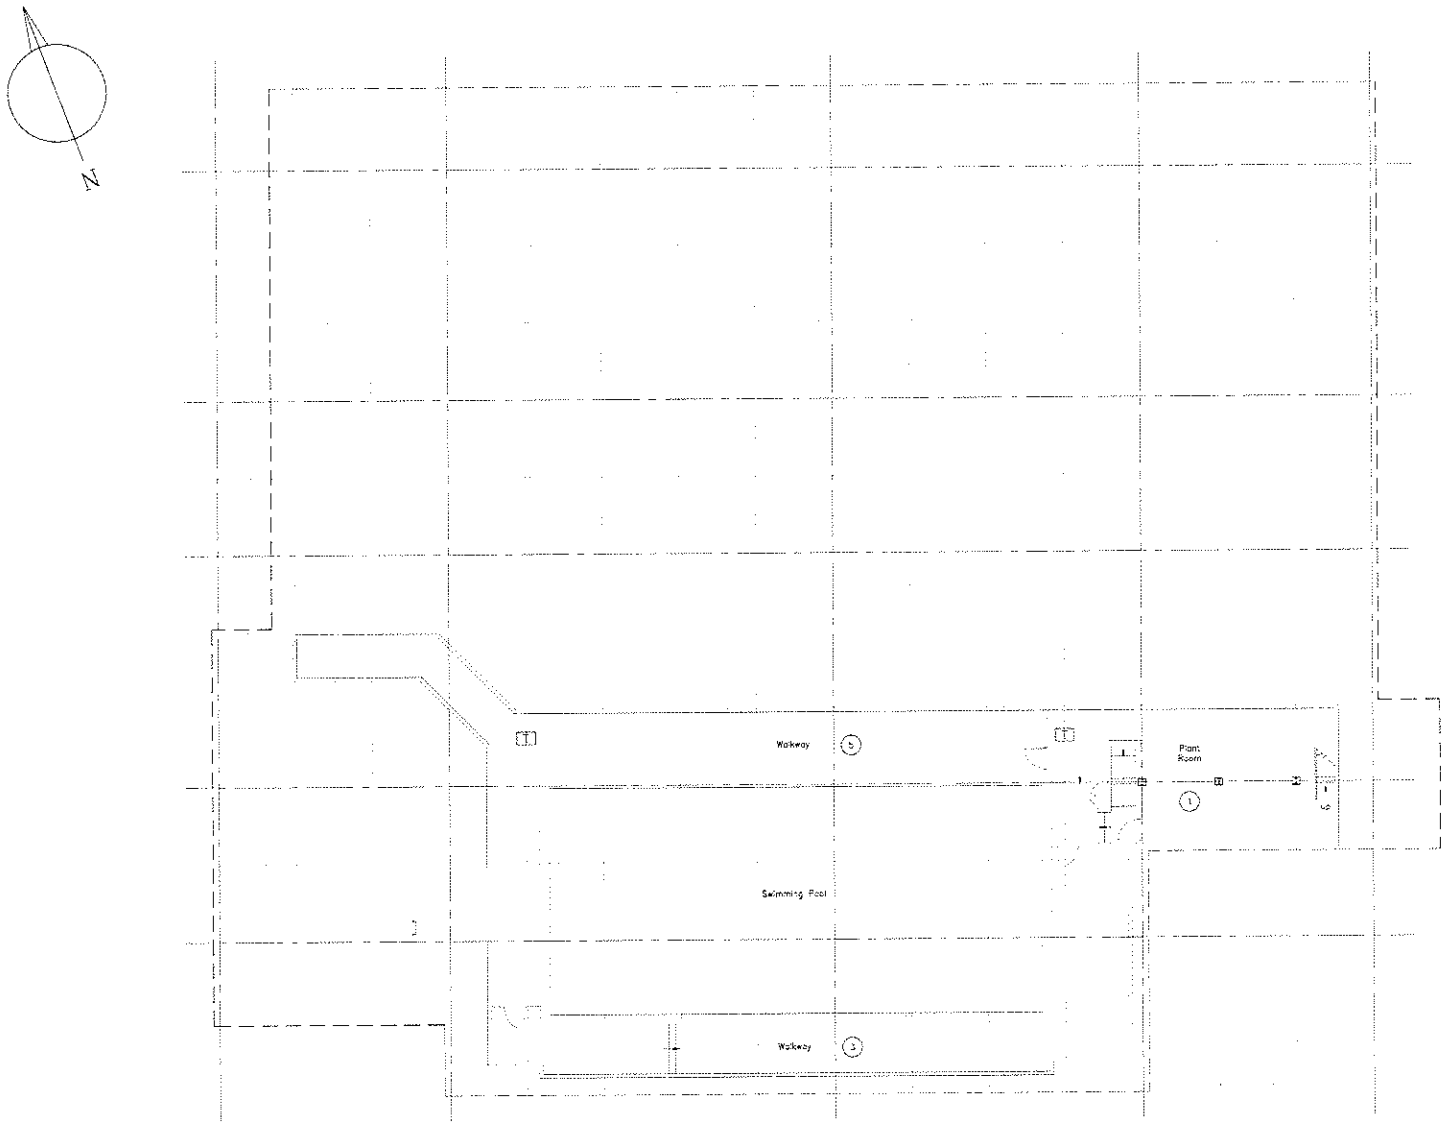

LEVEL 0


feet 0 4 8 12 16 20 30 40 50
metric 0 1 2 3 4 5 10 15

Project:

Title: ROEHAMPTON SPORTS CLUB
SWIMMING POOL AND SPORTS HALL

Dept/Team: Date: Jan 1998 Scale: 1:100 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev G

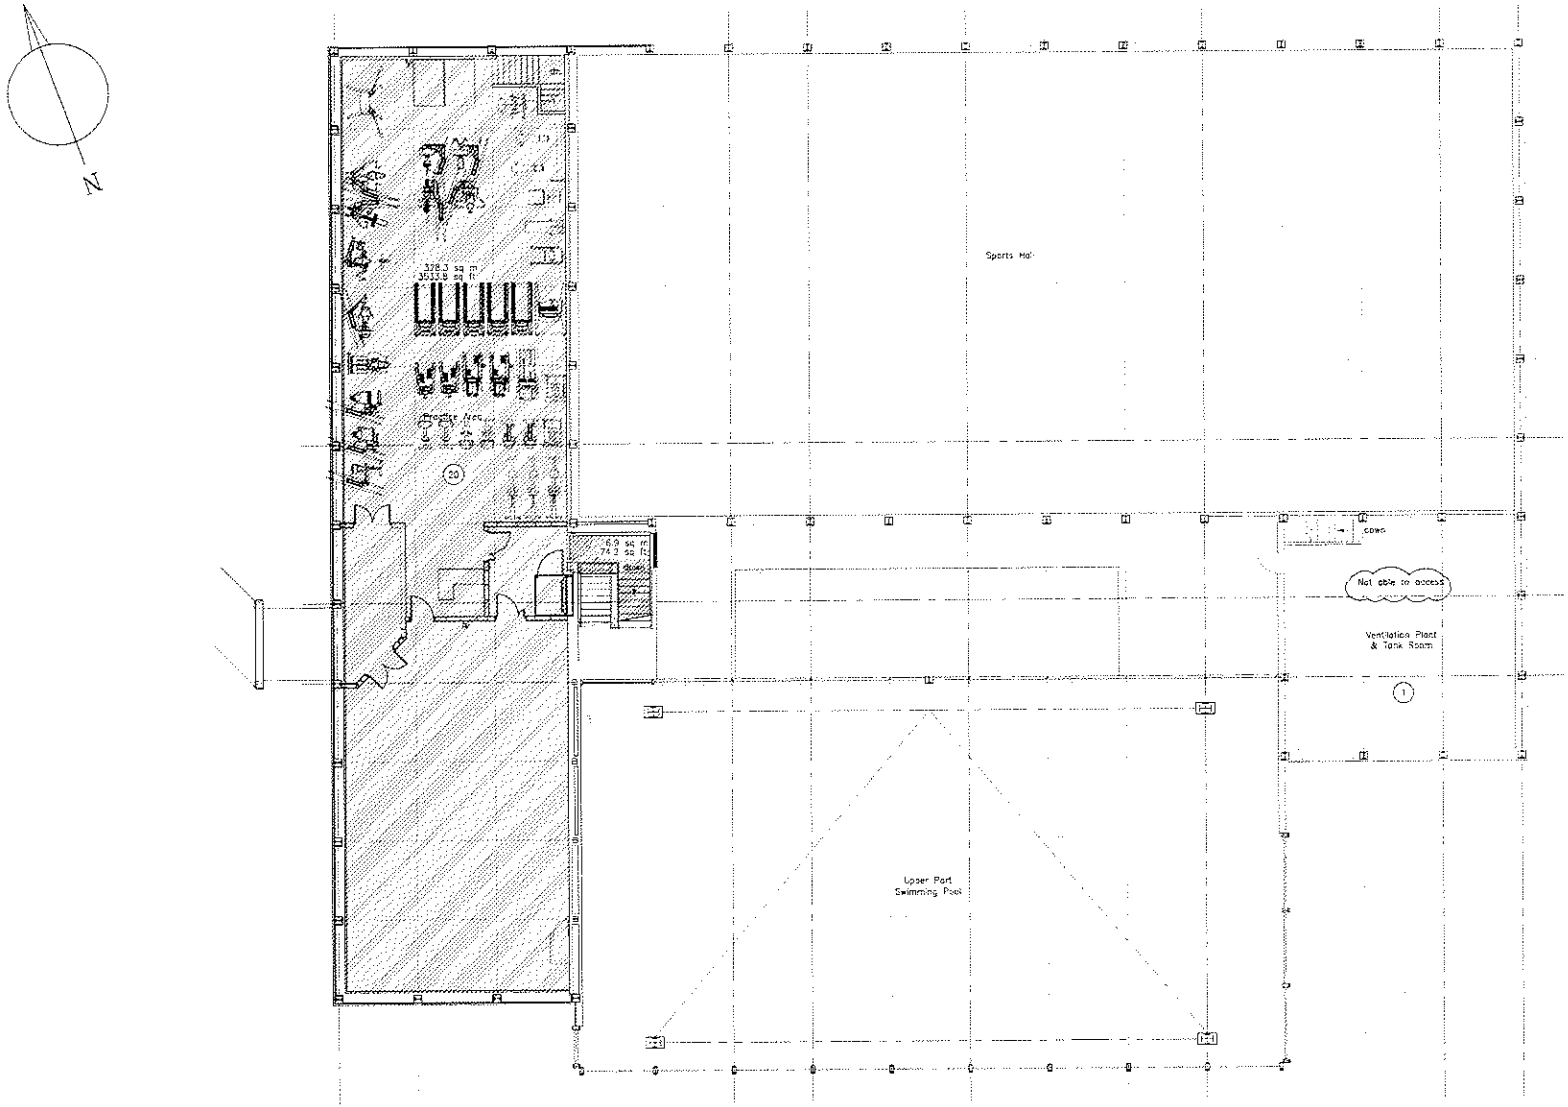

LEVEL 3

feet: 0 4 8 12 16 20 30 40 50
metric: 0 1 2 3 4 5 10 15

LEVEL 3 (LEVEL 148.50)

Project


Title ROEHAMPTON SPORTS CLUB
SWIMMING POOL AND SPORTS HALL

Dept/Team

Date: Jan 2010 Scale: 1:100 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

3

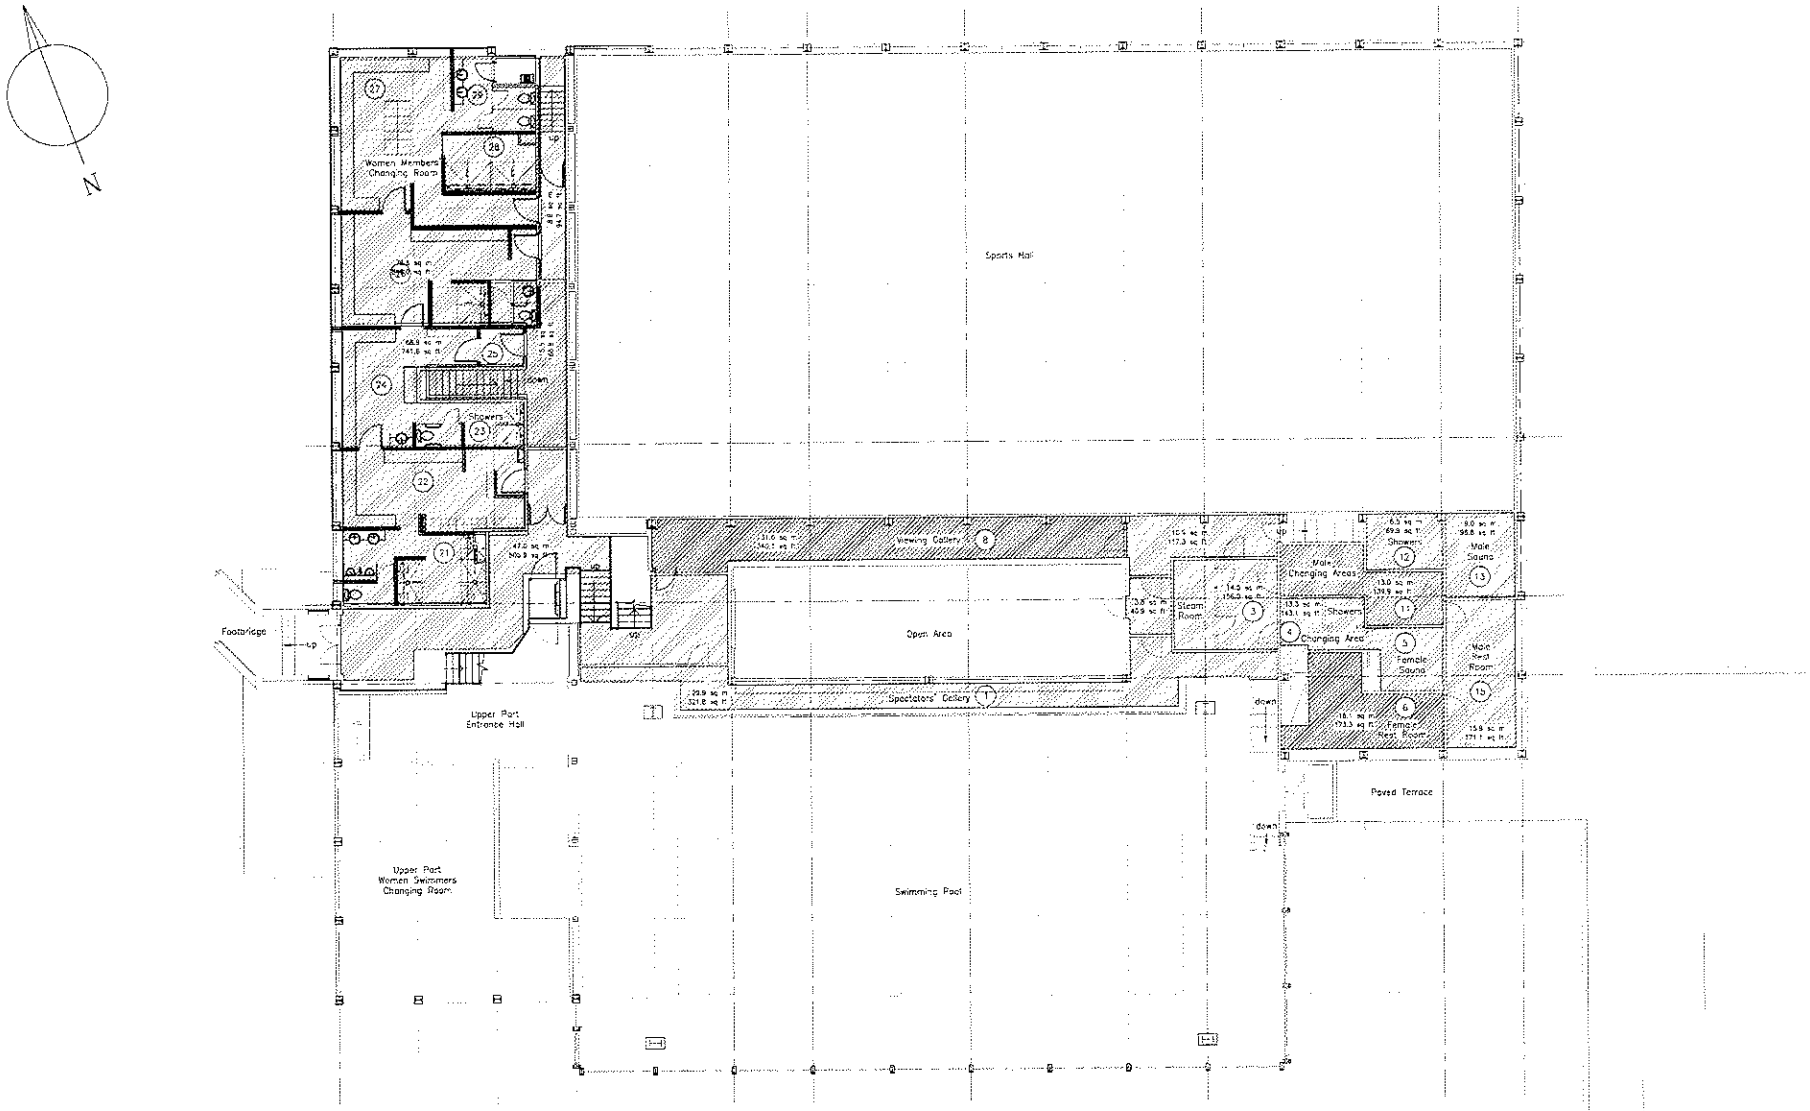

LEVEL 2

feet 0 4 8 12 16 20 30 40 50
metric 0 1 2 3 4 5 10 15

LEVEL 2 (LEVEL 138.50)


Project:

Title: ROEHAMPTON SPORTS CLUB
SWIMMING POOL AND SPORTS HALL

Dept/Team: Date: Jan 2010 Scale: 1:100 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev

2

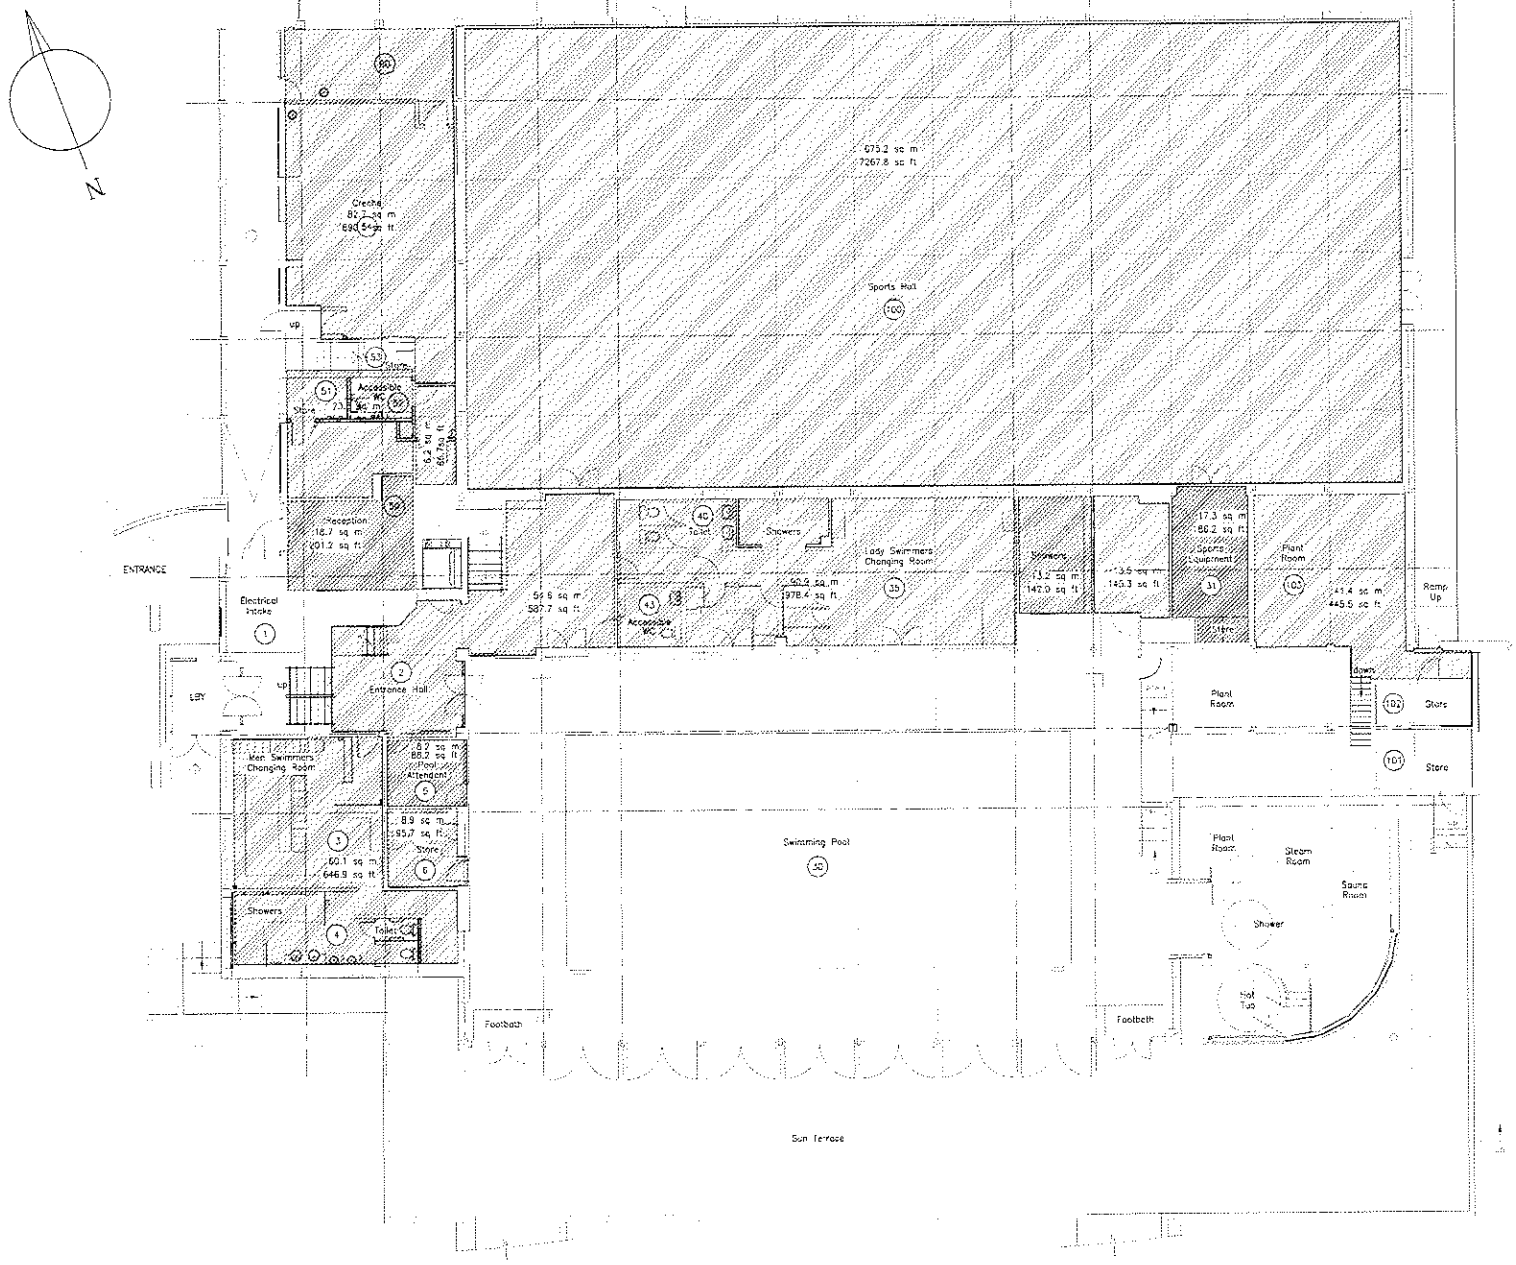

LEVEL 1

feet 0 4 8 12 16 20 30 40 50
metric 0 1 2 3 4 5 10 15


LEVEL 1 (LEVEL 128.50)

Project

Title: ROEHAMPTON SPORTS CLUB
SWIMMING POOL AND SPORTS HALL

Dept/Team: Date: Jan 2010 Scale: 1:100 @ A1

Floor Zone Project No. Dwg Stage Dwg No. Rev 1

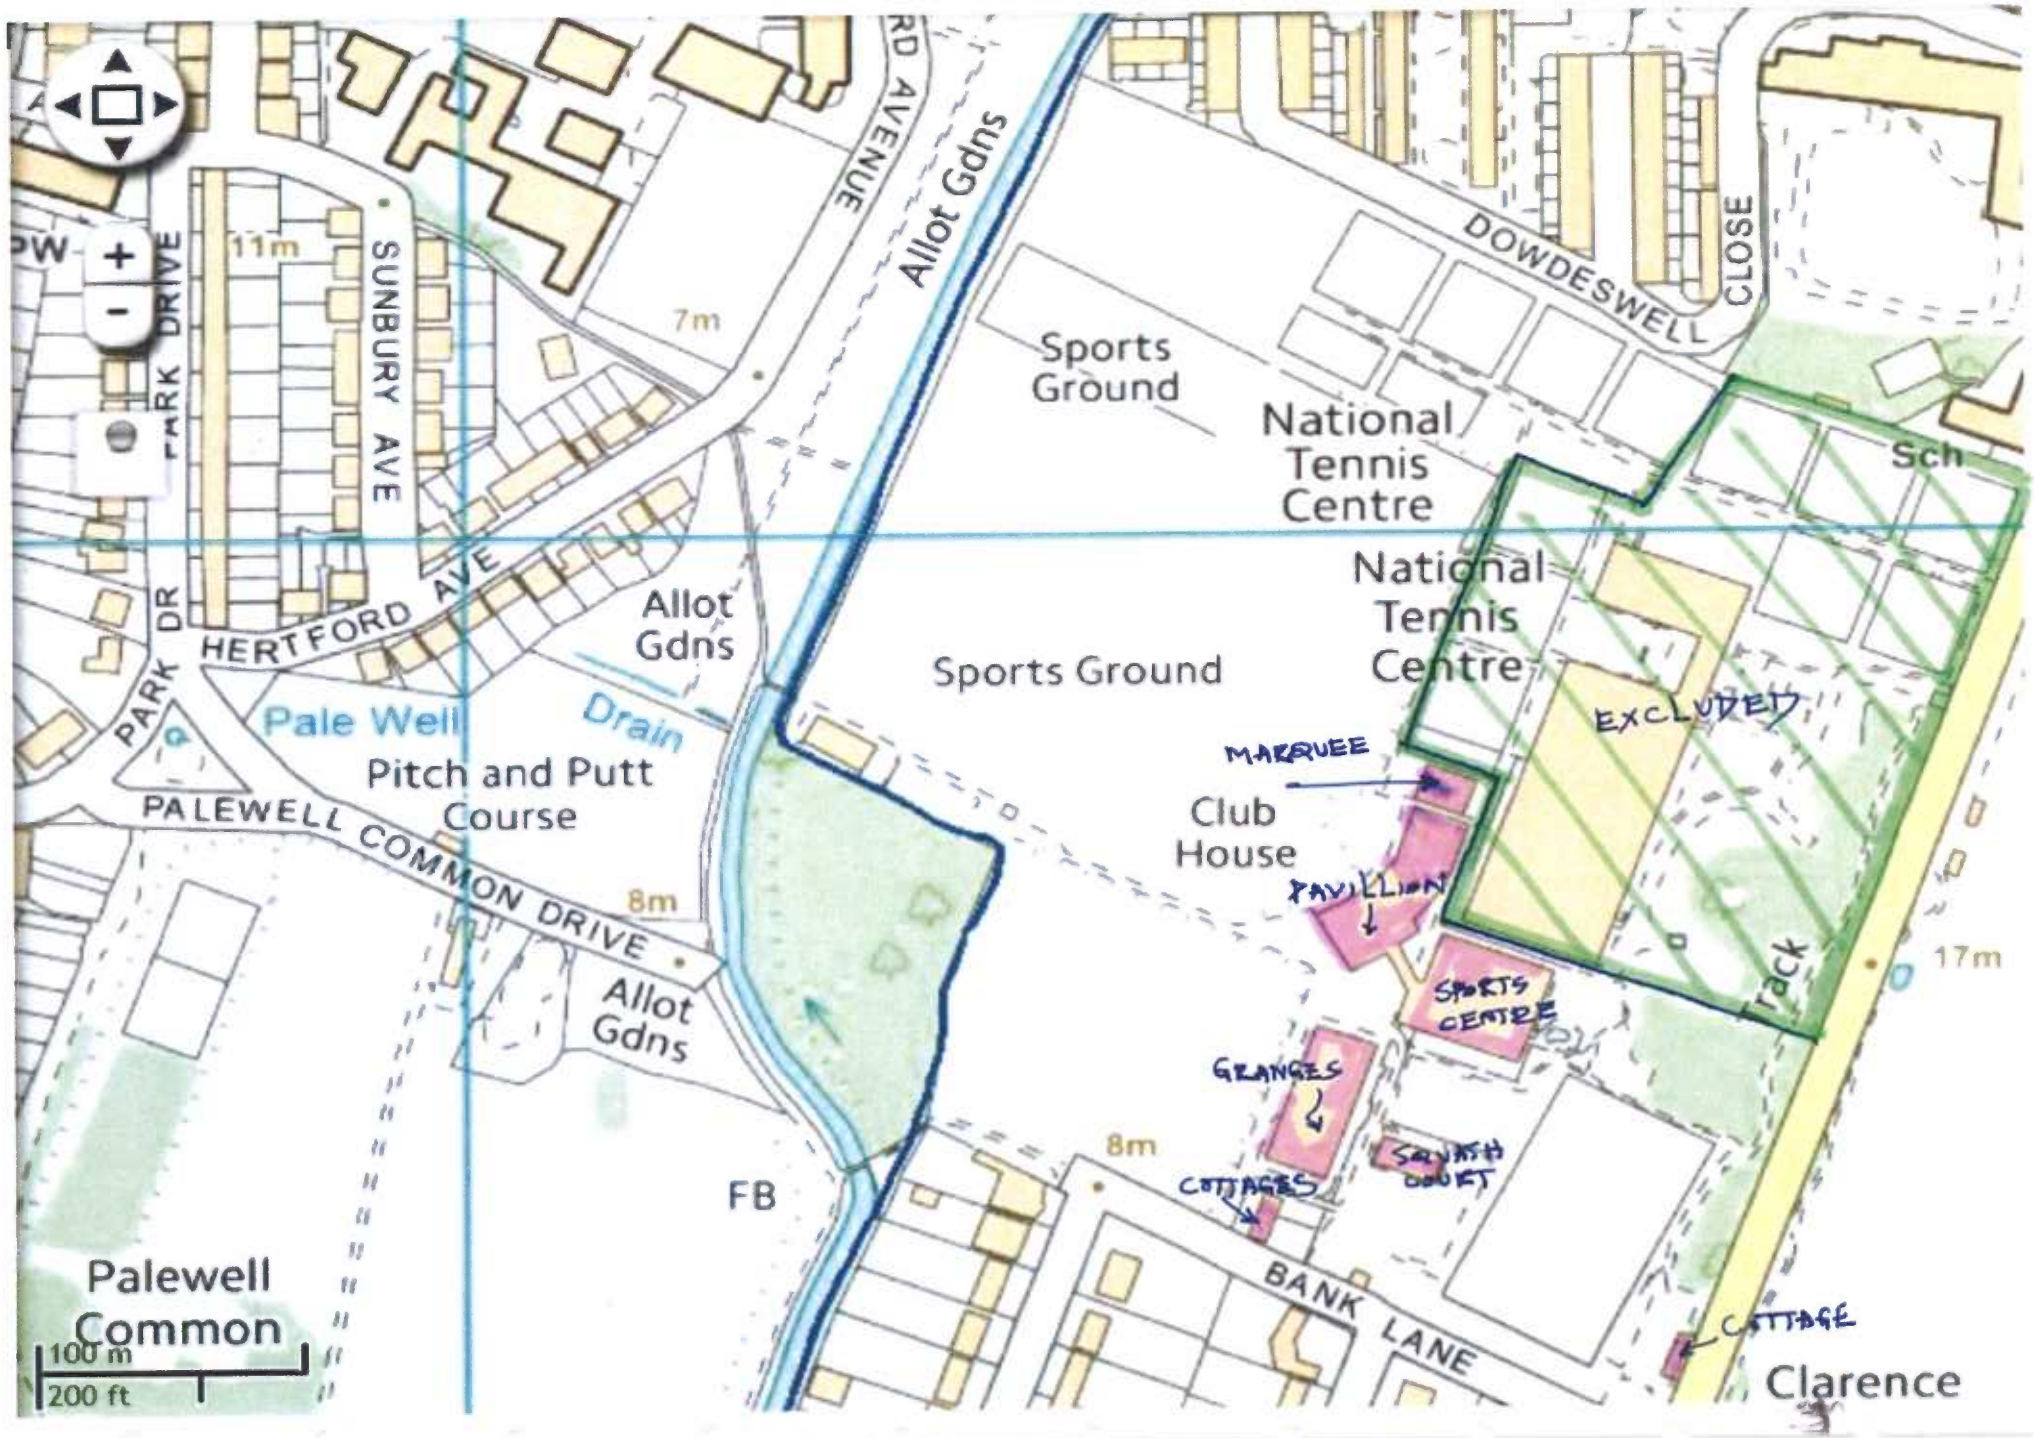
SUNBURY AVE
11m
7m
RD AVENUE
Allot Gdns
DOWDESWELL CLOSE
Sports Ground
National Tennis Centre
Sch
HERTFORD AVE
PARK DR
Allot Gdns
Sports Ground
National Tennis Centre
EXCLUDED
Pale Well
Drain
Pitch and Putt Course
MARQUEE
Club House
PAVILLION
PALEWELL COMMON DRIVE
8m
SPORTS CENTRE
Allot Gdns
GRANGES
17m
Rack
8m
FB
COTTAGES
BANK LANE
COTTAGE
Palewell Common
100 m
200 ft
Clarence

Appendix 4

Mechanical and electrical services reports



Bringing buildings to life

The Grange
Bank of England Sports Centre
Engineering Services Review

August 2019



PROJECT
Lighthouse Surveyors-Bank of England Sports Centre-The Grange

PROJECT REF
19820

REPORT
Engineering Services Review

DOCUMENT NUMBER (if applicable)
19820-MEP-RPT-001

STATUS:
Draft for Comment

DATE:
20th August 2019

This report has been authorised by:

.....

James Campbell
Partner

Revision	DCC No.	Comments	Date	Author	Checked
001	_	Draft for Comments	20/08/2019	IA	JC

This report is confidential and personal to the client for whom it was prepared and shall not be disclosed to any third party without TB+A's prior written consent. TB+A shall have no duty, responsibility and no liability to any party in connection with this report howsoever arising (whether in contract, in tort, in negligence or otherwise) other than that arising to the client under TB+A's appointment. Nothing in this report shall constitute or give rise to 1) a warranty, confirmation or statement that that any works, property or any other matter to which this report relates is fit for purpose or suitable for use or 2) a guarantee in respect of the performance of any works, property or any other matters to which the report relates."

This report is hereby signed off as the brief by: -

Company	Troup Bywaters and Anders
Name	Ian Andrews
Role	Senior Technical FM Consultant
Date	20th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	James Campbell
Role	Partner
Date	20th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	
Role	
Date	
Signature	

Contents

1.0 Introduction 1

1.1 The Property (The Grange) 1

1.2 Limitations 3

1.3 Services Overview 4

1.4 The Survey 5

2.0 Executive Summary 5

3.0 Mechanical Services 8

4.0 Electrical Services 12

1.0 Introduction


Troup Bywaters + Anders (TB+A) have been appointed by Lighthouse Surveyors and commissioned to undertake a review of the engineering services installations at the Bank of England Sports Centre, London SW15 5JQ.

The Bank of England Sports Centre covers approx. 32 acres and includes Commercial office space, administration and members facilities including commercial kitchens and restaurant, bars and sports facilities including residential cottages and grounds staff outbuildings.

This report has been prepared to provide a general appraisal of the engineering services installed within the sports centre complex in consideration of a potential purchase of the leasehold to the property. This report is solely for the property named as 'The Grange' – formally 'The Records Office'. Separate TB&A reports are provided for the Pavilion, Marquee, Squash Courts, Cottages and Grounds including Sports Hall & Swimming Pool,


1.1 The Property (The Grange)

Located in Priory Lane, Roehampton, South West London is a five-storey building known as the 'The Grange' The building spans from basement to 4th floor and GIA of 41,000sq.ft. The majority of Ventilation and Air conditioning plant are located at roof level with additional tenant's air conditioning equipment located to level 1 flat roof areas and the main LTHW and Chiller Plant Room located to ground and basement level. Non-potable and potable water services are located within the south basement wing. The floor plans provided only show the central core and south wing. ***N.B. The North Wing is not shown.***

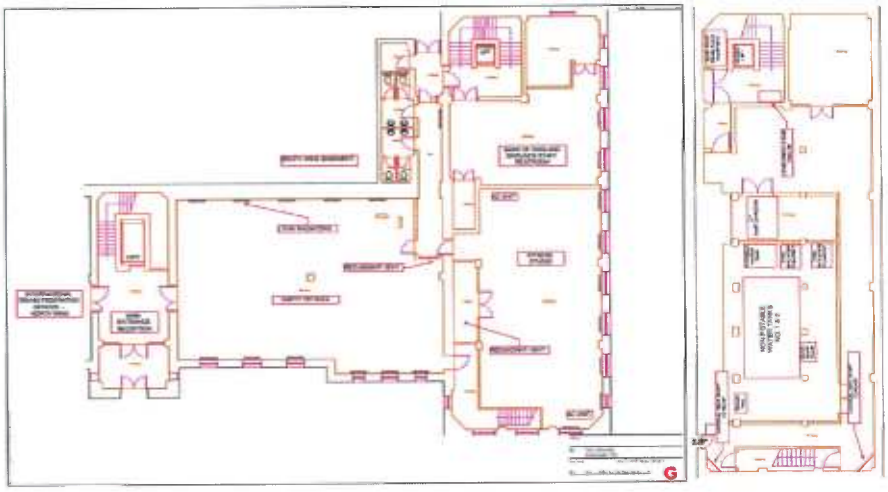


Ground Floor


Basement

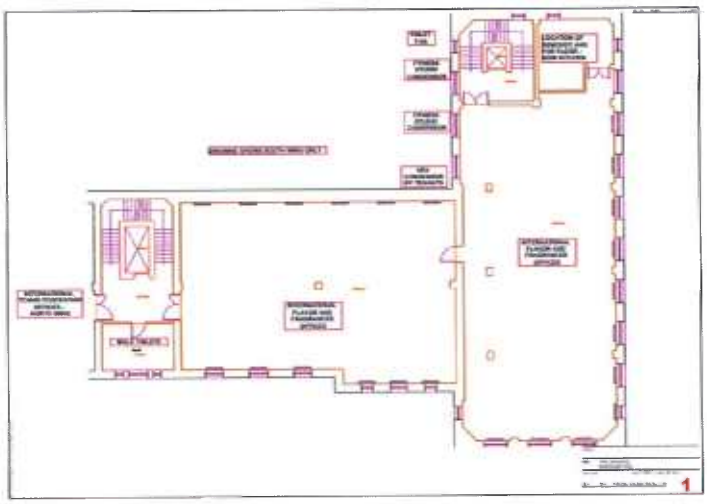


First Floor

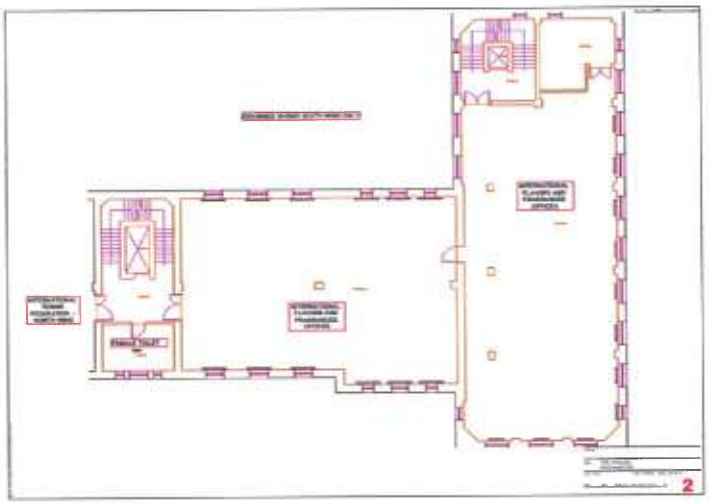

Second Floor

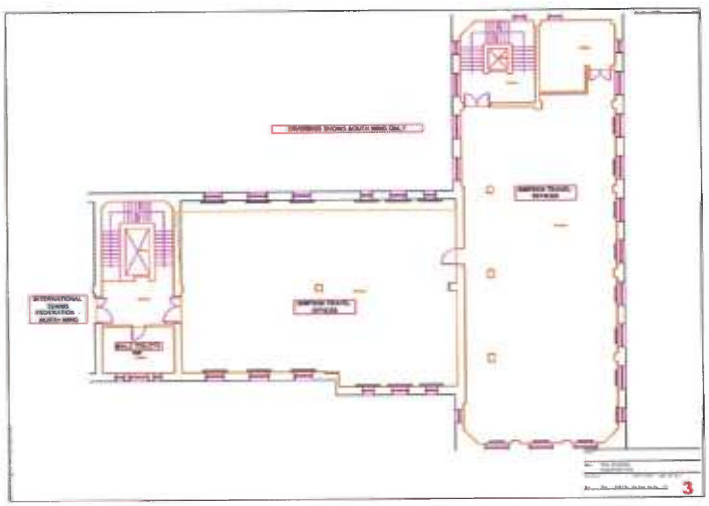

Third Floor

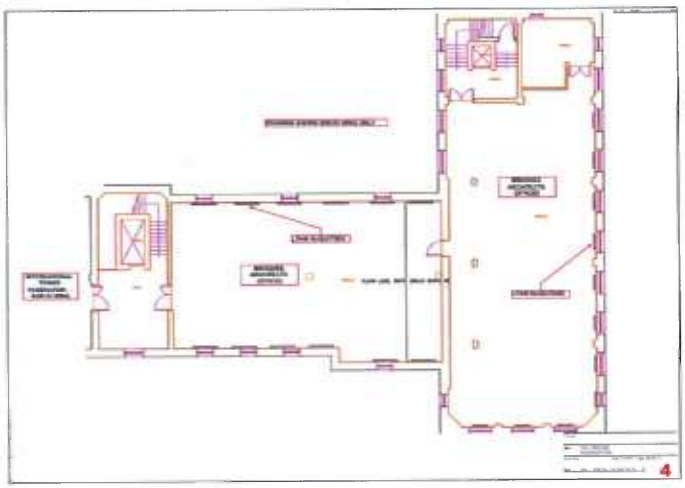

Fourth Floor

The property was originally constructed in 1908 and has been internally altered throughout the years, most recently in 1997 when the buildings landlords MEP services were refurbished under Bank of England Project 531. There are several tenants whom have completed their own MEP and fabric fit outs to their respective areas. These are detailed below:

Level	North Wing	Central Core	South Wing
Roof	ITF AHU Plant & LMR	LL Toilet AHU/Extract Plant	Tenants AC Plant & LMR
4th Floor	International Tennis Federation	LL Female Toilet	Brookes Architects
3rd Floor	International Tennis Federation	LL Male Toilet	Simpson Travel
2nd Floor	International Tennis Federation	LL Female Toilet	International Flavor and Fragrances
1st Floor	International Tennis Federation	LL Male Toilet	International Flavor and Fragrances
Grd Floor	International Tennis Federation	Main Plant Room & LMR	Vacant Commercial Space and Fitness Studio
Basement	No Basement	Main Plant Room	LV Switch room and CWS Tank Room

Entrance to the property is via the central core main entrance on Bank Lane to the Ground floor reception area. Separate stairwells and lifts are located to the South wing, North wing and Central Core which also houses toilets and lift lobbies. The stairwells to either end of the building extends to the roof level and mechanical plant. A basement level is located to the south wing and this houses the LV switch room and cold-water storage tanks. The main mechanical plant room is located to the rear central core with access from the rear of the property.

1.2 Limitations

No inspection was undertaken to those parts of the building services which are built in, covered up or otherwise inaccessible. The survey consisted of a non-invasive visual survey – no building services equipment covers were removed or ceiling tiles/plant sealed risers disturbed.

No definitive tests or calculations have been undertaken to determine the capacity of the plant nor have performance tests been carried out on the plant and system.

No functional testing of systems or installations was performed.

No access was available to Level 1 flat roofs, which were inaccessible.

1.3 Services Overview

The building is currently occupied on all floors, apart from the south wing ground floor. The building incorporates various modes of mechanical and natural ventilation, heating and cooling. The North wing offices (Grd to 4th floor) are served via a single 260kW Airedale TurboChill water-cooled Chiller installed late 2018 along with roof mounted Gunter forced air-cooled condensers – This unit provides chilled water to tenant - International Tennis Federation (ITF) 4-pipe Quartz horizontal chassis type fan coil units (89No)* located to above the suspended ceiling, (circa 1997) and cooling to the ITF AHU No. 1. Cooling for other tenants' floors in the south wing are provided by separate VRV and split air conditioning units.

2No. Hamworthy Gas forced draught Boilers each providing 380kW heat output are located in the Main plant room these supply constant and variable LTHW circuits to provide low temperature hot water to ITF fan coil units and main air handling plant including radiator circuits to 4th floor and ground floor south wing tenants' areas and DHWS via plate heat exchanger located to the basement.

Heating for other tenants' areas are provided by independent Daikin VAV and ceiling mounted AHU VAM units.

Primary mechanical fresh air ventilation is provided to the north wing only (Grd to 4th floor) by a roof mounted Airedale AHU (2.7m3/s). This provides fresh air to the rear of each ITF office FCU's. A separate Extract AHU is located adjacent to AHU No. 1 on the north wing roof. This provides extract via offices suspended ceiling return air plenum. The north wing ventilation system is a standalone system with fire dampers located to floor slab penetrations – there appears to be no recirculation or heat recovery mode for the units. (Supply & Extract Units circa1997).

The central core Landlords Toilets fresh air mechanical supply ventilation is provided by an Airedale AHU No. 2 (0.36m3/s) with separate extract fan unit, (circa 1997). Both units are located beneath the roof clock tower.

The south wing fresh air ventilation is provided by natural ventilation through wall grills and opening windows. Several tenants have Daikin ceiling mount AHUs to provide fresh air to VAV Fan Coil Units.

Several tenants have their own toilet and kitchen facilities located to the north and south wings.

The LV Electrical switch board is located to the basement and serves both landlords and tenants supplies. The landlords and north wing tenants' electrical supplies were installed circa 1997.

A non-potable boosted cold water service supplies both landlords and tenants' toilets and are served from 2No. GRP tanks with a total capacity of 18750 litres. A separate potable boosted cold water service provides drinking water to all floors – the FRP tank with a capacity of 1500 litres. Both tanks are circa 1997 with recently replaced booster sets to both potable and non-potable supplies.

The above ground rainwater pipework is provided by flat roof gullies and internal/external cast iron RWP with hoppers dating from 1908. SVP are cast iron.

A Trend 963 v3.72 Supervisor Building management system provides overview and limited control to the AHU's, Boiler Plant, VT circuit and HWS. The system connects to the Sport centre head end located within the Pavilion Maintenance office. Various outstations are situated within motor control cabinets and are circa 1997.

**Information taken from Project 513 Operating & Maintenance manual*

1.4 The Survey

A visual, non-intrusive survey was conducted by TB+A on 5th-6th August 2019. The physical condition of the systems is noted within the document, assessed from a combination of on-site visual inspection of each area, review of record documentation and discussions with the maintenance provider - Leisure Support Services Maintenance Manager – Glen Miller.

Systems and installations have been assigned a condition rating in accordance with the following definitions:

Serious or Critical issue; requires action due to risk of failure. Has reached the end of its economic life.

Important issue; may require action or resolution. Poor condition with evidence of defects.

Information only; no action required. Routine maintenance. Satisfactory condition.

Budget cost estimates for recommendations have been provided as an indication to likely investment required. Costs are exclusive of VAT and any professional fees unless otherwise stated.

2.0 Executive Summary

TB+A completed a visual, non-intrusive inspection of the engineering services at The Grange, Bank Lane London SW15. The building underwent a MEP refurbishment in 1997 and as such most of the building services are over 22 years of age and require replacing. The building has various types of ventilation and heating/cooling modes which is evidence of partial refurbishment over the years.

The services were generally found to be in an unsatisfactory visual condition however, as the majority have reached the end of their economic life. Unplanned and increased failure of the services is a likely a consequence of age and obsolescence of components will increase downtime and disruption to the business.

Key issues have been summarised in the table below.

Mechanical Services	
Mains Water Service	All tanks are 22 years old and appear to be in condition consummate with age, although they have reached the end of their economic life and will require replacement in the next 5-10 years.


	The service is not provided with a water softener device and this should be fitted to prevent scaling.
Domestic Hot Water Service	The domestic hot water service to central core toilets and tenants' kitchens is provided via landlord's twin pump Thermaflow hot water heat exchanger complete with trace heating to maintain the temperature of the pipes to enable a more constant temperature throughout. The unit was installed in 1997 and is 22 years old. This unit will require replacing in the next 5 years
Gas system	The gas pipework has Significant surface corrosion. A new meter connection has been fitted although several flange bolt fixings are missing from the pipework – Additionally there is a slight smell of gas within the area.
LTHW Heating System	LTHW boilers and CT/VT pumps are aged and require replacement – CT pump no. 4 was defective and shows signs of leaking.
Ventilation system	AHU 1 & 2 (Main North wing office supply and Toilet supply) requires refurbishment due to its current condition and age. Toilet and north wing main office extract fans require refurbishment due to defects – additionally several toilets and wall fans are defective.
Air Conditioning System	The north wing air conditioning chiller has recently been replaced in late 2018 along with forced air coolers to roof. Although there is significant redundant pipework through the building.
Plumbing Services	The kitchen and central toilets appear to be in a condition consummate with age. These require ongoing maintenance to rectify any defects found.
Rainwater and Above Ground Drainage System	The external drainage systems appear to be aged, (original 1908) but in a average condition. However, the roof gullies and drains require attention. The external car park interceptors should be inspected as should the underground drainage.
Vertical Transportation	
Passenger and Goods Lifts	The 2No. passenger lifts and 1No. goods lift – date from 1997 and 1987 respectively – these all require refurbishment.
Electrical Services	
Electrical Installation	The Grange general electrical installation was refurbished in 1997. However, this installation appears to have been poorly maintained – the south wing rising mains, distribution boards and final circuits require replacement and additionally the main LV switchgear requires refurbishment. There was a smell of overheating in the basement switch room and this should be investigated.
Lightning Protection	The lightning protection system failed its annual test in July 2019. Remedial works are required to provide a protected system.

	Additionally, surge protection should be considered on electrical switchboards.
Building Management System	The building management system dates from 1997 and requires upgrading to the latest Trend IQ4 controllers and IQ Vision software.

Site logbooks and maintenance tasks appear to be undertaken on a caretaker basis with reactive maintenance being undertaken. The contractor's site logbooks and water risk assessment folders were found to be out of date as were the F-Gas Folder.

Estimate budget costs for recommendations have been provided to identify likely investment required. Costs are exclusive of VAT and professional fees. Investment required within the next 5 years is estimated at £1.295 million excluding any asbestos survey and removal, builder's works and preliminaries. (BSRIA Blue Book 2018 - £680.00 per m^2 – Total GIA 3809m^2 adjusted for 50% (1904.5m^2) landlord's floor area, excluding Tenants Areas.

3.0 Mechanical Services

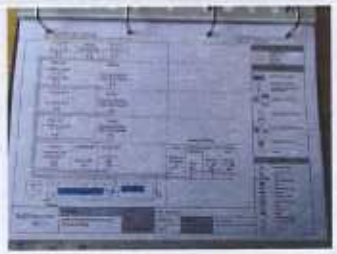No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Mains Water Service		A mains water service enters the basement via isolation valves and water meter and supplies 2No. sectional (non-potable) GRP tanks and 1No. FRP (Potable tank) and supplies the DHWS plate heat exchanger. Both potable and non-potable water services are provided with recently installed DAB twin Inverter pump booster sets which appear new. Leak protection has also been installed below the pump sets and appears to be operational. Water hygiene records such as flushing, temperature records and microbiological testing were not observed as records were found to be dated -Water Risk Assessment provided dated 2015.		+ Redundant plant requires removing from the tank room and area tidying. + The bund appears to be inadequate and relies on the room step for major spill containment. + Install magnetic water softener device on incoming service to prevent scaling. + Install insulation to missing CWS pipework sections. + Carry out a Water Risk Assessment to ensure compliance
2.0	Domestic Hot Water Service		The domestic hot water service to central core toilets and tenants' kitchens is provided via landlord's twin pump Thermaflow hot water heat exchanger complete with trace heating to maintain the temperature of the pipes to enable a more constant temperature throughout. The unit is controlled and monitored remotely on the BMS. The unit was installed in 1997 and is 22 years old. This unit will require replacing in the next 5 years. Several tenants have their own local electric water heaters located within their demise. These appeared to be recently installed.		+ Consider replacement of the Hot Water Heat Exchanger Unit within the next 5 years or when it fails.
3.0	Gas Service		A 90mm OD mild steel gas main enters the main plant room at basement level via a main isolating valve and meter. The gas service supplies the 2No. gas boilers and gas regulators and solenoid isolation valves. A safety solenoid valve is connected to the plant room EPO. This was not tested. The pipework was found to be incorrectly supported and surface corrosion is evident. A new meter connection has been fitted although several flange bolt fixings are missing from the pipework – Additionally there is a slight smell of gas within the area – this has been reported to BofE Centre Manager Steve Mellinger.		+ Investigate smell of gas around meter location. + Remove surface corrosion and repaint gas pipework + Supply and install new supports for the gas service pipework + Functionally check the solenoids for correct operation + Install bolts to meter pipework flanges and carry out gas leak test.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
4.0	Heating System		2No. 380kW net heat input Hamworthy Gas forced draught Boilers are located within the Main plant room with stainless steel flues. These were installed in 1997 and Boiler No. 1 has suffered previous fire damage to the front control panel. Boiler No. 2 was operating although both boilers were found to be in poor condition with covers not correctly fitted. Additionally, the heating VT and CT pump sets, (Nos 1-4) were found to be in a various state of repair with leak corrosion CT Pump No. 4. (this unit was not running – neither was the VT operational due to set point no being reached) Gas safety certificate dated 09/11/2018 indicated units were both safe for use. The flue dilution fan was found to be operational although the differential pressure switch was found to be damaged and not affixed. This belt driven twin motor unit was installed 1997 and has reach the end of its economic lifecycle. Several sections of the LTHW pipework show signs of corrosion – These require replacement when surface damage cannot be removed and painted. Additionally, Several AHU's were removed from tenants' areas to the south wing during previous fit outs. The LTHW and CHWS pipework is still in situ as it feeds 4th floor tenants radiator circuit. There are dead legs on this system.	 	+ The Boilers and Pump sets have reached the end of their economic life expectancy and are noted as being in various state of repair all require replacement within the next 5 years. *Although, the design should reflect current building use and layout as the boilers are significantly oversized for the current requirement. BSRIA Rules of thumb for thermal loads are 70w/m2 @ GIA 4366m2. This would require approx. 305kW heat output.* + Replace flue dilution fan with new unit. + Replaced corrosion damaged sections of LTHW pipework + Remove dead legs on South Wing LTHW rising main to 4th floor radiator circuit or remove entire rising LTHW and CHWs pipework and resupply 4th floor as the system is over sized for current operation. + Replace expansion vessel and pump unit.
5.0	Ventilation System		Primary mechanical fresh air ventilation is provided to the north wing only (Grd to 4th floor) by a roof mounted Airedale AHU. A separate Extract AHU is located adjacent to AHU No. 1 on the north wing roof. Both units are 22 years old and in a poor state of repair with exposed corroded LTHW and CHWS pipework and trace heating cable. The AHU condense drain pipework is disconnected and laying on the roof. The ductwork lagging is badly damaged and requires replacement MCP 2 indicated duty fan failure and the Supply fan was not operating at the time of the survey. However, the extract was running additionally MCP 2 control lamps were not indicating normal running conditions. Toilet supply and extract Airedale AHU Units are located to the central core roof plant room aged 22 years. These were found to be in a poor state of repair, with supply not running and extract operational. Several Extract fans require replacement in lift motor rooms and south wing ground floor toilet roof. A separate ITF AHU is located to the 1st floor roof and serves their laboratory – no access could be made to survey this equipment and it is considered as tenants own equipment.	 	+ Refurbish or replace AHU1 including replacing corrosion damaged sections of LTHW and CHWS pipework and replacing damaged insulation. (consider replacing central plant with Daikin VAM Ceiling mounted air handling units to floors – alike south wing) + Refurbish or replace EF/R01 office primary extract AHU new units or replaced central system. + Refurbish MCP2 with new control panel and BMS outstation. + Refurbish or replace Toilet supply and extract AHU's with new. + Replace lift motor room fans and ground floor toilet roof fans – all over 2 years and in poor repair. + Remove redundant ductwork to ground floor south wing.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
			26No. fire dampers were installed in 1997 – These appear no to have not been serviced by the incumbent maintenance provider and no annual drop test and inspection has been completed		+ Locate fire dampers and complete drop test and provide maintenance.
6.0	Air Conditioning system		The North wing offices (Grd to 4th floor) are served via a single 260kW Airedale TurboChill water-cooled Chiller installed late 2018 along with roof mounted Gunter forced air-cooled condensers – This unit provides chilled water to tenant - International Tennis Federation (ITF) 4-pipe Quartz horizontal chassis type fan coil units (89No.)* located to above the suspended ceiling. These fan coil units have water side actuators linked between units and controlled on a floor by floor basis from the BMS. The ITF FCU's and actuators are obsolete 22 years old. The chilled water system was reconfigured in 2018 to accommodate the single Airedale chiller – there is redundant CHWS and refrigeration pipework within the main plant room and building roof. The tenants have separate R410A VAV and split AC units located to the roof and 1st floor flat roofs. These are in various states of repair and date between 2005 and 2015. The tenants own equipment is outside of our scope for costs. The landlord has 2No. Fujitsu R410A AC Split Units located within the ground floor south fitness room – condensers located to the 1st floor south wing roof – there are 8 years old and will require replacement within the next 10 years.	 	+ The chiller has been sized for the ITF north wing office use only – therefore this system cannot be utilised for any further office areas. + Consider removal of all redundant LTHW, CHWS and refrigerant pipework throughout building and roof. + Replace 89No. ITF obsolete Fan Coil Units with new actuators and BMS controllers. + Tenants own AC equipment not included in costs. + Consider replacement of landlords Fujistu AC units within the next 5-10 years.
7.0	Plumbing services		The Landlord are responsible for the central core toilet areas and cleaners' cupboards. These areas were found to be in generally good condition and will require general maintenance over the coming years – although an update of the services would be required within the next 10 years. There are several tenant's kitchen on levels 4 to Grd – these were noted as being fitted out and adapted by the tenants and this is confirmed they are responsible for the maintenance themselves.		+ Continue PPM and reactive maintenance of the toilet areas + Consider future refurbishment of the toilet areas + Confirm responsibilities of maintenance and refurbishment of tenant's toilets and kitchens. + Remove all lead waste pipework


No	Service	Condition	Description	Photo (if applicable)	Recommendations
8.0	Rainwater and Above Ground Drainage System		The above ground drainage system is predominately cast iron and dates from original external 1908 downpipes and hoppers to later additions and repairs. There are several lead overflows pipes from downstairs toilets. The flat roof has several surface water drain covers missing and soil stack vent pipes with no cage protectors. These should be provided to ensure no foreign matter blocks the systems. The ground level surface water drain covers require cleaning from vegetation. The maintenance manager confirmed that there are several interceptor tanks below the car park – these were outside of the current scope to review. Sump pump control panels and pumps require refurbishment		+ Carry out CCTV survey of all underground RWP and Soil Pipework including inspections of interceptor tanks. + Provide SVP and RW drain covers to roof. + Clear all vegetation from surface drains. + Consider replacement of all sump pump panels and pumps (south wing basement) as these are 22 years old.

4.0 Electrical Services

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Main Electrical LV Switchboard		The Grange main LV switchboard is located in the South wing basement area. This switchboard and other complex buildings are supplied from a central HV/LV Main Systems switchboard located approx. 20m from The Grange in its own UKPN/bank of England switch room building. The switchboard has recently had a replacement ABB ACB which had previously failed. The main LV switch panel is a Main systems BS88 fuse switch cubicle panel serving both landlords and tenants electrical supplies. The electrical system is served via an 800A TP&N supply with a TNS earthing system. Outgoing fuse switch isolators are rated between 250A and 20A. The installation is 22 years old and requires replacement in the next 5-10 years. Additionally, there is an electrical overheating smell in the room. This was reported to both the maintenance and BofE Centre managers. This may require remedial works following the investigation. There are several redundant cut SWA cables and holes left in the top of the switchboard and redundant equipment located to the common parts of the building. Sub main supplies are provided by SWA cables and single cables* within steel trunking, (predominately south wing fire escape stairs*). The installation was last tested in 2015 with recommendations for further testing on 2016.	 	+ Investigate electrical overheating smell in switch room + Refurbish or replace the Main Systems LV switchboard in The Grange. + Refurbish or replace the main HV/LV switchboard located in the UKPN/BofE + Remove all redundant electrical equipment and cables within the building. + Fit blanking plates to top of switchboard to prevent potential water ingress. + Undertake new EICR test and inspection and ensure inadequate protective devices are replaced for correct size
2.0	LV Distribution		The LV distribution is provided by approx. 20no. Merlin Gerin, Crabtree and Main Systems cubicle type TP&N & SP&N type distribution boards located within tenant's floor areas and located to the south wing fire escape stairs. There are additionally several redundant MEM BS3036 rewireable distribution boards with asbestos fuse holders which require removed. (South wing basement) Separate cubicle switchboards, distribution boards and MCPs are located within lift motor rooms and plant areas. All final circuits are approx. 22 years old and of various installation methods from single PVC cable within steel trunking and conduit to Twin and Earth Cable and tray. Distribution boards are 22 years old and in reasonable condition, although the Merlin Gerin, Crabtree and MEM boards are now obsolete. All boards were noted as being tested within the last five years – although on inspection of the certificates available these indicated circuits requiring further investigation and sub mains with incorrect protective devices. Tenants have installed their own distribution boards within their demise with check metering – these are of various age and appear to be in good condition.	 	+ Remove all redundant MEM BS3036 rewireable distribution boards – this will require asbestos trained personnel. + Replace all single core sub mains in steel trunking to south wing to ensure no electrical services are located to the fire escape stairs or equipment enclosed in fire rated enclosure. + Allow to rewire all final circuits within the basement, roof and landlords' common parts with new. + Replace all obsolete distribution boards with Schneider distribution boards. + Undertake new EICR test and inspection and ensure inadequate protective devices are replaced for correct size

No	Service	Condition	Description	Photo (if applicable)	Recommendations
3.0	General Power		General power is provided by single cables within steel trunking and surface and slab mounted conduit. The accessories date from mid 1970s on the south wing stairs and of various ages elsewhere in the landlord's areas. The South wing tenants' office areas, (1st-4th floor) have been extensively refurbished, and these appear to be in good condition. The north wing tenant (ITF) electrical installation is dated from the 1997 refurbishment. There appears to be minimal use of 30mA RCD additional protection to small power final circuits – this should be provided for safety.		+ Allow to rewire all final circuits within the basement, roof and landlords' common parts with new. + Ascertain whether the tenant ITF is responsible for the electrical installation maintenance to the north wing offices. + Install 30mA RCD protection to small power final circuits.
4.0	General Lighting		General lighting is provided by a mixture of fluorescent linear, bulkhead and spot type luminaires throughout. The central core stairs, main plant room and several toilets lighting has been replaced with IP fluorescent and LED bulkheads and downlights. The majority of lighting throughout appears to be have been installed during the refurbishment in 1997. The majority or luminaires have exceeded or are approaching the end of their economic life and more energy efficient alternatives are now available and would make replacement a cost viable option. There is presently no external task lighting to the roof area to allow safe passage between plant and fire escape stairs – this should be considered.		+ Consider replacement of all existing fluorescent light fittings with LED equivalent fittings – this will provide a capital payback within 5 years and reduce maintenance lamp changes. + Consider installation of task and emergency lighting to roof walkway – for safe access to/from plant.
5.0	Emergency Lighting		The Emergency lighting installation was refurbished in 1997 and consists of mostly fluorescent type bulkhead fittings. The majority of the emergency fittings have exceeded or are approaching the end of their economic life and more energy efficient alternatives are now available and would make replacement a cost viable option. Monthly testing was observed to be carried out. Although several fittings observed during our survey were in poor condition with no charging lights.		+ Consider replacement of all existing emergency light fittings with LED equivalent fittings – this will provide a capital payback within 5 years and reduce maintenance lamp changes. + Ensure monthly inspection failures are rectified immediately.
6.0	External Lighting		LED perimeter external lighting is provided by IP rated floodlight fittings installed in the last 3 years. These are controlled by timeclock from ground floor distribution board adjacent the Centre core lift motor room. The fittings were observed to be in a good condition.		+ Continue with routine maintenance and replacement.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
7.0	Fire Detection and Alarm		A Honeywell Morley ZX5se analogue addressable fire alarm system is installed within the main reception area with the use of XP95 detectors and interfaces site wide. The system is operational and is not indicating any faults. The plant MCPs incorporate FA interfaces for plant shutdown in the event of fire alarm activation and additional indication to the main fire alarm system in the pavilion building. The 1st/2nd floor south wing tenants have their own FA system interfaced to the landlord's system. The current system is still supported and can be expected to operate for a number of years until obsolete.		+ Continue with routine maintenance and replacement.
8.0	Lightning Protection		The lightning protection was last tested in July 2019 at which point the system failed. The down conductor has test links and comprised of both coppers and aluminum conductors. All roof plant appeared to be The certificate identifies remedial works required to the down conductors		+ Carry out remedial works to the lightning protection system as required by the maintenance company.
9.0	Building Management System		A Trend 963 v3.72 Supervisor Building management system provides overview and limited control to the AHU's, Boiler Plant, CT & VT LTHW circuits and HWS. MCP 1, (circa 1997) is located to the main plant room requires refurbishment as the Trend 963 software, Trend IQ251 controllers and NDP panel display are now obsolete. MCP 2 also requires updating. The connection between buildings is completed by microwave radio transmitters and receivers. This system appears to have been installed within the last 5 years. The BMS system has been partially upgraded in other buildings to accommodate the latest IQ4 controllers and IQ view front panels.		+ Consider refurbishment of the BMS system within the grange to IQ4 and IQ view displays on all MCP's. + Consider upgrading the head end Trend 963 software and PC to Trend IQ Vision. + Carry out control panel refurbishment to MCP1 and MCP 2.
10.0	Passenger and Goods Lift		The Grange has 2No. passenger lifts and 1No. Goods lift. These are located to the north wing, central core and a goods lift to the south wing. They are hydraulic lifts with the lift motor roofs located to the roof apart from the central core lift where the lift motor room is located to the ground floor level. The Titan Type 3010 south wing hydraulic goods lift dates from 1987 and has an 8 person/500kg capacity with folding manual fire door on each level – there is no internal safety phone and the lift has been designated for goods only – not for passenger use. The lift has reached its economic lifecycle and the internal car requires refurbishment due to damage. No review could be made of the ride comfort due to no passenger use.		+ Refurbish all lifts to ensure continued service and spares availability. + Install safety phone to goods lift for safety requirements. + Review statutory compliance information for each lift which was not available during our survey.

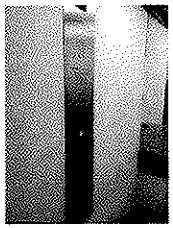NO	Service	Condition	Description	Photo (if applicable)	Recommendations
			Maintenance records identified controller and shaft lighting upgrade required.		
	Passenger and goods Lift – Cont		The central core Schindler Hydraulic passenger lift dates from 1997 and has a 13 person/1000kg capacity – the lift motor room is located to the ground floor. The lift appears to be in reasonable condition for its age although has reached its economic lifecycle. The lift has an underlying door fault which requires attention as this prevents correct operation without manual intervention. The ride comfort was adequate. Maintenance records identified shaft lighting upgrade required.		
			The North Wing Hydraulic Passenger Lift is operated and maintained by the tenant ITF. The lift dates from 1997 and has a 6 person/450kg capacity. No maintenance records were reviewed as the responsibility of the tenant, although the ride comfort was poor with horizontal travel between the lift car and shaft rails. The lift has reached its economic lifecycle and should be refurbished.		




tbanda.com



Bringing buildings to life

Sports Hall and Swimming Pool
Bank of England Sports Centre
Engineering Services Review

August 2019

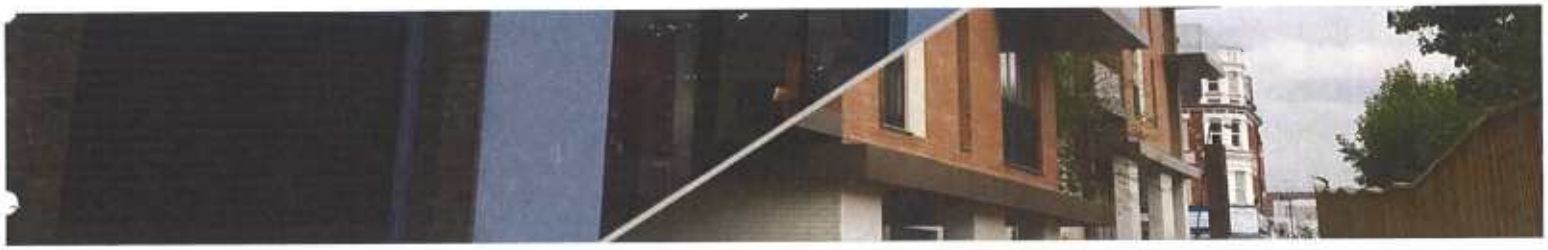

PROJECT
Lighthouse Surveyors-Bank of England Sports Centre-Sports Hall and Swimming Pool

PROJECT REF
19820

REPORT
Engineering Services Review

DOCUMENT NUMBER (if applicable)
19820-MEP-RPT-001

STATUS:
Draft for Comment

DATE:
21st August 2019

This report has been authorised by:



.....

James Partner
Partner

Revision	DCC No.	Comments	Date	Author	Checked
001	-	Draft for Comments	20th August 2019	IA	JC

This report is confidential and personal to the client for whom it was prepared and shall not be disclosed to any third party without TB+A's prior written consent. TB+A shall have no duty, responsibility and no liability to any party in connection with this report howsoever arising (whether in contract, in tort, in negligence or otherwise) other than that arising to the client under TB+A's appointment. Nothing in this report shall constitute or give rise to 1) a warranty, confirmation or statement that that any works, property or any other matter to which this report relates is fit for purpose or suitable for use or 2) a guarantee in respect of the performance of any works, property or any other matters to which the report relates."

This report is hereby signed off as the brief by: -

Company	Troup Bywaters and Anders
Name	Ian Andrews
Role	Senior Technical FM Consultant
Date	20th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	James Campbell
Role	Partner
Date	20th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	
Role	
Date	
Signature	

Contents

1.0 Introduction 1

1.1 The Property (Sports Hall and Swimming Pool) 1

1.2 Limitations 4

1.3 Services Overview 4

1.4 The Survey 5

2.0 Executive Summary 5

3.0 Mechanical Services 8

4.0 Electrical Services 12

1.0 Introduction


Troup Bywaters + Anders (TB+A) have been appointed by Lighthouse Surveyors and commissioned to undertake a review of the engineering services installations at the Bank of England Sports Centre, London SW15 5JQ.

The Bank of England Sports Centre covers approx. 32 acres and includes Commercial office space, administration and members facilities including commercial kitchens and restaurant, bars and sports facilities including residential cottages and grounds staff outbuildings.


This report has been prepared to provide a general appraisal of the engineering services installed within the sports centre complex in consideration of a potential purchase of the leasehold to the property. This report is solely for the property named as the Sports Hall and Swimming Pool. Separate TB&A reports are provided for the Grange (formally Records Office), Pavilion, Marquee, Squash Courts, Bank Lane & Clarence Farm Cottages.

1.1 The Property (Sports Hall and Swimming Pool)


Located off Priory Lane, Roehampton, South West London is a three-storey building known as the Sports Hall and Swimming Pool, the building spans from a basement under croft to the 3rd floor and GIA of 25,600sq.ft. The majority of Ventilation and Air conditioning plant are located at roof level and 3rd floor plant room. Non-potable water tank located within the 3rd floor plant room. The electrical supply is derived from the sports centre main HVLV switch room and the Sports Hall LV intake is located to the ground floor switch room. All LTHW is derived from the Pavilion basement plant room via underground piped services. The floor plans below show the general areas although omit the basement under croft areas and roof level.

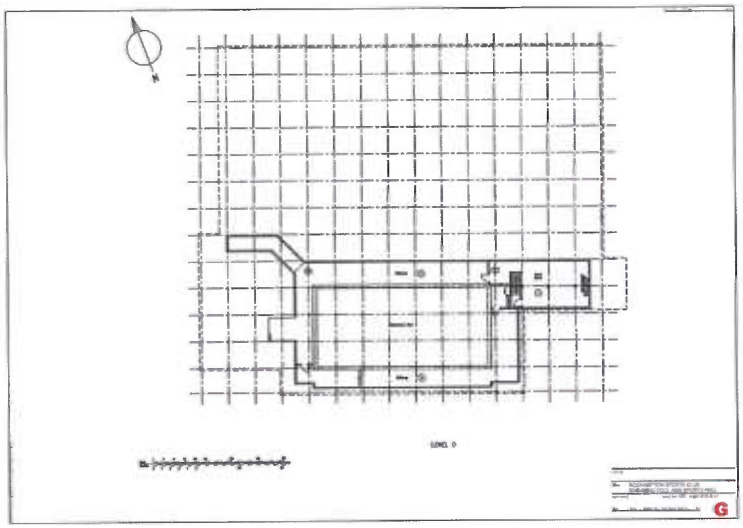


Ground floor

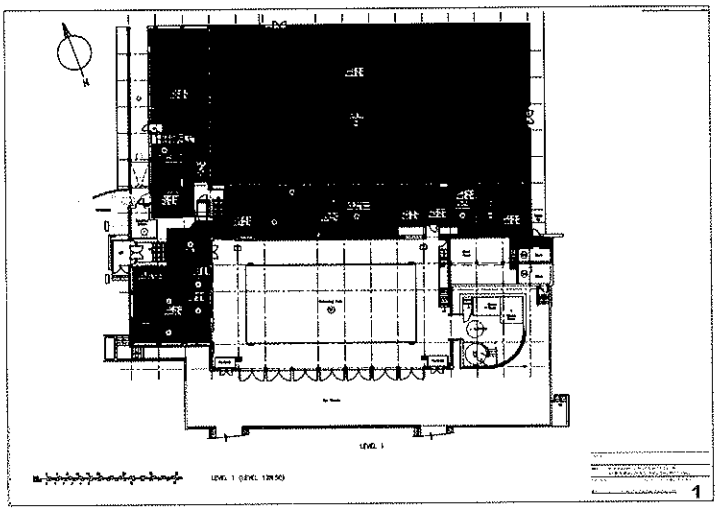

Level 1

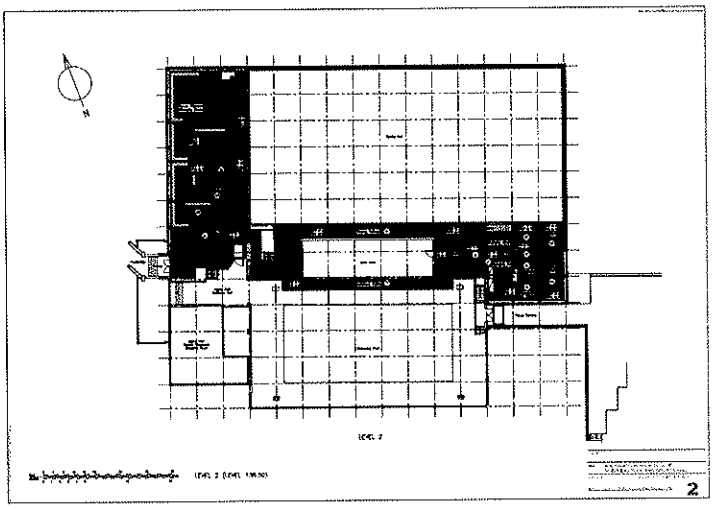

Level 2

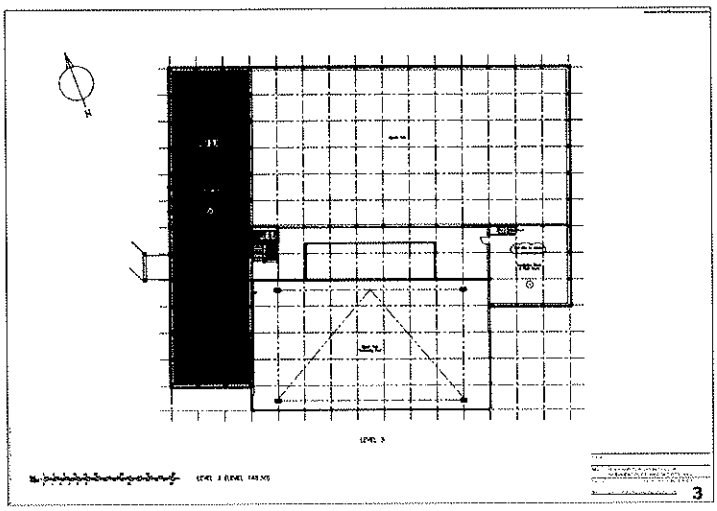

Level 3

The property was originally constructed in the 1960's and has been internally altered throughout the years, most recently in 1997 with the refurbishment of the electrical LV distribution infrastructure and 2008 when the gym and dance studios was refurbished and the solarium/spa was relocated.

Entrance to the property is possible via the walkway link bridge between the Pavilion changing rooms and the Sport Hall level 2 reception area and also by the level 1 Bank Lane reception area. Separate stairwells and a 5 person/400kg disabled lift provides access between ground floor and level 3.

A basement under croft level is provided and access can be made around the sides of the swimming pool. All mains services enter the under croft and distribute around the building. The main mechanical plant room is located to the south east basement area with access from the rear of the property.

Level 1 areas are utilised for changing, shower and toilet facilities for the swimming pool and sports hall with crèche facilities to the north end of the building. The sports hall (7268 sq. ft) can be accessed externally or via the ground floor reception area.

Level 2 houses members changing, shower and toilet facilities for the swimming pool and sports hall. Additionally, the swimming pool and sports hall viewing galleries are accessed via level 2. The original pre-2008 solarium and spa areas have been removed and relocated to level 1 south east side of the swimming pool. The areas services have been removed or made redundant and the internal fabric has been stripped to brick and concrete. Access to the 3rd floor plant room is via the old solarium although no lighting is provided which is a health and safety issue.

Level 3 areas include the 3rd floor plant room which houses the primary supply and extract AHU's and water tanks. Additionally, the gym and dance studio is located to the west side of the building. The 2008 refurbishment omitted removal of the LTHW radiant panel heaters. This redundant equipment is still located to the high-level ceiling as is the plant still located within the ground floor plant areas.

The level 2 and level 3 roofs house the swimming pool supply and extract ductwork, gym and dance studio air conditioning plant and sports hall and changing room roof extract fans, which are aged and redundant.

1.2 Limitations

No inspection was undertaken to those parts of the building services which are built in, covered up or otherwise inaccessible. The survey consisted of a non-invasive visual survey – no building services equipment covers were removed or ceiling tiles/plant sealed risers disturbed.

No definitive tests or calculations have been undertaken to determine the capacity of the plant nor have performance tests been carried out on the plant and system.

No functional testing of systems or installations was performed.

No inspection was undertaken to any underground services.

1.3 Services Overview

The building is currently occupied on all floors except the level 2 former solarium which has been stripped and the areas remain derelict. The building incorporates various modes of mechanical and natural ventilation, heating and cooling. The gym and dance studio have been provided with separate daikin VAM unit AHU's to provide fresh air and heat recovery – these being installed in 2008. Air-conditioning is provided to the gym and dance studio via 4No. Daikin RZQ140C7V1B R410A condensers with ceiling mounted cassette units within the gym and dance studio.

Primary mechanical fresh air ventilation is provided to the swimming pool via external insulated ductwork to side entry louvres at level 2 level. AHU No.2 VES Andover PM211S provides (4.4m3/s fresh air). The unit only has 1No. functioning fan the other is locked off due to failure. This provides fresh air to swimming pool area. A separate Extract AHU No. 1 PM211E with pumped heat recovery loop is located adjacent within the same plant room to AHU No. 1 on the south east level 3 plant room. The extract removes stale air from the swimming pool area and at present the unit only has 1No. functioning fan the other is locked off due to failure. (Both AHU's and pumps are circa 30-40 years old). MCC 4 is located within the level 3 plant room to control the AHU plant and is dated 2010 with IQ4E controller.

No Gas service was found provided to the Sports Hall and Swimming Pool building.

A Fire alarm system is provided within the Sports hall and Swimming Pool Building – this is linked to the pavilion building. The panel indicated all devices were within tolerance with no faults.

The Sports Hall and other central changing room areas are served via Brooks Jenna-Air roof extract fans which appear to be redundant and require replacement immediately with new controls.

The basement under croft is naturally ventilated via swimming pool floor grilles which draw the warm air from the basement through the swimming pool hall. The area is musky due to leaking pool overflow drains and poor ventilation. Various mechanical extract fans are provided for chlorine chemical rooms and changing room extract all these fans will require replacement within the next 5 years.

The Sports Hall and Swimming Pool LTHW heating for the main AHU plant, Swimming pool, VT ceiling panels and radiator circuit, redundant radiant (Ray strip) panels and DHWS plate heat exchangers are all supplied from the Pavilion main gas boilers via underground flow and return LTHW pipework. The basement plant room control panels, pump sets and pipework all date from the original1960's build. The ray strip pump sets and pipework have been decommissioned and the whole plant requires replacement within the next year.

Separate small plant areas are provided for the sauna, steam room and Jacuzzi spa. These are dated circa 2007, (apart from air blower fan) and appears to be good condition and operational. Although the original lighting, small power, air blower and general extract fan equipment is corroded due to caustic atmosphere and require replacement within the next year.

The Sports Hall and Swimming Pool LV Electrical switch board is located externally to the ground floor and serves all electrical supplies within the building. The public areas electrical installation was refurbished circa 1997. However, plant wiring and back of house areas are aged and rewire rewiring.

A non-potable boosted cold water service supplies members changing room showers, toilets, crèche and spa areas and are served from 2No. GRP tanks with a total capacity of 8000litres. Both tanks are circa 1997 with recently replaced booster sets to non-potable supplies.

The above ground rainwater pipework is provided by flat roof gullies and internal/external cast iron RWP with hoppers dating from 1960's. SVP are cast iron.

A Trend 963 v3.72 Supervisor Building management system provides overview and limited control to the AHU's, VT circuits and HWS. The system connects to the head end located within the Pavilion Maintenance office. Various outstations are situated within motor control cabinets and are dated circa 1997 with original swimming pool panel dating from 1960's with no BMS connection.

**Information taken from Project 513 Operating & Maintenance manual*

1.4 The Survey

A visual, non-intrusive survey was conducted by TB+A on 5th- 8th August 2019. The physical condition of the systems is noted within the document, assessed from a combination of on-site visual inspection of each area, review of record documentation and discussions with the maintenance provider - Leisure Support Services Maintenance Manager – Glen Miller.

Systems and installations have been assigned a condition rating in accordance with the following definitions:

Serious or Critical issue; requires action due to risk of failure. Has reached the end of its economic life.

Important issue; may require action or resolution. Poor condition with evidence of defects.

Information only; no action required. Routine maintenance. Satisfactory condition.

Budget cost estimates for recommendations have been provided as an indication to likely investment required. Costs are exclusive of VAT and any professional fees unless otherwise stated.

2.0 Executive Summary

TB+A completed a visual, non-intrusive inspection of the engineering services at the Sports Hall and Swimming Pool building, Bank Lane London SW15. The building dates from the mid 1960's and underwent a partial MEP refurbishment in 1997 and 2007 and most of the mechanical LTHW building services plant are over 50 years of age and require replacing. The building has various

types of ventilation and heating/cooling modes which is evidence of partial refurbishment over the years.

The services were generally found to be in an unsatisfactory visual condition however, as the majority have reached the end of their economic life. Unplanned and increased failure of the services is a likely a consequence of age and obsolescence of components will increase downtime and disruption to the business.

Key issues have been summarised in the table below.

Mechanical Services	
Mains Water Service	Consider Installing a magnetic water softener device on incoming service to prevent scaling. Install insulation to missing CWS pipework sections. Carry out a Water Risk Assessment to ensure compliance – the WRA document provided was dated Jun 2015 with a 2018 review date.
Domestic Hot Water Service	The PHX units was installed in 1997 and is 22 years old. This unit will require replacing in the next 5 years
Gas system	No gas service is provided to the Sports hall and Swimming Pool building. The LTHW heating is derived from the Pavilion building.
LTHW Heating System	The basement swimming pool LTHW plant room is in poor condition and equipment is over 50 years of age and requires refurbishment or replacement within the next 12 months.
Ventilation system	The Sports Hall and Swimming Pool is provided with mechanical and natural ventilation. The systems are passed their economic life expectancy and require refurbishment and replacement within the next 5 years.
Air Conditioning System	The Daikin Split air conditioning systems (4No.) serve the gym and dance studio which was refurbished in 2007. The systems appear to be operating normally and will continue to provide a good service for the next several years, allow to replace within the next 10 years.
Plumbing Services	The areas were found to be in generally good condition and will require general maintenance over the coming years – although an update of the services within the changing rooms would be required within the next 10 years.
Rainwater and Above Ground Drainage System	The above ground drainage system is predominately cast iron and dates from original external 1960's downpipes to later additions and repairs. The basement plant areas and undercroft SVP and RWP pipework is in poor condition and will require refurbishment in the next 5 years.
Spa	The steam room, sauna and Jacuzzi spa equipment will require general replacement over the next 10 years as the caustic atmosphere corrodes the plant equipment. The original spa areas to the 1st floor are derelict and require complete refurbishment.

Vertical Transportation	
Passenger and wheelchair lift	The Sports Hall and Swimming Pool has 1No. Wheelchair passenger lift with a (5 person/400kg) capacity. This provides a service between the ground floor and level 3. The lift ride was found to be satisfactory and should provide continued service for the next 5 years with good pre planned maintenance.
Electrical Services	
Electrical Installation	The electrical systems were partially refurbished in 1997 – the building will require a rewire within the next 5 years and the basement plant room within the next 12 months.
Lightning Protection	The current lighting protection certificate was not seen during our survey although all roof plant appeared to be connected to the lightning protection system. Carry out lightning protection inspection with 12 months. Consider surge protection devices to electrical intake position.
Building Management System	The building management system dates from 1997 and requires upgrading to the latest Trend IQ4 controllers and IQ Vision software.

Site logbooks and maintenance tasks appear to be undertaken on a caretaker basis with reactive maintenance being undertaken. The contractor's site logbooks and water risk assessment folders were found to be out of date as were the F-Gas Folder.

Estimate budget costs for recommendations have been provided to identify likely investment required. Costs are exclusive of VAT and professional fees. Investment required within the next 5-10 years is estimated at £1.665 million excluding any asbestos survey and removal costs, builders works and preliminaries. (BSRIA Blue Book 2018 - £700.00 per m^2 – Total GIA 2378m^2).

3.0 Mechanical Services

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Mains Water Service		A mains water service enters the basement via isolation valves and water meter and rises to supply 2No. sectional (non-potable) GRP tanks with approx. total capacity of 8000L. The non-potable water services are provided with recently installed DAB twin Inverter pump booster sets which appear to be recently installed within the last 2 years. The water tanks appear to be circa 1997 and are in good condition. A high-level expansion tank could not be accessed for its condition. The CWS mains service also supplies emergency plant room shower, outside tap, gym and dance studio drinking fountains and also drinking water points in crèche and spa areas. Water hygiene records such as flushing, temperature records and microbiological testing were not observed as records were found to be dated -Water Risk Assessment provided dated 2015.		+ Consider installing a magnetic water softener device on incoming service to prevent scaling. + Install insulation to missing CWS pipework sections. + Carry out a Water Risk Assessment to ensure compliance
2.0	Domestic Hot Water Service		The domestic hot water service to changing rooms, crèche, showers and toilets is provided via landlord's twin pump Thermaflow hot water heat exchanger complete with trace heating to maintain the temperature of the pipes to enable a more constant temperature throughout. The unit is controlled and monitored remotely on the BMS. The unit was installed in 1997 and is 22 years old. This unit will require replacing in the next 5 years. TMV valves will require replacement within the next 5 years. The sauna, steam room and Jacuzzi equipment will require replacement within the next 5-10 years with correct pre-planned maintenance. Although the air blower will require replacement in the next 5 years.	 	+ Consider replacement of the Hot Water Heat Exchanger Unit within the next 5 years or when it fails. + Consider testing and/or replacement of TMV to ensure continued safe use. + Spa equipment requires replacement within the next 5-10 years with continued pre planned maintenance and replacement when equipment fails.
3.0	Gas Service		No Gas Service was found to the Sports Hall and Swimming Pool Building – The heating is derived from the Pavilion Gas Boilers	N/A	+ The sports complex underground gas supply network should be surveyed to provide a detailed plan of all gas pipework.
4.0	Heating System		The Sports Hall and Swimming pool heating service is provided by a 100mm Ø LTHW supply and return branch derived from the pavilion basement LTHW plant room. The LTHW service enters the basement under croft via service duct and follows the walkway around to the basement mechanical plant area. Here the service splits to supply Variable Temperature heating circuits for Swimming Pool, changing room ceiling panel and radiator heating, DHWS and redundant Gym and dance studio Ray Strip Radiant Panels.		+ All LTHW equipment, control panels, actuators, valve sets, and Pump sets have reached the end of their economic life expectancy and are noted as being in a poor state of repair all require replacement within the next 5 years. Although, in the meantime equipment will need replacing as it fails.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
			All services have twin duty and standby pump sets with actuator valves. All MEP equipment within the plant room dates from the 1960's and requires replacement within the next 5 years. The VT circuit for the Ray Strip radiant panels and pump sets were found drained, disconnected and decommissioned. The whole system should be removed. The plant has been only receiving caretaker maintenance with replacement made when equipment fails. The heating control Panel MCC3 located within the ground floor plant room has been modernized with IQ4 View touch screen panel although no internal panel inspection was made. The panel appears to be around 22 years old and was modernized as part of the 1997 refurbishment. BMS alarms for the HWS pumps noted continuous hi-temp and trip status on the BMS alarm history - this requires investigation. Additionally, VT Pump No. 2 had tripped. The main swimming pool control panel is dated circa 1960's and requires replacement along with all control and electrical supplies. The swimming pool filter tank and pumps dated from the 1960's and require replacement. The under-croft pool overflow drains are corroded and leaking – some effort has been made to connect HDPE pipework to old cast pipework but the joint leak and floods the undercroft when back flushing is carried out by the maintenance team. The LTHW pipework has been repaired with compression clamps and was found to be corroded from the caustic atmosphere and requires replacement where damaged. The Jacuzzi air blower and control requires replacement as it is aged and corroded from caustic atmosphere. The filter pump and motor has been recently replaced.	   	+ Replaced corrosion damaged sections of LTHW pipework site wide. + Remove all insulation to Pavilion to Sports Hall LTHW pipework and clean, paint, install trace heating and reinsulate along entire length. + Investigate and repair HWS system going into alarm. + Upgrade all control panels and wiring for heating systems. + Investigate and repair all swimming pool overflow connections to prevent back flush flooding issues. + Strip all insulation within plant room, remove all redundant pipework and clean, replace here required and re-insulate. + Consider full refurbishment of Swimming Pool mechanical heating plant within next 5 years.
5.0	Ventilation System		Primary mechanical fresh air ventilation is provided to the swimming pool areas by the level 3 plant room VES PM211S AHU. A separate VES PM211E Extract AHU is located adjacent to AHU No. 2 with heat recovery loop and return air mixing actuator. Both units are over 22 years old and in a poor state of repair and require refurbishment or replacement within 5 years and defective fan motors replaced within 12 months. The ductwork lagging is damaged in areas and requires replacement The Supply and extract duty Supply/extract fan was not operating at the time of the survey and locked off at the isolator. However, MCC4 indicated no faults – replace defective fans to both supply and extract AHU's and refurbish AHU's. The heat reclaim circuit between AHU No. 1 and 2 requires refurbishment as the valves, twin pumps (pump no. 2 shows signs		+ Refurbish or replace AHU1 & AHU2 within 5 years. + Replace defective fan motors to AHU1 & 2 within the next 12 months. + Refurbish or replace the heat reclaim circuit pumps, actuators, valves with new within the next 5 years – replace pump no. 2 in the next 12 months. + Replace all roof mounted extract fans and controls with new equipment within 12 months.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
	Ventilation System…Cont.		of previous leaks), actuator and expansion vessel are at the end of their economic life expectancy. The ductwork located to the basement plant areas and basement under croft are badly corroded and require replacement – on completion of any works the system shall be thoroughly cleaned. The 2No. extract fans to the level 1 flat roof, (2No. Vent Axia ACQ31514HCNP) and associated ductwork are corroded and will require replacement within the next 5 years. The Brooks Jenna-Air roof extract fans - 4No. 900mm Ø providing extract to the sports hall and 4No. 450mm Ø extract for the changing rooms are over 40 years old and require replacement as the units were not operational and no control could be found during the survey. Several Extract fans require replacement in lift motor rooms and south wing ground floor toilet roof. The Chlorine and chemical rooms extract fans were damaged and covered in thick dust. The units require replacing within the next 12 months to ensure correct ventilation from the space. The gym and dance studio on level 3 provide fresh air to these areas via 2No. Daikin VAM AHU's. These were installed in 2008 and are 11 years old. These will provide continued service for the next several years with correct maintenance. No fire dampers were noted as being maintained by the maintenance provider – The refurbishment of the gym and dance studio in 2007 installed fire dampers - These appear not to have not been serviced by the incumbent maintenance provider and no annual drop test and inspection has been completed	   	+ Refurbish or replace plant room and chemical store extract fans and general changing room extract fans with new within the next 12 months. + Replace the 2No. level 1 flat roof Vent Axia fans within 5 years. + Replace corroded ductwork to basement plant areas within 5 years. + Continue to service gym and dance studio daikin VAM unit AHU's. Consider replacement in circa 10 years. + Locate fire dampers and complete drop test and provide maintenance within the next 12 months.
6.0	Air Conditioning system		The Sports Centre and Swimming Pool areas rely on extract fan ventilation for general cooling requirements with natural ventilation. An additional 4No. Daikin RZQ140C7V1B R410A heat pump units these each provide 14kW cooling capacity and 16kW heating capacity and are located to the 2nd floor central flat roof. These are in a good state of repair and dated 2007. The internal cassette type evaporators are ceiling mounted within the gym and dance studio areas. These units should provide continued service for the next 10 years if maintained to manufacturer's recommendations. The refrigerant pipework requires remedial works to repair damaged insulation and protect from mechanical damage		+ Consider replacement of the Daikin Heat Pumps in the approx. 10 years. + Repair damaged sections of the refrigerant pipework insulation and provide mechanical protection over the pipework. Complete within the next 5 years. + Continue with REFCOM approved maintenance of the units.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
7.0	Plumbing services		The building houses members changing, shower and toilet facilities for the swimming pool and sports. The crèche has kitchen facilities and sinks. These areas were found to be in generally good condition and will require general maintenance over the coming years – although an update of the services would be required within the next 10 years. The sinks and plumbing services to the basement plant room are in very poor condition and require either removal or replacement within the next 12 months.	 	+ Continue PPM and reactive maintenance of the changing rooms, showers, toilet and kitchen areas + Consider future phased refurbishment of the toilet areas in the next 10 years. + Remove or replace basement plant room sink and plumbing services. (within 12 months)
8.0	Rainwater and Above Ground Drainage System		The above ground drainage system is predominately cast iron and dates from original external 1960's downpipes to later additions and repairs. The basement plant areas and undercroft SVP and RWP pipework is in poor condition and will require refurbishment in the next 5 years. The saniflo pump installation within the basement requires replacement within the next 5 years. The flat roof has several surface waters drain covers missing and soil stack vent pipes with no cage protectors. These should be provided to ensure no foreign matter blocks the systems. The swimming pool overflow cast iron drains are leaking – these require extensive remedial works within the next 5 years. Several ground level surface drain covers require replacement as damaged and also require cleaning from vegetation. Sump pump control panels and pumps require refurbishment	 	+ Carry out CCTV survey and clean of all underground RWP and Soil Pipework. + Provide SVP and RW drain covers to roof within 12 months. + Replace Saniflo installation to basement plantroom within next 5 years. + Carry out extensive repairs to the swimming pool overflow junctions within the next 5 years with new pipework. + Complete repairs to missing defective drain cover and clear all vegetation from surface drains within 12 months. + Consider replacement of all sump pump panels and pumps as these are 22 years old. (Basement areas- within the next 5 years)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
9.0	Spa		The spa plant rooms are located adjacent the steam and sauna room within the service cupboard and the Jacuzzi plant room is located to the external east side of the building. The services have been replaced in 2007 when the spa was relocated from the first floor. The spa equipment will require general replacement over the next 10 years as the caustic atmosphere corrodes the plant equipment. The original spa areas are derelict and require complete refurbishment.		+ Allow to replace all spa equipment over the next 10 years. + Consider refurbishment of the original spa area as the floor area has been completely stripped back to the building fabric.

4.0 Electrical Services

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Main Electrical LV Switchboard		The Sports Hall and Swimming Pool building main LV switchboard is located in the west side of the building on the ground floor. This switchboard and other complex buildings are supplied from a central HV/LV Main Systems switchboard located approx. 40m from the building in its own UKPN/bank of England switch room building. The switchboard has recently had a replacement ABB ACB which had previously failed. The main LV switch panel is a Main systems BS88 fuse switch cubicle panel serving all the Sports Hall and Swimming pool electrical supplies. The electrical system is served via an 200A TP&N 4C 95mm^2 XLPE/SWA/PVC supply with a TNS earthing system. 19No. Outgoing fuse switch isolators and MCCB are rated between 200A and 20A. The board has been extended to provide additional supplies to the AELTC tennis courts 1-12. The installation is 22 years old and requires replacement in the next 5-10 years. The room incorporates several LV distribution boards, timers and contactors for external lighting and control. The wiring is dated and several sections of trunking lid is missing from the steel trunking. Sub main supplies are provided by SWA cables and single cables within steel trunking	 	+ Refurbish or replace the Main Systems LV switchboard serving the Sports Hall and Swimming Pool within the next 5-10 years. + Refurbish or replace the main HV/LV switchboard located in the UKPN/BofE in the next 5-10 years - Remove all redundant electrical equipment and cables within the building. - Install new steel trunking lid where found missing within the next 12 months. + Repair/replace defective Sangamo timers and contactors to LV switch room within the next 12 months. + Undertake new EICR test and inspection and ensure all C1 and C2 observations are completed within 12 months.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
			The swimming pool chlorine delivery pipework runs through the LV switch room – consideration should be given to relocate this service out of the electrical switch room. The installation was last tested in 2015 with recommendations for further testing on 2016.		
3.0	General Power		General power is provided by single cables within steel trunking and surface and slab mounted conduit. The wiring accessories date from mid 1960s for basement plant equipment and mid 1990's for the public facing areas. The complete small power wiring system and accessories should be replaced within the next 10 years. There are several broken wiring accessories noted during our survey, (Entrance lobby to sports hall fused connection unit). These require immediate replacement. Replace corroded electrical equipment to the spa plant rooms within the next 12 months. Allow to rewire the small power to the old solarium area within the next 12 months. There appears to be minimal use of 30mA RCD additional protection to small power final circuits – this should be provided for safety.	 	- Allow to rewire all final circuits within the building within the next 5-10 years. Basement undercroft and basement plant room within 12 months. - Install 30mA RCD protection to small power final circuits – although this will require replacement of the existing obsolete Merlin Gerin Distribution Boards. - Replace broken and defective wiring accessories. - Replace spa corroded metal equipment with corrosion resistant accessories.
4.0	General Lighting		General lighting is provided by a mixture of fluorescent linear, bulkhead and spot type luminaires throughout. The central core stairs, gym and dance studio and link bridge lighting have been replaced with IP fluorescent and LED bulkheads. The majority of lighting throughout appears to be have been installed during the refurbishment in 1997 and will require replacement with the next 5 years. The lighting installation to the old solarium area and fire escape requires rewiring and new lighting as the whole area is without artificial lighting causing a Health and Safety issue. The majority or luminaires have exceeded or are approaching the end of their economic life and more energy efficient alternatives are now available and would make replacement a cost viable option.	 	- Consider replacement of all existing fluorescent light fittings with LED equivalent fittings – this will provide a capital payback within 5 years and reduce maintenance lamp changes. - Immediately rewire the old solarium lighting installation to ensure general lighting is provided as the area is without any lighting at present.
5.0	Emergency Lighting		The Emergency lighting installation was refurbished in 1997 and consists of mostly fluorescent type bulkhead fittings. The majority of the emergency fittings have exceeded or are approaching the end of their economic life and more energy efficient alternatives are now available and would make replacement a cost viable option.		- Consider replacement of all existing emergency light fittings with LED equivalent fittings – this will provide a capital payback within 5 years and reduce maintenance lamp changes.

			The emergency lighting installation to the old solarium area and fire escape requires rewiring and new lighting as the whole area is without artificial lighting causing a Health and Safety issue. The emergency light fitting from the gym rear stairs in defective and damaged replace as are the external perimeter sports hall fittings Monthly testing was observed to be carried out. Although several fittings observed during our survey were in poor condition with no charging lights.		+ Immediately rewire the old solarium emergency lighting installation to ensure general lighting is provided as the area is without any lighting at present. + Ensure monthly inspection failures are rectified immediately.
6.0	External Lighting		The external lighting installation was refurbished in 1997 and consists of mostly fluorescent type bulkhead fittings. The external fittings have now exceeded or are approaching the end of their economic life and more energy efficient alternatives are now available and would make replacement a cost viable option.		+ Consider replacement of all existing emergency light fittings with LED equivalent fittings – this will provide a capital payback within 5 years and reduce maintenance lamp changes.
8.0	Fire Detection and Alarm		A Honeywell Morley ZX5se analogue addressable fire alarm system is installed within the main reception area with the use of XP95 detectors and interfaces site wide. The system is operational and is not indicating any faults. The plant MCPs incorporate FA interfaces for plant shutdown in the event of fire alarm activation and additional indication to the main fire alarm system in the pavilion building. The current system is still supported and can be expected to operate for a number of years until obsolete. The old solarium area require fire alarm remedial works as the area has disconnected and poor wiring within the area. This requires attention with the next 12 months.		+ Continue with routine maintenance and replacement. + Rewire fire alarm to old solarium area and recommission.
9.0	Lightning Protection		No lightning protection certificate was noted for the Sports Hall and Swimming Pool building. The down conductor has test links and comprised of both copper and aluminum conductors. All roof plant appeared to be connected to the lightning protection system.		+ Carry out a lightning protection test and complete any remedial works to the lightning protection system as required by the maintenance company. + Consider surge protection devices to electrical intake position.
10.0	Building Management System		A Trend 963 v3.72 Supervisor Building management system provides overview and limited control to the AHU's, VT LTHW circuits and HWS. MCC3 and MCC4, (circa 1997 and 2010) are located to the basement and 3rd floor plant rooms. These units have been upgraded to IQ4 controllers and IQ View touch screen on MCC3, although MCC 4 still has obsolete trend equipment installed. The connection between buildings is completed by microwave radio transmitters and receivers. This system appears to have been installed within the last 5 years.		+ Consider refurbishment of the BMS system within Sports hall and Swimming Pool building to IQ4 and IQ view displays on all MCP's. + Consider upgrading the head end Trend 963 software and PC to Trend IQ Vision. + Carry out control panel refurbishment to Swimming Pool MCC – Basement plantroom and MCC4

			The BMS system has been partially upgraded in other buildings to accommodate the latest IQ4 controllers and IQ view front panels.		
11.0	Passenger and Goods Lift		The Sports Hall and Swimming Pool has 1No. wheelchair passenger lift with a (5 person/400kg) capacity. This provides a service between the ground floor and level 3. The lift ride was found to be satisfactory and should provide continued service for the next 5 years with good pre planned maintenance.		+ Review statutory compliance information for each lift which was not available during our survey. + A separate lift inspection should be made by a VT engineer



tbanda.com



Bringing buildings to life

The Pavilion and Marquee
Bank of England Sports Centre
Engineering Services Review

August 2019



PROJECT
Lighthouse Surveyors-Bank of England Sports Centre-The Pavilion and Marquee

PROJECT REF
19820

REPORT
Engineering Services Review

DOCUMENT NUMBER (if applicable)
19820-MEP-RPT-001

STATUS:
Draft for Comment

DATE:
16th August 2019

This report has been authorised by:



.....

James Campbell
Partner

Revision	DCC No.	Comments	Date	Author	Checked
001	–	Draft for Comments	16/08/2019	IA	JC

This report is confidential and personal to the client for whom it was prepared and shall not be disclosed to any third party without TB+A's prior written consent. TB+A shall have no duty, responsibility and no liability to any party in connection with this report howsoever arising (whether in contract, in tort, in negligence or otherwise) other than that arising to the client under TB+A's appointment. Nothing in this report shall constitute or give rise to 1) a warranty, confirmation or statement that that any works, property or any other matter to which this report relates is fit for purpose or suitable for use or 2) a guarantee in respect of the performance of any works, property or any other matters to which the report relates."

This report is hereby signed off as the brief by: -

Company	Troup Bywaters and Anders
Name	Ian Andrews
Role	Senior Technical FM Consultant
Date	16th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	James Campbell
Role	Partner
Date	16th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	
Role	
Date	
Signature	

Contents

1.0 Introduction 1

1.1 The Property (Pavilion and Marquee) 1

1.2 Limitations 3

1.3 Services Overview 3

1.4 The Survey 5

2.0 Executive Summary 6

3.0 Mechanical Services (The Pavilion) 8

4.0 Electrical Services (The Pavilion) 13

5.0 Mechanical Services (The Marquee) 16

6.0 Electrical Services (The Marquee) 17

7.0 Appendix 1 (F Gas Register) 18

1.0 Introduction


Troup Bywaters + Anders (TB+A) have been appointed by Lighthouse Surveyors and commissioned to undertake a review of the engineering services installations at the Bank of England Sports Centre, London SW15 5JQ.

The Bank of England Sports Centre covers approx. 32 acres and includes Commercial office space, administration and members facilities including commercial kitchens and restaurant, bars and sports facilities including residential cottages and grounds staff outbuildings.


This report has been prepared to provide a general appraisal of the engineering services installed within the sports centre complex in consideration of a potential purchase of the leasehold to the property. This report is solely for the property named as the Pavilion and adjacent Marquee. Separate TB&A reports are provided for The Grange, (formally Records office), Squash Courts, Bank Lane & Clarence Farm Cottages and Sports Hall including Swimming Pool.

1.1 The Property (Pavilion and Marquee)


Located off of Priory Lane, Roehampton, South West London is a two-storey building known as the 'The Pavilion' The building spans from Basement to 1st floor and houses commercial kitchen, restaurant, hot service servery, bars, meeting rooms, offices and sports changing facilities with a GIA of 25,800sq.ft. A permanent marquee is located to the north of the Pavilion and is a single storey open plan structure with a GIA of 3,900sq.ft. The Pavilions ventilation and air conditioning plant equipment located to level 1 external flat roof areas and the main LTHW Boiler Plant Room is located to the basement level. The Marquee has a separate gas fired DX air handling unit providing air conditioning and is located to the rear of the marquee. Non-potable and potable water storage tanks are located within the pavilion central roof space loft.

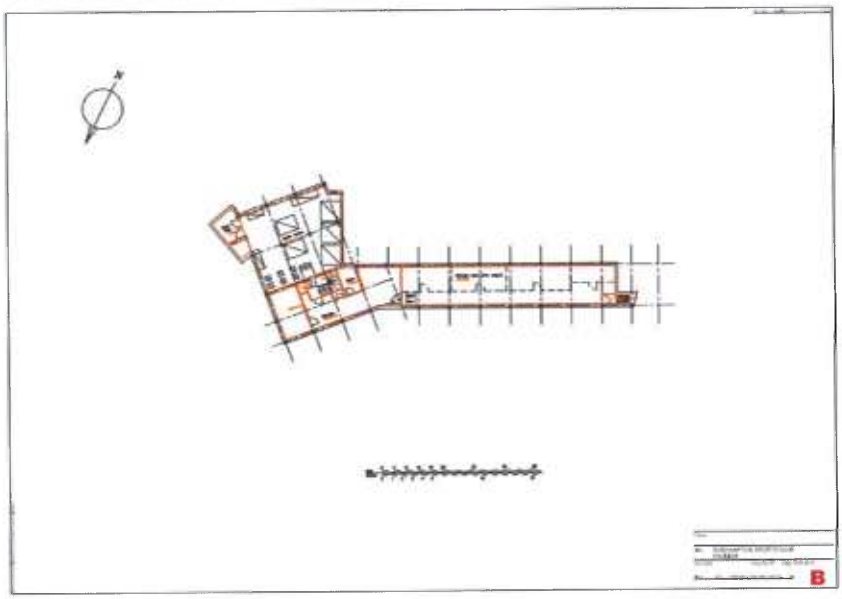

Basement

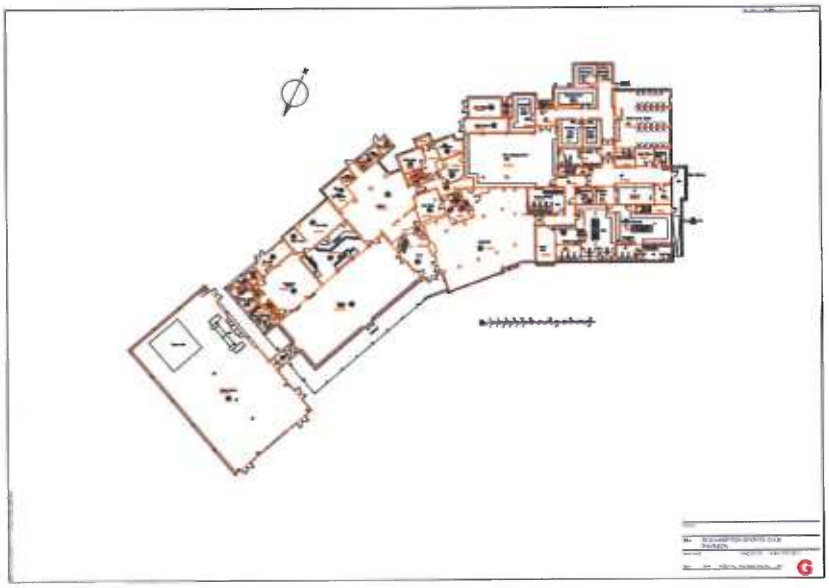

Ground Floor

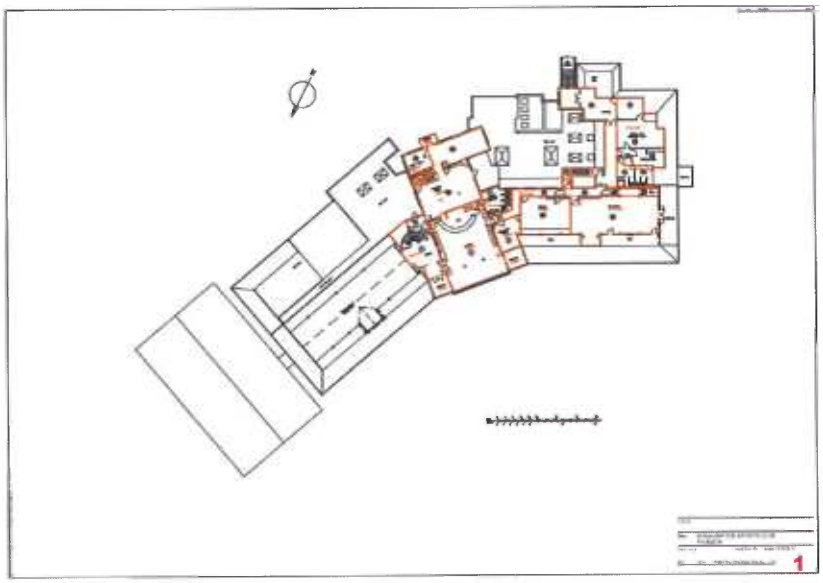

First Floor

The Pavilion property was originally constructed in early 1900's and has been internally altered throughout the years to provide kitchen, pot wash and servery areas, restaurants, bars, offices and meeting spaces.

The marquee is a relatively modern addition and constructed of GRP side panels and tent roof with side aluminium panels and glass doors, the building is used for wedding and social events.

Entrance to the Pavilion ground floor reception area is via Bank Lane car park to the south side of the property. Separate stairwells are located throughout the property with a first-floor link bridge to the Sports Hall & Swimming Pool building. A basement level is located under the central and south wing of the Pavilion and this houses the kitchen and catering storage areas and The Main LTHW Plant room (PAV/2) housing the boilers and gas intake. The LV room is located to the rear ground floor and this supplies all services within the Pavilion. The pavilion main gas service also supplies the Marquee AHU.

1.2 Limitations

No inspection was undertaken to those parts of the building services which are built in, covered up or otherwise inaccessible. The survey consisted of a non-invasive visual survey – no building services equipment covers were removed or ceiling tiles/plant sealed risers disturbed.

No definitive tests or calculations have been undertaken to determine the capacity of the plant nor have performance tests been carried out on the plant and system.

No functional testing of systems or installations was performed.

No access was gained to any underground services.

No access was possible to Pavilion kitchen high level flat roof, Pavilion North and South Wing loft space which were inaccessible. *(Note: The Pavilion north and south wing roof plant is only accessible by loft space crawling boards – this is a health and safety issue as a working at heights issue).*

1.3 Services Overview

The Pavilion building is occupied by both public and staff to the ground floor with admin offices, bars and meeting rooms on the first floor. The building incorporates various modes of mechanical and natural ventilation, heating and cooling.

The kitchen supply is served via a VES Andover MAX/E/3.4W/S AHU with separate Lennox A48 DX condenser unit and Kilo-heat RZR11-500 duty/standby extract fans with enclosure and ductwork are located to the level 1 north wing kitchen flat roof area and were installed in 2005. This provides primary treated fresh air supply to the kitchen, servery areas and extract from the 2No. kitchen cooker area hoods. The LTHW control panel for the AHU and extract plant is located to the 1st floor loft space. The Lennox external DX unit is unserviceable and isolated at present. The commercial kitchen is noted as having no fire suppression systems installed.

The north wing kitchen flat roof also houses several split unit condensers and walk in fridge and freezer compressors and condensers, complete with small VES Andover AHU an extract fans for the pot wash area.

The south wing flat roof area, (access via 1st floor admin office) houses 4No. VES Andover AHU's and various extract fan enclosures with split unit condensers. These units serve the reception, changing rooms, bar and first floor meeting room areas, all of these units are in a poor condition or isolated and disconnected.

Separate AHU's and extract fans are also located within the central roof space (Plant room PAV/3). This plant serves bar areas and restaurant high level extract. No access could be gained to review the restaurant extract due to working at heights H&S issue.

A redundant freight service lift (Dumb waiter) is installed between the basement and 1st floor with the lift motor room located within the central roof loft plant room (PAV/3). This was found isolated and the maintenance manager confirmed the lift motor room had suffered fire damaged and the lift has been out of service for the past few years. The complete lift system requires replacement along with controls and electrical supplies.

2No. Remeha P500 Gas cast-iron sectional Boilers with Reillo RS100 Burners, (750kW heat output per boiler) (925kw/hr input) are located in the basement main plant room (PAV/2) these supply constant and variable LTHW circuits to both the Pavilion and the Sports Hall/Swimming Pool buildings. The boiler flues are stainless steel and exit via the original chimney stack to the roof level. The units were installed in 2002 to replace original oil boilers and the project operating and maintenance manual states the underground tanks have been degassed filled with inert foam. Boiler number 1 currently has issues and requires remedials works which are in the process of being actioned by the maintenance team.

The basement plant room houses dosing equipment, DHWS plate heat exchanger and DHWS circuit pumps, main LTHW pressurisation sets with expansion tanks and CT/VT twin pump sets. All equipment is in a poor condition.

An approx. 200mm incoming gas service enters the basement plant room (PAV/2) via an underground service. The gas service splits and supplies the Marquee Trane unit, Pavilion Boilers and commercial kitchen gas equipment. The service is metered and provided with solenoid valves for the boilers and kitchen supply. The basement gas pipework, meter is poorly supported and solenoid valves have poor electrical connections.

The Pavilion Main LV Electrical switchboard, (Main Systems circa 1998) is located to the rear of the pavilion building ground floor, (PAV/1). The pavilion 400A TP&N supply is supplied from the Bank of England complex main HV/LV switch room via 300mm^2 XLPW/SWA/PVC installed to underground ducts. The pavilion switchboard supplies all electrical equipment in the pavilion and marquee.

1No. GRP sectional tank & 1No. redundant steel tank, each with a total capacity of approx. 7000 litres supply all the Pavilions cold water supplies serving changing rooms, toilets, kitchens and bars. An additional 2No. smaller redundant water tanks are located to the same roof loft space and ground floor servery rear store. The GRP tank is approx. 10 years old and the steel tank is approx. 40 years old. The water risk assessment completed in 2015 identifies issues with the tanks and numerous dead legs on the CWS pipework.

The above ground rainwater pipework is provided by flat roof gullies and internal/external uPVC guttering. The water runoff is stored in central underground grey water tank located under the Pavilion Patio. This served via underground water pumps with the local control panel to the pavilion

ground floor rear entrance. No information, nor access was gained to the underground tanks and pumps – this requires a separate survey and CCTV.

A Honeywell Morley ZX5se analogue addressable fire alarm system is installed within the main reception area. The building wiring is a mixture of MICS cables and FP200 type wiring serving XP95 smoke and heat detectors, sounders, plant shutdown interfaces and interface connections to other BofE buildings, (Grange, Sports hall, etc)

A Trend 963 v3.72 Supervisor Building management system provides overview and limited control to the AHU's, Boiler Plant, VT circuit and HWS. The BMS system connects to the head end located within the Pavilion Maintenance office. Various outstations are situated within motor control cabinets and are circa 1997.

The Marquee's primary supply air is provided by a Trane EYKH155 packaged unit installed in 2006, (Cooling capacity of 42.3kW, Heating capacity of 71.5kW) the unit incorporates a gas burner to provide heating and R407C DX unit to provide cooling – the unit is controlled from a wall mounted controller located within the marquee. The access to the equipment and the maintenance platform is dangerous and requires re-design.

1.4 The Survey

A visual, non-intrusive survey was conducted by TB+A on 5th-8th August 2019. The physical condition of the systems is noted within the document, assessed from a combination of on-site visual inspection of each area, review of record documentation and discussions with the maintenance provider - Leisure Support Services Maintenance Manager – Glen Miller.

Systems and installations have been assigned a condition rating in accordance with the following definitions:

Serious or Critical issue; requires action due to risk of failure. Has reached the end of its economic life.

Important issue; may require action or resolution. Poor condition with evidence of defects.

Information only; no action required. Routine maintenance. Satisfactory condition.

Budget cost estimates for recommendations have been provided as an indication to likely investment required. Costs are exclusive of VAT and any professional fees unless otherwise stated

2.0 Executive Summary

TB+A completed a visual, non-intrusive inspection of the engineering services at The Pavilion and Marquee, Bank Lane London SW15. The building was built circa early 1900's and has undergone various building upgrade works to the bars, kitchen, and restaurant. The building services are in a poor condition and aged and require refurbishment or replacing. The building has various types of ventilation and heating/cooling modes which is evidence of sectional refurbishment over the years.

The services were generally found to be in an unsatisfactory visual condition however and as the majority have reached the end of their economic life. Unplanned and increased failure of the services is a likely a consequence of age and obsolescence of components will increase downtime and disruption to the business.

Key issues have been summarised in the table below.


Mechanical Services	
Mains Water Service	The mains water services and storage tanks require refurbishment – the redundant tanks require removal including dead legs in pipework.
Domestic Hot Water Service	The plate heat exchanger DHWS unit was installed in 1997 and is 22 years old. This unit will require replacing in the next 5 years. Additionally, circulation pumps will require replacement.
Gas system	The incoming gas supply pipework and kitchen metering requires remedial works to provide secure support. The kitchen gas solenoid valve requires rewiring as the connections are via temporary connector blocks – all external exposed gas pipework should be cleaned and painted in ochre with BS banding.
LTHW Heating System	The boiler, VT pump sets are reaching the end of economic life expectancy and will need replacing within the next 5 years. The CT pump No. 2 is leaking, and a replacement is required. Sections of LTHW pipework are badly corroded and require replacement.
Ventilation system	The entire pavilions supply air handling units and extract fans require replacement. The systems are aged and several units are defective and/or disconnected. Advise refurbishment or replacement of the entire ventilation system. Note issues with restaurant high level crawling boards.
Air Conditioning System	The pavilion air conditioning systems are in poor condition. Redundant kitchen freezer compressor/condensers are sited on roof as are aged and unserviceable split ac units. The kitchen supply AHU Lennox DX condenser is unserviceable and requires replacement

Plumbing Services	The plumbing system is dated although the changing rooms, toilets and small kitchen are generally in good condition apart from minor maintenance issues with waste pipework entering the soil stacks. The toilets and showers will require modernisation within 10 years with continued good maintenance.
Rainwater and Above Ground Drainage System	The RWP guttering and downpipes appear to be in average condition although final connections to ground cast iron fittings are poor- these require correct connection to prevent blockages.
Vertical Transportation	
Freight lift (Dumb Waiter)	The freight lift is unserviceable and has been decommissioned. Remove or replace with new
Kitchen Catering Equipment	
Kitchen Catering Equipment	The commercial kitchen is in a poor condition and the appliances and general infrastructure requires replacement.
Electrical Services	
Electrical Installation	The electrical installation has been part refurbished in 1997 and additional areas have been refurbished in isolation – however, the whole installation requires rewire to ensure continued safe use for years to come.
Lightning Protection	The lightning protection system requires some remedial works to ensure all plant equipment to flat roofs are connected to the lightning protection system. A risk assessment should be undertaken to review whether surge protection devices are required as per BS7671;2018.
Building Management System	The building management system head end requires updating from Trend 963 to IQ vision software. Update all controllers to IQ4 as IQ3 and earlier are obsolete.

Site logbooks and maintenance tasks appear to be undertaken on a caretaker basis with reactive maintenance being undertaken. The contractor's site logbooks and water risk assessment folders were found to be out of date as were the F-Gas Folder.

Estimate budget costs for recommendations have been provided to identify likely investment required. Costs are exclusive of VAT and professional fees. Investment required within the next 5 years is estimated at £1.68million excluding asbestos survey and removal, builders works, commercial kitchen equipment and preliminaries. (BSRIA Blue Book 2018 - £700.00 per m^2 – Total GIA 2397m^2).

3.0 Mechanical Services (The Pavilion

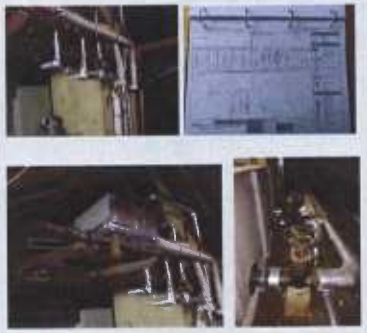No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Mains Water Service		A mains water service enters the basement plant room with main isolation valves and metering. The service divides off to serve chlorine dioxide dosing equipment, heating pressurization units and rises to 1st floor roof space via filter, separate isolation valves and water meter to serve 1No. sectional GRP and redundant empty 1No. Steel tank (non-potable tanks, each approx. 17000L). The basement chlorine dioxide dosing equipment was found in a poor state of repair. The GRP tank is in good condition and was operational during our inspection. However, the steel insulated tank is empty and was confirmed that it is only used for transfer of storage water for draining the main GRP tank. 2No. redundant water tanks are located within the loft space and ground floor storeroom. These require removing. Water hygiene records such as flushing, temperature records and microbiological testing were not observed as records were found to be dated - Water Risk Assessment provided dated 2015 with review date of 2018.		+ Replace existing CWS steel tank and replace with sectional GRP tank. + Replace basement dosing equipment as in poor condition + Remove redundant tanks and pipework dead legs on CWS. + Consider installing a magnetic water softener device on incoming service to prevent scaling. + Install insulation to missing CWS pipework sections. + Carry out a Water Risk Assessment to ensure compliance
2.0	Domestic Hot Water Service		The domestic hot water service to pavilion is provided via a twin pump Thermaflow hot water heat exchanger complete with trace heating to maintain the temperature of the pipes to enable a more constant temperature throughout. The unit is controlled and monitored remotely on the BMS. The unit was installed circa 1997 and is 22 years old. This unit will require replacing in the next 5 years. The DHWS has 3No. secondary circuits supplying the following areas: - + Secondary DHWS left hand pavilion corridor + Secondary DHWS back of pavilion + Secondary DHWS right hand side of corridor The 3No. circulation pumps will require replacement within the next 5 years.		+ Consider replacement of the Hot Water Heat Exchanger Unit within the next 5 years or when it fails.
3.0	Gas Service		An approx. 200mm OD mild steel gas main enters the main plant room at basement level via a main isolating valve and metering. The gas service supplies the Pavilion 2No. Remeha P500 gas boilers, commercial kitchen and Marquee AHU. Safety solenoid		+ Supply and install new supports for the gas service pipework and kitchen gas meter. + Rewire kitchen solenoid valve to ensure compliance with wiring regulations.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
			valves are provided for the kitchen and boiler supplies and connected to the plant room EPO. This was not tested. The lower section pipework, (appears to be serving the kitchen) was found to be incorrectly supported as was the gas meter which is lying directly on the floor and subject to water and mechanical damage. The kitchen solenoid valve cable was found to be poorly connected via temporary connector blocks.	 	+ Functionally check the solenoids for correct operation + Carry out full inspection to underground gas services.
4.0	Heating System		2No. 750kW Remeha P500-10 Gas sectional Boilers are located within the basement plant room with stainless steel flues installed to the redundant chimney stack from basement to Pavilion roof level. The boilers serve the Pavilion and Sports Hall/Swimming Pool LTHW and DHW services. The boilers were installed in 2002 and Boiler No. 1 has suffered from flue and burner maintenance issues and was awaiting repair. Boiler No. 2 was operating although both boilers are 17 years old and will require replacing within the next 5 years. Additionally, the heating VT and CT valves and pump sets, (Nos 1-4) were found to be in a various state of repair with a redundant CT pump and motor lying within the plant room. CT Pump No. 2 (Lowara 5.5kW motor with Hydrovar VSD) was found to be leaking from the pump flange and requires replacement. CT Pump No. 1 was operational. The VT Radiator and Panel pumps (Grundfos and Pullen) were not seen operational, although all these pumps are aged and require replacement. The expansion vessels are aged and require replacement. The plantroom LTHW pipework appears to have had repairs and the uninsulated sections showed heavy corrosion. All insulation should be removed, pipework checked, and corroded sections replaced and reinsulated. Additionally, there are several sections of redundant pipework and control panels within the basement. The LTHW 100mm Ø supply/return pipework to the swimming pool plantroom exits the basement plantroom to the rear lightwell to 1st floor roof level and drops to underground ducts to swimming pool plant area. The insulation was damaged and requires repair and the whole LTHW pipework should be checked for corrosion. The LTHW Pavilion cast radiators are over 40 years and are located within box work and exposed to back of house areas. Additional pressed steel radiators are located within the reception areas. Gas safety certificate dated 09/11/2018 indicated boilers were both safe for use.	  	+ The Boilers, flues and Pump sets have reached the end of their economic life expectancy and are noted as being in various state of repair all require replacement within the next 5 years. + Replace corrosion damaged sections of LTHW pipework and insulation internally and externally. + Refurbish local control panels for boiler plant. + Replace expansion vessels (x2) and pump control unit. + Replace cast radiators and provide TMV controls + Remove redundant VT circuit for panel heaters. (if not required)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
5.0	Ventilation System		The pavilion primary ventilation is served via several VES Andover air handling units and extract fans located to the 1st floor south and north flat roofs – these are dated between 1997 and 2005 and are either redundant, faulty and/or in a poor state of repair. The units are detailed below: - South Roof VES Green Room AHU – Disconnected and redundant – Replace VES Changing Room AHU –Poor condition/redundant LTHW/CHWS pipework – Replace VES Bar Area AHU – poor condition – Replace VES Bar Area AHU - poor condition – Replace Package Extract Fan changing room – poor condition – Replace Package Extract Fan Toilets – Poor condition – Replace Package Extract Fan 1st floor – Corroded unit – Replace Loft – Ground floor Bar extract fan – isolated – Replace Restaurant extract fan – no access – remove and replace Roof vortex extract fan – aged – Replace North Roof Kitchen VES Andover AHU with faulty external DX unit – Replace LTHW pipework is exposed and lagging requires replacement. Kitchen Extract package unit – duty and standby fan Replace AHU No. 2 pot wash area – Corroded and aged – Replace Pot wash extract – Corroded and aged – Replace General ventilation Approx. 30No. extract fans to toilets, shower rooms, stores and external windows in various states of repair - Replace The AHU's, packaged extract fans, wall extract fans and associated control panels are in a poor state of repair and should be replaced or system redesigned. . The general ductwork is without lagging and where lagging is installed it is badly damaged and requires replacement The ductwork requires cleaning and any fire dampers inspected. Although maintenance confirmed none installed.	   	+ Refurbish or replace all AHU's and extract fans including replacing corrosion damaged sections of LTHW and CHWS pipework and replacing damaged insulation. + Refurbish or replace Toilet supply and extract AHU's with new. + Replace wall/window mounted fans + Refurbish or replace all control panels and controls. + Remove redundant ductwork to ground floor south wing. + Repair/replace kitchen hoods where damaged + Locate fire dampers, (where installed) and complete drop test and provide maintenance.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
6.0	Air Conditioning system		The Pavilion is provided with separate split AC units located to the 1st floor flat roofs, external ground floor and internal evaporators located to the rooms. These are in various states of repair and date between 1997 and 2012. Additionally, there are redundant fridge/freezer chiller condenser equipment located to the roof areas which require removal and/or replacement. F Gas Register was found to be dated 2015 and requires updating. A copy is provided in Appendix 1. The kitchen primary supply AHU external Lennox DX unit is unserviceable and isolated at present. Air conditioning louvres within kitchen and Pavilion require cleaning, refurbishment or replacement. The 2No. Split units serving the admin offices are in a poor condition and require immediate replacement.		+ Replace Admin office split air conditioning units + Replace Lennox DX unit and pipework on Kitchen supply AHU. + Consider phase replacement of air conditioning units + Consider replacement of walk in freezer/fridges in kitchen. See section 9.0
7.0	Plumbing services		The Pavilion has separate members male and female changing rooms which include showers, WC's including disabled toilets. Additionally, the restaurant and server has separate WC facilities. The showers have thermostatic mixing valves installed to each group of members showers. The 1st floor facilities include catering staff changing areas, staff room, male and female WC's and the balcony bar. The first-floor toilets require refurbishment as the services are over 40 years old. The commercial kitchen & Tyrrell Bar plumbing services include the pot wash area, steam ovens, basins, Ice maker, dishwashers. The kitchen requires renovation (see section 9.0) and will require updating. The general members, bar and office toilet areas were found to be in generally good condition and will require general maintenance over the coming years – although an update of the services would be required within the next 10 years. The SVP drainage is cast iron and was found to be corroded in several toilets.	 	+ Continue PPM and reactive maintenance of the toilet areas + Consider future refurbishment of the shower and toilet areas + Ensure TMV valves are tested and replaced when fail. + Consider refurbishment 1st floor male and female toilets and kitchen + The SVP drainage is cast iron and was found to be corroded where toilet uPVC waste enters the underground services – complete CCTV survey to all underground pipework.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
8.0	Rainwater and Above Ground Drainage System		The above ground drainage system is predominately uPVC and dates from approx. 1980's. The underground RWP is poorly connected to the vertical downpipes a suitable cover should be provided to avoid blockages. The flat roof has several surface soil stack vent pipes with no cage protectors. These should be provided to ensure no foreign matter blocks the systems. The basement plant room external light well area has poor drainage and requires extensive works to outside services. Sump pump control panels and pumps require refurbishment		+ Carry out CCTV survey of all underground RWP and Soil Pipework including inspections of interceptor tanks. + Provide SVP and RW drain covers to downpipe connections and flat roof. + Clear all vegetation from surface drains. + Consider replacement of all sump pump panels and pumps as these are over 20 years old or redundant.
9.0	Kitchen Catering Equipment		The pavilion commercial kitchen is dated with the equipment in poor condition. The extract hood louvres are damaged and hood IP rated lighting is defective. The general kitchen electrical, gas and water supplies are in aged and poor condition – additionally, the kitchen has no cooling DX available for the main AHU supply air and therefore has increased supply temperatures. There is no fire suppression systems within the kitchen – this should be considered as part of any upgrade works. No gas interlock safety panel between extract ventilation and gas supplies was noted. This should be provided to prevent buildup of CO_2 and NO_2 in the event of ventilation failure.	 	+ Consider refurbishment or the commercial kitchen. + Consider replacement of all cooking equipment + Consider installation of Ansul systems over the grill and fryer areas. + Install gas interlock safety panel to BS EN 161
10.0	Irrigation System		An underground irrigation system is installed for the extensive grounds. The storage tanks and pumps are located under the pavilion patio and bank lane. The control panel is located to the rear ground floor of the pavilion. The system requires a separate underground services survey. No access was provided as underground services was outside of our scope of works.	 	+ Request full drawings and O&M for irrigation system and review to ensure fit for purpose. + Carry out survey of irrigation system to determine its condition.

4.0 Electrical Services (The Pavilion)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Main Electrical LV Switchboard		The Pavilion main LV switchboard is located to the rear of the pavilion on the ground floor (Plant Room PAV/1). The Main Systems switchboard dates from 1997 and is reaching the end of its economic lifecycle and will require refurbishment or replacement within the next 5 years. The electrical and switchboard was installed in 1997 under bank of England Project 000014. The pavilion is served via a 400A TP&N supply supplied from the Bank of England complex main HV/LV switch room via 300mm² XLPW/SWA/PVC installed to underground ducts. The pavilion switchboard supplies all electrical equipment in the Pavilion and Marquee. The lift, cricket score board and an unmarked switch fuse were found locked off. Sub main supplies are provided by SWA cables and single cables* within steel trunking. The installation was last tested in 2015 with recommendations for further testing on 2016.	 	+ Refurbish or replace the Main Systems LV switchboard in The Pavilion. + Remove all redundant electrical equipment and cables. + Metering was operational although not checked for accuracy. + Undertake new EICR test and inspection and ensure inadequate protective devices are replaced for correct size
2.0	LV Distribution		The LV distribution is provided by approx. 20no. Merlin Gerin, Crabtree and Main Systems cubicle type TP&N & SP&N type distribution boards located within pavilion and marquee. Separate cubicle switchboards, distribution boards and MCPs are located within lift motor rooms and plant areas. All equipment, sub mains and final circuits are approx. 22 years old and of various installation methods from single PVC cable within surface steel trunking and surface/slab conduit to Twin and Earth Cable and tray. The electrical systems are approaching their end of economic lifecycle and would advise a full rewire of the pavilion building. Distribution boards are 22 years old and in reasonable condition, although the Merlin Gerin, Crabtree and MEM boards are now obsolete. All boards were noted as being tested within the last five years – although on inspection of the certificates available these indicated circuits requiring further investigation and sub mains with incorrect protective devices.		+ Consider rewiring all sub mains within the pavilion + Replace all obsolete distribution boards with Schneider distribution boards. + Undertake new EICR test and inspection and ensure inadequate protective devices are replaced for correct size

No	Service	Condition	Description	Photo (if applicable)	Recommendations
3.0	General Power		General power is provided by single cables within steel trunking and surface and slab mounted conduit. The accessories date from 1980's and 90's. The wiring within the roof space (Plantroom PAV/3) was found to be in poor condition. The servery and reception has undergone renovation although the whole electrical systems should be renewed. There appears to be minimal use of 30mA RCD additional protection to small power final circuits – this should be provided for safety.		+ Allow to rewire all final circuits within the Pavilion + Allow to provide new wiring accessories. + Install 30mA RCD protection to small power final circuits.
4.0	General Lighting		General lighting is provided by a mixture of fluorescent linear, bulkhead and spot type luminaires throughout. Several areas including the servery, reception area and 1st floor link bridge to the swimming pool has be refurbished with LED bulkheads and downlights. The majority of lighting throughout appears to be have been installed in the 1980's and 90's. The majority or luminaires have exceeded or are approaching the end of their economic life and more energy efficient alternatives are now available and would make replacement a cost viable option. There is presently no external task lighting to the roof area to allow safe passage between plant and fire escape stairs – this should be considered.		+ Consider replacement of all existing fluorescent light fittings with LED equivalent fittings – this will provide a capital payback within 5 years and reduce maintenance lamp changes. + Consider installation of task and emergency lighting to roof walkway – for safe access to/from plant. + Allow to rewire all final circuits within the Pavilion + Allow to provide new wiring accessories.
5.0	Emergency Lighting		The Emergency lighting installation appears to be circa 25 years old and consists of mostly fluorescent type bulkhead fittings. The majority of the emergency fittings have exceeded or are approaching the end of their economic life and more energy efficient alternatives are now available and would make replacement a cost viable option. Monthly testing was observed to be carried out. Although several fittings observed during our survey were in poor condition with no charging lights.		+ Consider replacement of all existing emergency light fittings with LED equivalent fittings – this will provide a capital payback within 5 years and reduce maintenance lamp changes. + Ensure monthly inspection failures are rectified immediately.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
6.0	External Lighting		The external lighting installation appears to be circa 25 years old and consists of mostly fluorescent type bulkhead fittings. The majority of the external fittings have exceeded or are approaching the end of their economic life and more energy efficient alternatives are now available and would make replacement a cost viable option.		+ Consider replacement of all existing external light fittings with LED equivalent fittings – this will provide a capital payback within 5 years and reduce maintenance lamp changes.
7.0	Fire Detection and Alarm		A Honeywell Morley ZX5se analogue addressable fire alarm system is installed within the main reception area with the use of XP95 detectors and interfaces site wide. The system is operational and is not indicating any faults. The plant MCPs incorporate FA interfaces for plant shutdown in the event of fire alarm activation and additional indication to the main fire alarm system in the pavilion building. Redundant fire alarm system wiring is coiled up to the rear corridor of the pavilion building. This should be investigated and removed. Additionally, there is redundant fire alarm equipment to the reception area which requires removal. The system appears to have been wired for a future PAVA systems which has not been installed. 1st floor D/B F1 – a fire alarm cable is coiled up adjacent the DB. This requires investigation and connection or removal if not required. The current system is still supported and can be expected to operate for several years until obsolete. Although the unconnected and redundant equipment and wiring should be removed.	   	+ Carry out annual fire alarm inspection and test to ensure compliance with BS5839-pt.1 + Remove redundant wiring and equipment + Investigate and complete remedial works to unconnected cables in ground floor corridor and 1st floor level. + Carry out cause and effect testing to ensure all safety circuits are operational.
8.0	Lightning Protection		The latest lightning protection certificate for the pavilion was noted as being undertaken on 11/2016 and passed. No certificate was observed for the current year in the sub-contractor maintenance folder. The pavilion system relies on an air termination system with vertical rods to the top of the roof pitch. The system is a mixture of aluminum and copper conductors. The system is over 25 years old and requires remedial works.		+ Carry out remedial works to the lightning protection system as required by the maintenance company. + Carry out lightning protection inspection to ensure compliance. + Carry out risk assessment inline with BS7671;2018 to determine whether SPD are required.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
			AHU and services on the roofs do not appear to be connected to the lightning protection system, therefore additional works will be required to ensure compliance. A risk assessment should be undertaken to review whether surge protection is required to the electrical installation.		
9.0	Building Management System		A Trend 963 v3.72 Supervisor Building management system provides overview and limited control to the AHU's, Boiler Plant, CT & VT LTHW circuits and HWS. Boiler and how LTHW.DHWS MCP panel is located to the basement main plant room has been upgraded to include IQ view touch screen and IQ4 controller. MCP 2 (kitchen AHU and extract fan) also requires updating. The connection between buildings is completed by microwave radio transmitters and receivers. This system appears to have been installed within the last 5 years. The BMS system has been partially upgraded in other buildings to accommodate the latest IQ4 controllers and IQ view front panels.		- Consider refurbishment of the whole BMS system within the pavilion to IQ4 and IQ view displays on all MCP's. - Consider upgrading the head end Trend 963 software and PC to Trend IQ Vision. - Carry out control panel refurbishment to MCP 2.
10.0	Freight Lift (Dumb Waiter)		A traction freight lift (Dumb Waiter) is installed between the basement and 1st floor levels. The system is unserviceable and redundant due to issues within the pavilion roof lift motor which suffered fire damage. The electrical supply, control panels and motor have been partially stripped and the installation requires removal or replacement with new system.		- Remove or replace the dumb waiter lift installation with new installation.

5.0 Mechanical Services (The Marquee)


No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Trane Packaged AHU		The Marquee's primary supply and extract air is provided by a Trane EYKH155 packaged unit installed in 2006. (Cooling capacity of 42.3kW, Heating capacity of 71.5kW) The unit incorporates a gas burner to provide heating and R407C DX unit to provide cooling – the unit is controlled from a wall mounted controller located within the marquee. The equipment is 13 years old and nearing the end of its economic life expectancy. The unit will require replacement within the		- The Trane unit will require replacement within the next 5 years. - The method of access and working platform is a health and safety concern. A new staircase and working platform should be provided. - The internal supply and extract louvres require cleaning.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
			next 5 years, although will require ongoing maintenance including cleaning of louvre grills, removal of surface corrosion from the gas main pipework and foliage. The previous gas safety certificate was dated 09/11/2018 and no defects were noted. The access ladder to the Trane unit equipment and the maintenance platform is dangerous and requires re-design.	 	+ Clean surface corrosion from gas main and repaint + The foliage requires removal around the flexible ductwork + A gas safety test should be carried out in Nov 2019.

6.0 Electrical Services (The Marquee)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Electrical Installation		The marquee electrical installation is supplied from the Pavilion building via cables on overhead steel tray and catenary wires. A MEM 4-way TP&N distribution serves the external Trane AHU, DJ Booth, bar and external lighting/small power. The installation is approx. 10-15 years old and has undergone an EICR report within the last 5 years. The lighting and small power circuits are protected by 30mA RCBO for additional protection and the installation is in good condition. The installation will require ongoing maintenance and replacement of any defective fittings.	 	+ Continue ongoing maintenance of the electrical installation and emergency lighting. + Ensure RCBO's are functionally tested every 3 months.

7.0 Appendix 1 (F Gas Register)

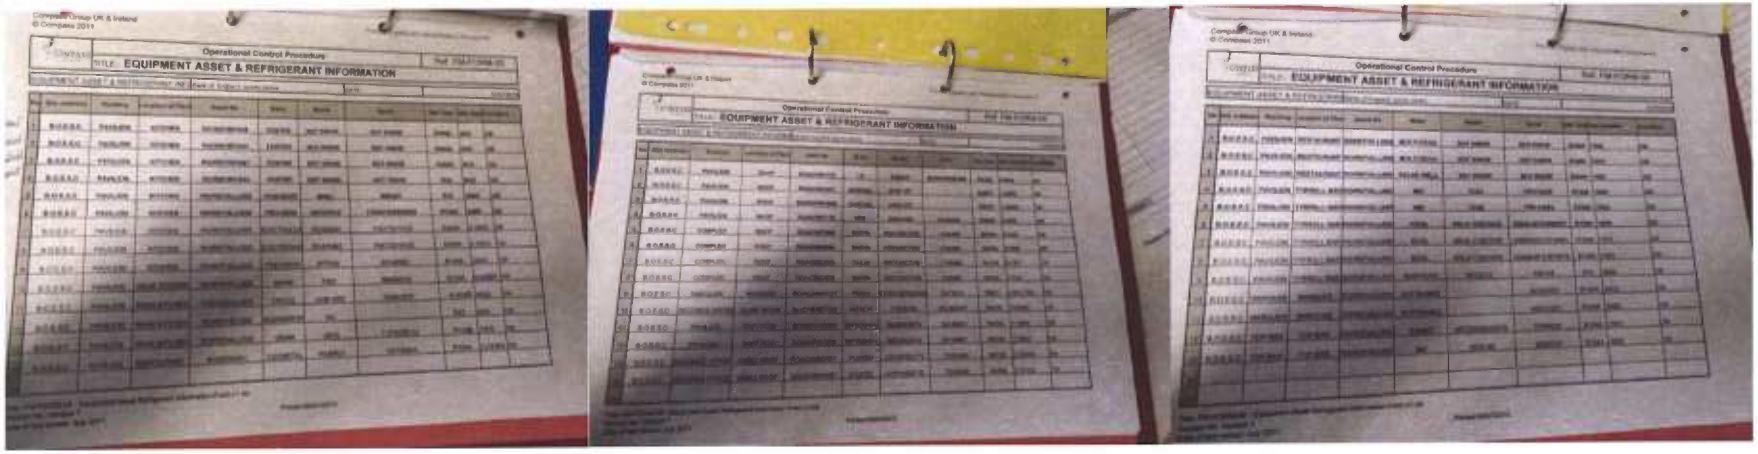



tbanda.com



Bringing buildings to life

Squash Courts
Bank of England Sports Centre, London
Engineering Services Review

August 2019



PROJECT
Lighthouse Surveyors-Bank of England Sports Centre

PROJECT REF
19820

REPORT
Engineering Services Review-Squash Courts

DOCUMENT NUMBER (if applicable)
19820-MEP-RPT-001

STATUS:
Draft for Comment

DATE:
16th August 2019

This report has been authorised by:

.....

James Campbell
Partner

Revision	DCC No.	Comments	Date	Author	Checked
001	-	Draft for Comments	16/08/2019	IA	JC

This report is confidential and personal to the client for whom it was prepared and shall not be disclosed to any third party without TB+A's prior written consent. TB+A shall have no duty, responsibility and no liability to any party in connection with this report howsoever arising (whether in contract, in tort, in negligence or otherwise) other than that arising to the client under TB+A's appointment. Nothing in this report shall constitute or give rise to 1) a warranty, confirmation or statement that that any works, property or any other matter to which this report relates is fit for purpose or suitable for use or 2) a guarantee in respect of the performance of any works, property or any other matters to which the report relates."

This report is hereby signed off as the brief by: -

Company	Troup Bywaters + Anders
Name	Ian Andrews
Role	Senior Technical FM Consultant
Date	16th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	James Campbell
Role	Partner
Date	16th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	
Role	
Date	
Signature	

Contents

1.0 Introduction 1

1.1 The Property (Squash Courts) 1

1.2 Limitations 2

1.3 Services Overview 2

1.4 The Survey 3

2.0 Executive Summary 4

3.0 Mechanical Services (Squash Courts) 5

4.0 Electrical Services (Squash Courts) 6

1.0 Introduction

Troup Bywaters + Anders (TB+A) have been appointed by Lighthouse Surveyors and commissioned to undertake a review of the engineering services installations at the Bank of England Sports Centre, London SW15 5JQ.

The Bank of England Sports Centre covers approx. 32 acres and includes Commercial office space, administration and members facilities including commercial kitchens and restaurant, bars and sports facilities including residential cottages and grounds staff outbuildings.

This report has been prepared to provide a general appraisal of the engineering services installed within the sports centre complex in consideration of a potential purchase of the leasehold to the property. This report is solely for the property named as the Squash Courts. Separate TB&A reports are provided for The Grange, Pavilion, Marquee, Bank Lane Cottages, Clarence Farm and Sports Hall & Swimming Pool,

1.1 The Property (Squash Courts)

Located in Priory Lane, Roehampton, South West London is the Bank of England Sports Centre where a detached sports building is located in the grounds. The building houses 3No. Full size wooden sprung floor squash courts with general circulation areas and viewing area to 1st floor. The building does not have any toilet, changing or shower facilities – these are all served from the pavilion building.



The Squash Court building is 2 storey brick-built building with corrugated sheet metal roof dating between 1980's-90. The building houses 3No.squash courts with entrance to each court from the circulation area on the ground floor. The 1st floor provides viewing gallery into each of the squash courts.

The building is served by mains electricity and gas supplies only – housed within service cupboard located to north end of the ground floor.

1.2 Limitations

No inspection was undertaken to those parts of the building services which are built in, covered up or otherwise inaccessible. The survey consisted of a non-invasive visual survey – no building services equipment covers were removed or ceiling tiles/plant sealed risers disturbed.

No definitive tests or calculations have been undertaken to determine the capacity of the plant nor have performance tests been carried out on the plant and system.

No functional testing of systems or installations was performed, or any flues checked.

No access to roof due to vertical ladder locked off.

1.3 Services Overview

The property is provided with a 1.5" Gas main supplied from the sports complex external gas mains. This service enters from ground level within the ground floor service cupboard with local isolation valve and rises to 1st floor level to serve 3No. Robert Gordon BH15 Radiant Heaters with reflectors. The gas radiant heaters, burners and solenoid valves are sited within the suspended ceiling open grill above each court. Each court has a local BMS Trend thermostat which controls and monitors the temperatures in each court. All Radiant heaters were last tested in Nov 2018 and no defects were noted on the certificates.

The radiant heater grills were found to be damaged from squash balls and the panels require remedial works to ensure these are safely affixed.

The electrical supply derives from the Bank of England Main HV/LV switch panel located approx. 20metres from the squash courts and supplies a 100A 24 Way SP&N Schneider MCB Distribution board with local 'Bill' isolator. The distribution board serves general internal and external lighting via digital timeclock, Intruder alarm, BMS radio link, cleaners' small power socket outlets and control circuits for the radiant heaters.

The final circuit wiring is via twin and Earth and Steel Wire armoured cable installed within the building fabric and surface mounted. The electrical installation was subject to an electrical inspection and test in May 2015 and is due for a retest next year, 2020. The observations indicated unknown circuits, hole to side of DB and lack of distribution schedule of final circuits.

Internal lighting is generally fluorescent bulkhead fittings and linear fluorescent fittings installed within the squash courts and fitted with replacement LED lamps and protective cages. External lighting is generally a mixture of LED and metal halide floodlights mounted to external elevations.

1.4 The Survey

A visual, non-intrusive survey was conducted by TB+A on 8th August 2019. The physical condition of the systems is noted within the document, assessed from a combination of on-site visual inspection of each area, review of record documentation and discussions with the maintenance provider - Leisure Support Services Maintenance Manager – Glen Miller.

Systems and installations have been assigned a condition rating in accordance with the following definitions:

Serious or Critical issue; requires action due to risk of failure. Has reached the end of its economic life.

Important issue; may require action or resolution. Poor condition with evidence of defects.

Information only; no action required. Routine maintenance. Satisfactory condition.

Budget cost estimates for recommendations have been provided as an indication to likely investment required. Costs are exclusive of VAT and any professional fees unless otherwise stated.

2.0 Executive Summary

TB+A completed a visual, non-intrusive inspection of the engineering services to the Bank of England Sports complex Squash Courts.

The building services within squash courts were generally found to be in a satisfactory visual condition however, the radiant heaters are approx. 10-15 years of age.

The squash court wooden floor was damaged – this was discussed with the maintenance manager whom confirmed that due to lack to suitable roof insulation and large unheated space – the radiant heaters cause considerable condensation and 'raining' onto the court floors when operating in cold weather. This system and method of heating requires further investigation and possible increase of insulation or alternative methods of background heating.

Key issues have been summarised in the table below.

Mechanical Services	
Gas Heating System	The squash courts only have 3No. Gas fired radiant heaters to provide heating within the building. There are ongoing issues with condensation 'raining' where the vacant buildings internal temperature drops below the dew point temperature and the operation of the radiant heaters then causes extreme condensation – this has damaged the courts floor in some areas.
Rainwater and Above Ground Drainage System	The external RWP system is in good condition and continued maintenance should be provided.
Electrical Services	
Electrical Installation	The electrical installation requires electrical inspection and test in 2020 and small power and external circuit should be provided with 30mA RCBO's for additional protection.

Site logbooks and maintenance tasks appear to be undertaken on a caretaker basis with reactive maintenance being undertaken. The contractor's site logbooks and water risk assessment folders were found to be out of date as were the F-Gas Folder.

Estimate budget costs for recommendations have been provided to identify likely investment required. Costs are exclusive of VAT and professional fees. Investment required within the next 5 years is estimated at £22,000 excluding any asbestos surveys and removal costs, builder's works and any preliminaries.

3.0 Mechanical Services (Squash Courts)


No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Gas Radiant Heating System		3No. Roberts Gordon BH15 Gas Radiant heaters are located within the suspended ceiling at high level within each of the squash courts. The units are approx. 10-15 years of age and are approaching the end of their recommended service life (20 years). Combustion appliance test certificate have been completed in Nov 2018 with no defects noted. No functional operational checks were made to the units. The units are controlled and monitored via the Trend BMS system. The radiant panels are the only heating source for the squash courts building and where the building is left for periods of occupation with no heating – condensation is an issue when the radiant heaters are started which has caused damage to the floor.		• Allow to refurbish or replace heaters within the next 5 years. (£15,000) • Review thermal building loss and provide additional background heating source to prevent condensation issues with radiant heaters. (£5,000 • Repair damaged suspended ceiling louvres where damaged. Fabric costs
2.0	Rainwater and Above Ground Drainage System		Above ground drainage is provided in coated steel guttering and pipework. It was found to be in good condition. Internal inspection of the pipework was not undertaken. The pipework is expected to be suitable for retention. The building has other aged above ground drainage pipework which is approx. 40 years of age		• Undertake general cleaning and maintenance of the above ground drainage distribution pipework.

4.0 Electrical Services (Squash Courts)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Electrical Installation		The 24way Schneider SP&N MCB distribution board is approx. 5 years old and in good condition, although as been fitted with various manufacturers MCB replacements. The electrical installation was inspected and tested in May 2015 and next tested is due in 2020 and is in a reasonable visual condition. The previous ECIR certificate observations indicated unknown circuits, hole to side of DB and lack of distribution schedule of final circuits. Additionally, there are damaged light fittings within the service cupboard and to staircase. These should be repaired or replaced. All other accessories and equipment are in reasonable condition and should provide continued service for the next 5-10 years.	 	+ Carry out EICR in 2020 and complete any actions + Provide final circuit schedule and ensure only Schneider MCBs are installed - not other manufacturers MCB's + Repair/replace defective light fittings + Continue maintenance to the electrical installation + Provide 30mA RCBO for small power and external final circuits. (Approx. £2000 for above works)



tbanda.com

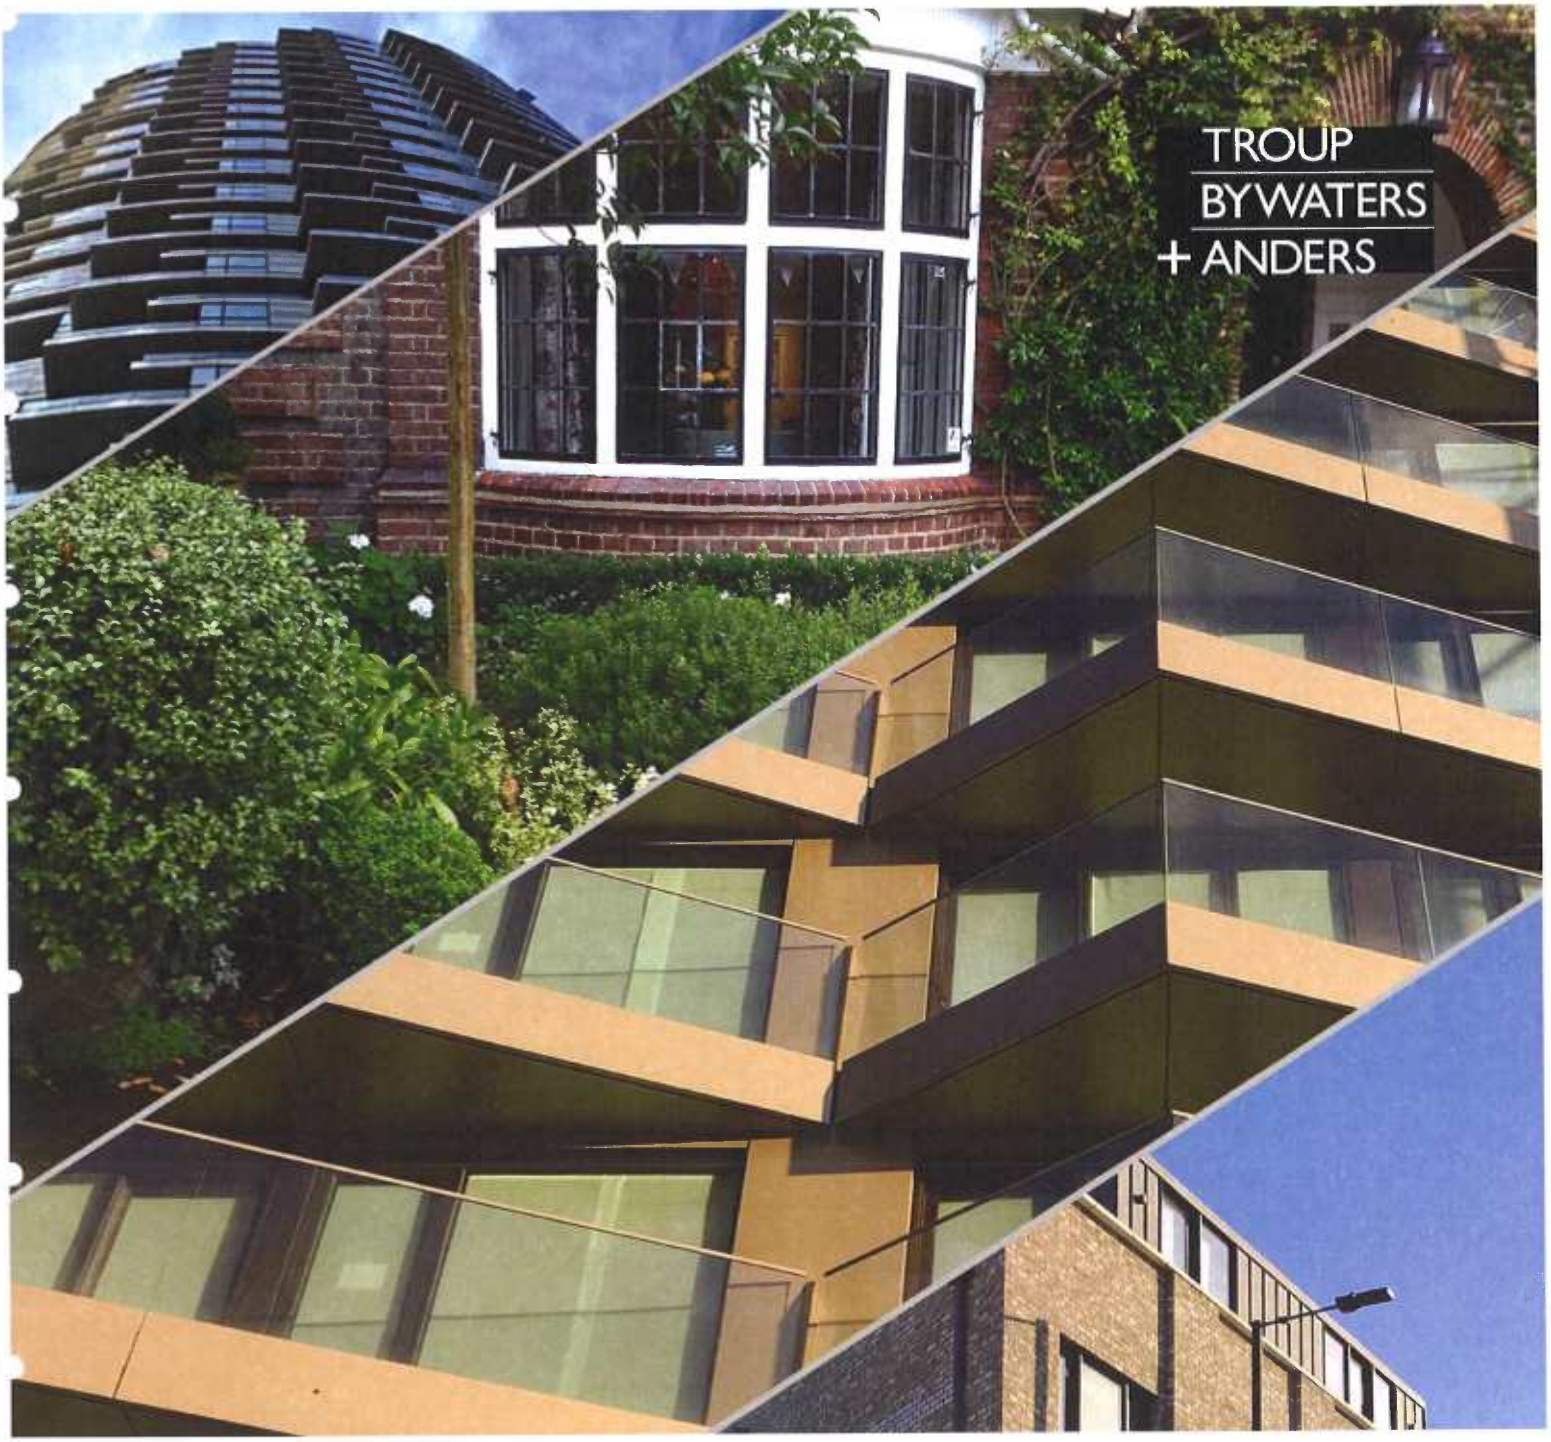

Bringing buildings to life

1&2 Bank Lane Cottages and Clarence Farm
Bank of England Sports Centre, London
Engineering Services Review

19820-MEP-RPT-001

August 2019



PROJECT
Lighthouse Surveyors-Bank of England Sports Centre

PROJECT REF
19820

REPORT
Engineering Services Review-Cottages 1&2 Bank Lane and Clarence Farm

DOCUMENT NUMBER (if applicable)
19820-MEP-RPT-001

STATUS:
Draft for Comment

DATE:
16th August 2019

This report has been authorised by:



.....

James Campbell

Partner

Revision	DCC No.	Comments	Date	Author	Checked
001	-	Draft for Comment	16/08/2019	IA	JC

This report is confidential and personal to the client for whom it was prepared and shall not be disclosed to any third party without TB+A's prior written consent. TB+A shall have no duty, responsibility and no liability to any party in connection with this report howsoever arising (whether in contract, in tort, in negligence or otherwise) other than that arising to the client under TB+A's appointment. Nothing in this report shall constitute or give rise to 1) a warranty, confirmation or statement that that any works, property or any other matter to which this report relates is fit for purpose or suitable for use or 2) a guarantee in respect of the performance of any works, property or any other matters to which the report relates."

This report is hereby signed off as the brief by: -

Company	Troup Bywaters & Anders
Name	Ian Andrews
Role	Senior Technical FM Consultant
Date	16th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	James Campbell
Role	Partner
Date	16th August 2019
Signature	
Company	Troup Bywaters and Anders
Name	
Role	
Date	
Signature	

Contents

1.0 Introduction 1

1.1 The Property (1 & 2 Bank Lane Cottages and Clarence Farm) 1
1.2 Limitations 2
1.3 Services Overview 3
1.4 The Survey 4

2.0 Executive Summary 4

3.0 Mechanical Services (Nos 1 & 2 Bank Lane) 6

4.0 Electrical Services (Nos 1 & 2 Bank Lane) 8

5.0 Mechanical Services (Clarence Farm) 9

6.0 Electrical Services (Clarence Farm) 10

1.0 Introduction


Troup Bywaters + Anders (TB+A) have been appointed by Lighthouse Surveyors and commissioned to undertake a review of the engineering services installations at the Bank of England Sports Centre, London SW15 5JQ.

The Bank of England Sports Centre covers approx. 32 acres and includes Commercial office space, administration and members facilities including commercial kitchens and restaurant, bars and sports facilities including residential cottages and grounds staff outbuildings.


This report has been prepared to provide a general appraisal of the engineering services installed within the sports centre complex in consideration of a potential purchase of the leasehold to the property. This report is solely for the 3No. Properties named as 1 & 2 Bank Lane Cottages and Clarence Farm. Separate TB&A reports are provided for The Grange, Pavilion, Marquee, Squash Courts and Sports Hall & Swimming Pool,

1.1 The Property (1 & 2 Bank Lane Cottages and Clarence Farm)

Located in Priory Lane, Roehampton, South West London is the Bank of England Sports Centre where three residential cottages are located in the grounds to provide accommodation for visitors and staff. These are designated as 1&2 Bank Lane cottages – which consist of a 3 bedroom and 4 bedroomed semi-detached property with party wall. The Clarence Farm property is a 1 bedroomed detached cottage with groundsmen mess rooms and equipment storage areas.

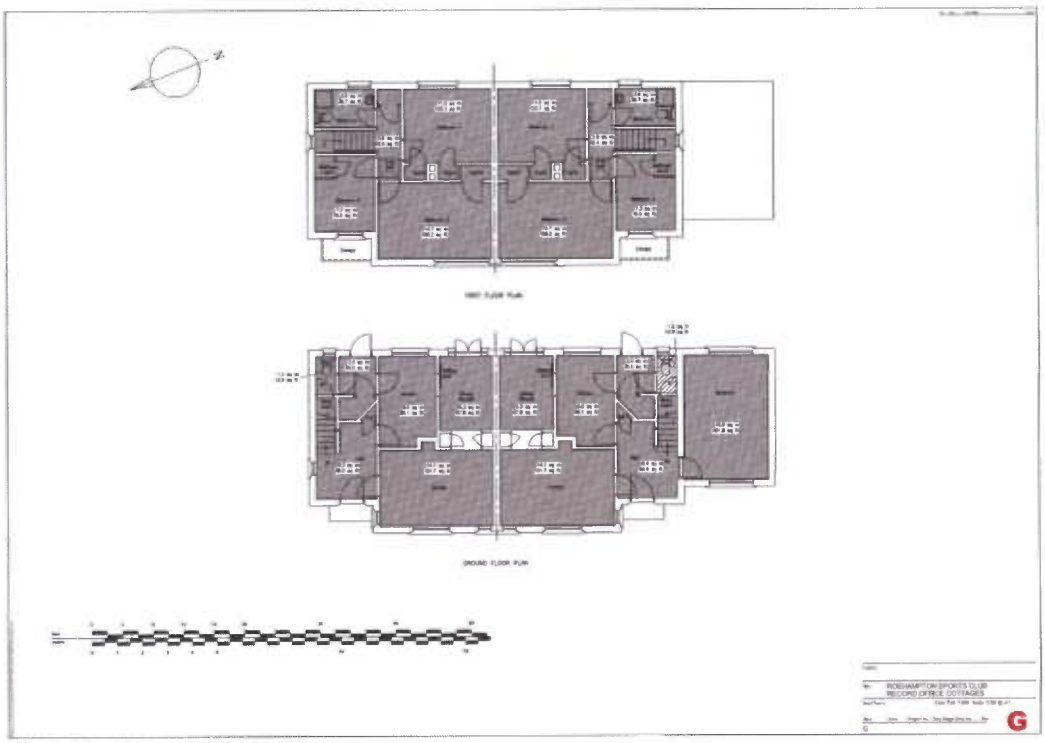

1&2 Bank Lane Cottages

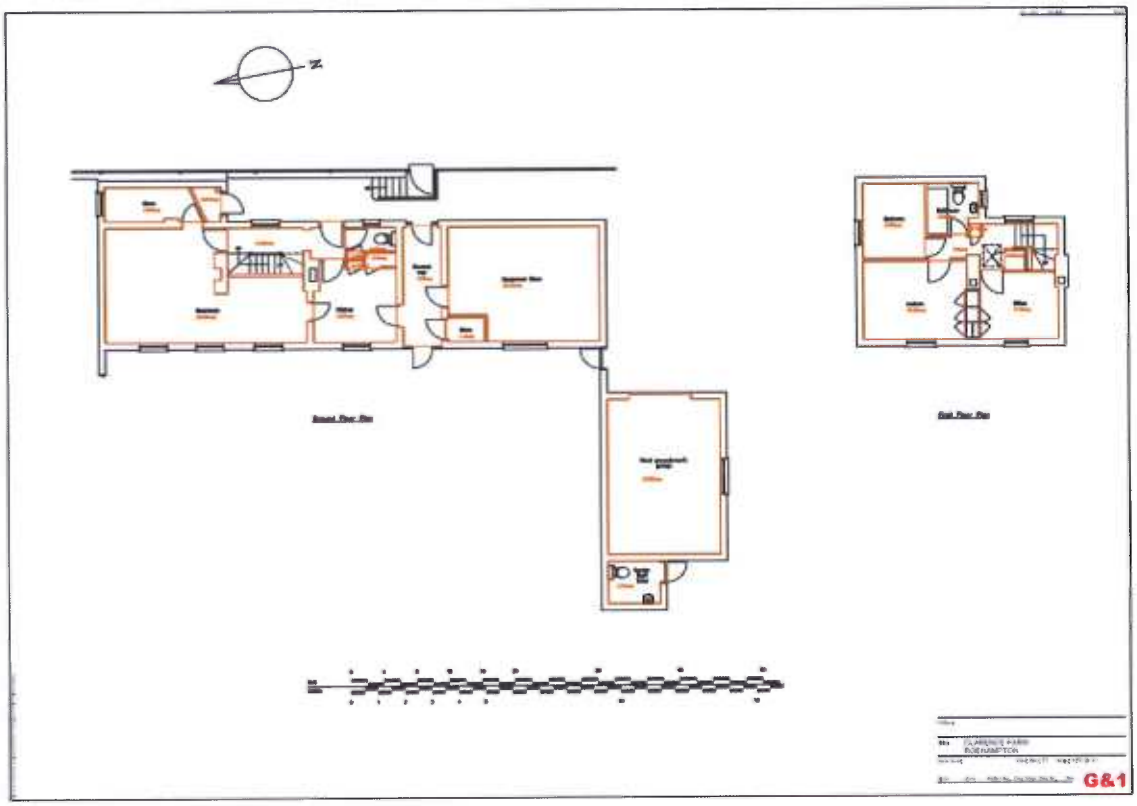

Clarence Farm

The Bank Lane properties was originally constructed circa 1930's and have been modified to provide bedsit accommodation. Each property services have been modernised over the years to include gas central heating systems with radiators, fitted kitchen with electric cooker and hob and 2No. WC's and shower room. The Clarence Farm appears to have been built early 1900's and has been empty for some time. The accommodation has toilet and shower facilities although all services have been isolated and are in an aged and poor state of repair, including the gas meter which has been removed and service isolated.

1.2 Limitations

No inspection was undertaken to those parts of the building services which are built in, covered up or otherwise inaccessible. The survey consisted of a non-invasive visual survey – no building services equipment covers were removed or ceiling tiles/plant sealed risers disturbed.

No definitive tests or calculations have been undertaken to determine the capacity of the plant nor have performance tests been carried out on the plant and system.

No functional testing of systems or installations was performed.

No access was available the loft space - which were inaccessible.

Cottages water meters could not be located.

1.3 Services Overview

No, 1 & 2 Bank Lane Cottages

The properties are provided with mains water, natural gas and an SP&N electrical supply with energy meters. These properties have recently had a replacement Worcester Bosch Greenstar Junior 24Ri gas central heating boiler – providing 24kW net heating. This provides central heating to the pressed steel radiators complete with TMV's within rooms and hot water to the shower, kitchen and WC's. A copper hot water cylinder storage tank with separate electric immersion heater is located within the upstairs cupboard although this appears to be circa 1980's as is the control wiring and circulation pump.

Heating control is provided by local radiator Thermostatic valves and BMs control and monitoring to the Trend central BMS system.

The electrical system is dated from the 1980's and benefits from the distribution board being replaced within the last 5 years to provide RCD protection to all final circuits. However, the electrical accessories and wiring appear to be circa 1980's. The light fittings are mainly pendent type fittings with florescent BC lamps.

Each property is provided with a Conventional 2 Zone fire alarm system, (Circa 1980's) with smoke detectors and bell sounders in each property. No faults were showing on the panels.

The main water connection provides cold water to kitchen washing machine and kitchen sink with riser to loft space tank and external bib tap. The storage tank provides cold fill to the hot water immersion tank, shower and WC's. The plumbing, toilets and shower appear to be in good order consummate with age circa 1990's. Although the water risk assessment identified issues with the cold-water storage tanks.

Clarence Farm

The property is provided with mains water, natural gas and an SP&N electrical supply with energy meters – apart from the gas meter which has been removed and services caped. This property has an aged Potterton profile gas boiler, (circa 1970-80) which is isolated and has missing covers. This would provide central heating to the pressed steel radiators within rooms and hot water to the shower, kitchen. The property is also served by an aged Gas Heater located to the living room which is isolated at presented and has a safety warning sign affixed.

The electrical system is dated from the 1980's and benefits from the distribution board circa 1990 with single RCD protection to cover all final circuits. However, the electrical accessories and wiring appear to be circa 1970-80's and is in poor condition. The electrical supply is currently isolated.

This property requires a full renovation and all plant replacing including full rewire, cold water storage tank and gas central heating including new toilet pans, shower and basins.

1.4 The Survey

A visual, non-intrusive survey was conducted by TB+A on 8th August 2019. The physical condition of the systems is noted within the document, assessed from a combination of on-site visual inspection of each area, review of record documentation and discussions with the maintenance provider - Leisure Support Services Maintenance Manager – Glen Miller.

Systems and installations have been assigned a condition rating in accordance with the following definitions:

Serious or Critical issue; requires action due to risk of failure. Has reached the end of its economic life.

Important issue; may require action or resolution. Poor condition with evidence of defects.

Information only; no action required. Routine maintenance. Satisfactory condition.

Budget cost estimates for recommendations have been provided as an indication to likely investment required. Costs are exclusive of VAT and any professional fees unless otherwise stated

2.0 Executive Summary

TB+A completed a visual, non-intrusive inspection of the engineering services to the cottages known as 1&2 Bank Lane and Clarence Farm.

The services within Nos 1 & 2 Bank Lane Cottages were generally found to be in a satisfactory visual condition however, Clarence Farm is derelict and require full refurbishment including all building services. Unplanned and increased failure of the services is a likely a consequence of age and obsolescence of components will increase downtime and disruption to the business.

Key issues have been summarised in the table below.

Mechanical Services	
Mains Water Service	Bank Lane The properties require extensive remedial works and replacement CWS tanks. Clarence Farm Property requires complete MEP renovation
Domestic Hot Water Service	Bank Lane The properties will require replacement works within 5 years Clarence Farm Property requires complete MEP renovation
Gas system	Bank Lane The properties require updating and gas meter relocating to external area. Clarence Farm Property requires complete MEP renovation
LTHW Heating System	Bank Lane The properties will require new central heating system within the next 5years. Although both properties have had new boilers fitted within the last couple of years and have current gas certificates.

	Clarence Farm Property requires complete MEP renovation
Plumbing Services	Bank Lane The properties WC; s and showers appear to be in good condition allow to replace when renovating in 5-10years. Clarence Farm Property requires complete MEP renovation
Rainwater and Above Ground Drainage System	Bank Lane The properties RWP appear to be in good condition allow to replace during renovation Clarence Farm Property requires complete MEP renovation
Electrical Services	
Electrical Installation	Bank Lane The properties have undergone distribution board changes with split load RCD MCB distribution boards -however, the accessories and wiring is dated from 1980's. Allow to rewire within 5 years. Clarence Farm Property requires complete MEP renovation
Fire Alarm System	Bank Lane The properties have 2 zone conventional fire alarm panels complete with smoke detectors and bell sounders – the systems panel were operational, and no faults were indicated. Would advise replacement of fire alarm systems within the next 5 years. Clarence Farm Property requires a fire risk assessment to assess whether it requires a fire alarm system.

Site logbooks and maintenance tasks appear to be undertaken on a caretaker basis with reactive maintenance being undertaken. The contractor's site logbooks and water risk assessment folders were found to be out of date as were the F-Gas Folder.

Estimate budget costs for recommendations have been provided to identify likely investment required. Costs are exclusive of VAT and professional fees. Investment required within the next 5-10 years is estimated at £36,000 (Bank Lane Cottages) and £18,500 (Clarence Farm) excluding any asbestos survey and removal, builder's works and preliminaries.

3.0 Mechanical Services (Nos 1 & 2 Bank Lane)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Mains Water Service		Each property has separate mains water supply and mains water service enters the properties to the rear and a provides cold water supply (CWS) to the roof storage tanks in each roof space and kitchen sink and outside bib tap - these supply all down service cold water. The CWS installation is approx. 30-40 years old and the installation will require replacement within the next 5 years.		+ Install new rising main and cold-water storage tank in accordance with current water regulations. (Replacement costs approx. £2000 each property)
2.0	Domestic Hot Water Service		Each property has separate insulated copper immersion tanks with separate electric immersion heater elements, (No access was made to Cottage no. 2) with three port valves and circulating pumps. The installation is approx. 30-40 years of age and will require replacement within the next 5 years.	 	+ Replace system with new – see heating costs section 4.0
3.0	Gas Service		Each property is provided with a gas meter located to the ground floor intake cupboard. The gas service in each property appears to be in condition consummate with age and has a current gas safety certificate. The installation is approx. 30-40 years of age and will require replacement within the next 5 years. The gas and electrical meters will require relocation externally to the property.		+ Install new gas service with external metering. (approx. £2000.00 each property)
4.0	Heating System		Each property has separate gas central heating systems remotely controlled and monitored via the Trend BMS system. The central heating system is served via separate Worcester Bosch Greenstar Junior 24Ri gas central heating boilers which appear to be installed within the last 5 years, although Cottage No. 2 cover has been removed. The system appears to be in a condition consummate with age (approx. 30-40 years old) although the controls wiring is aged and radiators appear to have signs of corrosion and valve caps missing and damaged.		+ Remove existing central heating system complete with radiators and pipework and immersion tank and supply and install new central heating system with new controls and TRV valves to all radiators. (Replacement costs approx. £2000-£3000 to each property – excludes boiler) + Service each boiler and replace missing control cover.

No	Service	Condition	Description	Photo (if applicable)	Recommendations
5.0	Plumbing services		The plumbing services in each property appears to have been updated over the years and are in good condition. The WC's, sinks and showers will require replacement within the next 5-10 years.		+ Allow budget to replace 2No. WC sets, sinks complete with taps and drainage and shower cubicle and associated plumbing mixture taps and waste. ((Replacement costs approx. £2000-£2500 per property) + The kitchen will require replacement – although is outside of our scope. (Allow £2000-3000 per property for simple kitchen without appliances)
6.0	Rainwater and Above Ground Drainage System		The rainwater guttering and downpipes appear to be in good condition with no signs of leaks to wall surfaces. The internal drainage is a mixture of copper and UPVC waste fittings. The system will require maintenance to keep gutters clean and would advise replacement when cottages renovations are undertaken.		+ Allow budget to replace all guttering during renovation. (Allow approx. £2000 per property)

4.0 Electrical Services (Nos 1 & 2 Bank Lane)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Electrical Installation		Each property has a separate SP&N service head, metering and 8-way split load RCD MK distribution board – both properties have been inspected and tested in sept 2017 with retest due in 2022. However, the electrical installation accessories, wiring are dated from the 1980's and therefore the electrical installation is approx. 40 years old and will require replacing within the next 5 years.	 	• Allow budget to rewire electrical installation and all accessories to comply with 18th Edition of the IET Wiring Regulations. ((Allow £3500-4000 per property ex. Builders works). • Costs excludes any REC replacement mains service cable, service head and external metering. • Cottage No. 2 has missing DB cover – replace
8.0	Fire Detection and Alarm		Each property is provided with a 2 Zone conventional fire alarm panel complete with smoke detectors and bell sounders. These systems appear to be dated circa 1980's and are tested weekly by the maintenance teams. We would advise these systems are updated when the property is renovated.		• The fire alarm system will require replacement within the next 5 years. (Allow budget of £2000 per property)


5.0 Mechanical Services (Clarence Farm)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Mains Water Service		The mains water service enters the property to the rear and a provides cold water supply (CWS) to the roof storage tank which supplies all down service cold water. The CWS installation is approx. 40 years old and requires complete replacement.		+ Install new rising main and cold-water storage tank in accordance with current water regulations. (Replacement costs approx. £2000)
2.0	Domestic Hot Water Service		The domestic hot water is provided by the electric immersion heater fitted to the immersion tank. The installation is approx. 40-50 years of age and requires complete replacement.	 	+ Replace system with new – see heating costs section 4.0
3.0	Gas Service		The gas service has been isolated and meter has been removed. The gas installation supplies the gas boiler located to the kitchen and gas heater to the living room area and approx. 40 years of age. Several sections of the gas pipework has corrosion and requires replacement.	 	+ Install new gas service with metering. (£2000.00)
4.0	Heating System		The boiler and gas wall heater require replacement including new flues.	 	+ Remove old boiler, water heater and central heating system complete with radiators and pipework and immersion tank and supply and install new central heating system with new controls and TRV valves to all radiators. (Replacement costs approx. £4000-£5000)


No	Service	Condition	Description	Photo (if applicable)	Recommendations
5.0	Plumbing services		The plumbing services appear to be approx. 40 years old and in poor condition. These require replacement. A shower with mixture valve taps is located in the upstairs bath area. This appears to be circa 20 old – although would advise replacement.		+ Install 2No. WC sets, sinks complete with taps and drainage and shower cubicle and associated plumbing mixture taps and waste. ((Replacement costs approx. £2000-£3000) + The kitchen will require replacement – although is outside of our scope. (Allow £2500-3000 for simple kitchen without appliances)
6.0	Rainwater and Above Ground Drainage System		The external rainwater guttering, and downpipes are cast iron and are over 50 years of age. The internal drainage system is a mixture of copper, lead and plastic waste pipework. The rear of the property has verdigris and overgrowth in the guttering. Renovate or replace. Carry out CCTV checks to underground drainag		+ Remove and replace all guttering to UPVC. Allow approx. £2000)

6.0 Electrical Services (Clarence Farm)

No	Service	Condition	Description	Photo (if applicable)	Recommendations
1.0	Electrical Installation		The electrical installation is served via a rewireable SP&N cutout, local single-phase meter and 8 way Wylex MCB distribution board with 30MA protection – The incoming SP&N cutout is approximately 50 years old with the electrical dating from between 20-50 years of age. The building requires a complete rewire and a new supply service head will be required.		+ Remove the electrical installation and all accessories and rewire to comply with 18th Edition of the IET Wiring Regulations. ((Allow £3500-4500 ex. Builders works). + Costs excludes any REC replacement mains service cable, service head and metering.

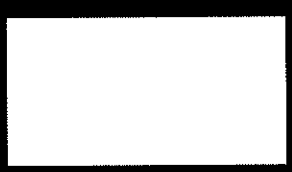

tbanda.com

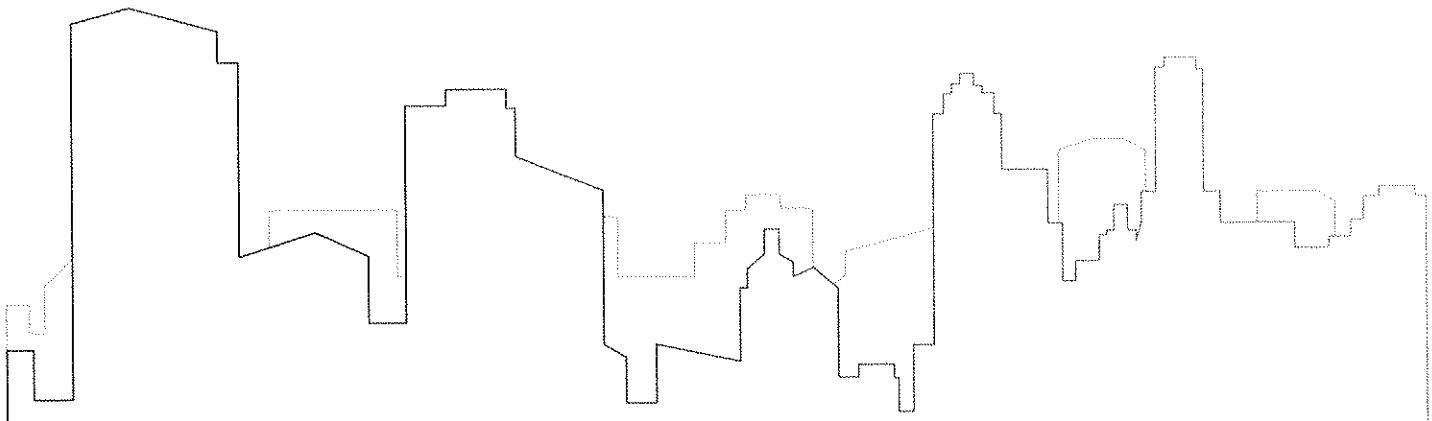

LIGHTHOUSE

The Old Church, Quicks Road, London SW19 1EX
T | 020 8545 2650
lighthousesurveyors.com

ANNEXURE 3

SCHEDULE OF CONDITION

APPENDIX 2
Equipment Schedule

Part 1
Grounds Equipment

Category of Item	Name of Item	Number of Items/ Sets of Items	Description of Items	Notes on Condition of Item(s)	Location to be found at Sports Club
Groundskeeping Equipment	SISIS LITAMINA	1	SYNTETIC TURF PITCH EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SISIS LIEXICOMB	1	SYNTETIC TURF PITCH EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SISIS OSCA3	1	SYNTETIC TURF PITCH EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	VERTI CLEAN	1	SYNTETIC TURF PITCH EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	JOHN DEERE FAIRWAY MOWER 3225C	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	JACOBSEN TR3	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	JACOBSEN T PLEX 185-D ZX000534	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	JACOBSEN G PLEX AND GREENS GROOMERS	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	KUBOTA L5040	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	KUBOTA L4240	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	KUBOTA B2410	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	ISEKI TM3265	1	TRACTOR		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	KAWASAKI KLF250	1	VEHICLE		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CUSHMAN UTILITY 1600XD	1	VEHICLE		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS - 36"	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS - 36"	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS - 36"	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS 34" G860	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS 34" G860 + SLITTER/GROOMER/SWEEPER UNITS + SEAT	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	RYAN TURFCUTTER	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS FT510 HONDA GX160 7768998	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SISIS ROTO-RAKE	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SISIS AUTO SEEDER	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS FT610 KUBOTA ENGINE 3A4377	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS FT610 KUBOTA ENGINE 3A4377	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DENNIS SUPER-CERTES 24" KUBOTA RB00328/RB00356	2	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TORO HYDROJECT	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	FERRIS, DDSKSKAV23CA	1	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BLEC UNI-SEEDER	2	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TURFCO TOP DRESSER	2	SEEDERS, MOWERS & SPIKERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	IVECO LONG WHEEL BASE TRANSIT	1	VEHICLE		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TECHNEAT120 ltr (ALLOY TANK)	1	SPRAYERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TECHNEAT120 ltr (ALLOY TANK)	2	SPRAYERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CLARKE AIR COMPRESSOR AND ATTACHMENTS	1	SPRAYERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	HONDA GENERATOR MC2500FF	1	SPRAYERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	STIHL JET WASH RA 129	1	SPRAYERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SPREADER - SCOTTS	2	PEDESTRIAN PROPELLED EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	WHEEL BARROWS	4	PEDESTRIAN PROPELLED EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	MOBILE TOWER	1	PEDESTRIAN PROPELLED EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	LINE MARKING MACHINE - RIGBY TAYLOR (BATTERY OPP)	1	PEDESTRIAN PROPELLED EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	LINE MARKERS (DIMPLE TYPE0	2	PEDESTRIAN PROPELLED EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	COOLIE 2 TON PALLET TRUCK	1	PEDESTRIAN PROPELLED EQUIPMENT		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CHAIN SAW - STIHL 021	1	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	STRIMMER - STIHL F.S. 40C	1	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BLOWER - STIHL B.G. 72	1	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	EDGE CUTTER - REDMAX RE200	1	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	KNAPSAC SPRAYER MK2	1	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TRUEMETER MEASURING WHEEL	2	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	STHIL HS80 HEDGE TRIMER	1	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	HONDA ROTAVATOR	1	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	HAYTER HARRIER 56	1	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	ROBIN FL251 BLOWER	3	LIGHT POWER MACHINES		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	HYDROLIC TIPPING TRAILER	2	GANGS AND TRAILERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	GREEN TECH EASY-LOAD TRAILER	1	GANGS AND TRAILERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SET OF 3-4' GANG ROLLERS	1	GANGS AND TRAILERS		Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	HAND ROLLERS	1	GANGS AND TRAILERS		Maintenance storage areas (groundskeepers)

Groundskeeping Equipment	SISIS TRAILER FLAT BED	1	GANGS AND TRAILERS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	AMAZONE SOIL SPREADER	1	GANGS AND TRAILERS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SCH TOWED CAGED TRAILER	1	GANGS AND TRAILERS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TRAILER FOR KOROING	1	GANGS AND TRAILERS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	ELLIET PROFS CHIPPER	1	GANGS AND TRAILERS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TRACTOR MOUNTED LUTE	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BLEC STONE BERRIER	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	VICON DISTIBUTER	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CHARTERHOUSE VERTI DRAIN	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CHARTER HOUSE VERTI CORE 1300	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BLEC MULTISEEDER	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	VARIOUS 3 POINT LINKAGE ATTACHEMENT	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	VARIOUS WEIGHTS & FRAMES	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	VARIOUS PTO DRIVE SHAFT	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	GRADEN SCARIFIER	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	KORO OUTFIELD MAKER 1500	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	GREENTEK MULTI BRUSH	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	WIDERMANN WHISPER TWISTER	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	PERUZZO RYTEC	1	TRACTOR MOUNTED EQUIPMENT	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	FORK LIFT - DAEWOOD D25/2	1	TRACTORS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	JCB ROBOT	1	TRACTORS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	AUTO ROLLLER (POWER STEERING) (4ft)	2	TRACTORS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BILLY GOAT SWEEPER	1	TRACTORS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	JCB MINI DIGGER 8081 CTS	1	TRACTORS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SHOVELS - FORKS - SPADES - BROOMS	1	GROUND HAND TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	WOODEN RAKES - MATEL RAKE - SLEDGE	1	GROUND HAND TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	HAMMERS - EDGING IRONS - TUFING IRONS	1	GROUND HAND TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TRUE LUTES - EDGING SHEARS - LUPPERS	1	GROUND HAND TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TRICO , FLEX HOSE PIPES	1	GROUND HAND TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BOUNDARY NETTING	1	GROUND HAND TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	VARIOUS METAL STAKES	1	GROUND HAND TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BENCH VICE - RECORD No 4 (4 1/2 " JAWS)	1	WORKSHOP TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BENCH VICE - "No 25 (6" JAWS)	2	WORKSHOP TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CLARKE STRONG ARM PRESS	1	WORKSHOP TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	ANVIL 3/4 CWT - WITH BASE	1	WORKSHOP TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TRP + DIE SET	1	WORKSHOP TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	JUMP START LEADS (HEAVY DUTY)	1	WORKSHOP TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	EXTENSIVE COLLECTION OF HAND TOOLS	MULTIPLE	WORKSHOP TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SEALEY POWER START 400	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BATTERY CHARGER - SELMA	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	12V POWER PACK	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	RED RAD HEATERS	3	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	ARC MACHINE - SEALEY 190	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TRANSFORMER - CLARKE (SINGLE OUTLET)	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SEALEY (DOUBLE OUTLET)	2	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	ELEC DRILL ELU 110 VOLTS	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	ANGLE GRINDER - BOSH 7" 240V	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BENCH GRINDER - SEALEY 8" 240V	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	BENCH DRILL - SEALEY 240v (GDM 1208)	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CIRCULAR POWER SAW SEALEY 110v	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TURBO OLYMPIC ARC WELDER	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CHARTERHOUSE BACK LAPPING MACHINE	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	TROLLEY JACK SEALEY (2 TON)	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	SEALEY 4" ANGLE GRINDER 240v	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	CLARKE XR 155 DIESEL HEATER	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)
Groundskeeping Equipment	DEWARTZ 871L CHOP SAW	1	WORKSHOP POWER TOOLS	Maintenance storage areas (groundskeepers)

Part 2
Gym Equipment

- Jordan Safety Bar
- Hammer strength Squat rack
- Punch bag and wall mount
- Reverse Hyper
- T-bar row
- Wattbike