
## How to replace the screws for anti-scatch the belt

The belts may touch screws for the first batch Z9V5Pro, which may cause scratch on the belt surface. Replacing some screws and gaskets can solve this problem.

## 1. Add M5 nuts on the bottom of two Iders



## 2. Replace the screws and add shim on the bottom of two Y carriers

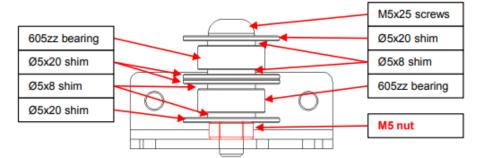