
1. Safety

1.1 Hazard alerts in the instruction manual Hazard alerts are shown as indicated below. Follow these hazard alerts for the safe of the operation.

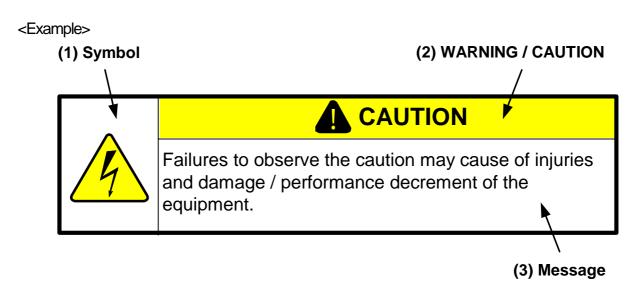

(1) Symbols: Observe hazard alerts shown below and operate safely.

Symbols	Meaning of the symbol
	HAZARDOUS VOLTAGE LINE VOLTAGE ALWAYS PRESENT
	CUTTER PRESENT
	HOT SURFACE
	MECHANICAL HAZARD
	PINCH POINT
<u></u>	More than one hazard as identified above

1.1 Hazard alerts in the instruction manual (Continued)

(2) Warning / Caution: The warning and caution show the level of the hazard.


Symbol	Meaning of the symbol
WARNING	Failure to observe the warning could cause of serious injuries to human body and damage/performance decrement of the equipment.
CAUTION	Failures to observe the caution may cause of injuries to human body and damage/performance decrement of the equipment.

- (3) Message: The message shows the followings
 - The potential hazard
 - The possible hazards when you disregard the warnings and cautions
 - Precautions

1.2 Warning labels

The warning labels are applied near the potential danger on the equipment. Observe the warning labels to operate the equipment safely.

<Example>

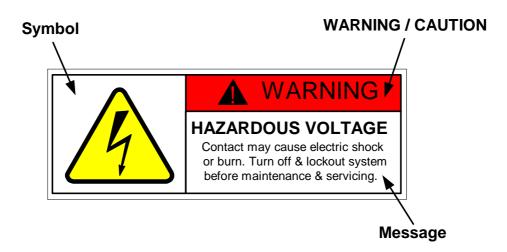

1.2 Warning labels (Continued)

Warning labels applied on the equipment.



WARNING

HAZARDOUS VOLTAGE

Contact could cause electric shock or burn. Turn off & lockout system before maintenance & servicing.



A CAUTION

LINE VOLTAGE ALWAYS PRESENT

Don't remove the protective cover.



A CAUTION

HOT SURFACE

Contact may cause burn.
Turn off & lockout system before maintenance & servicing.



A C

CAUTION

MECHANICAL HAZARD

Contact may cause injury to body. Turn off & lockout system before maintenance & servicing.



A

CAUTION

PINCH POINT

Contact may cause injury by pinching. Turn off & lockout system before maintenence & servicing.



M WARNING

UV RADIATION

Radiation could cause injury to skin or eyes. Turn off & lockout before maintenance & servicing.



WARNING

HAZARDOUS VOLTAGE



WARNING

LINE VOLTAGE ALWAYS PRESENT

1.3 Warning labels applied on the machine

