- 3. Preparation for auto operation
- 3.1 Peeling tape preparation

## **MARNING**




Wear the glove when you touch the chuck table. Touching the chuck table with bare hands cause of burn injuries.

Failure to observe the caution may cause of injuries to human body and damage/performance decrement of the equipment.




(1) Turn off the [HEATER] switch of the power box. Check whether the chuck table temperature is fallen.

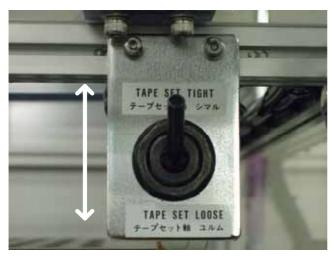


(2) Confirm the machine is in stopped state. Flip down the switch "TAPE SET LOOSE" to release the tape delivery shaft.


## 3.1 Peeling tape preparation (Continued)

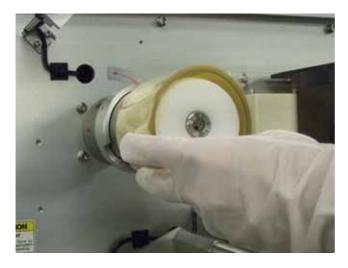


(3) Place the new peeling tape.

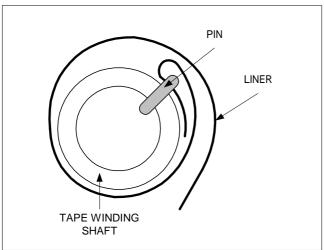


- (4) Place the liner (50-60cm) as shown figure, and fix it with the pin.
- (5) Place the peeling tape according to the tape path.

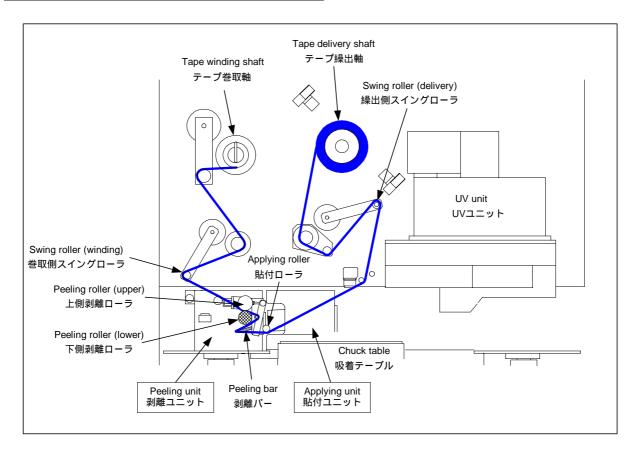

## 3.1 Peeling tape preparation (Continued)

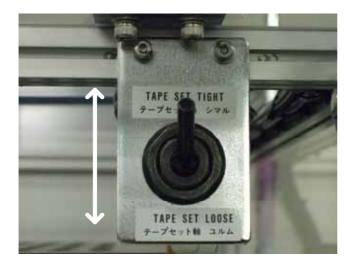

(6) Flip up the switch "TAPE SET TIGHT".

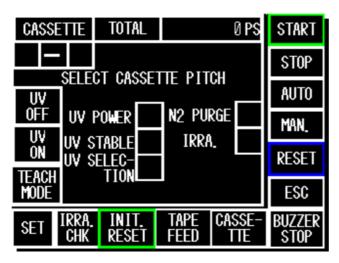

(7) Keep pressing [TAPE FEED] key until the BG tape is reeled 2 to 3 turns around the tape winding shaft.