



If room, add
one more
stich here

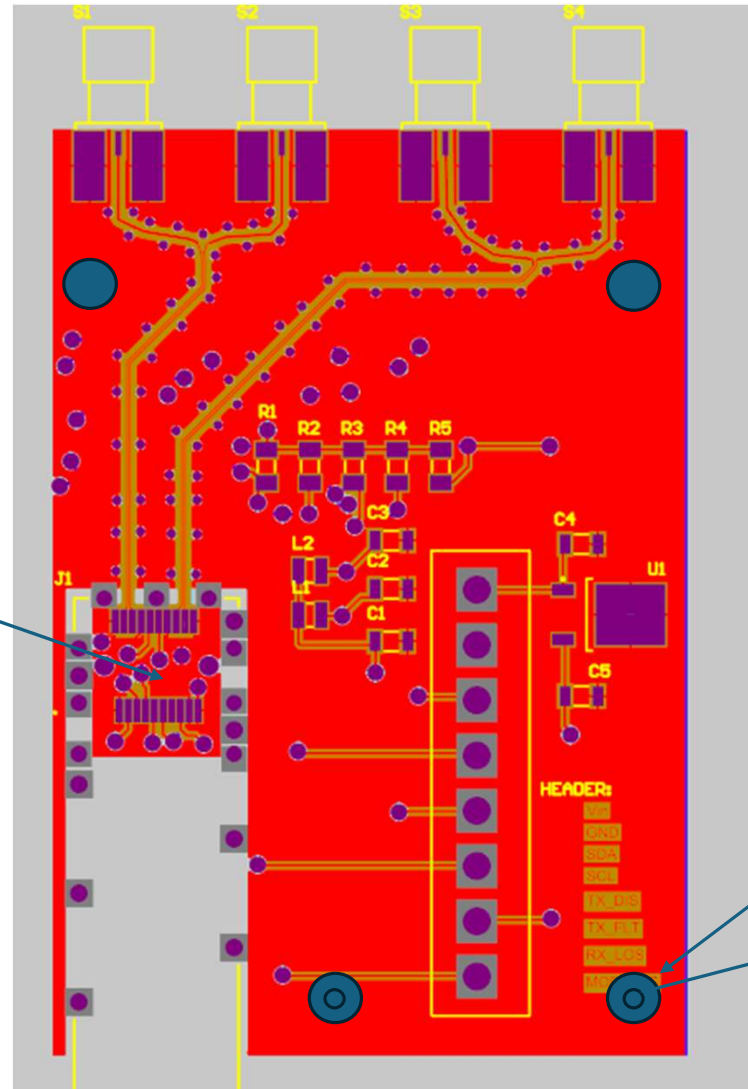


Clearance around hole

3.26mm hole
(4-40 clearance)

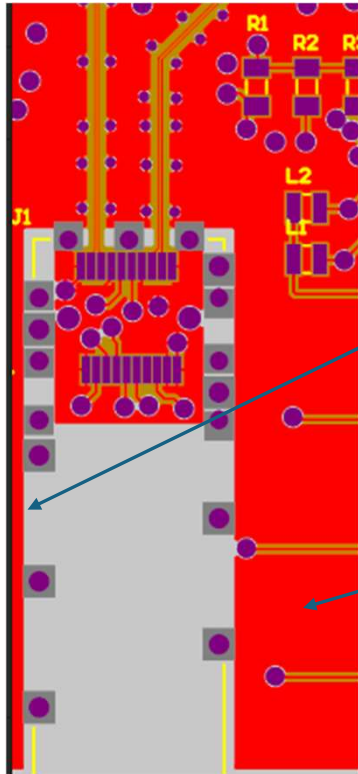


Delete metal here on layer 1 and 2 up to "J1"

Be sure all ground floods are tied to ground periodically

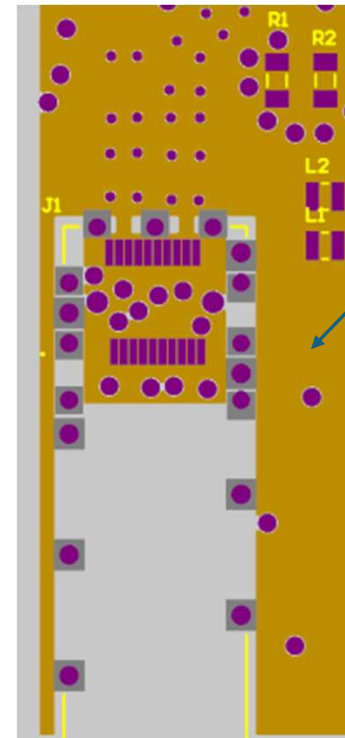


Be sure primary ground plane is unbroken

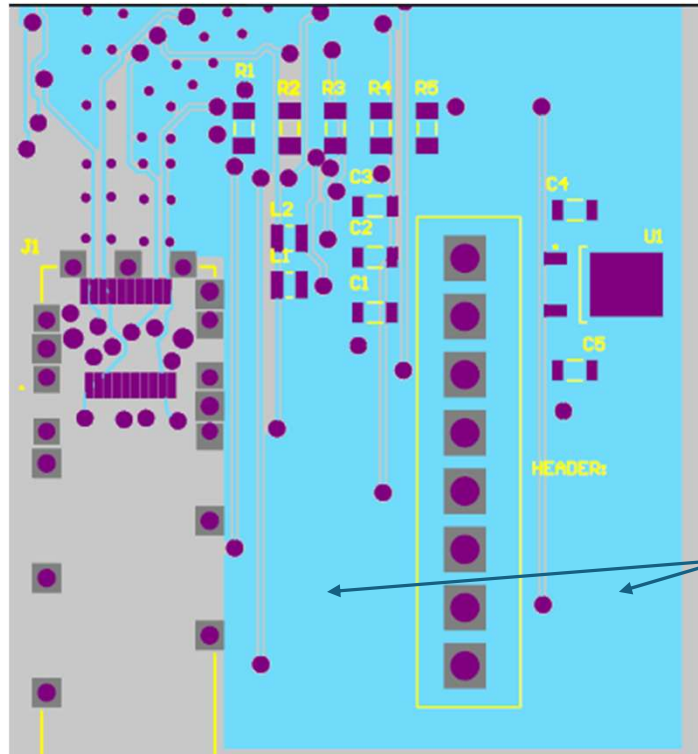

Be sure all ground
floods are tied to
ground periodically

The cage should be tied
to chassis ground
Connect chassis
ground to PCB
mounting holes

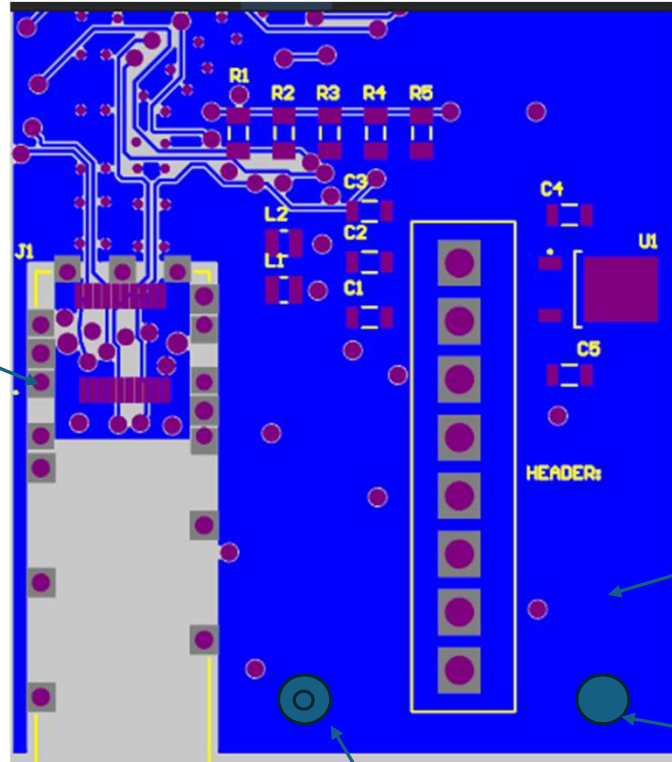

Be sure this layer is
isolated (only chassis
ground)

Mounting holes should
be connected to
chassis ground

Opening is solder mask