

DrawDiff Comparison Report

Part number: P-001 | **Job:** f6ff0930-0ef3-4a41-88c2-e2ab66be8ad7 | **Generated:** 2026-05-05T00:25:55+00:00

Summary

0 Critical	10 Significant	0 Minor	0 Uncertain	6 Views compared
----------------------	--------------------------	-------------------	-----------------------	----------------------------

Title Block

Field	Original	Revised
part_number		
revision	TS	
material		
tolerance		
drawn_by		
date		

Revision Block

Added in revised

No revision entries on revised drawing.

Removed from original


No revision entries on original drawing.

Annotated Drawings


Severity: ■ Critical ■ Significant ■ Minor ■ Uncertain

Sheet 1 — boxes mark views with detected changes.

Original

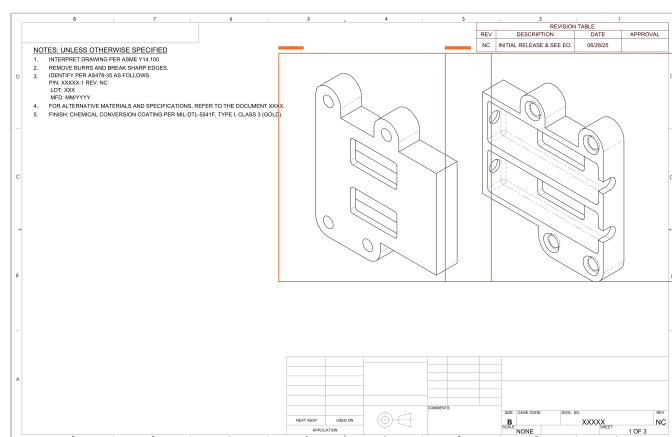


Revised

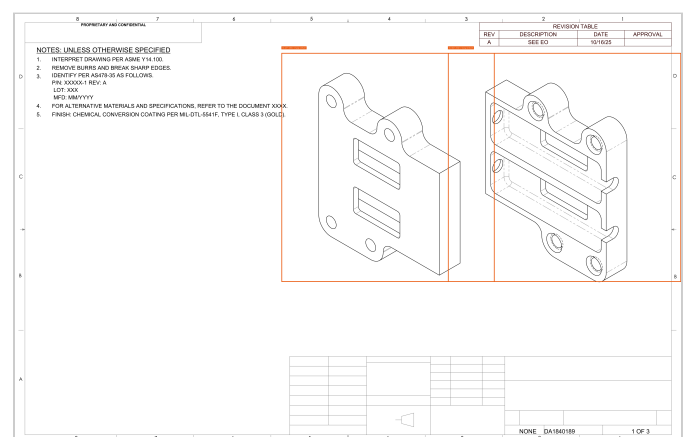


Sheet 2 — boxes mark views with detected changes.

Original

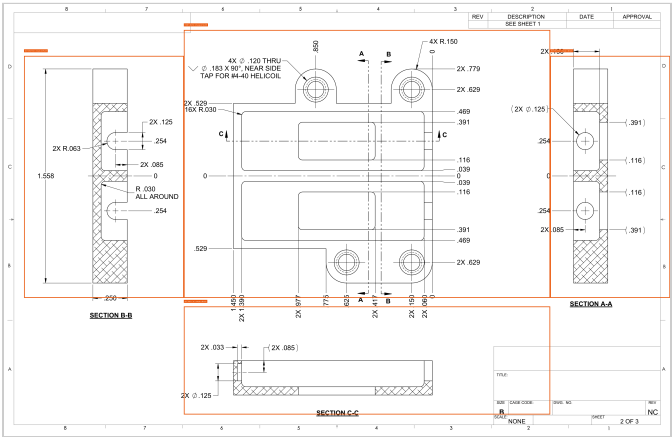

Revised

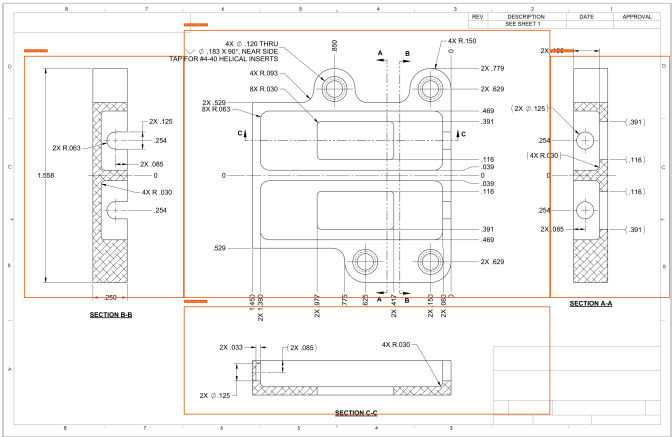

View-by-view Changes


title_block [TITLE_BLOCK]

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	revision	TS	—	1.00	title_block.revision changed from 'TS' to None

revision_block [REVISION_BLOCK]


No textual changes recorded for this view.

ISO_LEFT_VIEW [MATCHED]

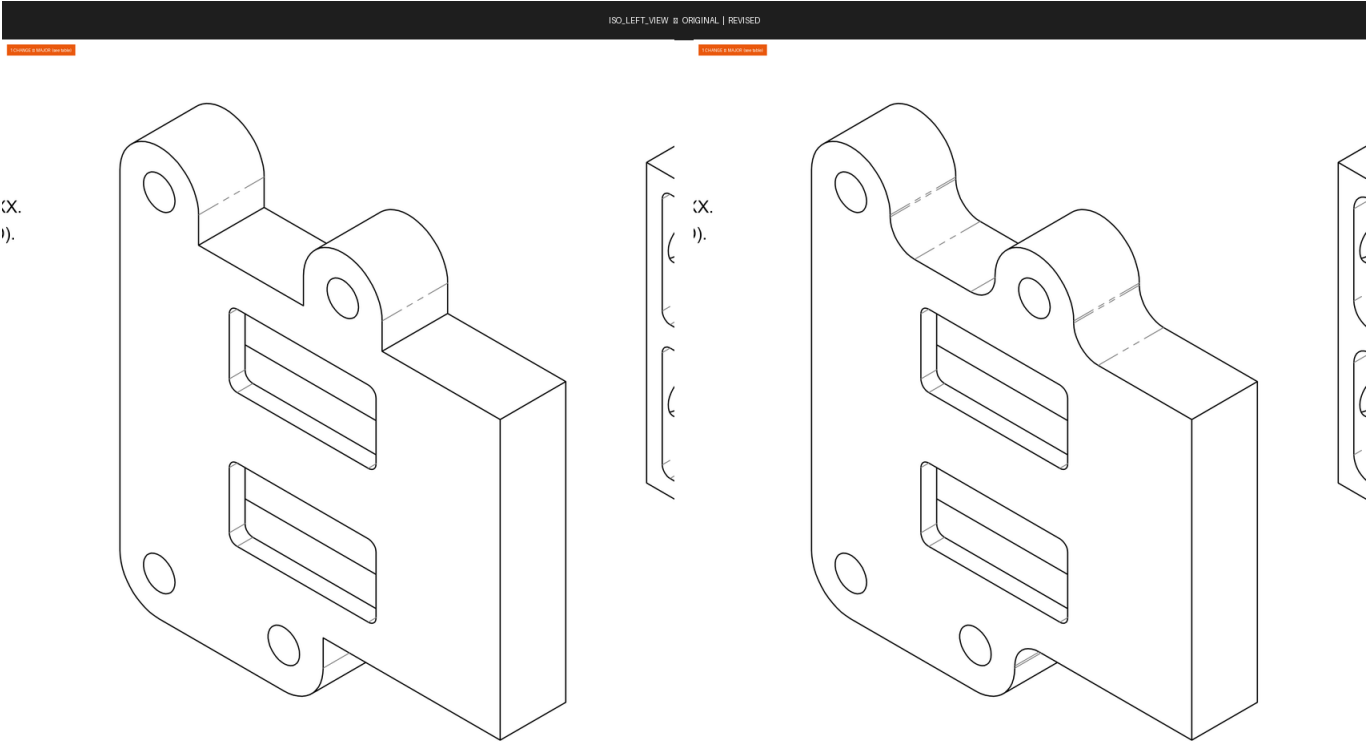

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Hinge knuckle/barrel region shows a flat or stepped transition between the two barrel lobes at the top of the part	Hinge knuckle/barrel region shows a continuous concave curved (filleted/relieved) transition between the two barrel lobes at the top of the part	0.72	The geometry of the hinge barrel connection area has changed from what appears to be a flat/stepped profile to a concave curved relief, which would affect the hinge pivot clearance, stress concentration, and potentially the fit with a mating pin or leaf.

ISO_RIGHT_VIEW [MATCHED]

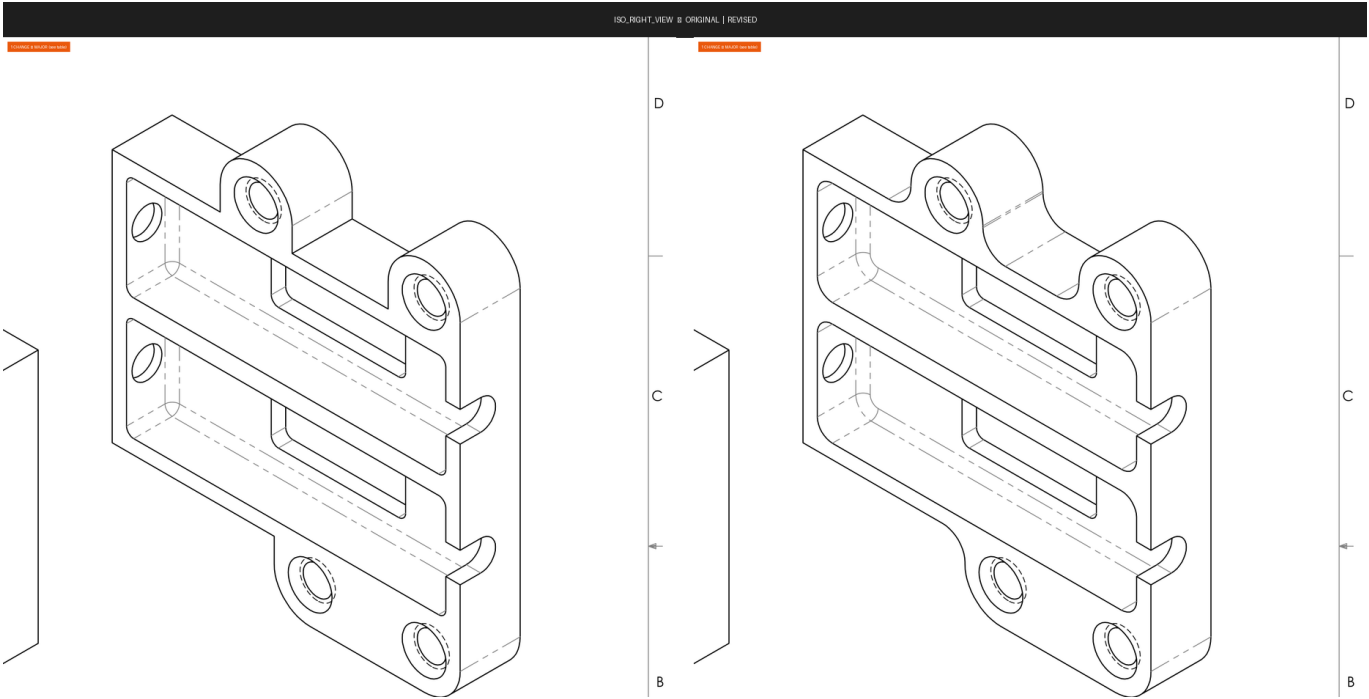



Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	geometry	Upper bracket/yoke feature shown with a raised rectangular bar/rib spanning between the two upper bosses, creating a stepped profile with a distinct horizontal flat top	Upper bracket/yoke feature shown with a smooth curved/arched profile between the two upper bosses, without the raised rectangular bar/rib	0.82	The upper connecting feature between the two boss/bearing housings changed from a flat-topped rectangular bar geometry to a smooth curved arch, indicating a significant shape modification that affects material distribution and potentially structural performance.

SECTION B-B [MATCHED]

SECTION B-B ■ ORIGINAL | REVISED


2 CHANGES & MAJOR (see table)

TAP

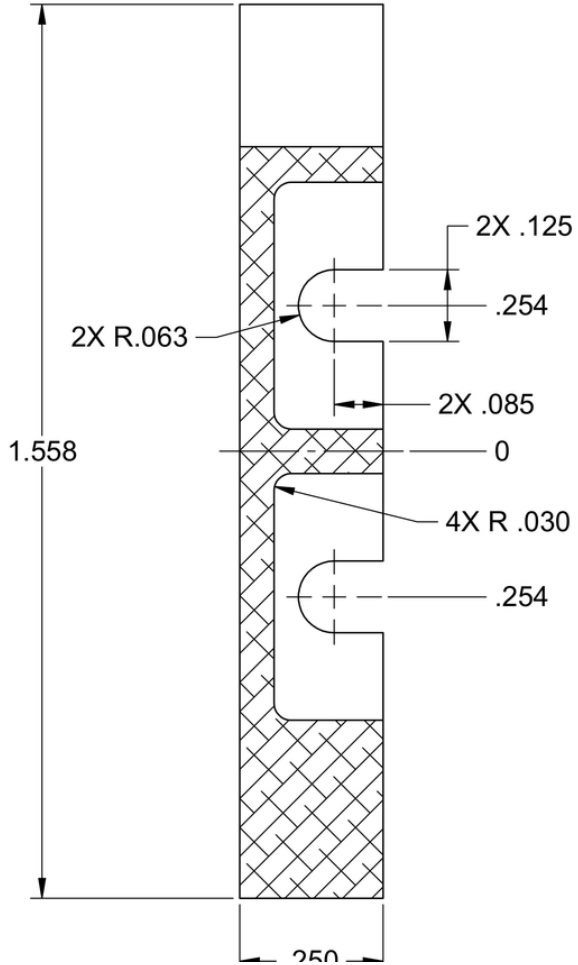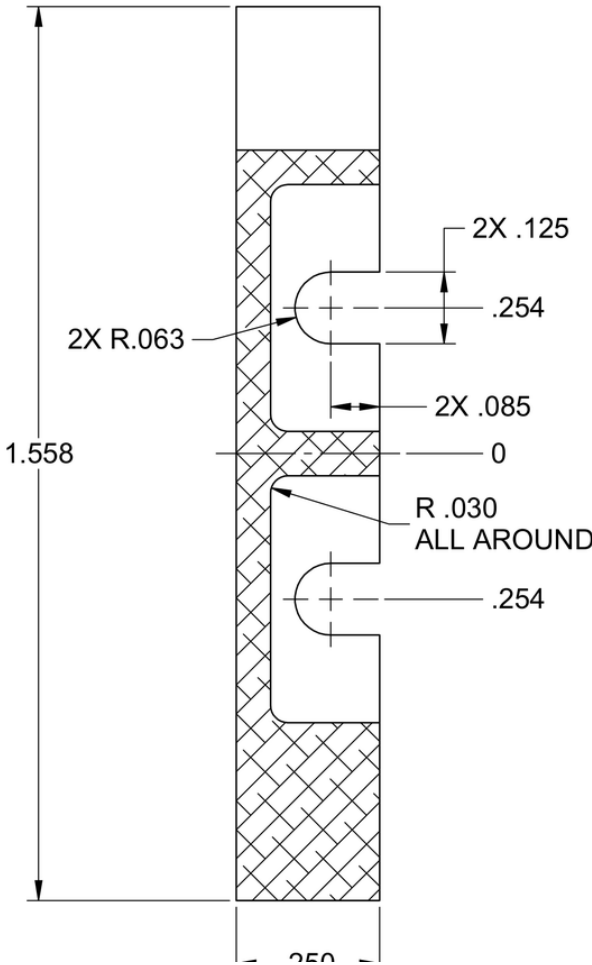


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	callout	R .030 ALL AROUND	4X R .030	0.90	The radius callout for the slot corners changed from 'R .030 ALL AROUND' to '4X R .030', altering how the radius application scope is specified — 'ALL AROUND' implies continuous application whereas '4X' specifies exactly four discrete instances, which could affect machining interpretation and resulting geometry.
SIGNIFICANT	annotation	—	TAP	0.82	A 'TAP' label has been added in the upper right corner of the revised view that was not present in the original, indicating a tapping operation is now called out for this feature.

FRONT_VIEW [MATCHED]

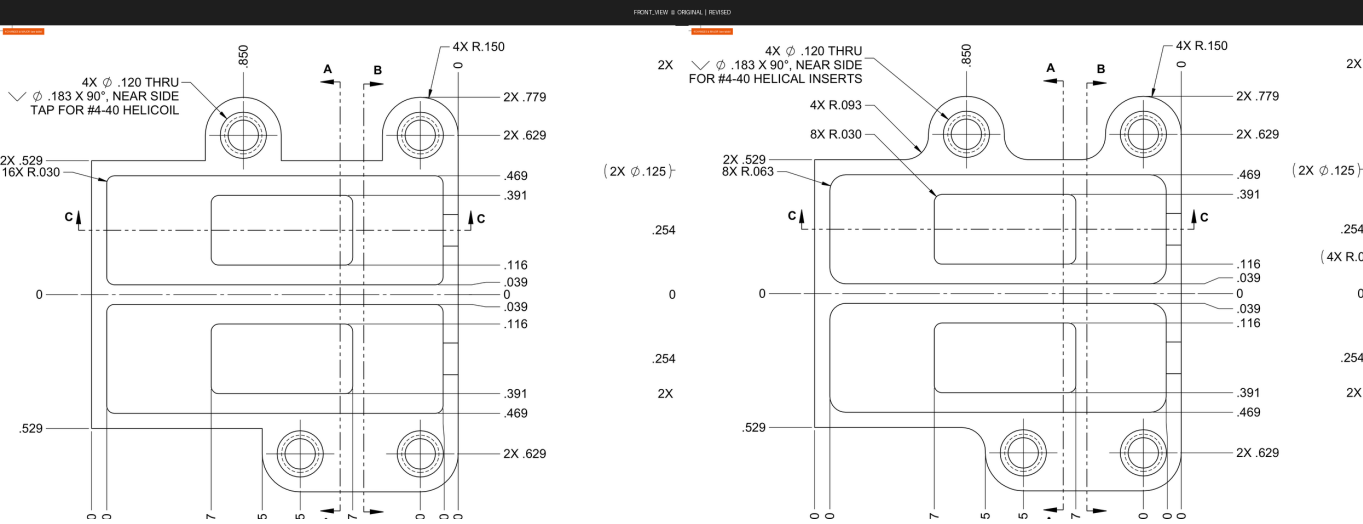


Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	callout	TAP FOR #4-40 HELICOIL	FOR #4-40 HELICAL INSERTS	0.92	The fastener insert callout changed from 'HELICOIL' (a brand-specific helical insert) to generic 'HELICAL INSERTS', which may affect procurement and installation specifications.
SIGNIFICANT	dimension	—	8X R.063	0.88	A new radius callout of 8X R.063 has been added in the revised drawing near the 2X .529 dimension, indicating new or changed fillet radii on the pocket/feature.
SIGNIFICANT	geometry	Pocket corners with smaller radii (R.030)	Pocket corners with larger radii (R.063)	0.85	The internal pocket corner radii appear to have changed from R.030 to R.063, which affects tooling requirements and part geometry.
UNCERTAIN*	annotation	—	(4X R.0	0.55	A partially visible new annotation '(4X R.0...' appears on the right side of the revised drawing that was not present in the original; the full value is cut off and cannot be confirmed. [possible match: SECTION C-C]

SECTION A-A [MATCHED]

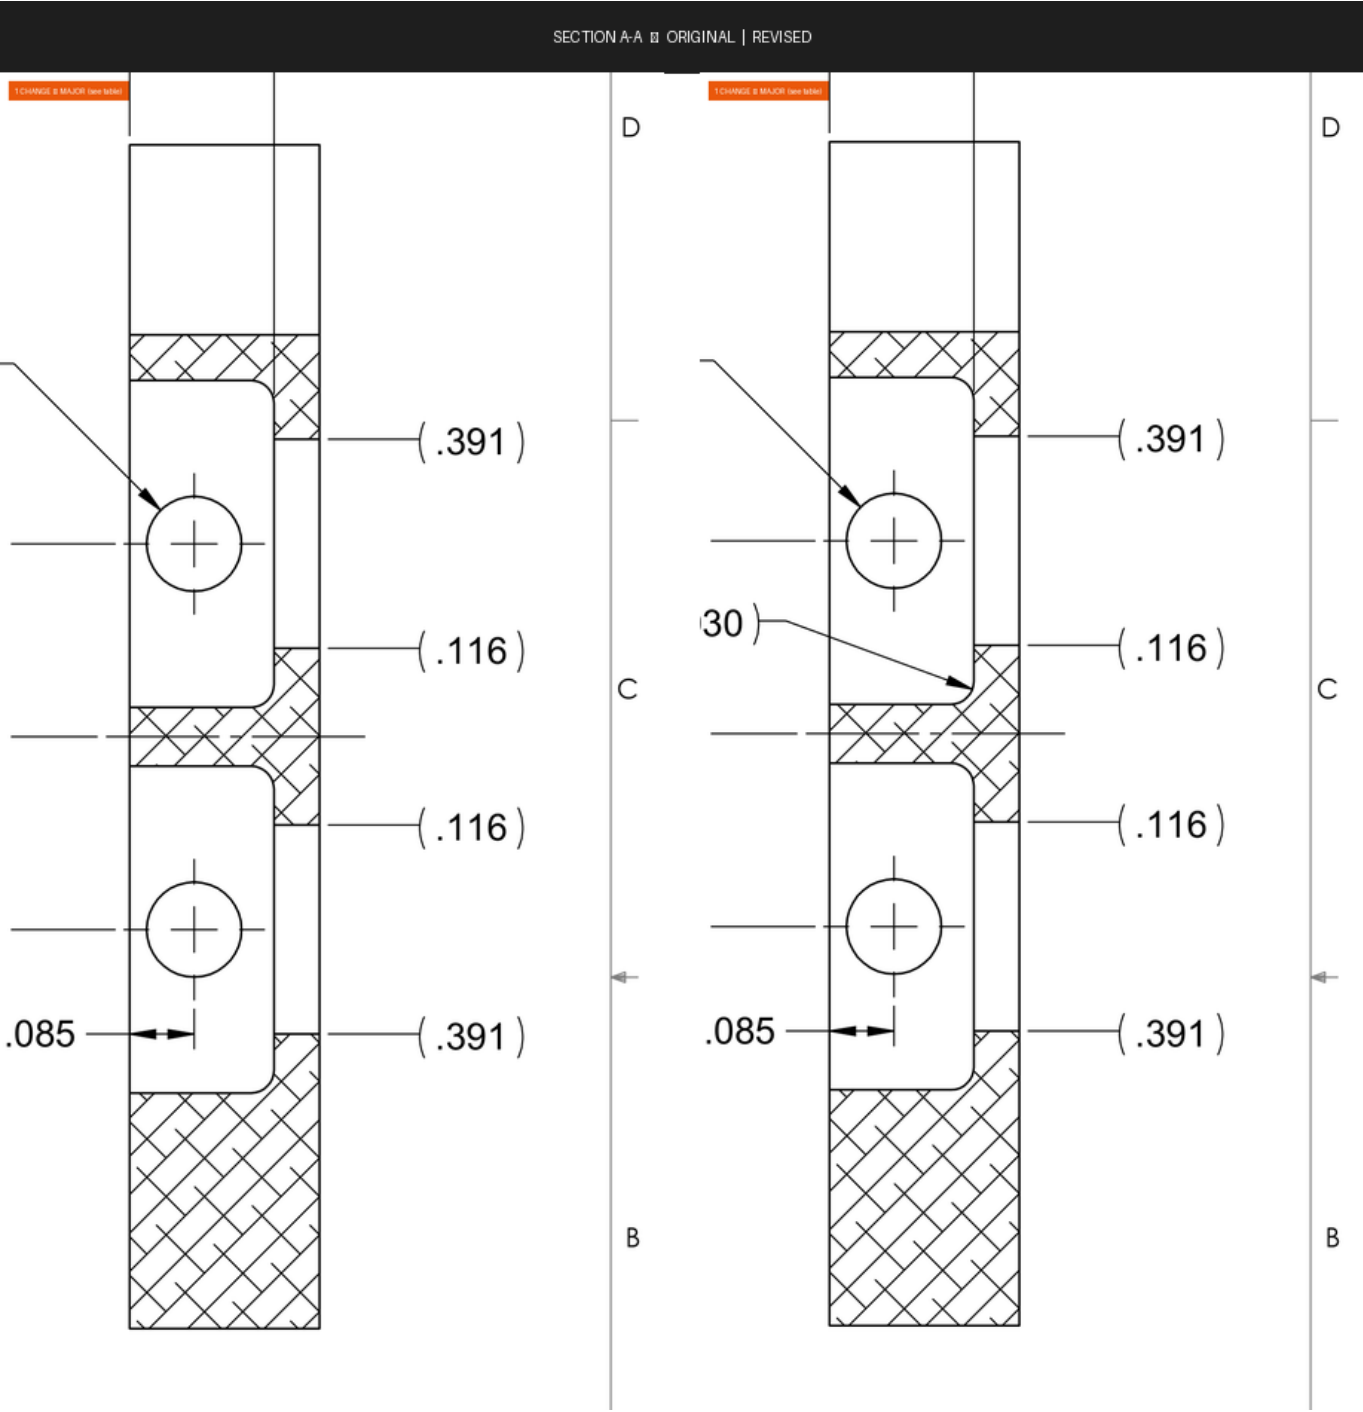

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	—	(.30)	0.72	A new reference dimension callout '(.30)' with a leader arrow pointing to the mid-section fillet/groove feature has been added in the revised drawing, which was not present in the original and may affect manufacturing interpretation of that feature.

SECTION C-C [MATCHED]

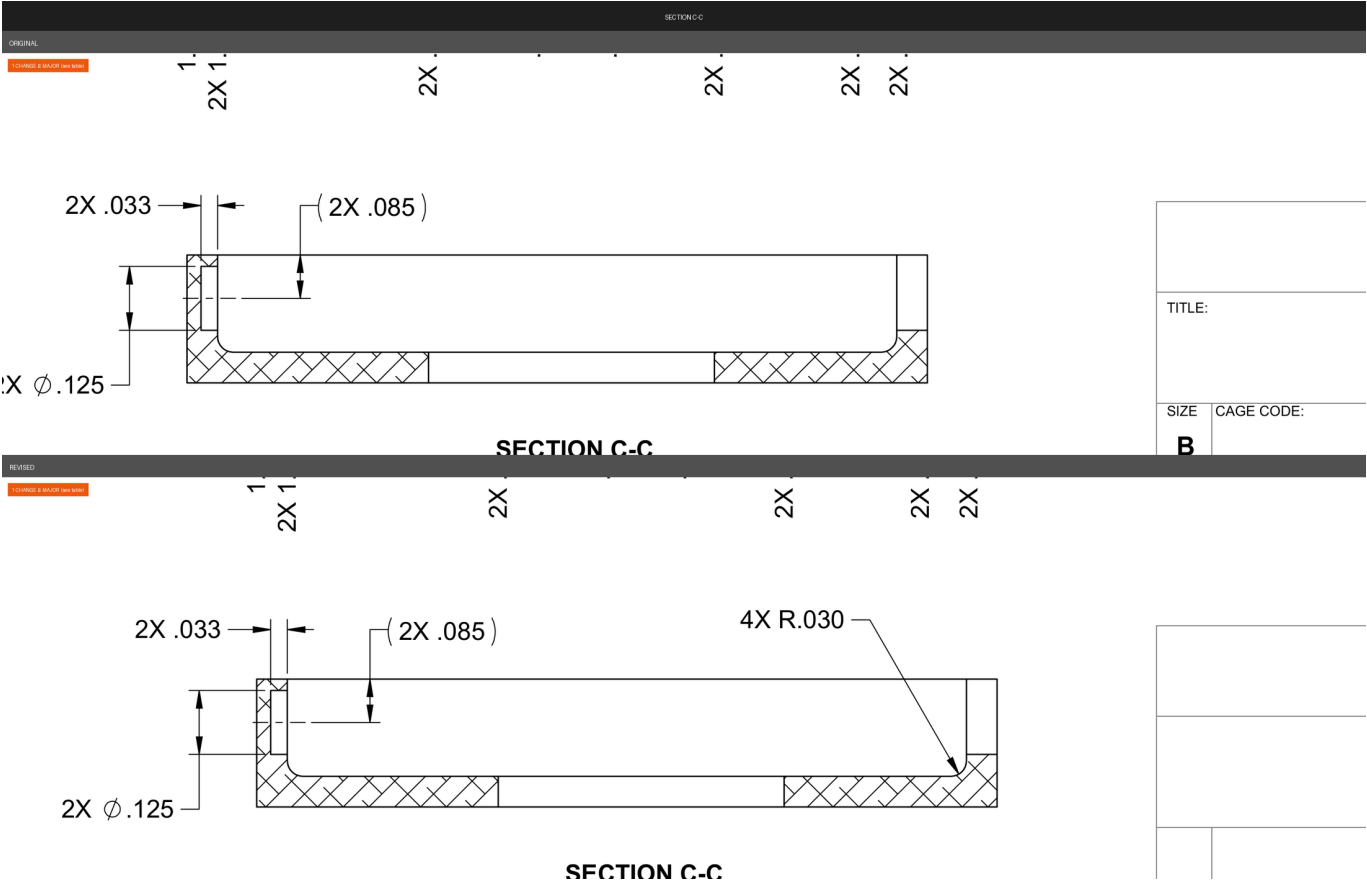

Severity	Field	Original	Revised	Conf.	Rationale
SIGNIFICANT	annotation	—	4X R.030	0.92	A new radius callout '4X R.030' with a leader pointing to the corner of the section profile has been added in the revised drawing, specifying a corner radius that was not previously called out, which affects manufacturing of the part edges.

Legend

- **CRITICAL** — Affects structural integrity, safety, interchangeability, or regulatory compliance.
 - **SIGNIFICANT** — Affects manufacturing scope, cost, or lead time. No safety risk but requires re-planning.
 - **MINOR** — Clarity, formatting, or documentation change. No manufacturing impact.
 - **UNCERTAIN** — Confidence below 0.65. Requires human review.
- ⚠ **AI-generated — requires human verification before release to manufacturing.**