


,	REVISIONS							
5	E.C. NO.	REV.	DESCRIPTION	BY	DATE			
		Α	DRAWING RELEASED	CE	1/04			
	0103	В	REVISED DRAWING	CE	7/04			
	1056	С	UPDATED TITLE BLOCK	ВН	5/10			

- THE BELLY STRINGERS PROVIDED WILL NEED TO BE CUT
- BETWEEN STATIONS 10 & 11, MAKE SURE THE 2" LEG OF BELLY STRINGER MF03-227 IS IN THE VERTICAL POSITION. THIS WILL BE NECESSARY WHEN THE RADIATOR EXHAUST
- WHERE THE BELLY STRINGERS MEET THE BULKHEADS, YOU WILL NEED TO MAKE A CUT IN THE BEND OF THE BELLY STRINGERS AND BEND THE INSIDE TAB UP 90° TO RIVET IT TO THE FACE OF THE BULKHEAD AS THE OTHER LEG OF THE BELLY STRINGER OVERLAPS THE FLANGE. (SEE

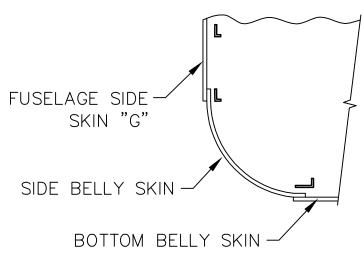

TITAN AIRCRAFT SUPPLY 1419 STATE ROUTE 45 SOUTH AUSTINBURG, OHIO 44010

DETAIL NAME A	LUMINUM	BELLY	STRINGER	INSTALLAT	ION					
SCALE $1/8"=1"$	PART NO.									
ASSEMBLY NAME										
PART NO.		DF	RAWING NO.	F39						
DRAWING NO. D	T 5 1	0.1	$I\lambda I C$	1011	\supset					