

Description: **Hydraulic thrust bearing**

Account Information

ID: 208948
Name: Reliance Heavy Industries
Address: Kattameya-Sokhna Road, Suez, 00000 EG

Sample Information

Sample ID: 26124405242
Service Level: Enhanced
Bottle ID: b108137312
Tested Lubricant: MOBIL SHC 639


Equipment Information

Asset Class: **Circulating System**
 Manufacturer: **FLS**
 Model: **FLS**
 Lubricant: **MOBIL SHC 639**


Sample Data & Trends

Sample Info	Report Status	Alert	Caution	Normal	Caution	Caution
	Sample ID	25180296254	25258159253	25294210233	26061630213	26124405242
	Service Level	Enhanced	Enhanced	Enhanced	Enhanced	Enhanced
	Bottle ID	b098244695	b098287892	b098190519	b098270084	b108137312
	Tested Lubricant	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639
	Sampled	18 Jun 2025	09 Sep 2025	16 Oct 2025	01 Feb 2026	26 Apr 2026
	Reported	01 Jul 2025	17 Sep 2025	22 Oct 2025	03 Mar 2026	05 May 2026
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Alert	Caution	Normal	Normal	Normal
	Equipment Rating	Normal	Caution	Normal	Normal	Caution
	Lubricant Rating	Caution	Normal	Normal	Caution	Normal
	PQ Index	20	15	13	22	55
	Visc@100C (cSt)	76.0	75.1	71.1	75.5	78.8
	TAN (mg KOH/g)	1.80	1.40	0.92	1.60	1.40
	Water (Vol%)	0.100	0.050	0.010	0.030	0.030
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	5	12	4	0	0
	Cr (Chromium)	2	1	0	0	0
	Cu (Copper)	1	3	2	0	0
	Fe (Iron)	30	72	34	42	22
	Mo (Molybdenum)	2	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	2	2	0	0	0
	Sn (Tin)	0	0	0	0	0
Contaminant (ppm)	K (Potassium)	1	2	0	0	0
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	6	0	12	4	0
Additive (ppm)	B (Boron)	2	30	0	9	14
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	11	29	14	20	5
	Mg (Magnesium)	1	3	2	2	2
	P (Phosphorus)	532	326	378	539	351
	Zn (Zinc)	590	49	38	71	468


Viscosity

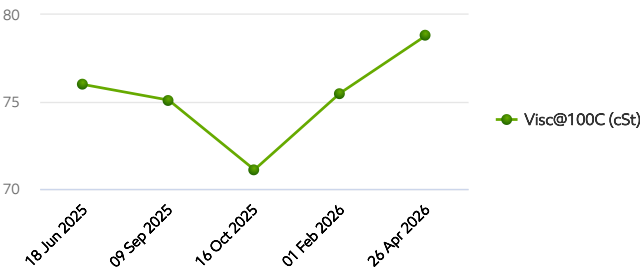


Wear

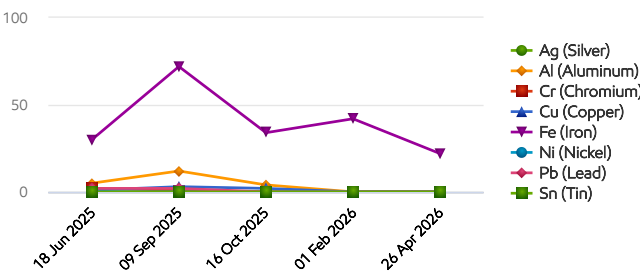

Contaminants

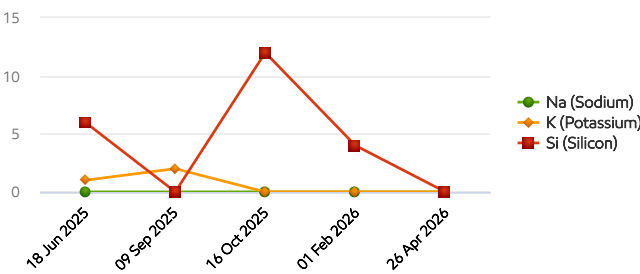

Physical Properties

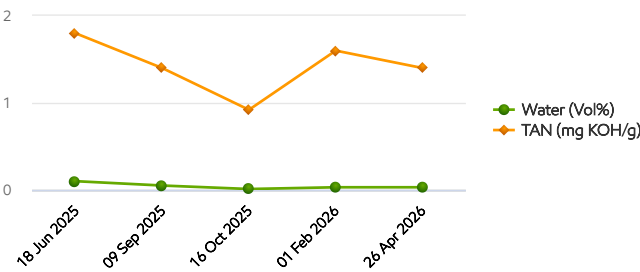

		Caution	
		Unit ID: 431.HT120(BE)	Asset ID: 30913120
		Description: Hydraulic thrust bearing	
Account Information		Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG		Sample ID: 26124405242 Service Level: Enhanced Bottle ID: b108137312 Tested Lubricant: MOBIL SHC 639	Asset Class: Circulating System Manufacturer: FLS Model: FLS Lubricant: MOBIL SHC 639
Recommendation/Comments			
CAUTION - ELEVATED FERROUS DEBRIS. Determine cause of ferrous debris and take corrective action. If the ferrous debris level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Potential causes of ferrous debris include: a. Metallic component wear caused by abrasive dirt (or other contaminants); b. Material fatigue from heavy loads or other adverse operating conditions; c. Corrosive wear due to water, acids, or other contaminants in the lubricant; d. Normal "break-in" wear of new or recently replaced equipment. Inspect the equipment for signs of damage. The oil is unfit for continued use and should be replaced immediately to prevent further wear and damage from occurring. Contact your ExxonMobil representative for further assistance if necessary.			
Sample Timeline			
26 Apr 2026 11:32 AM - Hassan Mostafa - In Service Oil Sample: Comments: Photo:			