

Description: **Clinker Cooler filter Fan**

Account Information

ID: 208948

Name: Reliance Heavy Industries

Address: Kattameya-Sokhna Road, Suez, 00000 EG

Sample Information

Sample ID: 26124405236

Service Level: **Enhanced**

Bottle ID: b108137437

Tested Lubricant: MOBIL SHC 632

Equipment Information

Asset Class: **Gear Drive**

Manufacturer: **FLENDER**


Model: H1SH9-3,55-FC

Lubricant: MOBIL SHC 632


Sample Data & Trends

Sample Info	Report Status	Caution	Caution	Caution	Caution	Caution
	Sample ID	24206247250	25049182244	25258159255	25294210244	26124405236
	Service Level	Enhanced	Enhanced	Enhanced	Enhanced	Enhanced
	Bottle ID	b088842834	b094031763	b098270700	b098190203	b108137437
	Tested Lubricant	MOBIL SHC 632	MOBIL SHC 632	MOBIL SHC 632	MOBIL SHC 632	MOBIL SHC 632
	Sampled	15 Jul 2024	13 Feb 2025	09 Sep 2025	16 Oct 2025	26 Apr 2026
	Reported	28 Jul 2024	19 Feb 2025	17 Sep 2025	22 Oct 2025	05 May 2026
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
Filter Changed						
Lubricant	Contamination Rating	Caution	Caution	Caution	Caution	Caution
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal
	ISO Code (4/6/14)		22/21/19			
	Particle Count >4um		23972			
	Particle Count >6um		14322			
	Particle Count>14um		4817			
	PQ Index	11	7	20	10	22
	Visc@40C (cSt)	340.0	295.0	330.7	317.6	333.6
	TAN (mg KOH/g)	1.41	1.12	1.20	1.20	1.30
	Water (Vol%)	<0.003	0.050	0.020	<0.003	0.040
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	4	13	4	0
	Cr (Chromium)	0	1	1	0	0
	Cu (Copper)	0	3	3	2	0
	Fe (Iron)	0	5	7	1	1
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	0	2	0	0	0
	Sn (Tin)	0	0	0	0	0
Contaminant (ppm)	K (Potassium)	0	0	0	0	0
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	18	21	9	36	15
Additive (ppm)	B (Boron)	16	8	21	0	12
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	2	8	35	8	0
	Mg (Magnesium)	0	2	2	0	15
	P (Phosphorus)	367	562	324	482	433
	Zn (Zinc)	13	14	14	3	9


Viscosity

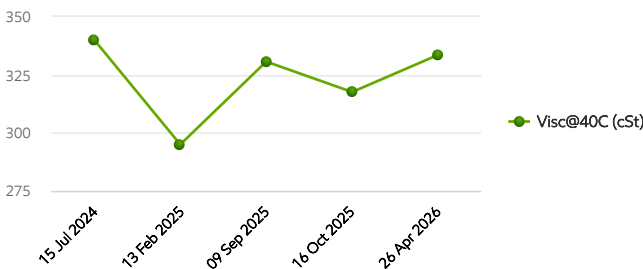


Wear

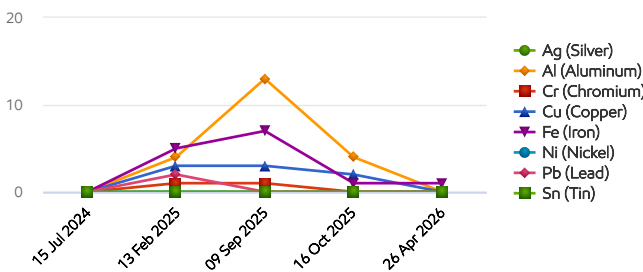

Contaminants

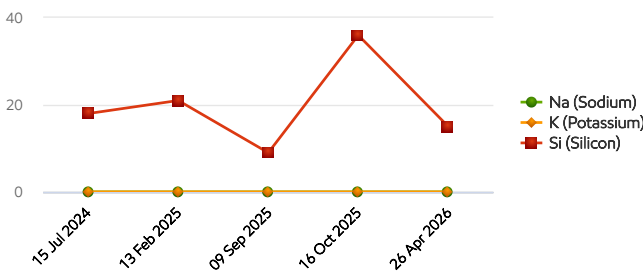

Physical Properties

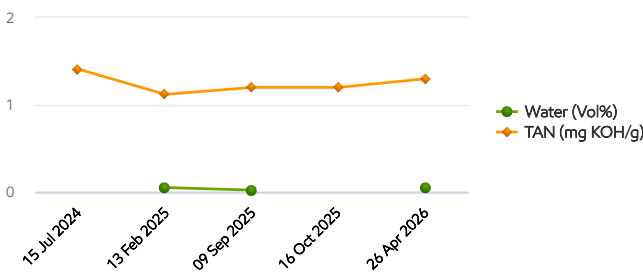

	Caution	
	Unit ID: 441.FN590	Asset ID: 30771884
	Description: Clinker Cooler filter Fan	
Account Information	Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG	Sample ID: 26124405236 Service Level: Enhanced Bottle ID: b108137437 Tested Lubricant: MOBIL SHC 632	Asset Class: Gear Drive Manufacturer: FLENDER Model: H1SH9-3,55-FC Lubricant: MOBIL SHC 632
Recommendation/Comments		
ADMINISTRATION - PARTICLE COUNT DATA NOT REPORTED. The sample is heavily contaminated with visible sediment. Oil samples that contain significant levels of any contaminant can damage the laboratory's precision equipment. As a result, the particle count test was not completed, and analysis could not be provided. Before sending future samples to the laboratory, please ensure that no signs of visible sediment contamination are present. Consider the following: 1. The sample may not be representative of the system if it was acquired from a non-turbulent area (i.e. tank bottom); 2. Installing sample ports helps ensure that the sample is taken from the same location every time; 3. Tank fill caps and breathers might not be properly secured; 4. The filter / centrifuge may be operating incorrectly. If the sample was representative of the system, change the oil immediately to prevent equipment damage. Contact your ExxonMobil representative for further assistance if necessary.		
Sample Timeline		
26 Apr 2026 10:37 AM - Hassan Mostafa - In Service Oil Sample: Comments: Photo:		