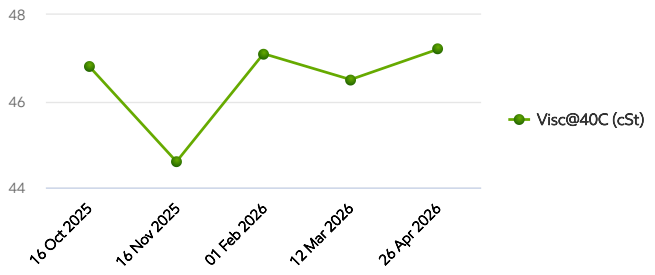
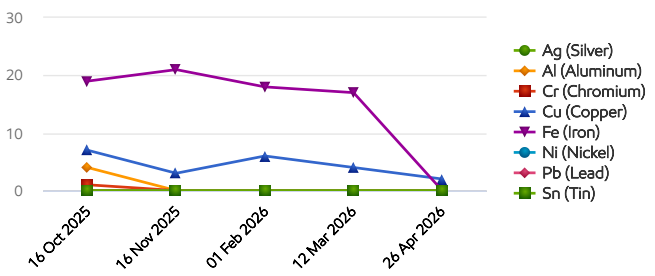
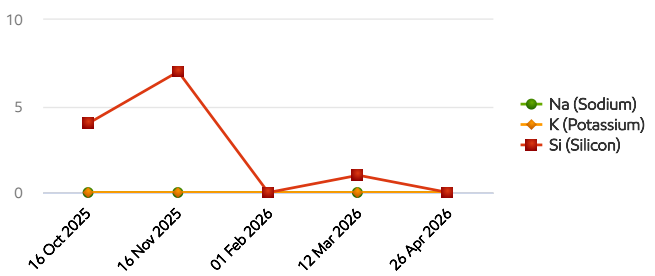
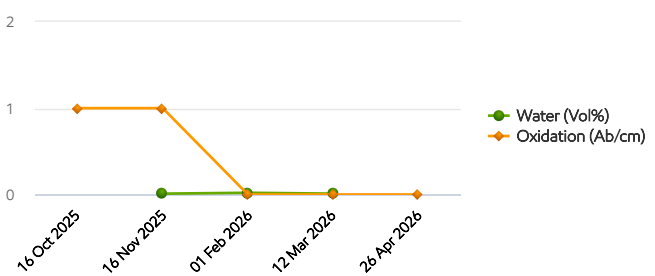


MobilTM							Caution								
							Unit ID: 461.HY110				Asset ID: 40584341				
							Description: Coal Mill 1 Hyd. tensioning sys.								
Account Information							Sample Information				Equipment Information				
ID: 208948							Sample ID: 26123350227				Asset Class: Hydraulic				
Name: Reliance Heavy Industries							Service Level: Enhanced				Manufacturer: FLS				
Address: Kattameya-Sokhna Road, Suez, 00000 EG							Bottle ID: b108138407				Model: ATOX MILL 25 HYD. TENSION				
							Tested Lubricant: MOBIL DTE 25				Lubricant: MOBIL DTE 25				
Sample Data & Trends															
Sample Info	Report Status	Caution	Caution	Caution	Caution	Caution	Viscosity  ● Visc@40C (cSt)								
	Sample ID	25294210215	25330261222	26060130243	26090313222	26123350227									
	Service Level	Enhanced	Enhanced	Enhanced	Enhanced	Enhanced									
	Bottle ID	b098307983	b098307816	b070051887	b105106465	b108138407									
	Tested Lubricant	MOBIL DTE 25	MOBIL DTE 25	MOBIL DTE 25	MOBIL DTE 25	MOBIL DTE 25									
	Sampled	16 Oct 2025	16 Nov 2025	01 Feb 2026	12 Mar 2026	26 Apr 2026									
	Reported	22 Oct 2025	27 Nov 2025	02 Mar 2026	01 Apr 2026	04 May 2026									
	Equipment Age														
	Oil Age														
	Make-up Volume														
	Oil Changed														
	Filter Changed														
Lubricant	Contamination Rating	Caution	Caution	Caution	Caution	Caution	Wear  ● Ag (Silver) ● Al (Aluminum) ● Cr (Chromium) ● Cu (Copper) ● Fe (Iron) ● Ni (Nickel) ● Pb (Lead) ● Sn (Tin)								
	Equipment Rating	Normal	Normal	Normal	Normal	Normal									
	Lubricant Rating	Normal	Normal	Normal	Normal	Normal									
	ISO Code (4/6/14)														
	Particle Count >4um														
	Particle Count >6um														
	Particle Count>14um														
	PQ Index	8	16	17	8	7									
	Visc@40C (cSt)	46.8	44.6	47.1	46.5	47.2									
	Oxidation (Ab/cm)	1	1	0	0	0									
	Water (Vol%)	<0.003	0.010	0.020	0.010	<0.003									
	Wear (ppm)	Ag (Silver)	0	0	0	0	0	Contaminants  ● Na (Sodium) ● K (Potassium) ● Si (Silicon)							
Al (Aluminum)		4	0	0	0	0									
Cr (Chromium)		1	0	0	0	0									
Cu (Copper)		7	3	6	4	2									
Fe (Iron)		19	21	18	17	0									
Mo (Molybdenum)		0	0	0	0	0									
Ni (Nickel)		0	0	0	0	0									
Pb (Lead)		0	0	0	0	0									
Sn (Tin)		0	0	0	0	0									
Contaminant (ppm)		K (Potassium)	0	0	0	0	0	Physical Properties  ● Water (Vol%) ● Oxidation (Ab/cm)							
		Na (Sodium)	0	0	0	0	0								
		Si (Silicon)	4	7	0	1	0								
Additive (ppm)	B (Boron)	0	3	0	2	10									
	Ba (Barium)	0	0	0	0	0									
	Ca (Calcium)	71	102	130	101	70									
	Mg (Magnesium)	1	2	2	0	2									
	P (Phosphorus)	410	450	415	496	451									
	Zn (Zinc)	406	497	652	685	621									

	Caution	
	Unit ID: 461.HY110	Asset ID: 40584341
	Description: Coal Mill 1 Hyd. tensioning sys.	
Account Information	Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG	Sample ID: 26123350227 Service Level: Enhanced Bottle ID: b108138407 Tested Lubricant: MOBIL DTE 25	Asset Class: Hydraulic Manufacturer: FLS Model: ATOX MILL 25 HYD. TENSION Lubricant: MOBIL DTE 25
Recommendation/Comments		
ADMINISTRATION - PARTICLE COUNT DATA NOT REPORTED. The sample is heavily contaminated with visible sediment. Oil samples that contain significant levels of any contaminant can damage the laboratory's precision equipment. As a result, the particle count test was not completed, and analysis could not be provided. Before sending future samples to the laboratory, please ensure that no signs of visible sediment contamination are present. Consider the following: 1. The sample may not be representative of the system if it was acquired from a non-turbulent area (i.e. tank bottom); 2. Installing sample ports helps ensure that the sample is taken from the same location every time; 3. Tank fill caps and breathers might not be properly secured; 4. The filter / centrifuge may be operating incorrectly. If the sample was representative of the system, change the oil immediately to prevent equipment damage. Contact your ExxonMobil representative for further assistance if necessary.		
Sample Timeline		
26 Apr 2026 9:41 AM - Hassan Mostafa - In Service Oil Sample: Comments: Photo:		