
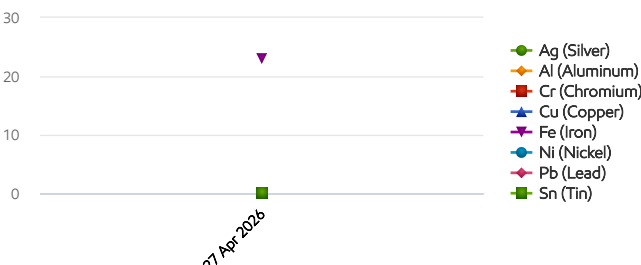
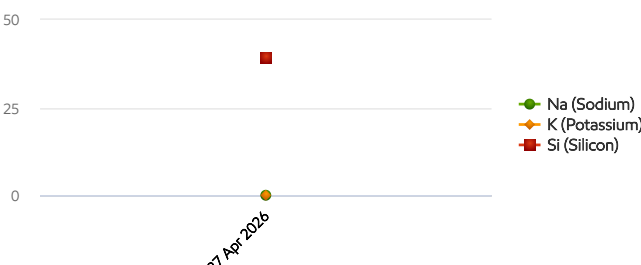


MobilTM			Caution		
			Unit ID: 532.MD302		
			Asset ID: 52305305		
			Description: Cement Mill #2 Separator Gearbox		
Account Information			Sample Information		Equipment Information
ID: 462031			Sample ID: 26124405227		Asset Class: Gear Drive
Name: ASEC - ACC			Service Level: Enhanced		Manufacturer: FLENDER
Address: , , EG			Bottle ID: b098084179		Model: N/A
			Tested Lubricant: MOBIL SHC 632		Lubricant: MOBIL SHC 632
Sample Data & Trends					
Sample Info	Report Status	Caution	Viscosity		
	Sample ID	26124405227			
	Service Level	Enhanced			
	Bottle ID	b098084179			
	Tested Lubricant	MOBIL SHC 632			
	Sampled	27 Apr 2026			
	Reported	05 May 2026			
	Equipment Age				
	Oil Age				
	Make-up Volume				
	Oil Changed				
Filter Changed					
Lubricant	Contamination Rating	Caution	Wear		
	Equipment Rating	Normal			
	Lubricant Rating	Normal			
	ISO Code (4/6/14)				
	Particle Count >4um				
	Particle Count >6um				
	Particle Count>14um				
	PQ Index	19			
	Visc@40C (cSt)	287.4			
	TAN (mg KOH/g)	1.40			
	Water (Vol%)	0.030			
Wear (ppm)	Ag (Silver)	0	Contaminants		
	Al (Aluminum)	0			
	Cr (Chromium)	0			
	Cu (Copper)	0			
	Fe (Iron)	23			
	Mo (Molybdenum)	0			
	Ni (Nickel)	0			
	Pb (Lead)	0			
	Sn (Tin)	0			
	K (Potassium)	0			
	Na (Sodium)	0			
Si (Silicon)	39				
Additive (ppm)	B (Boron)	12	Physical Properties		
	Ba (Barium)	0			
	Ca (Calcium)	21			
	Mg (Magnesium)	2			
	P (Phosphorus)	433			
	Zn (Zinc)	71			

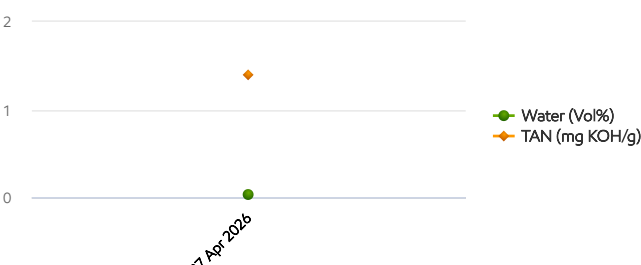

Caution

Unit ID: 532.MD302

Asset ID: 52305305

Description: Cement Mill #2 Separator Gearbox

Account Information	Sample Information	Equipment Information
ID: 462031 Name: ASEC - ACC Address: , , EG	Sample ID: 26124405227 Service Level: Enhanced Bottle ID: b098084179 Tested Lubricant: MOBIL SHC 632	Asset Class: Gear Drive Manufacturer: FLENDER Model: N/A Lubricant: MOBIL SHC 632

Recommendation/Comments

CAUTION - ELEVATED SILICON LEVEL. Determine source of Silicon (Si) and take corrective action. If the silicon level is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. If wear metals levels are low, then the silicon likely exists in a non-abrasive form. Possible sources of non-abrasive silicon include: a. Defoamants; b. Sealant compounds. If wear metal levels are elevated, then the silicon likely exists in an abrasive form. Possible sources of abrasive silicon include: a. Abrasive dirt remaining in equipment due to ineffective purification and / or filtration; b. Faulty seals, breather, fill caps; c. Improper sampling techniques that result in dirt contaminating the sample. The oil may be unfit for continued use and should be monitored closely for further condition regressions. Prolonged usage of lubricants with elevated levels of abrasive silicon can cause severe wear and damage to the equipment. Inspect the equipment for signs of excessive wear. Change the oil immediately if the condition escalates. Contact your ExxonMobil representative for further assistance if necessary.

ADMINISTRATION - PARTICLE COUNT DATA NOT REPORTED. The sample is heavily contaminated with visible sediment. Oil samples that contain significant levels of any contaminant can damage the laboratory's precision equipment. As a result, the particle count test was not completed, and analysis could not be provided. Before sending future samples to the laboratory, please ensure that no signs of visible sediment contamination are present. Consider the following: 1. The sample may not be representative of the system if it was acquired from a non-turbulent area (i.e. tank bottom); 2. Installing sample ports helps ensure that the sample is taken from the same location every time; 3. Tank fill caps and breathers might not be properly secured; 4. The filter / centrifuge may be operating incorrectly. If the sample was representative of the system, change the oil immediately to prevent equipment damage. Contact your ExxonMobil representative for further assistance if necessary.

Sample Timeline

- 27 Apr 2026 2:57 PM - Abd El Rahman Khaled - In Service Oil Sample : Comments: Photo:

Results and comments of this analysis are advisory only. The validity of the data may be impaired by a non-representative sample or incorrect data. © 2016-2024 ExxonMobil. ExxonMobil and Mobil are trademarks or registered trademarks of ExxonMobil Corporation or one of its subsidiaries. Other trademarks shown are property of their respective owners.