

Description: **Roller Lubrication Unit (Tank)**

Account Information

ID: 208948
Name: Reliance Heavy Industries
Address: Kattameya-Sokhna Road, Suez, 00000 EG

Sample Information





Sample ID: 26124405281
Service Level: Enhanced
Bottle ID: b105154347
Tested Lubricant: MOBIL SHC 639

Equipment Information

Asset Class: **Circulating System**
 Manufacturer: **FLS**
 Model: **N/A**
 Lubricant: **MOBIL SHC 639**

Sample Data & Trends

Sample Info	Report Status	Caution	Caution	Alert	Alert	Caution
	Sample ID	25295220232	25330281209	26004401263	26061630214	26124405281
	Service Level	Enhanced	Enhanced	Enhanced	Enhanced	Enhanced
	Bottle ID	b098269397	b105107407	b105106982	b093868315	b105154347
	Tested Lubricant	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639
	Sampled	16 Oct 2025	16 Nov 2025	16 Dec 2025	01 Feb 2026	26 Apr 2026
	Reported	23 Oct 2025	27 Nov 2025	05 Jan 2026	03 Mar 2026	05 May 2026
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Caution	Caution	Normal	Caution	Caution
	Equipment Rating	Normal	Normal	Normal	Normal	Normal
	Lubricant Rating	Caution	Caution	Alert	Alert	Caution
	PQ Index	18	15	23	17	25
	Visc@100C (cSt)	84.9	68.6	57.5	50.2	92.0
	TAN (mg KOH/g)	1.60	1.80	1.22	1.40	1.90
	Water (Vol%)	0.060	0.050	0.040	0.070	0.050
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	0	0	0	0	0
	Cr (Chromium)	0	0	0	0	0
	Cu (Copper)	0	7	0	1	26
	Fe (Iron)	0	7	6	13	10
	Mo (Molybdenum)	0	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	0	0	0	0	0
	Sn (Tin)	0	0	0	0	0
Contaminant (ppm)	K (Potassium)	0	2	0	0	2
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	1	45	11	10	0
Additive (ppm)	B (Boron)	0	41	22	10	19
	Ba (Barium)	1	0	0	0	0
	Ca (Calcium)	0	25	23	42	78
	Mg (Magnesium)	0	6	2	2	2
	P (Phosphorus)	443	456	306	388	799
	Zn (Zinc)	0	16	0	35	23

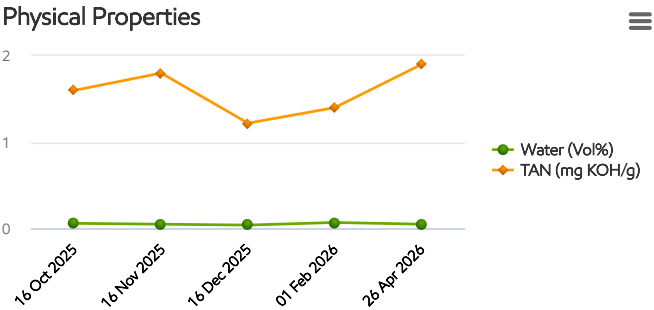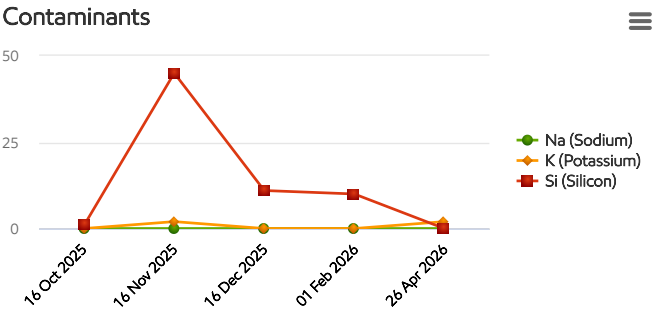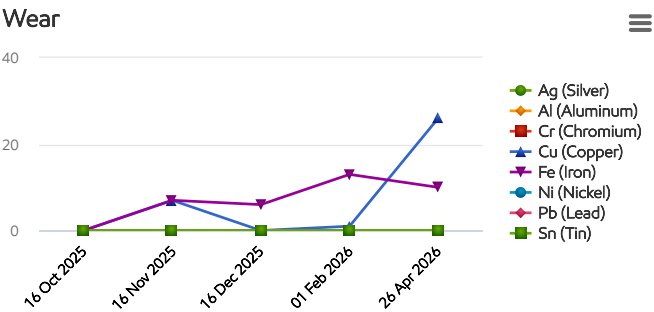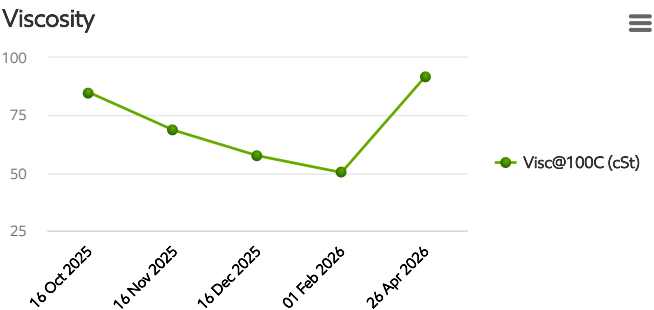

	Caution	
	Unit ID: R2.322.LQ120(T)	Asset ID: 40047887
	Description: Roller Lubrication Unit (Tank)	
Account Information	Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG	Sample ID: 26124405281 Service Level: Enhanced Bottle ID: b105154347 Tested Lubricant: MOBIL SHC 639	Asset Class: Circulating System Manufacturer: FLS Model: N/A Lubricant: MOBIL SHC 639
Recommendation/Comments		
ACTION REQUIRED - EXCESSIVE WATER CONTAMINATION. Determine source of water and take corrective action. Analyze the oil with an on-site water test if accessible. Potential sources of water include: a. Leaking seals; b. Condensation resulting from low operating temperatures or prolonged shutdowns; c. Compromised oil cooler; d. Direct exposure to atmosphere as a result of compromises to system components (i.e. improperly sealed tank fill access point. Remove water from oil using centrifuges or dehydration units, or drain the oil and recharge the system with new oil. Resample the system after corrective measures have been implemented. Contact your ExxonMobil representative for further assistance if necessary. ACTION REQUIRED - ELEVATED TAN. The Total Acid Number (TAN) of the sampled oil is above the Original Equipment Manufacturer (OEM) limits for this grade. Determine cause of elevated TAN and take corrective action. If the TAN is elevated for the first time with no history of an increasing trend, then resample immediately to confirm condition. Possible causes of an elevated TAN include: a. High oil temperature; b. Localized hot spots; c. Over-extended oil service life; d. Contamination with an oil that has a higher TAN; e. High rates of oxidation and nitration resulting in the formation of organic and inorganic acids. Contact your ExxonMobil representative for further assistance if necessary.		
Sample Timeline		
<u>26 Apr 2026 9:04 AM - Hassan Mostafa - In Service Oil Sample</u>: Comments: Photo:		