

Description: **Rotary feeder Gear Box**

Account Information

ID: 208948

Name: Reliance Heavy Industries

Address: Kattameya-Sokhna Road, Suez, 00000 EG

Sample Information

Sample ID: 26123350236

Service Level: **Enhanced**

Bottle ID: b108137721

Tested Lubricant: MOBIL SHC 639

Equipment Information

Asset Class: **Gear Drive**

Manufacturer: **FLENDER**


Model: Z108-M160L4

Lubricant: MOBIL SHC 639


Sample Data & Trends

Sample Info	Report Status	Alert	Alert	Alert	Alert	Caution
	Sample ID	25079203253	25112224249	25258159219	25294210228	26123350236
	Service Level	Enhanced	Enhanced	Enhanced	Enhanced	Enhanced
	Bottle ID	b087942221	b098245313	b098287949	b098288603	b108137721
	Tested Lubricant	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639	MOBIL SHC 639
	Sampled	09 Mar 2025	09 Apr 2025	10 Sep 2025	16 Oct 2025	26 Apr 2026
	Reported	24 Mar 2025	27 Apr 2025	17 Sep 2025	22 Oct 2025	04 May 2026
	Equipment Age					
	Oil Age					
	Make-up Volume					
	Oil Changed					
	Filter Changed					
Lubricant	Contamination Rating	Alert	Alert	Normal	Alert	Normal
	Equipment Rating	Alert	Caution	Normal	Normal	Normal
	Lubricant Rating	Normal	Normal	Alert	Alert	Caution
	PQ Index	125	63	6	5	12
	Visc@100C (cSt)	99.4	97.3	30.2	29.5	69.4
	TAN (mg KOH/g)	1.40	0.88	0.82	0.87	1.20
	Water (Vol%)	0.150	0.020	0.010	0.010	0.010
Wear (ppm)	Ag (Silver)	0	0	0	0	0
	Al (Aluminum)	39	7	6	4	0
	Cr (Chromium)	2	0	1	0	0
	Cu (Copper)	11	8	2	2	3
	Fe (Iron)	56	68	3	1	11
	Mo (Molybdenum)	2	0	0	0	0
	Ni (Nickel)	0	0	0	0	0
	Pb (Lead)	0	3	0	0	0
	Sn (Tin)	0	11	0	0	0
Contaminant (ppm)	K (Potassium)	0	3	0	0	0
	Na (Sodium)	0	0	0	0	0
	Si (Silicon)	57	48	14	53	6
Additive (ppm)	B (Boron)	41	17	10	0	0
	Ba (Barium)	0	0	0	0	0
	Ca (Calcium)	413	418	21	3	18
	Mg (Magnesium)	5	14	2	0	2
	P (Phosphorus)	449	584	741	541	662
	Zn (Zinc)	7	3	0	0	19


Viscosity

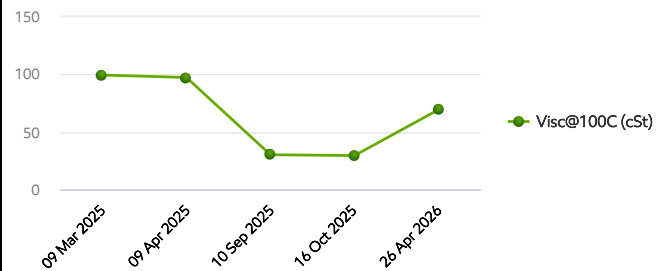


Wear

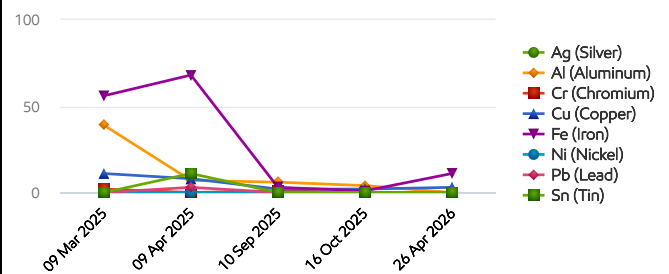

Contaminants

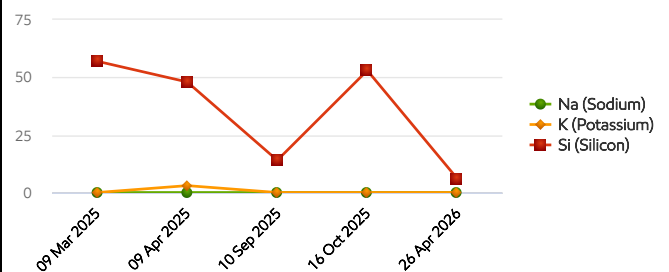

Physical Properties

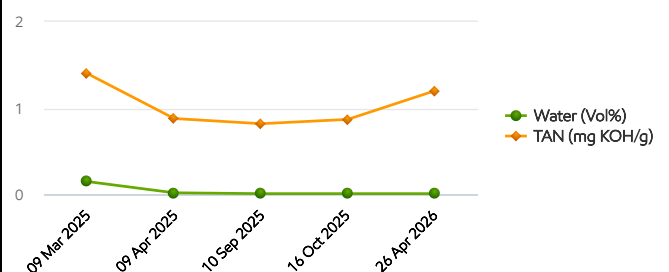

	Caution	
	Unit ID: R2.322.RF090	Asset ID: 40110631
	Description: Rotary feeder Gear Box	
Account Information	Sample Information	Equipment Information
ID: 208948 Name: Reliance Heavy Industries Address: Kattameya-Sokhna Road, Suez, 00000 EG	Sample ID: 26123350236 Service Level: Enhanced Bottle ID: b108137721 Tested Lubricant: MOBIL SHC 639	Asset Class: Gear Drive Manufacturer: FLENDER Model: Z108-M160L4 Lubricant: MOBIL SHC 639
Recommendation/Comments		
ACTION REQUIRED - REDUCED OIL VISCOSITY. Determine cause of reduced oil viscosity and take corrective action. Reduced viscosities can impair the lubricant's ability to protect the equipment. Possible causes of reduced viscosity include: a. Initial fill or contact with oil that has a lower viscosity; b. Contamination with a fuel or solvent; c. Incorrectly labeled sampled. Inspect the system for signs of fuel or coolant ingress. Resample the oil after corrective actions have been implemented. If the condition continues or escalates, recharge the system with new oil. Contact your ExxonMobil representative for further assistance if necessary.		
Sample Timeline		
<u>26 Apr 2026 9:06 AM - Hassan Mostafa - In Service Oil Sample</u>: Comments: Photo:		