

The Big

Request for Information (RFI)

Project:	The Big Business District	RFI No :	BD-CW-SAMCO-PCO-RFI-MECH-005
Owner:	ROYA Developments	Rev. :	R06
Project Manager:	ACE-PM	Date :	08 / 03 / 2026
Consultant:	Prime Consultant		
Contractor:	SAMCO National Construction		
To:	PCO		

Subject

Clarifications Required for Latest Infrastructure Package

With reference to the latest issued Infrastructure Package, we would like to request clarification on the following points to ensure proper coordination prior to execution.

1) Irrigation Line – Level & Location Confirmation:

As per the latest infrastructure package, an irrigation line is indicated; however, the exact level and location are not clearly defined. Additionally, it should be noted that this irrigation line was not included in the previously issued mechanical package.

Kindly confirm whether the currently indicated location is final and approved, or if it is subject to modification.

This clarification is required since the irrigation line location will directly affect the installation of the sleeves / puddle flanges through the water tank walls.

Therefore, confirming the final level and location is essential to proceed with the required penetrations and avoid any potential rework.

2) Firefighting Line from Pump Room – Diameter & Level Clarification:

As per the latest infrastructure package, a firefighting line with a diameter of 315 mm is shown exiting the pump room and passing outside the retaining wall.

However, the invert level of this line is not indicated in the drawings.

Additionally, this line was not shown in the previously issued mechanical package, where only one 150 mm line was indicated to serve Basement 1, Basement 2, and the buildings above.

Therefore, kindly clarify the following:

Confirm the required level of the 315 mm firefighting line.

Confirm whether this line represents a new addition or a revision to the previous design.

Confirm the exact location and requirements for the wall penetration.

This clarification is required as it will directly affect the sleeve size and location to be provided in the pump room wall.

3) Infrastructure Drainage Pipes – Invert Level Coordination:

Regarding the infrastructure drainage lines, it has been observed that the invert levels of some external manholes to which these pipes are intended to connect appear to be higher than the invert levels of the corresponding drainage pipes.

This condition may prevent proper gravity flow connection to the manholes.

Kindly review and clarify the correct invert levels and connection details.

This clarification is essential as it will directly affect the location and level of the sleeves required through the retaining wall.

4) Water Supply Line Filling the Tanks – Location & Level Confirmation:

Regarding the water supply line filling the two tanks from the infrastructure network, it has been observed that this line was 110 mm in the latest mechanical package.

However, in the infrastructure package, this line is indicated with a diameter of 200 mm.

Therefore, kindly confirm the exact location and level of this line and also the diameter of the 2 pipes filling the each tank to allow proper coordination and to determine the required sleeves through the retaining wall.

Attachments: Infrastructure drawings

For Contract



Signature: _____

Date: _____

Supervision Consultant Response:

Refer to the attached.

RE:

o sama waly

Signature: _____

Date:

5.4.2026

Project Manager Response (If required)

ACEPM:


Distribution

DATE: 5/11/2026

PCO

Signature: _____

Date: _____

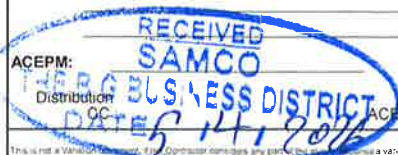

PCE REPLY

RFI : BIG.P2_ACE_RFI_ROYA_Required latest INFRA_Package_012_00

31) Irrigation Line – Level & Location Confirmation: As per the latest infrastructure package, an irrigation line is indicated; however, the exact level and location are not clearly defined. Additionally, it should be noted that this irrigation line was not included in the previously issued mechanical package. Kindly confirm whether the currently indicated location is final and approved, or if it is subject to modification. This clarification is required since the irrigation line location will directly affect the installation of the sleeves / puddle flanges through the water tank walls. Therefore, confirming the final level and location is essential to proceed with the required penetrations and avoid any potential rework.	- Kindly identify drawings number with related dates and issued. - Irrigation line 100mm is a branch from the domestic water pump set discharge header 150mm. - The contractor should be coordinate submitted pump room sleeves location with submitted infrastructure irrigation detailed design drawing through approved shop drawing by the site consultant Engineer. - Kindly coordinate shop drawing works with submitted utility corridor detail design drawing.
32) Firefighting Line from Pump Room – Diameter & Level Clarification: As per the latest infrastructure package, a firefighting line with a diameter of 315 mm is shown exiting the pump room and passing outside the retaining wall. However, the invert level of this line is not indicated in the drawings. Additionally, this line was not shown in the previously issued mechanical package, where only one 150 mm line was indicated to serve Basement 1, Basement 2, and the buildings above. Therefore, kindly clarify the following: Confirm the required level of the 315 mm firefighting line. Confirm whether this line represents a new addition or a revision to the previous design. Confirm the exact location and requirements for the wall penetration. This clarification is required as it will directly affect the sleeve size and location to be provided in the pump room wall.	- Kindly identify drawings number with related dates and issued. - Firefighting line 315mm is the main from the firefighting water pump set discharge header 250mm. - The contractor should be coordinate submitted pump room sleeves location with submitted firefighting detailed design drawing through approved shop drawing by the site consultant Engineer. - Kindly coordinate shop drawing works with submitted utility corridor detail design drawing.
33) Infrastructure Drainage Pipes – Invert Level Coordination: Regarding the infrastructure drainage lines, it has been observed that the invert levels of some external manholes to which these pipes are intended to connect appear to be higher than the invert levels of the corresponding drainage pipes. This condition may prevent proper gravity flow connection to the manholes. Kindly review and clarify the correct invert levels and connection details. This clarification is essential as it will directly affect the location and level of the sleeves required through the retaining wall.	- Kindly identify drawings number with related dates and issued. - The contractor should be coordinate submitted infrastructure drainage with submitted mechanical buildings last issued design drawing through approved shop drawing by the site consultant Engineer. - Kindly coordinate shop drawing works with submitted utility corridor detail design drawing.
4) Water Supply Line Filling the Tanks – Location & Level Confirmation: Regarding the water supply line filling the two tanks from the infrastructure network, it has been observed that this line was 110 mm in the latest mechanical package. However, in the infrastructure package, this line is indicated with a diameter of 200 mm. Therefore, kindly confirm the exact location and level of this line and also the diameter of the 2 pipes filling the each tank to allow proper coordination and to determine the required sleeves through the retaining wall.	- Kindly identify drawings number with related dates and issued. - The contractor should be coordinate submitted infrastructure water supply with submitted mechanical buildings last issued design drawing through approved shop drawing by the site consultant Engineer. - Infrastructure main filling line 200mm Parcel 2 tanks with branches at each inlet tanks 100mm - Kindly coordinate shop drawing works with submitted utility corridor detail design drawing.

Ahmed Amin

From: Mohamed Esmat
Sent: Tuesday, March 17, 2026 12:15 PM
To: Mostafa Galal
Cc: Islam Adel; George Farouk; Design; Mostafa Sadek; Mohamed Hamza
Subject: The Big - MEP Openings Status For Pump Room and Basement

Follow Up Flag: Follow up
Flag Status: Flagged

Dear Eng. Mostafa,
Hope this mail finds you well.

Please note that all MEP openings in the project will be divided into three main categories as follows:

1. From the tank to the pump room

These openings will be executed using puddle flanges, as previously submitted on 06/11/2025 by email, including all required technical details.

2. From the pump room to the basement level

These openings will be created after the completion of the structural works by special MEP contractor after submitted coordinated drawings .

3. From the basement level to the infrastructure connection works

These openings will be created after the completion of the structural works by special MEP contractor after submitted coordinated drawings .

Best Regards,
Mohamed Essmat
Mechanical Associate Design Manager



Tel: + (202) 226 845 00
EXT: 3207
Mobile: 01220001885
Email: mohamed.esmat@royadevelopments.com
1150/3 Entidad Abd Elhameed Badawy st. Sheraton



PARCEL 1

PARCEL 2

PARCEL 3


FROM WATER TANK
HI BELOW

EXT

ENT





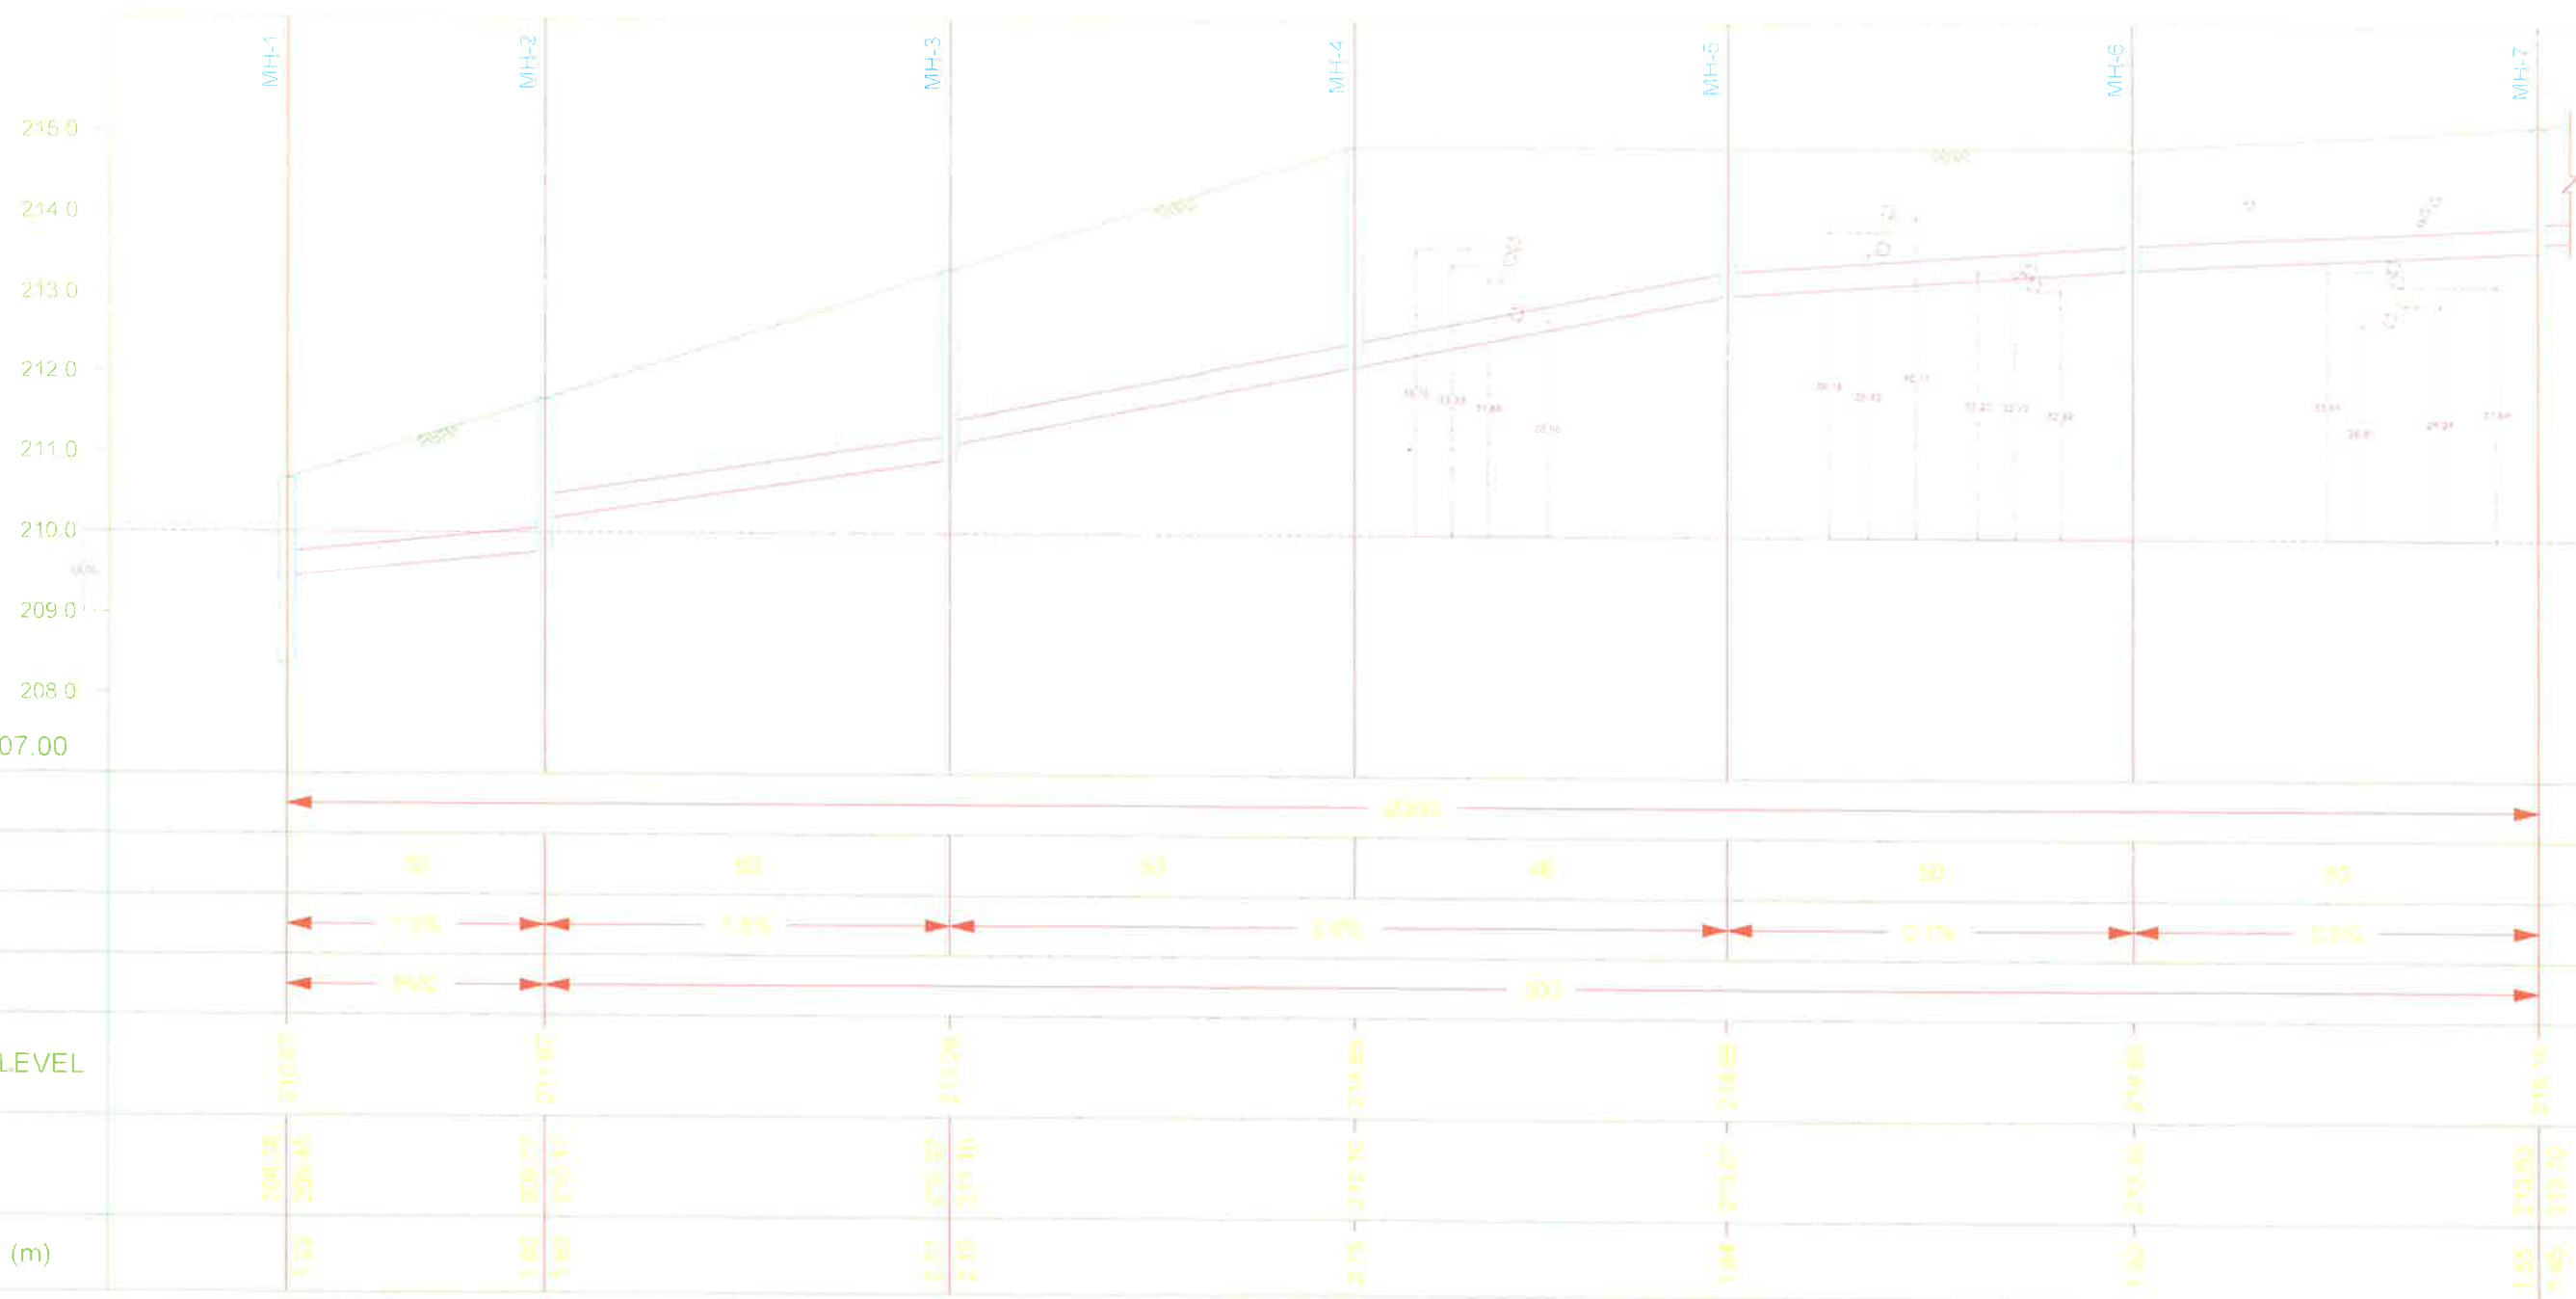

LINE 1 (PART 1/3)

