
HQ and branch failover validation

Production network / 3 branches and headquarters

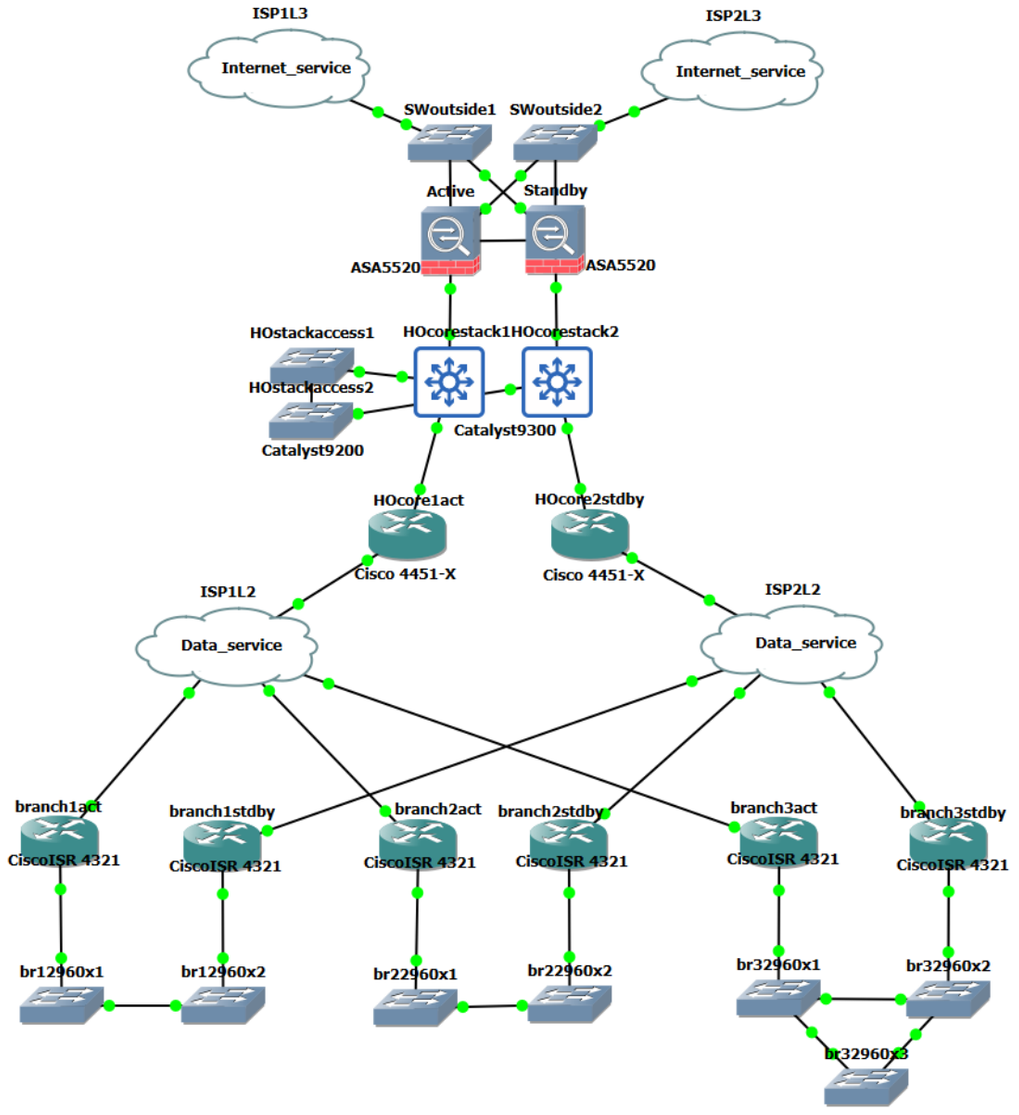

Reported test results / 6 of 6 passed

Branch primary data circuit — PASS

The primary branch path failed. IP SLA tracking triggered HSRP failover, and EIGRP selected the backup IPsec tunnel for return traffic from HQ.

Active branch router — PASS

The active ISR 4321 failed. Its peer took over the HSRP virtual gateway and restored branch-to-HQ connectivity.

Active HQ router — PASS

The active ISR 4451-X failed. Its peer took over the HSRP gateways for HQ users and the ASA pair, restoring reachability to the branches.

HQ core stack member — PASS

A simulated failure of Catalyst 9300 stack member 1 brought down the active ASA's inside link. ASA interface monitoring detected the link loss and triggered automatic failover. The standby ASA connected to stack member 2 became active and resumed forwarding HQ Internet traffic.

Active HQ firewall — PASS

The active ASA 5520 failed. The standby firewall became active and restored Internet access.

Primary Internet provider — PASS

The primary HQ Internet service (ISP1L3) failed. Internet traffic switched to the secondary provider (ISP2L3).