

Greensmith's Classic & Custom

Est 2010

Vehicle Report

Year: 1958

Make: Austin

Model A35

Date of inspection: 20.04.2026

Location: SP6 1QW

Vehicle Details

Registration Number: 360 HPB

Date of first registration: 9th of November 1958

Chassis No: 5283

Engine Number: 9-U-H 155283

Colour: Black

Mileage: 16175

Fuel Type: Petrol

*Number of previous owners: 1 recorded since 4th of October 1982,
unfortunately there are no records before this.*

MOT Expiry: No current MOT

I cannot confirm both the chassis and engine numbers match the V5c document as the owner couldn't find the V5. However they do match the HPI check

Vehicle Overview

Overall the car is in excellent condition, it has been restored to a high standard and doesn't require any immediate work to use or take to shows etc. It is a great example of an A35 with only very minor defects. One slight oil leak (far less than most) and two small areas of damage to the otherwise immaculate bodywork.


MOT History - None

Engine - 948cc

The engine starts and runs very well with 165-170psi of compression across all cylinders which is perfect. The engine was warm when I arrived, so I was unable to see how the car started from stone cold. The owner said he briefly started it to make sure there was fuel in the carburettor. It did however start and run very well, the large battery along with the starter motor turn the engine over, what I would say is faster than normal. The owner also advised it benefits from an unleaded head conversion and a stainless steel exhaust. The oil was clean and up to the correct level with no obvious leaks. The oil filter seal did look to be slightly pinched but it wasn't leaking

Please see pictures below of the compression test carried out before the car was taken on a test drive.


Cylinder 1 Compression test result

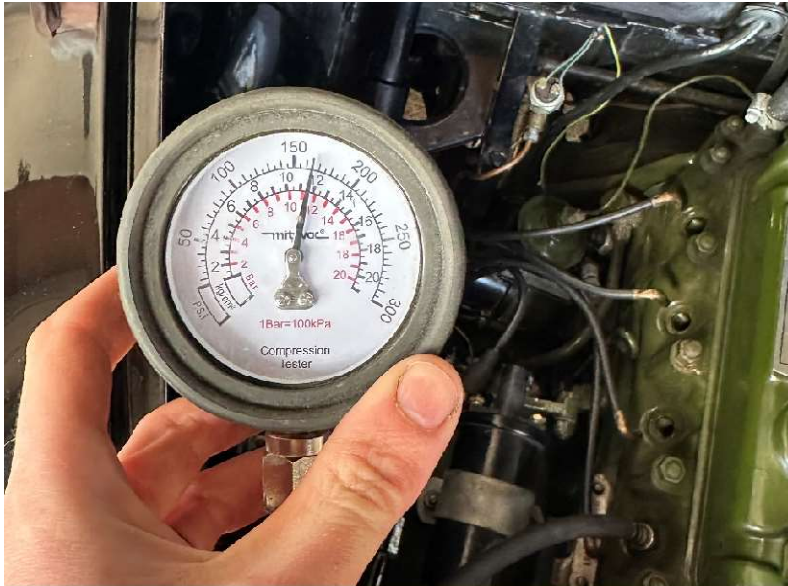


Cylinder 2 Compression test result



Cylinder 3 Compression test result

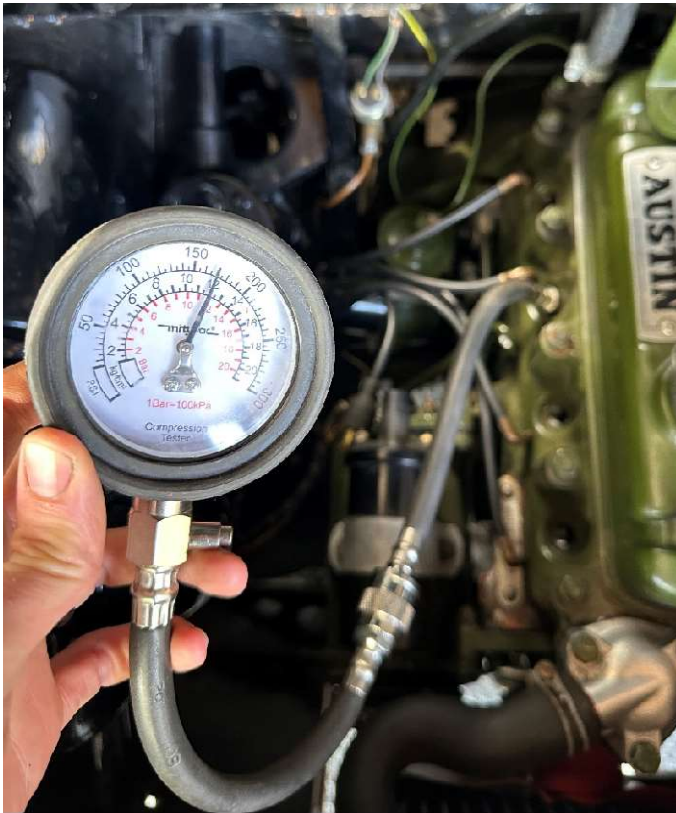

Cylinder 4 Compression test result

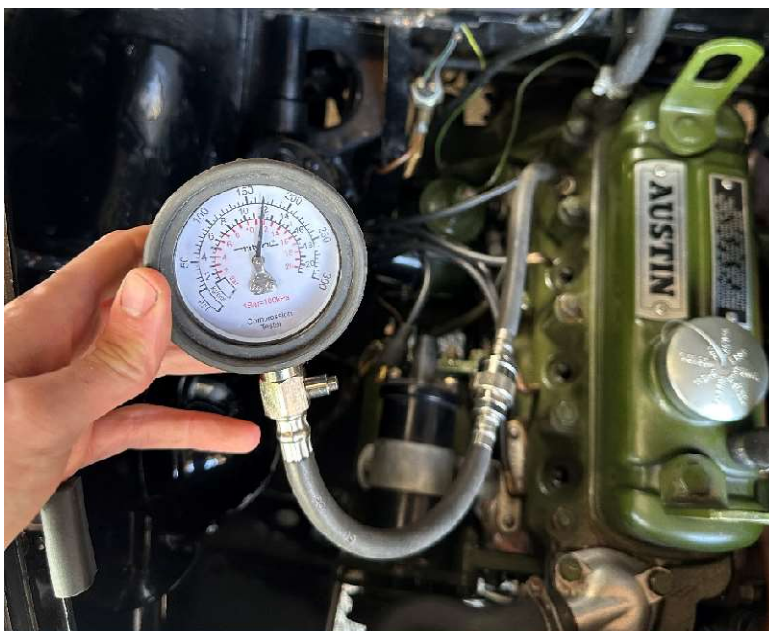

Gearbox

The gearbox, as with the rest of the car was in excellent condition with no leaks, new mounts and works as it should. All gears engaged smoothly, no crunching or whining at high speed. The clutch also worked very well.

Brakes:

All brakes are in good condition with no binding or noises. They worked very effectively in an emergency stop situation and did not pull the car one way or another. No squeaking, excessive heat and they operated smoothly.

Front Suspension and Steering:

The front suspension is in great order with no play, knocks or bangs while driving. The steering had a small amount of play which I believe is the steering box. This is fairly normal on a steering box set up. The steering box arm ball joint gaiter was ever so slightly perished and the steering box itself appeared to have a minor leak.



Rear Suspension and Axle:

The rear suspension and axle were also in great condition, with no leaks or corrosion. The differential had no excessive play and was quiet and smooth on a test drive. The only play I found was a small amount in the rear prop shaft universal joint. However this was minimal and shouldn't require immediate replacement.





Rust/Corrosion

There is no rust or corrosion on any part of the vehicle, all rust was repaired during the restoration and as per the invoice attached it was seam sealed and under sealed in 2012, then kept in a warm carpeted garage. There are only two bolts with any form of corrosion on them in the picture below, otherwise there is no corrosion anywhere!



Exterior, Bodywork, Paint and Trim

Overall the bodywork, chrome and trim are all in excellent condition. With the exception of the minor defects listed below. The paintwork overall was very good indeed and the chrome had no pitting, damage or imperfections of any kind.

- A dent/crease in the nearside rear quarter panel, just above the rear wheel*

- *two marks on the rear boot lid*
- *Some 'orange peel' on the front valance,*
- *Some minor scuffs that would buff out on top of offside front wing*
- *The corner of front windscreen seal starting to perish*

Approximately 3-4 inch long crease/dent in nearside rear quarter panel.



Two marks on top of bootlid



Light scuff marks on top of offside front wing



Slight perishing to offside lower corner of windscreen seal



Interior

The interior is in excellent condition with no rips, tears or damage and was restored in 2012. All the seats were firm with no sagging or foam disintegrating underneath.



Electrical

All electrical items worked very well, a new cloth braided loom looks to have been fitted when the car was restored and has not been modified or adapted. I am confident the car won't have any electrical issues in the near future.

Wheels and Tyres

The wheels and tyres are in excellent condition with no defects, buckles or corrosion. The tyres are dated 2011 so they are now 15 years old, however there is no signs of perishing and they all have excellent tread.

Tread Depth

FR: 5mm - Double checked this reading in several areas

FL: 7mm

RR: 7mm

RL: 7mm

NOTES:

- No logbook present so I could not confirm if the chassis and engine numbers match, also needed to transfer ownership
- Limited paperwork/receipts, although there is a folder of paperwork with the car it is all insurance and tax documents. There are a few invoices for previous work. Notably one for a new windscreen in 2016 and for seam sealing and underseal in 2012 for £3569.84
- The vehicle was warm I arrived so unable to start from stone cold
- Stainless Steel exhaust fitted
- Unleaded head fitted
- 3-point inertia reel seat belts fitted

Faults and suggested work

- Speedo overreads, when travelling at 30mph the speedo reads 60mph. The owners says this is just a speedo cable and has a replacement he will include with the car. I would suggest the speedo may need an overhaul/calibration as the cable only drives the speedo and should only need replacing if it seizes or snaps. Overhauling a speedo is usually around £300
- Two small marks on the offside of the boot lid and a dent in the nearside rear wing - to fix and respray the rear quarter panel and boot lid would be around £1200 at the same time a body shop should be able to sort the orange peel effect on the front valance
- Slight play in steering box - this is fairly normal
- Slight play in rear prop shaft UJ - this just needs monitoring and doesn't justify replacement just yet - replacement would be around £100
- Drips of oil on offside chassis leg, looks to be coming from the steering box

- *When driving the steering wheel isn't straight so will need removing and straightening and/or the tracking doing - this would be around £100 to fix*

HPI Check

The below HPI check confirms the car has never been written off or stolen. It also confirms the registered chassis and engine numbers. As it's a classic car and hasn't ever been MOT'd it can't show any other useful information.

AUSTIN

A35 (1958)

360 HPB

critical checks

not reported stolen

no record of write off

no record of import/export

at least 40yrs old

registered 1958

valid road tax found

346 days remaining due 1st Apr 2027

verify vehicle

previous ownership

Recorded previous keepers	1
Current keeper start	4th Oct 1982
Previous dispose	Not Available
Previous acquire	8th Nov 1958

Make sure to compare the last change details against the V5C before agreeing to buy this vehicle

vehicle identification number

VIN Last 4 Digits	5283
-------------------	------

Make sure to check that the VIN shown here matches the actual vehicle before agreeing to buy this vehicle.

engine number

Number	9UH155283
--------	-----------

Make sure to check this matches the actual vehicle before agreeing to buy this vehicle

plate changes

No plate transfers are recorded for this vehicle.

colour changes

No colour changes are recorded for this vehicle.

recorded use

mileage record

There are no mileages recorded in the data for this vehicle.

MOT status & history

MOT Status	No Status Found: vehicles over 40yrs old may not require an MOT
------------	---

Additional Pictures







FIRSTGLASS AUTOMOTIVE GLASS
UNIT 28, CHAMBERLAIN ROAD

www.first

01202

SPECIALIST BODY REPAIR
AND PAINTWORK

BODY ALIGNMENT
JIG SPECIALISTS

LOW DAKO OVEN

COLLECTION DELIVERY
SERVICE

BODYCARE ACCIDENT REPAIR CENTRE LTD.

Unit 5, Brook Park, 27 Brook Road,
Wimbome, Dorset, BH21 2BH
Tel: (01202) 887727 Fax: (01202) 840804



ALL INSURANCE REPAIR
UNDER TAKEN
24 HOUR RECOVERY SERVICE

VAT Number: 124 4973 10

Invoice Address		Vehicle Details		Customer Details	
Name	5721 Mr Bennett	Reg no	A3E	Name	Mr Bennett
Address	1 Kerry Gardens Sandle Heath Fordingbridge Hampshire SP6 1QW	Booked in date	11/03/2012	Address	1 Kerry Gardens Sandle Heath Fordingbridge Hampshire SP6 1QW
Policy Number		Registered by	31/12/2009	Order No	
Inspection Date		Make	OTHER	Ins Co	N/A
Claim Reference		Model	AUSTIN AYS		
		Version	1		
		Paint Code/Colour	BLACK		
		Taxi			
		Chassis/Vin no			
		Engine Number			

Estimate number 9627

Invoice Date 10/10/2012 Body Shop Invoice 14491

Qty	Part Number	Description	Unit	Disc	Ext'd price	Vat
1		SEAM SEALER	9.25	0.00%	9.25	1.85
1		SINGLE PACK STONE CHIP	11.50	0.00%	11.50	2.30
6		SCHULIZ	4.02	0.00%	24.12	4.82
10		3M 2 PACK SPRAY SEALER	16.00	0.00%	160.00	32.00
Parts Total					204.87	40.97
Labour Per Estimate					2,220.00	444.00
Paint and Sundries					550.00	110.00
Specialist Charges					0.00	0.00
Wash/And Corrosion					0.00	0.00
Less Overall discount			0.00%	(0.00)	(0.00)	
Invoice Sub Total					2,974.87	594.97
Less: Owner Contribution					(0.00)	(0.00)
Insured Excess					(0.00)	(0.00)
VAT Charge to Owner						
Total Amount Due					2,974.87	594.97
						3,569.84

To repair as per estimate, minus specialist costs for steam
cleaning/sand blasting, plus extra labour as discussed.

Payment Terms

Immediate by return
We reserve the right to claim statutory interest at 8% over
base rate at the date the debt becomes overdue
This is in accordance with Late Payment of Commercial
Debts (Interest) Act 1998.

Rec'd with sheet
C. Jones

parts on supplementary estimate

Register in England No: 07353706 Address: 2 Commarket Court, Wimbome, Dorset, BH21 1JL



