

Printer Dover

Spruce version 11.2 -- spooler version 11.2

File: BaseBd-mwRev-Bd.sil etc.

Creation date: 29-Apr-81 13:25:43

For: Spruce

17 total sheets = 16 pages, 1 copy.

Problems encountered:

Font HELVETICA24B substituted for font HELVE24.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.

Character code 157b not found in font Gates32.







DORADO SCHEMATICS




Base Board




Table of contents




<u>TITLE</u>	<u>Page</u>
Microcomputer and EPROMS _____	01
RAM, Timers and I/O pins _____	02
CP Bus & Mux and RCPBus _____	03
Muffler and Manifold _____	04
Alto Control Bus Receivers _____	05
Alto Control Bus Drivers _____	06
CP Bus handoff and Watchdog Timer _____	07
Clk Generator Ref. & Freq Comp _____	08
Clk Generator Loop Filter and VCO _____	09
Clk Generator & Backpanel Distributor _____	10
DAC and Current/Voltage Sensing _____	11
Temp Sense, PwrOn, & LED Ckts _____	12
Additional EPROMS & 7 Wire Interface _____	13
Layout _____	14
Loading Information _____	15



BASIC Ram covers [U , 1FF]

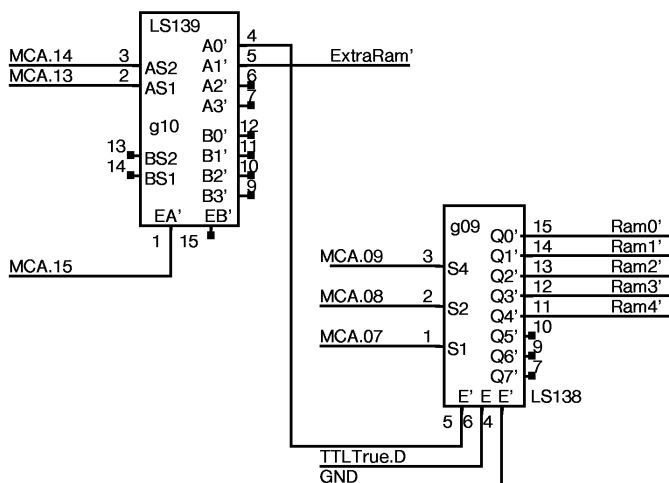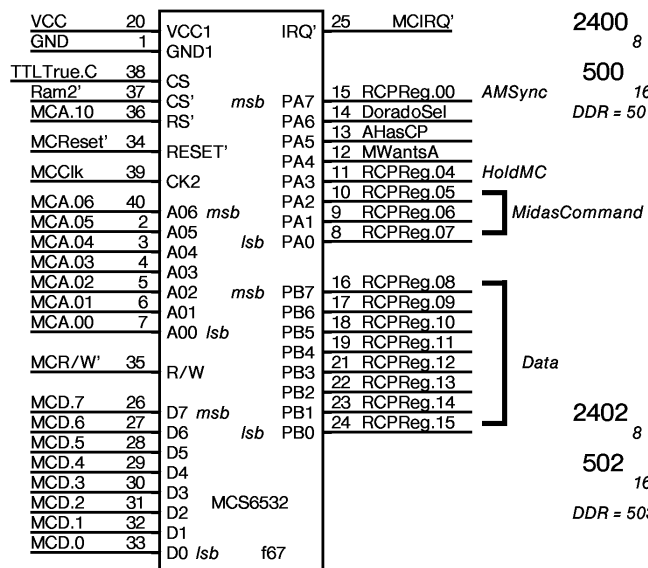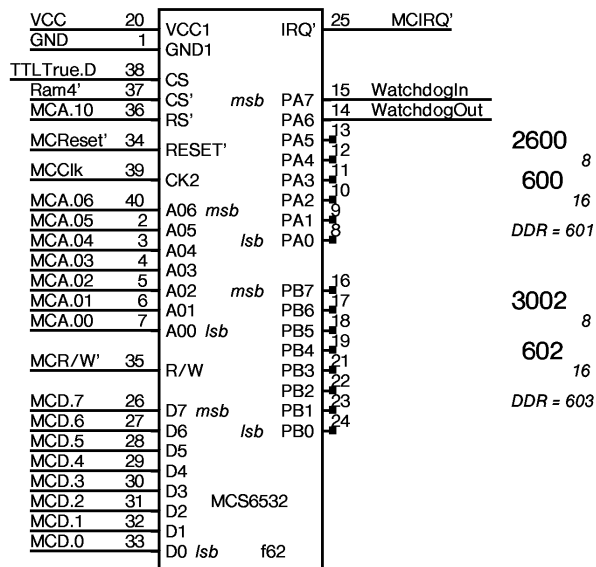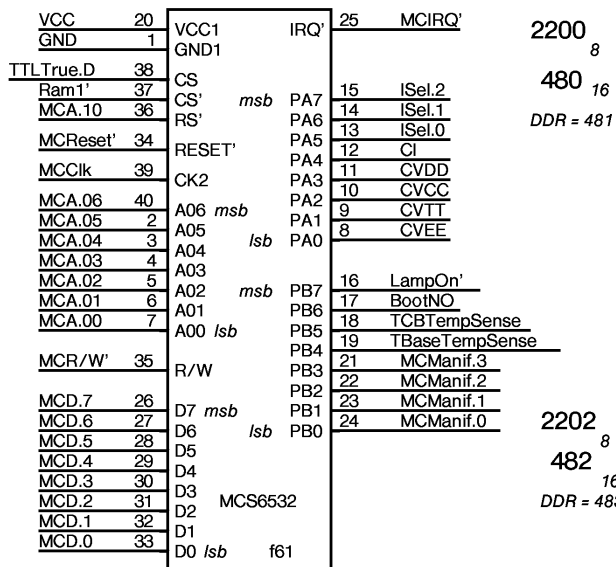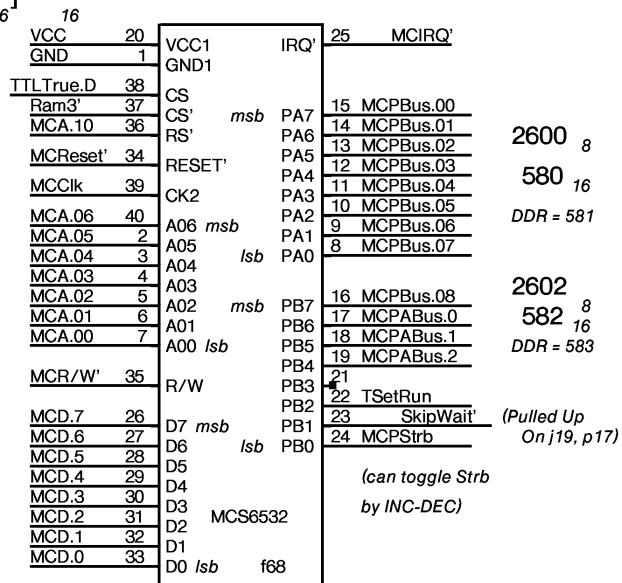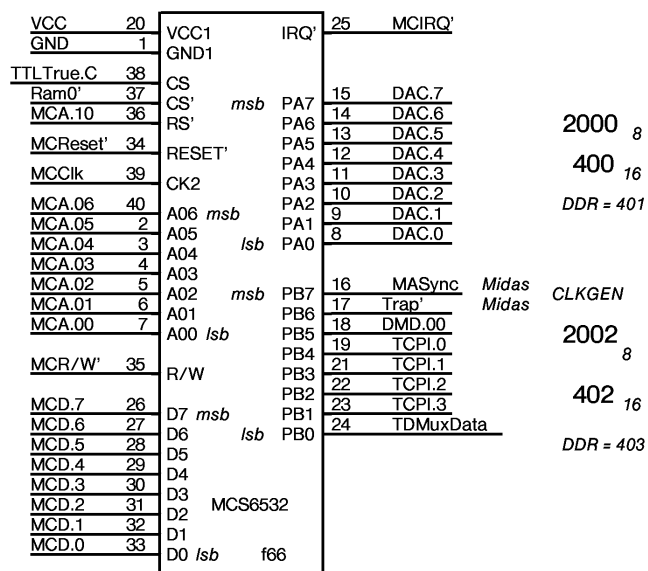

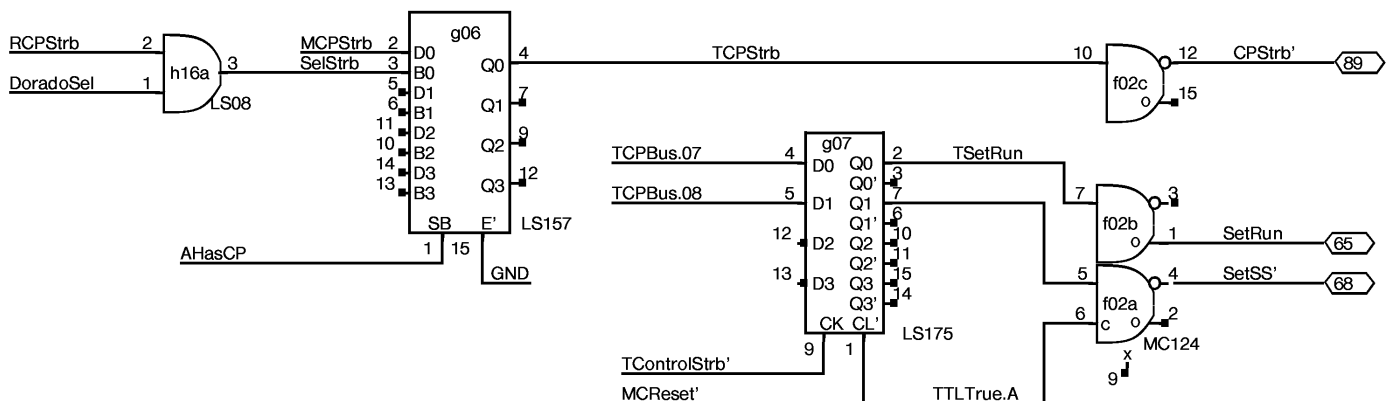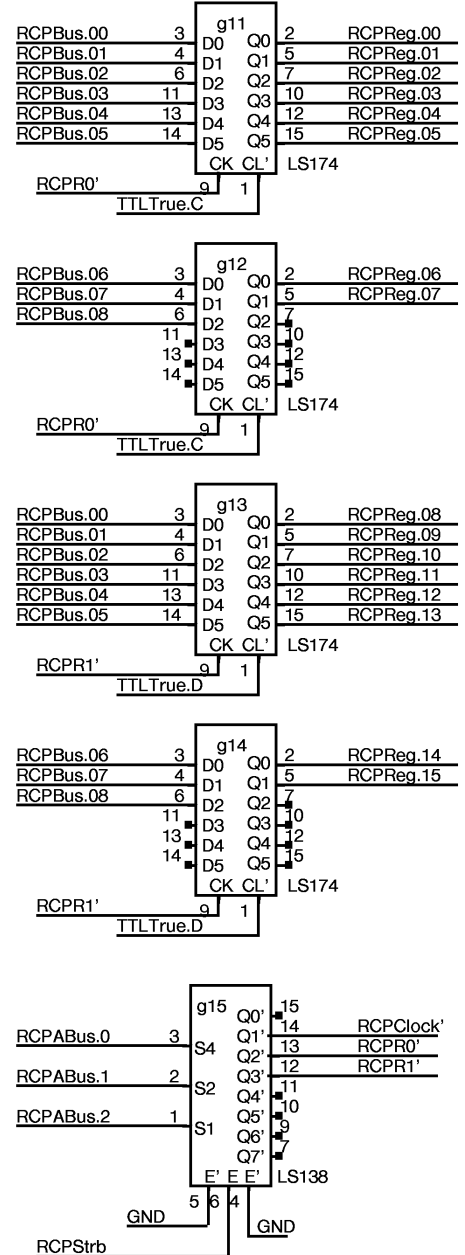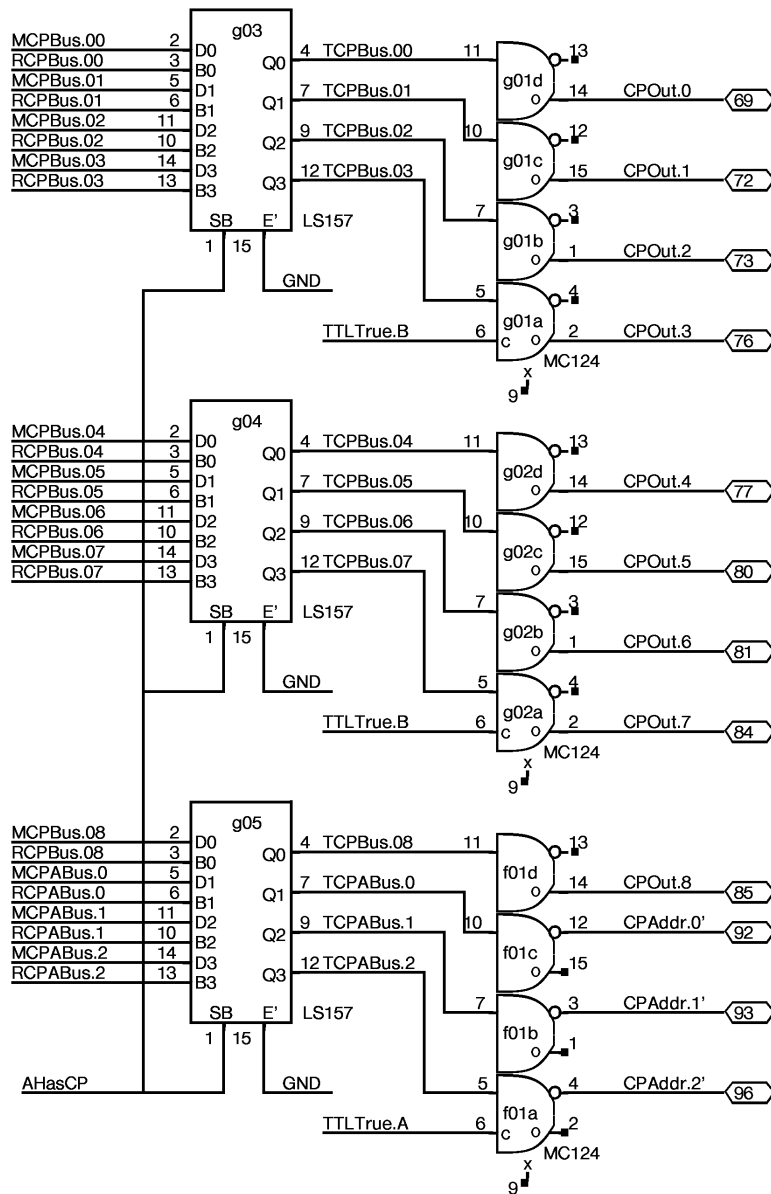

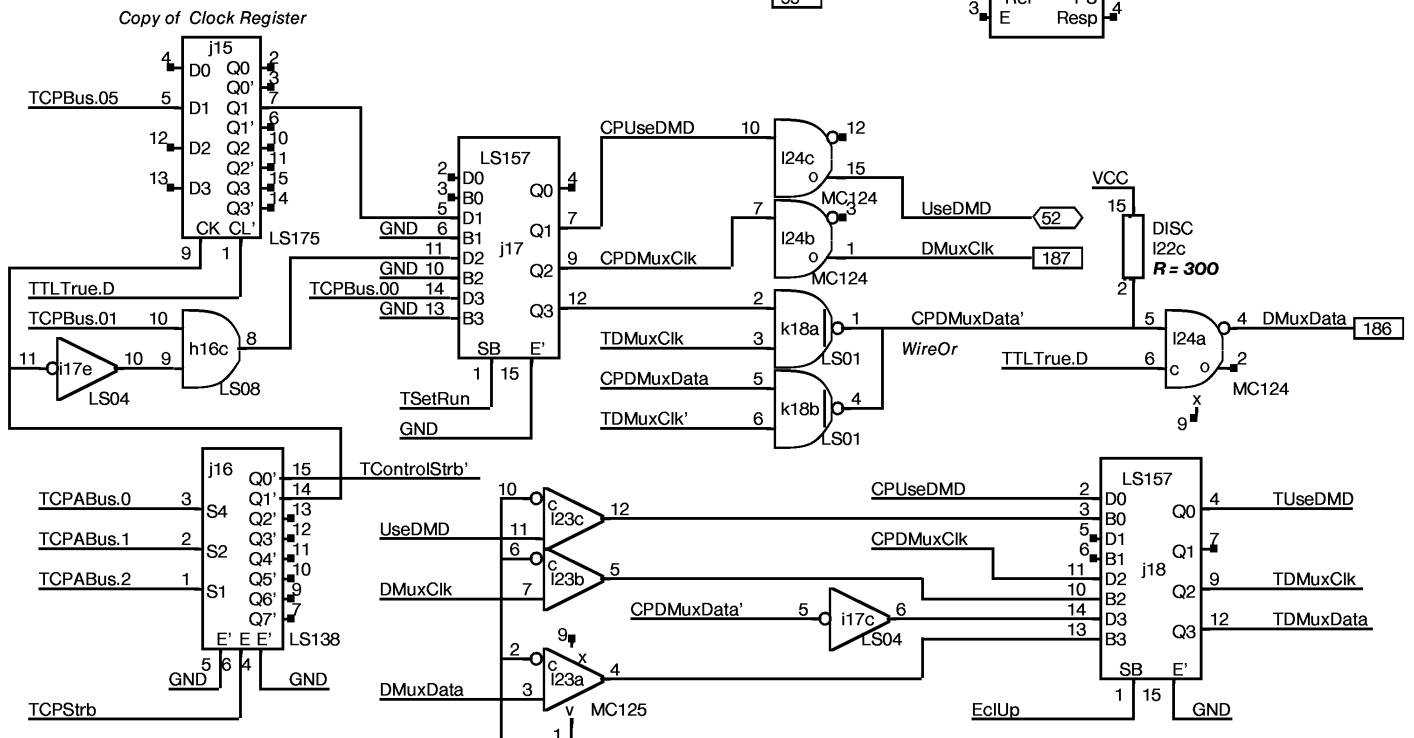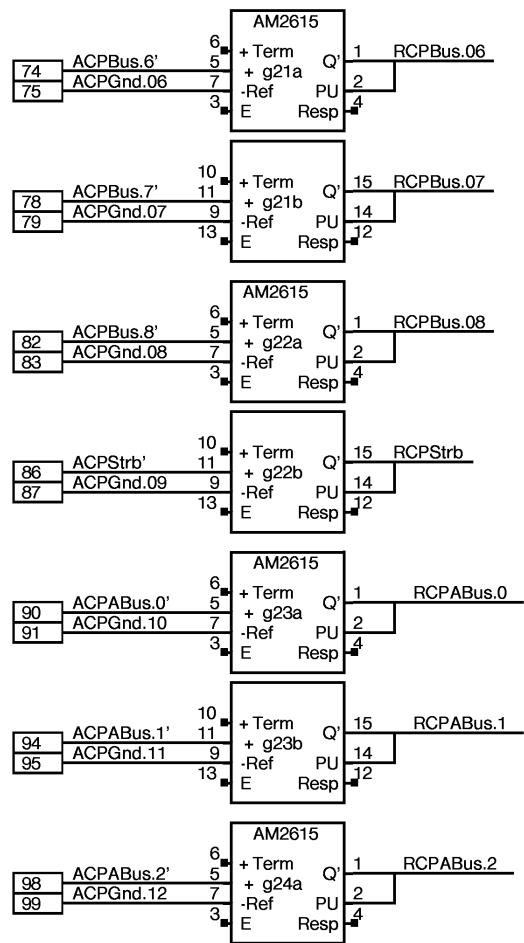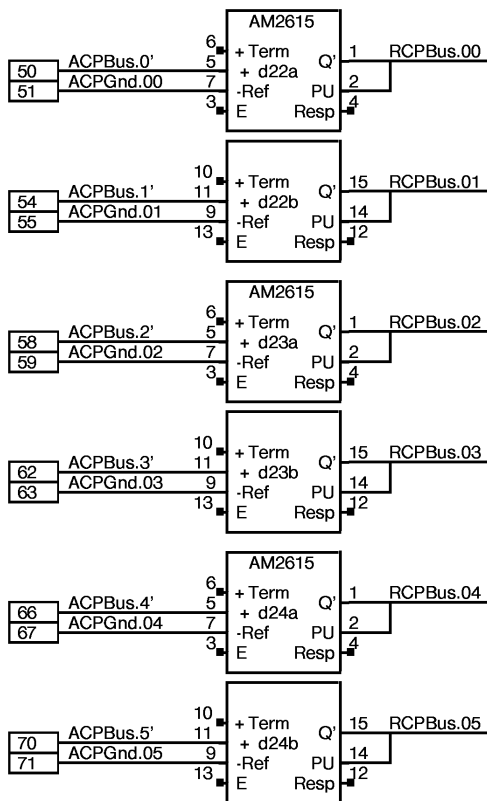


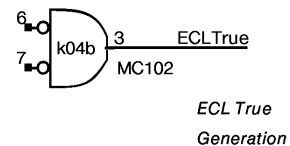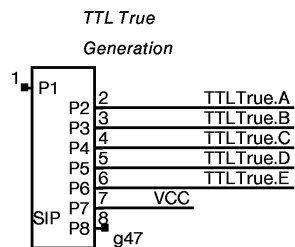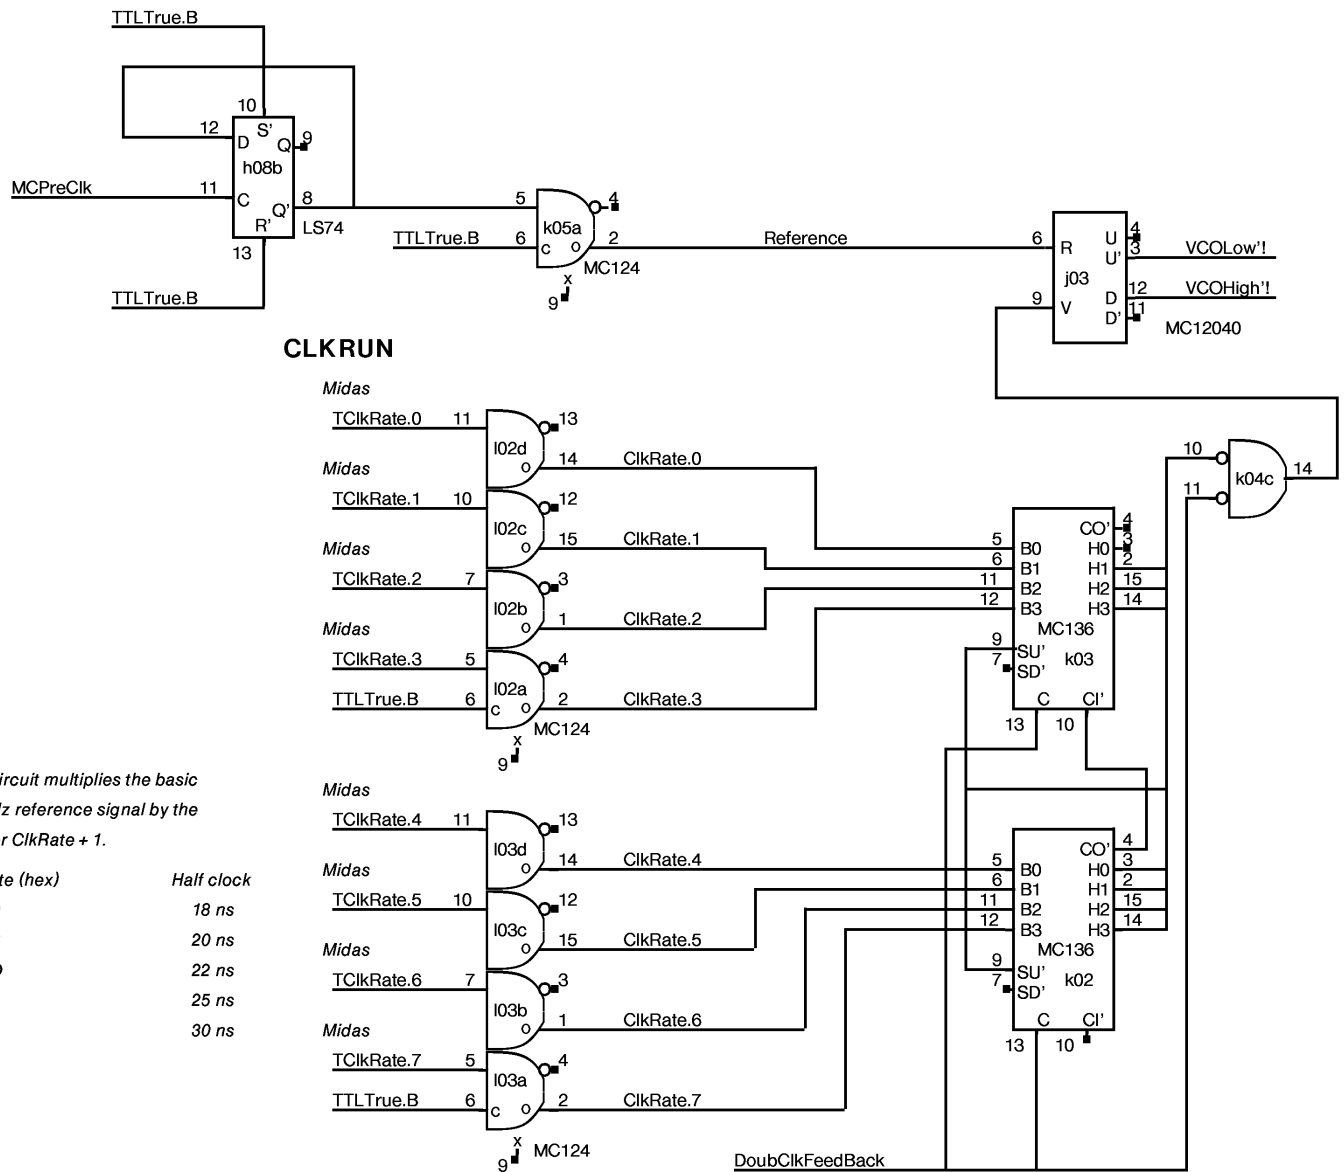

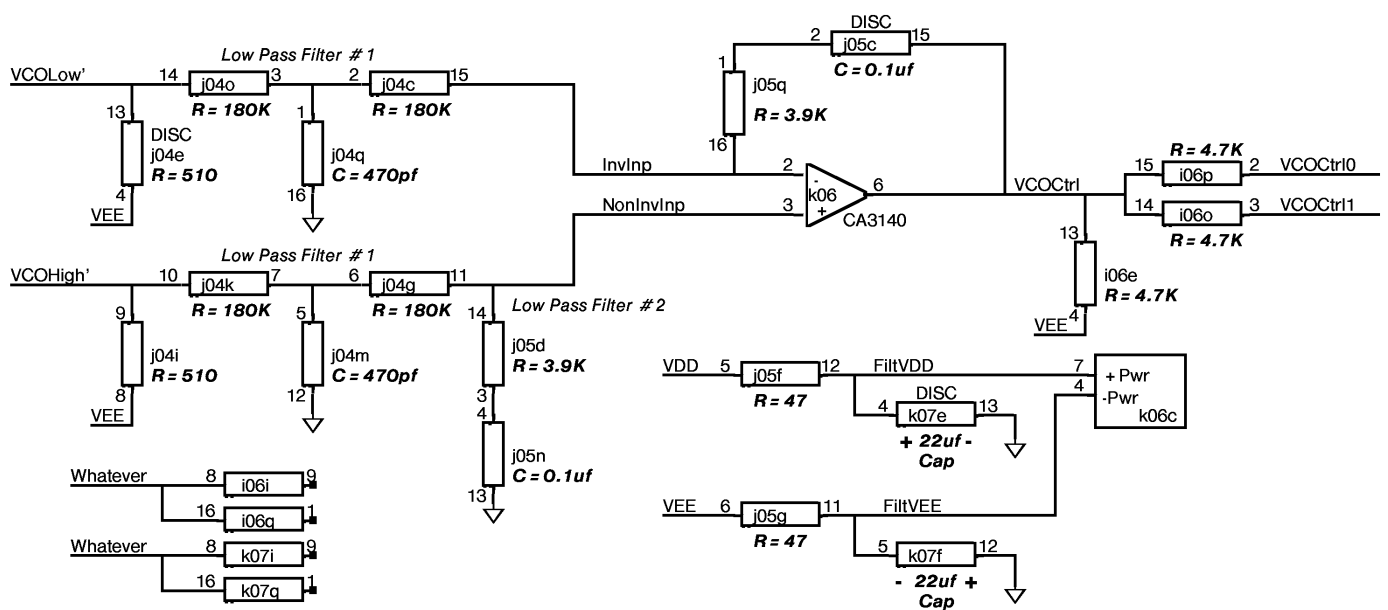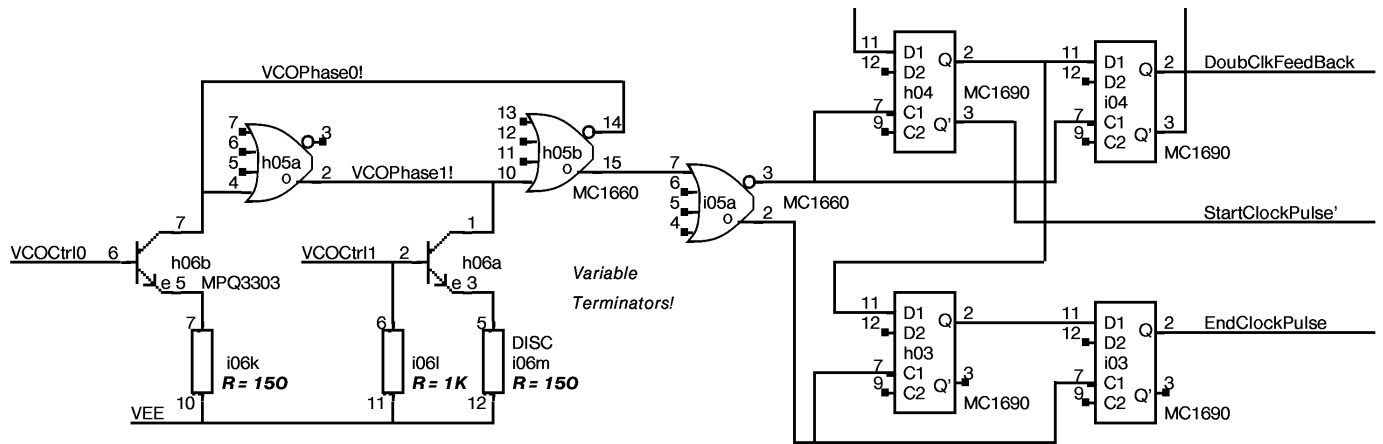


Loop Filter and System VCO


Power On Reset
Power Good at 4.5V

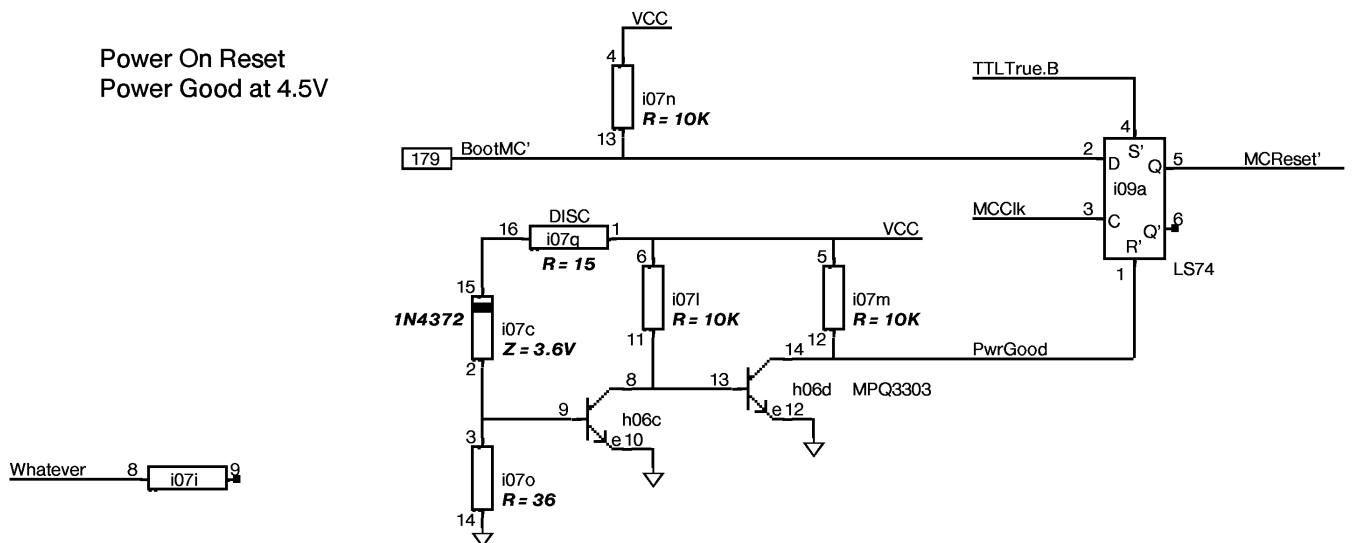




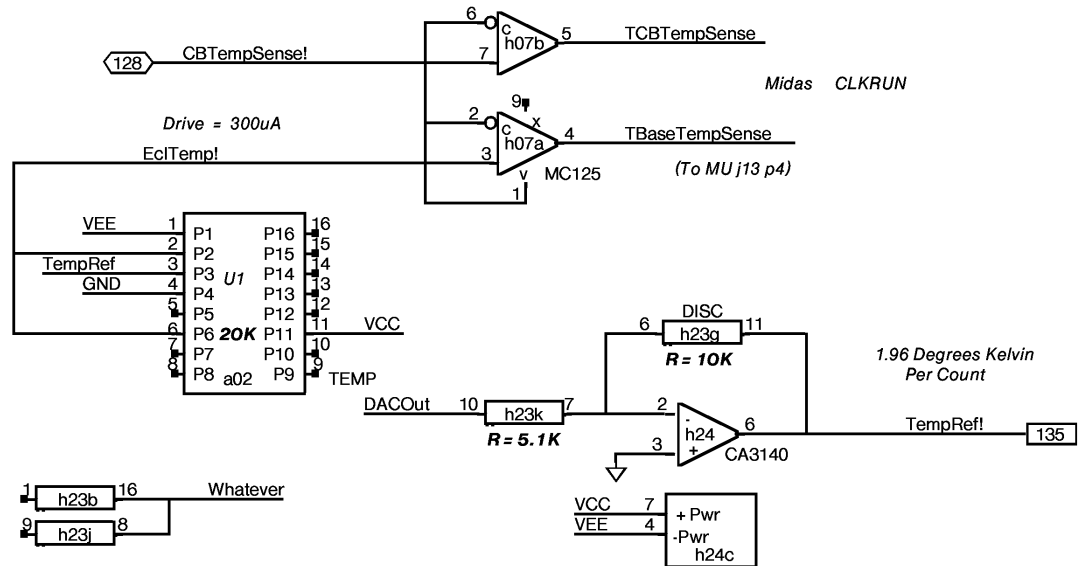


LED FLASH Decoder	
Lite always ON - BOOTED	
1	Normal Wait
2	Unable to Boot Dorado
3	Transient Power Problem
4	Current (NOW) Power Problem
5	Microcomputer Shutdown
6	Over Temperature
7	Microcomputer unable to get control of CP Bus to do its duties
NO LITE - Microcomputer is LOST or all power is OFF.	

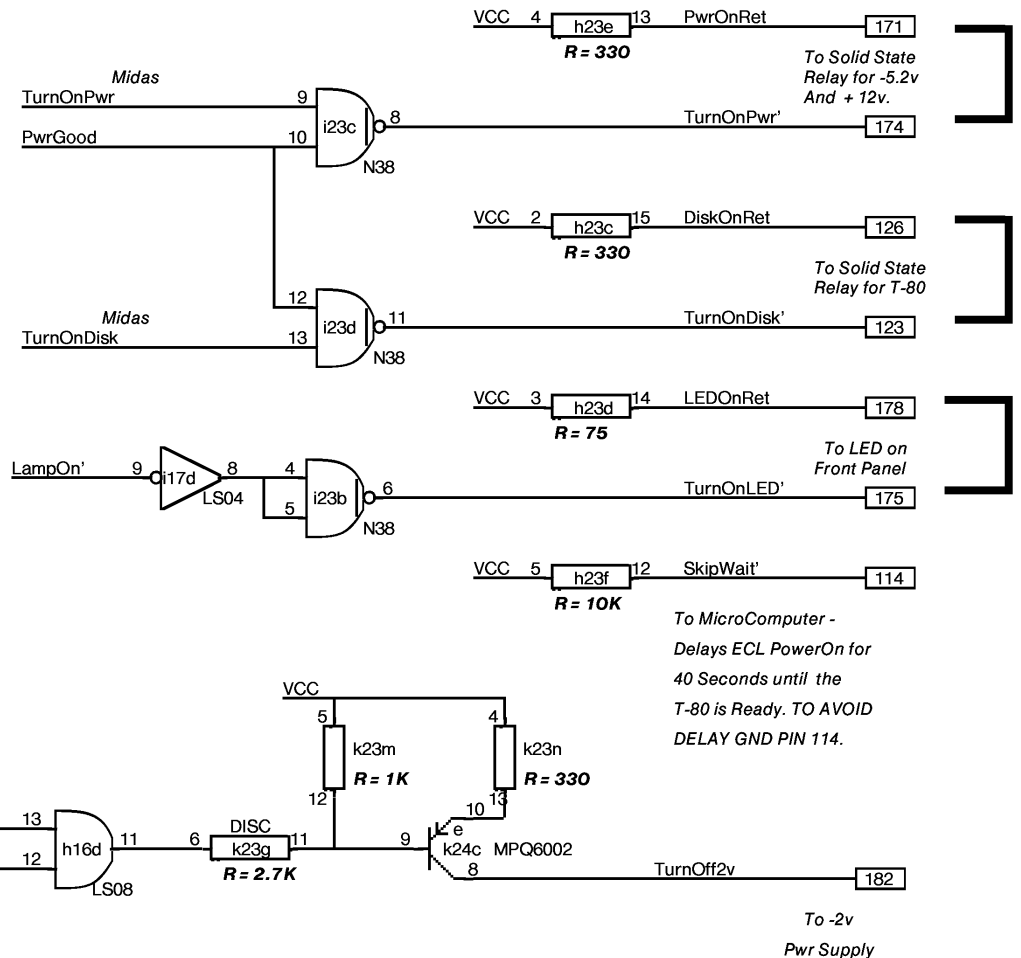


For Future Baseboard Ethernet

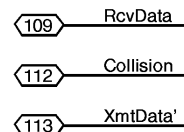

expansion EPROMS

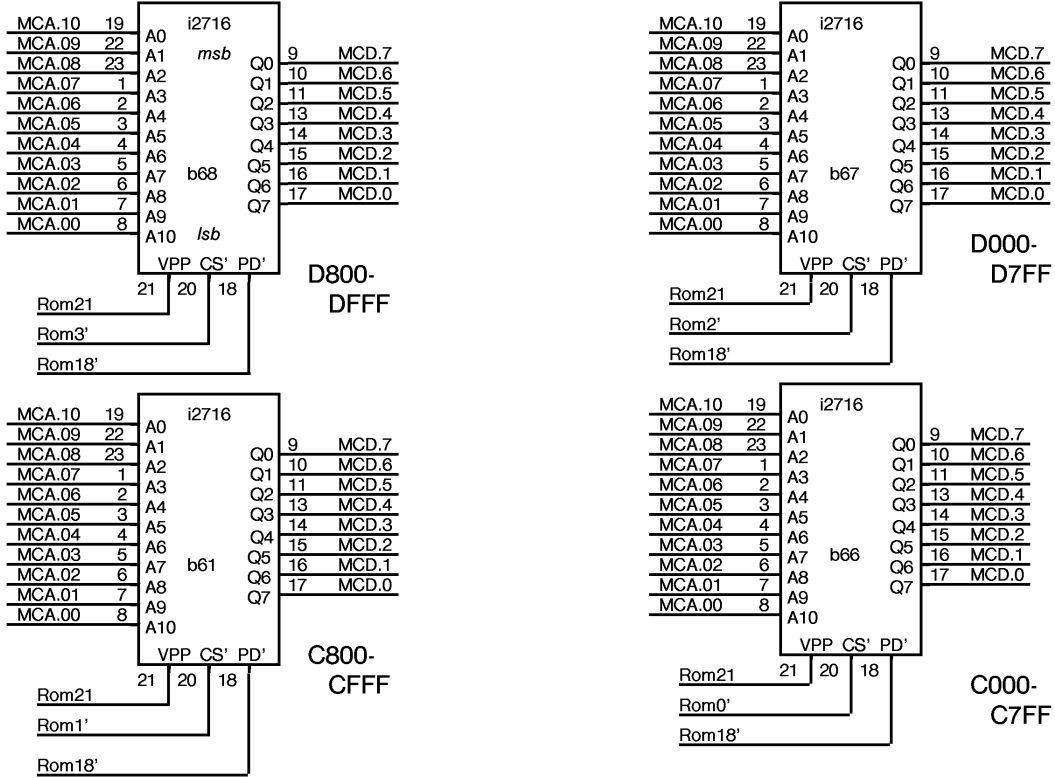


Differential Receivers for 7 wire Interface

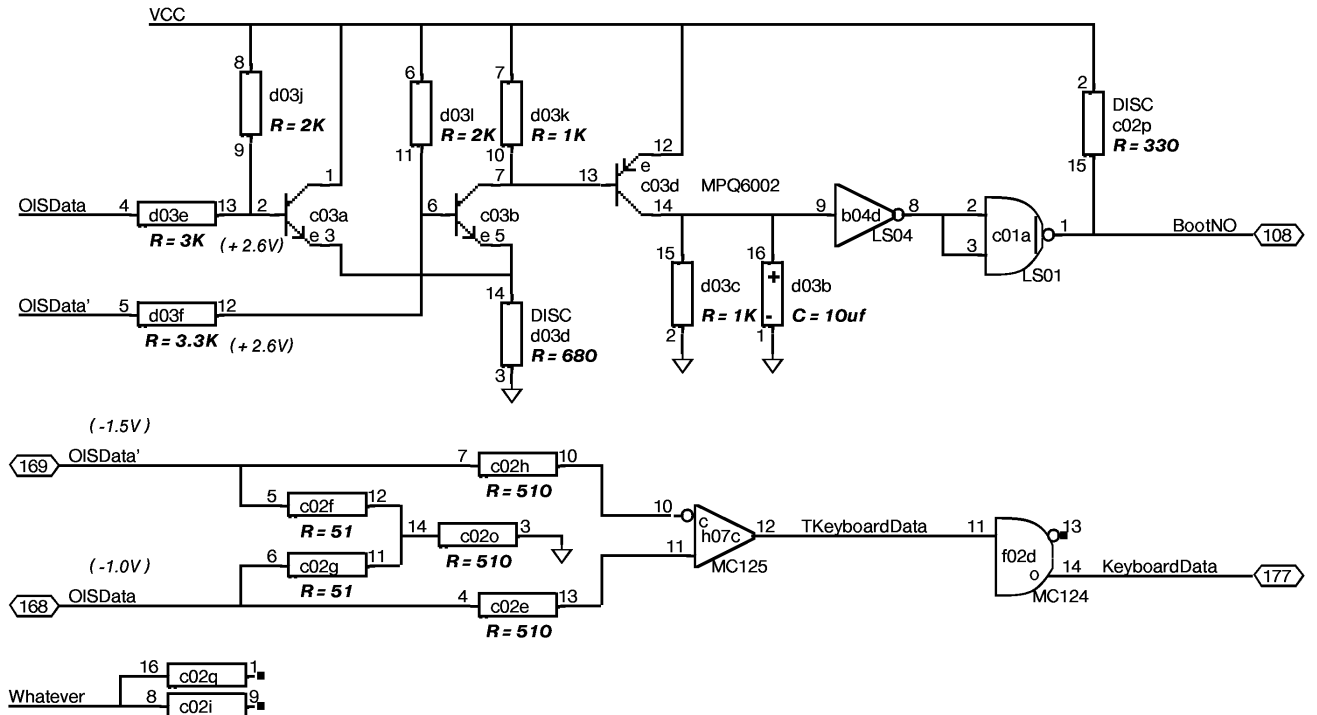


For c05

-5v


XEROX CSL	Project Dorado	Reference Board Layout	File Basebd14.sil	Designer McCreight	Rev Bd	Date 4/23/81	Page 14
---------------------	-------------------	---------------------------	----------------------	-----------------------	-----------	-----------------	------------

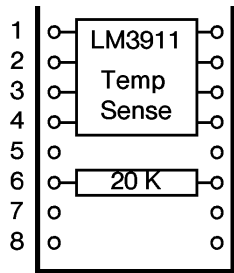


a02 Pg 12

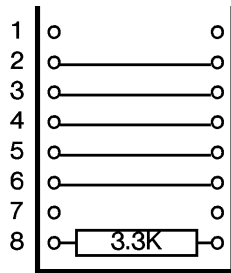


d04 Pg 01

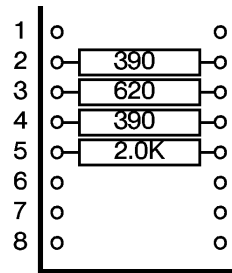


i20 Pg 11

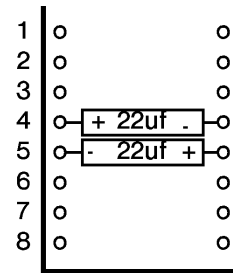


k07 Pg 09

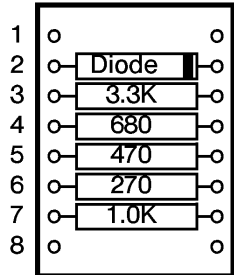


b21,b23,c20
&c22 Pg 06

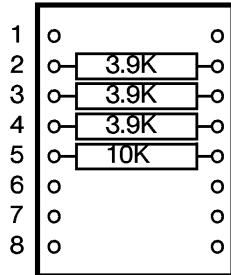


h21 Pg 11

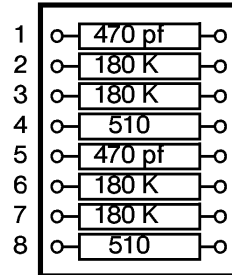


j04 Pg 09

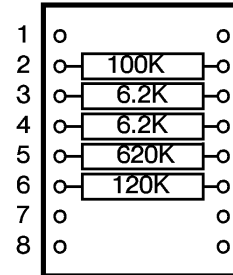


k21 Pg 11

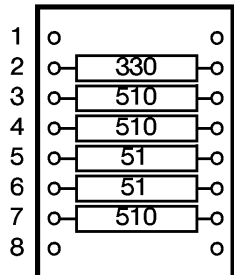


c02 Pg 13

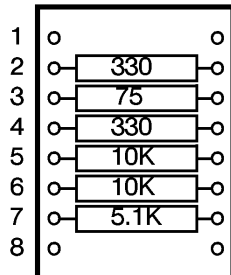


h23 Pg 12

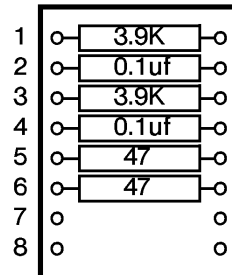


j05 Pg 09

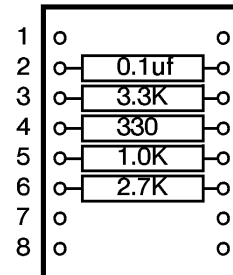


Pg 13

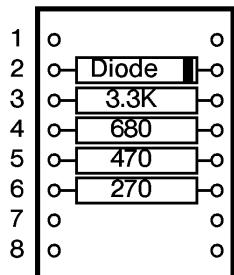


c24 Pg 06

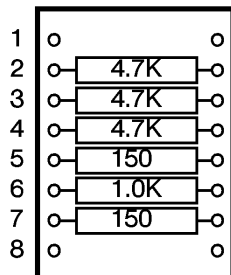


i06 Pg 09

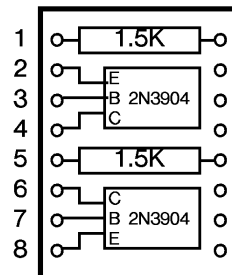


j22 Pg 11

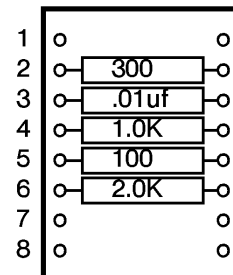

i22 Pg 13

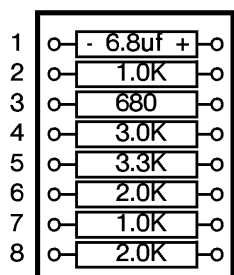

d03 Pg 13

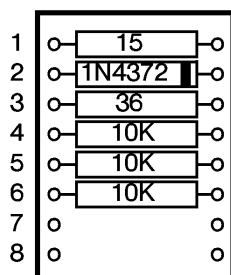

i07 Pg 09

NOTES:

All diodes are HP 5082-2835 unless otherwise noted

Locations c66,c61,c67,c68,b66,b61,b67 &b68 are EPROMS and must be programmed

Location g18 can use a 74151 instead of 74LS151

Location d49 must be loaded with SIP whose pins 2,4,5 & 7 have been cut