

Printer Dover

Spruce version 11.2 -- spooler version 11.2

File: BasebdPC01.sil etc.

Creation date: 21-Sep-85 14:54:19

For: Spruce

17 total sheets = 16 pages, 1 copy.

Problems encountered:

Font HELVETICA24B substituted for font HELVE24.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.


Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.




Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.



Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.

Not impl.: brightness, hue, saturation, show-object, show-dots-opaque, dots from files.


Character code 117b not found in font Gates32.

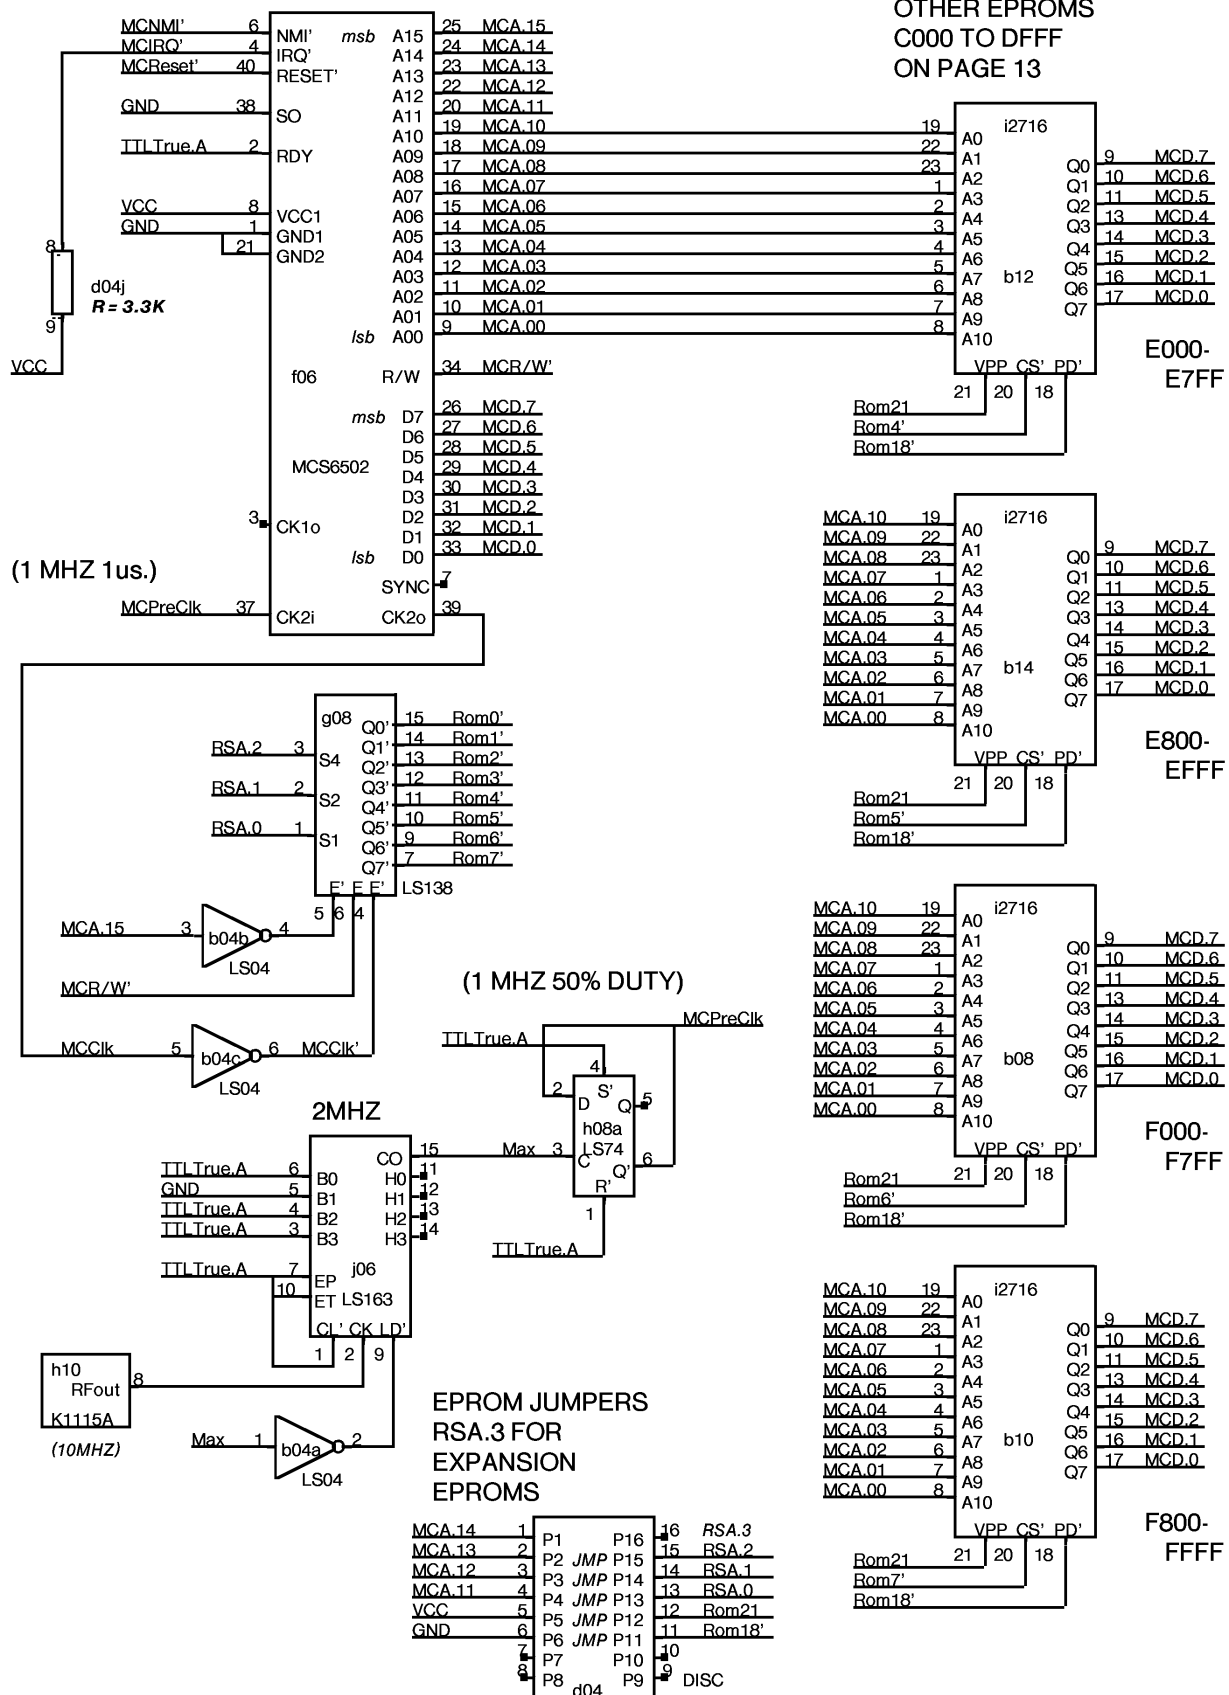

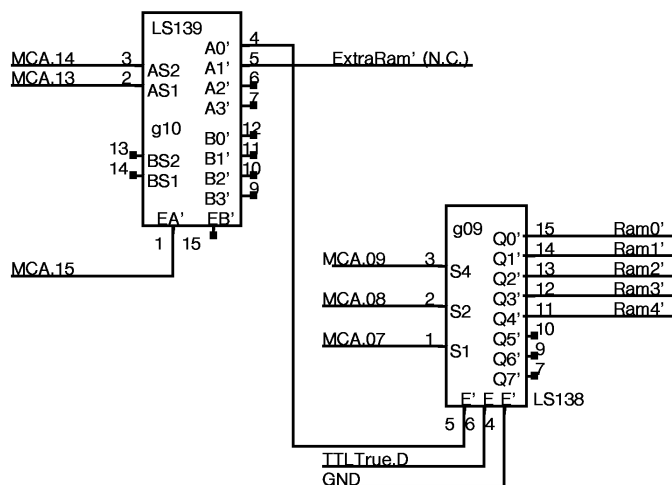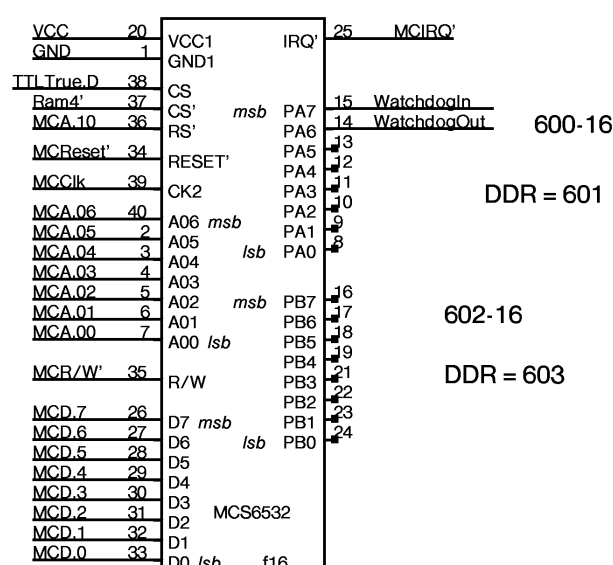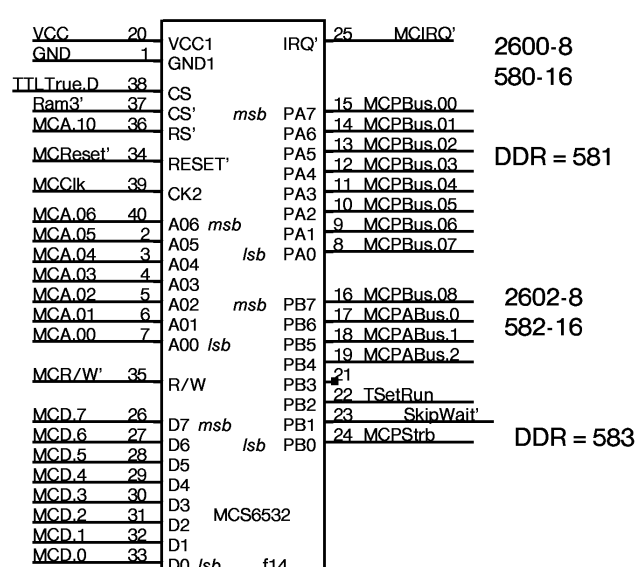

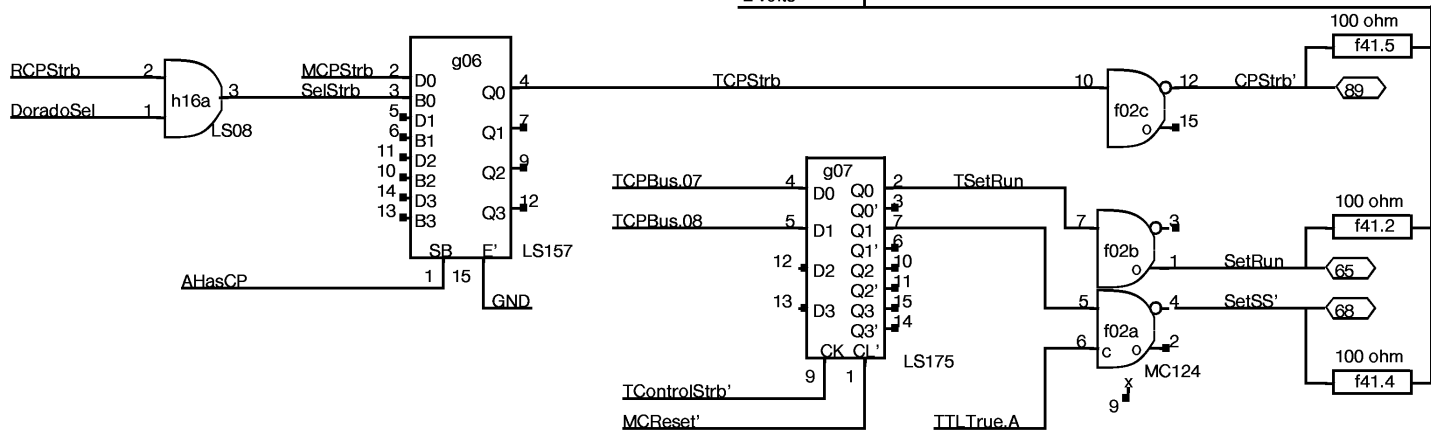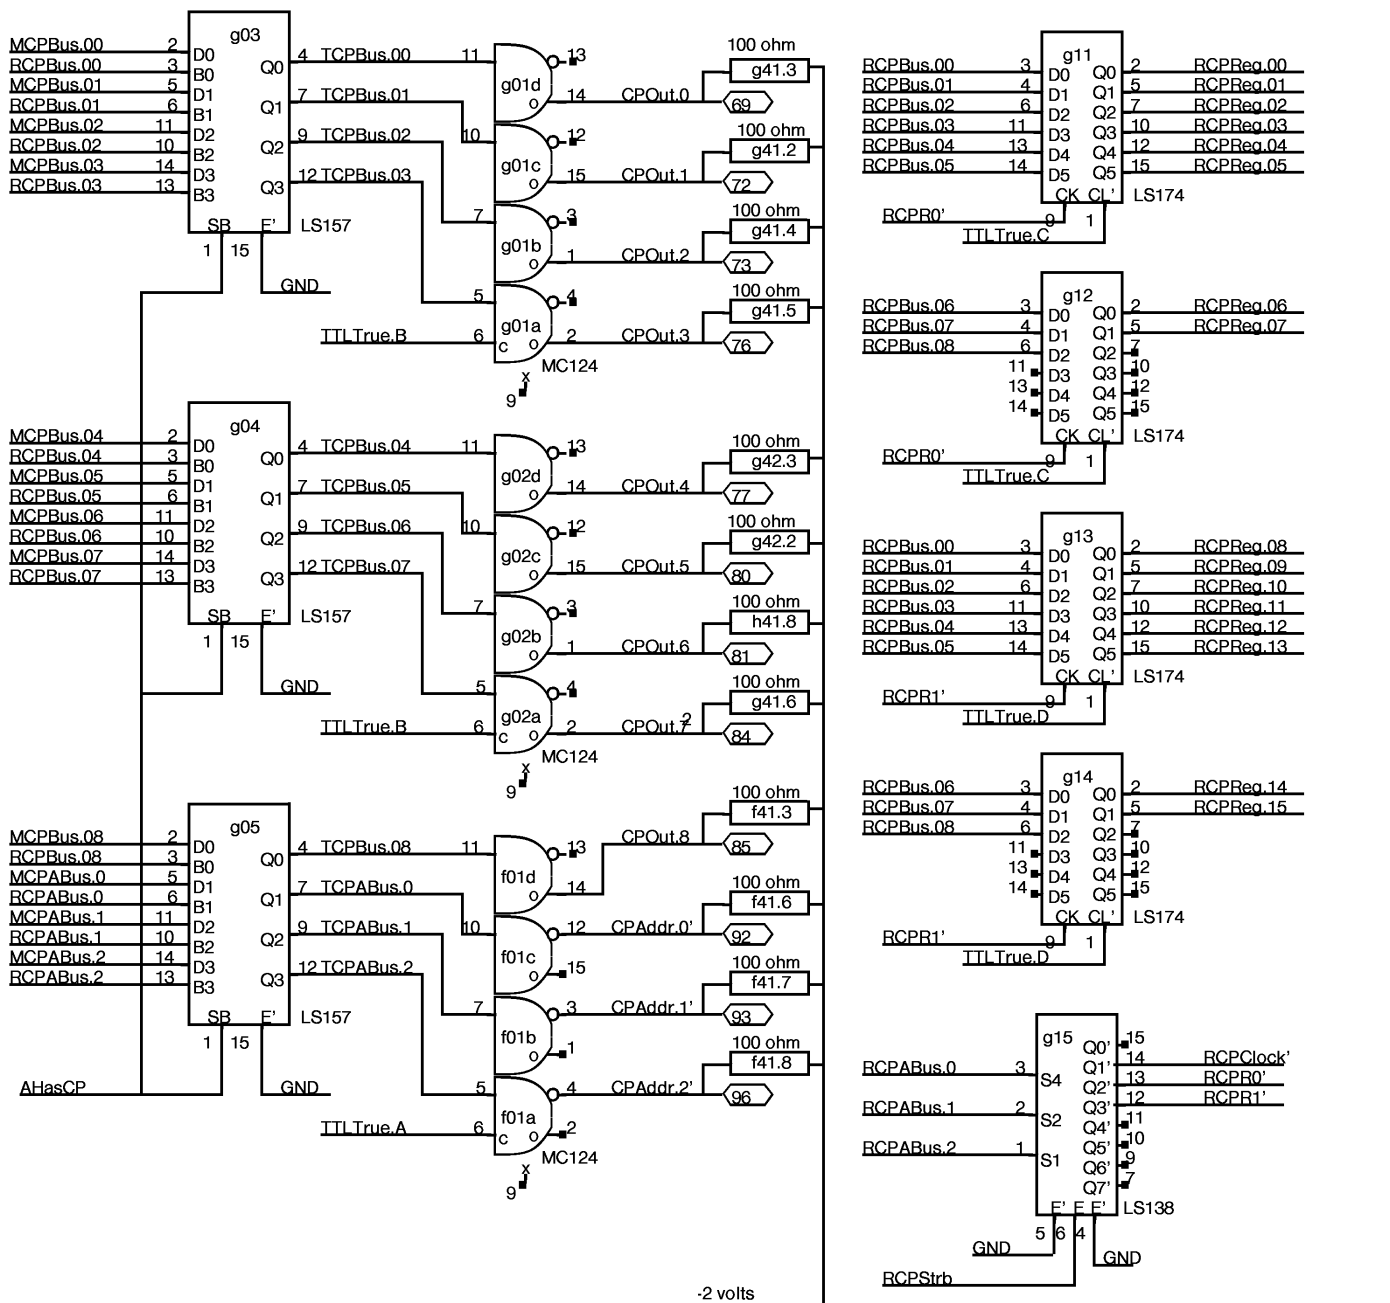


CLOCKRUN


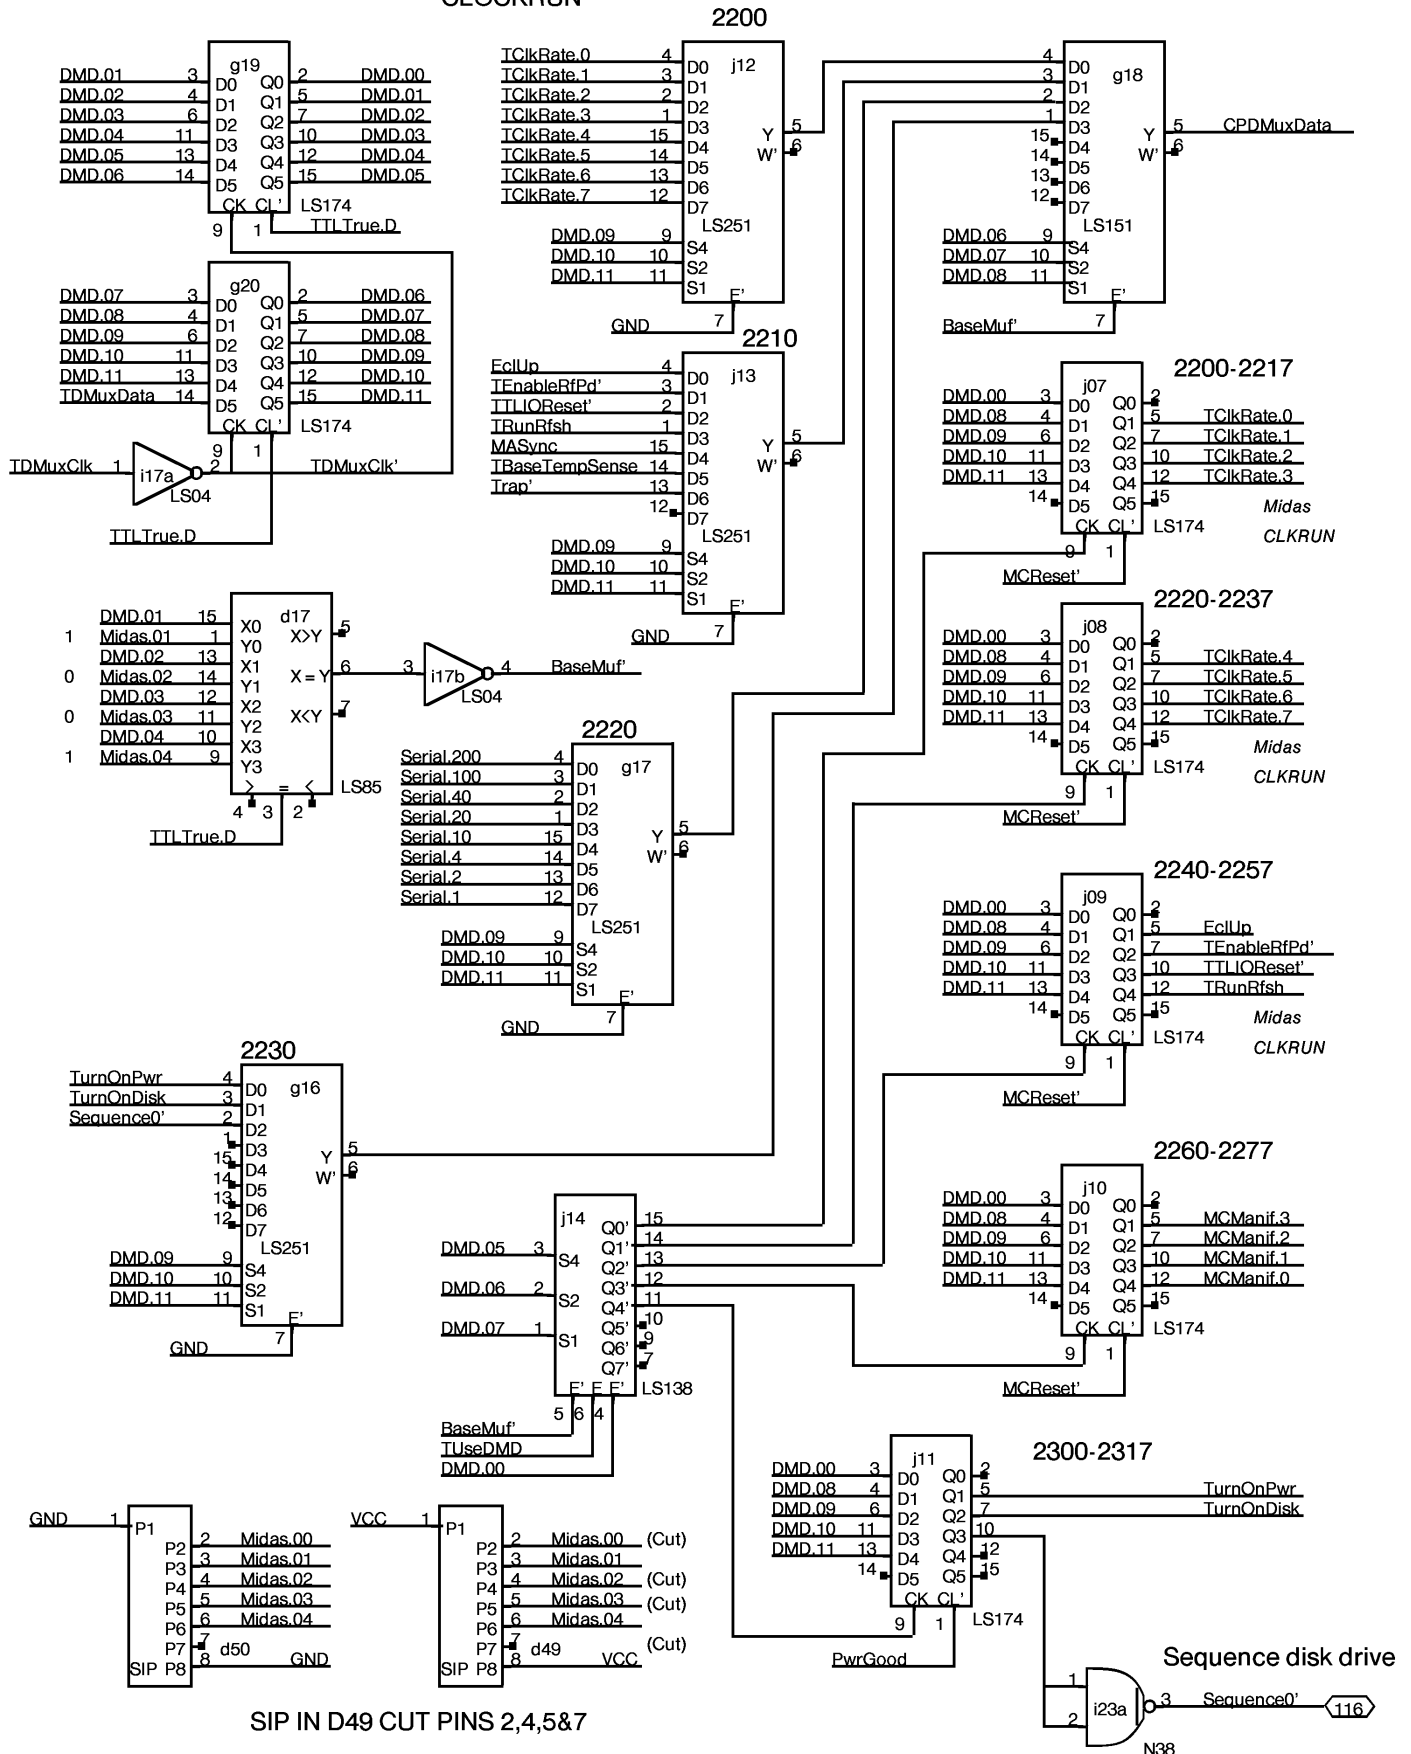



SIP IN D49 CUT PINS 2,4,5&7



Signals from debugging Alto

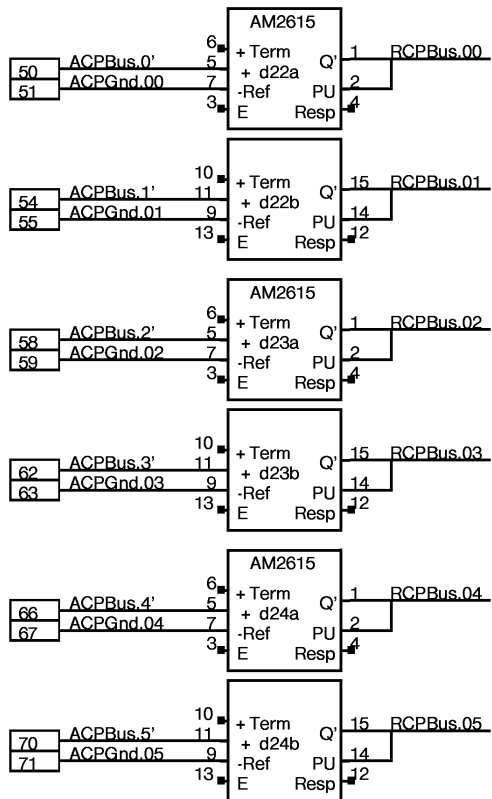


Signals from debugging Alto

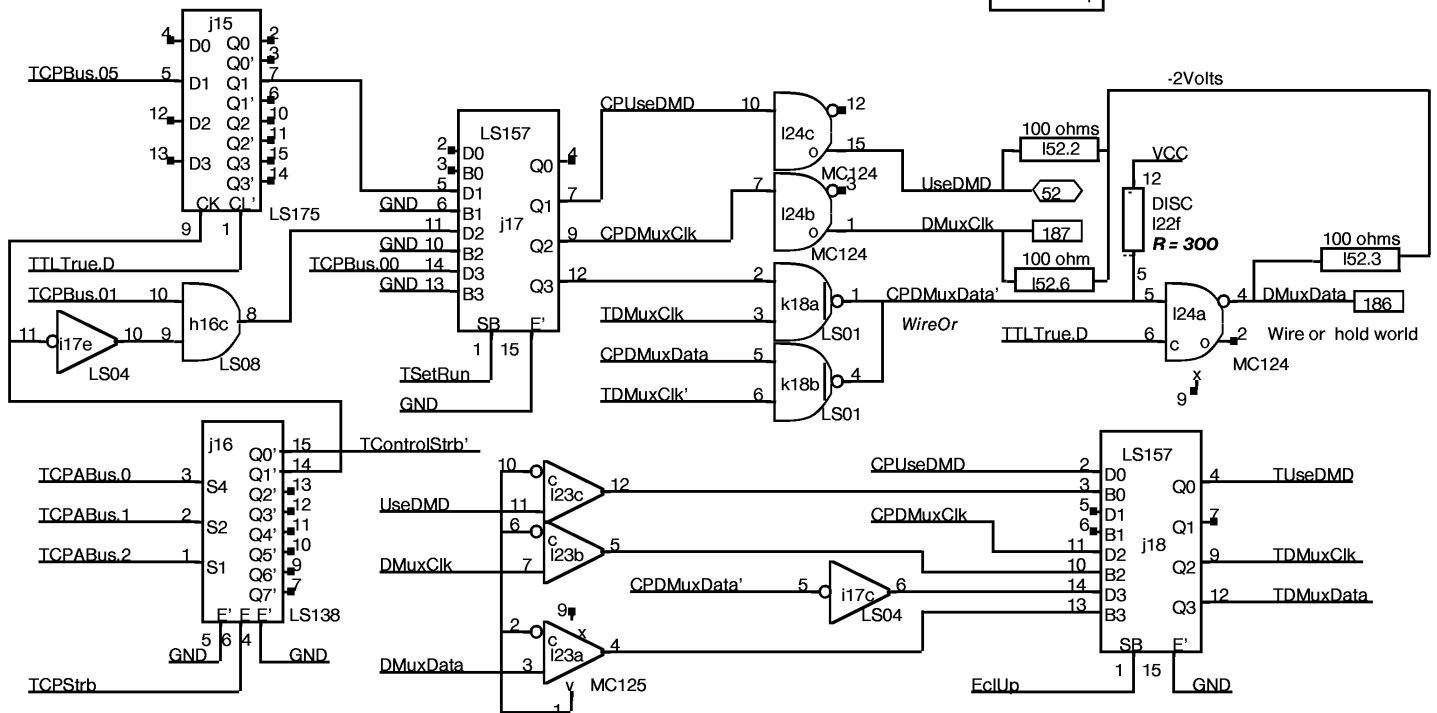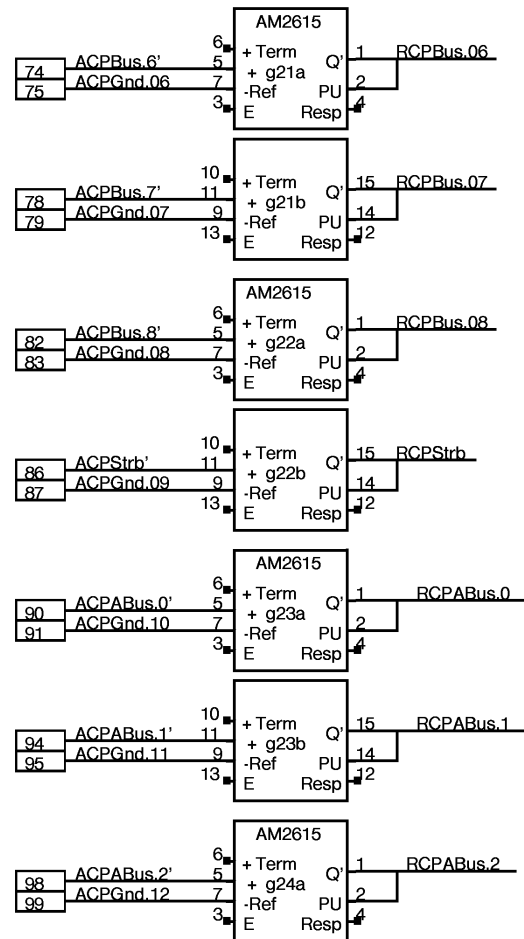

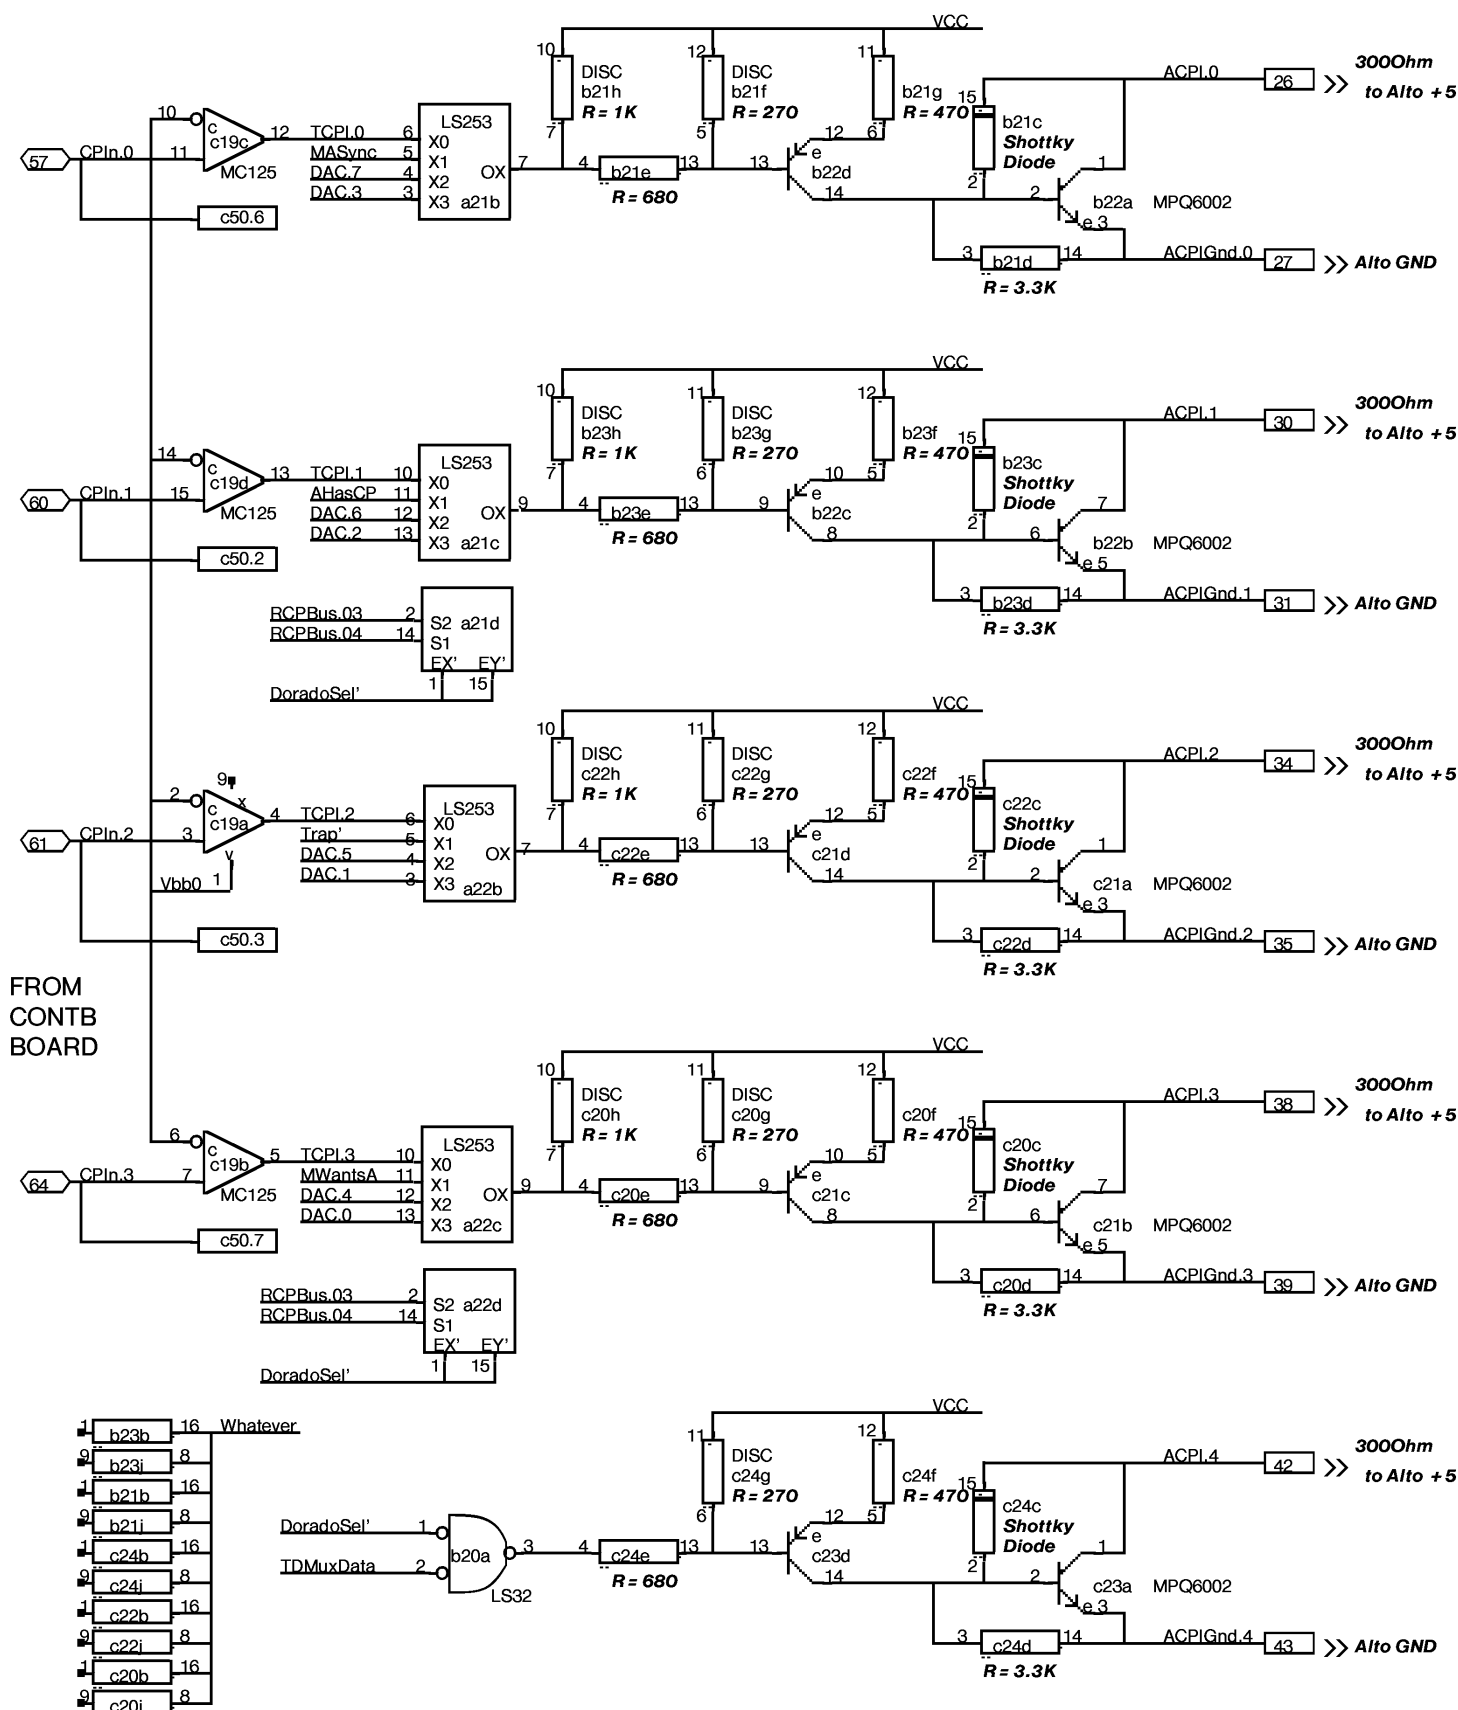


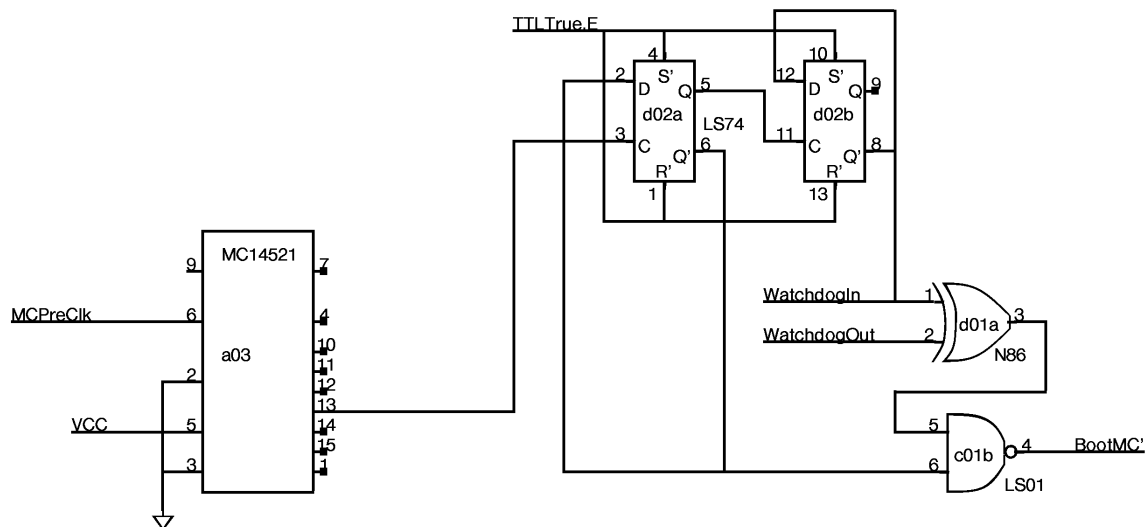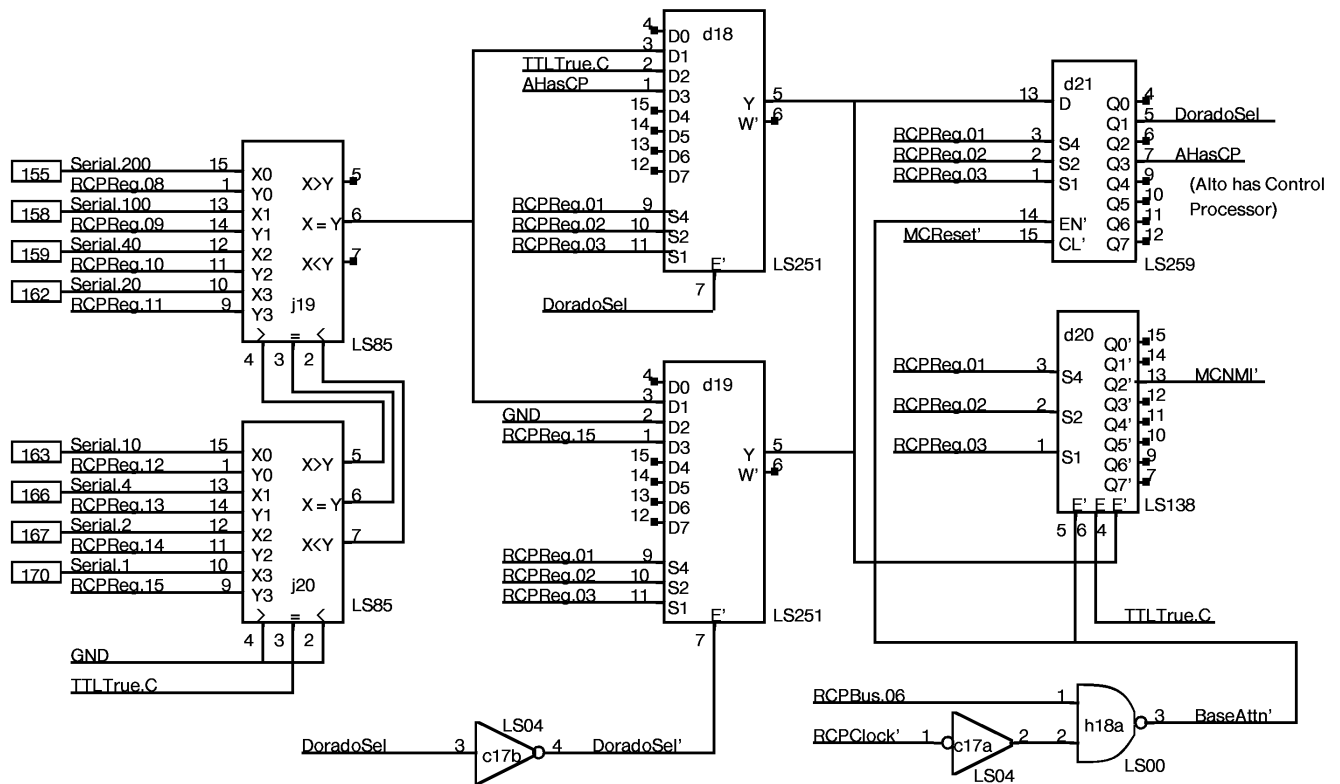


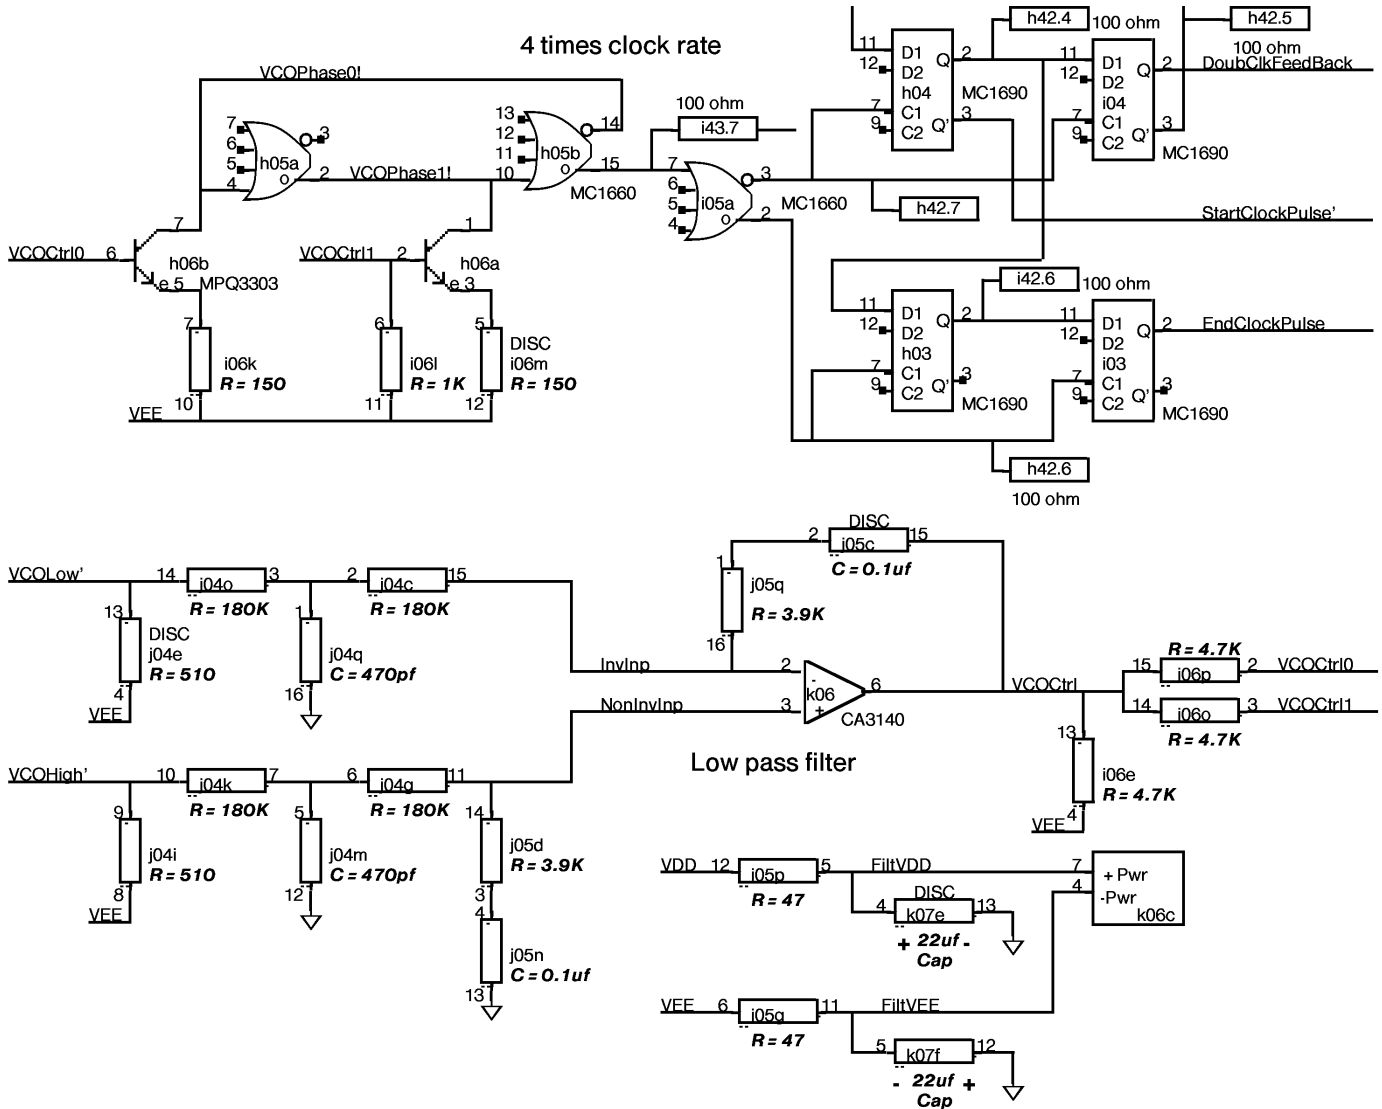



LOOP FILTER AND SYSTEM VCO

POWER ON RESET
POWER GOOD AT 4.5 VOLTS

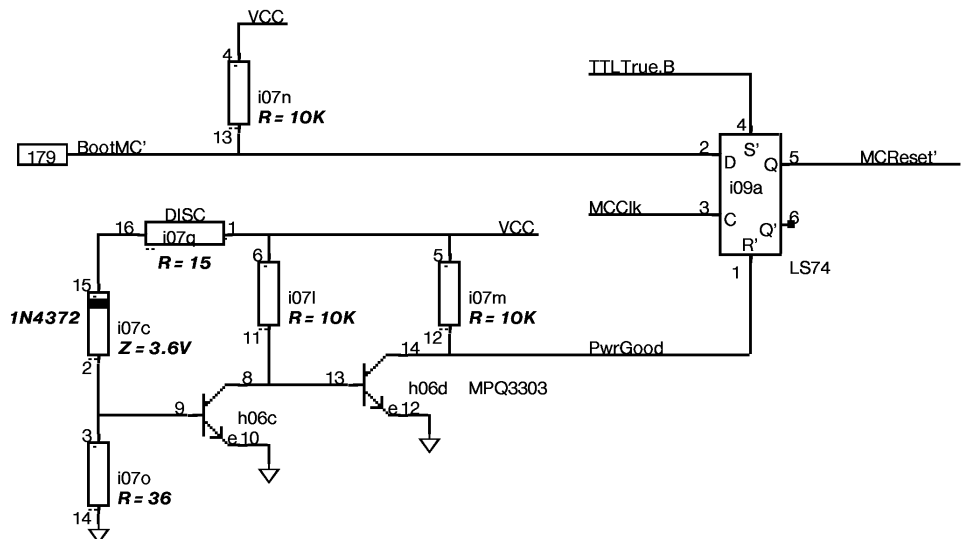


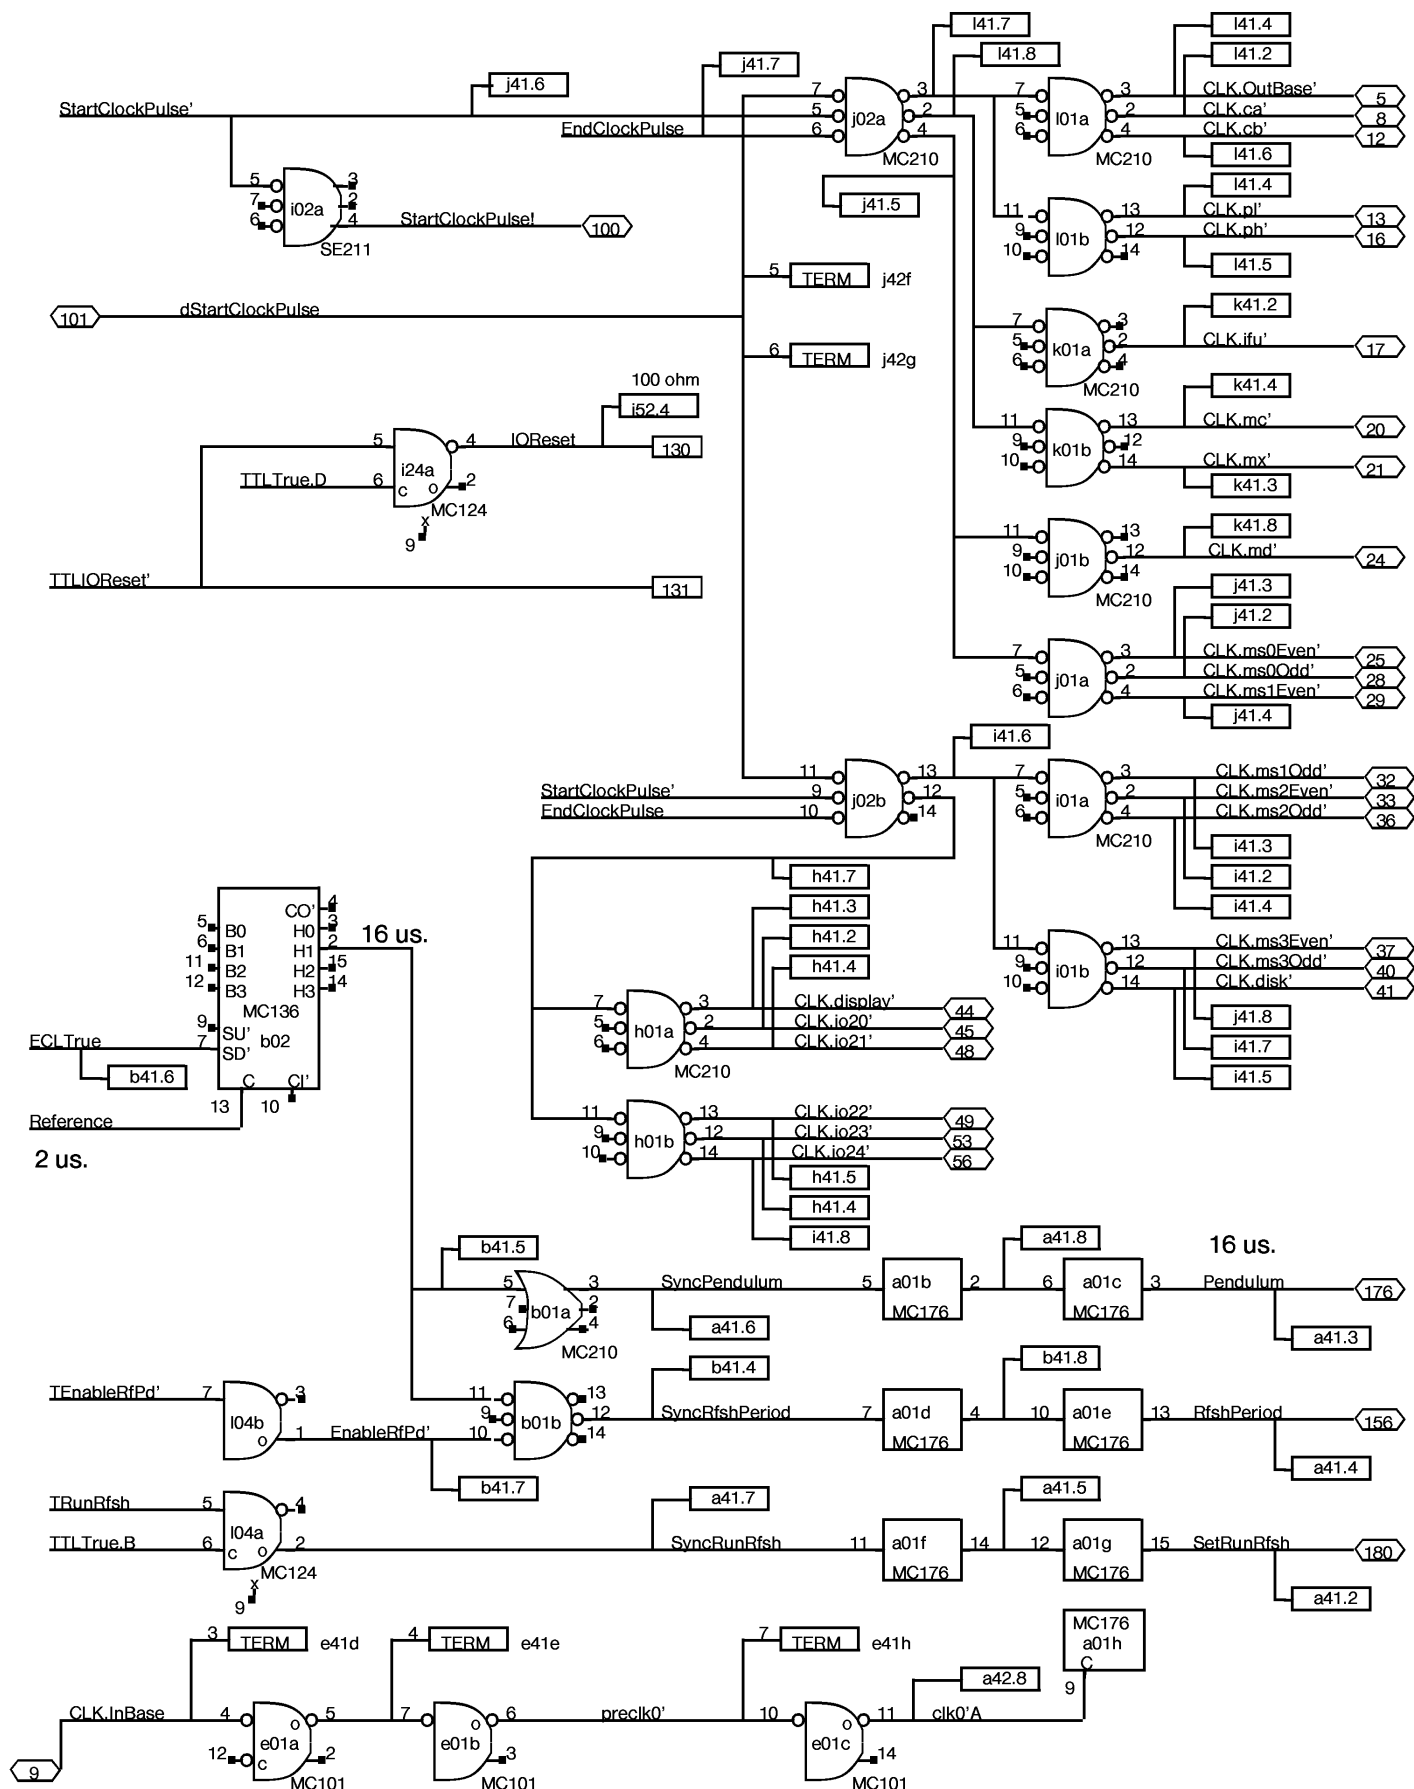

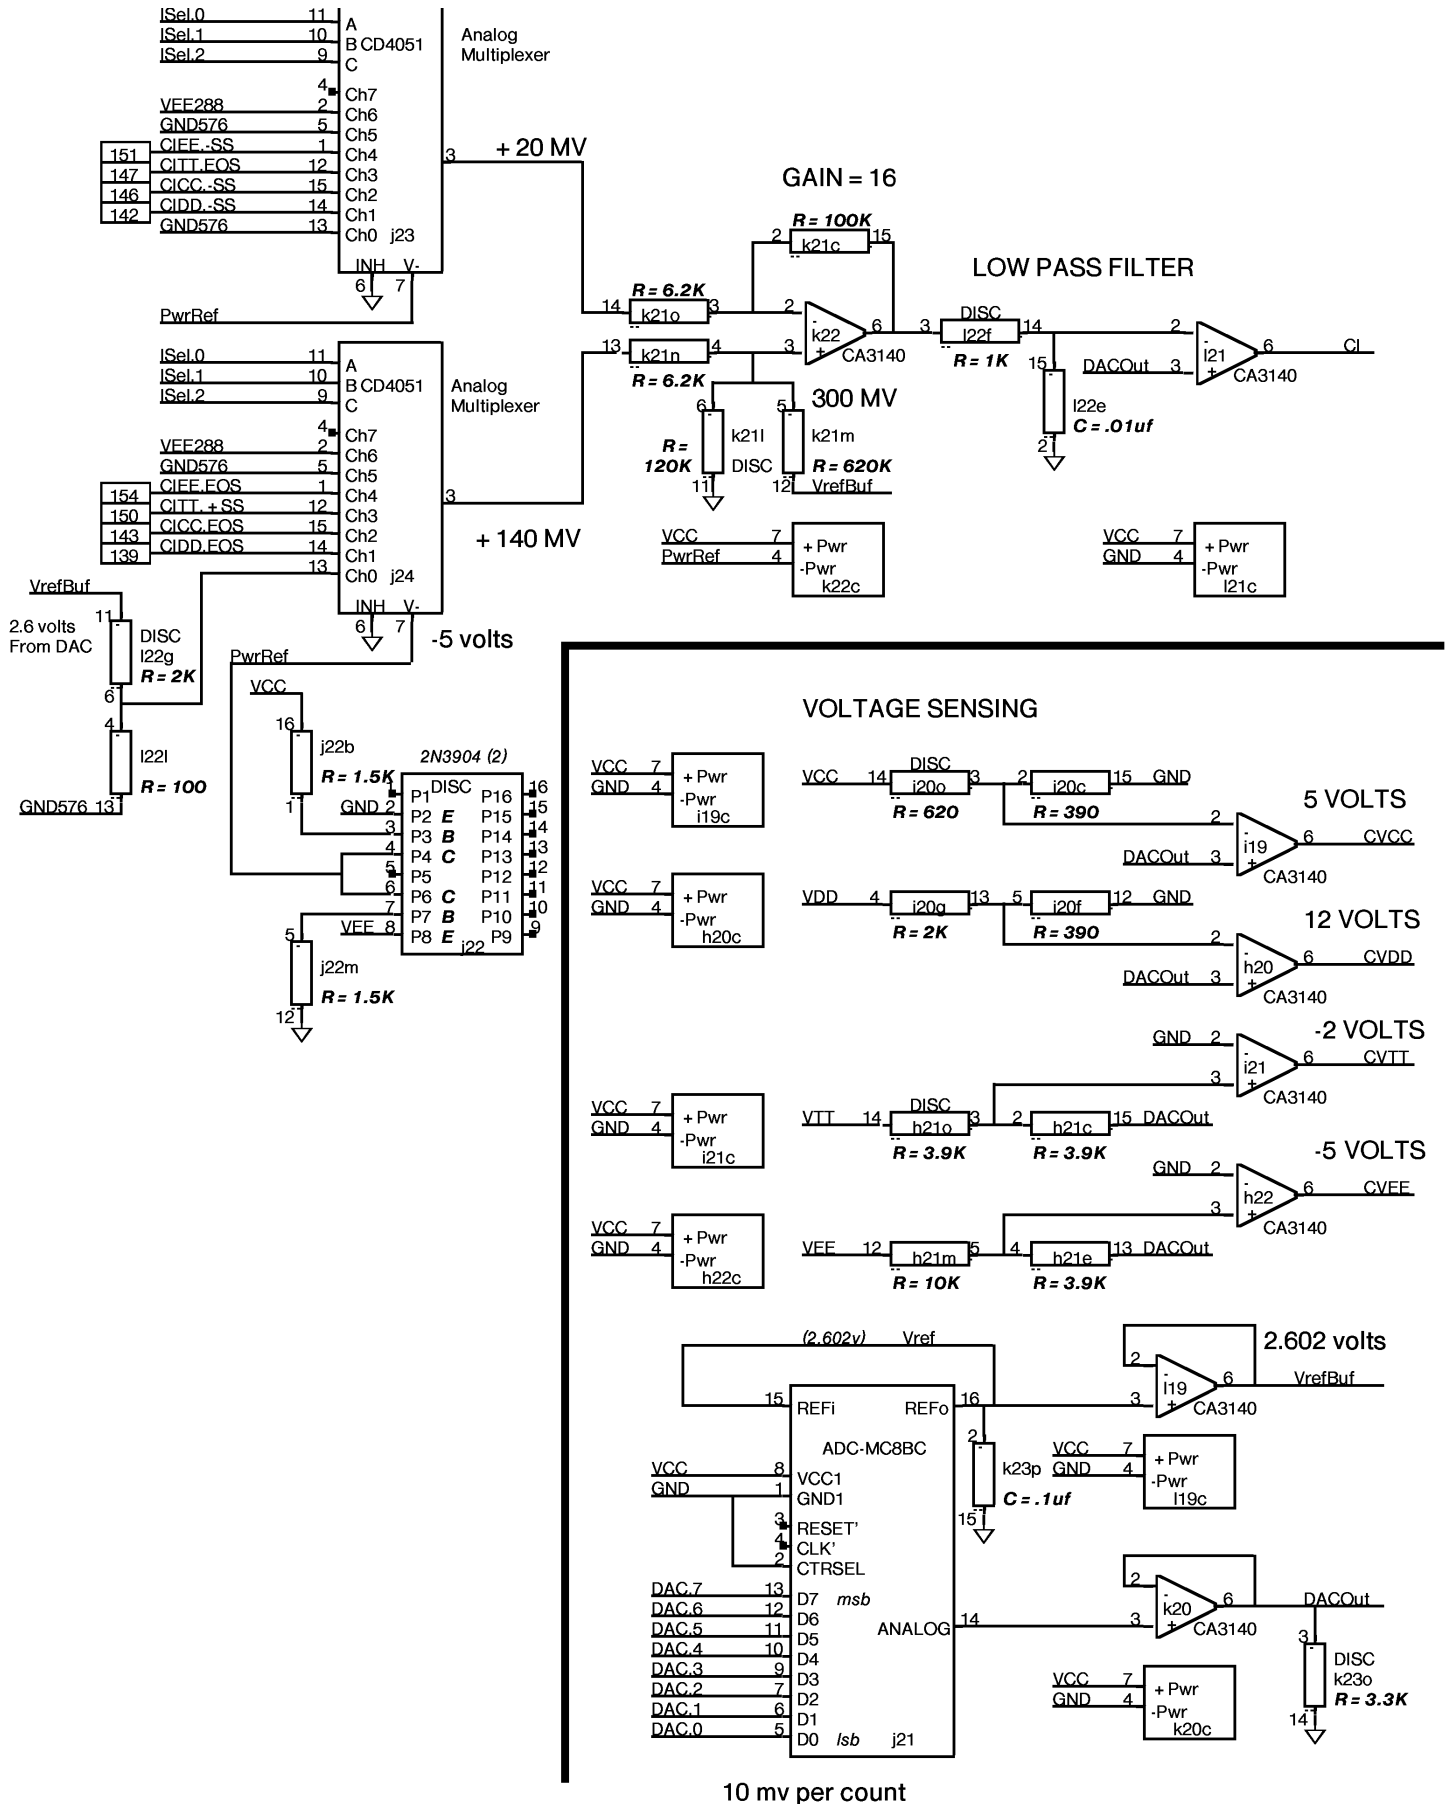


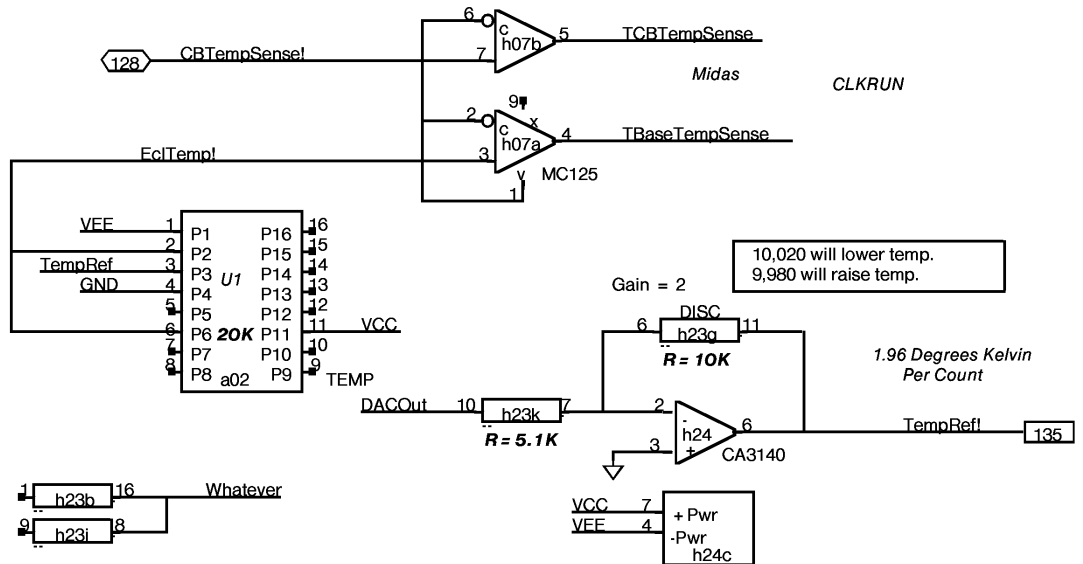

LED FLASH Decoder	
Lite always ON - BOOTED	
1	Normal Wait
2	Unable to Boot Dorado
3	Transient Power Problem
4	Current (NOW) Power Problem
5	Microcomputer Shutdown
6	Over Temperature
7	Microcomputer unable to get control of CP Bus to do its duties
NO LITE - Microcomputer is LOST or all power is OFF.	

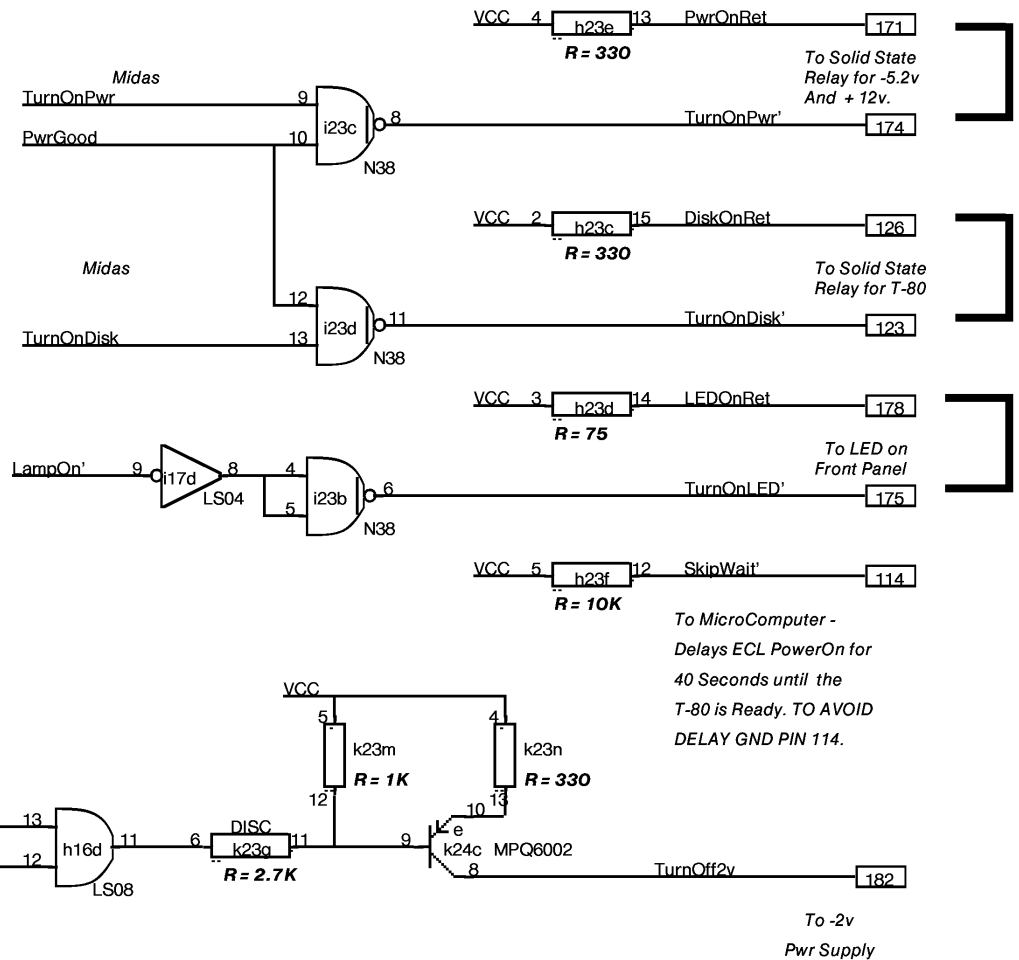


For Future Baseboard Ethernet

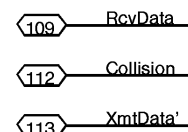


XEROX CSL	Project Dorado	Temp Sense, Pwr On, And LED Ckts	File BasebdPc12.sil	Designer McCreight	Rev Be	Date 7/10/81	Page 12
--------------	-------------------	-------------------------------------	------------------------	-----------------------	-----------	-----------------	------------


Expansion EPROMS

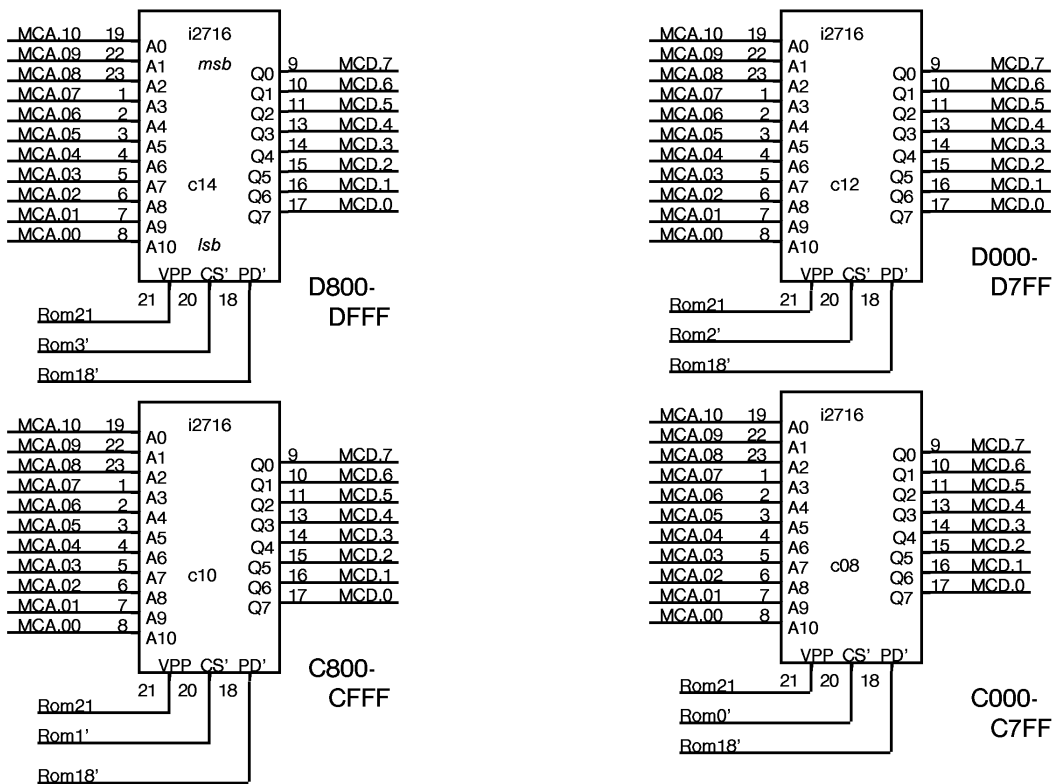


DIFFERENTIAL RECEIVERS FOR 7 WIRE INTERFACE

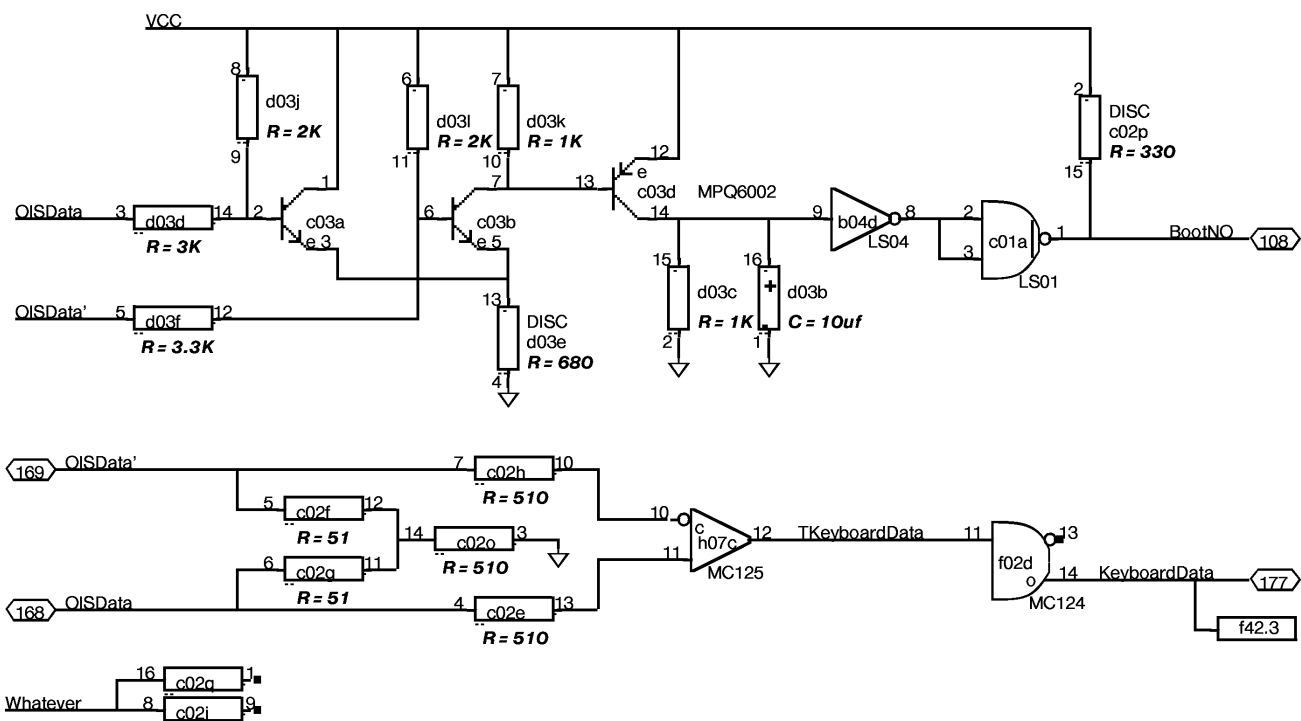


For c05

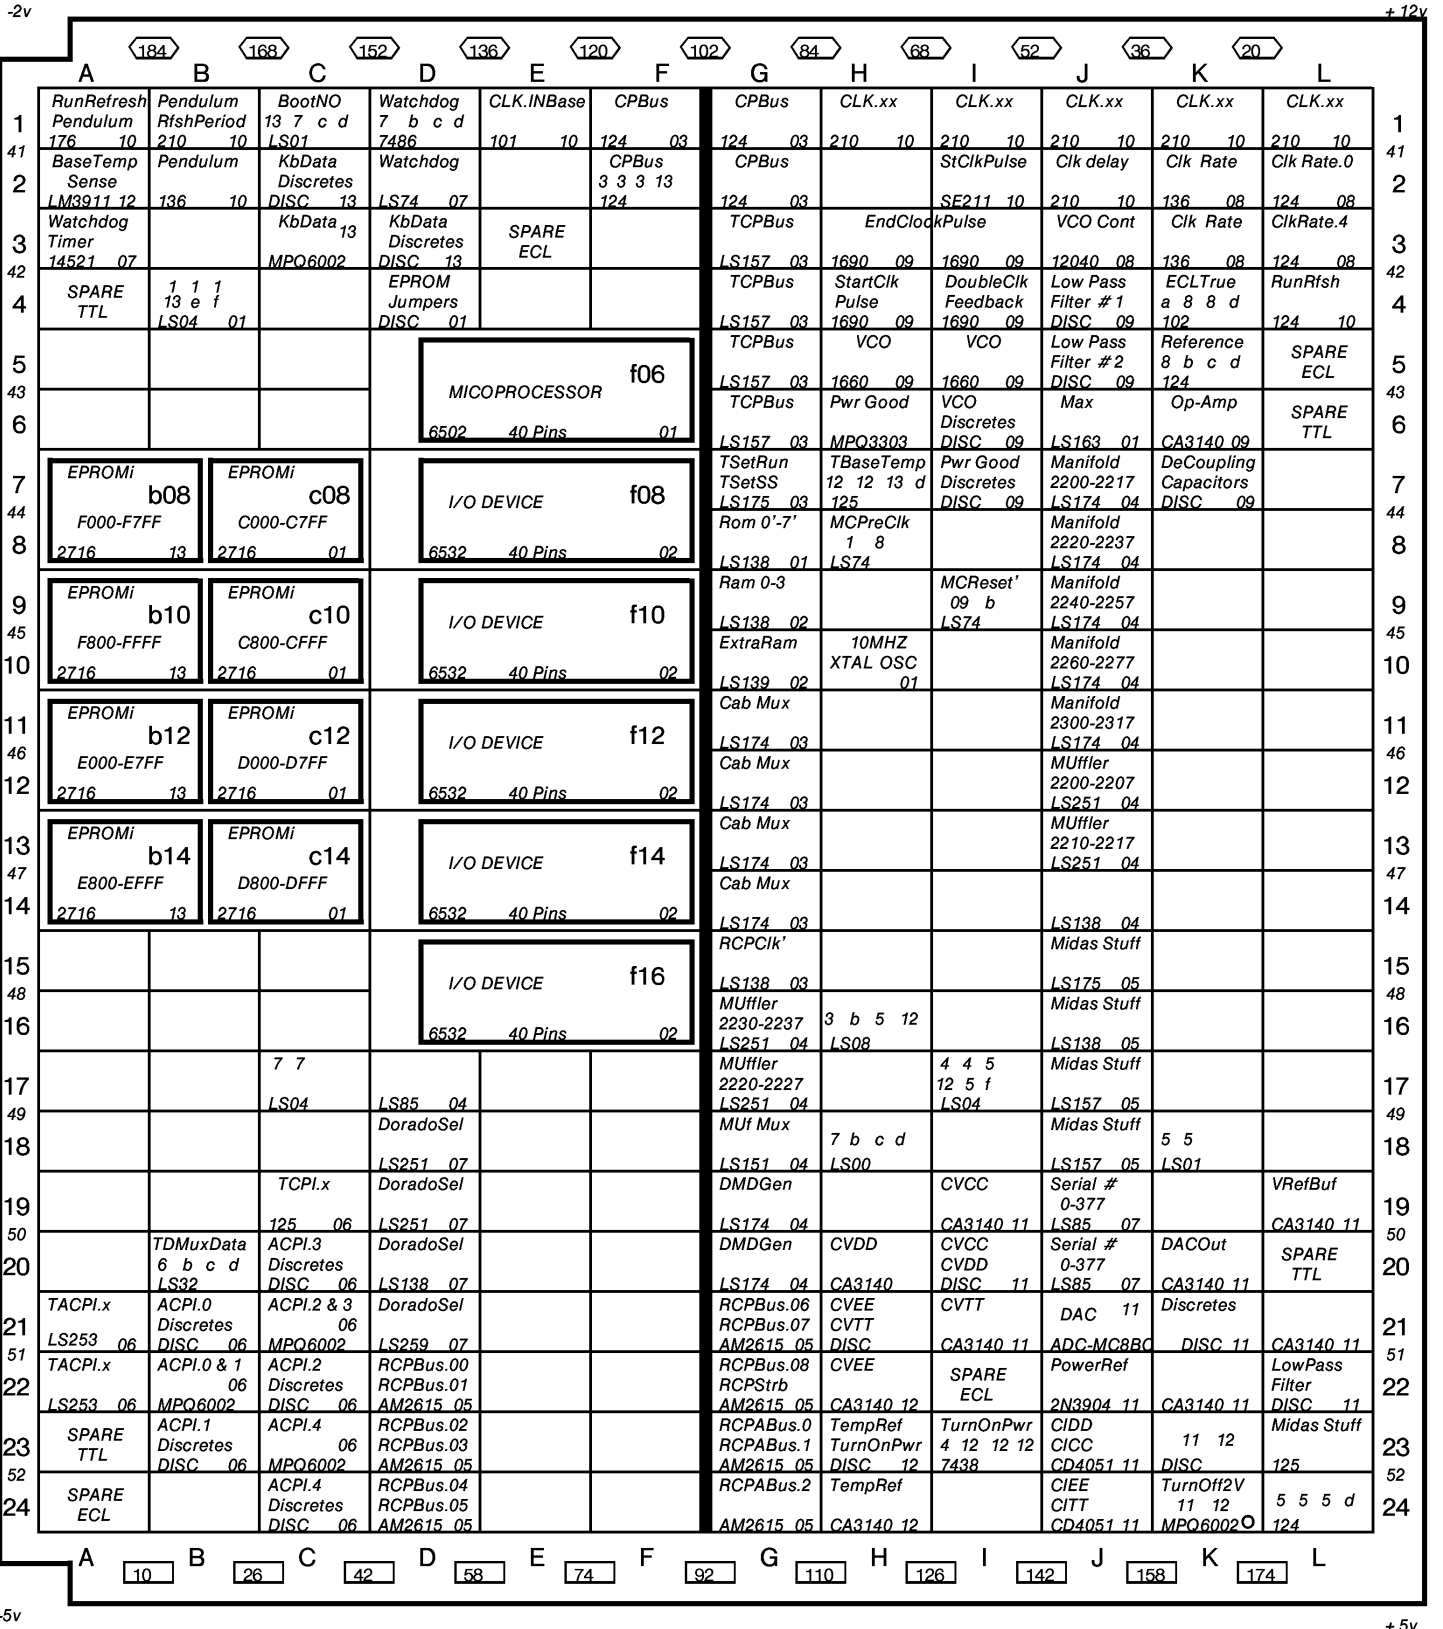


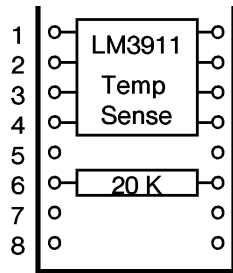


a02 Pg 12

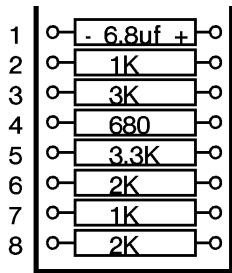


d03 Pg 13

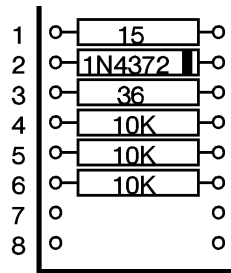


i07 Pg 09

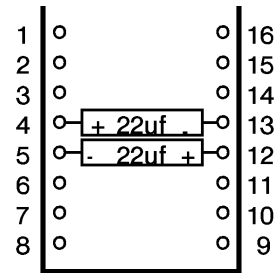


k07 Pg 09

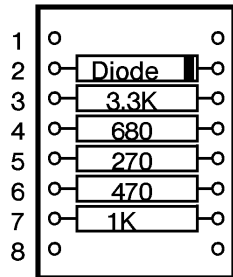


b21 Pg 06

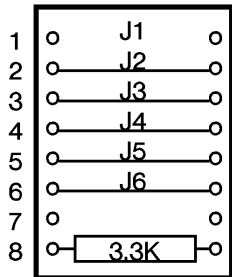


d04 Pg 01

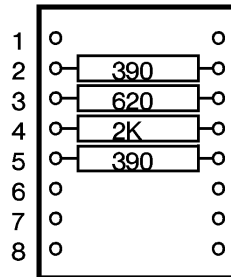


i20 Pg 11

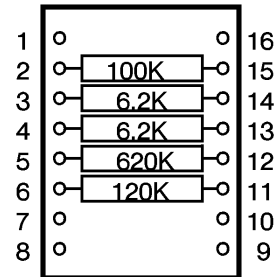


k21 Pg 11

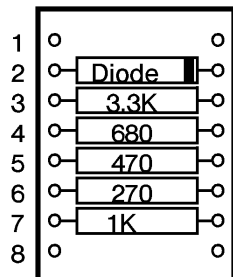


b23,c20 & c22
Pg 06

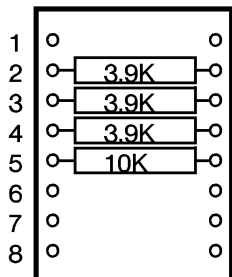


h21 Pg 11

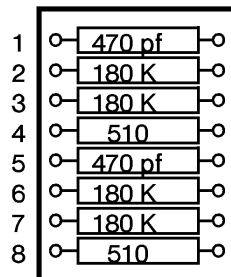


j04 Pg 09

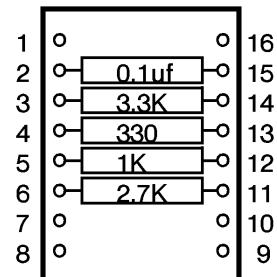


k23 Pg 11
Pg 13

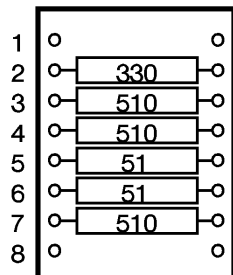


c02 Pg 13

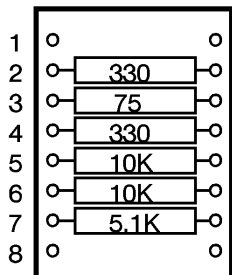


h23 Pg 12

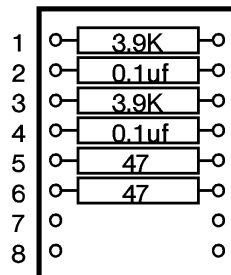


j05 Pg 09

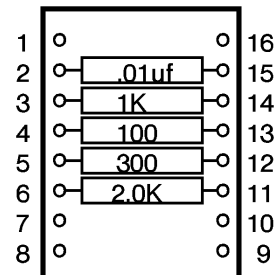


l22 Pg 13

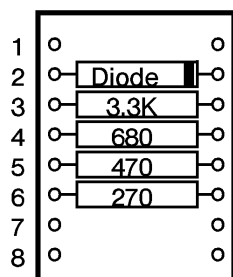

c24 Pg 06

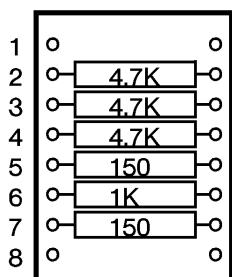

i06 Pg 09

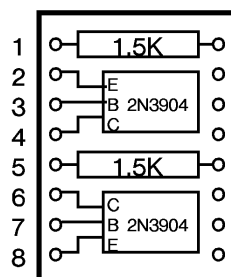

j22 Pg 11

NOTES:

- 1) All diodes are HP 5082-2835 unless otherwise noted.
- 2) Location d49 is load with a modified 100ohm SIP (pins 2,4,5&7 are cut)

[illegible]