
## Fault code: 405010 No. 2 motor running up timeout

Туре

Error Code

Solution

Check whether the motor driver line at the rear of the machine is loose; the power light of the No. 2 motor driver

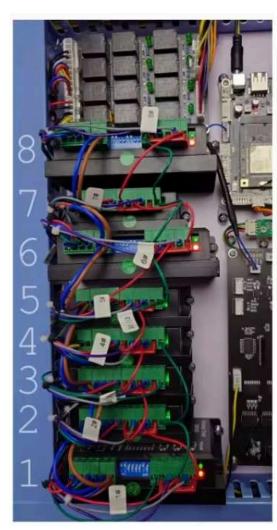

Driver#	Control
1	Arm Motor #1
2	Arm Motor #2
3	Arm Motor #3
4	Arm Motor #4
5	Rod Ejector Motor
6	Motor of the rod up and down
7	Left and right motors of the lever
8	Rod out rod motor

Created by



J Jason Lopez