


PLCopen motion control

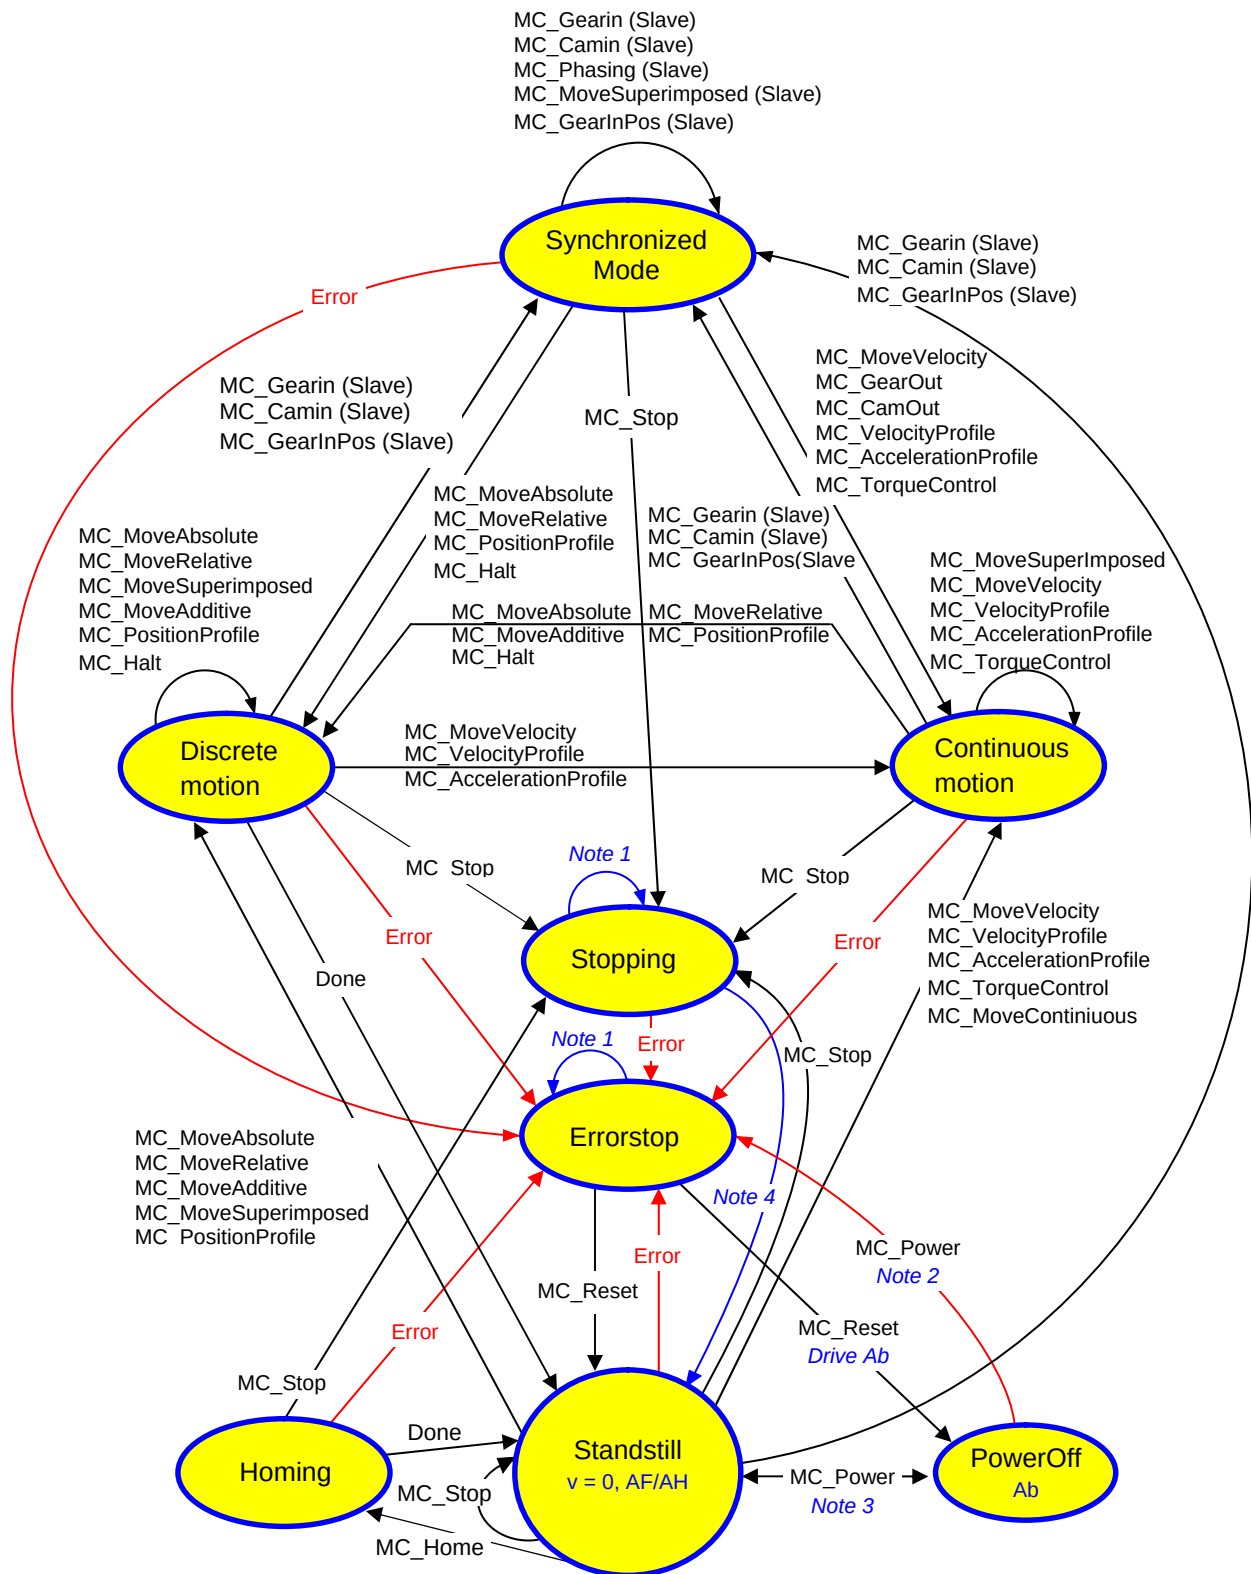

Note 1. All function blocks can be called without being processed, except for MC_Reset and Error - they initiate the respective transitions to StandStill or ErrorStop.

Note 2. Power.Enable = TRUE and error in the axis.

Note 3. Power.Enable = TRUE and fault-free axis.

Note 4. MC_Stop.Done AND NOT MC_Stop.Execute

An error in the drive results in a power switch off after a certain time, depending on the programmed error reaction. However, the state machine remains in ErrorStop and when power is switched off, MC_Reset results in Power Off state.