

ASBESTOS, LEAD PAINT, AND MOLD ASSESSMENT



TARAWA TERRACE II CHILD DEVELOPMENT CENTER

BLDG. TT-113 IWO JIMA BOULEVARD
TARAWA TERRACE, NORTH CAROLINA 28547

ECS PROJECT NO. 49:23942

FOR: MBF ARCHITECTS PA

SEPTEMBER 24, 2024





September 24, 2024

Mr. Bill Faulkenberry
MBF Architects PA
317-C Pollock Street
New Bern, North Carolina 28560

ECS Project No. 49:23942

Reference: Asbestos, Lead Paint, and Mold Assessment, Tarawa Terrace II Child Development Center, Bldg. TT-113 Iwo Jima Boulevard, Tarawa Terrace, North Carolina

Dear Mr. Faulkenberry:

ECS Southeast, LLC (ECS) is pleased to provide MBF Architects PA with the results of the above referenced Asbestos, Lead Paint, and Mold Assessment performed at the Tarawa Terrace II Child Development Center located at Bldg. TT-113 Iwo Jima Boulevard in the Tarawa Terrace subdivision at Camp Lejeune, North Carolina. This report summarizes our observations, analytical results, findings, and recommendations related to the work performed. The work described in this report was performed by ECS in general accordance with the Scope of Services described in ECS Proposal Number 49:43086P and the terms and conditions of the agreement authorizing those services.

ECS appreciates this opportunity to provide MBF Architects PA with our services. If we can be of further assistance to you, please do not hesitate to contact us.

Sincerely,

ECS Southeast, LLC

Braxton B. Dawson
Environmental Project Manager
bdawson@ecslimited.com
910-686-9114

Lindsey Thompson, REM
Environmental Principal
lthompson@ecslimited.com
864-987-1810

EXECUTIVE SUMMARY

The subject property is improved with Building TT-113 located at Iwo Jima Boulevard in Tarawa Terrace, Camp Lejeune, Onslow County, North Carolina. It is slated for interior and exterior renovations. The structure on the property is a single-story building utilized as the Tarawa Terrace II Child Development Center (CDC). The site features paved access from Iwo Jima Blvd, with a parking area to the north of the building. The building is currently occupied and is slated for interior and exterior renovations. ECS was contracted to perform an asbestos, lead paint, and mold assessment at the building prior to the proposed renovations.

The purpose of the survey was to determine whether asbestos-containing materials (ACMs), lead-containing paint (LCP), and visible mold are present on the subject property. The survey was performed within the interior and exterior areas of the subject building as well as the roof.

Asbestos Survey

On August 30, 2024, Mr. Braxton B. Dawson, a North Carolina state-certified inspector, performed the asbestos assessment. Bulk samples were submitted to Scientific Analytical Institute, Inc. (SAI) in Greensboro, North Carolina for analysis via Polarized Light Microscopy (PLM) in accordance with the current EPA-600 methodology.

A total of twenty-three (23) bulk samples from eleven (11) homogeneous areas were submitted to the laboratory, of which thirty-one (31) layers were analyzed. Based on the laboratory analysis of the bulk samples collected during the survey, none of the materials were reported to contain asbestos.

Due to inaccessibility or the destructive means that asbestos sampling requires, unseen ACMs may remain within the building hidden behind inaccessible areas, which include, but are not limited to, sub-grade walls, structural members, topping slabs, sub-grade sealants, flooring located below underlayments, areas behind exterior walls, pipe trenches, and subsurface utilities.

If suspect materials are discovered during construction activities, they should be presumed to contain asbestos and be treated as ACMs or be sampled immediately upon discovery and prior to disturbance for asbestos content by an accredited or certified asbestos inspector in accordance with 29 Code of Federal Regulations (CFR) 1926.1101.

Lead Paint Survey

The lead paint assessment was conducted by collection of paint chip samples from suspect lead paint materials. The paint chip samples were submitted to a laboratory that participates in the American Industrial Hygiene Association (AIHA) Environmental Lead Proficiency Analytical Testing (ELPAT) Programs for analysis of lead concentration (percent by weight) using Flame Atomic Absorption Spectroscopy.

Based on the laboratory analysis of the paint chips collected during the survey, lead was not detected above the laboratory detection limit.

Paint and surface coatings that contain detectable concentrations of lead are considered "lead-containing paints." Since OSHA has no specific action level for lead in paint, all paint on the site found to have a measurable concentration of lead should be assumed to be lead-containing. Work performed that may disturb lead-containing paint is regulated under OSHA, as referenced under 29 CFR 1926.62.

Visible Mold Assessment

ECS did not observe evidence of visible mold or moisture during our assessment. However, it was reported that ceiling tiles had been replaced due to HVAC condensation as part of routine maintenance activities. ECS does not recommend additional assessment pertaining to mold at this time.

The executive summary is an integral portion of this report, however, ECS recommends the report be read in its entirety.

	PAGE
1.0 SITE DESCRIPTION	1
2.0 PURPOSE	1
3.0 METHODOLOGY	1
3.1 Asbestos-Containing Materials	1
3.2 Lead in Paint and Surface Coatings	2
3.3 Visible Mold	2
4.0 RESULTS	2
4.1 Asbestos Sampling	3
4.2 Suspect or Assumed Asbestos-Containing Materials	6
4.3 Lead in Paint and Surface Coatings	6
4.4 Visible Mold and Moisture	7
4.4.1 Observations and Findings	7
5.0 RECOMMENDATIONS AND REGULATORY REQUIREMENTS	8
5.1 Asbestos-Containing Materials	8
5.2 Lead in Paint and Surface Coatings	8
5.3 Mold and Moisture	8
6.0 LIMITATIONS	9

TABLE OF APPENDICES

Appendix I: Figures

Appendix II: Site Photographs

Appendix III: Asbestos Bulk Sample Results

Appendix IV: Lead Laboratory Analytical Results

Appendix V: Certifications/Licenses

1.0 SITE DESCRIPTION

The subject property is improved with Building TT-113 located at Iwo Jima Boulevard in Tarawa Terrace, Camp Lejeune, Onslow County, North Carolina. It is slated for interior and exterior renovations. The structure on the property is a single-story building utilized as the Tarawa Terrace II Child Development Center (CDC). The site features paved access from Iwo Jima Blvd, with a parking area to the north of the building. The building is currently occupied and is slated for interior and exterior renovations. ECS was contracted to perform an asbestos, lead paint, and visible mold assessment in the building prior to the proposed renovations.

The building construction includes concrete masonry unit (CMU) walls with brick veneer façade, light-gauge steel framing, and a pitched standing seam metal roof system on a concrete slab foundation. Interior finishes include CMU walls, suspended ceiling tiles, gypsum upper ceilings, gypsum recessed skylights, aluminum framed windows, sheet vinyl flooring, and various styles of vinyl composite tiles (VCT).

2.0 PURPOSE

The purpose of the Asbestos, Lead Paint, and Mold Assessment was to identify asbestos-containing materials (ACM), lead-containing paint (LCP), and visible mold which may require special handling and/or disposal if disturbed during construction activities. The identification of ACMs requires trained labor, regulated work practices, and special disposal. The identification of LCP or other lead hazards requires disclosure to contractors and monitoring of lead exposure.

3.0 METHODOLOGY

ECS performed the authorized Scope of Services in general accordance with our proposal, standard industry practice(s) and methods specified by regulation(s) for the identification of ACMs.

3.1 Asbestos-Containing Materials

The asbestos survey was performed by Mr. Braxton B. Dawson (NC Asbestos Inspector No. 12830) on August 30, 2024. The survey consisted of observing the accessible areas of the building for the presence of suspect materials that may contain asbestos. The survey involved detecting both friable materials (materials that can be pulverized or reduced to a powder by hand pressure when dry) and non-friable materials (materials that pose a hazard when sawn, sanded, drilled, or pulverized). Homogeneous materials (based on material type, color, texture, etc.) were identified during the survey.

The EPA National Emissions Standard for Hazardous Air Pollutants (NESHAP) requires a survey for asbestos before renovation or demolition. Demolition is defined under NESHAP as the removal of a load-bearing structural member, and renovation is an action that disturbs building materials. Based on requirements under NESHAP and North Carolina Asbestos Hazard Management Program (AHMP), administered by the Health Hazards Control Unit (HHCU) for renovation or demolition activities, ECS conducted a limited survey for potential ACM. The ACM survey was limited in that we did not conduct demolition, such as jack/sledgehammering, to expose potentially concealed materials. Samples were

collected in general accordance with Environmental Protection Agency (EPA) Standard 40 CFR 763 Subpart E, Asbestos Hazard Emergency Response Act (AHERA), and Occupational Safety and Health Administration (OSHA) Standard 29 CFR 1926.1101 Inspection Protocol.

Representative bulk samples were collected, placed in sealed packages, and submitted to SAI for analysis using the Environmental Protection Agency (EPA) recommended method of Polarized Light Microscopy (PLM) coupled with dispersion staining (Method No. EPA 600/R-93/116). SAI participates in the National Voluntary Laboratory Accreditation Program (NVLAP). Their NVLAP accreditation number is 200664-0. Several of the samples were layered and analyzed as multiple samples. EPA regulations require collecting multiple samples of each homogeneous area for laboratory analysis. The material type, sample location, and analytical results of each bulk sample are also summarized in the attached Asbestos Bulk Analysis report in **Appendices**.

Samples were analyzed using the “Positive Stop” methodology. If one sample of a homogeneous material is reported to contain asbestos, the remaining samples are not analyzed. If one sample of a material from a homogeneous area is reported to contain greater than 1% asbestos, then by EPA definition, it is characterized as an ACM regardless of additional analysis.

During the survey, ECS attempted to identify suspect ACMs in readily accessible areas. However, due to the destructive means required to identify some materials, certain areas were deemed inaccessible (i.e. behind walls or sub-grade materials) and were not surveyed for suspect ACMs.

3.2 Lead in Paint and Surface Coatings

ECS completed a lead paint screening within the building as part of our assessment activities. The collection of representative paint chip samples was performed throughout the interior and exterior of the building. Samples collected were containerized, labeled, and transported to SAI. Each of the paint chip samples were subsequently analyzed for the presence of lead reported in percent lead by weight via EPA Method SW 846, 7000B (Flame AAS). The chain-of-custody, which includes sample numbers and sample locations, is included in an Appendix of this report.

3.3 Visible Mold

The assessment included a non-invasive visual and olfactory survey for evidence of mold and moisture within the subject property. The assessment focused on the areas of the building to be renovated. The ECS site personnel observed readily accessible areas and selected building materials to evaluate visible suspect fungal growth and/or moisture-impacted materials. A reasonable effort was made to identify water and mold-impacted areas; however, this does not imply a guarantee that all possible reservoirs of mold were identified because mold or water-impacted building materials may be hidden by walls, flooring, partitions, etc.

As is the case with many assessments of this nature, this evaluation was limited to the areas of the property deemed reasonably accessible by ECS. Reasonable effort was made to identify mold and moisture-impacted areas. However, mold/moisture-impacted areas may remain unidentified.

4.0 RESULTS

The following is a summary of laboratory results, findings and observations.

4.1 Asbestos Sampling

A total of twenty-three (23) bulk samples from eleven (11) homogeneous areas were submitted to the laboratory, of which thirty-one (31) layers were analyzed.

An ACM is defined as any material containing more than one percent (>1%) asbestos as determined using the method specified in Appendix E, Subpart E, 40 CFR Part 763, Section 1, PLM. Materials are categorized by the U.S. EPA in the following categories:

- Friable ACMs are defined as any ACM that, when dry, can be crumbled, pulverized, or reduced to powder by hand pressure. Non-friable ACMs are defined as any ACM that, when dry, cannot be crumbled, pulverized, or reduced to powder by hand pressure.
- Category I non-friable ACMs include packings, gaskets, resilient floor coverings, and asphalt roofing products containing more than one percent (>1%) asbestos.
- Category II non-friable ACM are listed as any material, excluding Category I non-friable ACM, containing more than one percent (>1%) asbestos.

Regulated Asbestos Containing Materials (RACM) are friable ACM or non-friable ACM that will be or has been subjected to sanding, grinding, cutting, or abrading or has crumbled, been pulverized, or reduced to powder in the course of renovation and/or demolition operations.

SAI submitted a signed final laboratory report to ECS on September 11, 2024. None of the bulk samples submitted for analysis were reported to contain asbestos in detectable concentrations.

A complete list of the sampled materials submitted for analysis and material locations are included below. Sample locations can be found in **Appendix I** and photographs are located in **Appendix II**. Analytical results of each material are also summarized in the attached Asbestos Bulk Analysis report in **Appendix III**.

Asbestos Bulk Sample Locations and Analysis Results

Sample ID	Material Location	Material Description	Analytical Results	Category	Estimated Quantity
HA1-1	Mechanical/ Electrical Room	White TSI Sealant	ND (None Detected)	N/A (Not Applicable)	N/A
HA1-2	Mechanical/ Electrical Room	White TSI Sealant	ND	N/A	N/A
HA2-1	Mechanical/ Electrical Room	Red Firestop Caulk	ND	N/A	N/A

Sample ID	Material Location	Material Description	Analytical Results	Category	Estimated Quantity
HA2-2	Mechanical/ Electrical Room	Red Firestop Caulk	ND	N/A	N/A
HA3-1	Mechanical/ Electrical Room	Drywall and Joint Compound	ND	N/A	N/A
HA3-2	Mechanical/ Electrical Room	Drywall and Joint Compound	ND	N/A	N/A
HA4-1	Throughout Building Structure	Drywall and Joint Compound Attic Upper Ceiling	ND	N/A	N/A
HA4-2	Throughout Building Structure	Drywall and Joint Compound Attic Upper Ceiling	ND	N/A	N/A
HA5-1	Throughout Building Structure	2x2 Smooth CT Lower Ceiling Grid	ND	N/A	N/A
HA5-2	Throughout Building Structure	2x2 Smooth CT Lower Ceiling Grid	ND	N/A	N/A
HA6-1-A	Toddler Classroom Baths	Beige Sheet Vinyl	ND	N/A	N/A
HA6-1-B	Toddler Classroom Baths	Beige Sheet Vinyl	ND	N/A	N/A
HA6-2-A	Toddler Classroom Baths	Beige Sheet Vinyl	ND	N/A	N/A
HA6-2-B	Toddler Classroom Baths	Beige Sheet Vinyl	ND	N/A	N/A

Sample ID	Material Location	Material Description	Analytical Results	Category	Estimated Quantity
HA7-1-A	Throughout Building Flooring	Grey 12" VCT & Mastic	ND	N/A	N/A
HA7-1-B	Throughout Building Flooring	Grey 12" VCT & Mastic	ND	N/A	N/A
HA7-2-A	Throughout Building Flooring	Grey 12" VCT & Mastic	ND	N/A	N/A
HA7-2-B	Throughout Building Flooring	Grey 12" VCT & Mastic	ND	N/A	N/A
HA8-1-A	Throughout Building Structure	Grey CB & Mastic	ND	N/A	N/A
HA8-1-B	Throughout Building Structure	Grey CB & Mastic	ND	N/A	N/A
HA8-2-A	Throughout Building Structure	Grey CB & Mastic	ND	N/A	N/A
HA8-2-B	Throughout Building Structure	Grey CB & Mastic	ND	N/A	N/A
HA9-1	Laundry	Can Vase TSI Pipe Wrap	ND	N/A	N/A
HA9-2	Laundry	Can Vase TSI Pipe Wrap	ND	N/A	N/A
HA9-3	Laundry	Can Vase TSI Pipe Wrap	ND	N/A	N/A
HA10-1-A	Accent (Hallway & Lobby)	Teal 12" VCT & Mastic	ND	N/A	N/A

Sample ID	Material Location	Material Description	Analytical Results	Category	Estimated Quantity
Accent (Hallway & Lobby)	Accent (Hallway & Lobby)	Teal 12" VCT & Mastic	ND	N/A	N/A
Accent (Hallway & Lobby)	Accent (Hallway & Lobby)	Teal 12" VCT & Mastic	ND	N/A	N/A
Accent (Hallway & Lobby)	Accent (Hallway & Lobby)	Teal 12" VCT & Mastic	ND	N/A	N/A
HA11-1	2'x2' Pinhole CT	Laundry (250ft)	ND	N/A	N/A
HA11-2	2'x2' Pinhole CT	Laundry (250ft)	ND	N/A	N/A

4.2 Suspect or Assumed Asbestos-Containing Materials

Due to the inaccessibility or the destructive means that asbestos sampling requires, additional suspect ACMs may remain within the building hidden behind inaccessible areas that include, but are not limited to, sub-grade walls, structural members, topping slabs, sub-grade sealants, flooring located below underlayments, areas behind exterior walls, pipe trenches, and subsurface utilities, etc. These areas were deemed inaccessible and were not assessed.

If these materials are discovered during construction activities, they should be presumed to contain asbestos and be treated as ACMs or be sampled immediately upon discovery and prior to disturbance for asbestos content by a certified asbestos inspector in accordance with 29 CFR 1926.1101.

4.3 Lead in Paint and Surface Coatings

Paint and surface coatings which contain detectable concentrations of lead considered "lead-containing paints" (LCP). Since OSHA has no specific action level for lead in paint, all paint on the site found to have a measurable concentration of lead should be assumed to be lead containing. Work performed which may disturb lead-containing paint is regulated under OSHA as referenced under 29 CFR 1926.62.

Based on laboratory analysis of the paint chip samples collected and analyzed for lead content, lead was not detected above the method detection limit.

Summary Paint Chip Sampling Results

Sample ID	Location	Substrate	Component	Color	Result
PC-1	Building Interior	Metal	Sprinkler Pipes	Red	<0.0042%
PC-2	Building Interior	Concrete	Wall	Beige	<0.0074%
PC-3	Building Interior	Metal	Door	Brown	<0.0040%
PC-4	Building Interior	Metal	Door Frame	Beige	<0.0042%
PC-5	Building Interior	Concrete	Wall	Teal	<0.0028%
PC-6	Building Interior	Concrete	Wall	Blue	<0.0047%
PC-7	Building Interior	Concrete	Wall	Yellow	<0.0060%
PC-8	Building Interior	Concrete	Wall	Pink	<0.0071%
PC-9	Building Interior	Concrete	Wall	Purple	<0.0042%
PC-10	Building Interior	Concrete	Wall	Green	<0.0038%
PC-11	Building Interior	Concrete	Wall	Orange	<0.0044%
PC-12	Building Interior	Metal	Door	Beige	<0.0042%
PC-13	Building Interior	Metal	Door Frame	Beige	<0.0029%

4.4 Visible Mold and Moisture

Below is a summary of our visual and olfactory observations collected as part of this evaluation.

4.4.1 Observations and Findings

Based on the visual assessment conducted on August 30, 2024, ECS presents a summary of observations and findings.

- ECS did not observe evidence of visible mold or moisture during our assessment. However, it was reported that ceiling tiles had been replaced throughout the building due to HVAC condensation.
- Mold odors were not observed in the building or attic space at the time of our assessment.

Representative photographs of the building are attached to this report.

5.0 RECOMMENDATIONS AND REGULATORY REQUIREMENTS

Based on our understanding of the purpose of the Asbestos, Lead Paint, and Mold Assessment, the results of laboratory analysis, and our findings and observations, ECS presents the following recommendations.

5.1 Asbestos-Containing Materials

None of the bulk samples submitted to Scientific Analytical Institute, Inc. were reported to contain detectable concentrations of asbestos. If additional suspect asbestos-containing materials are uncovered which were not accessible during this sampling event, it is recommended that these materials be sampled or tested immediately upon discovery for asbestos content by an asbestos inspector in accordance with 29 CFR 1926.1101.

5.2 Lead in Paint and Surface Coatings

Based on the results of paint chip sampling, lead was not detected in the samples above the laboratory detection limit.

Paint and surface coatings which contain detectable concentrations of lead considered "lead-containing paints" (LCP). Since OSHA has no specific action level for lead in paint, all paint on the site found to have a measurable concentration of lead should be assumed to be lead containing. Work performed which may disturb lead-containing paint is regulated under OSHA as referenced under 29 CFR 1926.62.

5.3 Mold and Moisture

ECS did not observe evidence of visible mold or moisture during our assessment. However, it was reported that ceiling tiles had been replaced due to HVAC condensation as part of routine maintenance activities. ECS does not recommend additional assessment pertaining to mold at this time.

Note: The purpose of this survey was to evaluate areas where visible or apparent mold growth and/or moisture intrusion has occurred and provide findings and recommendations for remedial work efforts. Identification and recommendation(s) for correction of all moisture intrusion concerns were outside of the scope of services for this work.

6.0 LIMITATIONS

The conclusions and recommendations presented within this report are based upon a reasonable level of assessment within normal bounds and standards of professional practice for a site in this particular geographic setting. ECS is not responsible or liable for the discovery and elimination of hazards that may potentially cause damage, accidents, or injuries.

The observations, conclusions, and recommendations pertaining to environmental conditions at the subject site are necessarily limited to conditions observed, and/or materials reviewed at the time this study was undertaken. No warranty, expressed or implied, is made with regard to the conclusions and recommendations presented within this report. This report is provided for the exclusive use of the client. This report is not intended to be used or relied upon in connection with other projects or by other unidentified third parties without the written consent of ECS and the client.

Our recommendations are in part based on federal, state, and local regulations and guidelines. ECS does not assume the responsibility of the person(s) in charge of the site, or otherwise undertake responsibility for reporting to any local, state, or federal public agencies, any conditions at the site that may present a potential danger to public health, safety, or the environment. Under this scope of services, ECS assumes no responsibility regarding any response actions initiated as a result of these findings. General compliance with regulations and response actions are the sole responsibility of the Client and should be conducted in accordance with local, state, and/or federal requirements.

Appendix I: Figures



Asbestos Survey

Figure 1

Site Overview


Sample Locations

Tarawa Terrace II Child Development
Center

TT-113 Iwo Jima Boulevard
Jacksonville, NC 28543
ECS Project No. 49:23942

IMAGE SOURCE:

Google Earth

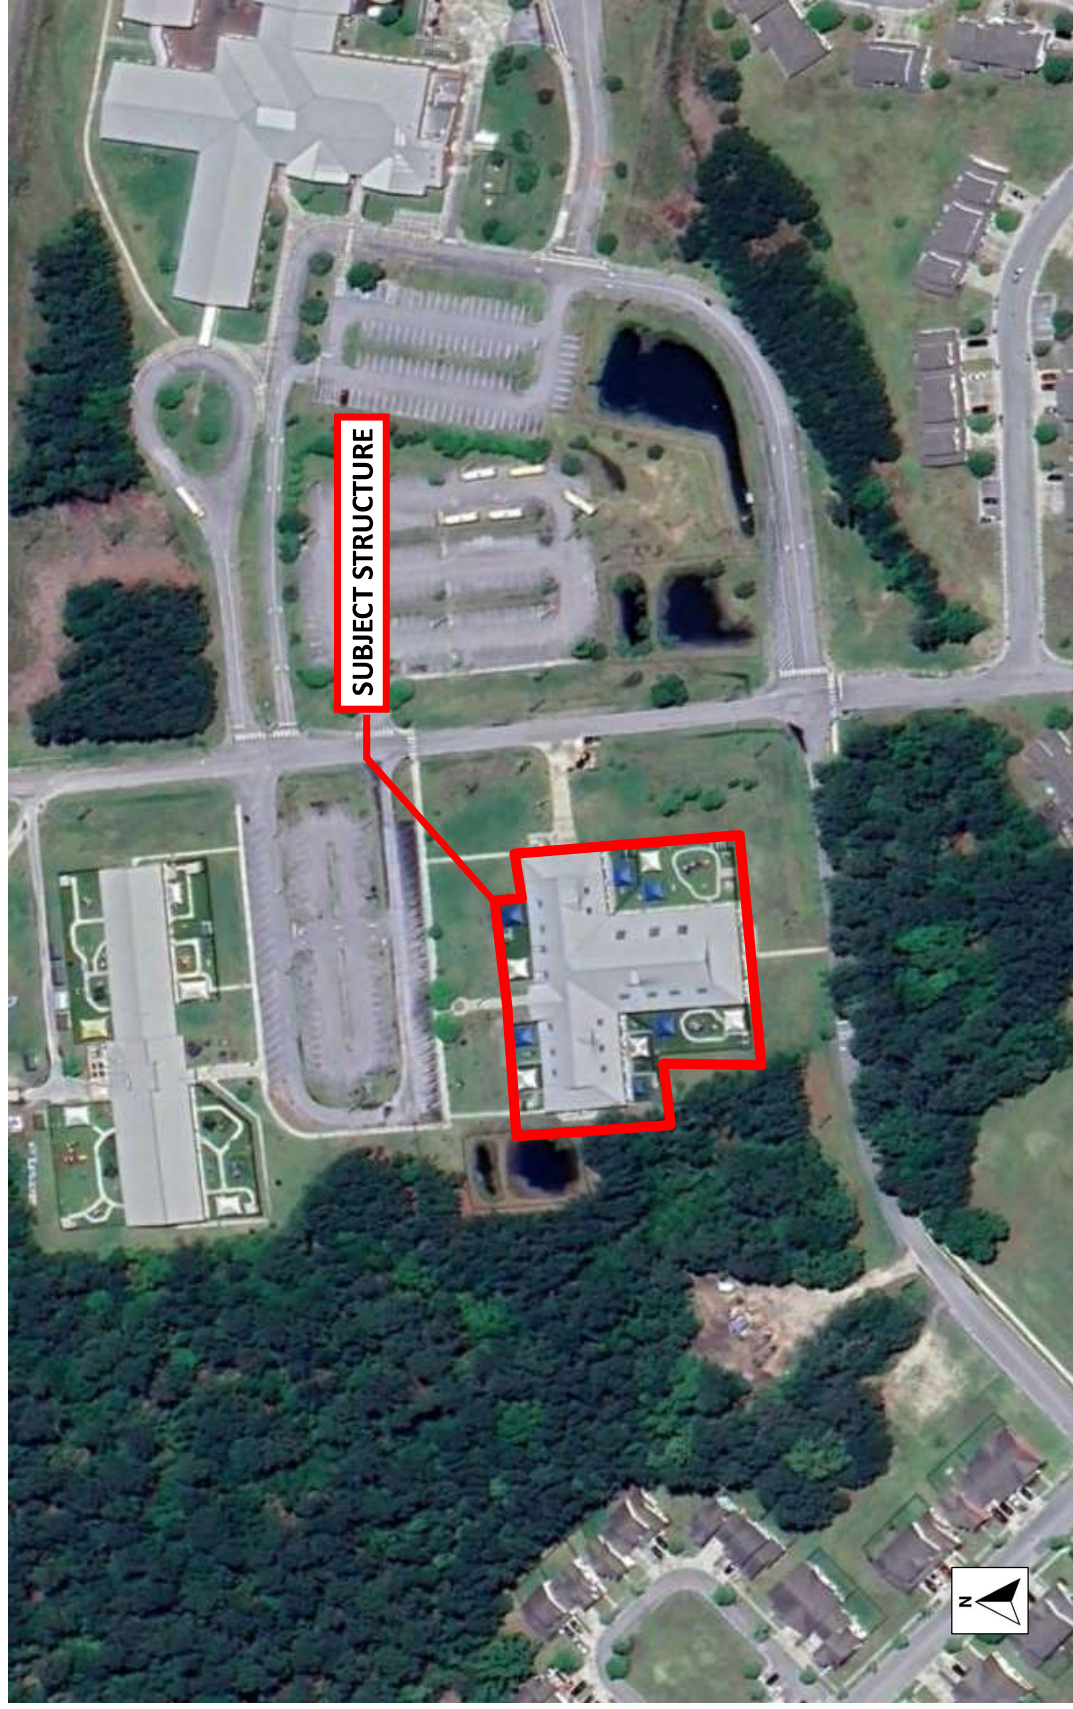



Asbestos Survey

Figure 2
Sample Locations
Tarawa Terrace II Child Development
Center

ECS Project No. 49-23942

LEGEND:

X-X

Sample Location



Asbestos Not Detected

LBP Sample Location

NOTES:

Not to Scale





LBP Survey

Figure 3

Sample Locations

Tarawa Terrace II Child Development Center

ECS Project No. 49-23942

LEGEND:

XX-X


Sample Location



Lead Not Detected

NOTES:

Not to Scale

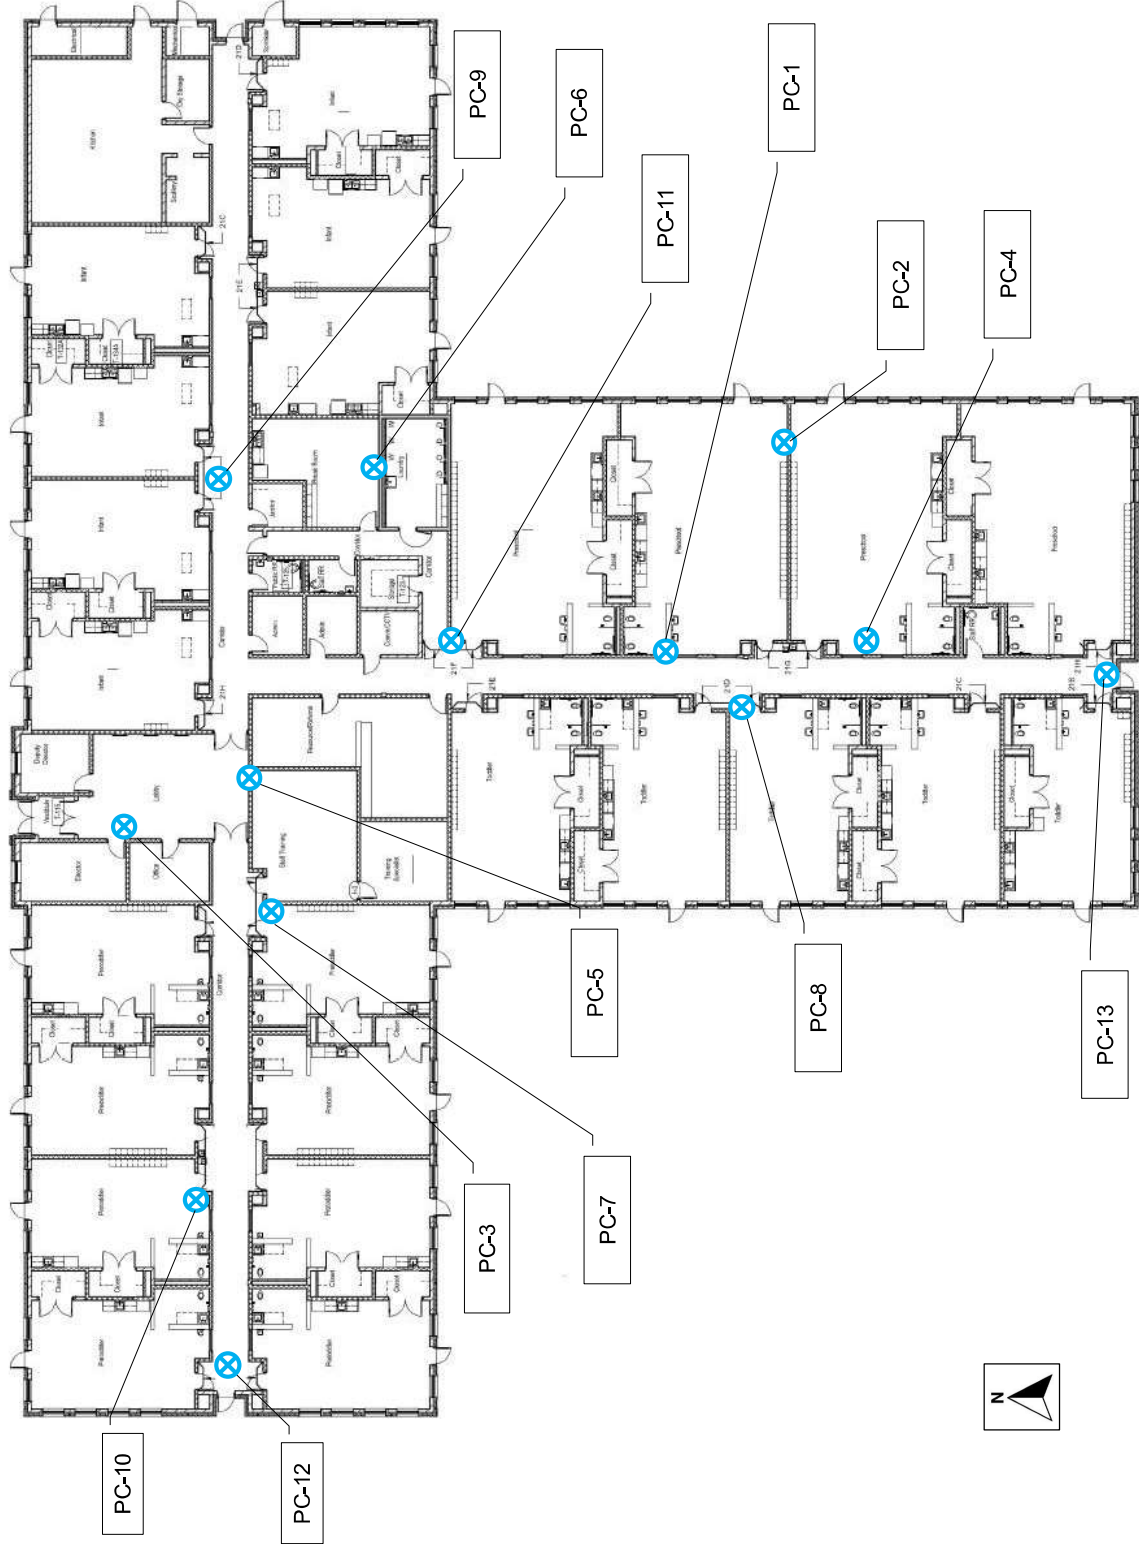

Appendix II: Site Photographs



1 - View of front entrance to TT113.



2 - View of the back of the building.



3 - View of the mechanical areas.



4 - View of the typical mechanical rooms



5 - View of the electrical room.



6 - View of the typical hallways.



7 - View of the kitchen.



8 - View of the nursery.



9 - View of the toddlers rooms.




10 - View of the staff lounge.




11 - View of storage closet.



12 - View of the laundry room.

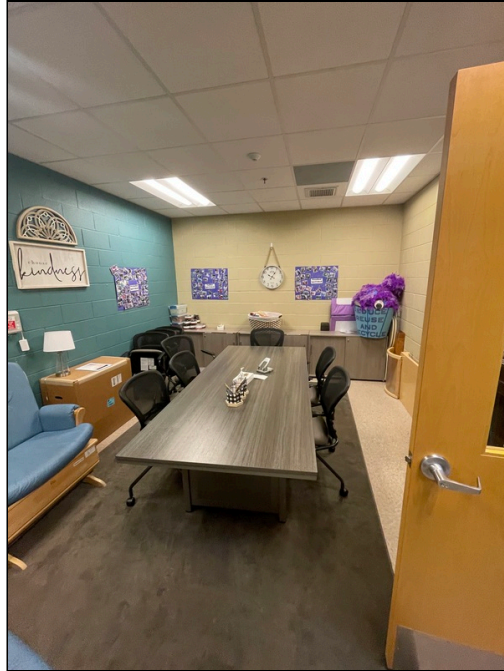

13 - View of the conference room.

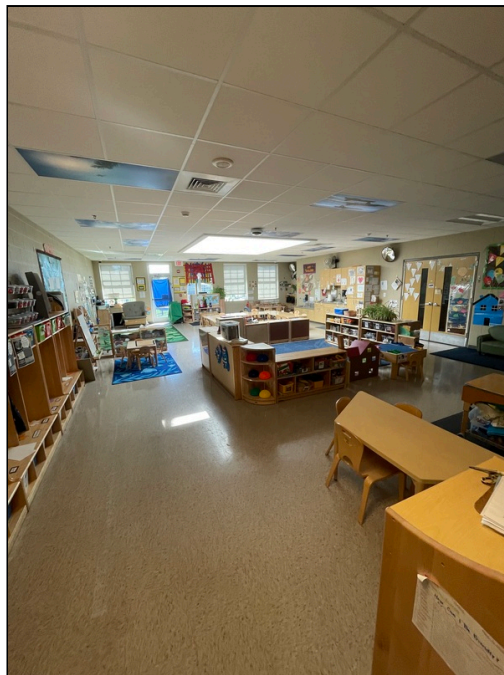

14 - View of the typical classrooms.



15 - View of the typical skylights.



16 - View of the attic space.




17 - View of the gypsum upper ceilings.



18 - View of the typical windows.



19 - View of the sheet vinyl in individual classrooms.

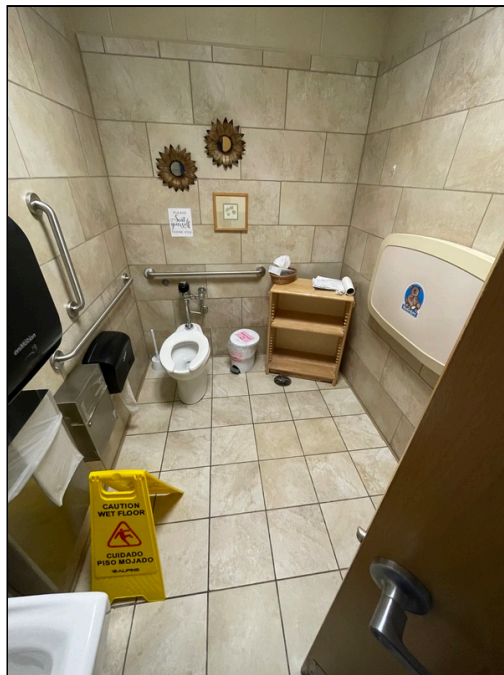

20 - View of the typical staff bathrooms.

Appendix III: Asbestos Bulk Sample Results



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E



Customer: ECS Southeast, LLP
6714 Netherlands Dr
Wilmington, NC 28405

Attn: Braxton Dawson

Lab Order ID: 10061850

Analysis: PLM

Date Received: 09/06/2024

Date Reported: 09/11/2024

Project: TT113 - Terawa Terrace II - CDC Camp
Lejeune, NC

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
HA1-1	White Foam TSI Sealant	None Detected	5% Cellulose	95% Other	White Non-Fibrous Homogeneous
10061850_0001					Ashed
HA1-2	White Foam TSI Sealant	None Detected	5% Cellulose	95% Other	White Non-Fibrous Homogeneous
10061850_0002					Ashed
HA2-1	Red Fire-Stop Caulk	None Detected		100% Other	Red Non-Fibrous Homogeneous
10061850_0003					Ashed
HA2-2	Red Fire-Stop Caulk	None Detected		100% Other	Red Non-Fibrous Homogeneous
10061850_0004					Ashed
HA3-1	Drywall & Joint Compound	None Detected	5% Cellulose	95% Other	White, Gray Non-Fibrous Homogeneous
10061850_0005	<i>drywall: none detected, joint compound: none detected</i>				Ashed
HA3-2	Drywall & Joint Compound	None Detected	5% Cellulose	95% Other	Gray, White Non-Fibrous Homogeneous
10061850_0006	<i>drywall: none detected, joint compound: none detected</i>				Ashed
HA4-1	Drywall & Joint Compound	None Detected	5% Cellulose	95% Other	Gray, White Non-Fibrous Homogeneous
10061850_0007	<i>drywall: none detected, joint compound: none detected</i>				Dissolved
HA4-2	Drywall & Joint Compound	None Detected	5% Cellulose	95% Other	White, Gray Non-Fibrous Homogeneous
10061850_0008	<i>drywall: none detected, joint compound: none detected</i>				Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (31)

Analyst

Nathaniel J. Durham

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E



Customer: ECS Southeast, LLP
6714 Netherlands Dr
Wilmington, NC 28405

Attn: Braxton Dawson

Lab Order ID: 10061850

Analysis: PLM

Date Received: 09/06/2024

Date Reported: 09/11/2024

Project: TT113 - Terawa Terrace II - CDC Camp
Lejeune, NC

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
HA5-1	2x2 Smooth Ceiling Tiles	None Detected	70% Fiber Glass	30% Perlite	Yellow Fibrous Homogeneous
10061850_0009					Dissolved
HA5-2	2x2 Smooth Ceiling Tiles	None Detected	70% Fiber Glass	30% Perlite	Yellow Fibrous Homogeneous
10061850_0010					Dissolved
HA6-1 - A	Beige Sheet Vinyl	None Detected	5% Cellulose 5% Fiber Glass	90% Other	Beige Fibrous Homogeneous
10061850_0011	sheet vinyl				Dissolved
HA6-1 - B	Beige Sheet Vinyl	None Detected	5% Cellulose	95% Other	Yellow Non-Fibrous Homogeneous
10061850_0024	mastic				Dissolved
HA6-2 - A	Beige Sheet Vinyl	None Detected	5% Fiber Glass 5% Cellulose	90% Other	Beige Fibrous Homogeneous
10061850_0012	sheet vinyl				Dissolved
HA6-2 - B	Beige Sheet Vinyl	None Detected	5% Cellulose	95% Other	Yellow Non-Fibrous Homogeneous
10061850_0025	mastic				Dissolved
HA7-1 - A	Grey 12' VCT and Mastic	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10061850_0013	VCT				Dissolved
HA7-1 - B	Grey 12' VCT and Mastic	None Detected		100% Other	Yellow Non-Fibrous Homogeneous
10061850_0026	mastic				Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (31)

Analyst

Nathaniel J. Durham

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E



Customer: ECS Southeast, LLP
6714 Netherlands Dr
Wilmington, NC 28405

Attn: Braxton Dawson

Lab Order ID: 10061850

Analysis: PLM

Date Received: 09/06/2024

Date Reported: 09/11/2024

Project: TT113 - Terawa Terrace II - CDC Camp
Lejeune, NC

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
HA7-2 - A	Grey 12' VCT and Mastic	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10061850_0014	VCT				Dissolved
HA7-2 - B	Grey 12' VCT and Mastic	None Detected		100% Other	Yellow Non-Fibrous Homogeneous
10061850_0027	mastic				Dissolved
HA8-1 - A	Grey Cove Base and Mastic	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10061850_0015	cove base				Ashed
HA8-1 - B	Grey Cove Base and Mastic	None Detected		100% Other	Yellow Non-Fibrous Homogeneous
10061850_0028	mastic				Ashed
HA8-2 - A	Grey Cove Base and Mastic	None Detected		100% Other	Gray Non-Fibrous Homogeneous
10061850_0016	cove base				Ashed
HA8-2 - B	Grey Cove Base and Mastic	None Detected		100% Other	Yellow Non-Fibrous Homogeneous
10061850_0029	mastic				Ashed
HA9-1	Canvas TSI Pipe Wrap	None Detected	20% Cellulose	80% Other	White Fibrous Homogeneous
10061850_0017					Ashed
HA9-2	Canvas TSI Pipe Wrap	None Detected	20% Cellulose	80% Other	White Fibrous Homogeneous
10061850_0018					Ashed

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogeneous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (31)

Analyst

Nathaniel J. Durham

Approved Signatory



Bulk Asbestos Analysis

By Polarized Light Microscopy
EPA Method: 600/R-93/116 and
40 CFR, Part 763, Subpart E, App.E



Customer: ECS Southeast, LLP
6714 Netherlands Dr
Wilmington, NC 28405

Attn: Braxton Dawson

Lab Order ID: 10061850

Analysis: PLM

Date Received: 09/06/2024

Date Reported: 09/11/2024

Project: TT113 - Terawa Terrace II - CDC Camp
Lejeune, NC

Sample ID	Description	Asbestos	Fibrous Components	Non-Fibrous Components	Attributes
Lab Sample ID	Lab Notes				Treatment
HA9-3	Canvas TSI Pipe Wrap	None Detected	20% Cellulose	80% Other	White Fibrous Homogeneous
10061850_0019					Ashed
HA10-1 - A	Teal 12" VCT and Mastic	None Detected		100% Other	Blue, Green Non-Fibrous Homogeneous
10061850_0020	VCT				Dissolved
HA10-1 - B	Teal 12" VCT and Mastic	None Detected		100% Other	Yellow Non-Fibrous Homogeneous
10061850_0030	mastic				Dissolved
HA10-2 - A	Teal 12" VCT and Mastic	None Detected		100% Other	Blue, Green Non-Fibrous Homogeneous
10061850_0021	VCT				Dissolved
HA10-2 - B	Teal 12" VCT and Mastic	None Detected		100% Other	Yellow Non-Fibrous Homogeneous
10061850_0031	mastic				Dissolved
HA11-1	2x2 Pinhole Ceiling Tiles	None Detected	70% Fiber Glass	30% Perlite	Gray Fibrous Homogeneous
10061850_0022					Dissolved
HA11-2	2x2 Pinhole Ceiling Tiles	None Detected	70% Fiber Glass	30% Perlite	Gray Fibrous Homogeneous
10061850_0023					Dissolved

Disclaimer: Due to the nature of the EPA 600 method, asbestos may not be detected in samples containing low levels of asbestos. We strongly recommend that analysis of floor tiles, vermiculite, and/or heterogenous soil samples be conducted by TEM for confirmation of "None Detected" by PLM. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. This report may not be used by the client to claim product endorsement by NVLAP or any other agency of the U.S. government. Analytical uncertainty available upon request. Scientific Analytical Institute participates in the NVLAP Proficiency Testing program. Unless otherwise noted blank sample correction was not performed. Estimated MDL is 0.1%.

Kiersten Smith (31)

Analyst

Nathaniel J. Durham

Approved Signatory

10061050

Client:	ECS Southeast, LLC	*Instructions: Use Column "B" for your contact info	
Contact:	Braxton Dawson		
Address:	6714 Netherlands Drive Wilmington, NC 28405	To See an Example Click the bottom Example Tab.	
Phone:	910-899-1289		
Fax:	910-686-9666	Enter samples between "<<" and ">>" Begin Samples with a "<<" above the first sample and end with a ">>" below the last sample. Only Enter your data on the first sheet "Sheet1"	
Email:	bdawson@ecslimited.com		
cc:		Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.	
Project:	TT113 - Terawa Terrace II - CDC Camp Lejeune, NC		
Client Notes:			
Date Sampled:	9/3/2024 0:00		
P.O. #:	49-23942		
Date Submitted:	9/5/2024 0:00		
Analysis:	PLM Bulk w/ Positive Stop		
TurnAroundTime:	72-hr TAT		

Scientific
Analytical
Institute

4604 Dundas Drive
Greensboro, NC 27407
Phone: 336.292.3888
Fax: 336.292.3313
Email: lab@sailab.com

Sample Number	Notes	Sample Description	Location
<<			
HA1-1		White Foam TSI Sealant	Mechanical/ Electrical Rooms
HA1-2		White Foam TSI Sealant	Mechanical/ Electrical Rooms
HA2-1		Red Fire-Stop Caulk	Mechanical/ Electrical Rooms
HA2-2		Red Fire-Stop Caulk	Mechanical/ Electrical Rooms
HA3-1	Composite	Drywall & Joint Compound	Mechanical/ Electrical Rooms
HA3-2	Composite	Drywall & Joint Compound	Mechanical/ Electrical Rooms
HA4-1	Composite	Drywall & Joint Compound	Upper ceilings/ Skylights
HA4-2	Composite	Drywall & Joint Compound	Upper ceilings/ Skylights
HA5-1		2x2 Smooth Ceiling Tiles	Ceilings Throughout
HA5-2		2x2 Smooth Ceiling Tiles	Ceilings Throughout
HA6-1		Beige Sheet Vinyl	Bathrooms in Classrooms
HA6-2		Beige Sheet Vinyl	Bathrooms in Classrooms
HA7-1		Grey 12' VCT and Mastic	Primary Flooring Throughout
HA7-2		Grey 12' VCT and Mastic	Primary Flooring Throughout
HA8-1		Grey Cove Base and Mastic	Classrooms and Hallways
HA8-2		Grey Cove Base and Mastic	Classrooms and Hallways
HA9-1		Canvas TSI Pipe Wrap	Laundry Room
HA9-2		Canvas TSI Pipe Wrap	Laundry Room
HA9-3		Canvas TSI Pipe Wrap	Laundry Room
HA10-1		Teal 12" VCT and Mastic	Accent Halways and Lobby
HA10-2		Teal 12" VCT and Mastic	Accent Halways and Lobby
HA11-1		2x2 Pinhole Ceiling Tiles	Laundry Rooms (250ft)
HA11-2		2x2 Pinhole Ceiling Tiles	Laundry Rooms (250ft)
>>			

Accepted ☒Rejected ☐

Braxton B. Dawson

Received By

Appendix IV: Lead Laboratory Analytical Results



Analysis for Lead Concentration in Paint Chips

by Flame Atomic Absorption Spectroscopy
EPA SW-846 3050B/6010C/7000B



Customer: ECS Southeast, LLP
6714 Netherlands Dr
Wilmington, NC 28405

Attn: Braxton Dawson

Lab Order ID: 10061848

Analysis: PBP

Date Received: 09/06/2024

Date Reported: 09/12/2024

Project: TT113 - Terawa Terrace II - CDC Camp
Lejeune, NC

Sample ID	Description	Mass (g)	Concentration (ppm)	Concentration (% by weight)
Lab Sample ID	Lab Notes			
PC-1	Red Metal Sprinkler Pipes	0.0958	<42	<0.0042%
10061848_0001				
PC-2	Beige CMU Walls	0.0537	<74	<0.0074%
10061848_0002				
PC-3	Brown Metal Door Frames	0.0994	<40.	<0.0040%
10061848_0003				
PC-4	Beige Metal Viewing Window Frames	0.0961	<42	<0.0042%
10061848_0004				
PC-5	Teal CMU Walls	0.0722	<28	<0.0028%
10061848_0005				
PC-6	Blue CMU Walls	0.0859	<47	<0.0047%
10061848_0006				
PC-7	Yellow CMU Walls	0.0662	<60.	<0.0060%
10061848_0007				
PC-8	Pink CMU Walls	0.0564	<71	<0.0071%
10061848_0008				

Disclaimer: Unless otherwise noted blank sample correction was not performed on analytical results. Scientific Analytical Institute participates in the AIHA ELPAT program. ELPAT Laboratory ID: 173190. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. Analytical uncertainty available upon request. The quality control samples run with the samples in this report have passed all EPA required specifications unless otherwise noted. RL: (Report Limit for an undiluted 50ml sample is 4µg Total Pb).

Athena Summa (13)

Analyst

Approved Signatory



Analysis for Lead Concentration in Paint Chips

by Flame Atomic Absorption Spectroscopy
EPA SW-846 3050B/6010C/7000B



Customer: ECS Southeast, LLP
6714 Netherlands Dr
Wilmington, NC 28405

Attn: Braxton Dawson

Lab Order ID: 10061848

Analysis: PBP

Date Received: 09/06/2024

Date Reported: 09/12/2024

Project: TT113 - Terawa Terrace II - CDC Camp
Lejeune, NC

Sample ID	Description	Mass (g)	Concentration (ppm)	Concentration (% by weight)
Lab Sample ID	Lab Notes			
PC-9	Purple CMU Walls	0.0962	<42	<0.0042%
10061848_0009				
PC-10	Green CMU Walls	0.1060	<38	<0.0038%
10061848_0010				
PC-11	Orange CMU Walls	0.0916	<44	<0.0044%
10061848_0011				
PC-12	Beige Metal Doors	0.0950	<42	<0.0042%
10061848_0012				
PC-13	Beige Metal Door Frames	0.1359	<29	<0.0029%
10061848_0013				

Disclaimer: Unless otherwise noted blank sample correction was not performed on analytical results. Scientific Analytical Institute participates in the AIHA ELPAT program. ELPAT Laboratory ID: 173190. This report relates only to the samples tested and may not be reproduced, except in full, without the written approval of SAI. Analytical uncertainty available upon request. The quality control samples run with the samples in this report have passed all EPA required specifications unless otherwise noted. RL: (Report Limit for an undiluted 50ml sample is 4µg Total Pb).

Athena Summa (13)

Analyst

Approved Signatory

10061848

Client: ECS Southeast, LLP Contact: Braxton Dawson Address: 6714 Netherlands Drive Wilmington, NC 28405 Mobile #: 910-899-1289 Fax: 910-686-9666 Email: bdawson@ecslimited.com cc: Project: TT113 - Terawa Terrace II - CDC Camp Lejeune, NC Client Notes: Date Sampled: 9/3/2024 17:00 P.O. #: 49-23942 Date Submitted: 9/5/2024 12:00 Analysis: Paint Chips by Flame AA (PBP) TurnAroundTime: 3-day	*Instructions: Use Column "B" for your contact info To See an Example Click the bottom Example Tab. Enter samples between "<<" and ">>" Begin Samples with a "<<" "above the first sample and end with a ">>" below the last sample. Only Enter your data on the first sheet "Sheet1" Note: Data 1 and Data 2 are optional fields that do not show up on the official report, however they will be included in the electronic data returned to you to facilitate your reintegration of the report data.	Lead Paint Chips Scientific Analytical Institute  4604 Dundas Drive Greensboro, NC 27407 Phone: 336.292.3888 Fax: 336.292.3313 Email: lab@sailab.com
--	--	---

Sample Number	Notes	Sample Description	Location
<<			
PC-1		Red Metal Sprinkler Pipes	Fire Sprinklers
PC-2		Beige CMU Walls	Primary Wall Coating
PC-3		Brown Metal Door Frames	Classrooms/Hallways
PC-4		Beige Metal Viewing Window Frames	Classrooms/Hallways
PC-5		Teal CMU Walls	Hallway Accent Walls
PC-6		Blue CMU Walls	Hallway Accent Walls
PC-7		Yellow CMU Walls	Hallway Accent Walls
PC-8		Pink CMU Walls	Hallway Accent Walls
PC-9		Purple CMU Walls	Hallway Accent Walls
PC-10		Green CMU Walls	Hallway Accent Walls
PC-11		Orange CMU Walls	Hallway Accent Walls
PC-12		Beige Metal Doors	Emergency Exits
PC-13		Beige Metal Door Frames	Emergency Exits
>>			


 Braxton B. Dawson

Accepted ☒
 Rejected ☐

Received By
 C-1 9/6. 10:30 AM

Appendix V: Certifications/ Licenses



NC DEPARTMENT OF
**HEALTH AND
HUMAN SERVICES**

ROY COOPER • Governor

KODY H. KINSLEY • Secretary

MARK T. BENTON • Deputy Secretary for Health

SUSAN KANSANGRA • Assistant Secretary for Public Health
Division of Public Health

February 5, 2024

Braxton B Dawson III
6213 Dominion Dr
Wilmington, NC 28403

Dear Mr. Dawson:

Based upon the review of your accreditation application, the Health Hazards Control Unit (HHCU) has determined that you have fulfilled the requirements and are eligible for asbestos accreditation as a(n) INSPECTOR. Your assigned North Carolina accreditation number is 12830, which is reflected on your enclosed North Carolina Accreditation card. Please be sure to take this card with you to any asbestos work site where you are employed. The State requires that all persons conducting asbestos abatement or asbestos management activities be accredited and have their identification card on site.

Your North Carolina Inspector accreditation will expire on JANUARY 31, 2025. It is NOT the policy of the HHCU to issue renewal notices. If you wish to continue working as a(n) Inspector after this expiration date, you must successfully complete the required training and submit a completed application to this office prior to January 31, 2025. If you should continue to perform asbestos management activities as a(n) Inspector without a valid North Carolina accreditation, you will be in violation of State regulations and may be cited for noncompliance.

Sincerely,

Ed Norman
Program Manager
Health Hazards Control Unit

**North Carolina
Asbestos Accreditation**



Braxton B Dawson III
6213 Dominion Dr
Wilmington, NC 28403

142877

EXPIRATION			
01-31-2025			
DOB	SEX	HT	WT
04-06-1982	M	6'2"	250
CLASS	#	EXP	
AIR MONITOR	80961	01-25	
INSPECTOR	12830	01-25	

NC DEPARTMENT OF HEALTH AND HUMAN SERVICES • DIVISION OF PUBLIC HEALTH



LOCATION: 5505 Six Forks Road, Building 1, Raleigh, NC 27609
MAILING ADDRESS: 1912 Mail Service Center, Raleigh, NC 27699-1912
www.ncdhhs.gov • TEL: 919-707-5950 • FAX: 919-870-4808

AN EQUAL OPPORTUNITY / AFFIRMATIVE ACTION EMPLOYER



NC DEPARTMENT OF
**HEALTH AND
HUMAN SERVICES**

ROY COOPER • Governor

JOE H. KINSLEY • Secretary

MARK T. BENTON • Deputy Secretary for Health

SUSAN KANSANGRA • Assistant Secretary for Public Health
Division of Public Health

July 11, 2024

Braxton B Dawson III
515 Green Meadows Dr
Wilmington, NC 28405

Dear Mr. Dawson:

The Health Hazards Control Unit (HHCU) has determined that you have fulfilled the application requirements and are eligible for lead certification as a(n) RISK ASSESSOR. Your assigned Risk Assessor certification number is 120251, which is reflected on your enclosed North Carolina Lead Certification card. The State requires that all persons conducting regulated lead-based paint activities be certified and have their identification card on-site.

A "Lead-Based Paint Activity Summary" shall be submitted to the HHCU by the certified inspector or risk assessor within 45 days of each inspection, risk assessment, or lead hazard screen conducted. The information shall be submitted on a form provided or approved by the Program, per 10A NCAC 41C .0807(b), Lead-Based Paint Hazard Management Program Rules.

Accredited refresher training must be completed at least every 24 months from the date of the last accredited training course **AND** within twelve months prior to applying for certification. The HHCU strongly recommends that individuals note the date of certification expiration and ensure all refresher training meets the above requirements.

Your North Carolina Risk Assessor certification will expire on JULY 31, 2025. It is NOT the policy of the HHCU to issue renewal notices. If you wish to continue working as a(n) Risk Assessor after this expiration date, you must successfully complete the required training and submit a completed application to this office prior to July 31, 2025. If you should perform lead-based paint activities as a(n) Risk Assessor without a valid North Carolina certification, you will be in violation of State regulations and may be cited for noncompliance.

If you have any questions, please contact our office at (919) 707-5954.

Sincerely,

Ed Norman
Program Manager
Health Hazards Control Unit

		NORTH CAROLINA LEAD CERTIFICATION	
Braxton B Dawson III 515 Green Meadows Dr Wilmington, NC 28405			
DOB	SEX	HT	WT
04-06-1982	M	6'2"	250
DISCIPLINE	#	LAST COURSE	EXPIRATION
RISK ASSESSOR	120251	INS 07-26-2023 RIS 07-27-2023	07-31-2025

HUMAN SERVICES • DIVISION OF PUBLIC HEALTH

LOCATION: 5505 Six Forks Road, Building 1, Raleigh, NC 27609
MAILING ADDRESS: 1912 Mail Service Center, Raleigh, NC 27699-1912
www.ncdhhs.gov • TEL: 919-707-5950 • FAX: 919-870-4808

AN EQUAL OPPORTUNITY / AFFIRMATIVE ACTION EMPLOYER

