

HAZARDOUS MATERIALS ASSESSMENT



EIELSON WASTE WATER TREATMENT PLANT REPAIR SCADA SYSTEM

EIELSON AFB, ALASKA

**Surveyed
November 5-7, 2024**

**Report Date
December 20, 2024**

EHS-ALASKA, INC.
ENGINEERING, HEALTH & SAFETY CONSULTANTS
11901 BUSINESS BLVD., SUITE 208
EAGLE RIVER, ALASKA 99577-7701

HAZARDOUS MATERIALS ASSESSMENT EIELSON WASTE WATER TREATMENT PLANT REPAIR SCADA SYSTEM

EIELSON AFB, ALASKA

TABLE OF CONTENTS

	PAGE NO.
OVERVIEW	3
A. GENERALIZED REQUIREMENTS FOR HAZARDOUS MATERIALS	3
B. BUILDING DESCRIPTION	4
C. SAMPLING AND ANALYSIS	5
1. Asbestos-Containing Materials	5
2. Lead-Containing Materials	6
3. Testing of Paints and Sealants for PCB's	6
D. SURVEY RESULTS	6
1. Asbestos-Containing Materials	6
2. Asbestos in Dusts	15
3. Lead-Containing Materials	15
4. PCB-Containing Materials	16
5. Mercury-Containing Materials	18
6. Other Hazardous Materials	18
E. REGULATORY CONSTRAINTS	19
1. Asbestos-Containing Materials	19
2. Dusts with Asbestos	19
3. Lead-Containing Materials	20
4. PCB-Containing Materials	21
5. Mercury-Containing Materials	22
6. Other Hazardous Materials	22
F. RECOMMENDATIONS	23
1. Asbestos-Containing Materials	23
2. Dusts with Asbestos	23
3. Lead-Containing Materials	23
4. PCB-Containing Materials	23
5. Mercury-Containing Materials	24
6. Other Hazardous Materials	24
G. LIMITATIONS	24
1. Accuracy of Information	24
2. Site Conditions	24
3. Changing Regulatory Constraints	25

APPENDICES

Appendix A	Asbestos Bulk Field Survey Data Sheets and Lab Reports
Appendix B	Bulk Product PCB Field Survey Data Sheets and Lab Reports
Appendix C	Lead Analyzer Test Results
Appendix D	Drawings of Sample Locations

HAZARDOUS MATERIALS ASSESSMENT
EIELSON WASTE WATER TREATMENT PLANT REPAIR SCADA SYSTEM
EIELSON AFB, ALASKA

OVERVIEW

The Waste Water Treatment Plant (B2316), Digester Building (B2317), Final Effluent Sampling House (B2320), Effluent Sampling Building (B2321), Miox Building (B2322), and the Blower Building (B2324), herein referenced as the Waste Water Treatment Plant buildings, located in Eielson Air Force Base, Alaska, were surveyed for the presence of asbestos-containing materials (ACM), and other potentially hazardous materials as a part of the design services for the Eielson Waste Water Treatment Plant Repair SCADA System Project for the United States Air Force. The survey also provided a “good faith” inspection for hazardous materials that may be disturbed during the construction. The proposed work includes the disturbance, demolition, removal and disposal of lead-containing paints and/or lead-containing materials that is incidental to the renovation and remodeling project. Mr. John H. Lamont of EHS-Alaska, Inc. (EHS-Alaska) conducted the inspections in November 2024. It will be the contractor's responsibility to take this baseline data, and to conduct hazardous materials removal in compliance with all regulatory requirements. This assessment includes data from previous inspections of the facility.

A. GENERALIZED REQUIREMENTS FOR HAZARDOUS MATERIALS

Potentially hazardous materials have been identified in the Waste Water Treatment Plant buildings that will be affected by the proposed renovations. Those materials include asbestos, lead, polychlorinated biphenyls (PCBs), mercury, and radioactive materials. Not all materials were tested for potentially hazardous components, other potentially hazardous materials, including those exterior to the buildings, such as contamination from underground fuel tanks may be present, but are not part of this report.

Buildings or portions of buildings that were constructed prior to 1978 which are residences, or contain day care facilities, kindergarten classes or other activities frequently visited by children under 6 years of age are classified as *child occupied facilities*. All work which is NOT classified as “minor repair and maintenance activities” (as defined by the regulations), that takes place in the “*child occupied*” portions of facilities must comply with the requirements of 40 CFR 745. These buildings are not classified as a *child occupied facilities* and therefore the requirements of 40 CFR 745 are not applicable.

Only the materials that will be directly affected by this project are required to be removed. The quantities and types of materials are incorporated into the design documents for this renovation. The removal and disposal of potentially hazardous materials are highly regulated, and it is anticipated that removal and disposal of asbestos, lead and chemical hazards will be conducted by a subcontractor to the general contractor who is qualified for such removal. It is anticipated that the general contractor and other trades will be able to conduct their work using engineering controls and work practices to control worker exposure and to keep airborne contaminants out of occupied areas of the buildings.

Settled and concealed dusts in areas not subject to routine cleaning are present throughout the buildings, including the roof, and inside and on top of architectural, mechanical, electrical, and structural elements, and those dusts are assumed to contain regulated air contaminants. This should not be read to imply that there is an existing hazard to building occupants (normal occupants of the building as opposed to construction workers working in the affected areas). However, depending on the specific work items involved and on the means and methods employed when working in the affected areas, construction workers could be exposed to regulated air contaminants from those dusts in excess of the OSHA Permissible Exposure Limits (PELs).

The settled and concealed dusts were examined by an EPA Certified Building Inspector but were not sampled. The inspector determined that the dusts are not “asbestos debris” from an asbestos-containing

building material (ACBM). Based on similar sampling from similar buildings, the inspector also determined that the dusts are unlikely to contain more than one percent (1%) asbestos by weight, and therefore are not an asbestos-containing material (ACM). Reference 40 CFR 763.83.

“Awareness training” (typically 2 hours) and possibly respiratory protection will be required for all Contractor Personnel who will be disturbing the dusts. The extent of the training and protective measures will depend upon the airborne concentrations measured during air monitoring of the contractors work force, which depends on the means and methods employed to control the dusts. The air monitoring may be discontinued following a “negative exposure assessment” showing that worker exposures are below the OSHA permissible exposure limits for the type of work and means and methods employed. Previous air monitoring from similar jobs with similar conditions may be used as historical data to establish a “negative exposure assessment”.

B. BUILDING DESCRIPTION

The Waste Water Treatment Plant was originally constructed in 1952, and the Digester Building was originally constructed in 1996, both with various upgrades and repairs through the years. EHS-Alaska was not provided the construction history on the other buildings (B2320, B2321, B2322, and B2324) related to the project.

Waste Water Treatment Plant Building 2316

The interior partitions were primarily of framed construction, concrete masonry unit (CMU) block walls, and poured concrete walls. The interior office area walls were typically of gypsum wallboard.

The exterior walls were of CMU block walls with an Exterior Insulation Finishing System (EIFS) on the exterior finish. The roofs were typically of concrete or steel beams and open web steel joists supporting a metal deck.

The corridor and office ceilings were typically of 2' x 4' acoustic ceiling tiles. The toilet rooms had gypsum wallboard ceilings. The rest of the building typically had exposed roof deck ceilings.

Floor finishes in the office and corridor areas were mainly of vinyl composition tile on concrete. The toilet rooms had glazed ceramic tiles. The rest of the building typically had exposed concrete floor finishes.

The building was heated by a hydronic heating system combined with various fan coil units supplying ventilation and heating. The heating and domestic water piping was typically insulated with fiberglass.

Digester Building 2317

The interior walls were primarily concrete masonry unit (CMU) block walls and poured concrete walls. The exterior walls were of CMU block walls and poured concrete. The roof structure was typically of concrete. Ceilings were typically exposed concrete decking and floor finishes typically had exposed concrete floors. The building was heated by a hydronic heating system. The heating piping was typically insulated with fiberglass.

Final Effluent Sampling House Building 2320

The exterior walls were of CMU block walls and EIFS. The roof is assumed to be of wood joists supporting a plywood deck. The ceiling was unfinished plywood paneling, and the floor finishes were of exposed concrete. The building was heated by a hydronic heating system and the piping was insulated with fiberglass.

Effluent Sampling Building 2321

The lower portion (approximately 2 and a half feet from finish floor) of the exterior walls were of CMU block walls with the remaining upper portion being of framed construction and EIFS. The roof is assumed to be of wood joists supporting a plywood deck. The ceiling was unfinished plywood paneling, and the floor finishes were of exposed concrete. The building was heated by an electric unit heater.

Miox Building 2322

The exterior walls were of CMU block walls with an EIFS. The roof was of open web steel joists supporting a metal deck. Ceilings were exposed to the metal decking and the floor finishes were of exposed concrete. The building was heated by various electric unit heaters and had an air handling unit in the tank room.

Blower Building 2324

The exterior walls were of CMU block walls with an EIFS. The roof was of open web steel joists supporting a metal deck. Ceilings were exposed to the metal decking and the floor finishes were of exposed concrete. The building was heated by various electric unit heaters.

C. SAMPLING AND ANALYSIS**1. Asbestos-Containing Materials**

The survey included sampling of suspect ACM materials that had not been sampled in prior asbestos surveys, or samples of materials where previous sampling had been inconsistent. Refer to the asbestos management plan available for review in the offices for information on previous sampling which is not included in this report. Additional testing of materials pertinent to the project, including asbestos and lead was conducted and is included in this report.

The samples were analyzed for the presence of asbestos using polarized light microscopy (PLM), analysis, as recommended by EPA, to determine the composition of suspected ACMs (EPA method 600/M4-82-020). Only materials containing more than 1% total asbestos were classified as "asbestos-containing" based on EPA and OSHA criteria. Samples analyzed to have less than 10% asbestos were "point-counted" by the laboratory for more accuracy. Samples listed as having a "Trace by Point Count" had asbestos fibers found in the material, but the fibers were not present at the counting grids. Table 1 in Part D below contains a summary list of the asbestos bulk samples and the applicable results.

The Bulk Asbestos samples were analyzed for asbestos content by International Asbestos Testing Laboratories (IATL), Mt. Laurel, New Jersey, a National Voluntary Laboratory Accreditation Program (NVLAP) accredited laboratory.

EPA regulations under 40 CFR 763 require the use of PLM to determine whether or not a material contains asbestos. While PLM analysis does a good job for most materials, it does have some limitations. Fibers may be undetectable if their small size prevents visibility under a standard optical microscope, or if they are bound in an organic matrix to the point that the fibers are obscured. At the discretion of the building inspector and the client, some types of samples may be analyzed or re-analyzed by what is called Transmission Electron Microscopy for Non-Friable Organically Bound (TEM NOB) materials. TEM NOB is the definitive method for determining if asbestos is present, but TEM NOB use is not required by the EPA. TEM NOB analysis was not done for this project.

Field survey data sheets and laboratory reports of the bulk samples are included in Appendix A. Drawings showing sample locations are included as Appendix D.

2. Lead-Containing Materials

Nearly all surfaces in the building were coated with paint and most surfaces had been repainted. EHS-Alaska tested representative paints throughout the affected areas of the building using a SciAps X-550 Pb X-Ray Fluorescence (XRF) lead paint analyzer (Serial # 01052 with firmware version 2.6.1.4). The lead testing conducted was not a Lead-Based Paint Inspection or Screening as defined by Department of Housing and Urban Development (HUD) or EPA regulations, but was done to test surfaces that may be representative of those likely to be affected by this project. If surfaces and materials other than those tested are identified, the Contractor shall test and treat appropriately. Refer to the Lead Analyzer Test Results Table in Appendix C that identifies the surfaces tested, and the results. The Lead Test Locations are shown in Appendix D.

EPA and HUD have defined lead-based paint as any paint or other surface coating that contains lead equal to or in excess of 1.0 milligram per square centimeter (mg/cm²) or 0.5 percent by weight. XRF results are classified as positive (lead is present at 1.0 mg/cm² or greater), negative (less than 1.0 mg/cm² of lead was present) or inconclusive (the XRF could not make a conclusive positive or negative determination). Tests that were invalid due to operator error are shown as void tests.

A Performance Characteristic Sheet (PCS) for the SciAps X-550 Pb is available upon request. This PCS data provides supplemental information to be used in conjunction with Chapter 7 of the "HUD Guidelines". Performance parameters provided in the PCS are applicable when operating the instrument using the manufacturer's instructions and the procedures described in Chapter 7 of the "HUD Guidelines". The instrument was operated in accordance with manufacturer's instructions and Chapter 7 of the HUD Guidelines. No substrate correction is required for this instrument. There is no inconclusive classification for this instrument when using the 1.0 mg/cm² threshold.

3. Testing of Paints and Sealants for PCB's

Representative paint and sealant samples were collected from throughout the Waste Water Treatment Plant (B2316 and B2317) and analyzed for total PCBs. Samples of paint were collected by scraping the paint down to bare substrate, or by cutting out a portion of the sealants. Samples were analyzed for total PCBs by EMSL Analytical, Inc, 200 Route 130 North, Cinnaminson, New Jersey. Results of the total PCB analysis for each sample was used to determine if the dried paint or sealants are considered PCB bulk product waste. Field Survey Data Sheets and Lab results are included in Appendix B. Drawings showing sample locations is provided in Appendix D.

D. SURVEY RESULTS

1. Asbestos-Containing Materials

Building 2316

The following Table 1A lists the samples taken in November 2024 in Waste Water Treatment Plant Building 2316, and the results of the laboratory analysis. Asbestos field survey data sheets and laboratory reports are included as Appendix A. Refer to Appendix D for sample locations.

TABLE 1A

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2316-2411-A01	White joint compound; with white tape	Office 104: West wall above suspended ceiling system on gypsum wall board. Photo 11 11/06	Both Layers None Detected

HAZARDOUS MATERIALS ASSESSMENT

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2316-2411-A02	Red "Firestop"	Office 104: West wall above suspended ceiling system at channel bracing penetration through gypsum wall board. Photo 14 11/06	None Detected
B2316-2411-A03	Green "Firestop"	Office 104B: West wall above suspended ceiling system at conduit penetration through gypsum wall board. Photo 16 11/06	None Detected
B2316-2411-A04	LCT-2: 2'x4' straight edge acoustic ceiling tile with random 1/4" fissures and random 1/8" dense dots	Office 104: Acoustic ceiling tile in suspended ceiling system. Photo 18 11/06	None Detected
B2316-2411-A05	White joint compound; with CB-1: beige 4" vinyl cove base; with cream mastic	Vestibule 101: South wall left side of exterior door, vinyl cove base over metal nosing over gypsum wall board. Photo 24 11/06	All Layers None Detected
B2316-2411-A06	FT-1: 12"x12" off-white with beige streaks vinyl floor tile; with tan mastic	Vestibule 101: South wall left side of threshold, vinyl floor tile over concrete. Photo 26 11/06	Both Layers None Detected
B2316-2411-A07	White sealant	Vestibule 101: South wall left side of exterior door, white sealant between metal door frame and gypsum wall board. Photo 29 11/06	None Detected
B2316-2411-A08	White joint compound; with white gypsum wall board; with CB-1: beige 4" vinyl cove base; with cream mastic	Corridor 102: South wall right side of door, vinyl cove base over gypsum wall board. Photo 35 11/06	All Layers None Detected
B2316-2411-A09	FT-1: 12"x12" off-white with beige streaks vinyl floor tile; with tan mastic	Corridor 102: South wall right side of threshold, vinyl floor tile over concrete. Photo 36 11/06	Both Layers None Detected
B2316-2411-A10	Beige faux wood linoleum flooring; over light grey unknown vinyl floor tile; with tan mastic	Controls Room 104B: South wall left side of threshold to controls room, multiple layers of flooring over unknown substrate. Photo 41 11/06	All Layers None Detected
B2316-2411-A11	CB-2: dark grey 4" vinyl cove base; with cream mastic; with tan mastic	Controls Room 104B: South wall left side of door, vinyl cove base over gypsum wall board. Photo 42 11/06	All Layers None Detected
B2316-2411-A12	White sealant	Bathroom 105: North wall left side of sink, sealant between ceramic sink and ceramic wall tile. Photo 54 11/06	None Detected

HAZARDOUS MATERIALS ASSESSMENT

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2316-2411-A13	Grey penetration putty	Garage 103: North wall at conduit penetration through CMU block wall. Photo 69 11/06	None Detected
B2316-2411-A14	Hard black sealant	Laboratory 109: Hard black sealant at black "Transite" countertop on south wall of room. Photo 105 11/06	None Detected
B2316-2411-A15	Black cementitious lab countertop	Laboratory 109: Black "Transite" countertop on west wall of room next to fume hood. Photo 110 11/06	None Detected
B2316-2411-A16	White semi-fibrous fume hood enclosure panel	Laboratory 109: White enclosure material inside of fume hood. Photo 114 11/06	None Detected
B2316-2411-A17	LCT-1: 2'x4' straight edge acoustic ceiling tile with 1/4" to 1/2" random fissures and random 1/16" to 1/8" dense dots	Laboratory 109: Southeast corner of Lab, acoustic ceiling tile in suspended ceiling system. Photo 116 11/06	None Detected
B2316-2411-A18	CB-3: maroon 4" vinyl cove base; with cream mastic	Laundry 111: East wall left side of door, vinyl cove base over gypsum wall board. Photo 122 11/06	Both Layers None Detected
B2316-2411-A19	FT-2: 12"x12" white with black speckles vinyl floor tile; with cream mastic	Laundry 111: Left side of threshold to room, vinyl floor tile over concrete. Photo 123 11/06	Both Layers None Detected
B2316-2411-A20	Grey duct seam sealant	Lower Level Clarifier Room: East wall of lower room, sealant on rectangular metal duct. Photo 143 11/06	None Detected
B2316-2411-A21	Red gasket material	Utilidor Connecting Lower Clarifier Room to Lower Digester Room: Red gasket between metal flanges. Photo 151 11/06	None Detected
B2316-2411-A22	Grey cementitious grout	Utilidor Connecting Lower Clarifier Room to Lower Digester Room: North wall closer to Clarifier Room, grout at penetration through concrete wall. Photo 154 11/06	None Detected
B2316-2411-A23	Black gasket material	Lower Level Digester Room: Black gasket between metal flanges. Photo 170 11/06	None Detected
B2316-2411-A24	Red gasket material	Lower Level Digester Room: Red gasket between metal flanges. Photo 172 11/06	None Detected
B2316-2411-A25	Silver sealant	Middle Level Digester Room: South wall, silver sealant on concrete wall. Photo 181 11/06	None Detected

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2316-2411-A26	Grey sealant	Dry Well 114: North wall, left side of metal rectangular duct through concrete wall. Photo 191 11/06	None Detected
B2316-2411-A27	White duct wrap	Boiler Room II 119: Rectangular metal duct through west wall of room, white duct wrap under silver foil over metal duct. Photo 248 11/07	None Detected
B2316-2411-A28	White sealant	Generator Room 120: West wall at pipe penetration through CMU block wall. Photo 263 11/07	None Detected
B2316-2411-A29	Black rubber gasket	Office 104: Window on east wall of room, rubber gasket between glazing and vinyl. Photo 437 11/07	None Detected
B2316-2411-A30	White sealant	Office 104: South wall of office room, at chair rail and gypsum wall board. Photo 440 11/07	None Detected
B2316-2411-A31	Grey expansion joint sealant	Garage 103: Expansion joint sealant between concrete pads. Photo 445 11/07	None Detected
The testing method used (polarized light microscopy [PLM]) is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Before this material can be considered or treated as non-asbestos containing, confirmation should be made by quantitative transmission electron microscopy (TEM).			

The following materials in Building 2316 have been found to contain asbestos in this or previous surveys, or were assumed to contain asbestos.

1. Assumed hidden above ceilings, behind walls, and in pipe chases hard insulation at end caps of pipe valves and fittings (assumed asbestos-containing).
2. Exterior tarry damp-proofing (assumed asbestos-containing).
3. High temperature wiring insulation at lights (assumed asbestos-containing).
4. Boiler gaskets and stack insulation (assumed asbestos-containing).
5. Remnants of asbestos-containing patching tars and sealants (assumed asbestos-containing).
6. Flange gaskets on piping (assumed asbestos-containing).

The effects of the above asbestos-containing materials in Building 2316 on the proposed renovation are discussed below.

Pipe Insulation

All piping inspected in the project areas were insulated with fiberglass insulation. Although no asbestos was detected, piping was concealed above ceilings and walls in some areas. Due to the age of construction, some concealed asbestos-containing insulation may be uncovered during demolition. If any concealed piping is found to have hard and chalky or other insulation suspected of containing asbestos, those materials shall be sampled prior to disturbance.

Exterior Foundation Wall Damp-proofing Sealant

The foundation water-proofing is assumed to contain asbestos. The sealants are assumed to be not friable and in good condition. The tarry sealants are unlikely to be disturbed by this project.

High Temperature Wiring Insulation

High Temperature Wiring Insulation is assumed have asbestos-containing insulation. The wiring was assumed to be present at older incandescent light fixtures, and at high temperature heating equipment. Wiring insulation is typically not friable, and are unlikely to be disturbed by this project.

Boiler Gaskets and Sealants

Due to their age, gaskets and sealants on the boilers are assumed to be asbestos-containing. These materials are difficult to sample without disassembly of equipment and consequently limited sampling was performed. These materials were in good condition but may become friable during removal for replacement. The gaskets and sealants are unlikely to be disturbed by this project.

Roofing

Roofing over this portion of the building is a rubberized EPDM type roof which does not contain asbestos. However residual mastic from the original roof may still exist beneath the newer roof on the roof deck and on flashing and other equipment penetrating the roof deck. The roofing materials are unlikely to be disturbed by this project.

Flange Gaskets and Valve Packing

Due to their age, gaskets and valve packing on mechanical equipment throughout the buildings, but mostly in mechanical rooms are assumed to be asbestos-containing. These materials are difficult to sample without disassembly of equipment and consequently limited sampling was performed. These materials were in good condition but may become friable during removal for replacement. The gaskets and packings may be disturbed by this project.

Building 2317

Table 1B includes samples taken in November 2024 in Digester Building 2317, and the results of the laboratory analysis. Asbestos field survey data sheets and laboratory reports are included in Appendix A. Refer to Appendix E for sample locations.

TABLE 1B

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2317-2411-A01	Black damp proofing	Digester Utilidor: West wall adjacent to exit vestibule, black damp proofing on concrete wall. Photo 285 11/07	None Detected
B2317-2411-A02	Black tar and black tar paper **IGNORE YELLOW INSULATION**	Digester Utilidor: Right side utilidor, first room on right, black tar and tar paper between concrete lid and insulation. Photo 288 11/07	None Detected
B2317-2411-A03	Black tar; with tan tar paper	Digester Utilidor: Right side utilidor, second room on the right, black tar adhering tar paper to insulation. Photo 290 11/07	Both Layers None Detected
B2317-2411-A04	Silver foil with white duct wrap	Digester Utilidor: Main room at rectangular metal duct on west wall of room. Photo 305 11/07	None Detected
B2317-2411-A05	Red gasket material; with black tar	Digester Utilidor: Left side utilidor, room on the right, red gasket between metal flanges. Photo 310 11/07	Both Layers None Detected

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2317-2411-A06	Silver foil; with black tar and tan tar paper	Digestor Utilidor: Left side utilidor, room on the right, silver foil over insulation at concrete ceiling. Photo 313 11/07	Both Layers None Detected
The testing method used (polarized light microscopy [PLM]) is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Before this material can be considered or treated as non-asbestos containing, confirmation should be made by quantitative transmission electron microscopy (TEM).			

The following materials in Building 2317 have been found to contain asbestos in this or previous surveys, or were assumed to contain asbestos.

1. High temperature wiring insulation at lights (assumed asbestos-containing).
2. Exterior tarry damp-proofing (assumed asbestos-containing).
3. Flange gaskets on piping (assumed asbestos-containing).

The effects of the above asbestos-containing materials in Building 2317 on the proposed renovation are discussed below.

High Temperature Wiring Insulation

High Temperature Wiring Insulation is assumed have asbestos-containing insulation. The wiring was assumed to be present at older incandescent light fixtures and at high temperature heating equipment. Wiring insulation is typically not friable, and are unlikely to be disturbed by this project.

Exterior Foundation Wall Damp-proofing Sealant

The foundation water-proofing is assumed to contain asbestos. The sealants are assumed to be not friable and in good condition. The tarry sealants are unlikely to be disturbed by this project.

Flange Gaskets and Valve Packing

Due to their age, gaskets and valve packing on mechanical equipment throughout the building, but mostly in mechanical rooms are assumed to be asbestos-containing. These materials are difficult to sample without disassembly of equipment and consequently limited sampling was performed. These materials were in good condition but may become friable during removal for replacement. The gaskets and packings are unlikely to be disturbed by this project.

Building 2320

Table 1C includes samples taken in November 2024 in the Final Effluent Sampling House Building 2320 and the results of the laboratory analysis. Asbestos field survey data sheets and laboratory reports are included in Appendix A. Refer to Appendix E for sample locations.

TABLE 1C

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2320-2411-A01	White sealant	Interior: Left side of door, sealant between CMU block wall and metal door frame. Photo 389 11/07	None Detected
B2320-2411-A02	Beige sealant	Exterior: Right side of door, sealant between EIFS exterior wall and metal door frame. Photo 392 11/07	None Detected
The testing method used (polarized light microscopy [PLM]) is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Before this material can be considered or treated as non-asbestos containing, confirmation should be made by quantitative transmission electron microscopy (TEM).			

The following materials in Building 2320 have been found to contain asbestos in this or previous surveys, or were assumed to contain asbestos.

1. Exterior tarry damp-proofing (assumed asbestos-containing).

The effects of the above asbestos-containing materials in Building 2320 on the proposed renovation are discussed below.

Exterior Foundation Wall Damp-proofing Sealant

The foundation water-proofing is assumed to contain asbestos. The sealants are assumed to be not friable and in good condition. The tarry sealants are unlikely to be disturbed by this project.

Building 2321

Table 1D includes samples taken in November 2024 in Effluent Pumping Building 2321, and the results of the laboratory analysis. Asbestos field survey data sheets and laboratory reports are included in Appendix A. Refer to Appendix E for sample locations.

TABLE 1D

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2321-2411-A01	Silver vapor barrier; with black tar paper	Controls Room: Left side of door, vapor barrier between gypsum wall board and EIFS. Photo 324 11/07	None Detected
B2321-2411-A02	White sealant	Controls Room: South wall, sealant between wood wall panels. Photo 326 11/07	None Detected
B2321-2411-A03	Grey sealant	Control Room: Sealant at penetration at top of metal utility box on south side of room. Photo 328 11/07	None Detected
B2321-2411-A04	Beige sealant	Exterior: Left side of door, sealant between EIFS and metal door frame. Photo 332 11/07	None Detected
The testing method used (polarized light microscopy [PLM]) is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Before this material can be considered or treated as non-asbestos containing, confirmation should be made by quantitative transmission electron microscopy (TEM).			

The following materials in Building 2321 have been found to contain asbestos in this or previous surveys, or were assumed to contain asbestos.

1. Exterior tarry damp-proofing (assumed asbestos-containing).
2. Flange gaskets on piping (assumed asbestos-containing).

The effects of the above asbestos-containing materials in Building 2321 on the proposed renovation are discussed below.

Exterior Foundation Wall Damp-proofing Sealant

The foundation water-proofing is assumed to contain asbestos. The sealants are assumed to be not friable and in good condition. The tarry sealants are unlikely to be disturbed by this project.

Flange Gaskets and Valve Packing

Due to their age, gaskets and valve packing on mechanical equipment throughout the building, but mostly in mechanical rooms are assumed to be asbestos-containing. These materials are difficult to sample without disassembly of equipment and consequently limited sampling was performed. These materials were in good condition but may become friable during removal for replacement. The gaskets and packings are unlikely to be disturbed by this project.

Building 2322

Table 1E includes samples taken in November 2024 in Miox Building 2322, and the results of the laboratory analysis. Asbestos field survey data sheets and laboratory reports are included in Appendix A. Refer to Appendix E for sample locations.

TABLE 1E

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2322-2411-A01	Beige sealant	Exterior: South entrance door, right side of door, sealant between EIFS and metal door frame. Photo 351 11/07	None Detected
B2322-2411-A02	White sealant	South Room: South entrance door, right side of door, sealant between gypsum wall board and metal door frame. Photo 356 11/07	None Detected
B2322-2411-A03	Green gasket	North Room: Metal piping on north wall of room, gasket between metal flanges. Photo 370 11/07	None Detected
B2322-2411-A04	Grey sealant	North Room: Sealant at metal pipe fittings on north wall of room. Photo 372 11/07	None Detected
B2322-2411-A05	Off-white/grey sealant	North Room: Sealant at metal pipe fittings on north wall of room. Photo 374 11/07	None Detected
B2322-2411-A06	White sealant	North Room: North entrance door, right side of door, sealant between gypsum wall board and metal door frame. Photo 377 11/07	None Detected
The testing method used (polarized light microscopy [PLM]) is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Before this material can be considered or treated as non-asbestos containing, confirmation should be made by quantitative transmission electron microscopy (TEM).			

The following materials in Building 2322 have been found to contain asbestos in this or previous surveys, or were assumed to contain asbestos.

1. Flange gaskets on piping (assumed asbestos-containing).
2. Exterior tarry damp-proofing (assumed asbestos-containing).
3. Generator gaskets and sealants (assumed asbestos-containing).
4. Metal roofing sealants and patching tars (assumed asbestos-containing).

The effects of the above asbestos-containing materials in Building 2322 on the proposed renovation are discussed below.

Metal Roofing Sealants and Patching Tars

Roofing over the building is a standing seam roof. The roofing was not inspected, because it was not planned for disturbance. The standing seams are assumed to have asbestos-containing sealants. Patching tars and sealants which are assumed to be present at flashings, vents, and other equipment penetrating the roofing are assumed to contain asbestos. The roofing materials are unlikely to be disturbed by this project.

Exterior Foundation Wall Damp-proofing Sealant

The foundation water-proofing is assumed to contain asbestos. The sealants are assumed to be not friable and in good condition. The tarry sealants are unlikely to be disturbed will be partially removed by this project.

Generator Gaskets and Sealants

Due to their age, gaskets and sealants on the generators are assumed to be asbestos-containing. These materials are difficult to sample without disassembly of equipment and consequently limited sampling was performed. These materials were in good condition but may become friable during removal for replacement. The gaskets and sealants are unlikely to be disturbed by this project.

Flange Gaskets and Valve Packing

Due to their age, gaskets and valve packing on mechanical equipment throughout the buildings, but mostly in mechanical and fan rooms are assumed to be asbestos-containing. These materials are difficult to sample without disassembly of equipment and consequently limited sampling was performed. These materials were in good condition but may become friable during removal for replacement. The gaskets and packings are unlikely to be disturbed will be partially removed by this project.

Building 2324

Table 1F includes samples taken in November 2024 in Blower Building 2324, and the results of the laboratory analysis. Asbestos field survey data sheets and laboratory reports are included in Appendix A. Refer to Appendix E for sample locations.

TABLE 1F

SAMPLE NUMBER	MATERIAL	LOCATION	ASBESTOS CONTENT
B2322-2411-A01	Beige sealant	Exterior: North entrance door, right side of door between EIFS and metal door frame. Photo 337 11/07	None Detected
B2322-2411-A02	White gasket	Middle Generator: White gasket between metal flanges. Photo 345 11/07	70% Chrysotile
B2322-2411-A03	Red gasket	North Generator: Red gasket between metal flanges. Photo 347 11/07	None Detected
The testing method used (polarized light microscopy [PLM]) is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. Before this material can be considered or treated as non-asbestos containing, confirmation should be made by quantitative transmission electron microscopy (TEM).			

The following materials in Building 2324 have been found to contain asbestos in this or previous surveys, or were assumed to contain asbestos.

1. Exterior tarry damp-proofing (assumed asbestos-containing).
2. Metal roofing sealants and patching tars (assumed asbestos-containing).
3. Flange gaskets on piping (confirmed asbestos-containing).

The effects of the above asbestos-containing materials in Building 2324 on the proposed renovation are discussed below.

Exterior Foundation Wall Damp-proofing Sealant

The foundation water-proofing is assumed to contain asbestos. The sealants are assumed to be not friable and in good condition. The tarry sealants are unlikely to be disturbed by this project.

Metal Roofing Sealants and Patching Tars

Roofing over the building is a standing seam roof. The roofing was not inspected, because it was not planned for disturbance. The standing seams are assumed to have asbestos-containing sealants. Patching tars and sealants which are assumed to be present at flashings, vents, and other equipment penetrating the roofing are assumed to contain asbestos. The roofing materials are unlikely to be disturbed by this project.

Flange Gaskets and Valve Packing

Gaskets and valve packing on mechanical equipment throughout the building are confirmed to be asbestos-containing. These materials are difficult to sample without disassembly of equipment and consequently limited sampling was performed. These materials were in good condition but may become friable during removal for replacement. The gaskets and packings are unlikely to be disturbed by this project.

2. Asbestos in Dusts

The settled and concealed dusts were examined by an EPA Certified Building Inspector but no samples for asbestos in dusts were authorized for this project. Based on their visual inspection and experience from similar buildings, the inspector determined that the typical settled and concealed dusts are not "asbestos debris" from an asbestos-containing building material (ACBM). Based on similar sampling from similar buildings, the inspector also determined that the dusts are unlikely to contain more than one percent (1%) asbestos by weight, and therefore are not an asbestos-containing material (ACM).

3. Lead-Containing Materials

Lead-Testing

EHS-Alaska tested paint and other materials throughout the affected areas of the building using a SciAps XRF lead paint analyzer. Lead in paints tested varied from a trace amount to 2.5 mg/cm². Lead in other materials tested varied from a trace amount to 0.19 mg/cm². Refer to the Lead Analyzer Test Results Table in Appendix C that identifies the surfaces tested, and the results. The Lead Test Locations are shown in the Drawings in Appendix D.

Paints

There were varying lead contents found in the paints, based on what surfaces they are on, with most surfaces containing little lead (but are still classified as lead-containing materials by OSHA). The highest levels of lead were found on original concrete walls and original cement masonry unit block walls, with lower levels on walls and other painted surfaces, and lowest levels on pre-finished materials.

Lead based paints (paint containing more than 1.0 mg/cm² of lead) were identified in the project on the original construction concrete walls and cement masonry unit block walls. It is anticipated that other older walls may be painted with lead-based paint. It is anticipated that other walls, floors and ceilings may be painted with lead-based paint. Lead was detected at very low levels in most of the painted floor, newer wall and newer ceiling surfaces. XRF testing is not able to "prove" that "no" lead exists in the paint. Low levels of lead found by XRF testing does not mean that the paints are free of lead, the paints may contain lead. At least an initial exposure determination of potential worker exposures for all disturbance of lead-containing materials is required unless laboratory analysis shows that there is zero detectable lead in the materials being disturbed (which requires special analysis). However, these paints may not present a

hazard to occupants or workers performing renovation or demolition if lead-safe work practices are followed.

Metallic Lead in Batteries, Pipe Solder and Flashing

Metallic lead items identified in the building included lead soldering at the lead solder at copper piping, and poured lead sealants at bell and spigot joints of waste and vent piping and lead acid batteries in emergency lights and other battery backup equipment. If removed during renovation or demolition they should be recycled or disposed of as hazardous waste.

Lead Dusts

The settled and concealed dusts were examined but no samples for lead in dusts were authorized for this project. Based on their visual inspection and similar sampling from similar buildings, the inspector also determined that the dusts are likely to have measurable concentrations of lead in the dusts.

4. PCB-Containing Materials

Light Ballasts

Older fluorescent lights typically have PCB-containing ballasts. PCB-containing ballasts in fluorescent lights were banned in 1978, but manufacturers were allowed to use up existing stocks, and lights may have been reused from other facilities. The survey included examination of what were considered to be representative light fixtures, but not all fixtures were able to be accessed. All lights shall be inspected during removal or relocation. Unless ballasts were marked "No PCBs," they must be assumed to contain PCBs and must be disposed of as a hazardous waste when removed for disposal. Fluorescent light fixtures with PCB-containing ballasts are assumed to be present in the building. The fluorescent light fixtures are unlikely to be disturbed by this project.

Older HID lights may have PCB-containing ballasts. Due to height restrictions and sealed ballast enclosures, the HID fixtures were not able to be accessed. All HID lights shall be inspected during removal or relocation. If ballasts are not marked "No PCBs," we suggest contacting the manufacturer of the lights to determine if the ballasts contain PCB's, or assume that they contain PCB's and be disposed of as a hazardous waste. The HID light fixtures are unlikely to be disturbed by this project.

Bulk Products

Representative paint and sealant samples were collected from the Waste Water Treatment Plant Building 2316 and 2317.

The following Table 2A summarizes the PCB Bulk samples taken November 2024 by EHS-Alaska, Inc. Field Survey Data Sheets and Lab results are included in Appendix B. Refer to Appendix E for sample locations.

TABLE 2A

SAMPLE NUMBER	MATERIAL	LOCATION	TOTAL PCB CONCENTRATION
B2316-2411- PCB01	White paint on gypsum wall board	Office 104: North wall above suspended ceiling system adjacent to Controls 104B, paint on gypsum wall board. Photo 31 11/06	None Detected
B2316-2411- PCB02	White paint on CMU block wall	Garage 103: East wall, painted CMU block wall. Photo 63 11/06	None Detected
B2316-2411- PCB03	White paint over beige paint over blue paint over grey paint over green paint on concrete wall	UPS Room 112: East wall, painted concrete wall. Photo 86 11/06	3.53 ppm

HAZARDOUS MATERIALS ASSESSMENT

SAMPLE NUMBER	MATERIAL	LOCATION	TOTAL PCB CONCENTRATION
B2316-2411- PCB04	White paint over beige paint over silver paint on concrete wall	Lab 109: East wall above suspended ceiling system, paint on concrete wall. Photo 96 11/06	110 ppm
B2316-2411- PCB05	Grey sealant at metal duct and concrete wall	Lab 109: East wall above suspended ceiling system, sealant at duct penetration through concrete wall. Photo 99 11/06	None Detected
B2316-2411- PCB06	Dark red "Firestop" sealant at concrete deck	Lab 109: East side of room above door to Corridor II 109 above suspended ceiling system at penetration through concrete deck. Photo 101 11/06	None Detected
B2316-2411- PCB07	White paint over beige paint over teal paint over blue paint on CMU block wall	Clarifier 115: East wall next to Primary Clarifier 3, paint on CMU block wall. Photo 130 11/06	4.1 ppm
B2316-2411- PCB08	White paint over beige paint over yellow paint over blue paint on CMU block wall	Clarifier 115: Northeast wall next to Primary Clarifier 1, paint on CMU block wall. Photo 134 11/06	2.3 ppm
B2316-2411- PCB09	White paint over beige paint over silver paint on concrete wall	Sludge Pump Room: East wall, painted concrete wall. Photo 146 11/06	5.0 ppm
B2316-2411- PCB10	White paint over beige paint over green paint over silver paint on concrete wall	Utilidor from B2316 to B2317: North wall, painted concrete wall. Photo 158 11/06	4.0 ppm
B2316-2411- PCB11	White paint over beige paint over silver paint on concrete wall	Main Digester Level: South wall, painted concrete wall. Photo 181 11/06	2.4 ppm
B2316-2411- PCB12	Grey sealant under white paint over beige paint over blue paint at metal duct and concrete wall	Dry Well 114: North wall, painted sealant at duct penetration through concrete wall. Photo 191 11/06	None Detected
B2316-2411- PCB13	Brown paint over white paint over grey paint on concrete wall	Boiler Room I 118: South wall, painted concrete wall. Photo 199 11/06	2.8 ppm
B2316-2411- PCB14	Clear sealant at wood soffit and metal deck	Boiler Room II 119: Roof access hatch at platform in Boiler Room, sealant between wood soffit and metal deck. Photo 249 11/07	None Detected
B2316-2411- PCB15	White sealant at patched penetration through CMU block wall	Generator Room 120: East wall left side of generator, patched penetration through CMU block wall. Photo 263 11/07	None Detected

SAMPLE NUMBER	MATERIAL	LOCATION	TOTAL PCB CONCENTRATION
B2316-2411- PCB16	Black tar paper over yellow insulation over black tarry vapor barrier on concrete deck	Utilidor at B2317: First room on the right side of the utilidor, tar paper, insulation, vapor barrier on concrete deck. Photo 290 11/07	None Detected
Total PCB's listed herein includes the sum of all congeners of PCB's. Refer to the laboratory reports for the concentrations of the various congeners of PCBs found in the samples.			

One of the samples had PCB concentrations above 50 ppm which would be classified by the EPA as PCB Bulk Product Wastes. Seven samples contained more than 1 ppm PCBs detected but had concentrations of PCB's that were less than 50 ppm. Eight samples had no PCBs detected. Refer to Regulatory Constraints discussion below for more information.

5. Mercury-Containing Materials

Fluorescent Lamps

Fluorescent lamps use mercury to excite the phosphor crystals that coat the inside of the lamp. These lamps contain from 15 to 48 milligrams of mercury depending on their age and manufacturer. No fluorescent light fixtures are scheduled to be replaced by this project.

Thermostats

Older thermostats or other electrical switches that may contain mercury were noted in the building.

High Intensity Discharge Lamps

High Intensity Discharge (HID) lamps use mercury and sodium vapors in the lamp, and also typically have lead-containing solders at the bases. These lamps contain varying amounts of mercury depending on their age and manufacturer. No HID light fixtures are scheduled to be replaced by this project.

All mercury-containing items being removed by this project are required to be disposed of as hazardous waste or recycled.

6. Other Hazardous Materials

Smoke Detectors

Several radioactive smoke detectors were found in the renovation area. If any radioactive items are removed by this project, they are required to be disposed of as hazardous waste or recycled.

Soil Contamination

The scope of work for EHS-Alaska, Inc. did not include investigation of soils for petroleum or other contaminations.

Refrigerants

Refrigerators, freezers, and water coolers were identified in the building that may contain ozone depleting refrigerants. Air conditioning units are also present. Ozone depleting substances (ODS) are regulated by the EPA and must be removed by certified technicians prior to equipment disposal.

Heat Transfer Fluids

The existing heating system is assumed to contain heat transfer fluids, including glycol or other boiler treatment chemicals. Any heat transfer fluids removed from the heating system shall be recovered and properly disposed of or recycled. The heating system is unlikely to be disturbed by this project.

E. REGULATORY CONSTRAINTS

1. Asbestos-Containing Materials

The Federal Occupational Safety and Health Administration (29 CFR 1926.1101) and the State of Alaska Department of Labor (8 AAC 61) have promulgated regulations requiring testing for airborne asbestos fibers; setting allowable exposure limits for workers potentially exposed to airborne asbestos fibers; establishing contamination controls, work practices, and medical surveillance; and setting worker certification and protection requirements. These regulations apply to all workplace activities involving asbestos-containing materials. No asbestos-containing materials are anticipated to be affected by this project.

The EPA regulations, issued as Title 40 of the Code of Federal Regulations, Part 61 (40 CFR 61), Subpart M under the National Emission Standards for Hazardous Air Pollutants (NESHAP), established procedures for handling ACM during asbestos removal and waste disposal. It is recommended that clearance sampling which complies with the EPA's Asbestos Hazard Emergency Response Act (AHERA) protocol be required following removal of asbestos-containing materials to document that the asbestos has been properly removed.

The EPA regulations require an owner (or the owner's contractor) to notify the EPA of asbestos removal operations and to establish responsibility for the removal, transportation, and disposal of asbestos-containing materials.

The disposal of asbestos waste is regulated by the EPA, the Alaska Department of Environmental Conservation, and the disposal site operator. Wastes being transported to the disposal site must be sealed in leak tight containers prior to disposal and must be accompanied by disposal permits and waste manifests.

2. Dusts with Asbestos

Settled and concealed dusts above ceilings, and at other areas that are not routinely cleaned (such as inside ducts and at roofs, etc.) are assumed to have measurable concentrations of asbestos. Based on sampling of similar settled and concealed dusts at similar buildings, those dusts are assumed to contain less than 1 percent asbestos. Normal settled and concealed dusts are distinct and treated differently from debris resulting from damaged asbestos-containing materials.

Background levels of asbestos in dusts for a particular location will depend on many factors, including whether or not asbestos occurs naturally in soils in the area.

Likely sources of asbestos in dusts include natural occurrences of asbestos

The types of asbestos found in settled and concealed dusts often contain actinolite, anthophyllite and tremolite forms of asbestos which are not commonly found in bulk samples taken of materials from buildings. Those forms of asbestos may come from natural occurrences of asbestos in an outside source, such as rock or ore deposits, which appear to be common in Alaska.

Because the type of disturbance, concentration of asbestos in the dusts, cohesiveness of the dusts and room sizes will change, the airborne asbestos levels expected during the project will depend on the contractor's means and methods of conducting the work. The mere presence of asbestos in the dusts does not necessarily imply that a "hazard" exists which would require the use of specially trained workers to "abate" the "hazard". All dusts will likely be required to be removed from the areas where asbestos-containing materials are being removed (abatement areas) in order to achieve clearances. The dusts in the other areas are to be controlled so as to limit worker exposures and prevent contamination of occupied areas of the building.

There is no established correlation between settled or adhered dusts with measurable concentrations of asbestos and airborne concentrations. The definition in the OSHA regulations of asbestos-containing materials as those materials that contain 1 percent or more asbestos by weight, apply to cohesive materials and not to dusts. The OSHA regulations are essentially “performance based”, if workers are exposed above the permissible exposure limits, then all of the requirements in the regulations become effective.

3. Lead-Containing Materials

The EPA Standard 40 CFR 745, Lead-Based Paint Poisoning Prevention in Certain Residential Structures, defines lead-based paint hazards and regulates lead based paint activities in target housing and child-occupied facilities. The requirements of this regulation include training certification, pre-work notifications, work practice standards and record keeping. Areas typically classified as child occupied facilities may include but are not limited to: day care facilities, preschools, kindergarten classrooms, restrooms, multipurpose rooms, cafeterias, gyms, libraries and other areas routinely used by children under 6 years of age. Training requirements for Firms (Contractors) and Renovators (Workers) became effective on April 22, 2010. The building is not classified as a child occupied facility, therefore the requirements of 40 CFR 745 do not apply.

Federal OSHA (29 CFR 1926.62) and the State of Alaska (8 AAC Chapter 61) have promulgated regulations that apply to all construction work where employees may be exposed to lead. The disturbance of any surfaces painted with lead-containing paint requires lead-trained personnel, personnel protective procedures, and air monitoring until exposure levels can be determined. If initial monitoring verifies that the work practices being used are not exposing workers, monitoring and protection procedures may be relaxed. Experience has shown that some paints in most buildings will contain low concentrations of lead and disturbance of those paints are still regulated under the OSHA lead standard, 29 CFR 1926.62. Low levels of lead found by XRF testing does not mean that the paints are free of lead, the paints may contain lead, and OSHA regulations apply anytime measurable amounts of lead are present in paints.

Settled and concealed dust above ceilings, and at other areas that are not routinely cleaned are assumed to have measurable concentrations of lead. Background levels of lead in dusts for a particular location will depend on many factors, including whether or not engines utilizing leaded gasoline were run in or near a building, and upon the age of the building, and thus the age of the dusts. Because the type of disturbance, quantity of lead dusts, cohesiveness of the dusts and room sizes will change, the airborne lead levels expected during the project will depend on the contractor's means and methods of conducting the work. The mere presence of lead in the dusts does not necessarily imply that a “hazard” exists which would require the use of specially trained workers to “abate” the “hazard”.

There is no established correlation between settled or adhered lead dust concentrations and airborne concentrations. The OSHA regulations are essentially “performance based”, if workers are exposed above the permissible exposure limits, then all of the requirements in the regulations become effective.

The EPA requires that actual construction or demolition debris that contains lead or lead-containing paint or other heavy metals be tested using the TCLP test to determine if the waste must be treated as hazardous waste. All federal, state and local standards regulating lead and lead-containing wastes are required to be followed during the renovation or demolition of portions of this building.

If the TCLP tests done on the waste stream(s) that are produced by the contractor are found to contain more than 5.0 mg/liter or 5.0 ppm of lead, they are classified as hazardous wastes, then those waste stream(s) will have to be packaged for shipping and disposal in accordance with hazardous waste and transportation regulations. Because there are no hazardous waste landfills in Alaska, this report assumes that any hazardous waste disposal will take place in Seattle or elsewhere in the Pacific Northwest.

4. PCB-Containing Materials

The EPA has promulgated regulations (40 CFR Part 761) that cover the proper handling and disposal of PCB-containing materials. PCB-containing “Bulk Product” materials (defined by the EPA as Bulk Products that contain more than 50 ppm PCBs) were found by this survey in paints on the original concrete and concrete masonry unit block walls throughout the main waste water treatment plant building. 7 of the 16 samples of paints in the building were found to contain low concentrations (more than 1 ppm, but less than 50 ppm) of PCBs that are not classified by the EPA as PCB containing materials at all. Those materials with low concentrations of PCBs included painted materials that were likely to have been manufactured after PCB’s were “banned” in 1979. 8 of the 16 samples of paints and sealants had no PCB’s detected.

Materials containing PCB’s at any detectable concentrations are not allowed to be disposed of in Alaska Landfills under current Alaska Department of Conservation landfill permits, which exceeds the EPA regulations for disposal of PCB Bulk Products. The EPA regulates liquid PCBs differently from non-liquid materials, such as PCB Bulk Products.

Bulk product wastes that contain PCBs at 50 ppm or greater are regulated by the EPA, however, even at concentrations higher than 50 ppm, such as found by this survey, PCB bulk products are allowed by the EPA to be disposed of at municipal or non municipal, non-hazardous waste landfill because the PCBs in bulk products are not likely to leach out of the solid material. The following citation of 40 CFR 761.62(b) illustrates this: *“Disposal in solid waste landfills. (1) Any person may dispose of the following PCB bulk product waste in a facility permitted, licensed, or registered by a State as a municipal or non-municipal non-hazardous waste landfill: (i) Plastics (such as plastic insulation from wire or cable; radio, television and computer casings; vehicle parts; or furniture laminates); preformed or molded rubber parts and components; applied dried paints, varnishes, waxes or other similar coatings or sealants; caulking; Galbestos; non-liquid building demolition debris; or non-liquid PCB bulk product waste from the shredding of automobiles or household appliances from which PCB small capacitors have been removed (shredder fluff). (ii) Other PCB bulk product waste, sampled in accordance with the protocols set out in subpart R of this part, that leaches PCBs at <10 µg/L of water measured using a procedure used to simulate leachate generation.”*

On October 24, 2012, EPA issued a Memorandum on the proposed reinterpretation of the PCB bulk product waste definition noting that building materials or substrates that are *“coated or serviced with PCB Bulk Product Waste (e.g., caulk, paint, mastic, sealants) at the time of designation of disposal are to be managed as a PCB bulk product waste, even if the PCBs have migrated from the overlying bulk product waste into the substrate, provided there is no other source of PCB contamination on or in the substrate.”*

The EPA’s 2012 Memorandum included the requirement that the potentially contaminated substrate (such as concrete or bricks or wood) be identified as PCB bulk product waste, prior to the material being designated as wastes, otherwise those materials would be classified as PCB remediation wastes, and be required to be disposed of at an EPA permitted hazardous waste landfill. If PCBs have migrated out of the PCB bulk product into the soils, then any soils containing more than 1 ppm, those soils are considered PCB remediation wastes and are subject to the cleanup and disposal requirements of 40 CFR 761.61.

As of June 2024, materials containing PCB’s at any detectable concentrations are not allowed to be disposed of in Alaska Landfills under current Alaska Department of Conservation landfill permits, which exceeds the EPA regulations for disposal of PCB Bulk Products. The EPA regulates liquid PCBs differently from non-liquid materials, such as PCB Bulk Products.

8 of the samples of suspect PCB Bulk Products taken by this project contained had detectable concentrations of PCB’s. The Anchorage Regional Landfill Policy prohibits the disposal of PCB waste with detectable concentrations of PCB’s. State of Alaska regulation 18 AAC 60.025 prohibits the disposal of materials that contain a hazardous substance in concentrations that exceed the applicable soil cleanup

levels in 18 AAC 75.341 (Table B1 or B2) in unlined landfills. This regulation is being applied to lead-based paint and PCB-containing building materials (PCB Bulk Products) in renovation or demolition projects by the Alaska Department of Environmental Conservation (ADEC). Although we believe this is outside of the intent of the regulation, there are currently no options for disposal of PCB Bulk Product waste with measurable concentrations of PCB's in Alaska.

Since EPA regulations would allow disposal of PCB bulk products at essentially unlimited concentrations, it is recommended that additional coordination with local landfills be conducted to determine if at least the PCB bulk product wastes that contain less than 50 ppm be allowed to be disposed of at a local landfill, since they likely already have millions of tons of wastes that are likely classified as PCB bulk product wastes disposed of in their landfills.

Under 40 CFR 761.62 any person disposing of PCB bulk product waste in a waste management facility that does not have a commercial PCB storage or disposal approval must provide written notice to the facility a minimum of 15 days in advance of the first shipment. Content of the required notice is specified in 40 CFR 761.62.

Workers who remove or handle PCB-containing or PCB-contaminated materials or who transport or dispose of PCB wastes must be trained and certified in hazardous waste operations and emergency response (HAZWOPER) as required by 29 CFR 1910.120 and the State of Alaska Department of Labor (8 AAC 61). The Department of Transportation under 49 CFR Parts 100-199 regulates the marking, packaging, handling and transportation of hazardous materials. All federal, state and local standards regulating PCBs and PCB waste must be followed during this project.

5. Mercury-Containing Materials

Thermostats and mercury-containing lamps are classified by the EPA as Universal Wastes. The EPA encourages that all Universal Wastes be recycled in accordance with 40 CFR 273. Mercury and mercury-containing products are considered hazardous waste if TCLP testing of the waste for mercury confirms the mercury content to be greater than the EPA criteria of 0.2 mg/l.

6. Other Hazardous Materials

Refrigerants

Refrigerators, freezers, and water coolers were present in the building that are scheduled to remain. Air conditioning systems were present in the building that are scheduled to remain. Typically, refrigeration and air conditioning systems with ODS shall be maintained in order to prevent discharge of ODS.

Chemical Hazards

The EPA has promulgated regulations (40 CFR Parts 260 to 299 amongst others) that cover the proper handling and disposal of waste chemicals, including listed wastes, which are ignitable, corrosive, reactive, toxic, or an acute hazardous waste or wastes that exhibit the characteristics of toxicity. All construction workers who are required to remove or handle chemical hazards or to transport or dispose of chemical wastes shall be trained and certified as required by the U.S. Department of Labor (29 CFR 1910.120) and the State of Alaska Department of Labor (8 AAC 61). Transportation of chemical hazards are regulated by Department of Transportation regulations under 49 CFR Parts 171 to 178 amongst others.

Waste heat transfer fluids (such as used heating/cooling system glycol or other circulating heating/cooling fluids) are a potentially hazardous waste and are required to be TCLP tested prior to disposal to determine if the fluids are classified as hazardous or non-hazardous waste per the EPA's RCRA regulations governing hazardous wastes. According to a study performed by the University of Northern Iowa, standard TCLP analysis using ICP SW 6010 testing procedures commonly report levels of Arsenic and Selenium over regulatory thresholds due to interferences in the matrix. That report concluded that additional analysis should be performed to refute the presence of Arsenic or Selenium over the regulatory levels by either mass spectrometry using method SW 6020, or by graphite furnace using method SW 7060. Some heat transfer fluids may also contain potentially hazardous additives that modify the

properties of the fluids for use in a particular system. It is recommended that the contractor consult with the persons responsible for maintaining the system to determine if any additives that may be potentially hazardous were used in the system to further determine disposal requirements.

Radioactive Materials

Self-luminous products that contain Tritium, Krypton-85, or Promethium-147 are considered radioactive. There are special disposal requirements for products that contain Tritium, Krypton-85, or Promethium-147 that are generally licensed. Data from the Nuclear Regulatory Commission (NRC) indicates that most all Tritium powered exit signs are generally licensed and therefore must be disposed of at a licensed disposal facility or returned to the manufacturer/distributor for disposal. Licensed radioactive products are regulated by Nuclear Regulatory Commission standard 10 CFR 20 and 10 CFR 32. Smoke detectors were present in the project area that may contain a radioactive material. If the detectors are of the ionization type they typically contain a small amount of Americium. If removed during renovation, the detectors should be returned to the owner for reuse or returned to the manufacturer for disposal or recycling. There are no licensed disposal facilities for radioactive wastes in Alaska.

F. RECOMMENDATIONS

1. Asbestos-Containing Materials

The asbestos-containing materials identified in the building are typically in intact condition and are classified as both friable and non-friable ACM. All asbestos-containing materials that will be disturbed by the planned renovation work are required to be removed by trained asbestos workers. If any asbestos-containing materials are found that will be disturbed by the planned renovations, they are required to be removed by trained asbestos workers.

2. Dusts with Asbestos

Dusts with measurable concentrations of asbestos are assumed to be present, but are not classified as asbestos-containing materials, or as debris from asbestos-containing materials. Workers disturbing dusts are required to have hazard communication training in accordance with OSHA regulations, but are not required to receive 40 hours of training, which is required for asbestos workers. The contractor will need to choose means and methods to control worker exposures to airborne contaminants. At least an initial exposure assessment or data from previous air monitoring is needed to show that worker exposures are maintained below the OSHA permissible exposure limits (PELs).

3. Lead-Containing Materials

Federal OSHA (29 CFR 1926.62) and the State of Alaska (8 AAC Chapter 61) have promulgated regulations that apply to all construction work where employees may be exposed to lead, including disturbance of paints with low concentrations of lead.

Worker exposure to lead may be able to be controlled below the OSHA permissible exposure limit if proper engineering controls and procedures are used during renovation. Lead is a potentially hazardous waste and the EPA requires that all wastes that contains lead be tested to determine if they must be treated as hazardous waste. A TCLP test of the waste stream(s) produced by the Contractor's means and methods are required to be performed to determine if those wastes will be classified as hazardous or non-hazardous.

4. PCB-Containing Materials

If any PCB-containing ballasts are discovered, and they are removed or replaced, they will need to be removed, handled, packaged and disposed of in accordance with all regulations. Refer to Section 02 84 18 Removal and Disposal of Chemical Hazards.

As stated above, PCB Bulk Product wastes materials have been identified at 1 sample of paints at Waste Water Treatment Plant Building 2316, and paints and sealants with concentrations of PCBs that are less than 50 ppm were found in all but 8 of the rest of the 16 samples taken. It is recommended that additional coordination and negotiation be conducted with local landfill operators to encourage them to allow the disposal of at least the materials that contain less than 50 ppm.

5. Mercury-Containing Materials

If any mercury-containing materials are removed or replaced, they will need to be removed, handled, packaged and disposed of in accordance with all regulations. If mercury-containing lamps are handled and disposed of in accordance with the Universal Waste Regulations, no TCLP test is required. If the Contractor chooses to perform a TCLP test of fluorescent lamps, the test shall be conducted in accordance with the requirements of ANSI/NEMA Standard Procedure for Fluorescent Lamp Sample Preparation and Toxicity Characteristic Leaching Procedure, C78.LL 1256-2003 or latest version.

6. Other Hazardous Materials

If any radioactive materials are removed or replaced, they will need to be removed, handled, packaged and disposed of in accordance with all regulations.

If any ODS are removed or replaced, they will need to be removed, handled, packaged and disposed of in accordance with all regulations.

If any heat transfer fluids are removed or replaced, they will need to be removed, handled, packaged and disposed of in accordance with all regulations.

G. LIMITATIONS

The conclusions and recommendations contained in this report are based upon professional opinions with regard to the subject matter. These opinions have been arrived at in accordance with currently accepted environmental consulting and engineering standards and practices and are subject to the following inherent limitations:

1. Accuracy of Information

The laboratory reports utilized in this assessment were provided by the accredited laboratories cited in this report. Although the conclusions, opinions, and recommendations are based in part, on such information, our services did not include the verification of accuracy or authenticity of such reports. Should such information provided be found to be inaccurate or unreliable, EHS-Alaska, Inc. reserves the right to amend or revise its conclusions, opinions, and/or recommendations.

2. Site Conditions

This limited survey did not include investigation of the entire site and may not be valid outside the survey area. The intent of this survey was to identify common hazardous materials that may be disturbed during renovations. This survey is not intended to be utilized as the sole design document for abatement. This survey was conducted while the site was occupied. All inspections were performed with furniture, equipment and/or stored items in place. The scope of work for this survey did not include identification of all potentially hazardous materials that may be present at this site, and was limited to the scope of work agreed upon with our client. Although a concerted effort was made to identify those common hazardous materials likely to be affected by this project, some hazardous materials may have been hidden by furniture, equipment or stored items and may not have been identified. The survey investigated representative materials and items, such as lights and mechanical components. Variations may occur between materials and items that appear to be the same, but are actually of different construction or materials. Other asbestos-containing or potentially hazardous materials may be present in the facilities

that were concealed by structural members, walls, ceilings or floor coverings, or in materials where testing was not conducted.

3. Changing Regulatory Constraints

The regulations concerning hazardous materials are constantly changing, including the interpretations of the regulations by the local and national regulating agencies. Should the regulations or their interpretation be changed from our current understanding, EHS-Alaska, Inc. reserves the right to amend or revise its conclusions, opinions, and/or recommendations.

APPENDIX A

Asbestos Bulk Sample Field Survey Data Sheets and Laboratory Reports


EHS ALASKA
INCORPORATED

EHS-Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

 e-mail • ehslabs@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Waste Water Treatment Plan Building 2316	COLLECTION DATE: 11/06-07/24
-------------------------------	--	--	--

CHAIN OF CUSTODY RECORD

ANALYSIS REQUESTED:	☒ PLM BULK ☐ LEAD DUST ☐ TEM MICROVAC DUST (ASTM 5756)	☐ PLM DUST ☐ LEAD TCLP ☐ TEM BULK ☐ LEAD PPM	TYPE: ☒ ASBESTOS ☐ LEAD	TURNAROUND: 3 DAYS	DISPOSAL: NORMAL	QUANTITY: 31
COLLECTED BY (signature) John H. Lamont PRINTED NAME TBI4-1021-15908 / 20220011 CERIS AHERA# FedEx SHIPPING METHOD FedEx: 7798 8444 8757 COURIER (signature) 11/11/2024 1100 am DATE/TIME		IATL SELECTED LABORATORY SAMPLES ACCEPTED BY DATE/TIME ANALYST'S SIGNATURE DATE		SPECIAL INSTRUCTIONS / COMMENTS: LAB: RETURN A SIGNED COPY OF THIS FORM WITH THE FINAL REPORT TO EHS-ALASKA, INC. See sample location drawing for more detailed explanation of exact locations.		

FIELD SURVEY DATA ND = NONE DETECTED

EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION/COMMENTS (INCLUDING PHOTO/REF)	RESULTS FOR EHS-ALASKA USE ONLY
B2316-2411-A01	White joint compound; with white tape	Office 104: West wall above suspended ceiling system on gypsum wall board. Photo 11 11/06	BOTH LAYERS = ND
B2316-2411-A02	Red "Firestop"	Office 104: West wall above suspended ceiling system at channel bracing penetration through gypsum wall board. Photo 14 11/06	ND
B2316-2411-A03	Green "Firestop"	Office 104B: West wall above suspended ceiling system at conduit penetration through gypsum wall board. Photo 16 11/06	ND
B2316-2411-A04	LCT-2: 2'x4' straight edge acoustic ceiling tile with random 1/4" fissures and 1/8" dense dots	Office 104: Acoustic ceiling tile in suspended ceiling system. Photo 18 11/06	ND
B2316-2411-A05	White joint compound; with CB-1: beige 4" vinyl cove base; with cream mastic	Vestibule 101: South wall left side of exterior door, vinyl cove base over metal nosing over gypsum wall board. Photo 24 11/06	ALL LAYERS = ND
B2316-2411-A06	FT-1: 12"x12" off-white with beige streaks vinyl floor tile; with tan mastic	Vestibule 101: South wall left side of threshold, vinyl floor tile over concrete. Photo 26 11/06	BOTH LAYERS = ND
B2316-2411-A07	White sealant	Vestibule 101: South wall left side of exterior door, white sealant between metal door frame and gypsum wall board. Photo 29 11/06	ND
B2316-2411-A08	White joint compound; with white gypsum wall board; with CB-1: beige 4" vinyl cove base; with cream mastic	Corridor 102: South wall right side of door, vinyl cove base over gypsum wall board. Photo 35 11/06	ALL LAYERS = ND


EHS ALASKA
INCORPORATED

EHS Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

 e-mail • ehslabs@ehs-alaska.com

PROJECT NO:	PROJECT NAME:	FACILITY:	COLLECTION DATE:
8145-01	Eielson FTQW 221012 Waste Water Treatment Plant Repair	Waste Water Treatment Plan Building 2316	11/06-07/24
FIELD SURVEY DATA ND = NONE DETECTED			
EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION, (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION COMMENTS (INCLUDING PHOTO/REF)	RESULTS FOR EHS-ALASKA USE ONLY
B2316-2411-A09	FT-1: 12"x12" off-white with beige streaks vinyl floor tile; with tan mastic	Corridor 102: South wall right side of threshold, vinyl floor tile over concrete. Photo 36 11/06	BOTH LAYERS = ND
B2316-2411-A10	Linoleum flooring; over light blue unknown vinyl floor tile; with tan mastic	Controls Room 104B: South wall left side of threshold to controls room, multiple layers of flooring over unknown substrate. Photo 41 11/06	ALL LAYERS = ND
B2316-2411-A11	CB-2: dark grey 4" vinyl cove base; with cream mastic; WITH TAN MASTIC	Controls Room 104B: South wall left side of door, vinyl cove base over gypsum wall board. Photo 42 11/06	ALL LAYERS = ND
B2316-2411-A12	White sealant	Bathroom 105: North wall left side of sink, sealant between ceramic sink and ceramic wall tile. Photo 54 11/06	ND
B2316-2411-A13	Grey penetration putty	Garage 103: North wall at conduit penetration through CMU block wall. Photo 69 11/06	ND
B2316-2411-A14	Hard black sealant	Laboratory 109: Hard black sealant at black "Transite" countertop on south wall of room. Photo 105 11/06	ND
B2316-2411-A15	Black "Transite" countertop	Laboratory 109: Black "Transite" countertop on west wall of room next to fume hood. Photo 110 11/06	ND
B2316-2411-A16	White fume hood enclosure	Laboratory 109: White enclosure material inside of fume hood. Photo 114 11/06	ND
B2316-2411-A17	LCT-1: 2'x4' straight edge acoustic ceiling tile with random 1/4" to 1/2" random fissures and 1/16" to 1/8" dense dots	Laboratory 109: Southeast corner of Lab, acoustic ceiling tile in suspended ceiling system. Photo 116 11/06	ND
B2316-2411-A18	CB-3: maroon 4" vinyl cove base; with cream mastic	Laundry 111: East wall left side of door, vinyl cove base over gypsum wall board. Photo 122 11/06	BOTH LAYERS = ND
B2316-2411-A19	FT-2: 12"x12" white with black speckles vinyl floor tile; with cream mastic	Laundry 111: Left side of threshold to room, vinyl floor tile over concrete. Photo 123 11/06	BOTH LAYERS = ND
B2316-2411-A20	Grey duct seam sealant	Lower Level Clarifier Room: East wall of lower room, sealant on rectangular metal duct. Photo 143 11/06	ND
B2316-2411-A21	Red gasket material	Utilidor Connecting Lower Clarifier Room to Lower Digester Room: Red gasket between metal flanges. Photo 151 11/06	ND


EHS ALASKA
 INCORPORATED

EHS-Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

 e-mail • ehslabs@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Waste Water Treatment Plan Building 2316	COLLECTION DATE: 11/06-07/24
FIELD SURVEY DATA <i>ND = NONE DETECTED</i>			
EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION/COMMENTS (INCLUDING PHOTO/REF)	RESULTS FOR EHS-ALASKA USE ONLY
B2316-2411-A22	Grey cementitious grout	Utilidor Connecting Lower Clarifier Room to Lower Digester Room: North wall closer to Clarifier Room, grout at penetration through concrete wall. Photo 154 11/06	<i>ND</i>
B2316-2411-A23	Black gasket material	Lower Level Digester Room: Black gasket between metal flanges. Photo 170 11/06	<i>ND</i>
B2316-2411-A24	Red gasket material	Lower Level Digester Room: Red gasket between metal flanges. Photo 172 11/06	<i>ND</i>
B2316-2411-A25	Silver sealant	Middle Level Digester Room: South wall, silver sealant on concrete wall. Photo 181 11/06	<i>ND</i>
B2316-2411-A26	Grey sealant	Dry Well 114: North wall, left side of metal rectangular duct through concrete wall. Photo 191 11/06	<i>ND</i>
B2316-2411-A27	White duct wrap	Boiler Room II 119: Rectangular metal duct through west wall of room, white duct wrap under silver foil over metal duct. Photo 248 11/07	<i>ND</i>
B2316-2411-A28	White sealant	Generator Room 120: West wall at pipe penetration through CMU block wall. Photo 263 11/07	<i>ND</i>
B2316-2411-A29	Black rubber gasket	Office 104: Window on east wall of room, rubber gasket between glazing and vinyl. Photo 437 11/07	<i>ND</i>
B2316-2411-A30	White sealant	Office 104: South wall of office room, at chair rail and gypsum wall board. Photo 440 11/07	<i>ND</i>
B2316-2411-A31	Grey expansion joint sealant	Garage 103: Expansion joint sealant between concrete pads. Photo 445 11/07	<i>ND</i>
END	**END**	**END**	

Report for:

EHS Labs, John Lamont
EHS-Alaska, Inc.
11901 Business Blvd, Suite 208
Eagle River, AK 99577

Regarding: Eurofins EPK Built Environment Testing, LLC
Project: 8145-01 - Waste Water Treatment Plan Building 2316
EML ID: 3850306

Approved by:



Approved Signatory
Frank Ehrenfeld

Dates of Analysis:

Asbestos PLM (Layer %): 11-18-2024

Service SOPs: Asbestos PLM (Layer %) (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins EPK Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: EHS-Alaska, Inc.

C/O: EHS Labs, John Lamont

Re: 8145-01 - Waste Water Treatment Plan Building Date of Receipt: 11-13-2024

2316

Date of Report: 11-18-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2316-2411-A01. White Joint Compound, with White Tape; Office 104: West Wall above Suspended Ceiling System on Gypsum Wall Board. Photo 11 11/06 19042004-1	Layer 1 White Joint Compound Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 White Tape Homogeneity:Good	Not Detected	98% Cellulose 2% Non-Fibrous Material	
B2316-2411-A02. Red "Firestop"; Office 104: West Wall above Suspended Ceiling System at Channel Bracing Penetration through Gypsum Wall Board. Photo 14 11/06 19042005-1	Layer 1 Red Fire Stop Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A03. Green "Firestop"; Office 104B: West Wall above Suspended Ceiling System at COnduit Penetration through Gypsum Wall Board. Photo 16 11/06 19042006-1	Layer 1 Green Fire Stop Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A04. LCT-2: 2'x4' Straight Edge Acoustic Ceiling Tile with Random 1/4" Fissures and 1/8" Dense Dots; Office 104: Acoustic Ceiling Tile in Suspended Ceiling System. Photo 18 11/06 19042007-1	Layer 1 Gray/ White Ceiling Tile Homogeneity:Good	Not Detected	50% Cellulose 30% Glass Fibers 20% Non-Fibrous Material	
B2316-2411-A05. White Joint Compound, with CB-1, Beige 4" Vinyl Cove Base, with Cream Mastic; Vestibule 101: South Wall Left Side of Exterior Door, Vinyl Cove Base over Metal Nosing over Gypsum Wall Board. Photo 24 11/06 19042008-1	Layer 1 Brown Cove Base Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.

C/O: EHS Labs, John Lamont

Re: 8145-01 - Waste Water Treatment Plan Building Date of Receipt: 11-13-2024
2316 Date of Report: 11-18-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2316-2411-A05. White Joint Compound, with CB-1, Beige 4" Vinyl Cove Base, with Cream Mastic; Vestibule 101: South Wall Left Side of Exterior Door, Vinyl Cove Base over Metal Nosing over Gypsum Wall Board. Photo 24 11/06 19042008-1(cont.)	Layer 2 Tan Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 3 White Joint Compound Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A06. FT-1: 12"x12" Off-White with Beige Streaks Vinyl Floor Tile, with Tan Mastic; Vestibule 101: South Wall Left Side of Threshold, Vinyl Floor Tile over Concrete. Photo 26 11/06 19042009-1	Layer 1 Off White/ Beige Floor Tile Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Tan Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A07. White Sealant; Vestibule 101: South Wall Left Side of Exterior Door, White Sealant between Metal Door Frame and Gypsum Wall Board. Photo 29 11/06 19042010-1	Layer 1 White Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A08. White Joint Compound, with White Gypsum Wall Board, with CB-1, Beige 4" Vinyl Cove Base, with Cream Mastic; Corridor 102: South Wall Right Side of Door, Vinyl Cove Base over Gypsum Wall Board. Photo 35 11/06 19042011-1	Layer 1 White/ Brown Drywall Homogeneity:Good	Not Detected	75% Non-Fibrous Material 25% Cellulose	

Comments:

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.

C/O: EHS Labs, John Lamont

Re: 8145-01 - Waste Water Treatment Plan Building Date of Receipt: 11-13-2024
2316 Date of Report: 11-18-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2316-2411-A08. White Joint Compound, with White Gypsum Wall Board, with CB-1, Beige 4" Vinyl Cove Base, with Cream Mastic; Corridor 102: South Wall Right Side of Door, Vinyl Cove Base over Gypsum Wall Board. Photo 35 11/06 19042011-1(cont.)	Layer 2 White Joint Compound Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 3 Brown Cove Base Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 4 Tan Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A09. FT-1: 12"x12" Off-White with Beige Streaks Vinyl Floor Tile, with Tan Mastic; Corridor 102: South Wall Right Side of Threshold, Vinyl Floor Tile over Concrete. Photo 36 11/06 19042012-1	Layer 1 Off White/ Beige Floor Tile Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Tan Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A10. Linoleum Flooring, Over Light Blue Unknown Vinyl Floor Tile, with Tan Mastic; Controls Room 104B: South Wall Left Side of Threshold to Controls Room, Multiple Layers of Flooring over Unknown Substrate. Photo 41 11/06 19042013-1	Layer 1 Gray/ Black Sheet Flooring Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.

C/O: EHS Labs, John Lamont

Re: 8145-01 - Waste Water Treatment Plan Building Date of Receipt: 11-13-2024
2316 Date of Report: 11-18-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2316-2411-A10. Linoleum Flooring, Over Light Blue Unknown Vinyl Floor Tile, with Tan Mastic; Controls Room 104B: South Wall Left Side of Threshold to Controls Room, Multiple Layers of Flooring over Unknown Substrate. Photo 41 11/06 19042013-1(cont.)	Layer 2 Gray Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 3 Beige/ Gray Sheet Flooring Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A11. CB-1, Dark Grey 4" Vinyl Cove Base, with Cream Mastic; Controls Room 104B: South Wall Left Side of Door, Vinyl Cove Base over Gypsum Wall Board. Photo 42 11/06 19042014-1	Layer 1 Dark Gray Cove Base Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Off-White Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 3 Tan Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A12. White Sealant; Bathroom 105: North Wall Left Side of Sink, Sealant between Ceramic Sink and Ceramic Wall Tile. Photo 54 11/06 19042015-1	Layer 1 White Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A13. Grey Penetration Putty; Garage 103: North Wall at Conduit Penetration through CMU Block Wall. Photo 69 11/06 19042016-1	Layer 1 Gray Putty Homogeneity:Good	Not Detected	95% Non-Fibrous Material 5% Cellulose	
B2316-2411-A14. Hard Black Sealant; Laboratory 109: Hard Black Sealant at Black "Transite" Countertop on South Wall of Room. Photo 105 11/ 06 19042017-1	Layer 1 Black Sealant Homogeneity:Good	Not Detected	90% Non-Fibrous Material 10% Wollastonite	

Comments:

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.

C/O: EHS Labs, John Lamont

Re: 8145-01 - Waste Water Treatment Plan Building Date of Receipt: 11-13-2024
2316 Date of Report: 11-18-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2316-2411-A15. Black "Transite" Countertop; Laboratory 109: Black " Transite" Countertop on West Wall of Room next to Fume Hood. Photo 110 11/06 19042018-1	Layer 1 Black Fiberboard Homogeneity:Good	Not Detected	75% Cellulose 25% Non-Fibrous Material	
B2316-2411-A16. White Fume Hood Concrete; Laboratory 109: White Enclosed Material inside of Fume Hood. Photo 114 11/06 19042019-1	Layer 1 White Semi-Fibrous Material Homogeneity:Good	Not Detected	90% Non-Fibrous Material 10% Glass Fibers	
B2316-2411-A17. LCT-1: 2'x4' Straight Edge Acoustic Ceiling Tile with Random 1/4" to 1/2" Random Fissures and 1/16" to 1/8" Dense Dots; Laboratory 109: Southeast Corner of Lab, Acoustic Ceiling Tile in Suspended Ceiling System . Photo 116 11/06 19042020-1	Layer 1 Gray/ White Ceiling Tile Homogeneity:Good	Not Detected	50% Glass Fibers 30% Cellulose 20% Non-Fibrous Material	
B2316-2411-A18. CB-3: Maroon 4" Vinyl Cove Base, with Cream Mastic; Laundry 111: East Wall Left Side of Door, Vinyl Cove Base over Gypsum Wall Board. Photo 122 11/06 19042021-1	Layer 1 Maroon Cove Base Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Tan Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A19. FT-2: 12"x12" White with Black Speckles Vinyl Floor Tile, with Cream Mastic; Laundry 111: Left Side of Threshold to Room, Vinyl Floor Tile over Concrete. Photo 123 11/06 19042022-1	Layer 1 White Floor Tile Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Off-White Mastic Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A20. Grey Duct Seam Sealant; Lower Level Clarifier Room: East Wall of Lower Room, Sealant on Rectangular Metal Duct. Photo 143 11/06 19042023-1	Layer 1 Gray Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.

C/O: EHS Labs, John Lamont

Re: 8145-01 - Waste Water Treatment Plan Building Date of Receipt: 11-13-2024
2316 Date of Report: 11-18-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2316-2411-A21. Red Gasket Material; Utilidor Connecting Lower Clarifier Room to Lower Digester Room: Red Gasket between Metal Flanges. Photo 151 11/06 19042024-1	Layer 1 Red Gasket Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A22. Grey Cementitious Grout; Utilidor Connecting Lower Clarifier Room to Lower Digester Room: North Wall Closet to Clarifier Room. Grout at Penetration through Concrete Wall. Photo 154 11/06 19042025-1	Layer 1 Gray Grout Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A23. Black Gasket Material; Lower Level Digester Room: Black Gasket between Metal Flanges. Photo 170 11/06 19042026-1	Layer 1 Black Gasket Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A24. Red Gasket Material; Lower Level Digester Room: Red Gasket between Metal Flanges. Photo 172 11/06 19042027-1	Layer 1 Red Gasket Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A25. Silver Sealant; Middle Level Digester Room: South Wall, Silver Sealant on Concrete Wall/ Photo 191 11/06 19042028-1	Layer 1 Silver Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A26. Grey Sealant; Dry Well 114: North Wall, Left Side of Metal Rectangular Duct through Concrete Wall. Photo 191 11/06 19042029-1	Layer 1 Gray Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A27. White Duct Wrap; Boiler Room II 119: Rectangular Metal Duct through West Wall of Room, White Duct Wrap under Silver Foil over Metal Duct. Photo 248 11/07 19042030-1	Layer 1 White Wrap Homogeneity:Good	Not Detected	60% Cellulose 30% Non-Fibrous Material 10% Glass Fibers	
B2316-2411-A28. White Sealant; Generator Room 120: West Wall at Pipe Penetration through CMU Block Wall/ Photo 263 11/07 19042031-1	Layer 1 White Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.

C/O: EHS Labs, John Lamont

Re: 8145-01 - Waste Water Treatment Plan Building Date of Receipt: 11-13-2024
2316 Date of Report: 11-18-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2316-2411-A29. Black Rubber Gasket; Office 104: Window on East Wall of Room, Rubber Gasket between Glazing and Vinyl. Photo 437 11/07 19042032-1	Layer 1 Black Gasket Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A30. White Sealant; Office 104: South Wall of Office Room, at Chair Rail and Gypsum Wall Board. Photo 440 11/07 19042033-1	Layer 1 White Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2316-2411-A31. Grey Expansion Joint Sealant; Garage 103: Expansion Joint Sealant between Concrete Pads. Photo 445 11/07 19042034-1	Layer 1 Gray Expansion Joint Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

Analyst(s): Rebecca Hargrove

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.


C/O: EHS Labs, John Lamont

Re: 8145-01 - Waste Water Treatment Plan Building Date of Receipt: 11-13-2024
2316 Date of Report: 11-18-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

PROJECT ANALYST AND SIGNATORY REPORT


Project Analyst

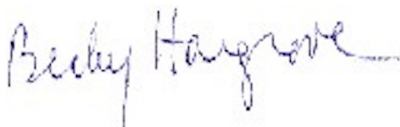

Analyst: Rebecca Hargrove

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

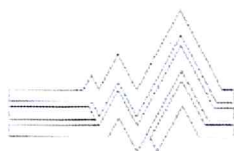
EHS ALASKA
INCORPORATED

EHS-Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

e-mail • ehslabs@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Digester Building 2317	COLLECTION DATE: 11/06-07/24
-------------------------------	--	--	--

CHAIN OF CUSTODY RECORD

ANALYSIS REQUESTED:	☒ PLM BULK ☐ LEAD DUST ☐ TEM MICROVAC DUST (ASTM 5756)	☐ PLM DUST ☐ LEAD TCLP	☐ TEM BULK ☐ LEAD PPM	TYPE: ☒ ASBESTOS ☐ LEAD	TURNAROUND: 2 DAYS	DISPOSAL: NORMAL	QUANTITY: 6
---------------------	--	---	--	--	------------------------------	----------------------------	-----------------------

COLLECTED BY (signature) John H. Lamont PRINTED NAME TB14-1021-15908 / 20220011 CERT# AHERA# FedEx SHIPPING METHOD FedEx: 7798 8444 8757 COURIER (signature) 11/11/2024 DATE/TIME 1100 am	IATL SELECTED LABORATORY SAMPLES ACCEPTED BY DATE/TIME ANALYST'S SIGNATURE DATE	SPECIAL INSTRUCTIONS / COMMENTS: LAB: RETURN A SIGNED COPY OF THIS FORM WITH THE FINAL REPORT TO EHS-ALASKA, INC. See sample location drawing for more detailed explanation of exact locations.
---	---	--

FIELD SURVEY DATA **ND = NONE DETECTED**

EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION/COMMENTS (INCLUDING PHOTO/REF)	RESULTS FOR EHS-ALASKA USE ONLY
B2317-2411-A01	Black damp proofing	Digester Utilidor: West wall adjacent to exit vestibule, black damp proofing on concrete wall. Photo 285 11/07	ND
B2317-2411-A02	Black tar; with black tar paper **IGNORE YELLOW INSULATION**	Digester Utilidor: Right side utilidor, first room on right, black tar and tar paper between concrete lid and insulation. Photo 288 11/07	ND
B2317-2411-A03	Black tar; with black tar paper	Digester Utilidor: Right side utilidor, second room on the right, black tar adhering tar paper to insulation. Photo 290 11/07	BOTH LAYERS = ND
B2317-2411-A04	Silver foil; with white duct wrap	Digester Utilidor: Main room at rectangular metal duct on west wall of room. Photo 305 11/07	ND
B2317-2411-A05	Red gasket material; with unknown black material	Digester Utilidor: Left side utilidor, room on the right, red gasket between metal flanges. Photo 310 11/07	BOTH LAYERS = ND
B2317-2411-A06	Silver foil; with black tar; with black tar paper	Digester Utilidor: Left side utilidor, room on the right, silver foil over insulation at concrete ceiling. Photo 313 11/07	BOTH LAYERS = ND
END	**END**	**END**	

Report for:

John Lamont
EHS-Alaska, Inc.
11901 Business Blvd, Suite 208
Eagle River, AK 99577

Regarding: Eurofins EPK Built Environment Testing, LLC
Project: 8145-01 - Digester Building 2317
EML ID: 3850266

Approved by:



Approved Signatory
Frank Ehrenfeld

Dates of Analysis:
Asbestos PLM (Layer %): 11-15-2024

Service SOPs: Asbestos PLM (Layer %) (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins EPK Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: EHS-Alaska, Inc.
C/O: John Lamont
Re: 8145-01 - Digester Building 2317

Date of Receipt: 11-13-2024
Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2317-2411-A01. Black Damp Proofing; Digester Utilidor: West Wall adjacent to Exit Vestibule, Black Damp Proofing on Concrete Wall. Photo 285 11/07 19041701-1	Layer 1 Black/White Tar Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2317-2411-A02. Black Tar, with Black Tar Paper; Digester Utilidor: Right Side Utilidor, First Room on Right, Black Tar and Tar Paper between Concrete Lid and Insulation. Photo 288 11/07 19041702-1	Layer 1 Black Tar and Black Tar Paper Homogeneity:Good	Not Detected	93% Non-Fibrous Material 7% Cellulose	
B2317-2411-A03. Black Tar, with White Duct Wrap; Digester Utilidor: Right Side Utilidor, Second Room on the Right, Black Tar adhering Tar Paper to Insulation. Photo 290 11/07 19041703-1	Layer 1 Black Tar Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Tan/ Black Tar paper Homogeneity:Good	Not Detected	65% Cellulose 35% Non-Fibrous Material	
B2317-2411-A04. Silver Foil, with White Duct Wrap; Digester Utilidor: Main Room at Rectangular Metal Duct on West Wall of Room. Photo 305 11/07 19041704-1	Layer 1 Off-White Wrap wth silver foil attached Homogeneity:Good	Not Detected	95% Cellulose 5% Non-Fibrous Material	
B2317-2411-A05. Red Gasket Material, with Unknown Black Material; Digester Utilidor: Left Side Utilidor, Room on the Right, Red Gasket between Metal Flanges. Photo 310 11/07 19041705-1	Layer 1 Red Gasket Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Black Tar Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.
C/O: John Lamont
Re: 8145-01 - Digester Building 2317

Date of Receipt: 11-13-2024
Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2317-2411-A06. Silver Foil, with Black Tar, with Black Tar Paper; Digester Utilidor: Left Side Utilidor, Room on the Right, Silver Foil over Insulation at Concrete Ceiling. Photo 313 11/07 19041706-1(cont.)	Layer 1 Black Tar Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Black/ Tan Tar paper attached to silver foil material Homogeneity:Good	Not Detected	55% Cellulose 45% Non-Fibrous Material	

Comments:

Analyst(s): Ellen Smith
Whitney Champion

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.
C/O: John Lamont
Re: 8145-01 - Digester Building 2317

Date of Receipt: 11-13-2024
Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

PROJECT ANALYSTS AND SIGNATORY REPORT

Project Analysts



Analyst: Whitney Champion




Analyst: Ellen Smith

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

003850221

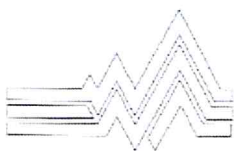

EHS ALASKA
INCORPORATED

EHS-Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

e-mail • ehslabs@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Final Effluent Sampling House Building 2320	COLLECTION DATE: 11/06-07/24
-------------------------------	--	---	--

CHAIN OF CUSTODY RECORD

ANALYSIS REQUESTED:	☒ PLM BULK ☐ LEAD DUST ☐ TEM MICROVAC DUST (ASTM 5756)	☐ PLM DUST ☐ LEAD TCLP ☐ LEAD PPM	TYPE: ☒ ASBESTOS ☐ LEAD	TURNAROUND: 2 DAYS	DISPOSAL: NORMAL	QUANTITY: 2
---------------------	--	--	--	------------------------------	----------------------------	-----------------------

COLLECTED BY (signature) John H. Lamont PRINTED NAME TB14-1021-15908 / 20220011 CERT# AHERA FedEx SHIPPING METHOD FedEx: 7798 8444 8757 COURIER (signature) 11/11/2024 1100 am DATE/TIME	IATL SELECTED LABORATORY SAMPLES ACCEPTED BY DATE/TIME ANALYST'S SIGNATURE DATE	SPECIAL INSTRUCTIONS / COMMENTS: LAB: RETURN A SIGNED COPY OF THIS FORM WITH THE FINAL REPORT TO EHS-ALASKA, INC. See sample location drawing for more detailed explanation of exact locations.
--	---	--

FIELD SURVEY DATA ND = NONE DETECTED

EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION, (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION COMMENTS (INCLUDING PHOTO/REF)	RESULTS FOR EHS-ALASKA USE ONLY
B2320-2411-A01	White sealant	Interior: Left side of door, sealant between CMU block wall and metal door frame. Photo 389 11/07	ND
B2320-2411-A02	Beige sealant	Exterior: Right side of door, sealant between EIFS exterior wall and metal door frame. Photo 392 11/07	ND
END	**END**	**END**	

Report for:

John Lamont
EHS-Alaska, Inc.
11901 Business Blvd, Suite 208
Eagle River, AK 99577

Regarding: Eurofins EPK Built Environment Testing, LLC
Project: 8145-01 - Final Effluent Sampling House Building 2320
EML ID: 3850221

Approved by:



Approved Signatory
Frank Ehrenfeld

Dates of Analysis:
Asbestos PLM (Layer %): 11-15-2024

Service SOPs: Asbestos PLM (Layer %) (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins EPK Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: EHS-Alaska, Inc.

C/O: John Lamont

Re: 8145-01 - Final Effluent Sampling House
Building 2320

Date of Receipt: 11-13-2024

Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2320-2411-A01. White Sealant; Interior: Left Side of Door, Sealant between CMU Block Wall and Metal Door Frame. Photo 389 11/07 19041477-1	Layer 1 White Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2320-2411-A02. Beige Sealant; Exterior: Right Side of Door, Sealant between EFIS Exterior Wall and Metal Door Frame. Photo 392 11/07 19041478-1	Layer 1 Tan Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

Analyst(s): Ellen Smith

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.

C/O: John Lamont

Re: 8145-01 - Final Effluent Sampling House
Building 2320

Date of Receipt: 11-13-2024

Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Ellen Smith

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

003850227



EHS ALASKA
INCORPORATED

EHS-Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

e-mail • ehslabs@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Effluent Pumping Building 2321	COLLECTION DATE: 11/06-07/24
-------------------------------	--	--	--

CHAIN OF CUSTODY RECORD

ANALYSIS REQUESTED:	☒ PLM BULK ☐ LEAD DUST ☐ TEM MICROVAC DUST (ASTM 5756)	☐ PLM DUST ☐ LEAD TCLP	☐ TEM BULK ☐ LEAD PPM	TYPE: ☒ ASBESTOS ☐ LEAD	TURNAROUND: 2 DAYS	DISPOSAL: NORMAL	QUANTITY: 4
---------------------	--	---	--	--	------------------------------	----------------------------	-----------------------

COLLECTED BY (signature) John H. Lamont PRINTED NAME TBI4-1021-15908 / 20220011 CERT# AHERA# FedEx SHIPPING METHOD FedEx: 7798 8444 8757 COURIER (signature) 11/11/2024 1100 am DATE/TIME	IATL SELECTED LABORATORY SAMPLES ACCEPTED BY DATE/TIME ANALYST'S SIGNATURE DATE	SPECIAL INSTRUCTIONS / COMMENTS: LAB: RETURN A SIGNED COPY OF THIS FORM WITH THE FINAL REPORT TO EHS-ALASKA, INC. See sample location drawing for more detailed explanation of exact locations.
--	---	--

FIELD SURVEY DATA ND= NONE DETECTED

EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION/COMMENTS (INCLUDING PHOTO/REF)	RESULTS FOR EHS-ALASKA USE ONLY
B2321-2411-A01	Silver vapor barrier; with black tar paper	Controls Room: Left side of door, vapor barrio between gypsum wall board and EIFS. Photo 324 11/07	ND
B2321-2411-A02	White sealant	Controls Room: South wall, sealant between wood wall panels. Photo 326 11/07	ND
B2321-2411-A03	Grey sealant	Control Room: Sealant at penetration at top of metal utility box on south side of room. Photo 328 11/07	ND
B2321-2411-A04	Beige sealant ; WITH GREY CONCRETE	Exterior: Left side of door, sealant between EIFS and metal door frame. Photo 332 11/07	BOTH LAYERS = ND
END	**END**	**END**	

Report for:

John Lamont
EHS-Alaska, Inc.
11901 Business Blvd, Suite 208
Eagle River, AK 99577

Regarding: Eurofins EPK Built Environment Testing, LLC
Project: 8145-01 - Effluent Pumping Building 2321
EML ID: 3850227

Approved by:



Approved Signatory
Frank Ehrenfeld

Dates of Analysis:
Asbestos PLM (Layer %): 11-15-2024

Service SOPs: Asbestos PLM (Layer %) (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins EPK Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: EHS-Alaska, Inc.

C/O: John Lamont

Re: 8145-01 - Effluent Pumping Building 2321

Date of Receipt: 11-13-2024

Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2321-2411-A01. Silver Vapor Barrier, with Black Tar Paper; Controls Room: Left Side of Door, Vapor Barrier between Gypsum Wall Board and EFIS. Photo 324 11/07 19041498-1	Layer 1 Black/ Tan Tar Paper With Silver Vapor Barrier Homogeneity:Good	Not Detected	85% Cellulose 10% Non-Fibrous Material 5% Glass Fibers	
B2321-2411-A02. White Sealant; Controls Room: South Wall, Sealant between Wood Wall Panels. Photo 326 11/07 19041499-1	Layer 1 White Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2321-2411-A03. Grey Sealant; Control Room: Sealant at Penetration at Top of Metal Utility Box on South Side of Room. Photo 328 11/07 19041500-1	Layer 1 Gray Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2321-2411-A04. Beige Sealant; Exterior: Left Side of Door, Sealant between EFIS and Metal Door Frame. Photo 332 11/07 19041501-1	Layer 1 Beige Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Gray Concrete - located on the top portion of the sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

Analyst(s): Whitney Champion
Ellen Smith

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.

C/O: John Lamont

Re: 8145-01 - Effluent Pumping Building 2321

Date of Receipt: 11-13-2024

Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

PROJECT ANALYSTS AND SIGNATORY REPORT

Project Analysts




Analyst: Whitney Champion



Analyst: Ellen Smith

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

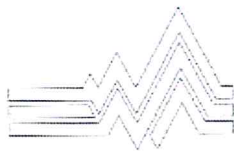
EHS ALASKA
 INCORPORATED

EHS Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

 e-mail • ehslabs@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Miox Building 2322	COLLECTION DATE: 11/06-07/24
-------------------------------	--	--	--

CHAIN OF CUSTODY RECORD				
ANALYSIS REQUESTED:	☒ PLM BULK ☐ LEAD DUST ☐ TEM MICROVAC DUST (ASTM 5756)	☐ PLM DUST ☐ LEAD TCLP ☐ LEAD PPM	☐ TEM BULK ☐ LEAD PPM	TYPE: ☒ ASBESTOS ☐ LEAD
		TURNAROUND: 2 DAYS	DISPOSAL: NORMAL	QUANTITY: 6

COLLECTED BY (signature) John H. Lamont PRINTED NAME TBI4-1021-15908 / 20220011 CERT# AHS# FedEx SHIPPING METHOD FedEx: 7798 8444 8757 COURIER (signature) 11/11/2024 1100 am DATE/TIME	IATL SELECTED LABORATORY SAMPLES ACCEPTED BY DATE/TIME ANALYST'S SIGNATURE DATE 	SPECIAL INSTRUCTIONS / COMMENTS: LAB: RETURN A SIGNED COPY OF THIS FORM WITH THE FINAL REPORT TO EHS-ALASKA, INC. See sample location drawing for more detailed explanation of exact locations.
--	---	--


FIELD SURVEY DATA ND = NONE DETECTED			
EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION, (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION/COMMENTS (INCLUDING PHOTO/REF)	RESULTS FOR EHS-ALASKA USE ONLY
B2322-2411-A01	Beige sealant	Exterior: South entrance door, right side of door, sealant between EIFS and metal door frame. Photo 351 11/07	ND
B2322-2411-A02	White sealant	South Room: South entrance door, right side of door, sealant between gypsum wall board and metal door frame. Photo 356 11/07	ND
B2322-2411-A03	Green gasket	North Room: Metal piping on north wall of room, gasket between metal flanges. Photo 370 11/07	ND
B2322-2411-A04	Grey sealant	North Room: Sealant at metal pipe fittings on north wall of room. Photo 372 11/07	ND
B2322-2411-A05	Off-white/grey sealant	North Room: Sealant at metal pipe fittings on north wall of room. Photo 374 11/07	BOTH LAYERS = ND
B2322-2411-A06	White sealant	North Room: North entrance door, right side of door, sealant between gypsum wall board and metal door frame. Photo 377 11/07	ND
END	**END**	**END**	

Report for:

John Lamont
EHS-Alaska, Inc.
11901 Business Blvd, Suite 208
Eagle River, AK 99577

Regarding: Eurofins EPK Built Environment Testing, LLC
Project: 8145-01 - Miox Building 2322
EML ID: 3850243

Approved by:

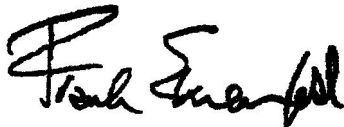

Approved Signatory
Frank Ehrenfeld

Dates of Analysis:
Asbestos PLM (Layer %): 11-15-2024

Service SOPs: Asbestos PLM (Layer %) (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins EPK Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: EHS-Alaska, Inc.
C/O: John Lamont
Re: 8145-01 - Miox Building 2322

Date of Receipt: 11-13-2024
Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2322-2411-A01. Beige Sealant; Exterior: South Entrance Door, Right Side of Door, Sealant between EFIS and Metal Door Frame. Photo 351 11/07 19041553-1	Layer 1 Beige Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2322-2411-A02. White Sealant; South Room: South Entrance Door, Right Side of Door, Sealant between Gypsum Wall Board and Metal Door Frame. Photo 356 11/07 19041554-1	Layer 1 White Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2322-2411-A03. Green Gasket; North Room: Metal Piping on North Wall of Room, Gasket between Metal Flanges. Photo 370 11/07 19041555-1	Layer 1 Green Gasket Homogeneity:Good	Not Detected	75% Non-Fibrous Material 25% Cellulose	
B2322-2411-A04. Grey Sealant; North Room: Sealant at Metal Pipe Fittings on North Wall of Room. Photo 372 11/07 19041556-1	Layer 1 Gray Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2322-2411-A05. Off-White/Grey Sealant; North Room: Sealant at Metal Pipe Fittings on North Wall of Room. Photo 374 11/07 19041557-1	Layer 1 Beige Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
	Layer 2 Gray Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2322-2411-A06. White Sealant; North Room: North Entrance Door, Right Side of Door, Sealant between Gypsum Wall Board and Metal Door Frame. Photo 377 11/07 19041558-1	Layer 1 White Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

Analyst(s): Ellen Smith

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.
C/O: John Lamont
Re: 8145-01 - Miox Building 2322

Date of Receipt: 11-13-2024
Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

PROJECT ANALYST AND SIGNATORY REPORT


Project Analyst



Analyst: Ellen Smith

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

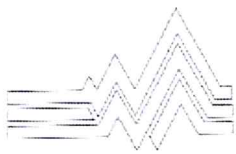
EHS ALASKA
INCORPORATED

EHS Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

e-mail • ehslabs@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Blower Building 2324	COLLECTION DATE: 11/06-07/24
-------------------------------	--	--	--

CHAIN OF CUSTODY RECORD

ANALYSIS REQUESTED:	☒ PLM BULK ☐ LEAD DUST ☐ TEM MICROVAC DUST (ASTM 5756)	☐ PLM DUST ☐ LEAD TCLP	☐ TEM BULK ☐ LEAD PPM	TYPE: ☒ ASBESTOS ☐ LEAD	TURNAROUND: 2 DAYS	DISPOSAL: NORMAL	QUANTITY: 3
COLLECTED BY (signature) John H. Lamont PRINTED NAME TB14-1021-15908 / 20220011 CERT# / AHERA# FedEx SHIPPING METHOD FedEx: 7798 8444 8757 COURIER (signature) 11/11/2024 1100 am DATE/TIME		IATL SELECTED LABORATORY SAMPLES ACCEPTED BY: DATE/TIME ANALYST'S SIGNATURE DATE		SPECIAL INSTRUCTIONS / COMMENTS: LAB: RETURN A SIGNED COPY OF THIS FORM WITH THE FINAL REPORT TO EHS-ALASKA, INC. See sample location drawing for more detailed explanation of exact locations.			

FIELD SURVEY DATA ND = NONE DETECTED

EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION, (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION/COMMENTS (INCLUDING PHOTO/REF)	RESULTS FOR EHS-ALASKA USE ONLY
B2322-2411-A01	Beige sealant	Exterior: North entrance door, right side of door between EIFS and metal door frame. Photo 337 11/07	ND
B2322-2411-A02	White gasket	Middle Generator: White gasket between metal flanges. Photo 345 11/07	70% CHRYSO TILE
B2322-2411-A03	Red gasket	North Generator: Red gasket between metal flanges. Photo 347 11/07	ND
END	**END**	**END**	

Report for:

John Lamont
EHS-Alaska, Inc.
11901 Business Blvd, Suite 208
Eagle River, AK 99577

Regarding: Eurofins EPK Built Environment Testing, LLC
Project: 8145-01 - Blower Building 2324
EML ID: 3850206

Approved by:



Approved Signatory
Frank Ehrenfeld

Dates of Analysis:
Asbestos PLM (Layer %): 11-15-2024

Service SOPs: Asbestos PLM (Layer %) (EPA 40CFR App E to Sub E of Part 763 & EPA METHOD 600/R-93-116, SOP EM-AS-S-1267)

All samples were received in acceptable condition unless noted in the Report Comments portion in the body of the report. The results relate only to the samples as received and tested. The results include an inherent uncertainty of measurement associated with estimating percentages by polarized light microscopy. Measurement uncertainty data for sample results with >1% asbestos concentration can be provided when requested.

Eurofins EPK Built Environment Testing, LLC ("the Company"), a member of the Eurofins Built Environment Testing group of companies, shall have no liability to the client or the client's customer with respect to decisions or recommendations made, actions taken or courses of conduct implemented by either the client or the client's customer as a result of or based upon the Test Results. In no event shall the Company be liable to the client with respect to the Test Results except for the Company's own willful misconduct or gross negligence nor shall the Company be liable for incidental or consequential damages or lost profits or revenues to the fullest extent such liability may be disclaimed by law, even if the Company has been advised of the possibility of such damages, lost profits or lost revenues. In no event shall the Company's liability with respect to the Test Results exceed the amount paid to the Company by the client therefor.

Client: EHS-Alaska, Inc.
C/O: John Lamont
Re: 8145-01 - Blower Building 2324

Date of Receipt: 11-13-2024
Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

Sample ID # Lab-ID version	Sample Description	Asbestos Constituents	Non-Asbestos Constituents	Comment
B2322-2411-A01. Beige Sealant; Exterior: North Entrance Door, Right Side of Door between EFIS and Metal Door Frame. Photo 337 11/07 19041452-1	Layer 1 Beige Sealant Homogeneity:Good	Not Detected	100% Non-Fibrous Material	
B2322-2411-A02. White Gasket; Middle Generator: White Gasket between Metal Flanges. Photo 345 11/07 19041453-1	Layer 1 Gray Gasket Homogeneity:Good	70% Chrysotile	30% Non-Fibrous Material	
B2322-2411-A03. Red Gasket; North Generator: Red Gasket between Metal Flanges. Photo 347 11/07 19041454-1	Layer 1 Red Gasket Homogeneity:Good	Not Detected	100% Non-Fibrous Material	

Comments:

Analyst(s): Ellen Smith

The total percentage of sample components shown may be greater than 100% when some components are detected at <1%.

The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified. Inhomogeneous samples are separated into homogeneous subsamples and analyzed individually. ND means no fibers of that type were detected. When detected, the minimum detection and reporting limit is less than 1% unless point counting is performed. Floor tile samples may contain large amounts of interference material and it is recommended that the sample be analyzed by gravimetric point count analysis to lower the detection limit and to aid in asbestos identification.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

Client: EHS-Alaska, Inc.
C/O: John Lamont
Re: 8145-01 - Blower Building 2324

Date of Receipt: 11-13-2024
Date of Report: 11-15-2024

Bulk Asbestos Fiber Analysis by Polarized Light Microscopy (PLM)
Appx E Sub E 40 CFR 763 / EPA 600/R-93/116

PROJECT ANALYST AND SIGNATORY REPORT

Project Analyst



Analyst: Ellen Smith


The test report shall not be reproduced except in full, without written approval of the laboratory. The report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST, or any agency of the federal government. The Company reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

‡ A "Version" indicated by "-x" after the Lab ID# with a value greater than 1 indicates a sample with amended data. The revision number is reflected by the value of "x".

APPENDIX B

Bulk Product PCB Sample Field Survey Data Sheets and Laboratory Reports

AC36754

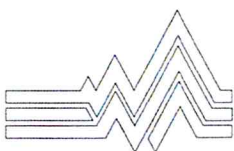
EHS ALASKA
INCORPORATED

EHS-Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

e-mail • ehsak@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Waste Water Treatment Plant Building 2316	COLLECTION DATE: 11/06-07/24
-------------------------------	--	---	--

CHAIN OF CUSTODY RECORD


ANALYSIS REQUESTED:	☐ PLM BULK ☐ LEAD DUST ☐ TEM MICROVAC DUST (ASTM 5756)	☐ PLM DUST ☐ LEAD TCLP ☐ TEM BULK ☒ PCB BULK	TYPE: ☐ ASBESTOS ☒ PCBs	TURNAROUND: 2 Week	DISPOSAL: NORMAL	QUANTITY: 16
---------------------	---	--	--	-----------------------	---------------------	-----------------

COLLECTED BY (signature) John H. Lamont PRINTED NAME 20220011 / TB14-1022-17114 Title FedEx SHIPPING METHOD FedEx: 7798 3893 6184 COURIER (signature) 11/11/2024 DATE/TIME 11 AM	EMSL - Cinnaminson NJ SELECTED LABORATORY SAMPLES ACCEPTED BY 11/12/24 0930 DATE/TIME ANALYST'S SIGNATURE DATE	SPECIAL INSTRUCTIONS / COMMENTS: LAB: RETURN A SIGNED COPY OF THIS FORM WITH THE FINAL REPORT TO EHS-ALASKA, INC. See sample location drawing for more detailed explanation of exact locations. * RESULTS RECEIVED IN mg/kg FROM LAB & ARE REPORTED IN ppm (PART PER MILLION) BELOW. 228°C Rec'd in Plastic
--	--	---

FIELD SURVEY DATA ND = NONE DETECTED

EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION, (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION/COMMENTS (INCLUDING PHOTO/XREF)	RESULTS FOR EHS-ALASKA USE ONLY
1 B2316-2411-PCB01	White paint on gypsum wall board	Office 104: North wall above suspended ceiling system adjacent to Controls 104B, paint on gypsum wall board. Photo 31 11/06	ND
2 B2316-2411-PCB02	White paint on CMU block wall	Garage 103: East wall, painted CMU block wall. Photo 63 11/06	ND
3 B2316-2411-PCB03	White paint over beige paint over blue paint over grey paint over green paint on concrete wall	UPS Room 112: East wall, painted concrete wall. Photo 86 11/06	3.53 ppm
4 B2316-2411-PCB04	White paint over beige paint over silver paint on concrete wall	Lab 109: East wall above suspended ceiling system, paint on concrete wall. Photo 96 11/06	110 ppm
5 B2316-2411-PCB05	Grey sealant at metal duct and concrete wall	Lab 109: East wall above suspended ceiling system, sealant at duct penetration through concrete wall. Photo 99 11/06	ND
6 B2316-2411-PCB06	Dark red "Firestop" sealant at concrete deck	Lab 109: East side of room above door to Corridor II 109 above suspended ceiling system at penetration through concrete deck. Photo 101 11/06	ND
7 B2316-2411-PCB07	White paint over beige paint over teal paint over blue paint on CMU block wall	Clarifier 115: East wall next to Primary Clarifier 3, paint on CMU block wall. Photo 130 11/06	4.1 ppm
8 B2316-2411-PCB08	White paint over beige paint over yellow paint over blue paint on CMU block wall	Clarifier 115: Northeast wall next to Primary Clarifier 1, paint on CMU block wall. Photo 134 11/06	2.3 ppm

AC36754

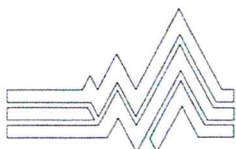
EHS ALASKA
INCORPORATED

EHS Alaska, Inc.

11901 Business Blvd., Suite 208, Eagle River, AK 99577

(907) 694-1383 • (907) 694-1382 fax

e-mail • ehsak@ehs-alaska.com

PROJECT NO: 8145-01	PROJECT NAME: Eielson FTQW 221012 Waste Water Treatment Plant Repair	FACILITY: Waste Water Treatment Plant Building 2316	COLLECTION DATE: 11/06-07/24
-------------------------------	--	---	--

FIELD SURVEY DATA ND = NONE DETECTED

	EHS SAMPLE NO. LAB ID NO	SAMPLE DESCRIPTION. (COLOR, MATERIAL TYPE, LAYERS, FRIABILITY)	LOCATION/COMMENTS (INCLUDING PHOTO/XREF)	RESULTS FOR EHS-ALASKA USE ONLY
9	B2316-2411-PCB09	White paint over beige paint over silver paint on concrete wall	Sludge Pump Room: East wall, painted concrete wall. Photo 146 11/06	5.0 ppm
10	B2316-2411-PCB10	White paint over beige paint over green paint over silver paint on concrete wall	Utilidor from B2316 to B2317: North wall, painted concrete wall. Photo 158 11/06	4.0 ppm
11	B2316-2411-PCB11	White paint over beige paint over silver paint on concrete wall	Main Digester Level: South wall, painted concrete wall. Photo 181 11/06	2.4 ppm
12	B2316-2411-PCB12	Grey sealant under white paint over beige paint over blue paint at metal duct and concrete wall	Dry Well 114: North wall, painted sealant at duct penetration through concrete wall. Photo 191 11/06	ND
13	B2316-2411-PCB13	Brown paint over white paint over grey paint on concrete wall	Boiler Room I 118: South wall, painted concrete wall. Photo 199 11/06	2.8 ppm
14	B2316-2411-PCB14	Clear sealant at wood soffit and metal deck	Boiler Room II 119: Roof access hatch at platform in Boiler Room, sealant between wood soffit and metal deck. Photo 249 11/07	ND
15	B2316-2411-PCB15	White sealant at patched penetration through CMU block wall	Generator Room 120: East wall left side of generator, patched penetration through CMU block wall. Photo 263 11/07	ND
16	B2316-2411-PCB16	Black tar paper over yellow insulation over black tarry vapor barrier on concrete deck	Utilidor at B2317: First room on the right side of the utilidor, tar paper, insulation, vapor barrier on concrete deck. Photo 290 11/07	ND
	END	**END**	**END**	



EMSL Analytical, Inc.

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax: 856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754

LIMS Reference ID: AC36754

EMSL Customer ID: ENVI04

November 27, 2024

John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701

The following analytical report covers the analysis performed on samples submitted to EMSL Analytical, Inc. on 11/12/2024. The results are tabulated on the attached pages for the following client designated project:

Eielson FOQW 221012 Waste Water Treatment Plant Repair

The reference number for these samples is EMSL Order #: AC36754 . Please use this reference when calling about these samples. If you have any questions, please do not hesitate to contact the lab at 856-858-4800.

Owen McKenna Laboratory Manager or other approved signatory

Table of Contents

Cover Letter	1
Sample Condition on Receipt	3
Samples in Report	4
Positive Hits Summary	5
Sample Results	7
Quality Assurance Results	23
Certified Analyses	25
Certifications	25
Qualifiers, Definitions and Disclaimer	26
Chain of Custody PDF	27



EMSL Analytical, Inc.

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754

LIMS Reference ID: AC36754

EMSL Customer ID: ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Condition on Receipt

Cooler ID: Default Cooler		Temperature: 22.8 °C
Custody Seals	Y	
Containers Intact	Y	
COC/Labels Agree	Y	
Preservation Confirmed	Y	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax: 856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Samples in this Report

Lab ID	Sample	Matrix	Date Sampled	Date Received
AC36754-01	B2316-2411-PCB01	Solid	11/6/24 12:00 am	11/12/2024
AC36754-02	B2316-2411-PCB02	Solid	11/6/24 12:00 am	11/12/2024
AC36754-03	B2316-2411-PCB03	Solid	11/6/24 12:00 am	11/12/2024
AC36754-04	B2316-2411-PCB04	Solid	11/6/24 12:00 am	11/12/2024
AC36754-05	B2316-2411-PCB05	Solid	11/6/24 12:00 am	11/12/2024
AC36754-06	B2316-2411-PCB06	Solid	11/6/24 12:00 am	11/12/2024
AC36754-07	B2316-2411-PCB07	Solid	11/6/24 12:00 am	11/12/2024
AC36754-08	B2316-2411-PCB08	Solid	11/6/24 12:00 am	11/12/2024
AC36754-09	B2316-2411-PCB09	Solid	11/6/24 12:00 am	11/12/2024
AC36754-10	B2316-2411-PCB10	Solid	11/6/24 12:00 am	11/12/2024
AC36754-11	B2316-2411-PCB11	Solid	11/6/24 12:00 am	11/12/2024
AC36754-12	B2316-2411-PCB12	Solid	11/6/24 12:00 am	11/12/2024
AC36754-13	B2316-2411-PCB13	Solid	11/6/24 12:00 am	11/12/2024
AC36754-14	B2316-2411-PCB14	Solid	11/7/24 12:00 am	11/12/2024
AC36754-15	B2316-2411-PCB15	Solid	11/7/24 12:00 am	11/12/2024
AC36754-16	B2316-2411-PCB16	Solid	11/7/24 12:00 am	11/12/2024

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax: 856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Positive Hits Summary

Lab ID	Client ID					Sampled
AC36754-03RE1	B2316-2411-PCB03					11/06/24 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1260	0.63		mg/kg	11/27/2024	11:26
SW846-8082A	Aroclor-1254	2.9		mg/kg	11/27/2024	11:26
Lab ID	Client ID					Sampled
AC36754-04	B2316-2411-PCB04					11/06/24 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	110	D	mg/kg	11/26/2024	13:27
Lab ID	Client ID					Sampled
AC36754-07	B2316-2411-PCB07					11/06/24 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	4.1		mg/kg	11/25/2024	19:28
Lab ID	Client ID					Sampled
AC36754-08	B2316-2411-PCB08					11/06/24 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.3		mg/kg	11/25/2024	19:49
Lab ID	Client ID					Sampled
AC36754-09	B2316-2411-PCB09					11/06/24 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	5.0		mg/kg	11/25/2024	20:10
Lab ID	Client ID					Sampled
AC36754-10	B2316-2411-PCB10					11/06/24 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	4.0	D	mg/kg	11/26/2024	13:47
Lab ID	Client ID					Sampled
AC36754-11	B2316-2411-PCB11					11/06/24 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.4		mg/kg	11/25/2024	20:51



EMSL Analytical, Inc.

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754

LIMS Reference ID: AC36754

EMSL Customer ID: ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Positive Hits Summary
(Continued)

Lab ID	Client ID					Sampled
AC36754-13	B2316-2411-PCB13					11/06/24 00:00
Method	Analyte	Result	Qualifier	Unit	Analyzed	
SW846-8082A	Aroclor-1254	2.8		mg/kg	11/25/2024 21:32	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

Sample: B2316-2411-PCB01
AC36754-01 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro- <i>m</i> -xylene	53%		10-112			11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A
Surrogate: Decachlorobiphenyl	47%		10-123			11/25/24 10:31	11/25/24 17:25	NP2/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB02
AC36754-02 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro-m-xylene	49%		10-112		11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate: Decachlorobiphenyl	43%		10-123		11/25/24 10:31	11/25/24 17:46	NP2/TL1	SW846 3546	SW846-8082A	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB03
AC36754-03 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Aroclor-1254	2.9		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Aroclor-1260	0.63		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND		1	0.25	mg/kg	11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery		Q	Limits						
<i>Surrogate: Tetrachloro-m-xylene</i>	52%			10-112		11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	175%	S1		10-123		11/26/24 08:34	11/27/24 11:26	CWA/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB04
AC36754-04 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	ND	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	110	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND	D	100	25	mg/kg	11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	79%		10-112			11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	103%		10-123			11/25/24 10:31	11/26/24 13:27	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB05
AC36754-05 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1254	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND	1		0.76	mg/kg	11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
Surrogate: Tetrachloro-m-xylene	48%			10-112		11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A
Surrogate: Decachlorobiphenyl	47%			10-123		11/25/24 10:31	11/25/24 18:47	NP2/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB06
AC36754-06 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1254	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND	1		0.65	mg/kg	11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
Surrogate: Tetrachloro-m-xylene	61%			10-112		11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A
Surrogate: Decachlorobiphenyl	50%			10-123		11/25/24 10:31	11/25/24 19:08	NP2/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB07
AC36754-07 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	4.1	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro-m-xylene	46%		10-112		11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate: Decachlorobiphenyl	43%		10-123		11/25/24 10:31	11/25/24 19:28	NP2/TL1	SW846 3546	SW846-8082A	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB08
AC36754-08 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	2.3	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 19:49	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro-m-xylene	54%		10-112							
Surrogate: Decachlorobiphenyl	49%		10-123							

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB09
AC36754-09 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	5.0	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.26	mg/kg	11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro-m-xylene	53%		10-112		11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate: Decachlorobiphenyl	48%		10-123		11/25/24 10:31	11/25/24 20:10	NP2/TL1	SW846 3546	SW846-8082A	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results (Continued)

Sample: B2316-2411-PCB10
AC36754-10 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1221	ND	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1232	ND	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1242	ND	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1248	ND	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1254	4.0	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1260	ND	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1262	ND	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Aroclor-1268	ND	D	5	1.3	mg/kg	11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q	Limits							
<i>Surrogate: Tetrachloro-m-xylene</i>	59%		10-112			11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A
<i>Surrogate: Decachlorobiphenyl</i>	66%		10-123			11/25/24 10:31	11/26/24 13:47	NP2/AxJ	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB11
AC36754-11 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	2.4	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 20:51	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro-m-xylene	55%		10-112							
Surrogate: Decachlorobiphenyl	47%		10-123							

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB12
AC36754-12 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro- <i>m</i> -xylene	50%		10-112			11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A
Surrogate: Decachlorobiphenyl	46%		10-123			11/25/24 10:31	11/25/24 21:11	NP2/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB13
AC36754-13 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	2.8	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro-m-xylene	65%		10-112		11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate: Decachlorobiphenyl	55%		10-123		11/25/24 10:31	11/25/24 21:32	NP2/TL1	SW846 3546	SW846-8082A	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results (Continued)

Sample: B2316-2411-PCB14
AC36754-14 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	0.25	mg/kg	11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro- <i>m</i> -xylene	35%		10-112		11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate: Decachlorobiphenyl	33%		10-123		11/25/24 10:31	11/25/24 21:52	NP2/TL1	SW846 3546	SW846-8082A	

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB15
AC36754-15 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1221	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1232	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1242	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1248	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1254	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1260	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1262	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Aroclor-1268	ND	1		0.25	mg/kg	11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Surrogate(s)	Recovery	Q		Limits						
Surrogate: Tetrachloro-m-xylene	50%			10-112		11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A
Surrogate: Decachlorobiphenyl	46%			10-123		11/25/24 10:31	11/25/24 22:13	NP2/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax:856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Sample Results

(Continued)

Sample: B2316-2411-PCB16
AC36754-16 (Solid)

Analyte	Result	Q	DF	RL	Units	Prepared Date/Time	Analyzed Date/Time	Prep/Analyst Initials	Prep Method	Analytical Method
GC-SVOA										
Aroclor-1016	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1221	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1232	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1242	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1248	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1254	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1260	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1262	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Aroclor-1268	ND	1	1.0	mg/kg	11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A	
Surrogate(s)	Recovery	Q	Limits							
Surrogate: Tetrachloro- <i>m</i> -xylene	62%		10-112			11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A
Surrogate: Decachlorobiphenyl	37%		10-123			11/25/24 10:31	11/25/24 22:33	NP2/TL1	SW846 3546	SW846-8082A

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax: 856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Quality Control**GC-SVOA**

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BCK2550 - SW846 3546**Blank (BCK2550-BLK1)**

Prepared & Analyzed: 11/25/2024

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg
Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	62	10-112
Surrogate: Decachlorobiphenyl	0.5000	53	10-123

LCS (BCK2550-BS1)

Prepared & Analyzed: 11/25/2024

Aroclor-1016	3.10	0.25	mg/kg	5.000	62	23-111
Aroclor-1260	3.33	0.25	mg/kg	5.000	67	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	67	10-112
Surrogate: Decachlorobiphenyl	0.5000	59	10-123

Matrix Spike (BCK2550-MS1)**Source: AC36754-04**

Prepared: 11/25/2024 Analyzed: 11/26/2024

Aroclor-1016	NDR5, D	26	mg/kg	5.128	ND	10-111
Aroclor-1260	NDR5, D	26	mg/kg	5.128	ND	10-132

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5128	96	10-112
Surrogate: Decachlorobiphenyl	0.5128	316	10-123

Matrix Spike Dup (BCK2550-MSD1)**Source: AC36754-04**

Prepared: 11/25/2024 Analyzed: 11/26/2024

Aroclor-1016	NDR5, D	25	mg/kg	5.025	ND	10-111	28
Aroclor-1260	NDR5, D	25	mg/kg	5.025	ND	10-132	28

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5025	83	10-112
Surrogate: Decachlorobiphenyl	0.5025	108	10-123

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax: 856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Quality Control (Continued)

GC-SVOA (Continued)

Analyte	Result Qual	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit
---------	-------------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------

Batch: BCK2551 - SW846 3546**Blank (BCK2551-BLK1)**

Prepared: 11/26/2024 Analyzed: 11/27/2024

Aroclor-1016	ND	0.25	mg/kg
Aroclor-1221	ND	0.25	mg/kg
Aroclor-1232	ND	0.25	mg/kg
Aroclor-1242	ND	0.25	mg/kg
Aroclor-1248	ND	0.25	mg/kg
Aroclor-1254	ND	0.25	mg/kg
Aroclor-1260	ND	0.25	mg/kg
Aroclor-1262	ND	0.25	mg/kg
Aroclor-1268	ND	0.25	mg/kg

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	60	10-112
Surrogate: Decachlorobiphenyl	0.5000	56	10-123

LCS (BCK2551-BS1)

Prepared: 11/26/2024 Analyzed: 11/27/2024

Aroclor-1016	3.07	0.25	mg/kg	5.000	61	23-111
Aroclor-1260	3.00	0.25	mg/kg	5.000	60	29-119

Surrogate(s)

Surrogate: Tetrachloro-m-xylene	0.5000	62	10-112
Surrogate: Decachlorobiphenyl	0.5000	57	10-123

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax: 856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Certified Analyses included in this Report

Analyte	CAS #	Certifications
SW846-8082A in Solid		
Aroclor-1016	12674-11-2	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1221	11104-28-2	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1232	11141-16-5	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1242	53469-21-9	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1248	12672-29-6	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1254	11097-69-1	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1260	11096-82-5	NJDEP,NYSDOH,PADEP,California ELAP
Aroclor-1262	37324-23-5	NJDEP,NYSDOH,PADEP
Aroclor-1268	11100-14-4	NJDEP,NYSDOH,PADEP

List of Certifications

Code	Description	Number	Expires
PADEP	Pennsylvania Department of Environmental Protection	68-00367	11/30/2025
NYSDOH	New York State Department of Health	10872	04/01/2025
NJDEP	New Jersey Department of Environmental Protection	03036	06/30/2025
MADEP	Massachusetts Department of Environmental Protection	M-NJ337	06/30/2025
CTDPH	Connecticut Department of Public Health	PH-0270	06/23/2026
California ELAP	California Water Boards	1877	06/30/2025
AIHA LAP	EMSL Analytical, Inc. Cinnaminson, NJ AIHA-LAP, LLC-ELLAP Accredited	100194	01/01/2025
A2LA	A2LA Environmental Certificate	2845.01	07/31/2026

Please see the specific Field of Testing (FOT) on www.emsl.com <<http://www.emsl.com>> for a complete listing of parameters for which EMSL is certified.

**EMSL Analytical, Inc.**

200 Route 130, Cinnaminson, NJ, 08077
Telephone: 856-858-4800 Fax: 856-786-5974
EMSL-CIN-01

EMSL Order ID: 012436754**LIMS Reference ID:** AC36754**EMSL Customer ID:** ENVI04

Attention: John Lamont
EHS Alaska, Inc. [ENVI04]
11901 Business Blvd., Suite 208
Eagle River, AK 99577-7701
(907) 694-1383
jlamont@ehs-alaska.com

Project Name: Eielson FOQW 221012 Waste Water
Treatment Plant Repair

Customer PO: 8145-01
EMSL Sales Rep: Stefan Wiersgalla
Received: 11/12/2024 09:30
Reported: 11/27/2024 17:38

Notes and Definitions

Item	Definition
D	Analyte was reported from a dilution run.
R5	Recovery is outside of the control limits due to dilution.
S1	Surrogate recovery is outside the control limits, results confirmed by re-extraction and re-analysis.
S8	Surrogate recovery is outside the control limits due to dilution.
(Dig)	For metals analysis, sample was digested.
[2C]	Reported from the second channel in dual column analysis.
DF	Dilution Factor
MDL	Method Detection Limit.
ND	Analyte was NOT DETECTED at or above the detection limit.
NR	Spike/Surrogate showed no recovery.
Q	Qualifier
RL	Reporting Limit
Wet	Sample is not dry weight corrected.
%REC	Percent Recovery
RPD	Relative Percent Difference
Source	Sample that was matrix spiked or duplicated

Measurement of uncertainty and any applicable definitions of method modifications are available upon request. Per EPA NLLAP policy, sample results are not blank corrected.

APPENDIX C

Lead Analyzer Test Results

LEAD ANALYZER TEST RESULTS

SciAps, X-550 Pb, Serial #01052

NO.	SITE	INSPECTOR	FLOOR	ROOM	COMPONENT	SUBSTRATE	CONDITION	COLOR	TIME	RESULTS		
										LBP	mg/cm ²	+/- ERROR
1	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 12:17	NEGATIVE	0.9416	0.0314
2	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 12:17	NEGATIVE	0.9289	0.0288
3	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 12:17	NEGATIVE	0.9492	0.0293
4	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 12:17	NEGATIVE	0.9399	0.0172
5	B2316	LAMONT	FIRST	ARCTIC ENTRY I	DOOR FRAME	METAL	INTACT	PINK	11/5/2024 12:21	NEGATIVE	-0.0007	0.0003
6	B2316	LAMONT	FIRST	ARCTIC ENTRY I	DOOR	METAL	INTACT	PINK	11/5/2024 12:22	NEGATIVE	0.0004	0.0002
7	B2316	LAMONT	FIRST	ARCTIC ENTRY I	COVE BASE	VINYL	INTACT	PINK	11/5/2024 12:22	NEGATIVE	0.0013	0.0011
8	B2316	LAMONT	FIRST	ARCTIC ENTRY I	WALL	DRYWALL	INTACT	WHITE	11/5/2024 12:23	NEGATIVE	-0.0001	0.0002
9	B2316	LAMONT	FIRST	ARCTIC ENTRY I	DOOR	WOOD	INTACT	VARNISH	11/5/2024 12:24	NEGATIVE	0	0.0002
10	B2316	LAMONT	FIRST	OFFICE	WINDOW SILL	WOOD	INTACT	VARNISH	11/5/2024 12:25	NEGATIVE	0.0002	0.0002
11	B2316	LAMONT	FIRST	OFFICE	WINDOW CASING	VINYL	INTACT	WHITE	11/5/2024 12:26	NEGATIVE	0.0002	0.0002
12	B2316	LAMONT	FIRST	OFFICE	WINDOW FRAME	WOOD	INTACT	WHITE	11/5/2024 12:27	NEGATIVE	-0.0001	0.0002
13	B2316	LAMONT	FIRST	OFFICE	RADIATOR	METAL	INTACT	WHITE	11/5/2024 12:28	NEGATIVE	0.0004	0.0002
14	B2316	LAMONT	FIRST	DATA ROOM	WALL	DRYWALL	INTACT	WHITE	11/5/2024 12:29	NEGATIVE	0	0.0002
15	B2316	LAMONT	FIRST	DATA ROOM	WALL	WOOD	INTACT	GREY	11/5/2024 12:29	NEGATIVE	-0.0002	0.0002
16	B2316	LAMONT	FIRST	MEN'S BATHROOM	WALL	CERAMIC	INTACT	PINK	11/5/2024 12:31	NEGATIVE	0.0035	0.0014
17	B2316	LAMONT	FIRST	MEN'S BATHROOM	SINK	CERAMIC	INTACT	WHITE	11/5/2024 12:31	NEGATIVE	0.0006	0.0006
18	B2316	LAMONT	FIRST	MEN'S BATHROOM	TOILET	CERAMIC	INTACT	WHITE	11/5/2024 12:32	NEGATIVE	0.0107	0.0021
19	B2316	LAMONT	FIRST	MEN'S BATHROOM	FLOOR TILE	CERAMIC	INTACT	MULTI	11/5/2024 12:32	NEGATIVE	0.0068	0.0027
20	B2316	LAMONT	FIRST	CORRIDOR	FLOOR TILE	VINYL	INTACT	MULTI	11/5/2024 12:33	NEGATIVE	0.0002	0.0002
21	B2316	LAMONT	FIRST	GARAGE	WALL	CMU	INTACT	WHITE	11/5/2024 12:34	NEGATIVE	0.0002	0.0002
22	B2316	LAMONT	FIRST	GARAGE	WALL	CMU	INTACT	WHITE	11/5/2024 12:35	NEGATIVE	-0.0006	0.0003
23	B2316	LAMONT	FIRST	CORRIDOR	DOOR FRAME	METAL	INTACT	PINK	11/5/2024 12:36	NEGATIVE	-0.0008	0.0003
24	B2316	LAMONT	FIRST	CORRIDOR	DOOR	METAL	INTACT	PINK	11/5/2024 12:37	NEGATIVE	-0.0001	0.0003
25	B2316	LAMONT	FIRST	LABORATORY	WALL	DRYWALL	INTACT	WHITE	11/5/2024 12:40	NEGATIVE	0.0003	0.0002
26	B2316	LAMONT	FIRST	LABORATORY	COUNTER	CONCRETE	INTACT	BLACK	11/5/2024 12:41	NEGATIVE	-0.0004	0.0003
27	B2316	LAMONT	FIRST	UPS ROOM	WALL	CONCRETE	INTACT	WHITE	11/5/2024 12:42	POSITIVE	2.509	0.1126
28	B2316	LAMONT	FIRST	UPS ROOM	FLOOR	CONCRETE	INTACT	GREY	11/5/2024 12:42	NEGATIVE	0.0026	0.0017
29	B2316	LAMONT	FIRST	UPS ROOM	EQUIPMENT	METAL	INTACT	GREEN	11/5/2024 12:43	NEGATIVE	-0.0045	0.0008
30	B2316	LAMONT	FIRST	UPS ROOM	WALL	CMU	INTACT	WHITE	11/5/2024 12:44	NEGATIVE	0.678	0.1064
31	B2316	LAMONT	FIRST	CORRIDOR	WALL	DRYWALL	INTACT	WHITE	11/5/2024 12:45	NEGATIVE	-0.0001	0.0002
32	B2316	LAMONT	FIRST	CORRIDOR	DOOR FRAME	METAL	INTACT	PINK	11/5/2024 12:46	NEGATIVE	-0.0003	0.0003
33	B2316	LAMONT	FIRST	CORRIDOR	DOOR	METAL	INTACT	PINK	11/5/2024 12:46	NEGATIVE	0	0.0003
34	B2316	LAMONT	FIRST	WET WELL	DOOR FRAME	METAL	INTACT	TAN	11/5/2024 12:47	NEGATIVE	0.0001	0.0002
35	B2316	LAMONT	FIRST	WET WELL	DOOR	METAL	INTACT	TAN	11/5/2024 12:48	NEGATIVE	-0.0003	0.0003
36	B2316	LAMONT	FIRST	WET WELL	WALL	CONCRETE	INTACT	WHITE	11/5/2024 12:48	POSITIVE	1.1825	0.037
37	B2316	LAMONT	FIRST	DRY WELL	WALL	CMU	INTACT	WHITE	11/5/2024 12:50	NEGATIVE	0.2869	0.1032
38	B2316	LAMONT	FIRST	DRY WELL	DOOR FRAME	METAL	INTACT	TAN	11/5/2024 12:50	NEGATIVE	0.0002	0.0002
39	B2316	LAMONT	FIRST	DRY WELL	DOOR	METAL	INTACT	TAN	11/5/2024 12:51	NEGATIVE	0	0.0002
40	B2316	LAMONT	FIRST	DRY WELL	FLOOR	CONCRETE	INTACT	GREY	11/5/2024 12:51	NEGATIVE	0.0008	0.0003
41	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 12:54	NEGATIVE	0.9021	0.0157
42	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 12:54	NEGATIVE	0.8956	0.0153
43	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 12:55	NEGATIVE	0.8867	0.015

LEAD ANALYZER TEST RESULTS

NO.	SITE	INSPECTOR	FLOOR	ROOM	COMPONENT	SUBSTRATE	CONDITION	COLOR	TIME	RESULTS		
										LBP	mg/cm ²	+/- ERROR
44	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 13:44	NEGATIVE	0.9858	0.0322
45	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 13:44	NEGATIVE	0.9032	0.0283
46	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 13:44	NEGATIVE	0.9258	0.0289
47	EIE WWTP	LAMONT	-	-	CALIBRATE	WOOD	-	RED	11/5/2024 13:44	NEGATIVE	0.9383	0.0172
48	B2316	LAMONT	FIRST	GRIT CHAMBER	WALL	CMU	INTACT	WHITE	11/5/2024 13:46	NEGATIVE	-0.0001	0.0002
49	B2316	LAMONT	FIRST	CLARIFIER ROOM	WALL	CONCRETE	INTACT	WHITE	11/5/2024 13:49	NEGATIVE	0.9842	0.0423
50	B2316	LAMONT	FIRST	CLARIFIER ROOM	WALL	CMU	INTACT	WHITE	11/5/2024 13:49	NEGATIVE	0.2318	0.0658
51	B2316	LAMONT	FIRST	CLARIFIER ROOM	WALL	CMU	INTACT	WHITE	11/5/2024 13:50	NEGATIVE	0.0003	0.0002
52	B2316	LAMONT	FIRST	ARCTIC ENTRY II	WALL	CONCRETE	INTACT	WHITE	11/5/2024 13:51	NEGATIVE	0.655	0.0631
53	B2316	LAMONT	FIRST	ARCTIC ENTRY II	DOOR FRAME	METAL	INTACT	PINK	11/5/2024 13:52	NEGATIVE	-0.0009	0.0003
54	B2316	LAMONT	FIRST	ARCTIC ENTRY II	DOOR	METAL	INTACT	PINK	11/5/2024 13:52	NEGATIVE	-0.0007	0.0003
55	B2316	LAMONT	FIRST	ELECTRICAL ROOM	WALL	CONCRETE	INTACT	WHITE	11/5/2024 13:53	NEGATIVE	0.2285	0.0865
56	B2316	LAMONT	FIRST	ELECTRICAL ROOM	WALL	CONCRETE	INTACT	WHITE	11/5/2024 13:54	NEGATIVE	0.6041	0.0548
57	B2316	LAMONT	FIRST	BOILER ROOM I	STAIRS	METAL	INTACT	BEIGE	11/5/2024 13:55	NEGATIVE	0.3615	0.0134
58	B2316	LAMONT	FIRST	BOILER ROOM I	STAIRS	METAL	INTACT	BEIGE	11/5/2024 13:55	NEGATIVE	0.3951	0.0569
59	B2316	LAMONT	FIRST	BOILER ROOM I	BOILER	METAL	INTACT	BLUE	11/5/2024 13:56	NEGATIVE	0.0002	0.0002
60	B2316	LAMONT	FIRST	BOILER ROOM I	BOILER	METAL	INTACT	BLUE	11/5/2024 13:57	NEGATIVE	-0.0018	0.0006
61	B2316	LAMONT	FIRST	BOILER ROOM I	WALL	CMU	INTACT	WHITE	11/5/2024 13:58	NEGATIVE	0.0103	0.0019
62	B2316	LAMONT	FIRST	BOILER ROOM I	WALL	CONCRETE	INTACT	WHITE	11/5/2024 13:59	NEGATIVE	0.0645	0.0216
63	B2316	LAMONT	FIRST	BOILER ROOM I	WALL	CONCRETE	INTACT	BEIGE	11/5/2024 13:59	NEGATIVE	0.0507	0.0045
64	B2316	LAMONT	FIRST	BOILER ROOM I	WALL	CONCRETE	INTACT	BEIGE	11/5/2024 14:00	NEGATIVE	0.0718	0.0239
65	B2316	LAMONT	FIRST	BOILER ROOM I	STEEL POST	METAL	INTACT	WHITE	11/5/2024 14:02	NEGATIVE	0.0004	0.0002
66	B2316	LAMONT	FIRST	BOILER ROOM I	TANK	METAL	INTACT	BLUE	11/5/2024 14:02	NEGATIVE	-0.0002	0.0002
67	B2316	LAMONT	FIRST	CLARIFIER ROOM	WALL	CMU	INTACT	WHITE	11/5/2024 14:04	POSITIVE	1.9385	0.0463
68	B2316	LAMONT	FIRST	CLARIFIER ROOM	WALL	CMU	INTACT	WHITE	11/5/2024 14:05	POSITIVE	1.6546	0.0395
69	B2316	LAMONT	FIRST	CLARIFIER ROOM	WALL	METAL	INTACT	WHITE	11/5/2024 14:05	NEGATIVE	0.0013	0.001
70	B2316	LAMONT	FIRST	CLARIFIER ROOM	DOOR FRAME	METAL	INTACT	PINK	11/5/2024 14:06	NEGATIVE	0.0003	0.0003
71	B2316	LAMONT	FIRST	CLARIFIER ROOM	DOOR	METAL	INTACT	PINK	11/5/2024 14:06	NEGATIVE	-0.0002	0.0002
72	B2316	LAMONT	FIRST	CLARIFIER ROOM	FLOOR	CONCRETE	INTACT	GREY	11/5/2024 14:08	NEGATIVE	0.0003	0.0002
73	B2316	LAMONT	FIRST	CLARIFIER ROOM	HANDRAIL	METAL	INTACT	GREY	11/5/2024 14:09	NEGATIVE	0.0005	0.0002
74	B2316	LAMONT	FIRST	CLARIFIER ROOM	EQUIPMENT	METAL	INTACT	GREY	11/5/2024 14:10	NEGATIVE	-0.0005	0.0003
75	B2316	LAMONT	FIRST	BOILER ROOM II	WALL	CMU	INTACT	WHITE	11/5/2024 14:12	NEGATIVE	0.0002	0.0002
76	B2316	LAMONT	FIRST	BOILER ROOM II	HANDRAIL	METAL	INTACT	WHITE	11/5/2024 14:12	NEGATIVE	0	0.0003
77	B2316	LAMONT	FIRST	BOILER ROOM II	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:14	NEGATIVE	0.0007	0.0003
78	B2316	LAMONT	FIRST	BOILER ROOM II	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:14	NEGATIVE	0.0038	0.001
79	B2316	LAMONT	FIRST	BOILER ROOM II	FLANGE	METAL	INTACT	BLACK	11/5/2024 14:21	NEGATIVE	-0.0008	0.0006
80	B2316	LAMONT	FIRST	BOILER ROOM II	PUMP	METAL	INTACT	RED	11/5/2024 14:21	NEGATIVE	-0.0032	0.0007
81	B2316	LAMONT	FIRST	GENERATOR ROOM	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:23	NEGATIVE	0.0042	0.0029
82	B2316	LAMONT	FIRST	GENERATOR ROOM	WALL	CMU	INTACT	WHITE	11/5/2024 14:23	NEGATIVE	0.0001	0.0002
83	B2316	LAMONT	FIRST	GENERATOR ROOM	L CHANNEL	METAL	INTACT	WHITE	11/5/2024 14:24	NEGATIVE	0.0002	0.0002
84	B2316	LAMONT	FIRST	GENERATOR ROOM	TANK	METAL	INTACT	BEIGE	11/5/2024 14:25	NEGATIVE	-0.0011	0.0005
85	B2316	LAMONT	FIRST	GENERATOR ROOM	STEEL JOIST	METAL	INTACT	PEA GREEN	11/5/2024 14:26	NEGATIVE	-0.0011	0.0003
86	B2316	LAMONT	FIRST	SWITCH GEAR ROOM	ELECTRICAL EQUIPMENT	METAL	INTACT	GREY	11/5/2024 14:27	NEGATIVE	-0.0005	0.0004
87	B2316	LAMONT	FIRST	SWITCH GEAR ROOM	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:28	NEGATIVE	0.0005	0.0002

LEAD ANALYZER TEST RESULTS

NO.	SITE	INSPECTOR	FLOOR	ROOM	COMPONENT	SUBSTRATE	CONDITION	COLOR	TIME	RESULTS		
										LBP	mg/cm ²	+/- ERROR
88	B2316	LAMONT	FIRST	SWITCH GEAR ROOM	FLOOR	CONCRETE	INTACT	GREY	11/5/2024 14:28	NEGATIVE	0.0018	0.001
89	B2316	LAMONT	FIRST	SWITCH GEAR ROOM	WALL	CMU	INTACT	WHITE	11/5/2024 14:30	NEGATIVE	0.0004	0.0002
90	B2316	LAMONT	LOWER	WET WELL	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:33	NEGATIVE	0	0.0002
91	B2316	LAMONT	LOWER	WET WELL	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:34	NEGATIVE	0.0007	0.0003
92	B2316	LAMONT	LOWER	WET WELL	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:34	NEGATIVE	0.0003	0.0002
93	B2316	LAMONT	LOWER	WET WELL	CEILING	CONCRETE	INTACT	WHITE	11/5/2024 14:34	NEGATIVE	0.0008	0.0003
94	B2316	LAMONT	LOWER	DRY WELL	BEAM	CONCRETE	INTACT	WHITE	11/5/2024 14:36	NEGATIVE	0.0004	0.0002
95	B2316	LAMONT	LOWER	DRY WELL	FLANGE	METAL	INTACT	RED	11/5/2024 14:37	NEGATIVE	-0.0004	0.0002
96	B2316	LAMONT	LOWER	DRY WELL	PUMP	METAL	INTACT	RED	11/5/2024 14:38	NEGATIVE	-0.0002	0.0002
97	B2316	LAMONT	LOWER	DRY WELL	PIPE	METAL	INTACT	BLACK	11/5/2024 14:38	NEGATIVE	-0.0045	0.0007
98	B2316	LAMONT	LOWER	DRY WELL	POST	CONCRETE	INTACT	GREY	11/5/2024 14:39	NEGATIVE	0.0001	0.0002
99	B2316	LAMONT	LOWER	DRY WELL	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:39	NEGATIVE	0.0018	0.0011
100	B2316	LAMONT	LOWER	CLARIFIER ROOM	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:42	NEGATIVE	0.0002	0.0002
101	B2316	LAMONT	LOWER	CLARIFIER ROOM	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:43	NEGATIVE	0	0.0002
102	B2316	LAMONT	LOWER	UTILIDOR	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:44	NEGATIVE	0.0004	0.0002
103	B2316	LAMONT	LOWER	UTILIDOR	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:44	NEGATIVE	0.0005	0.0002
104	B2316	LAMONT	LOWER	UTILIDOR	FLOOR	CONCRETE	INTACT	GREY	11/5/2024 14:45	NEGATIVE	0.0422	0.0045
105	B2316	LAMONT	LOWER	UTILIDOR	CEILING	CONCRETE	INTACT	WHITE	11/5/2024 14:46	NEGATIVE	0.0003	0.0002
106	B2317	LAMONT	LOWER	DIGESTER	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:47	NEGATIVE	0.0006	0.0002
107	B2317	LAMONT	LOWER	DIGESTER	PIPE	METAL	INTACT	BROWN	11/5/2024 14:48	NEGATIVE	-0.0016	0.0005
108	B2317	LAMONT	LOWER	DIGESTER	FOUNDATION	CONCRETE	INTACT	WHITE	11/5/2024 14:50	NEGATIVE	0.3156	0.0553
109	B2317	LAMONT	LOWER	DIGESTER	LADDER	METAL	INTACT	GREY	11/5/2024 14:50	NEGATIVE	0.0771	0.0062
110	B2317	LAMONT	MIDDLE	DIGESTER	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:53	NEGATIVE	0.0001	0.0002
111	B2317	LAMONT	MIDDLE	DIGESTER	WALL	CONCRETE	INTACT	WHITE	11/5/2024 14:53	NEGATIVE	0.0019	0.0016
112	B2317	LAMONT	MIDDLE	DIGESTER	PIPE	METAL	INTACT	BLACK	11/5/2024 14:54	NEGATIVE	-0.0032	0.0008
113	B2317	LAMONT	MIDDLE	DIGESTER	EQUIPMENT	METAL	INTACT	GREY	11/5/2024 14:54	NEGATIVE	0.0003	0.0002
114	B2317	LAMONT	MIDDLE	DIGESTER	LADDER	METAL	INTACT	WHITE	11/5/2024 14:55	NEGATIVE	0.0586	0.0253
115	B2317	LAMONT	MIDDLE	DIGESTER	DUCT	METAL	INTACT	WHITE	11/5/2024 14:55	NEGATIVE	0.1993	0.2095
116	B2317	LAMONT	MIDDLE	DIGESTER	HANDRAIL	METAL	INTACT	WHITE	11/5/2024 14:56	NEGATIVE	0.1114	0.0313
117	B2317	LAMONT	UPPER	DIGESTER	WALL	CONCRETE	INTACT	WHITE	11/5/2024 15:02	NEGATIVE	0.0015	0.0009
118	B2317	LAMONT	UPPER	DIGESTER	WALL	CMU	INTACT	WHITE	11/5/2024 15:03	NEGATIVE	0.0015	0.0011
119	B2317	LAMONT	UPPER	DIGESTER	CEILING	CONCRETE	INTACT	BLACK	11/5/2024 15:03	NEGATIVE	0	0.0002
120	B2317	LAMONT	UPPER	DIGESTER	CEILING	CONCRETE	INTACT	GREY	11/5/2024 15:04	NEGATIVE	0.0053	0.0014
121	B2317	LAMONT	UPPER	DIGESTER	DOOR FRAME	METAL	INTACT	BROWN	11/5/2024 15:06	NEGATIVE	-0.0016	0.0005
122	B2317	LAMONT	UPPER	DIGESTER	DOOR	METAL	INTACT	BROWN	11/5/2024 15:07	NEGATIVE	-0.0007	0.0004
123	B2321	LAMONT	FIRST	EFFLUENT PUMPING	ELECTRICAL EQUIPMENT	METAL	INTACT	GREY	11/5/2024 15:09	NEGATIVE	0.0005	0.0002
124	B2321	LAMONT	FIRST	EFFLUENT PUMPING	DOOR FRAME	METAL	INTACT	BROWN	11/5/2024 15:10	NEGATIVE	0.0001	0.0004
125	B2321	LAMONT	FIRST	EFFLUENT PUMPING	DOOR	METAL	INTACT	BEIGE	11/5/2024 15:11	NEGATIVE	-0.0003	0.0002
126	B2321	LAMONT	FIRST	EFFLUENT PUMPING	HATCH	METAL	INTACT	WHITE	11/5/2024 15:13	NEGATIVE	0.0012	0.0007
127	B2324	LAMONT	FIRST	BLOWER BUILDING	WALL	CMU	INTACT	WHITE	11/5/2024 15:17	NEGATIVE	0.0002	0.0002
128	B2324	LAMONT	FIRST	BLOWER BUILDING	WALL	CMU	INTACT	WHITE	11/5/2024 15:17	NEGATIVE	0.0003	0.0002
129	B2324	LAMONT	FIRST	BLOWER BUILDING	DOOR FRAME	METAL	INTACT	BROWN	11/5/2024 15:19	NEGATIVE	-0.0027	0.0006
130	B2324	LAMONT	FIRST	BLOWER BUILDING	DOOR	METAL	INTACT	BEIGE	11/5/2024 15:19	NEGATIVE	-0.0002	0.0003
131	B2324	LAMONT	FIRST	BLOWER BUILDING	EQUIPMENT	METAL	INTACT	GREY	11/5/2024 15:20	NEGATIVE	-0.0012	0.0004

LEAD ANALYZER TEST RESULTS

NO.	SITE	INSPECTOR	FLOOR	ROOM	COMPONENT	SUBSTRATE	CONDITION	COLOR	TIME	RESULTS		
										LBP	mg/cm ²	+/- ERROR
132	B2322	LAMONT	FIRST	MIOX BUILDING	DOOR FRAME	METAL	INTACT	BEIGE	11/5/2024 15:22	NEGATIVE	-0.0007	0.0003
133	B2322	LAMONT	FIRST	MIOX BUILDING	DOOR	METAL	INTACT	BEIGE	11/5/2024 15:23	NEGATIVE	-0.0007	0.0002
134	B2322	LAMONT	FIRST	MIOX BUILDING	WALL	CMU	INTACT	WHITE	11/5/2024 15:23	NEGATIVE	-0.0001	0.0002
135	B2322	LAMONT	FIRST	MIOX BUILDING	WALL	CMU	INTACT	WHITE	11/5/2024 15:24	NEGATIVE	0	0.0002
136	B2322	LAMONT	FIRST	MIOX BUILDING	GARAGE DOOR	METAL	INTACT	WHITE	11/5/2024 15:25	NEGATIVE	-0.0005	0.0004
137	B2320	LAMONT	FIRST	FINAL SAMPLING	DOOR FRAME	METAL	INTACT	BROWN	11/5/2024 15:27	NEGATIVE	-0.0011	0.0005
138	B2320	LAMONT	FIRST	FINAL SAMPLING	DOOR	METAL	INTACT	BROWN	11/5/2024 15:27	NEGATIVE	-0.0008	0.0004
139	B2320	LAMONT	FIRST	FINAL SAMPLING	WALL	CMU	INTACT	WHITE	11/5/2024 15:28	NEGATIVE	0.0003	0.0002
140	B2320	LAMONT	FIRST	FINAL SAMPLING	FLOOR	CONCRETE	INTACT	GREY	11/5/2024 15:29	NEGATIVE	0.0005	0.0003
141	B2320	LAMONT	FIRST	FINAL SAMPLING	RADIATOR	METAL	INTACT	BEIGE	11/5/2024 15:30	NEGATIVE	-0.002	0.0006
142	EIE WWTP	LAMONT	FIRST	NO SELECTION	CALIBRATE	WOOD	INTACT	RED	11/5/2024 15:36	NEGATIVE	0.8946	0.0306
143	EIE WWTP	LAMONT	FIRST	NO SELECTION	CALIBRATE	WOOD	INTACT	RED	11/5/2024 15:36	NEGATIVE	0.8644	0.0277
144	EIE WWTP	LAMONT	FIRST	NO SELECTION	CALIBRATE	WOOD	INTACT	RED	11/5/2024 15:36	NEGATIVE	0.8638	0.028
145	EIE WWTP	LAMONT	FIRST	NO SELECTION	CALIBRATE	WOOD	INTACT	RED	11/5/2024 15:36	NEGATIVE	0.8743	0.0166

Table Heading Descriptions:

LBP: Results are shown as positive (POS ≥ 1.0 mg/cm²) or negative (NEG < 1.0 mg/cm²). Positive results are shown in bold print.


mg/cm²: This is the testing results produced by the SciAps X-550 Pb instrument in milligrams of lead per square centimeter (mg/cm²). The EPA defines lead based paint as paint containing lead at 1.0 mg/cm² or greater. A negative number is a result of an internal computation made by the instrument and should be interpreted as zero. Even though paint may be termed negative (less than 1.0 mg/cm²) by EPA definition, disturbance of the paint may still be regulated by OSHA under 29 CFR 1926.62. Where lead is present at any level, appropriate engineering controls, work practices and personal protective equipment should be used until a negative exposure assessment can be determined. <LOD indicates that the lead present was less than the limits of detection of the instrument (very little or no lead present).

VOID: This indicates that the test was intentionally terminated by the operator due to operator error (e.g. - operator moved analyzer while testing).

Substrate: Where ceramic is shown as a substrate, lead content is typically from the glazing on the tile unless the tile is painted.

APPENDIX D

Drawings of Sample Locations

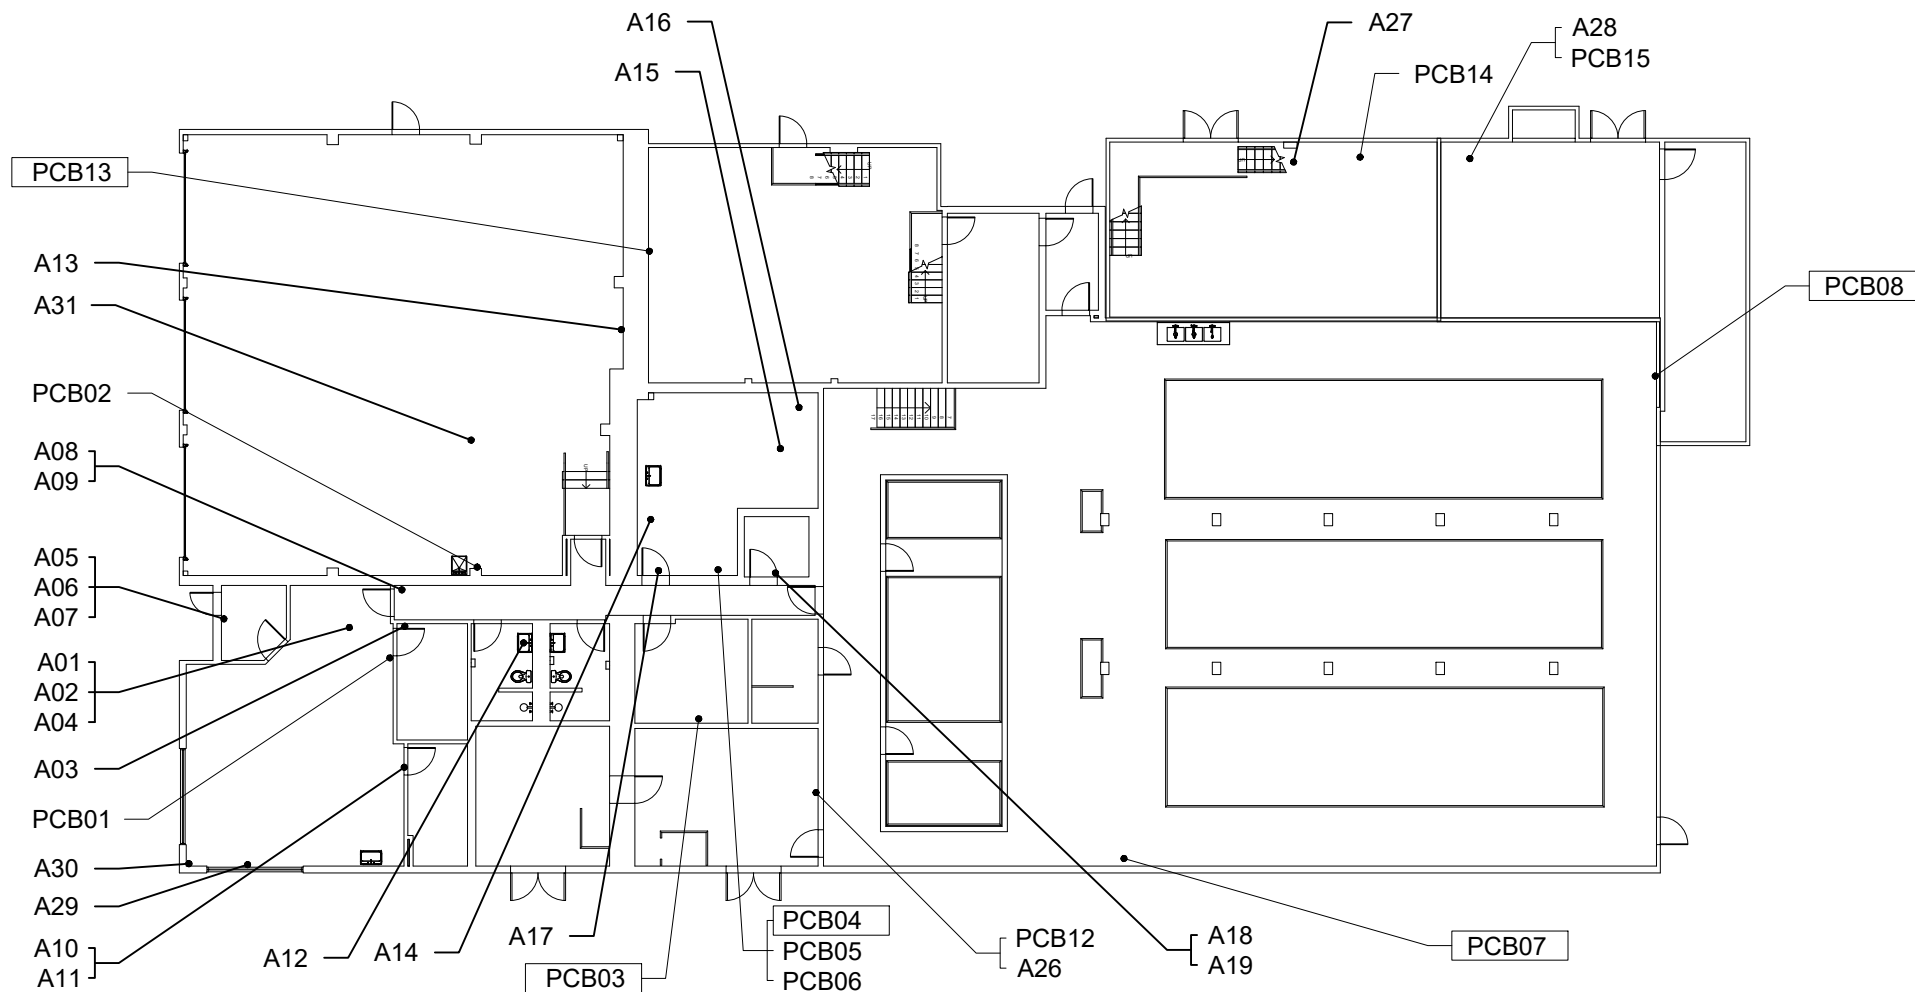

LEGEND

- PCBXX PCB TEST LOCATION
- PCBXX PCB TEST POSITIVE

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS.



BUILDING 2316
NTS



LEGEND

- AXX ASBESTOS TEST LOCATION
- AXX LAB TEST RESULTS POSITIVE FOR ASBESTOS

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS. ALL SAMPLES HAVE B2316-2411- PREFIX.

**UNITED
STATES
AIR FORCE**

**EILSON AIR FORCE BASE
BUILDING 2316 GROUND FLOOR
ASBESTOS & PCB SAMPLE LOCATIONS**



EHS ALASKA
INCORPORATED


ENGINEERING, HEALTH & SAFETY CONSULTANTS

DRAWN: FGG
CHECK: RAF

FILE #:
8145-SL

DATE:
11/06-07/24

DWG.NO:
C-1

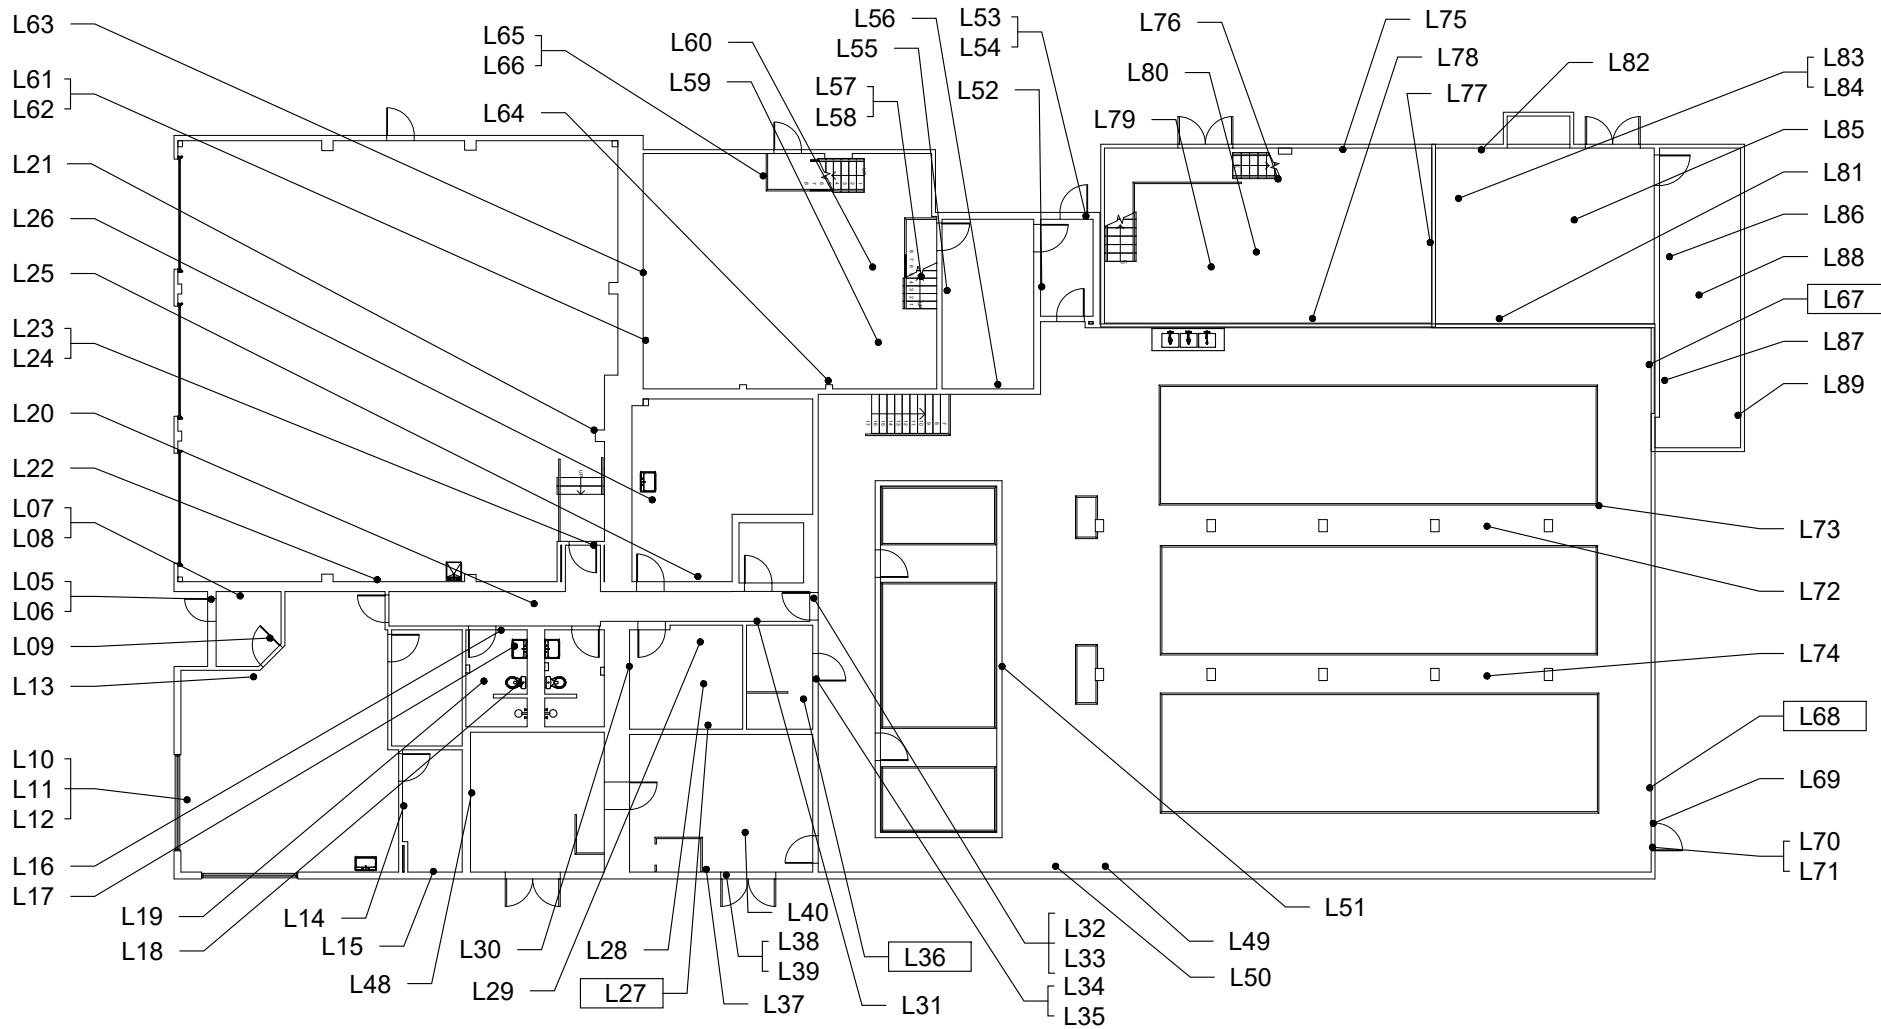

1
C-2

BUILDING 2316

NTS


LEGEND

● LXX LEAD TEST LOCATION

● LXX LEAD TEST CONTAINING $\geq 1.0 \text{ mg/cm}^2$ OF LEAD

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS.


UNITED STATES AIR FORCE	EILSON AIR FORCE BASE BUILDING 2316 GROUND FLOOR LEAD TEST LOCATIONS	 EHS ALASKA INCORPORATED ENGINEERING, HEALTH & SAFETY CONSULTANTS	DRAWN: FGG CHECK: RAF FILE #: 8145-SL	DATE: 11/05/2024 DWG.NO: C-2
-------------------------------	--	---	--	---------------------------------------

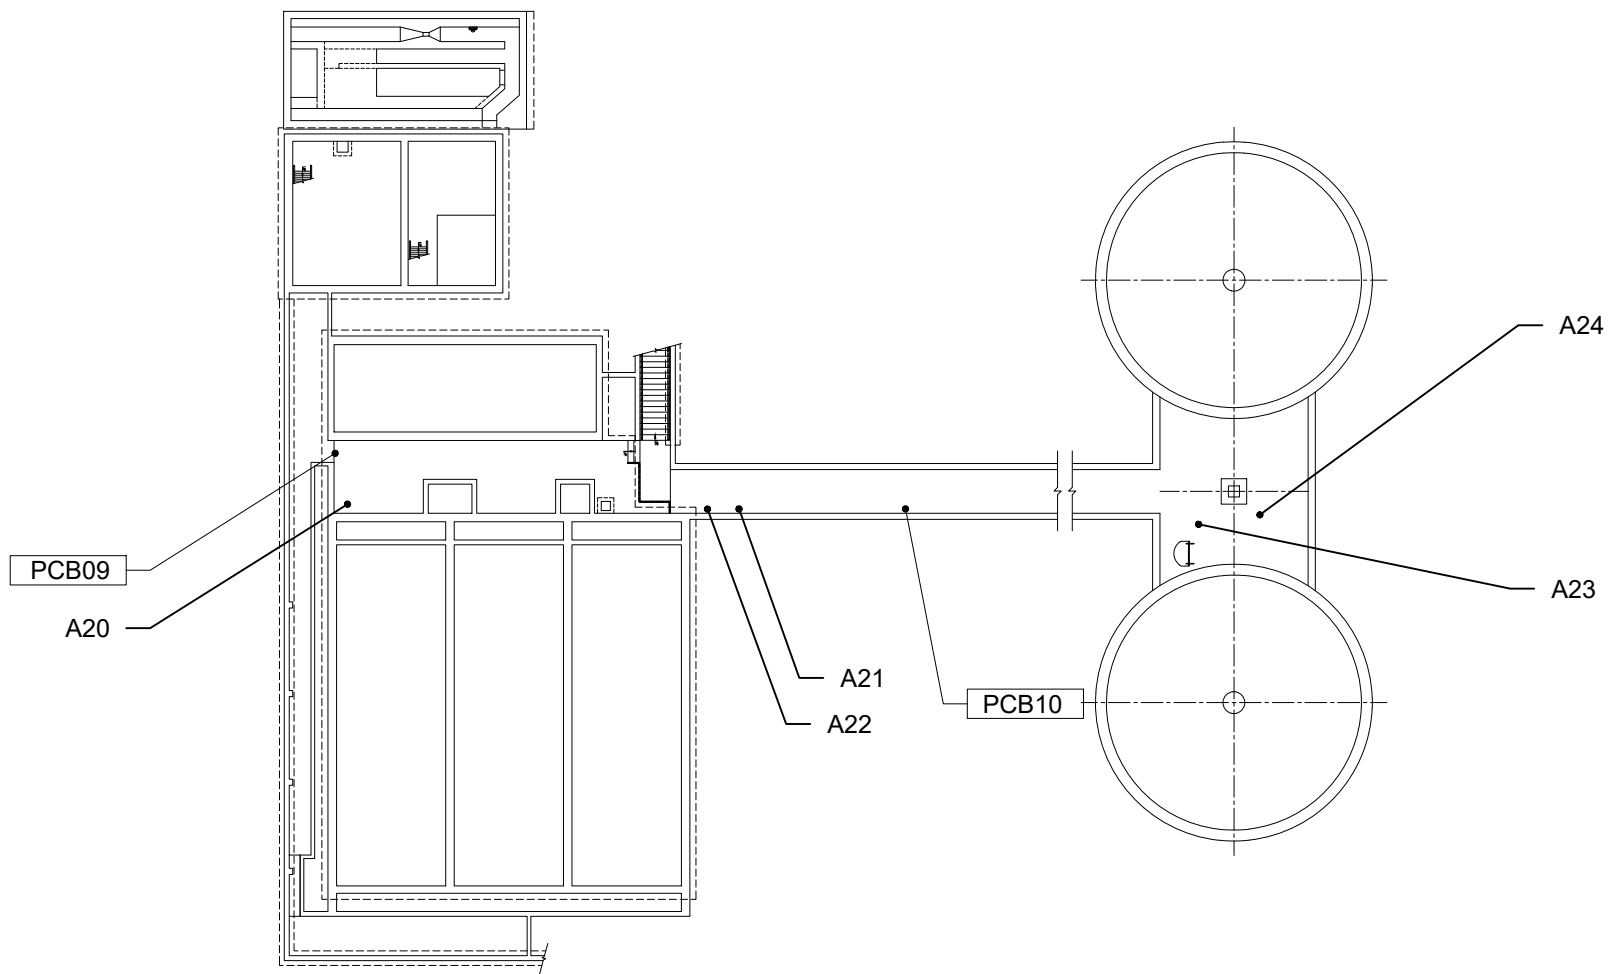

LEGEND

- PCBXX PCB TEST LOCATION
- PCBXX PCB TEST POSITIVE

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS.



**BUILDING 2316 - LL
NTS**



LEGEND

- AXX ASBESTOS TEST LOCATION
- AXX LAB TEST RESULTS POSITIVE FOR ASBESTOS

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS. ALL SAMPLES HAVE B2316-2411- PREFIX.

**UNITED
STATES
AIR FORCE**

**EILSON AIR FORCE BASE
BUILDING 2316 LOWER LEVEL
ASBESTOS & PCB SAMPLE LOCATIONS**



**EHS ALASKA
INCORPORATED**


ENGINEERING, HEALTH & SAFETY CONSULTANTS

**DRAWN: FGG
CHECK: RAF**

**FILE #:
8145-SL**

**DATE:
11/06-07/24**

**DWG.NO:
C-3**

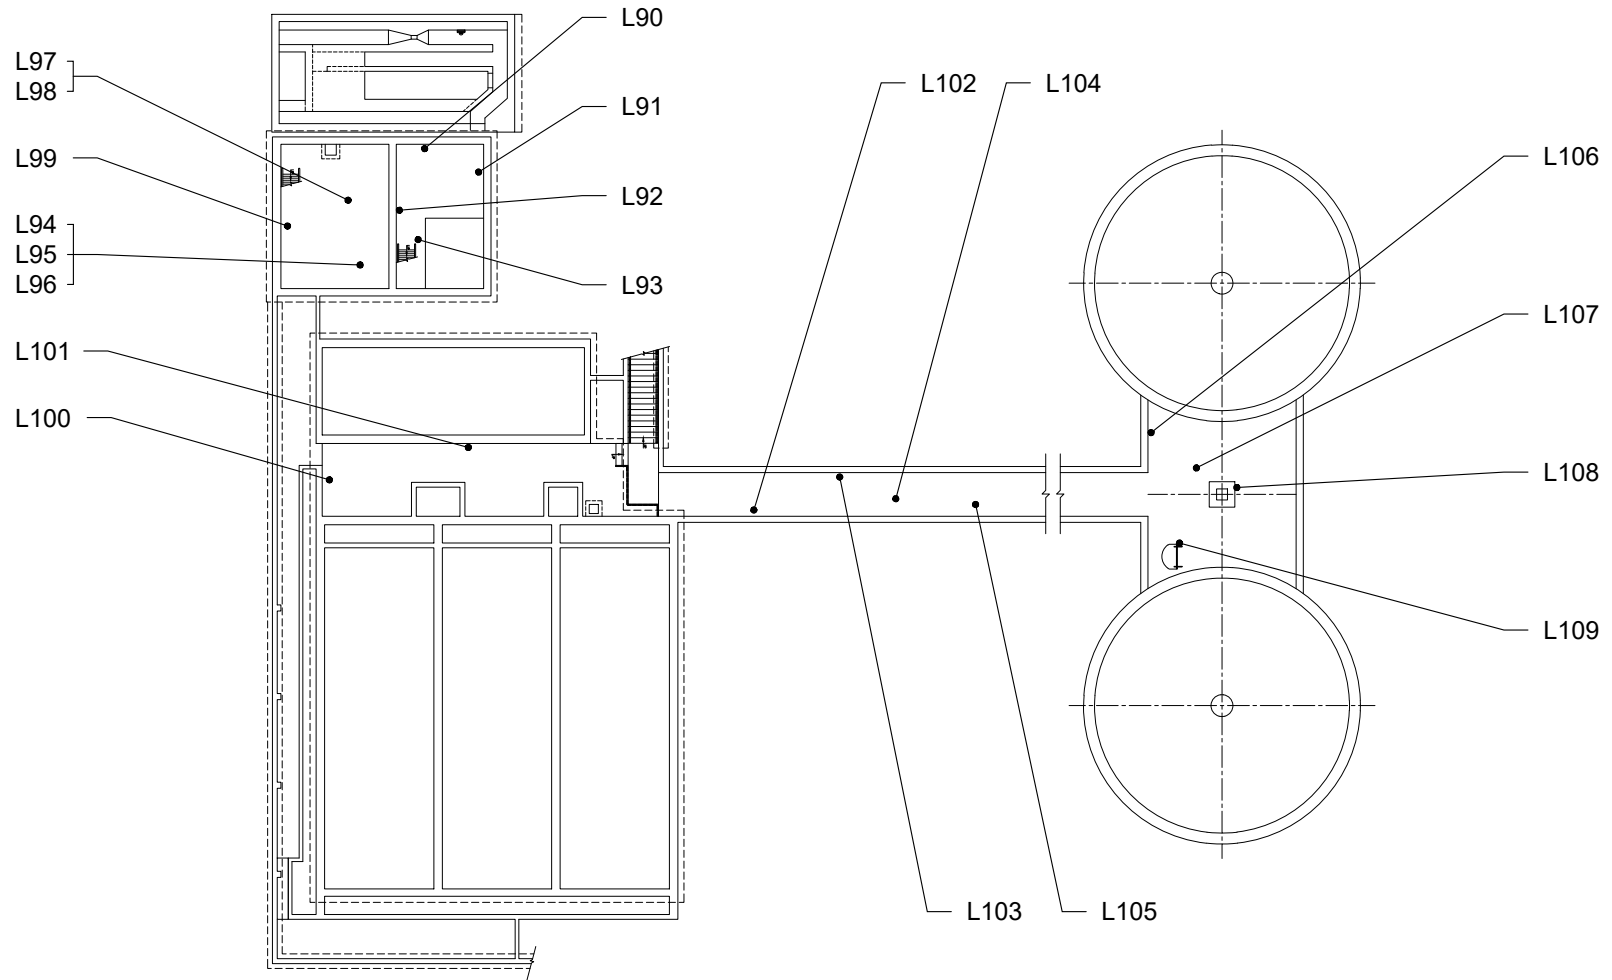

1
C-4

BUILDING 2316 - LL
NTS



LEGEND

- LXX LEAD TEST LOCATION
- LXX LEAD TEST CONTAINING ≥ 1.0 mg/cm² OF LEAD


REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS.

UNITED
STATES
AIR FORCE

EILSON AIR FORCE BASE
BUILDING 2316 LOWER LEVEL
LEAD TEST LOCATIONS



DRAWN: FGG	DATE: 11/05/2024
CHECK: RAF	DWG.NO: C-4
FILE #:	
8145-SL	

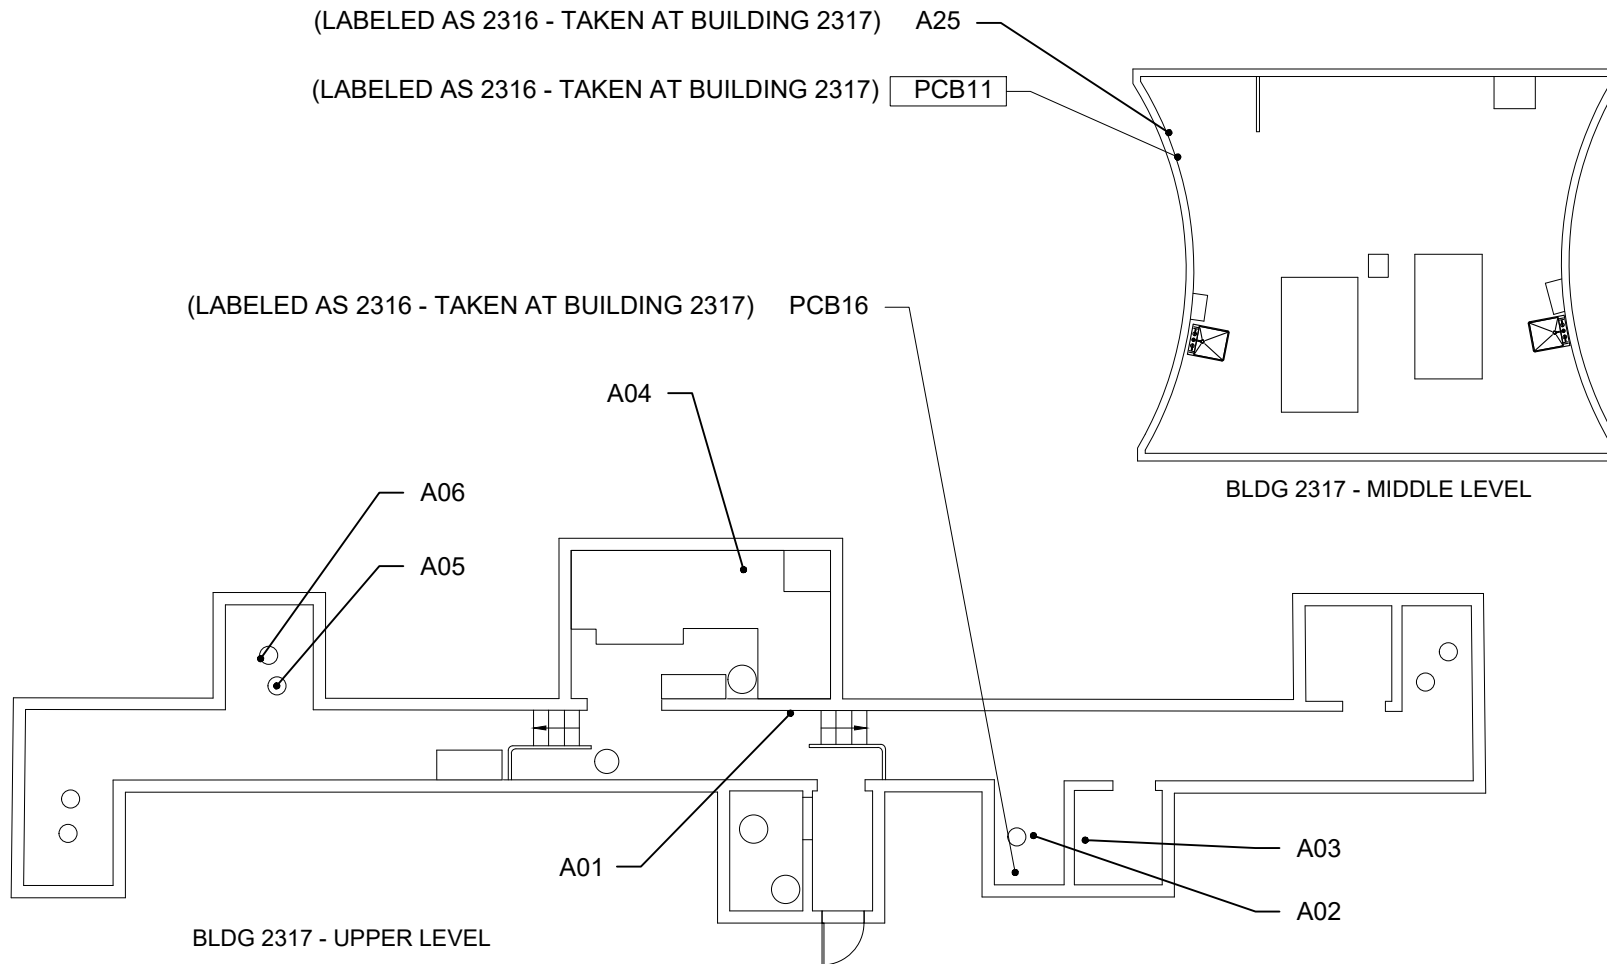


LEGEND

- PCBXX PCB TEST LOCATION
- PCBXX PCB TEST POSITIVE

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS.



BLDG 2317
NTS

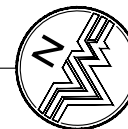

LEGEND

- AXX ASBESTOS TEST LOCATION
- AXX LAB TEST RESULTS POSITIVE FOR ASBESTOS

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS. ALL SAMPLES HAVE B2316-2411- AND B2317-2411- PREFIX.

UNITED
STATES
AIR FORCE

EILSON AIR FORCE BASE
BUILDING 2317 MIDDLE/UPPER
ASBESTOS & PCB SAMPLE LOCATIONS



EHS ALASKA
INCORPORATED


ENGINEERING, HEALTH & SAFETY CONSULTANTS

DRAWN: FGG
CHECK: RAF

FILE #:
8145-SL

DATE:
11/06-07/24

DWG.NO:
C-5

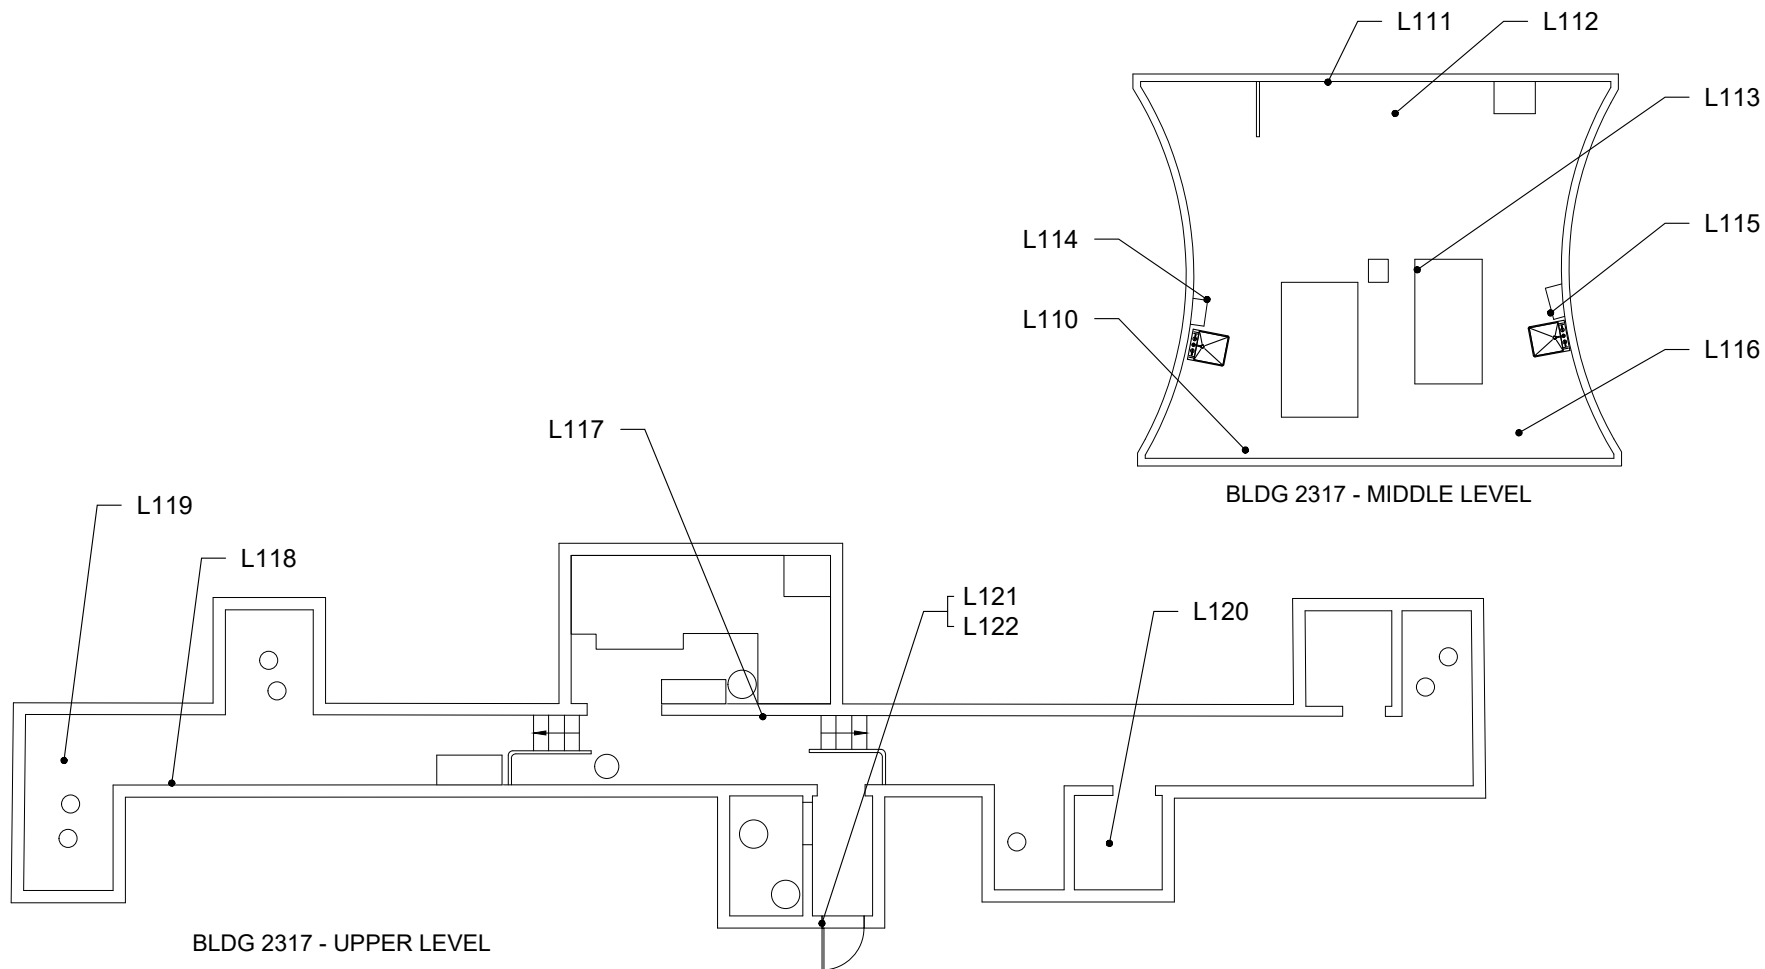

1
C-6

BUILDING 2317
NTS



UNITED
STATES
AIR FORCE

EILSON AIR FORCE BASE
BUILDING 2317 MIDDLE/UPPER
LEAD TEST LOCATIONS



EHS ALASKA
INCORPORATED





ENGINEERING, HEALTH & SAFETY CONSULTANTS

DRAWN: FGG
CHECK: RAF

DATE:
11/05/2024

FILE #:
8145-SL

DWG.NO:
C-6

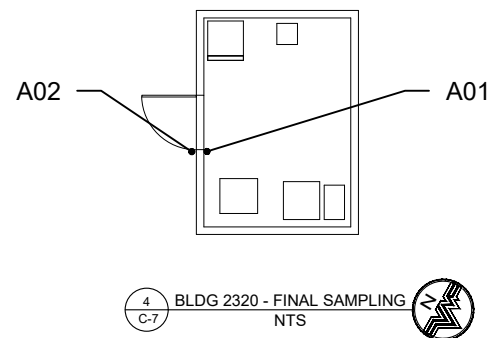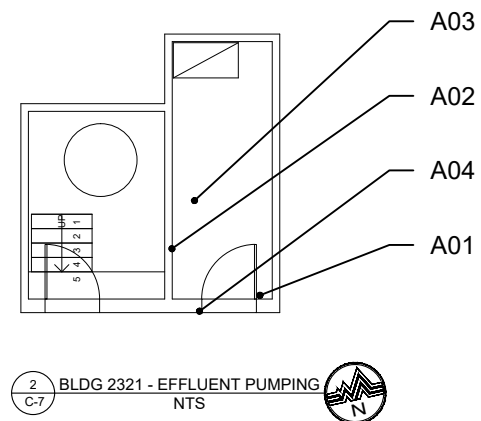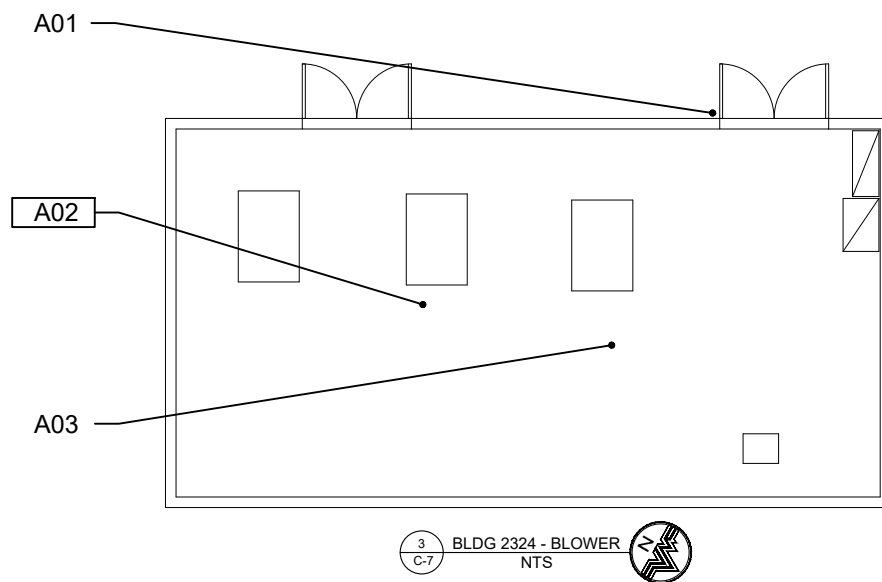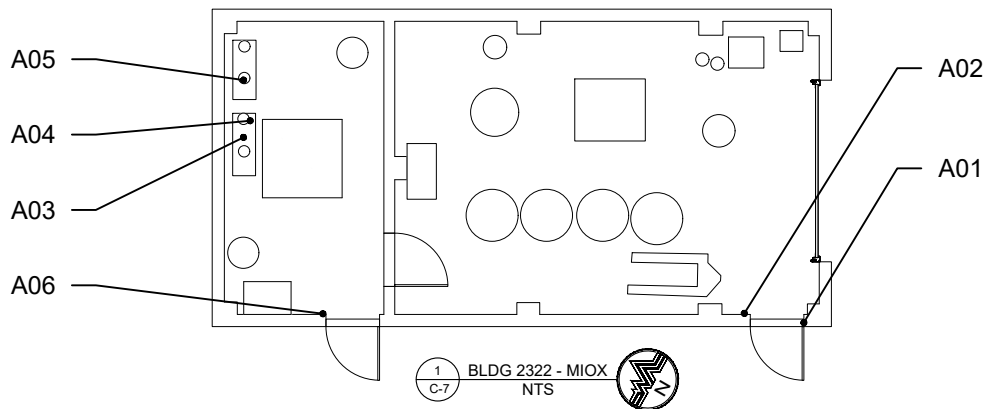

LEGEND

- AXX ASBESTOS TEST LOCATION
- AXX LAB TEST RESULTS POSITIVE FOR ASBESTOS

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS. ALL SAMPLES HAVE B2320-2411-, B2321-2411-, B2322-2411-, B2324-2411- PREFIX.





UNITED
STATES
AIR FORCE

EILSON AIR FORCE BASE
BLDGS 2320, 2321, 2322, 2324
ASBESTOS & PCB SAMPLE LOCATIONS



DRAWN: FGG
CHECK: RAF
FILE #:
8145-SL

DATE:
11/06-07/24
DWG.NO:
C-7

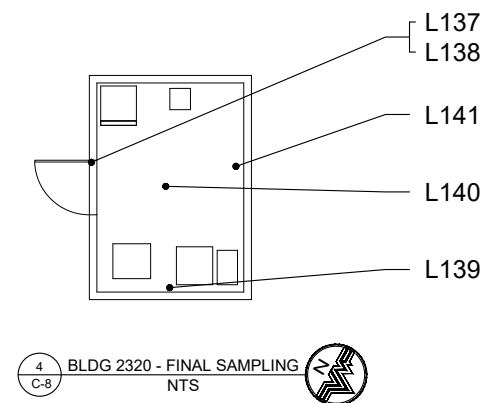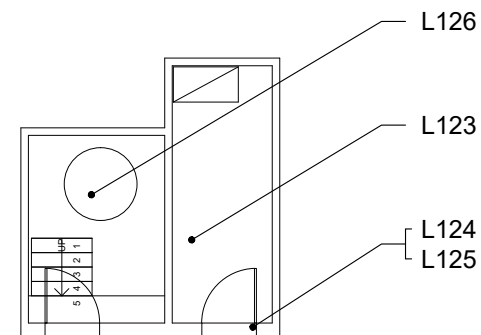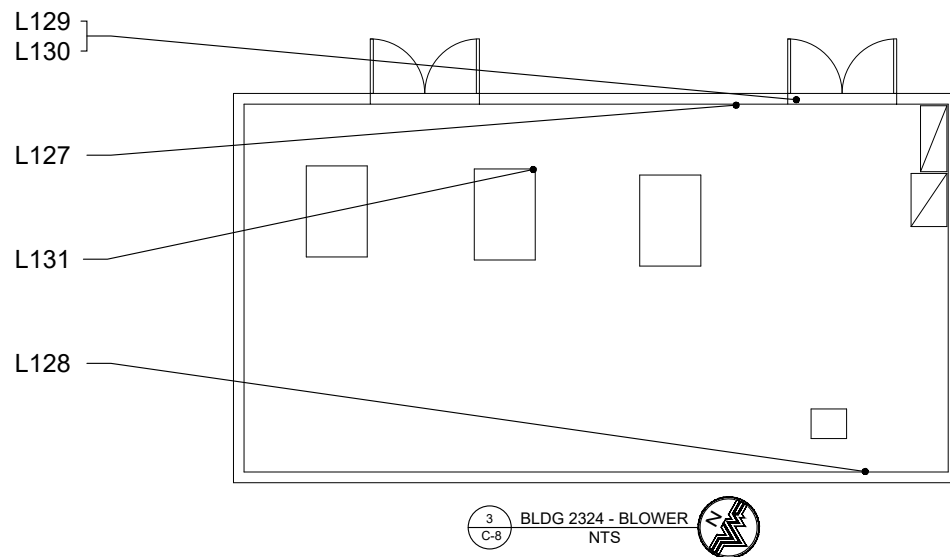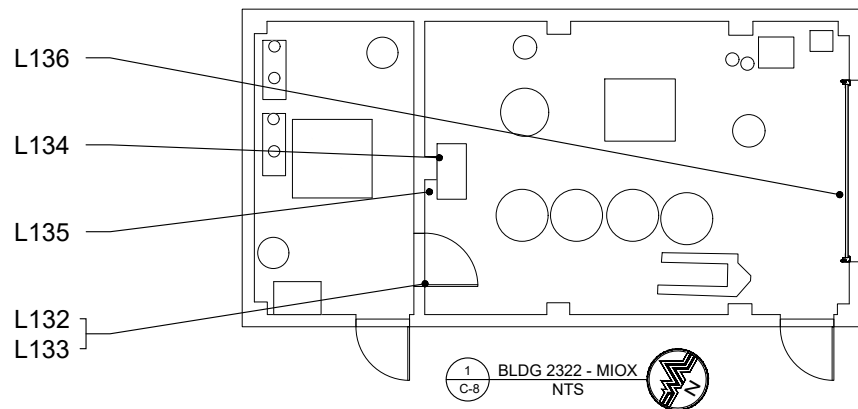

LEGEND

- LXX LEAD TEST LOCATION
- LXX LEAD TEST CONTAINING ≥ 1.0 mg/cm² OF LEAD

REFER TO TESTING SUMMARY IN REPORT FOR FULL DETAILS.

UNITED
STATES
AIR FORCE

EILSON AIR FORCE BASE
BLDGS 2320,2321,2322,2324
LEAD TEST LOCATIONS



DRAWN: FGG
CHECK: RAF
FILE #:
8145-SL

DATE:
11/05/2024
DWG.NO:
C-8