

MEMORANDUM


Subject: Asbestos Survey / Building A, 4th Floor

Date: February 9, 2023

Reply to Attention of: Daryl Kosturock, Environmental Manager

To: Henry Vo, Electrical Engineer

The GPO Safety Branch evaluated the spaces highlighted in the drawing seen below for the presence of asbestos containing materials (ACM) that may interfere with the construction / demolition tasks of converting this area of the building into Archival Storage for a tenant, the National Archives and Records Administration.

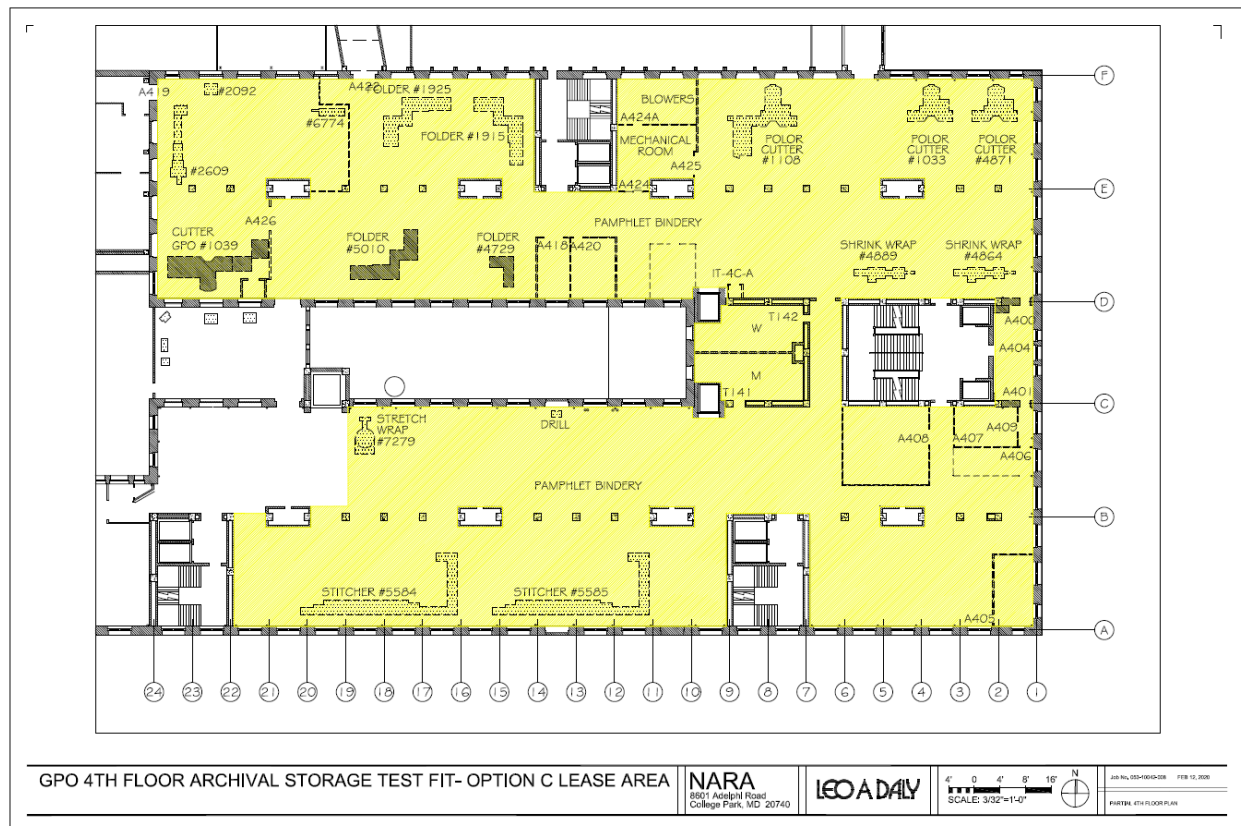

Scope: GPO Engineering has an upcoming project in design to move all GPO activities on the 4th Floor of Building A to another area in the complex, and convert this vacated space into Archival Storage for a tenant, the National Archives and Records Administration. A contractor or GPO Shops will perform major demolition and construction activities to accommodate this project.


MEMORANDUM

Page 2

Asbestos Survey Results: Asbestos was widely used in building materials prior to 1980. Since the GPO Central Complex buildings were constructed before this time, ACM can be found in building materials such as pipe insulation, troweled-on plaster, fire doors, wallboards, roof chalking and sealants, and vinyl floor tiles. Though much of the Building's ACM has been removed, some of these building materials are still present. Provided that the materials remain intact and undisturbed, the materials do not present an exposure risk. There are several areas of known ACM scattered throughout the footprint of this project and are noted below.

Known ACM: **Note: the following pictures will show several pipes wrapped with insulation. Generally, the Thermal Systems Insulation (TSI) with ACM will have Yellow and Black Caution stickers affixed, while the other unlabeled pipes are wrapped with TSI containing fiberglass.*


- 1) Stairway 4: Vertical chilled water pipes wrapped in TSI containing ACM, with branch pipes feeding the 4th Floor that are also wrapped in TSI with ACM.

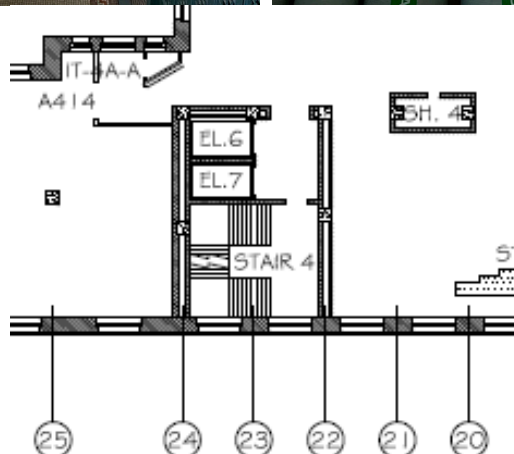


MEMORANDUM

Page 3

- 2) Column 4C13: Chilled water pipes wrapped in TSI with ACM.

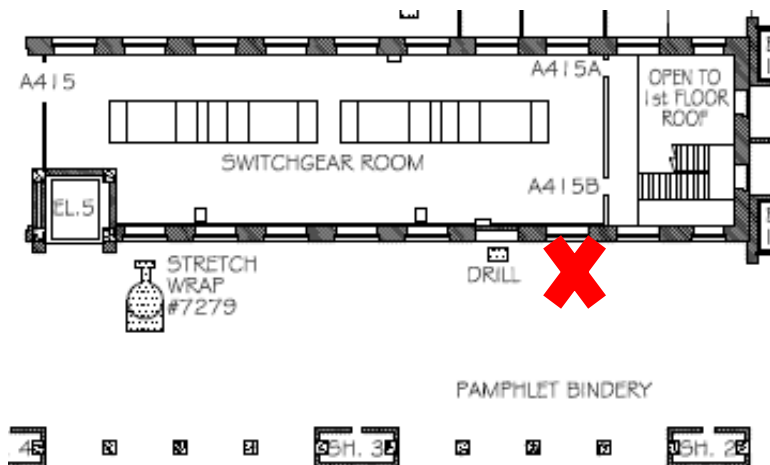


- 3) A424A, East wall: Chilled water pipes wrapped in TSI with ACM.

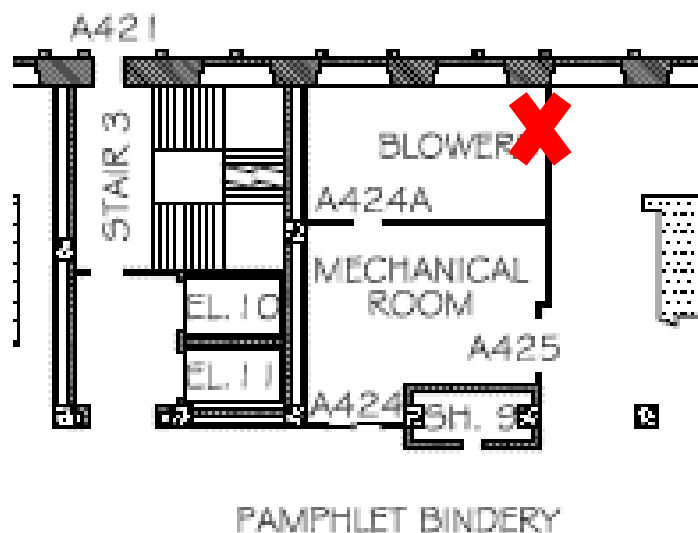


MEMORANDUM

Page 4

- 4) Column 4F8: Chilled water pipes wrapped in TSI with ACM.

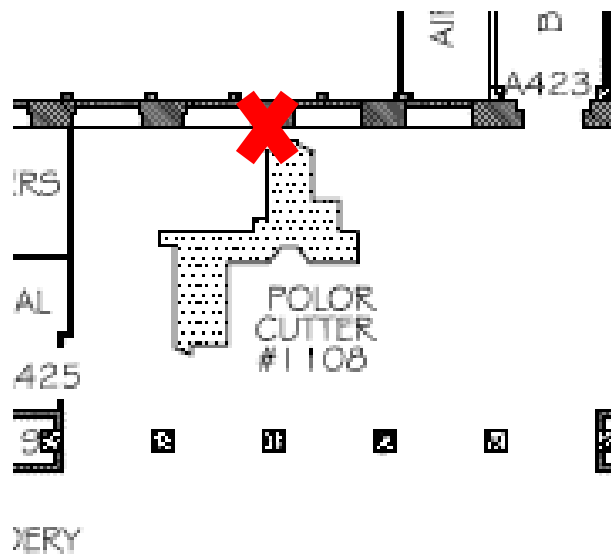


- 5) Column 4F7: Hot water pipes wrapped in TSI with ACM.

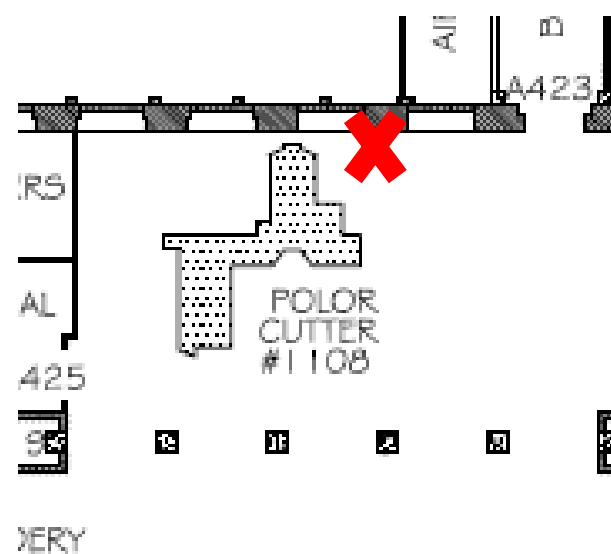


MEMORANDUM


Page 5

- 6) Columns 4A4 / 4A5: Rain leader pipes wrapped in insulation with ACM.

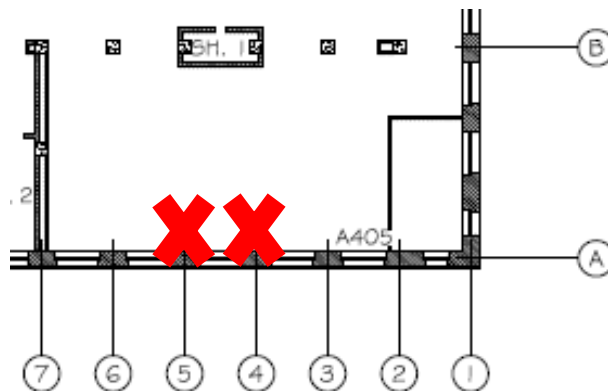

- 7) A424 / A424A / A425: Asbestos-containing, cement-board material (Transite) secured to the metal cage and used as wall boards:

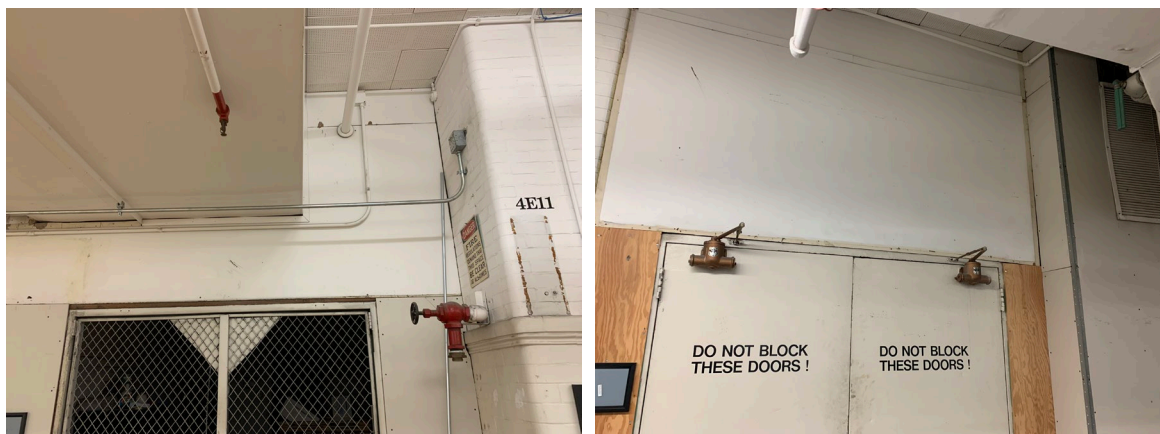

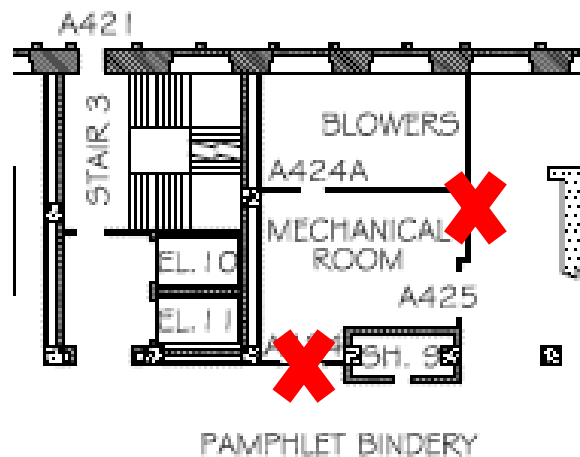

- 8) Shafts: Several of the shafts in the GPO Central Complex are known to contain ACM, mostly TSI and some cementitious material. A visual inspection of the shafts on the 4th Floor revealed no obvious ACM present. However, if any of these shafts must be entered from different floors in support of this project, ACM may be present.

Questionable Building Materials: Materials were found that required laboratory analysis to determine the presence of ACM. As seen in ATTACHMENT A, there was no ACM detected.

- 1) Entire 4th Floor: 12" X 12" fibrous (acoustic) ceiling tiles. **Note: the area survey revealed all ceiling tiles appeared to be fastened with nails and no mastic was found. There are other known areas within the Central Complex where mastic was used to fasten similar tiles. Laboratory results of that mastic have revealed both non-detect and ACM present.*

Recommendations: All work may proceed since all known ACM appears to be in good condition and questionable materials were determined to not contain ACM. Additionally;

- 1) Proper safe work practices and procedures shall be used while performing tasks in support of this project to minimize contact with ACM.
- 2) Care shall be used while entering all shafts within the Central Complex.
- 3) If previously unknown questionable materials are discovered during the demolition phase, samples shall be sent to a NVLAP Accredited laboratory to determine the presence of ACM, prior to disturbing these materials.
- 4) All known and unknown ACM that may interfere with this project shall be removed by a qualified ACM removal company, licensed through the District of Columbia, per 20 DCMR, Section 800 "Control of Asbestos."

Daryl Kosturock, CHST PMP

Environmental Manager

ATTACHMENT A



EMSL Analytical, Inc.

10752 Baltimore Avenue Beltsville, MD 20705

Tel/Fax: (301) 937-5700 / (301) 937-5701

<http://www.EMSL.com/beltsvillelab@emsl.com>

EMSL Order: 192301111

Customer ID: USGPO80

Customer PO:

Project ID:

Attention: Daryl Kosturock

US Govt Publishing Office Safety Branch

732 North Capitol Street NW

Washington, DC 20401

Phone: (202) 512-1628

Fax: (202) 512-1034

Received Date: 02/07/2023 10:14 AM

Analysis Date: 02/08/2023

Collected Date: 02/06/2023

Project: 20230208

**Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E
Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy**

Sample	Description	Appearance	Non-Asbestos		Asbestos % Type
			% Fibrous	% Non-Fibrous	
2023020801 192301111-0001	A403 / NEXT TO SHAFT 4 / CEILING BROWN/WHITE CEILING TILE	Brown/White Fibrous Homogeneous	98% Cellulose	2% Non-fibrous (Other)	None Detected
2023020802 192301111-0002	A420 / HALLWAY / CEILING BROWN/WHITE CEILING TILE	Brown/White Fibrous Homogeneous	98% Cellulose	2% Non-fibrous (Other)	None Detected
2023020803-Floor Tile 192301111-0003	B109 / NW CORNER / FLOOR BROWN FLOOR TILE WITH CLEAR MASTIC	Gray Non-Fibrous Homogeneous		50% Ca Carbonate 5% Mica 45% Non-fibrous (Other)	None Detected
2023020803-Mastic 192301111-0003A	B109 / NW CORNER / FLOOR BROWN FLOOR TILE WITH CLEAR MASTIC	Yellow Non-Fibrous Homogeneous	2% Cellulose	15% Ca Carbonate 5% Mica 78% Non-fibrous (Other)	None Detected
2023020804-Floor Tile 192301111-0004	B109 / NW CORNER / FLOOR / UNDER 2023020803 TAN FLOOR TILE WITH BLACK MASTIC	Brown Non-Fibrous Homogeneous	1% Cellulose 5% Wollastonite	50% Ca Carbonate 8% Mica 36% Non-fibrous (Other)	None Detected
2023020804-Mastic 192301111-0004A	B109 / NW CORNER / FLOOR / UNDER 2023020803 TAN FLOOR TILE WITH BLACK MASTIC	Black Non-Fibrous Homogeneous	2% Cellulose	15% Ca Carbonate 5% Mica 78% Non-fibrous (Other)	None Detected

Analyst(s)

Ryan Manion (S)

Joe Centifanti, Laboratory Manager
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and meet method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 "Interim Method") but augmented with procedures outlined in the 1993 ("final") version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Initial report from: 02/08/2023 16:31:23



MEMORANDUM

Subject: NARA 4th Floor Archive Storage Lead Survey

Date: November 8, 2022

Reply to Attention of: Joselito Sto Tomas, Industrial Hygienist, Safety Branch

To: Henry H. Vo, Electrical Engineer, Facilities Management Office

1. On 10/4-10/24/22, the IH conducted a lead survey of the Bindery area. The Bindery area is located on Bldg. A 4th Floor. The survey was requested by the Electrical Engineer to determine what architectural components in the Bindery area contain lead based or lead containing paint that would be impacted during the planned renovation of Bldg. A, 4th Floor.

The IH used a Niton XLp 301A Lead Paint analyzer to conduct non-destructive, real time testing of painted architectural components. 1.0 mg/cm² is the Department of Housing and Urban Development (HUD) testing standard for lead based paints. Any result at or above the standard means that the architectural component tested has lead-based paint and will show as positive result. Any result below the standard has lead levels below 1.0 mg/cm² and will show as a negative result. Note that a negative result does not mean that the surface has no lead content.

2. The results of the testing are as follows:

Table of Components that tested positive.

Component	Color	Location
Wall	White	Rm. A426, Column 4F24
Pipe1 Cover, fiberglass	White	Rm. A426
Pipe1 Cover, metal	Beige	Rm. A426
Pipe2 Cover, fiberglass	White	Rm. A426
Door Casing, metal	Beige	Rm. A426
Window Frame, metal	Beige	Rm. A426 Upper Window, North Side
Window Frame, metal	Beige	Rm. A426 Lower Window, North Side
Window Sill, Wood	Beige	Rm. A426, North Side
Wall	White	Rm. A426, Column 4F23 upper side
Wall	White	Rm. A426, Column 4F22 upper side

Table of Components that tested positive.

Component	Color	Location
Door Frame	Beige	Rm A426, elevator entrance
Wall	White	Rm. A426, Column 4F20 upper side
Wall	White	Rm. A426, south side, Column 4E18
Column	White	Rm A426, Column 4D24
Wall Covering, Metal	Beige	Rm A426, South side
Window Frame, Wood	White	Rm A426, South side
Column	White	Rm A426, Column 4D23
Window Frame, Wood	White	South Side
Window Frame, Wood	Beige	South Side
Column	White	Column 4E24 Upper Side
Wall	White	South Side next to fire exit
Column	White	Column 4E22 Upper Side next to fire exit
Column	White	Column 4E23 Upper Side
Column	White	Column 4D21 Upper Side
Column Footer, Concrete	Yellow	Column 4D21
Column Footer, Metal	Yellow	Column 4D21
Column	White	Column 4E20
Column	White	Column 4E19
Wall	White	Column 4E19
Roll on Door Frame	White	Column 4F19
Roll on Door Frame	Yellow	Column 4F19
Column	White	Column 4F18
Column Footer, concrete	Yellow	Column 4F18
Column Footer, concrete	Yellow	Column 4F18

Table of Components that tested positive.

Component	Color	Location
Window Frame, wood	White	Column 4F18
Window Frame, wood	Beige	Column 4F18
Column	White	Column 4F16
Window Frame, wood	White	Column 4F16
Window Frame, wood	Beige	Column 4F16
Column	White	Column 4F15
Window Frame, wood	White	Column 4F15
Window Frame, wood	Beige	Column 4F15
Window Sill, wood	Beige	Column 4F15
Window trough	Beige	Column 4F15
Wall	White	Column 4E14
Column	White	Column 4E15
Column	White	Column 4E16
Column	White	Column 4E17
Window Sill	White	Column 4D16
Column	White	Column 4E18
Column	White	Column 4D15
Window Casing	Beige	Column 4D15
Column	White	Column 4D16
Column	White	Column 4D17
Window Casing	White	Column 4D16
Window Sill	White	Column 4D18
Closet	White	Column 4D18
Window Casing	White	Column 4D18
Window Sill	White	Column 4D18
Column	White	Column 4D20
Column footer	Yellow	Column 4D20
Safety Railing	Yellow	Near Column 4D20
Safety Railing footer	Yellow	Near Column 4D20
Window Casing	White	Rm A418
Window Sill	Beige	Rm A418
Window Casing	White	Rm A420
Window Sill	Beige	Rm A420
Column	White	Column 4E15
Column	White	Column 4E13
Column	White	Column 4E12
Wall	White	Rm 424A South side

Table of Components that tested positive.

Component	Color	Location
Window casing	Brown	Rm 4244A North side
Window sill	Brown	Rm 424A North side upper window
Column	Yellow	Column 4F11
Column	Yellow	Column 4F10
Wall	Yellow	Rm 424A West side
Column footer	Beige	Column 4D10 office space
Window Frame	White	Office space
Window Casing	White	Office space
Wall	White	Rm A425 exterior south side
Window Frame	Beige	Column 4F9
Window Casing	White	Column 4F9
Window Sill	White	Column 4F9
Window Frame	Beige	Column 4F8
Window Casing	White	Column 4F8
Window Sill	White	Column 4F8
Column	White	Column 4F9
Column	White	Column 4F7
Column	White	Column 4F6
Column	White	Column 4E9
Safety Rail	Yellow	Near Column 4E9
Safety Rail footer	Yellow	Near Column 4E9
Column	White	Column 4E8
Column	White	Column 4E7
Column	White	Column 4E6
Wall, ceramic tile	Brown	T142/Women's RR North side
Wall, ceramic tile	Brown	T142/Women's RR East side
Wall, ceramic tile	Brown	T142/Women's RR South side
Wall, ceramic tile	Brown	T142/Women's RR West side
Wall, ceramic tile	White	T141/Men's RR North side
Wall, ceramic tile	White	T141/Men's RR North side
Wall, ceramic tile	White	T141/Men's RR North side
Wall, ceramic tile	White	T141/Men's RR North side
Janitor's sink	White	T141/Men's RR North side

Table of Components that tested positive.

Component	Color	Location
Door Frame	Beige	T141/Men's RR North side
Transom	Beige	T141/Men's RR North side
Wall, exterior	Beige	T141/Men's RR North side
Column	White	Column 4C7
Column Safety corner	Beige	Col 4C7
Wall, exterior	White	T142/Women's RR South side
Wall	White	Column 4D6
Wall	White	Column 4D4
Wall	White	Column 4D3
Door	Beige	Tape area
Door Frame	Beige	Tape area
Column	Beige	Column 4E5
Door Shaft	Beige	Column 4E5
Wall	Beige	Rm A404, north side
Wall	Beige	Rm A404, east side
Window Casing	Beige	Rm A404, east side
Wall	Beige	Rm A404, south side
Door	Beige	Rm A404, south side
Door Frame	Beige	Rm A404, south side
Column	White	Column 4F5
Column Safety Guard	Yellow	Column 4F5
Window Sill	Beige	Column 4F4
Wall	White	Column 4F4
Window Casing	Beige	Column 4F3
Column	White	Column 4F3
Column	White	Column 4F2
Window Casing	Beige	Column 4F1
Column	White	Column 4E1
Wall	White	Column 4E1
Window Sill	Beige	Column 4E1
Column	White	Column 4E1
Window Casing	White	Column 4D1
Window Sill	Beige	Column 4D1
Wall	White	Rm A406, north side
Door	Brown	Rm A409, north side
Wall Paneling	White	Rm A409, east side
Wall Paneling	White	Rm A409, west side
Window Casing	White	Rm A409, east side

Table of Components that tested positive.

Component	Color	Location
Wall	White	Rm A407 exterior, north side
Wall	White	Rm A408, north side
Column	White	Column 4B6
Column	White	Column 4B5
Column	White	Column 4B3
Column	White	Column 4B2
Column Railing Footer	Yellow	Column 4B2
Column Footer	Beige	Column 4B2
Wall	White	Rm A405, east side
Window Casing	White	Rm A405, east side
Window Sill	White	Rm A405, east side
Wall	White	Column 4A7
Window Casing	White	Column 4A3
Window Sill	White	Column 4A3
Column	White	Column 4A3
Column Footer	Beige	Column 4A3
Column	White	Column 4A3
Pipe Wrap	White	Column 4A5
Window Casing	White	Column 4A5
Window Sill	Beige	Column 4A5
Column	White	Column 4B7
Wall	White	Column 4B8
Column	White	Column 4B10
Shaft Door	Beige	Column 4B10
Column Footer	Yellow	Column 4B10
Column	White	Column 4B12
Column	White	Column 4B13
Column	White	Column 4B14
Railing	Beige	Column 4B14
Railing	Yellow	Column 4B14
Railing Footer	Yellow	Column 4B14
Column	White	Column 4B15
Door	Beige	Column 4B15 Shaft#3
Column	White	Column 4B16
Column	White	Column 4B17
Column	White	Column 4B18
Column	White	Column 4B19
Column	White	Column 4B20
Column	White	Column 4B21
Wall	White	Column 4A10 East side
Window Casing	White	Column 4A10
Column	White	Column 4A10
Column Footer	Beige	Column 4A10

Table of Components that tested positive.

Component	Color	Location
Column	White	Column 4A20
Column	White	Column 4A11
Window Casing	White	Column 4A11
Column	White	Column 4A13
Window Casing	White	Column 4A13
Column	White	Column 4A14
Window Casing	White	Column 4A14
Column	White	Column 4A15
Window Casing	White	Column 4A15
Column	White	Column 4A17
Window Sill	Beige	Column 4A17
Column	White	Column 4A18
Window Casing	White	Column 4A18
Window Sill	White	Column 4A18
Column	White	Column 4A19
Column Footer	White	Column 4A20
Safety Rail Footer	Yellow	Column 4A20
Column	White	Column 4C15
Window Frame Exterior	Beige	Column 4C15
Window Frame Exterior	Beige	Column 4C15
Window Casing	White	Column 4C14
Window Casing Guard	White	Column 4C13
Window Sill	White	Column 4C13
Column	White	Column 4C10
Column Footer	Yellow	Column 4C10
Door	White	EL #13
Door	Yellow	EL #13
Gate	Beige	EL #13
Column	White	Column 4C9
Column Footer	Yellow	Column 4C9
Column	White	Column 4C14
Column	White	Column 4C12
Column	White	Column 4B17

Table of Components that tested negative.

Component	Color	Location
Wall	Beige	Column F24
Pipe, metal	Beige	Column F24, pipe 2
Pipe, fiberglass	White	Column F24, pipe 2
Door	Beige	Rm A426, Fire Door exit
Door casing	Beige	Rm A426, Fire Door exit
Window board	Beige	Rm A426, north side
Pipe brace	Beige	Rm A426, north side
Pipe	Beige	Rm A426
Wall	Beige	Column 4F23
Pipe, metal	Beige	Column 4F23
Pipe, fiberglass	White	Column 4F23
Wall	Beige	Column 4F22
Wall	Beige	Column 4F20
Wall	White	Rm A426, East wall, upper side
Wall	Beige	Rm A426, East wall, lower side
Wall	Yellow	Rm A426, East wall, safety stop
Wall	Beige	Rm A426, South wall, Column 4E18
Pipe, fiberglass	White	Column 4D23
Pipe, metal	Beige	Column 4D23
Column	Beige	Column 4E24
Wall	Beige	Rm A426, south side, next to fire exit
Column	Beige	Column 4E22
Column	Beige	Column 4E23
Column	Beige	Column 4D21, Rm A426 ext.
Pipe, fiberglass	Beige	Column 4D21
Pipe, metal	Gray	Column 4D21
Wall	White	Rm A426 ext.
Wall	Beige	Rm A426 ext.
Safety Railing	Yellow	Rm A426 ext.
Door Frame	Beige	Rm A426 ext.
Door	Beige	Rm A426 ext.
Electrical Panel	Gray	Panel A-P-4-7
Door	Beige	Shaft #7
Door Frame	Beige	Shaft #7
Electrical Panel	Beige	Panel A-L-4-7
Column	Beige	Column 4E20
Column Footer	Yellow	Column 4E20

Table of Components that tested negative.

Component	Color	Location
Column	Beige	Column 4E20
Column Footer	Yellow	Column 4E20
Safety Railing	Yellow	Column 4E20
Column	Beige	Column 4E19
Wall	Beige	Rm A426, south exterior wall
Wall	White	Rm A426, south exterior wall
Wall cover	Yellow	Rm A426, south exterior wall
Safety Railing	Yellow	Rm A426, exterior
Wall	White	Rm A426, exterior north wall
Wall	Beige	Rm A426, exterior north wall
Wall	Yellow	Rm A426, exterior north wall
Wall footer	Yellow	Rm A426, exterior north wall
Wall	Beige	Column 4F19
Wall footer	Yellow	Column 4F19
Column	Beige	Column 4F19
Pipe, metal	Beige	Column 4F19
Safety Rail	Yellow	Column 4F18
Column	Beige	Column 4F18
Wall	Beige	Column 4F18
Window Cover	Beige	Column 4F18
Column	Beige	Column 4F17
Column Footer	Beige	Column 4F17
Pipe, fiberglass	White	Column 4F17
Pipe, metal	Beige	Column 4F17
Column	Beige	Column 4F16
Pipe, fiberglass	White	Column 4F16
Pipe, metal	Beige	Column 4F16
Pipe vertical, pipe wrap	White	Column 4F16
Pipe vertical	Metal	Column 4F16
Wall	Beige	Column 4F16
Wall cover	Beige	Column 4F16
Column	Beige	Column 4F15
Wall	Beige	Column 4F15
Wall Cover	Beige	Column 4F15
Column	Beige	Column 4F14
Column footer	Beige	Column 4F14

Table of Components that tested negative.

Component	Color	Location
Pipe, fiberglass	White	Column 4F14
Pipe, metal	Metal	Column 4F14
Wall	Beige	Column 4F14
Wall	Beige	Column 4E14
Column	Beige	Column 4E15
Column	Beige	Column 4E16
Column	Beige	Column 4E17
Column footer	Beige	Column 4E17
Column	Beige	Column 4E18
Window Frame	Gray	Column 4D15
Window	Gray	Column 4D15
Column	Beige	Column 4D16
Window Sill	Beige	Column 4D16
Column	Beige	Column 4D17
Window Frame	White	Column 4D17
Window	White	Column 4D17
Storage space	Beige	Column 4D17
Closet	Beige	Column 4D18
Column	Beige	Column 4D20
Wall, exterior	Beige	Rm A418
Door	Beige	Rm A418
Door hinge	Gray	Rm A418
Wall, interior	Beige	Rm A418, north side
Wall, interior	Beige	Rm A418, east side
Wall, exterior	Beige	Rm A418, south side
Wall, exterior	Beige	Rm A420, south side
Wall, exterior	Beige	Rm A420, east side
Wall Footer	Beige	Rm A420, east side
Wall Footer	Beige	Rm A420, south side
Door	Beige	Rm A420, east side
Door Jamb	Metal	Rm A420, east side
Door hinge	Metal	Rm A420, east side
Wall	Beige	Rm A420, south side
Safety railing	Yellow	Rm A418
Column	Beige	Column 4E14
Column	Beige	Column 4E13
Column	Beige	Column 3E12
Column Footer	Beige	Column 4E12
Door Frame	White	Rm. A424, north side
Door	White	Rm. A424, north side
Wall	White	Rm. A424, south side
Door Frame	Beige	Rm. A424, east side

Table of Components that tested negative.

Component	Color	Location
Door	Beige	Rm A424, east side
Wall	Beige	Rm A424, east side
Wall	Beige	Rm A424, south side
Wall	Beige	Rm A424, south side
Wall	Beige	Rm A424A, north side
Wall, exterior	Gray	Rm A424A, exterior north side
Wall	Beige	Rm A424A, north side
Pipe, fiberglass	Beige	Rm A424A, north side
Column	Beige	Column 4F10
Pipe, fiberglass	Beige	Rm A424A, north side
Wall Stud	Brown	Rm A424A
Door	Gray	Rm 424A, south side
Door frame	Gray	Rm 424A, south side
Door jamb	Copper	Rm A424A, south side
Column	Beige	Office Space
Wall	Beige	Rm. A425, south exterior wall
Wall footer	Beige	Rm. A425, south exterior wall
Door	Beige	Rm. A425, entrance
Door frame	Beige	Rm. A425, entrance
Wall	Beige	Rm. A425, entrance
Wall	Beige	Column 4F9
Column	Beige	Column 4F9
Pipe, fiberglass	White	Column 4F9
Pipe, metal	Beige	Column 4F9
Pipe, cold water wrap	White	Column 4F9
Pipe, cold water wrap	White	Column 4F8
Pipe, metal	Beige	Column 4F8
Window casing	White	Column 4F7
Window sill	White	Column 4F7
Column	Beige	Column 4F7
Pipe, cold water wrap	White	Column 4F7
Pipe, cold water	Beige	Column 4F7
Wall	Beige	Column 4F7
Column	Beige	Column 4F6
Wall	White	Bridge 31, north side
Wall	Yellow	Bridge 31, north side
Column	Beige	Column 4E9
Column footer	Beige	Column 4E9

Table of Components that tested negative.

Component	Color	Location
Safety Rail	Yellow	Column 4E9
Column	Beige	Column 4E8
Column footer	Beige	Column 4E8
Column	Beige	Column 4E7
Column	Beige	Column 4E6
Column footer	Beige	Column 4E6
Wash basin	White	Rm. T142, Women's RR
Wall Frame	Red	Rm. T142, Women's RR, south side
Stall	Red	Rm. T142, Women's RR
Stall Door	Red	Rm. T142, Women's RR
Stall Wall, interior	Red	Rm. T142, Women's RR
Toilet Paper dispenser	Gray	Rm. T142, Women's RR
Wall Extension	Beige	Rm. T142, Women's RR
Well Extension Frame	Beige	Rm. T142, Women's RR
Commode	White	Rm. T142, Women's RR
Door Frame	Beige	Rm. T142, Women's RR, south side
Door	Beige	Rm. T142, Women's RR, south side
Door Jamb	Brass	Rm. T142, Women's RR, south side
Entry way, wood	Beige	Rm. T142, Women's RR, exterior
Commode	White	Rm. T141, Men's RR
Urinal	White	Rm. T141, Men's RR
Wash Stand	White	Rm. T141, Men's RR
Stall Wall	Blue	Rm. T141, Men's RR
Stall Door	Blue	Rm. T141, Men's RR
Heater	Beige	Rm. T141, Men's RR
Door	Beige	Rm. T141, Men's RR
Door Frame	Beige	Rm. T141, Men's RR
Wall, exterior	Beige	Rm T142, Women's RR
Wall exterior footer	Beige	Rm T142, Women's RR
Wall	Beige	Column 4D6
Wall	Beige	Column 4D4

Table of Components that tested negative.

Component	Color	Location
Wall footer	Beige	Column 4D4
Wall	Beige	Stairwell 1
Wall	White	Stairwell 1
Door	Wood	Stairwell 1
Door Jamb	Copper	Stairwell 1
Door Casing	Beige	Stairwell 1
Wall	Beige	Column 4D3
Wall footer	Beige	Column 4D3
Pipe1, fiberglass	White	Column 4D3
Pipe1, metal	Beige	Column 4D3
Pipe2, fiberglass	White	Column 4D3
Pipe2, metal	Beige	Column 4D3
Column	Beige	Column 4E5
Electrical Box	Beige	Column 4E5
Column Footer	Beige	Column 4E5
Safety Railing	Yellow	Column 4E5
Water Fountain	Gray	Column 4E5
Sink	Gray	Column 4E5
Wall	Beige	Rm A404, north side
Wall molding	Beige	Rm A404, north side
Wall	Beige	Rm A404, east side
Wall molding	Beige	Rm A404, east side
Window Frame	Beige	Rm A404, east side
Wall	Beige	Rm A404, south side
Wall molding	Beige	Rm A 404, south side
Wall	White	Rm A404, south side
Wall	Beige	Rm A404, south side
Transom	Beige	Rm A404, south side
Column	Beige	Column 4F4
Column footer	Beige	Column 4F4
Pipe, fiberglass	White	Column 4F4
Pipe, metal	Beige	Column 4F4
Window frame	Brown	Column 4F3
Pipe, fiberglass	White	Column 4F3
Pipe, metal	Beige	Column 4F3
Column	Beige	Column 4F3
Column footer	Beige	Column 4F3
Pipe, fiberglass	White	Column 4F3
Pipe, metal	Beige	Column 4F3
Column	Beige	Column 4F2
Column footer	Beige	Column 4F2
Window frame	Brown	Column 4F1
Wall	Beige	Column 4E1
Window frame	Beige	Column 4F1
Column	Beige	Column 4E1

Table of Components that tested negative.

Component	Color	Location
Pipe, fiberglass	White	Column 4E1
Pipe, metal	Beige	Column 4E1
Window frame	Brown	Column 4E1
Window Casing	White	Column 4E1
Wall	Beige	Column 4E1
Pipe, fiberglass	White	Column 4E1
Pipe, metal	Beige	Column 4E1
Window frame	Brown	Column D1
Wall	Beige	Column 4D1
Wall	White	Rm A406, north side
Door frame	White	Rm A406, east side
Door, metal	Brown	Rm A406, east side
Door jamb	Brass	Rm A406, north side
Door	Brown	Rm A406, south side
Transom	White	Rm A409, north side
Wall paneling	White	Rm A409, east side
Wall	White	Rm A409, east side
Window frame	Brown	Rm A409, east side
Window	Clear	Rm A409, east side
Window sill	White	Rm A409, east side
Wall	White	Rm A409, south side
Pipe, fiberglass	White	Rm A409
Pipe, metal	Gray	Rm A409
Door frame	Brown	Rm A409, south side
Door	Brown	Rm A409, south side
Wall	White	Rm A409, south side
Door	Brown	Rm A409, south side
Door frame	Brown	Rm A409, south side
Safety footer	Yellow	Rm A407 exterior, east side
Trim, yellow	Yellow	Rm A407, exterior, east side
Wall	White	Rm A407, exterior, east side
Wall	Beige	Rm A407, exterior, east side
Window frame	Brown	Rm A407, exterior, east side
Window frame	Brown	Rm A407, exterior, south side
Door frame	Brown	Rm A407, exterior, east side
Door	Brown	Rm A407, east side
Wall, exterior	White	Rm A408, south side
Wall, exterior	Beige	Rm A408, south side

Table of Components that tested negative.

Component	Color	Location
Wall, exterior	White	Rm A408, north side
Wall, exterior	Beige	Rm A408, north side
Wall exterior	White	Rm A408, south side
Wall, exterior	Beige	Rm A408, south side
Floor safety guide	Yellow	Rm A408 exterior, east side
Floor safety guide	Yellow	Rm A408 exterior, south side
Floor safety guide	Yellow	Rm A408 exterior, west side
Window frame, exterior	Beige	Rm A408, west side
Window frame, exterior	Beige	Rm A408, north side
Column	Beige	Column 4B6
Column footer	Beige	Column 4B6
Column	Beige	Column 4B5
Column footer	Beige	Column 4B5
Sink	Gray	Column 4B5
Drinking Fountain	Gray	Column 4B5
Column	White	Column 4B3
Column	White	Column 4B2
Column	Beige	Column 4B2
Column Railing	Yellow	Column 4B2
Wall	Beige	Rm A405, north side
Wall	Beige	Rm A405, east side
Window frame	Brown	Rm A405, east side
Wall	Beige	Rm A405, south side
Window frame	Beige	Rm A405, south side
Door	Beige	Rm A405, south side
Door, exterior	Beige	Rm A405, south side
Door Frame, exterior	Beige	Rm A405, east side
Door, exterior	Beige	Rm A405, east side
Window frame, exterior	Beige	Rm A405, east side
Wall, exterior	Brown	Rm A405, south side
Wall, exterior	Beige	Rm A405, south side
Wall exterior, corner protector	White	Rm A405, south side
Wall	Beige	Column 4A7
Wall footer	Beige	Column 4A7
Window frame	Beige	Column 4A3
Column	Beige	Column 4A3

Table of Components that tested negative.

Component	Color	Location
Wall	Beige	Column 4B8
Column	Beige	Column 4B10
Door Frame	Beige	Column 4B10
Electrical Panel	Beige	Column 4B10
Column footer	Beige	Column 4B10
Column footer	Beige	Column 4B10
Column	Beige	Column 4B12
Column footer	Beige	Column 4B12
Column	Beige	Column 4B13
Column footer	Beige	Column 4B13
Column	Beige	Column 4B14
Column footer	Beige	Column 4B14
Column railing	Yellow	Column 4B14
Column	Beige	Column 4B15
Column footer	Beige	Column 4B15
Electrical panel	Beige	Column 4B15
Door frame	Beige	Column 4B15
Column	Beige	Column 4B16
Column 4B16 footer	Beige	Column 4B16
Railing	Yellow	Column 4B15
Water Fountain	Gray	Column 4B15
Column	Beige	Column 4B17
Column footer	Beige	Column 4B17
Column	Beige	Column 4B18
Column	Beige	Column 4B19
Column footer	Beige	Column 4B19
Platform	Beige	Column 4B19
Platform railing	Beige	Column 4B19
Column	Beige	Column 4B20
Column footer	Beige	Column 4B20
Column	Beige	Column 4B21
Column footer	Beige	Column 4B21
Column footer	Beige	Column 4B21
IT junction box	Beige	Column 4B21
Railing	Beige	Column 4B21
Railing footer	Beige	Column 4B21
Wall	Beige	Column 4A10
Wall footer	Beige	Column 4A10
Column	Beige	Column 4A5
Column	Beige	Column 4B7

Table of Components that tested negative.

Component	Color	Location
Column	Beige	Column 4A10
Pipe, fiberglass	White	Column 4A10
Pipe, metal	Beige	Column 4A10
Safety rail	Yellow	Column 4A11
Window frame	Yellow	Column 4A11
Window casing	Brown	Column 4A11
Column	Beige	Column 4A11
Column footer	Beige	Column 4A11
Pipe, fiberglass	White	Column 4A11
Pipe, metal	Beige	Column 4A11
Safety rail	Yellow	Column 4A11
Window frame	Brown	Column 4A11
Window casing	Brown	Column 4A11
Column	Beige	Column 4A13
Column footer	Beige	Column 4A13
Pipe, fiberglass	White	Column 4A13
Pipe, metal	Brown	Column 4A13
Column	Beige	Column 4A14
Pipe, fiberglass	White	Column 4A14
Pipe, metal	Beige	Column 4A14
Window frame	Brown	Column 4A14
Window casing	Brown	Column 4A14
Radiator	Beige	Column 4A14
Column	Beige	Column 4A15
Pipe, fiberglass	White	Column 4A15
Pipe, Metal	Beige	Column 4A15
Window frame	Brown	Column 4A17
Window casing	Beige	Column 4A17
Column	Beige	Column 4A18
Column footer	Beige	Column 4A18
Window frame	Brown	Column 4A18
Pipe, fiberglass	White	Column 4A18
Pipe, metal	Beige	Column 4A18
Window frame	Brown	Column 4A18
Wall	Beige	Column 4A19
Column	Beige	Column 4A20
Pipe, fiberglass	White	Column 4A20
Pipe, metal	Beige	Column 4A20
Wall	Beige	Column 4A20
Safety rail	Yellow	Column 4A20
Column	Beige	Column 4C18
Pipe, fiberglass	White	Column 4C18
Pipe, metal	Beige	Column 4C18
Window frame	Gray	Column 4C18

Table of Components that tested negative.

Component	Color	Location
Radiator	Beige	Column 4C18
Column footer	Beige	Column 4C18
Wall	Beige	Column 4C18
Cabinet	Beige	Column 4C14
Pipe, fiberglass	White	Column 4C14
Pipe, metal	Beige	Column 4C14
Column	Beige	Column 4C12
Column footer	Beige	Column 4C12
Radiator	Beige	Column 4C12
Column	Beige	Column 4C10
Column	Beige	Column 4C9
Floor, wood	Brown	Column 4A21
Floor, wood	Brown	Column 4A20
Floor, wood	Brown	Column 4A19
Floor, wood	Brown	Column 4A16
Floor, wood	Brown	Column 4A15
Floor, wood	Brown	Column 4A13
Floor, wood	Brown	Column 4A11
Floor, wood	Brown	Column 4B12
Floor safety line	Yellow	Column 4B12
Floor, wood	Brown	Column 4B13
Floor safety line	Yellow	Column 4B13
Floor, wood	Brown	Column 4B14
Floor, wood	Brown	Column 4B15
Floor, wood	Brown	Column 4B16
Floor safety line	Yellow	Column 4B16
Floor, wood	Brown	Column 4B17
Floor, concrete	Gray	Column 4B18
Floor, concrete	Gray	Column 4B19
Floor, wood	Brown	Column 4C19
Floor, wood	Brown	Column 4C18
Floor, wood	Brown	Column 4C16
Floor, wood	Brown	Column 4C14
Floor, wood	Brown	Column 4C12
Floor, wood	Brown	Column 4C11
Floor, wood	Brown	Column 4C10
Floor, wood	Brown	Column 4C9
Floor, wood	Brown	Column 4C8
Floor, wood	Brown	Column 4C7
Floor, safety line	Yellow	Column 4C7
Floor, safety line	Yellow	Column 4B7
Floor, safety line	Yellow	Column 4B8
Floor, safety line	Yellow	Column 4B9
Floor, wood	Brown	Column 4B9-Column 4D7 passageway

Table of Components that tested negative.

Component	Color	Location
Floor, ceramic tile	Gray	T141, Men's RR
Floor, ceramic tile	White	T142, Women's RR
Floor, wood	Brown	Column 4B6
Floor, wood	Brown	Column 4B5
Floor, wood	Brown	Column 4B4
Floor, wood	Brown	Column 4B3
Floor, wood	Brown	Column 4B2
Floor, wood	Brown	Column 4A3
Floor, wood	Brown	Column 4A4
Floor, wood	Brown	Column 4A5
Floor, wood	Brown	Column 4A6
Floor, wood	Brown	Column 4A7
Floor, wood	Brown	Column 4C3
Floor, concrete	Gray	Column 4E2
Floor, concrete	Gray	Column 4E3
Floor, concrete	Gray	Column 4E4
Floor, concrete	Gray	Column 4E6
Floor, concrete	Gray	Column 4E8
Floor, concrete	Gray	Column 4F7
Floor, concrete	Gray	Column 4F4
Floor, concrete	Gray	Column 4E1
Floor, wood	Brown	Column 4E12
Floor, wood	Brown	Rm A418
Floor, wood	Brown	Column 4D16
Floor, wood	Brown	Column 4D18
Floor, wood	Brown	Column 4D21
Floor, wood	Brown	Column 4E19
Floor, wood	Brown	Column 4E17
Floor, wood	Brown	Column 4E15
Floor, wood	Brown	Column 4E14
Floor, concrete	Gray	Column 4E20
Floor, concrete	Gray	Column 4E18
Floor, concrete	Black	Column 4E16
Floor, concrete	Black	Column 4E12
Floor, concrete	Black	Column 4E10
Floor, concrete	Gray	Rm A424A
Floor, concrete	Gray	Rm A424
Floor, wood	Brown	Column 4D10
Floor, wood	Brown	Rm A420

MEMORANDUM

Page 20

3. Observations:

- a) The IH was not able to access the ceiling of the 4th floor, Bldg. A. Kindly notify the IH if the ceiling will be impacted so that XRF testing can be done.
- b) The pipes have typically 2 surfaces. The lower half has a metal guard while the upper part has a pipe wrap surface. Both surfaces tested negative for lead based paint.



- c) It is noted that the top half of the walls and columns have generally tested to be positive for lead based paint.

- d) Footer refers to the architectural component found at the base of safety railings, walls and columns



- e) It should be stressed that a negative reading by the Niton XRF paint analyzer does not mean that there is no lead present in the paint/coatings used. It means that the lead present in the paint coating does not reach the HUD standard for lead based paint. Lead containing dust will be generated when the architectural components are impacted during the decommissioning activities of the presses.

4. Recommendations:

- a. It is recommended that workers use proper work practices and procedures. The level of protection must be commensurate with the method being used. Half and full-face respirators will require a fit test and medical examination.

5. A spreadsheet containing the XRF readings will be attached to this report. If you have any questions, please contact me at extension 2-1477.

//Signed//
Joselito Sto Tomas, Industrial Hygienist
Security Services

Reading N	Time	Type	Duration	Units	Sequence	Component	Substrate	Side	Condition	Color	Site	Inspector	Floor	Room	Misc 1	Misc 2	Res	EScale1	EscleCT	Results	Depth	Inde	Action	Lev	PbC	PbC Error	PbL	PbL Error	PbK	PbK Error
5	10/4/2022 22:26	PAINT		0.75 mg / cm	Final	WALL	brick	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	col 4F24						Positive	10		1 < LOD		21.9 < LOD		2.02 < LOD		21.9
7	10/4/2022 22:29	PAINT		0.89 mg / cm	Final	Pipe	fiberglass	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	pipe1 uper						Positive	4.77		1 < LOD		16.65 < LOD		0.73 < LOD		16.65
8	10/4/2022 22:30	PAINT		0.74 mg / cm	Final	Pipe	METAL	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	pipe1 uper						Positive	6.63		1 < LOD		26.55 < LOD		1.17 < LOD		26.55
9	10/4/2022 22:31	PAINT		0.89 mg / cm	Final	Pipe	fiberglass	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	pipe2 upper						Positive	3.37		1 < LOD		21 < LOD		0.37 < LOD		21
10	10/4/2022 22:31	PAINT		0.89 mg / cm	Final	Pipe	METAL	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	pipe2 lower						Positive	6.89		1 < LOD		21.15 < LOD		0.81 < LOD		21.15
14	10/4/2022 22:37	PAINT		7.26 mg / cm	Final	DOOR casing	METAL	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	fire door exit						Positive	6.39	1	2	1	0.8		0.2	2	1
20	10/4/2022 22:44	PAINT		0.6 mg / cm	Final	WINDOW frame	METAL	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426							Positive	10		1 < LOD		35.85 < LOD		2.55 < LOD		35.85
21	10/4/2022 22:45	PAINT		0.74 mg / cm	Final	WINDOW frame	METAL	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	lower window						Positive	10		1 < LOD		28.65 < LOD		3 < LOD		28.65
24	10/4/2022 22:48	PAINT		0.59 mg / cm	Final	WINDOW sill	WOOD	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426							Positive	10		1 < LOD		37.5 < LOD		6.45 < LOD		37.5
25	10/4/2022 22:53	PAINT		0.74 mg / cm	Final	WALL	brick	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	col F23 upper						Positive	7.03		1 < LOD		25.95 < LOD		1.5 < LOD		25.95
28	10/5/2022 1:03	PAINT		0.59 mg / cm	Final	WALL	brick	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	col F23 upper						Positive	10		1 < LOD		31.65 < LOD		3.3 < LOD		31.65
31	10/5/2022 1:08	PAINT		0.74 mg / cm	Final	WALL	brick	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	COL F22 upper						Positive	10		1 < LOD		25.8 < LOD		2.7 < LOD		25.8
34	10/5/2022 1:12	PAINT		0.74 mg / cm	Final	WALL	brick	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	COL F20 upper						Positive	10		1 < LOD		26.7 < LOD		4.05 < LOD		26.7
41	10/5/2022 1:23	PAINT		0.74 mg / cm	Final	WALL	CONCRETE	C	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	south wall Col E18						Positive	10		1 < LOD		26.25 < LOD		3.3 < LOD		26.25
43	10/5/2022 1:28	PAINT		0.75 mg / cm	Final	WALL	brick	C	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	south wall Col E19 upper						Positive	7.41		1 < LOD		25.05 < LOD		2.1 < LOD		25.05
45	10/5/2022 1:32	PAINT		0.74 mg / cm	Final	WALL	brick	B	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	eastwall net tl door						Positive	2.72		1 < LOD		23.4 < LOD		0.55 < LOD		23.4
58	10/5/2022 1:49	PAINT		9.06 mg / cm	Final	DOOR frame	METAL	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	elevator entrance						Positive	4.48	1	1.9	0.9	0.9		0.2	1.9	0.9
6	10/10/2022 21:57	PAINT		0.88 mg / cm	Final	COLUMN	brick	C	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	col D24						Positive	2.6		1 < LOD		20.1 < LOD		0.24 < LOD		20.1
10	10/10/2022 22:01	PAINT		4 mg / cm	Final	WALL COVERING	METAL	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426							Positive	1		1	2.3	1.2 < LOD		0.03	2.3	1.2
11	10/10/2022 22:02	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	C	FAIR	WHITE	bldg.a	jsst	FOURTH	A426							Positive	7.01		1 < LOD		38.55 < LOD		2.1 < LOD		38.55
12	10/10/2022 22:03	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426							Positive	10		1 < LOD		43.2 < LOD		2.7 < LOD		43.2
13	10/10/2022 22:06	PAINT		0.88 mg / cm	Final	COLUMN	BRICK	C	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	col D23						Positive	7.72		1 < LOD		21.3 < LOD		1.5 < LOD		21.3
15	10/10/2022 22:10	PAINT		0.74 mg / cm	Final	WALL	WOOD	D	FAIR	WHITE	bldg.a	jsst	FOURTH	A426							Positive	8.7		1 < LOD		29.55 < LOD		2.25 < LOD		29.55
17	10/10/2022 22:12	PAINT		0.88 mg / cm	Final	WALL	BRICK	D	FAIR	WHITE	bldg.a	jsst	FOURTH	A426							Positive	10		1 < LOD		21.15 < LOD		3.3 < LOD		21.15
20	10/10/2022 22:14	PAINT		0.89 mg / cm	Final	WINDOW FRAME	WOOD	D	FAIR	WHITE	bldg.a	jsst	FOURTH	A426							Positive	10		1 < LOD		20.1 < LOD		8.1 < LOD		20.1
21	10/10/2022 22:14	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426							Positive	10		1 < LOD		43.8 < LOD		5.25 < LOD		43.8
30	10/10/2022 22:27	PAINT		0.74 mg / cm	Final	COLUMN	BRICK	D	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	COL E24						Positive	6.66		1 < LOD		25.95 < LOD		1.8 < LOD		25.95
32	10/10/2022 22:29	PAINT		1.03 mg / cm	Final	WALL	BRICK	D	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	next to fire exit						Positive	10	1	14.2		9 < LOD		2.1	14.2	9
34	10/10/2022 22:40	PAINT		0.73 mg / cm	Final	COLUMN 4E22	BRICK	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	next to fire exit						Positive	10		1 < LOD		22.35 < LOD		2.55 < LOD		22.35
35	10/10/2022 22:41	PAINT		0.74 mg / cm	Final	COLUMN 4E22	BRICK	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	next to fire exit						Positive	10		1 < LOD		26.85 < LOD		2.25 < LOD		26.85
37	10/10/2022 22:43	PAINT		0.59 mg / cm	Final	COLUMN E23	BRICK	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426							Positive	10		1 < LOD		31.5 < LOD		3.3 < LOD		31.5
39	10/10/2022 23:26	PAINT		0.88 mg / cm	Final	COLUMN 4D21	BRICK	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426 ext							Positive	10		1 < LOD		22.8 < LOD		2.7 < LOD		22.8
41	10/10/2022 23:27	PAINT		1.76 mg / cm	Final	COLUMN 4D21 footer	CONCRETE	A	FAIR	YELLOW	bldg.a	jsst	FOURTH	A426 ext							Positive	7.7	1	2.8	1.8	2.8		1.8 < LOD		5.55
42	10/10/2022 23:27	PAINT		1.18 mg / cm	Final	COLUMN 4D21 footer	METAL	A	FAIR	YELLOW	bldg.a	jsst	FOURTH	A426 ext							Positive	3.14	1	2.7	1.3	2.7		1.3 < LOD		7.05
59	10/10/2022 23:46	PAINT		0.74 mg / cm	Final	COLUMN	BRICK	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426 ext	COL 4E20						Positive	10		1 < LOD		28.05 < LOD		3.3 < LOD		28.05
64	10/10/2022 23:51	PAINT		0.88 mg / cm	Final	COLUMN	CONCRETE	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426 ext	COL 4E19						Positive	10		1 < LOD		22.5 < LOD		3 < LOD		22.5
8	10/11/2022 21:04	PAINT		0.73 mg / cm	Final	WALL COLUMN	CONCRETE	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F19						Positive	10		1 < LOD		24.9 < LOD		1.89 < LOD		24.9
10	10/11/2022 21:08	PAINT		1.17 mg / cm	Final	ROLL ON DOOR FRAME	METAL	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F19						Positive	6.8		1 < LOD		3.45 < LOD		3.45 < LOD		7.65
12	10/11/2022 21:08	PAINT		0.89 mg / cm	Final	ROLL ON DOOR FRAME	METAL	A	FAIR	YELLOW	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F19						Positive	3	1	3.4	2.2	3.4		2.2 < LOD		14.7
14	10/11/2022 21:10	PAINT		0.74 mg / cm	Final	COLUMN 4F18	CONCRETE	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F18						Positive	6.62		1 < LOD		25.35 < LOD		1.65 < LOD		25.35
16	10/11/2022 21:12	PAINT		0.88 mg / cm	Final	COLUMN 4F18 FOOTER	CONCRETE	A	FAIR	YELLOW	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F18						Positive	2.44	1	2.7	1.7	2.7		1.7 < LOD		11.25
17	10/11/2022 21:12	PAINT		0.59 mg / cm	Final	COLUMN 4F18 FOOTER	METAL	A	FAIR	YELLOW	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F18						Positive	2.37		1 < LOD		4.2 < LOD		4.2 < LOD		16.65
18	10/11/2022 21:14	PAINT		1.03 mg / cm	Final	WINDOW FRAME	WOOD	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F18						Positive	10	1	13.6	8.6 < LOD		6.9	13.6	8.6	
19	10/11/2022 21:15	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F18						Positive	3.79		1 < LOD		34.05 < LOD		0.75 < LOD		34.05
25	10/11/2022 21:26	PAINT		0.73 mg / cm	Final	COLUMN 4F17	CONCRETE	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F17						Positive	10		1 < LOD		24.15 < LOD		3.45 < LOD		24.15
30	10/11/2022 21:41	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F17						Positive	10		1 < LOD		41.7 < LOD		3.45 < LOD		41.7
31	10/11/2022 21:42	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F17						Positive	10		1 < LOD		42.9 < LOD		3.3 < LOD		42.9
37	10/11/2022 21:49	PAINT		0.73 mg / cm	Final	COLUMN 4F16	CONCRETE	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F16						Positive	6.16		1 < LOD		27.45 < LOD		0.81 < LOD		27.45
49	10/11/2022 22:03	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F16						Positive	10		1 < LOD		38.25 < LOD		3.75 < LOD		38.25
51	10/11/2022 22:04	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F16						Positive	10		1 < LOD		46.5 < LOD		3.9 < LOD		46.5
56	10/11/2022 22:09	PAINT		0.73 mg / cm	Final	COLUMN 4F15	CONCRETE	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F15						Positive	10		1 < LOD		23.85 < LOD		2.25 < LOD		23.85
58	10/11/2022 22:30	PAINT		0.73 mg / cm	Final	WINDOW FRAME	WOOD	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F15						Positive	10		1 < LOD		29.1 < LOD		4.05 < LOD		29.1
59	10/11/2022 22:30	PAINT		0.59 mg / cm	Final	WINDOW FRAME	WOOD	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	COL 4F15						Positive	10		1 < LOD		37.95 < LOD		3.15 < LOD		37.95
62	10/11/2022 22:33	PAINT		0.59 mg / cm	Final	WINDOW SILL	WOOD																							

29	10/12/2022 22:11 PAINT	0.88 mg / cm ^2Final	COLUMN	BRICK	C	FAIR	WHITE	BLDG. A	JSST	FOURTH	BINDERY AREA	COL 4D18	Positive	10	1 < LOD	21.45 < LOD	2.7 < LOD	21.45			
30	10/12/2022 22:14 PAINT	0.89 mg / cm ^2Final	COLUMN 4D20	BRICK	C	FAIR	WHITE	BLDG. A	JSST	FOURTH	BINDERY AREA	COL 4D20	Positive	6.63	1 < LOD	18.45 < LOD	1.28 < LOD	18.45			
32	10/12/2022 22:15 PAINT	1.33 mg / cm ^2Final	COLUMN 4D20 footer	CONCRETE	C	FAIR	YELLOW	BLDG. A	JSST	FOURTH	BINDERY AREA	COL 4D20	Positive	2.34	1	1.9	0.8	1.9	0.8 < LOD	6.3	
34	10/12/2022 22:17 PAINT	1.33 mg / cm ^2Final	railing	METAL	C	FAIR	YELLOW	BLDG. A	JSST	FOURTH	BINDERY AREA	COL 4D20	Positive	2.35	1	1.8	0.8	1.8	0.8 < LOD	6.15	
35	10/12/2022 22:18 PAINT	1.17 mg / cm ^2Final	railing footer	METAL	C	FAIR	YELLOW	BLDG. A	JSST	FOURTH	BINDERY AREA	COL 4D20	Positive	3.47	1	2.2	1.2	2.2	1.2 < LOD	6.3	
36	10/12/2022 22:18 PAINT	1.18 mg / cm ^2Final	railing footer	CONCRETE	C	FAIR	YELLOW	BLDG. A	JSST	FOURTH	BINDERY AREA	COL 4D20	Positive	3.3	1	2.4	1.2	2.4	1.2 < LOD	6.9	
46	10/12/2022 22:31 PAINT	0.59 mg / cm ^2Final	WINDOW CASING	CONCRETE	C	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A418		Positive	10	1 < LOD	43.35 < LOD	5.1 < LOD	43.35			
47	10/12/2022 22:32 PAINT	0.59 mg / cm ^2Final	WINDOW SILL	CONCRETE	C	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A418		Positive	7.69	1 < LOD	36.6 < LOD	17.55 < LOD	36.6			
63	10/12/2022 22:47 PAINT	0.59 mg / cm ^2Final	WINDOW CASING	CONCRETE	C	FAIR	WHITE	BLDG. A	JSST	FOURTH	A420		Positive	10	1 < LOD	43.65 < LOD	5.7 < LOD	43.65			
65	10/12/2022 22:49 PAINT	0.59 mg / cm ^2Final	WINDOW SIL	WOOD	C	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420		Positive	10	1 < LOD	41.55 < LOD	17.7 < LOD	41.55			
4	10/13/2022 21:51 PAINT	0.88 mg / cm ^2Final	COLUMN 4E14	BRICK	A	FAIR	WHITE	BLDG. A	jsst	FOURTH	BINDERY AREA	COL 4E15	Positive	10	1 < LOD	21.45 < LOD	4.35 < LOD	21.45			
7	10/13/2022 21:53 PAINT	0.73 mg / cm ^2Final	COLUMN 4E13	BRICK	A	FAIR	WHITE	BLDG. A	jsst	FOURTH	BINDERY AREA	COL 4E13	Positive	10	1 < LOD	25.35 < LOD	3.3 < LOD	25.35			
9	10/13/2022 21:55 PAINT	0.88 mg / cm ^2Final	COLUMN 4E12	BRICK	A	FAIR	WHITE	BLDG. A	jsst	FOURTH	BINDERY AREA	COL 4E12	Positive	10	1 < LOD	18.75 < LOD	4.35 < LOD	18.75			
17	10/13/2022 22:03 PAINT	0.73 mg / cm ^2Final	WALL	BRICK	D	FAIR	WHITE	BLDG. A	jsst	FOURTH	A424	UPPER SIDE	Positive	9.61	1 < LOD	23.4 < LOD	5.1 < LOD	23.4			
35	10/13/2022 22:36 PAINT	0.73 mg / cm ^2Final	WALL	BRICK	D	FAIR	WHITE	BLDG. A	jsst	FOURTH	A424	UPPER	Positive	9.05	1 < LOD	27.75 < LOD	7.5 < LOD	27.75			
38	10/13/2022 22:39 PAINT	0.73 mg / cm ^2Final	WALL	BRICK	C	FAIR	WHITE	BLDG. A	jsst	FOURTH	A424	UPPER	Positive	10	1 < LOD	25.95 < LOD	7.5 < LOD	25.95			
42	10/13/2022 22:57 PAINT	0.59 mg / cm ^2Final	WINDOW CASING	BRICK	A	FAIR	BROWN	BLDG. A	jsst	FOURTH	A424A		Positive	2.8	1 < LOD	43.95 < LOD	1.95 < LOD	43.95			
43	10/13/2022 22:58 PAINT	0.59 mg / cm ^2Final	WINDOW CASING	WOOD	A	FAIR	BROWN	BLDG. A	jsst	FOURTH	A424A		Positive	3.35	1 < LOD	40.2 < LOD	2.25 < LOD	40.2			
44	10/13/2022 22:59 PAINT	0.73 mg / cm ^2Final	WINDOW SILL	WOOD	UPPER	CRACKED	BROWN	BLDG. A	jsst	FOURTH	A424A		Positive	3.98	1 < LOD	24.45 < LOD	11.55 < LOD	24.45			
48	10/13/2022 23:04 PAINT	0.73 mg / cm ^2Final	COLUMN 4F11	BRICK	A	FAIR	YELLOW	BLDG. A	jsst	FOURTH	A424A		Positive	2.47	1 < LOD	23.25 < LOD	1.2 < LOD	23.25			
51	10/13/2022 23:07 PAINT	0.73 mg / cm ^2Final	COLUMN 4F10	BRICK	A	FAIR	YELLOW	BLDG. A	jsst	FOURTH	A424A		Positive	4.48	1 < LOD	22.95 < LOD	3.3 < LOD	22.95			
62	10/13/2022 23:15 PAINT	0.73 mg / cm ^2Final	WALL	BRICK	D	FAIR	YELLOW	BLDG. A	jsst	FOURTH	A424A		Positive	3.57	1 < LOD	25.95 < LOD	2.25 < LOD	25.95			
66	10/13/2022 23:22 PAINT	0.73 mg / cm ^2Final	COLUMN 4D10 FOOTER	BRICK	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	OFFICE SPACE		Positive	9.09	1 < LOD	26.55 < LOD	129.3 < LOD	26.55			
67	10/13/2022 23:23 PAINT	0.59 mg / cm ^2Final	WINDOW FRAME	WOOD	C	FAIR	WHITE	BLDG. A	jsst	FOURTH	OFFICE SPACE		Positive	10	1 < LOD	43.2 < LOD	6.3 < LOD	43.2			
68	10/13/2022 23:24 PAINT	0.59 mg / cm ^2Final	WINDOW CASING	WOOD	C	FAIR	WHITE	BLDG. A	jsst	FOURTH	OFFICE SPACE		Positive	10	1 < LOD	45.6 < LOD	11.4 < LOD	45.6			
69	10/13/2022 23:24 PAINT	0.59 mg / cm ^2Final	WINDOW SILL	WOOD	C	FAIR	WHITE	BLDG. A	jsst	FOURTH	OFFICE SPACE		Positive	10	1 < LOD	41.85 < LOD	6 < LOD	41.85			
4	10/16/2022 21:44 PAINT	0.73 mg / cm ^2Final	WALL	BRICK	D	POOR	WHITE	BLDG.A	JSST	FOURTH	A425 ext		Positive	10	1 < LOD	28.95 < LOD	8.4 < LOD	28.95			
13	10/16/2022 21:53 PAINT	0.58 mg / cm ^2Final	WINDOW FRAME	WOOD	D	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4F9		Positive	10	1 < LOD	40.65 < LOD	2.55 < LOD	40.65			
14	10/16/2022 21:53 PAINT	0.58 mg / cm ^2Final	WINDOW FRAME	WOOD	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4F9		Positive	10	1 < LOD	43.95 < LOD	2.85 < LOD	43.95			
15	10/16/2022 21:54 PAINT	0.58 mg / cm ^2Final	WINDOW SILL	WOOD	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4F9		Positive	10	1 < LOD	44.1 < LOD	15.15 < LOD	44.1			
18	10/16/2022 21:57 PAINT	0.58 mg / cm ^2Final	WINDOW FRAME	WOOD	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4F8		Positive	10	1 < LOD	35.25 < LOD	4.8 < LOD	35.25			
19	10/16/2022 21:57 PAINT	0.58 mg / cm ^2Final	WINDOW FRAME	WOOD	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4F8		Positive	10	1 < LOD	43.8 < LOD	3.15 < LOD	43.8			
20	10/16/2022 21:58 PAINT	0.59 mg / cm ^2Final	WINDOW SILL	WOOD	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4F8		Positive	10	1 < LOD	45.6 < LOD	15.15 < LOD	45.6			
21	10/16/2022 21:59 PAINT	0.72 mg / cm ^2Final	COLUMN 4F9	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4F9		Positive	10	1 < LOD	28.8 < LOD	2.85 < LOD	28.8			
30	10/16/2022 22:13 PAINT	0.73 mg / cm ^2Final	COLUMN 4F7	CONCRETE	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4F7		Positive	10	1 < LOD	27.6 < LOD	4.5 < LOD	27.6			
37	10/16/2022 22:21 PAINT	0.72 mg / cm ^2Final	COLUMN 4F6	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4F6		Positive	10	1 < LOD	25.8 < LOD	3.45 < LOD	25.8			
41	10/16/2022 22:33 PAINT	0.73 mg / cm ^2Final	COLUMN 4E9	BRICK	A	CRACKED	WHITE	BLDG.A	JSST	FOURTH	COL 4E9		Positive	10	1 < LOD	23.25 < LOD	2.85 < LOD	23.25			
42	10/16/2022 22:33 PAINT	0.73 mg / cm ^2Final	COLUMN 4E9	BRICK	B	CRACKED	WHITE	BLDG.A	JSST	FOURTH	COL 4E9		Positive	9.04	1 < LOD	27.75 < LOD	4.2 < LOD	27.75			
43	10/16/2022 22:34 PAINT	0.73 mg / cm ^2Final	COLUMN 4E9	BRICK	C	CRACKED	WHITE	BLDG.A	JSST	FOURTH	COL 4E9		Positive	10	1 < LOD	28.05 < LOD	4.8 < LOD	28.05			
44	10/16/2022 22:34 PAINT	0.73 mg / cm ^2Final	COLUMN 4E9	BRICK	D	CRACKED	WHITE	BLDG.A	JSST	FOURTH	COL 4E9		Positive	10	1 < LOD	26.7 < LOD	5.25 < LOD	26.7			
52	10/16/2022 22:39 PAINT	3.8 mg / cm ^2Final	COLUMN 4E9 SAFETY RAIL	METAL	A	FAIR	YELLOW	BLDG.A	JSST	FOURTH	COL 4E9		Positive	1.87	1	1.3	0.2	1.3	0.2 < LOD	2.25	
53	10/16/2022 22:40 PAINT	2.77 mg / cm ^2Final	COLUMN 4E9 SAFETY RAIL FOI	CONCRETE	A	FAIR	YELLOW	BLDG.A	JSST	FOURTH	COL 4E9		Positive	1.99	1 < LOD	4.5	1.4	0.4 < LOD	4.5		
54	10/16/2022 22:40 PAINT	1.17 mg / cm ^2Final	COLUMN 4E9 SAFETY RAIL FOI	CONCRETE	C	FAIR	YELLOW	BLDG.A	JSST	FOURTH	COL 4E9		Positive	2.24	1	1.8	0.8	1.8	0.8 < LOD	6.31	
56	10/16/2022 22:43 PAINT	0.59 mg / cm ^2Final	COLUMN 4E8	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E8		Positive	10	1 < LOD	35.1 < LOD	15.75 < LOD	35.1			
57	10/16/2022 22:43 PAINT	0.73 mg / cm ^2Final	COLUMN 4E8	BRICK	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E8		Positive	10	1 < LOD	28.2 < LOD	3.45 < LOD	28.2			
58	10/16/2022 22:44 PAINT	0.58 mg / cm ^2Final	COLUMN 4E8	BRICK	C	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E8		Positive	10	1 < LOD	36.15 < LOD	5.1 < LOD	36.15			
59	10/16/2022 22:44 PAINT	0.73 mg / cm ^2Final	COLUMN 4E8	BRICK	D	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E8		Positive	10	1 < LOD	25.35 < LOD	3.9 < LOD	25.35			
69	10/16/2022 22:51 PAINT	0.58 mg / cm ^2Final	COLUMN 4E7	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E7		Positive	10	1 < LOD	41.7 < LOD	7.35 < LOD	41.7			
70	10/16/2022 22:52 PAINT	0.58 mg / cm ^2Final	COLUMN 4E7	BRICK	D	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E7		Positive	10	1 < LOD	35.85 < LOD	5.25 < LOD	35.85			
71	10/16/2022 22:53 PAINT	0.59 mg / cm ^2Final	COLUMN 4E7	BRICK	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E7		Positive	10	1 < LOD	34.05 < LOD	3 < LOD	34.05			
72	10/16/2022 22:54 PAINT	0.73 mg / cm ^2Final	COLUMN 4E7	BRICK	C	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E7		Positive	10	1 < LOD	29.4 < LOD	6.75 < LOD	29.4			
80	10/16/2022 23:00 PAINT	0.73 mg / cm ^2Final	COLUMN 4E6	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E6		Positive	10	1 < LOD	25.5 < LOD	5.1 < LOD	25.5			
81	10/16/2022 23:00 PAINT	0.73 mg / cm ^2Final	COLUMN 4E6	BRICK	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E6		Positive	10	1 < LOD	27.75 < LOD	3.45 < LOD	27.75			
82	10/16/2022 23:00 PAINT	0.73 mg / cm ^2Final	COLUMN 4E6	BRICK	C	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E6		Positive	10	1 < LOD	26.85 < LOD	9.75 < LOD	26.85			
83	10/16/2022 23:01 PAINT	0.73 mg / cm ^2Final	COLUMN 4E6	BRICK	D	FAIR	WHITE	BLDG.A	JSST	FOURTH	COL 4E6		Positive	10	1 < LOD	24.45 < LOD	7.35 < LOD	24.45			
4	10/17/2022 22:39 PAINT	0.58 mg / cm ^2Final	WALL	CERAMIC	T A	FAIR	BROWN	BLDG.A	JSST	FOURTH	T142	women rr	Positive	2.62	1 < LOD	5.4 < LOD	5.4 < LOD	14.7			
5	10/17/2022 22:40 PAINT	0.58 mg / cm ^2Final	WALL	CERAMIC	T A	FAIR	BROWN	BLDG.A	JSST	FOURTH	T142	women rr	Positive	2.26	1 < LOD	4.35 < LOD	4.35 < LOD	16.05			
6	10/17/2022 22:40 PAINT	0.58 mg / cm ^2Final	WALL	CERAMIC	T B	FAIR	BROWN	BLDG.A	JSST	FOURTH	T142	women rr	Positive	1.94	1	3.3	2.2	3.3	2.2 < LOD	14.4	
7	10/17/2022 22:41 PAINT	0.58 mg / cm ^2Final	WALL	CERAMIC	T C	FAIR	BROWN	BLDG.A	JSST	FOURTH	T142	women rr	Positive	1.99	1	3.5	2.3	3.5	2.3 < LOD	16.35	
8	10/17/2022 22:41 PAINT	0.58 mg / cm ^2Final	WALL	CERAMIC	T D	FAIR	BROWN	BLDG.A	JSST	FOURTH	T142	women rr	Positive	1.95	1	3.4	2.2	3.4	2.2 < LOD	16.5	
34	10/18/2022 0:37 PAINT	4.37 mg / cm ^2Final	WALL	CERAMIC	T A	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Positive	1.83	1	1.2	0.2	1.2	0.2 < LOD	1.65	
35	10/18/2022 0:38 PAINT	3.5 mg / cm ^2Final	WALL	CERAMIC	T A	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Positive	2.13	1	1.3	0.2	1.3	0.2 < LOD	1.95	
36	10/18/2022 0:39 PAINT	6.29 mg / cm ^2Final	WALL	CERAMIC	T A	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Positive	2.02	1	1.2	0.2	1.2	0.2	1.6	0.9
37	10/18/2022 0:39 PAINT	6 mg / cm ^2Final	WALL	CERAMIC	T B	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Positive	1.96	1	1.2	0.2	1.2	0.2	1.6	0.9
38	10/18/2022 0:40 PAINT	3.51 mg / cm ^2Final	WALL	CERAMIC	T C	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Positive	2.14	1	1.4	0.3	1.4	0.3 < LOD	2.1	
40	10/18/2022 0:41 PAINT	3.51 mg / cm ^2Final	WALL	CERAMIC	T C	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Positive	2.05	1	1.3	0.2	1.3	0.2 < LOD	1.8	
41	10/18/2022 0:42 PAINT	4.53 mg / cm ^2Final	WALL	CERAMIC	T D	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Positive	1.96	1	1.2	0.2	1.2	0.2 < LOD	1.65	
42	10/18/2022 0:42 PAINT	1.31 mg / cm ^2Final	WALL	CERAMIC	T D	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Positive	2.81	1	1.9	0.9	1.9</			

31	10/18/2022 22:14 PAINT	0.73 mg / cm ^2 Final	DOOR	WOOD	D	PEELING	BEIGE	BLDG.A	JSST	FOURTH	TAPE AREA	Positive	10	1 < LOD	21.9 < LOD	6 < LOD	21.9			
34	10/18/2022 22:30 PAINT	0.72 mg / cm ^2 Final	COLUMN 4E5	BRICK	A	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDERY	Positive	10	1 < LOD	27 < LOD	1.81 < LOD	27			
37	10/18/2022 22:33 PAINT	3.05 mg / cm ^2 Final	DOOR SHAFT	METAL	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDERY	Positive	4.04	1	2.5	1.5	1.6	0.6	2.5	1.5
41	10/18/2022 22:37 PAINT	0.58 mg / cm ^2 Final	COLUMN 4E5	BRICK	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	BINDERY	Positive	10	1 < LOD	31.8 < LOD	7.05 < LOD	31.8			
43	10/18/2022 22:38 PAINT	1.02 mg / cm ^2 Final	COLUMN 4E5	BRICK	C	FAIR	WHITE	BLDG.A	JSST	FOURTH	BINDERY	Positive	10	1 < LOD	16.35 < LOD	3.9 < LOD	16.35			
46	10/18/2022 22:41 PAINT	0.73 mg / cm ^2 Final	COLUMN 4E5	BRICK	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	BINDERY	Positive	10	1 < LOD	24.15 < LOD	4.05 < LOD	24.15			
51	10/18/2022 23:54 PAINT	0.43 mg / cm ^2 Final	WALL	CONCRETE A		INTACT	WHITE	BLDG.A	JSST	FOURTH	RM A404	Positive	10	1 < LOD	65.85 < LOD	1.48 < LOD	65.85			
58	10/19/2022 0:01 PAINT	0.58 mg / cm ^2 Final	WALL	CONCRETE B		INTACT	WHITE	BLDG.A	JSST	FOURTH	RM A404	Positive	3.14	1 < LOD	47.55 < LOD	0.31 < LOD	47.55			
63	10/19/2022 0:06 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE B		INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404	Positive	10	1 < LOD	54.3 < LOD	1.43 < LOD	54.3			
65	10/19/2022 0:07 PAINT	0.58 mg / cm ^2 Final	WALL	CONCRETE C		INTACT	WHITE	BLDG.A	JSST	FOURTH	RM A404	Positive	3.66	1 < LOD	47.55 < LOD	0.46 < LOD	47.55			
70	10/19/2022 0:11 PAINT	0.87 mg / cm ^2 Final	DOOR	WOOD	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404	Positive	10	1 < LOD	18 < LOD	3.15 < LOD	18			
71	10/19/2022 0:11 PAINT	1.02 mg / cm ^2 Final	DOOR FRAME	WOOD	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404	Positive	10	1	9.8	6.4 < LOD	1.72	9.8	6.4	
74	10/19/2022 0:35 PAINT	0.72 mg / cm ^2 Final	COLUMN 4F5	BRICK	A	INTACT	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING	Positive	10	1 < LOD	24 < LOD	3.75 < LOD	24			
76	10/19/2022 0:37 PAINT	0.58 mg / cm ^2 Final	COLUMN 4F5 SAFETY GUARD	METAL	A	INTACT	YELLOW	BLDG.A	JSST	FOURTH	DIGITAL CUTTING	Positive	3.57	1 < LOD	8.25 < LOD	8.25 < LOD	31.35			
82	10/19/2022 0:44 PAINT	1.02 mg / cm ^2 Final	WINDOW SILL	CONCRETE A		CRACKED	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING COL 4F4	Positive	10	1 < LOD	12.15 < LOD	8.4 < LOD	12.15			
83	10/19/2022 0:45 PAINT	0.87 mg / cm ^2 Final	WALL COL 4F4	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING COL 4F4	Positive	10	1 < LOD	22.05 < LOD	3.3 < LOD	22.05			
91	10/19/2022 0:55 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE A		FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING COL 4F3	Positive	10	1 < LOD	44.25 < LOD	6.9 < LOD	44.25			
92	10/19/2022 0:56 PAINT	0.73 mg / cm ^2 Final	COLUMN 4F3	CONCRETE A		FAIR	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING COL 4F3	Positive	10	1 < LOD	24.15 < LOD	4.35 < LOD	24.15			
97	10/19/2022 1:09 PAINT	0.73 mg / cm ^2 Final	COLUMN 4F2	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING COL 4F2	Positive	10	1 < LOD	24 < LOD	2.85 < LOD	24			
102	10/19/2022 1:12 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE A		FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING COL 4F1	Positive	10	1 < LOD	42.45 < LOD	7.8 < LOD	42.45			
103	10/19/2022 1:13 PAINT	0.87 mg / cm ^2 Final	COLUMN 4F1	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING COL 4F1	Positive	10	1 < LOD	23.1 < LOD	3.45 < LOD	23.1			
4	10/19/2022 20:52 PAINT	0.72 mg / cm ^2 Final	WALL	BRICK	B	FAIR	WHITE	BDLG.A	JSST	FOURTH	DIGITAL CUTTING COL 4E1	Positive	10	1 < LOD	27.45 < LOD	2.85 < LOD	27.45			
8	10/19/2022 20:55 PAINT	0.73 mg / cm ^2 Final	WINDOW SILL	CONCRETE B		FAIR	BEIGE	BDLG.A	JSST	FOURTH	DIGITAL CUTTING COL 4E1	Positive	10	1 < LOD	29.4 < LOD	19.95 < LOD	29.4			
9	10/19/2022 20:55 PAINT	0.73 mg / cm ^2 Final	COLUMN 4E1	BRICK	B	FAIR	WHITE	BDLG.A	JSST	FOURTH	DIGITAL CUTTING COL 4E1	Positive	10	1 < LOD	28.95 < LOD	1.88 < LOD	28.95			
16	10/19/2022 21:00 PAINT	0.58 mg / cm ^2 Final	WINDOW SILL	CONCRETE B		FAIR	BEIGE	BDLG.A	JSST	FOURTH	DIGITAL CUTTING COL 4E1	Positive	9.16	1 < LOD	40.65 < LOD	8.7 < LOD	40.65			
18	10/19/2022 21:02 PAINT	0.87 mg / cm ^2 Final	WALL	BRICK	B	FAIR	WHITE	BDLG.A	JSST	FOURTH	DIGITAL CUTTING COL 4E1	Positive	10	1 < LOD	22.05 < LOD	3.45 < LOD	22.05			
24	10/19/2022 21:07 PAINT	0.73 mg / cm ^2 Final	WALL	CONCRETE B		FAIR	WHITE	BDLG.A	JSST	FOURTH	DIGITAL CUTTING COL 4E1	Positive	2.52	1 < LOD	28.2 < LOD	0.46 < LOD	28.2			
28	10/19/2022 21:12 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE B		PEELING	WHITE	BDLG.A	JSST	FOURTH	DIGITAL CUTTING COL 4D1	Positive	7.95	1 < LOD	48.45 < LOD	2.25 < LOD	48.45			
30	10/19/2022 21:14 PAINT	2.05 mg / cm ^2 Final	WINDOW SILL	CONCRETE B		PEELING	BEIGE	BDLG.A	JSST	FOURTH	DIGITAL CUTTING COL 4D1	Positive	5.81	1 < LOD	5.7 < LOD	1.2 < LOD	5.7			
32	10/19/2022 21:33 PAINT	0.58 mg / cm ^2 Final	WALL	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH	A406	Positive	10	1 < LOD	40.95 < LOD	3.6 < LOD	40.95			
35	10/19/2022 21:36 PAINT	0.58 mg / cm ^2 Final	WALL	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH	A406	Positive	10	1 < LOD	36.45 < LOD	2.55 < LOD	36.45			
52	10/19/2022 21:54 PAINT	0.73 mg / cm ^2 Final	DOOR	WOOD	A	INTACT	BROWN	BDLG.A	JSST	FOURTH	A409	Positive	10	1 < LOD	21.15 < LOD	5.4 < LOD	21.15			
54	10/19/2022 21:56 PAINT	0.87 mg / cm ^2 Final	WALL PANELING	WOOD	B	INTACT	WHITE	BDLG.A	JSST	FOURTH	A409	Positive	10	1 < LOD	19.2 < LOD	4.35 < LOD	19.2			
55	10/19/2022 21:56 PAINT	0.87 mg / cm ^2 Final	WALL PANELING	WOOD	D	INTACT	WHITE	BDLG.A	JSST	FOURTH	A409	Positive	10	1 < LOD	19.2 < LOD	2.55 < LOD	19.2			
56	10/19/2022 21:57 PAINT	0.58 mg / cm ^2 Final	WALL PANELING	BRICK	B	INTACT	WHITE	BDLG.A	JSST	FOURTH	A409	Positive	9.56	1 < LOD	44.1 < LOD	6.45 < LOD	44.1			
59	10/19/2022 21:59 PAINT	0.58 mg / cm ^2 Final	WALL	BRICK	B	INTACT	WHITE	BDLG.A	JSST	FOURTH	A409	Positive	10	1 < LOD	38.25 < LOD	4.35 < LOD	38.25			
61	10/19/2022 22:01 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE B		PEELING	WHITE	BDLG.A	JSST	FOURTH	A409	Positive	10	1 < LOD	46.05 < LOD	3.9 < LOD	46.05			
87	10/20/2022 0:28 PAINT	0.73 mg / cm ^2 Final	WALL	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH	A407 ext	Positive	10	1 < LOD	27 < LOD	2.85 < LOD	27			
89	10/20/2022 0:31 PAINT	0.87 mg / cm ^2 Final	WALL	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Positive	10	1 < LOD	23.7 < LOD	2.55 < LOD	23.7			
110	10/20/2022 1:02 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B6	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Positive	10	1 < LOD	21.9 < LOD	3.6 < LOD	21.9			
114	10/20/2022 1:06 PAINT	1.02 mg / cm ^2 Final	COLUMN 4B6	BRICK	D	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Positive	10	1	10.3	6.7 < LOD	1.6	10.3	6.7	
124	10/20/2022 1:12 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B5	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	10	1 < LOD	33.9 < LOD	6.3 < LOD	33.9			
125	10/20/2022 1:13 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B5	BRICK	B	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	10	1 < LOD	26.85 < LOD	7.2 < LOD	26.85			
126	10/20/2022 1:13 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B5	BRICK	C	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	10	1 < LOD	25.5 < LOD	6.9 < LOD	25.5			
127	10/20/2022 1:14 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B5	BRICK	D	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	10	1 < LOD	34.8 < LOD	13.05 < LOD	34.8			
136	10/20/2022 1:21 PAINT	1.01 mg / cm ^2 Final	COLUMN 4B3	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	10	1 < LOD	14.4 < LOD	2.4 < LOD	14.4			
138	10/20/2022 1:22 PAINT	1.01 mg / cm ^2 Final	COLUMN 4B3	BRICK	B	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	10	1 < LOD	16.5 < LOD	3.45 < LOD	16.5			
139	10/20/2022 1:22 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B3	BRICK	C	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	9.99	1 < LOD	41.85 < LOD	1.95 < LOD	41.85			
140	10/20/2022 1:23 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B3	BRICK	C	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	6.41	1 < LOD	39.6 < LOD	1.08 < LOD	39.6			
149	10/20/2022 1:31 PAINT	0.44 mg / cm ^2 Final	COLUMN 4B2	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	3.01	1 < LOD	64.8 < LOD	28.5 < LOD	64.8			
163	10/20/2022 1:39 PAINT	0.87 mg / cm ^2 Final	COLUMN 4B2	WOOD	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Positive	10	1 < LOD	17.7 < LOD	5.4 < LOD	17.7			
165	10/20/2022 1:40 PAINT	0.87 mg / cm ^2 Final	COLUMN 4B2 RAILING FOOTING	CONCRETE C		INTACT	YELLOW	BDLG.A	JSST	FOURTH		Positive	2.03	1	2.4	1.4	2.4	1.4 < LOD	10.8	
166	10/20/2022 1:41 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B2 FOOTER	CONCRETE C		INTACT	BEIGE	BDLG.A	JSST	FOURTH		Positive	10	1 < LOD	37.05 < LOD	8.1 < LOD	37.05			
167	10/20/2022 1:42 PAINT	0.59 mg / cm ^2 Final	COLUMN 4B2 FOOTER	CONCRETE D		INTACT	BEIGE	BDLG.A	JSST	FOURTH		Positive	6.49	1 < LOD	39.3 < LOD	3.6 < LOD	39.3			
169	10/20/2022 1:45 PAINT	0.58 mg / cm ^2 Final	WALL	BRICK	B	INTACT	WHITE	BDLG.A	JSST	FOURTH	RM 405	Positive	10	1 < LOD	45.15 < LOD	3.9 < LOD	45.15			
172	10/20/2022 1:47 PAINT	0.43 mg / cm ^2 Final	WINDOW CASING	CONCRETE B		INTACT	WHITE	BDLG.A	JSST	FOURTH	RM 405	Positive	10	1 < LOD	66 < LOD	4.8 < LOD	66			
173	10/20/2022 1:48 PAINT	0.58 mg / cm ^2 Final	WINDOW SILL	CONCRETE B		INTACT	BEIGE	BDLG.A	JSST	FOURTH	RM 405	Positive	6.33	1 < LOD	35.7 < LOD	1.3 < LOD	35.7			
174	10/20/2022 1:49 PAINT	0.58 mg / cm ^2 Final	WALL	BRICK	C	INTACT	WHITE	BDLG.A	JSST	FOURTH	RM 405	Positive	10	1 < LOD	41.55 < LOD	3.3 < LOD	41.55			
179	10/20/2022 1:52 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE C		INTACT	WHITE	BDLG.A	JSST	FOURTH	RM 405	Positive	3.7	1 < LOD	43.95 < LOD	0.56 < LOD	43.95			
180	10/20/2022 1:53 PAINT	0.58 mg / cm ^2 Final	WINDOW SILL	CONCRETE C		POOR	WHITE	BDLG.A	JSST	FOURTH	RM 405	Positive	7.36	1 < LOD	32.7 < LOD	0.86 < LOD	32.7			
4	10/20/2022 20:31 PAINT	1.02 mg / cm ^2 Final	WALL	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A7	Positive	10	1 < LOD	15.9 < LOD	10.65 < LOD	15.9			
8	10/20/2022 20:40 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE B		PEELING	WHITE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A3	Positive	4.33	1 < LOD	54.3 < LOD	1.35 < LOD	54.3			
9	10/20/2022 20:40 PAINT	0.58 mg / cm ^2 Final	WINDOW SILL	CONCRETE B		CRACKED	WHITE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A3	Positive	10	1 < LOD	43.5 < LOD	3.9 < LOD	43.5			
10	10/20/2022 20:41 PAINT	0.58 mg / cm ^2 Final	COLUMN 4A3	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A3	Positive	10	1 < LOD	42.3 < LOD	3.75 < LOD	42.3			
12	10/20/2022 20:43 PAINT	3.78 mg / cm ^2 Final	COLUMN 4A3 FOOTER	METAL	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A3	Positive	2.81	1	0.8	0.2	0.8	0.2 < LOD	1.95	
14	10/20/2022 20:44 PAINT	0.72 mg / cm ^2 Final	COLUMN 4A5	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A3	Positive	10	1 < LOD	21.15 < LOD	5.4 < LOD	21.15			
16	10/20/2022 20:46 PAINT	0.58 mg / cm ^2 Final	COLUMN 4A5 PIPE	PIPE WRAF	B	INTACT	WHITE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A5	Positive	1.67	1 < LOD	34.5 < LOD	0.13 < LOD	34.5			
18	10/20/2022 20:49 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE B		INTACT	WHITE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A5	Positive	7.86	1 < LOD	43.65 < LOD	51.9 < LOD	43.65			
19	10/20/2022 20:50 PAINT	0.58 mg / cm ^2 Final	WINDOW SILL	CONCRETE B		INTACT	BEIGE	BLDG.A	JSST	FOURTH	BILL CORNER COL 4A5	Positive	7.79	1 < LOD	39 < LOD	12.6 < LOD	39			
20	10/20/2022 20:55 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B7	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	25.05 < LOD	3.3 < LOD	25.05			
22	10/20/2022 20:57 PAINT	0.72 mg / cm ^2 Final	WALL 4B8	BRICK	C	FAIR	WHITE	BLDG.A	JSST	FOURTH		Positive								

58	10/20/2022 21:46 PAINT	0.73 mg / cm ^2 Final	COLUMN 4B13	BRICK	D	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	26.55 < LOD	5.25 < LOD	26.55		
70	10/20/2022 22:05 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B14	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	26.7 < LOD	4.5 < LOD	26.7		
71	10/20/2022 22:05 PAINT	0.73 mg / cm ^2 Final	COLUMN 4B14	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	6.49	1 < LOD	25.65 < LOD	0.95 < LOD	25.65		
85	10/20/2022 22:14 PAINT	2.17 mg / cm ^2 Final	COLUMN 4B14 RAILING	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH		Positive	2.66	1	1.6	0.6	1.6	0.6 < LOD	4.65
86	10/20/2022 22:15 PAINT	2.76 mg / cm ^2 Final	COLUMN 4B14 RAILING	METAL	D	INTACT	YELLOW	BLDG.A	JSST	FOURTH		Positive	1.8	1	1.4	0.4	1.4	0.4 < LOD	3.9
88	10/20/2022 22:16 PAINT	4.5 mg / cm ^2 Final	COLUMN 4B14 RAILING	METAL	A	INTACT	YELLOW	BLDG.A	JSST	FOURTH		Positive	2.11	1	1.3	0.2	1.3	0.2 < LOD	1.8
89	10/20/2022 22:17 PAINT	0.73 mg / cm ^2 Final	COLUMN 4B14 RAILING FOOT	CONCRETE	A	PEELING	YELLOW	BLDG.A	JSST	FOURTH		Positive	4.43	1 < LOD	10.05 < LOD	10.05 < LOD		18.45	
90	10/20/2022 22:18 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B15	BRICK	A	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	34.05 < LOD	3.6 < LOD		34.05	
91	10/20/2022 22:19 PAINT	0.87 mg / cm ^2 Final	COLUMN 4B15	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	21.6 < LOD	4.65 < LOD		21.6	
92	10/20/2022 22:20 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B15	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	26.85 < LOD	4.35 < LOD		26.85	
103	10/20/2022 22:28 PAINT	2.31 mg / cm ^2 Final	COLUMN 4B15 SHAFT#3 DOOR	METAL	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH		Positive	6.12	1	2.1	1.1	2.1	1.1 < LOD	3.9
105	10/20/2022 22:29 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B16	BRICK	A	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	39.45 < LOD	6.75 < LOD		39.45	
106	10/20/2022 22:30 PAINT	0.87 mg / cm ^2 Final	COLUMN 4B16	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	18 < LOD	5.85 < LOD		18	
107	10/20/2022 22:31 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B16	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	25.05 < LOD	6.15 < LOD		25.05	
117	10/21/2022 0:27 PAINT	0.87 mg / cm ^2 Final	COLUMN 4B17	BRICK	A	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	5.63	1 < LOD	18.45 < LOD	2.1 < LOD		18.45	
118	10/21/2022 0:28 PAINT	6.43 mg / cm ^2 Final	COLUMN 4B17	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	6.56	1	1.9	0.9 < LOD	0.16	1.9	0.9
120	10/21/2022 0:29 PAINT	3.21 mg / cm ^2 Final	COLUMN 4B17	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1	2.6	1.5 < LOD	0.44	2.6	1.5
121	10/21/2022 0:30 PAINT	1.02 mg / cm ^2 Final	COLUMN 4B17	BRICK	D	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	16.65 < LOD	2.7 < LOD		16.65	
130	10/21/2022 0:37 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B18	BRICK	A	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	24.3 < LOD	3.3 < LOD		24.3	
131	10/21/2022 0:38 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B18	BRICK	B	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	25.05 < LOD	4.05 < LOD		25.05	
132	10/21/2022 0:39 PAINT	0.73 mg / cm ^2 Final	COLUMN 4B18	BRICK	C	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	25.65 < LOD	2.25 < LOD		25.65	
133	10/21/2022 0:39 PAINT	1.02 mg / cm ^2 Final	COLUMN 4B18	BRICK	D	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	10.65 < LOD	2.1 < LOD		10.65	
134	10/21/2022 0:39 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B18	BRICK	D	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	28.5 < LOD	2.55 < LOD		28.5	
142	10/21/2022 0:46 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B19	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	25.95 < LOD	2.7 < LOD		25.95	
143	10/21/2022 0:46 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B19	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	33 < LOD	4.2 < LOD		33	
144	10/21/2022 0:47 PAINT	0.73 mg / cm ^2 Final	COLUMN 4B19	BRICK	C	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	25.95 < LOD	3.75 < LOD		25.95	
145	10/21/2022 0:48 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B19	BRICK	D	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	9.72	1 < LOD	26.7 < LOD	3.3 < LOD		26.7	
161	10/21/2022 1:00 PAINT	0.73 mg / cm ^2 Final	COLUMN 4B20	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	27 < LOD	6.6 < LOD		27	
162	10/21/2022 1:01 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B20	BRICK	A	FAIR	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	34.05 < LOD	5.7 < LOD		34.05	
163	10/21/2022 1:02 PAINT	0.73 mg / cm ^2 Final	COLUMN 4B20	BRICK	B	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	27.45 < LOD	6.3 < LOD		27.45	
164	10/21/2022 1:03 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B20	BRICK	C	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	25.2 < LOD	3.6 < LOD		25.2	
165	10/21/2022 1:04 PAINT	0.72 mg / cm ^2 Final	COLUMN 4B21	BRICK	A	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	27.15 < LOD	4.35 < LOD		27.15	
166	10/21/2022 1:05 PAINT	0.58 mg / cm ^2 Final	COLUMN 4B21	BRICK	D	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	34.5 < LOD	6.75 < LOD		34.5	
167	10/21/2022 1:05 PAINT	0.87 mg / cm ^2 Final	COLUMN 4B21	BRICK	C	CRACKED	WHITE	BLDG.A	JSST	FOURTH		Positive	10	1 < LOD	20.4 < LOD	3.75 < LOD		20.4	
4	10/23/2022 21:45 PAINT	0.58 mg / cm ^2 Final	WALL	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH	Col 4A10	Positive	10	0.8 < LOD	39.6 < LOD	8.7 < LOD		39.6	
10	10/23/2022 21:50 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE	B	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	44.1 < LOD	6.6 < LOD		44.1	
12	10/23/2022 21:52 PAINT	0.72 mg / cm ^2 Final	COLUMN 4A10	BRICK	B	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	24.75 < LOD	8.85 < LOD		24.75	
14	10/23/2022 21:53 PAINT	2.03 mg / cm ^2 Final	COLUMN 4A10 FOOTER	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	6.43	0.8	2	1.2	2	1.2 < LOD	4.5
17	10/23/2022 21:57 PAINT	0.57 mg / cm ^2 Final	COLUMN 4A11	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	33.9 < LOD	6.75 < LOD		33.9	
30	10/23/2022 22:09 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	METAL	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	49.65 < LOD	4.95 < LOD		49.65	
32	10/23/2022 22:21 PAINT	0.72 mg / cm ^2 Final	COLUMN 4A13	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	27.15 < LOD	5.55 < LOD		27.15	
42	10/23/2022 22:30 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	46.65 < LOD	12 < LOD		46.65	
43	10/23/2022 22:30 PAINT	0.87 mg / cm ^2 Final	WINDOW SILL	CONCRETE	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	8.79	0.8 < LOD	22.2 < LOD	9.6 < LOD		22.2	
44	10/23/2022 22:33 PAINT	0.87 mg / cm ^2 Final	COLUMN 4A14	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	20.85 < LOD	4.65 < LOD		20.85	
50	10/23/2022 22:39 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE	C	CRACKED	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	47.25 < LOD	5.55 < LOD		47.25	
53	10/23/2022 22:42 PAINT	0.58 mg / cm ^2 Final	COLUMN 4A15	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	31.65 < LOD	5.55 < LOD		31.65	
57	10/23/2022 22:46 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	49.05 < LOD	8.55 < LOD		49.05	
62	10/24/2022 0:34 PAINT	0.87 mg / cm ^2 Final	COLUMN 4A17	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	21.75 < LOD	5.85 < LOD		21.75	
69	10/24/2022 0:39 PAINT	0.72 mg / cm ^2 Final	WINDOW SILL	CONCRETE	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	32.55 < LOD	13.05 < LOD		32.55	
70	10/24/2022 0:40 PAINT	0.72 mg / cm ^2 Final	COLUMN 4A18	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	22.35 < LOD	5.25 < LOD		22.35	
74	10/24/2022 0:44 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	44.55 < LOD	13.2 < LOD		44.55	
78	10/24/2022 0:58 PAINT	0.57 mg / cm ^2 Final	WINDOW CASING	CONCRETE	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	49.35 < LOD	11.25 < LOD		49.35	
79	10/24/2022 0:58 PAINT	1.01 mg / cm ^2 Final	WINDOW SILL	CONCRETE	C	CRACKED	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	17.7 < LOD	6.3 < LOD		17.7	
80	10/24/2022 0:59 PAINT	0.72 mg / cm ^2 Final	COLUMN 4A19	CONCRETE	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	23.25 < LOD	4.95 < LOD		23.25	
89	10/24/2022 1:06 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	45.6 < LOD	8.1 < LOD		45.6	
90	10/24/2022 1:07 PAINT	0.58 mg / cm ^2 Final	WINDOW SILL	CONCRETE	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	39.45 < LOD	10.5 < LOD		39.45	
92	10/24/2022 1:10 PAINT	0.72 mg / cm ^2 Final	COLUMN 4A20	BRICK	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	22.95 < LOD	3 < LOD		22.95	
94	10/24/2022 1:11 PAINT	3.19 mg / cm ^2 Final	COLUMN 4A20 FOOTER	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	4.3	0.8	1.2	0.4	1.2	0.4 < LOD	2.4
97	10/24/2022 1:15 PAINT	0.72 mg / cm ^2 Final	WALL	BRICK	D	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	10	0.8 < LOD	28.95 < LOD	10.5 < LOD		28.95	
99	10/24/2022 1:16 PAINT	3.32 mg / cm ^2 Final	WALL FOOTER	METAL	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Positive	4.18	0.8	1.2	0.3	1.2	0.3 < LOD	2.1
7	10/24/2022 21:38 PAINT	0.87 mg / cm ^2 Final	SAFETY RAIL FOOTER	CONCRETE	UPPER	FAIR	YELLOW	BLG.A	JSST	FOURTH	BINDERY A	Positive	3.83	0.8 < LOD	3.9 < LOD	3.9 < LOD		9.9	
8	10/24/2022 21:39 PAINT	0.72 mg / cm ^2 Final	COLUMN 4C18	BRICK	A	FAIR	WHITE	BLG.A	JSST	FOURTH	BINDERY A	Positive	10	0.8 < LOD	24.3 < LOD	5.85 < LOD		24.3	
16	10/24/2022 21:48 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING COO 4C18	CONCRETE	A	FAIR	GRAY	BLG.A	JSST	FOURTH	BINDERY Area	Positive	10	0.8 < LOD	38.25 < LOD	5.1 < LOD		38.25	
22	10/24/2022 21:57 PAINT	0.72 mg / cm ^2 Final	COLUMN 4C14	BRICK	A	FAIR	WHITE	BLG.A	JSST	FOURTH	BINDERY Area	Positive	10	0.8 < LOD	25.2 < LOD	6.3 < LOD		25.2	
26	10/24/2022 22:00 PAINT	0.58 mg / cm ^2 Final	WINDOW FRAME EXT	WOOD	A	CRACKED	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area	Positive	10	0.8 < LOD	38.4 < LOD	25.5 < LOD		38.4	
27	10/24/2022 22:01 PAINT	0.58 mg / cm ^2 Final	WINDOW FRAME EXT	WOOD	A	CRACKED	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area	Positive	10	0.8 < LOD	37.05 < LOD	35.1 < LOD		37.05	
28	10/24/2022 22:02 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE	A	INTACT	WHITE	BLG.A	JSST	FOURTH	BINDERY Area	Positive	10	0.8 < LOD	44.85 < LOD	9.45 < LOD		44.85	
29	10/24/2022 22:03 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING GUARD	METAL	A	INTACT	WHITE	BLG.A	JSST	FOURTH	BINDERY Area	Positive	10	0.8 < LOD	45 < LOD	9.9 < LOD		45	
37	10/24/2022 22:12 PAINT	0.58 mg / cm ^2 Final	WINDOW FRAME EXT	WOOD	A	FAIR	GRAY	BLG.A	JSST	FOURTH	BINDERY Area	Positive	10	0.8 < LOD	40.95 < LOD	13.95 < LOD		40.95	
38	10/24/2022 22:13 PAINT	0.58 mg / cm ^2 Final	WINDOW CASING	CONCRETE	A	FAIR	WHITE	BLG.A</											

Reading N	Time	Type	Duration	Units	Sequence	Component	Substrate	Side	Condition	Color	Site	Inspector	Floor	Room	Misc 1	Misc 2	Res	EScale1	EScleCT	Results	Depth	Inde	Action	Lev	PbC	PbC Error	PbL	PbL Error	PbK	PbK Error
6	10/4/2022 22:27	PAINT	2.69	mg / cm ^2	Final	WALL	brick	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	col F24 lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		3	
11	10/4/2022 22:32	PAINT	3.12	mg / cm ^2	Final	Pipe	METAL	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	pipe2 lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		1.11	
12	10/4/2022 22:34	PAINT	1.04	mg / cm ^2	Final	Pipe	fiberglass	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	pipe2 upper						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		1.94	
13	10/4/2022 22:36	PAINT	1.04	mg / cm ^2	Final	DOOR	METAL	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	fire door exit						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		5.21	
15	10/4/2022 22:38	PAINT	1.04	mg / cm ^2	Final	DOOR casing	METAL	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	fire door exit						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		5.4	
16	10/4/2022 22:41	PAINT	1.04	mg / cm ^2	Final	WINDOW board	METAL	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	upper window						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		3.84	
17	10/4/2022 22:42	PAINT	1.04	mg / cm ^2	Final	WINDOW board	METAL	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	upper window						Negative	1.1		1 < LOD		0.04 < LOD	0.04 < LOD		4.15	
18	10/4/2022 22:43	PAINT	1.05	mg / cm ^2	Final	WINDOW board	WOOD	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	lower window						Negative	1		1 < LOD		0.04 < LOD	0.04 < LOD		2.65	
19	10/4/2022 22:43	PAINT	1.04	mg / cm ^2	Final	WINDOW board	WOOD	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	lower window						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		3	
22	10/4/2022 22:46	PAINT	1.04	mg / cm ^2	Final	Pipe brace	METAL	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	lower window						Negative	2.11		1 < LOD		0.13 < LOD	0.13 < LOD		5.6	
23	10/4/2022 22:47	PAINT	1.04	mg / cm ^2	Final	Pipe	METAL	D	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	goes thru window						Negative	1.37		1 < LOD		0.09 < LOD	0.09 < LOD		5.14	
27	10/5/2022 1:02	PAINT	2.99	mg / cm ^2	Final	WALL	brick	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	col F23 lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.85	
29	10/5/2022 1:04	PAINT	1.04	mg / cm ^2	Final	pipe	fiberglass	A	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	col F23 upper						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		1.41	
30	10/5/2022 1:04	PAINT	3.11	mg / cm ^2	Final	pipe	METAL	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	col F23 lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		0.94	
32	10/5/2022 1:09	PAINT	3.13	mg / cm ^2	Final	WALL	brick	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	COL F22 lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		1.8	
35	10/5/2022 1:13	PAINT	3.12	mg / cm ^2	Final	WALL	brick	A	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	COL F20 lower						Negative	1.97		1 < LOD		0.04 < LOD	0.04 < LOD		1.65	
36	10/5/2022 1:15	PAINT	3.11	mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	COL F20 upper						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		0.85	
37	10/5/2022 1:16	PAINT	2.53	mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	COL F20 lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.22	
38	10/5/2022 1:17	PAINT	1.04	mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	east wall upper						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.36	
39	10/5/2022 1:18	PAINT	2.08	mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	east wall lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.28	
40	10/5/2022 1:19	PAINT	1.04	mg / cm ^2	Final	WALL	WOOD	B	FAIR	YELLOW	bldg.a	jsst	FOURTH	A426	east wall safety stop						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.37	
42	10/5/2022 1:24	PAINT	2.98	mg / cm ^2	Final	WALL	brick	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	south wall Col E17 lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		3.02	
44	10/5/2022 1:30	PAINT	3.12	mg / cm ^2	Final	WALL	brick	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	south wall Col lower						Negative	2.23		1 < LOD		0.04 < LOD	0.04 < LOD		1.84	
46	10/5/2022 1:33	PAINT	3.14	mg / cm ^2	Final	WALL	brick	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	eastwall net to door lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.01	
47	10/5/2022 1:34	PAINT	1.49	mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	eastwall next to door upper						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.3	
48	10/5/2022 1:35	PAINT	1.34	mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	eastwall next to door lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.34	
49	10/5/2022 1:36	PAINT	1.04	mg / cm ^2	Final	WALL	WOOD	B	FAIR	YELLOW	bldg.a	jsst	FOURTH	A426	safety stop						Negative	1		1 < LOD		0.04 < LOD	0.04 < LOD		2.49	
50	10/5/2022 1:37	PAINT	3.11	mg / cm ^2	Final	WALL	CONCRETE	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	safety stop						Negative	3.51		1	0.4	0.2	0.4	0.2 < LOD	1.5	
51	10/5/2022 1:38	PAINT	1.04	mg / cm ^2	Final	DOOR	WOOD	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	main entrance						Negative	1		1 < LOD		0.05 < LOD	0.05 < LOD		3.51	
52	10/5/2022 1:39	PAINT	1.34	mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	main entrance upper						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.44	
53	10/5/2022 1:40	PAINT	1.79	mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	main entrance lower						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.24	
54	10/5/2022 1:45	PAINT	14	mg / cm ^2	Final	WALL	brick	B	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	elevator entrance upper						Negative	3.89		1 < LOD		0.75	0.17	0.06 < LOD	0.75	
55	10/5/2022 1:45	PAINT	5.36	mg / cm ^2	Final	WALL	brick	B	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	elevator entrance upper						Negative	6.33		1 < LOD		1.41	0.4	0.2 < LOD	1.41	
57	10/5/2022 1:47	PAINT	2.83	mg / cm ^2	Final	WALL	brick	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	elevator entrance lower						Negative	1.78		1 < LOD		0.06 < LOD	0.06 < LOD		2.91	
59	10/5/2022 1:49	PAINT	1.04	mg / cm ^2	Final	DOOR	WOOD	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	elevator entrance						Negative	2.92		1 < LOD		0.6 < LOD	0.6 < LOD		4.95	
60	10/5/2022 1:51	PAINT	1.05	mg / cm ^2	Final	electrical box	METAL	C	FAIR	bare metal	bldg.a	jsst	FOURTH	A426	elevator entrance						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		5.51	
61	10/5/2022 1:52	PAINT	1.04	mg / cm ^2	Final	electrical box	METAL	C	FAIR	gray	bldg.a	jsst	FOURTH	A426	elevator entrance junction box						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		5.34	
62	10/5/2022 1:53	PAINT	1.05	mg / cm ^2	Final	electrical box	METAL	C	FAIR	gray	bldg.a	jsst	FOURTH	A426	elevator entrance powet switch						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		5.17	
63	10/5/2022 1:57	PAINT	6.09	mg / cm ^2	Final	WALL	brick	B	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	elevetor entrance east side upp						Negative	10		1 < LOD		1.29	0.4	0.2 < LOD	1.29	
64	10/5/2022 1:58	PAINT	2.08	mg / cm ^2	Final	WALL	brick	B	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	elevetor entrance east side low						Negative	2.74		1 < LOD		0.12 < LOD	0.12 < LOD		3.35	
67	10/5/2022 2:01	PAINT	1.03	mg / cm ^2	Final	POWER SWITCH	METAL	B	FAIR	gray	bldg.a	jsst	FOURTH	A426	elevator er electrical power switch						Negative	1.76		1 < LOD		0.07 < LOD	0.07 < LOD		4.82	
7	10/10/2022 21:58	PAINT	2.94	mg / cm ^2	Final	COLUMN	brick	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	col 4D24						Negative	7.15		1 < LOD		0.27 < LOD	0.27 < LOD		2.91	
8	10/10/2022 21:59	PAINT	8.68	mg / cm ^2	Final	WALL	brick	C	FAIR	WHITE	bldg.a	jsst	FOURTH	A426	col 4D24						Negative	9.27		1 < LOD		1.08	0.6	0.2 < LOD	1.08	
9	10/10/2022 22:00	PAINT	3.09	mg / cm ^2	Final	WALL	brick	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	Col 4D24						Negative	10		1 < LOD		2.01 < LOD	0.49 < LOD		2.01	
14	10/10/2022 22:06	PAINT	1.77	mg / cm ^2	Final	COLUMN	BRICK	C	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426	Col 4D23						Negative	1.33		1 < LOD		0.05 < LOD	0.05 < LOD		3.37	
16	10/10/2022 22:11	PAINT	1.48	mg / cm ^2	Final	WALL	WOOD	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426						Negative	1		1 < LOD		0.04 < LOD	0.04 < LOD		4.17		
18	10/10/2022 22:13	PAINT	2.5	mg / cm ^2	Final	WALL	BRICK	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		3.09		
22	10/10/2022 22:15	PAINT	2.36	mg / cm ^2	Final	WALL	CONCRETE	D	FAIR	WHITE	bldg.a	jsst	FOURTH	A426						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		2.91		
23	10/10/2022 22:16	PAINT	2.21	mg / cm ^2	Final	WALL	CONCRETE	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426						Negative	1		1 < LOD		0.03 < LOD	0.03 < LOD		3.22		
24	10/10/2022 22:17	PAINT	2.8	mg / cm ^2	Final	FOOTER	CONCRETE	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426						Negative	4.48		1 < LOD		0.23 < LOD	0.23 < LOD		3.16		
25	10/10/2022 22:19	PAINT	2.95	mg / cm ^2	Final	COLUMN	BRICK	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426						Negative	2.45		1 < LOD		0.07 < LOD	0.07 < LOD		3.49		
26	10/10/2022 22:20	PAINT	1.03	mg / cm ^2	Final	WINDOW COVER	WOOD	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426						Negative	1		1 < LOD		0.05 < LOD	0.05 < LOD		4.16		
27	10/10/2022 22:22	PAINT	1.76	mg / cm ^2	Final	PIPE	FIBERGLASS	D	FAIR	WHITE	bldg.a	jsst	FOURTH	A426						Negative	1		1 < LOD		1.44 < LOD	0.03 < LOD		1.44		
28	10/10/2022 22:22	PAINT	2.51	mg / cm ^2	Final	PIPE	METAL	D	FAIR	BEIGE	bldg.a	jsst	FOURTH	A426						Negative	1.3		1 < LOD		0.03 < LOD	0.03 < LOD		1.77		
31	10/10/2022 22:28	PAINT	3.1	mg / cm ^2	Final	COLUMN	BRICK	D	FAIR	BEIGE	bldg.a																			

73	10/10/2022 23:58 PAINT	1.03 mg / cm ^2	Final	SAFETY RAILING	METAL	A	FAIR	YELLOW	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	6.52	
74	10/10/2022 23:58 PAINT	1.18 mg / cm ^2	Final	WALL	DRYWALL	A	FAIR	WHITE	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.09	
75	10/10/2022 23:59 PAINT	2.06 mg / cm ^2	Final	WALL	DRYWALL	A	FAIR	BEIGE	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.2	
76	10/10/2022 23:59 PAINT	2.35 mg / cm ^2	Final	WALL COVER	DRYWALL	A	FAIR	YELLOW	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.33	
77	10/11/2022 0:00 PAINT	1.04 mg / cm ^2	Final	WALL FOOTER	WOOD	A	FAIR	YELLOW	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	2.15	
78	10/11/2022 0:01 PAINT	2.06 mg / cm ^2	Final	WALL	DRYWALL	D	FAIR	WHITE	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.27	
79	10/11/2022 0:02 PAINT	1.33 mg / cm ^2	Final	WALL	DRYWALL	D	FAIR	BEIGE	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.81	
80	10/11/2022 0:02 PAINT	2.49 mg / cm ^2	Final	WALL COVER	WOOD	D	FAIR	YELLOW	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.32	
81	10/11/2022 0:03 PAINT	1.04 mg / cm ^2	Final	WALL FOOTER	WOOD	D	FAIR	YELLOW	bl dg a	jsst	FOURTH	A426 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.88	
4	10/11/2022 21:01 PAINT	3.09 mg / cm ^2	Final	WALL	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F19	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.76	
5	10/11/2022 21:02 PAINT	2.35 mg / cm ^2	Final	WALL	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F19	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.15	
6	10/11/2022 21:03 PAINT	1.91 mg / cm ^2	Final	WALL FOOTER	CONCRETE	A	FAIR	YELLOW	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F19	Negative	6.76	1 < LOD	0.43 < LOD	0.43 < LOD	3.68	
7	10/11/2022 21:03 PAINT	1.03 mg / cm ^2	Final	WALL FOOTER	METAL	A	FAIR	YELLOW	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F19	Negative	1	1 < LOD	0.08 < LOD	0.08 < LOD	5.59	
9	10/11/2022 21:05 PAINT	3.09 mg / cm ^2	Final	WALL COLUMN	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F19	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.65	
10	10/11/2022 21:06 PAINT	2.36 mg / cm ^2	Final	PIPE	METAL	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F19	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.6	
13	10/11/2022 21:09 PAINT	1.03 mg / cm ^2	Final	SAFETY RAIL	METAL	A	FAIR	YELLOW	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F18	Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	6.29	
15	10/11/2022 21:11 PAINT	2.95 mg / cm ^2	Final	COLUMN 4F18	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F18	Negative	1.55	1 < LOD	0.04 < LOD	0.04 < LOD	2.98	
20	10/11/2022 21:16 PAINT	2.78 mg / cm ^2	Final	WALL	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F18	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.59	
22	10/11/2022 21:17 PAINT	1.03 mg / cm ^2	Final	WINDOW COVER	WOOD	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F18	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.13	
23	10/11/2022 21:18 PAINT	3.37 mg / cm ^2	Final	WINDOW COVER	BRICK	LOWER	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F18	Negative	3.74	1	0.2	0.13	0.2	1.65
24	10/11/2022 21:19 PAINT	1.04 mg / cm ^2	Final	WALL COVER	WOOD	LOWER	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F18	Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	2.85	
26	10/11/2022 21:27 PAINT	3.08 mg / cm ^2	Final	COLUMN 4F17	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F17	Negative	2.32	1 < LOD	0.06 < LOD	0.06 < LOD	1.81	
27	10/11/2022 21:27 PAINT	1.03 mg / cm ^2	Final	COLUMN 4F17 FOOTER	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F17	Negative	2.49	1 < LOD	0.33 < LOD	0.33 < LOD	5.67	
28	10/11/2022 21:28 PAINT	1.03 mg / cm ^2	Final	PIPE	FIBERGLASS	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F17	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.98	
29	10/11/2022 21:29 PAINT	2.21 mg / cm ^2	Final	PIPE	METAL	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F17	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.85	
38	10/11/2022 21:49 PAINT	2.95 mg / cm ^2	Final	COLUMN 4F16	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.8	
39	10/11/2022 21:50 PAINT	0.88 mg / cm ^2	Final	COLUMN 4F16 PIPE	FIBERGLASS	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	1.96 < LOD	0.06 < LOD	1.96	
40	10/11/2022 21:50 PAINT	3.08 mg / cm ^2	Final	COLUMN 4F16 PIPE	METAL	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.04	
42	10/11/2022 21:58 PAINT	1.61 mg / cm ^2	Final	PIPE VERTICAL	PIPE WRAP	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.63	
43	10/11/2022 21:58 PAINT	1.91 mg / cm ^2	Final	PIPE VERTICAL	PIPE WRAP	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.68	
44	10/11/2022 21:59 PAINT	2.93 mg / cm ^2	Final	PIPE VERTICAL	PIPE WRAP	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.6	
45	10/11/2022 21:59 PAINT	2.36 mg / cm ^2	Final	PIPE VERTICAL	PIPE WRAP	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.18	
46	10/11/2022 22:00 PAINT	2.5 mg / cm ^2	Final	PIPE VERTICAL	METAL	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.01	
47	10/11/2022 22:01 PAINT	3.09 mg / cm ^2	Final	PIPE VERTICAL	METAL	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.14	
53	10/11/2022 22:06 PAINT	2.95 mg / cm ^2	Final	WALL	CONCRETE	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.7	
54	10/11/2022 22:06 PAINT	1.03 mg / cm ^2	Final	WALL COVER	WOOD	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.08	
55	10/11/2022 22:07 PAINT	3.08 mg / cm ^2	Final	WALL	WOOD	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F16	Negative	7.16	1 < LOD	0.41 < LOD	0.41 < LOD	1.85	
57	10/11/2022 22:09 PAINT	3.51 mg / cm ^2	Final	COLUMN 4F15	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F15	Negative	1.39	1 < LOD	0.03 < LOD	0.03 < LOD	1.8	
61	10/11/2022 22:32 PAINT	3.24 mg / cm ^2	Final	WALL	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F15	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.66	
64	10/11/2022 22:34 PAINT	3.08 mg / cm ^2	Final	WALL	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F15	Negative	2.25	1 < LOD	0.14 < LOD	0.14 < LOD	1.57	
65	10/11/2022 22:35 PAINT	1.03 mg / cm ^2	Final	WALL COVER	WOOD	LOWER	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F15	Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	2.55	
67	10/11/2022 22:37 PAINT	2.5 mg / cm ^2	Final	COLUMN 4F14	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F14	Negative	4.99	1 < LOD	0.2 < LOD	0.2 < LOD	3.19	
68	10/11/2022 22:38 PAINT	2.35 mg / cm ^2	Final	COLUMN 4F14 FOOTER	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F14	Negative	2.77	1 < LOD	0.13 < LOD	0.13 < LOD	3.13	
69	10/11/2022 22:39 PAINT	1.03 mg / cm ^2	Final	PIPE	FIBERGLASS	A	FAIR	WHITE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F14	Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	1.41	
70	10/11/2022 22:39 PAINT	2.79 mg / cm ^2	Final	PIPE	METAL	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4F14	Negative	3.39	1 < LOD	1.97 < LOD	0.08 < LOD	1.97	
73	10/11/2022 22:48 PAINT	3.09 mg / cm ^2	Final	WALL 4E14	BRICK	B	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4E14	Negative	3.34	1 < LOD	0.1 < LOD	0.1 < LOD	2	
75	10/11/2022 22:49 PAINT	2.8 mg / cm ^2	Final	WALL 4E14	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR COL 4E14	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.02	
78	10/11/2022 22:53 PAINT	3.1 mg / cm ^2	Final	COLUMN 4E15	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.02	
80	10/11/2022 22:54 PAINT	3.11 mg / cm ^2	Final	COLUMN 4E15	BRICK	B	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2	
82	10/11/2022 22:56 PAINT	3.11 mg / cm ^2	Final	COLUMN 4E15	BRICK	C	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.76	
85	10/11/2022 23:00 PAINT	2.07 mg / cm ^2	Final	COLUMN 4E16	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1.18	1 < LOD	0.03 < LOD	0.03 < LOD	3.29	
87	10/11/2022 23:01 PAINT	3.1 mg / cm ^2	Final	COLUMN 4E16	BRICK	D	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	3.18	1 < LOD	0.11 < LOD	0.11 < LOD	1.97	
90	10/11/2022 23:03 PAINT	3.1 mg / cm ^2	Final	COLUMN 4E16	BRICK	C	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1.7	1 < LOD	0.04 < LOD	0.04 < LOD	1.98	
91	10/11/2022 23:04 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E16 FOOTER	BRICK	C	PEELING	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	2.53	1 < LOD	0.29 < LOD	0.29 < LOD	5.85	
92	10/11/2022 23:04 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E16 FOOTER	BRICK	D	PEELING	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	5.2	1 < LOD	0.63 < LOD	0.63 < LOD	6.17	
93	10/11/2022 23:05 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E16 FOOTER	BRICK	A	PEELING	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1.37	1 < LOD	0.13 < LOD	0.13 < LOD	6.7	
94	10/11/2022 23:06 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E15 FOOTER	BRICK	A	PEELING	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1	1 < LOD	0.06 < LOD	0.06 < LOD	5.28	
95	10/11/2022 23:07 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E15 FOOTER	BRICK	B	PEELING	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	3.26	1 < LOD	0.38 < LOD	0.38 < LOD	5.38	
96	10/11/2022 23:08 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E15 FOOTER	METAL	C	PEELING	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1.23	1 < LOD	0.15 < LOD	0.15 < LOD	6.44	
98	10/12/2022 1:25 PAINT	3.1 mg / cm ^2	Final	COLUMN 4E17	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1.4	1 < LOD	0.03 < LOD	0.03 < LOD	1.87	
103	10/12/2022 1:30 PAINT	3.1 mg / cm ^2	Final	COLUMN 4E17	BRICK	C	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	2.83	1 < LOD	0.09 < LOD	0.09 < LOD	1.82	
105	10/12/2022 1:32 PAINT	3.11 mg / cm ^2	Final	COLUMN 4E17	BRICK	D	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.88	
106	10/12/2022 1:33 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E17 FOOTER	CONCRETE	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	3.01	1 < LOD	0.42 < LOD	0.42 < LOD	6.6	
107	10/12/2022 1:33 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E17 FOOTER	CONCRETE	B	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	4.29	1 < LOD	0.48 < LOD	0.48 < LOD	6.23	
108	10/12/2022 1:33 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E17 FOOTER	CONCRETE	C	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	2.29	1 < LOD	0.33 < LOD	0.33 < LOD	6.38	
109	10/12/2022 1:34 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E17 FOOTER	CONCRETE	D	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	3.25	1 < LOD	0.49 < LOD	0.49 < LOD	6.74	
111	10/12/2022 1:36 PAINT	2.36 mg / cm ^2	Final	COLUMN 4E18	BRICK	A	FAIR	BEIGE	BLD.A	JSST	FOURTH	BINDERY FLOOR	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.22	
113	10/12/2022 1:37 PAINT	3.1 mg / cm ^2	Final	COLUMN															

42	10/12/2022 22:28	PAINT	1.61 mg / cm ^2	Final	WALL INT	METAL	A	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A418			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.83
43	10/12/2022 22:29	PAINT	1.62 mg / cm ^2	Final	WALL INT	METAL	B	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A418			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.44
44	10/12/2022 22:30	PAINT	3.8 mg / cm ^2	Final	WALL	CONCRETE	B	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A418			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.45
48	10/12/2022 22:33	PAINT	1.77 mg / cm ^2	Final	WALL INT	DRYWALL	D	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A418			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.65
49	10/12/2022 22:34	PAINT	1.32 mg / cm ^2	Final	WALL EXT	DRYWALL	C	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.92
50	10/12/2022 22:35	PAINT	2.79 mg / cm ^2	Final	WALL EXT	DRYWALL	B	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.16
51	10/12/2022 22:36	PAINT	1.03 mg / cm ^2	Final	WALL FOOTER	DRYWALL	B	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.76
52	10/12/2022 22:36	PAINT	1.03 mg / cm ^2	Final	WALL FOOTER	DRYWALL	C	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.24
53	10/12/2022 22:37	PAINT	1.03 mg / cm ^2	Final	WINDOW FRAME	WOOD	C	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.59
54	10/12/2022 22:38	PAINT	1.03 mg / cm ^2	Final	WINDOW FRAME	WOOD	B	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.14
55	10/12/2022 22:39	PAINT	1.91 mg / cm ^2	Final	WALL INT	DRYWALL	A	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.62
56	10/12/2022 22:41	PAINT	1.32 mg / cm ^2	Final	WALL INT	DRYWALL	B	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.34
57	10/12/2022 22:41	PAINT	3.08 mg / cm ^2	Final	WALL INT	DRYWALL	D	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.4
58	10/12/2022 22:42	PAINT	1.03 mg / cm ^2	Final	DOOR	WOOD	C	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.06
59	10/12/2022 22:43	PAINT	1.02 mg / cm ^2	Final	DOOR JAMB	METAL	B	FAIR	COPPER	BLDG. A	JSST	FOURTH	A420			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	5.85
60	10/12/2022 22:43	PAINT	1.03 mg / cm ^2	Final	DOOR JAMB	METAL	B	FAIR	COPPER	BLDG. A	JSST	FOURTH	A418			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	5.21
61	10/12/2022 22:44	PAINT	1.02 mg / cm ^2	Final	DOOR HINGE	METAL	B	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A418			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	5.55
62	10/12/2022 22:45	PAINT	0.88 mg / cm ^2	Final	WALL	BRICK	C	FAIR	BEIGE	BLDG. A	JSST	FOURTH	A420			Null	1.76	1 < LOD	0.19 < LOD	0.19 < LOD	7.35
64	10/12/2022 22:48	PAINT	13.15 mg / cm ^2	Final	WINDOW FRAME	METAL	C	FAIR	GREY	BLDG. A	JSST	FOURTH	A420			Null	1	1 < LOD	0.03 < LOD	0.03 < LOD	0.75
66	10/12/2022 22:51	PAINT	1.18 mg / cm ^2	Final	SAFETY RAILING	METAL	UPPER	FAIR	YELLOW	BLDG. A	JSST	FOURTH	A418			Negative	1.11	1 < LOD	0.03 < LOD	0.03 < LOD	5.8
67	10/12/2022 22:51	PAINT	1.03 mg / cm ^2	Final	SAFETY RAILING	METAL	A	FAIR	YELLOW	BLDG. A	JSST	FOURTH	A418			Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	5.49
5	10/13/2022 21:51	PAINT	2.79 mg / cm ^2	Final	COLUMN 4E14	BRICK	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	BINDERY AREA	COL 4E14		Negative	1.21	1 < LOD	0.03 < LOD	0.03 < LOD	2.5
6	10/13/2022 21:52	PAINT	1.03 mg / cm ^2	Final	COLUMN 4E14 FOOTER	CONCRETE	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	BINDERY AREA	COL 4E14		Negative	2.54	1 < LOD	0.47 < LOD	0.47 < LOD	5.7
8	10/13/2022 21:54	PAINT	2.06 mg / cm ^2	Final	COLUMN 4E13	BRICK	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	BINDERY AREA	COL 4E13		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.32
10	10/13/2022 21:56	PAINT	3.09 mg / cm ^2	Final	COLUMN 4E12	BRICK	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	BINDERY AREA	COL 4E12		Negative	1.79	1 < LOD	0.03 < LOD	0.03 < LOD	1.75
12	10/13/2022 21:58	PAINT	1.03 mg / cm ^2	Final	COLUMN 4E12 FOOTER	METAL	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	BINDERY AREA	COL 4E12 FROM WALL COL 4E13 to 4E12		Negative	1.4	1 < LOD	0.47 < LOD	0.47 < LOD	6.3
15	10/13/2022 22:01	PAINT	1.03 mg / cm ^2	Final	DOOR FRAME	METAL	A	FAIR	WHITE	BLDG. A	jsst	FOURTH	A424			Negative	2.31	1 < LOD	0.27 < LOD	0.27 < LOD	5.68
16	10/13/2022 22:01	PAINT	1.04 mg / cm ^2	Final	DOOR	METAL	A	FAIR	WHITE	BLDG. A	jsst	FOURTH	A424			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	6.07
18	10/13/2022 22:04	PAINT	2.95 mg / cm ^2	Final	WALL	BRICK	D	FAIR	WHITE	BLDG. A	jsst	FOURTH	A424	LOWE SIDE		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.65
19	10/13/2022 22:08	PAINT	1.03 mg / cm ^2	Final	WALL EXT	DRYWALL	A	FAIR	WHITE	BLDG. A	jsst	FOURTH	A424			Negative	5.56	1 < LOD	0.96 < LOD	0.96 < LOD	4.79
20	10/13/2022 22:22	PAINT	1.31 mg / cm ^2	Final	WALL	DRYWALL	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	UPPER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.33
21	10/13/2022 22:23	PAINT	1.03 mg / cm ^2	Final	WALL	DRYWALL	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	LOWER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.24
22	10/13/2022 22:24	PAINT	1.03 mg / cm ^2	Final	DOOR FRAME	METAL	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424			Negative	1	1 < LOD	0.1 < LOD	0.1 < LOD	4.75
23	10/13/2022 22:24	PAINT	1.02 mg / cm ^2	Final	DOOR	METAL	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.77
24	10/13/2022 22:25	PAINT	1.03 mg / cm ^2	Final	DOOR JAMB	METAL	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.71
25	10/13/2022 22:28	PAINT	1.17 mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	NEXT TO EAST ENTRANCE UPPER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.67
26	10/13/2022 22:29	PAINT	1.31 mg / cm ^2	Final	WALL	DRYWALL	B	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	NEXT TO EAST ENTRANCE LOWER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.02
27	10/13/2022 22:30	PAINT	1.03 mg / cm ^2	Final	DOOR FRAME	METAL	B	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	EAST SIDE DOOR		Negative	1	1 < LOD	0.09 < LOD	0.09 < LOD	5.85
28	10/13/2022 22:30	PAINT	1.03 mg / cm ^2	Final	DOOR	METAL	B	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	EAST SIDE DOOR		Negative	1	1 < LOD	0.07 < LOD	0.07 < LOD	4.78
29	10/13/2022 22:32	PAINT	1.03 mg / cm ^2	Final	DOOR FRAME	METAL	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	EAST SIDE DOOR		Negative	1.27	1 < LOD	0.21 < LOD	0.21 < LOD	5.77
30	10/13/2022 22:32	PAINT	1.03 mg / cm ^2	Final	DOOR	METAL	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	EAST SIDE DOOR		Negative	2.07	1 < LOD	0.17 < LOD	0.17 < LOD	5.55
31	10/13/2022 22:33	PAINT	1.02 mg / cm ^2	Final	WALL	METAL	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	EAST SIDE DOOR UPPER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.99
32	10/13/2022 22:34	PAINT	1.02 mg / cm ^2	Final	WALL	METAL	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	EAST SIDE DOOR LOWER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.35
33	10/13/2022 22:34	PAINT	1.02 mg / cm ^2	Final	WALL	DRYWALL	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	EAST SIDE DOOR LOWER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.96
34	10/13/2022 22:35	PAINT	1.02 mg / cm ^2	Final	WALL	DRYWALL	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	EAST SIDE DOOR UPPER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.93
36	10/13/2022 22:37	PAINT	0.74 mg / cm ^2	Final	WALL	BRICK	D	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	UPPER		Positive	8.54	1 < LOD	24.9 < LOD	10.35 < LOD	24.9
37	10/13/2022 22:38	PAINT	3.24 mg / cm ^2	Final	WALL	BRICK	D	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	LOWER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.77
39	10/13/2022 22:40	PAINT	3.09 mg / cm ^2	Final	WALL	BRICK	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424	LOWER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.5
41	10/13/2022 22:57	PAINT	3.24 mg / cm ^2	Final	WALL	BRICK	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.76
45	10/13/2022 23:00	PAINT	5.26 mg / cm ^2	Final	WALL EXT	CONCRETE	A	CRACKED	GREY	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.22
46	10/13/2022 23:01	PAINT	3.1 mg / cm ^2	Final	WALL	CONCRETE	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424A	LOWER		Negative	2.62	1 < LOD	0.09 < LOD	0.09 < LOD	1.68
47	10/13/2022 23:02	PAINT	1.03 mg / cm ^2	Final	PIPE	FIBERGLASS	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.06 < LOD	0.06 < LOD	1.73
49	10/13/2022 23:05	PAINT	2.95 mg / cm ^2	Final	COLUMN 4F11	BRICK,	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424A	LOWER		Null	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.9
50	10/13/2022 23:05	PAINT	1.03 mg / cm ^2	Final	PIPE	FIBERGLASS	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.64
52	10/13/2022 23:08	PAINT	3.1 mg / cm ^2	Final	COLUMN 4F10	BRICK	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424A	LOWER		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.84
53	10/13/2022 23:09	PAINT	1.02 mg / cm ^2	Final	PIPE,	FIBERGLASS	A	FAIR	BEIGE	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.06 < LOD	0.06 < LOD	1.92
54	10/13/2022 23:10	PAINT	1.04 mg / cm ^2	Final	WALL STUD	WOOD	B	FAIR	BROWN	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	3.18
56	10/13/2022 23:11	PAINT	2.34 mg / cm ^2	Final	WALL	WOOD	B	FAIR	BROWN	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.55
57	10/13/2022 23:11	PAINT	1.02 mg / cm ^2	Final	WALL	DRYWALL	C	FAIR	BROWN	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3
58	10/13/2022 23:12	PAINT	1.03 mg / cm ^2	Final	WALL STUD	DRYWALL	C	FAIR	BROWN	BLDG. A	jsst	FOURTH	A424A			Negative	2.23	1 < LOD	0.23 < LOD	0.23 < LOD	3.62
59	10/13/2022 23:13	PAINT	1.02 mg / cm ^2	Final	DOOR	METAL	C	FAIR	GRAY	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	4.87
60	10/13/2022 23:13	PAINT	1.03 mg / cm ^2	Final	DOOR FRAME	METAL	C	FAIR	GRAY	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.14 < LOD	0.14 < LOD	5.03
61	10/13/2022 23:14	PAINT	1.03 mg / cm ^2	Final	DOOR JAMB	METAL	C	FAIR	COPPER	BLDG. A	jsst	FOURTH	A424A			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.48
65	10/13/2022 23:21	PAINT	3.24 mg / cm ^2	Final	COLUMN 4D10	BRICK	C	FAIR	BEIGE	BLDG. A	jsst	FOURTH	OFFICE SPACE			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.5
5	1																				

46	10/16/2022 22:35 PAINT	3.21 mg / cm ^2	Final	COLUMN 4E9	BRICK	B	CRACKED	BEIGE	BLDG.A	JSST	FOURTH	COL 4E9	Negative	1.82	1 < LOD	0.03 < LOD	0.03 < LOD	1.86		
47	10/16/2022 22:36 PAINT	2.78 mg / cm ^2	Final	COLUMN 4E9	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E9	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.94		
48	10/16/2022 22:36 PAINT	2.78 mg / cm ^2	Final	COLUMN 4E9	BRICK	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E9	Negative	1.25	1 < LOD	0.03 < LOD	0.03 < LOD	3.11		
49	10/16/2022 22:37 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E9 FOOTER	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E9	Negative	1.63	1 < LOD	0.19 < LOD	0.19 < LOD	6.01		
50	10/16/2022 22:37 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E9 FOOTER	BRICK	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E9	Negative	1.92	1 < LOD	0.34 < LOD	0.34 < LOD	6.84		
51	10/16/2022 22:38 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E9 FOOTER	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E9	Negative	2.55	1 < LOD	0.31 < LOD	0.31 < LOD	6.46		
55	10/16/2022 22:41 PAINT	1.46 mg / cm ^2	Final	COLUMN 4E9 SAFETY RAIL	METAL	C	FAIR	YELLOW	BLDG.A	JSST	FOURTH	COL 4E9	Negative	2.04	1 < LOD	0.4 < LOD	0.4 < LOD	5.1		
61	10/16/2022 22:45 PAINT	2.05 mg / cm ^2	Final	COLUMN 4E8	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E8	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.68		
62	10/16/2022 22:46 PAINT	3.22 mg / cm ^2	Final	COLUMN 4E8	BRICK	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E8	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.8		
63	10/16/2022 22:46 PAINT	2.63 mg / cm ^2	Final	COLUMN 4E8	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E8	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.14		
64	10/16/2022 22:47 PAINT	2.34 mg / cm ^2	Final	COLUMN 4E8	BRICK	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E8	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.45		
65	10/16/2022 22:47 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E8 FOOTER	CONCRETE	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E8	Negative	1	1 < LOD	0.12 < LOD	0.12 < LOD	6.6		
66	10/16/2022 22:48 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E8 FOOTER	CONCRETE	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E8	Negative	1.66	1 < LOD	0.24 < LOD	0.24 < LOD	6.15		
67	10/16/2022 22:48 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E8 FOOTER	CONCRETE	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E8	Negative	1.37	1 < LOD	0.17 < LOD	0.17 < LOD	5.8		
68	10/16/2022 22:49 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E8 FOOTER	CONCRETE	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E8	Negative	1.39	1 < LOD	0.21 < LOD	0.21 < LOD	5.91		
73	10/16/2022 22:55 PAINT	3.21 mg / cm ^2	Final	COLUMN 4E7	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E7	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.61		
74	10/16/2022 22:55 PAINT	3.21 mg / cm ^2	Final	COLUMN 4E7	BRICK	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E7	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.81		
75	10/16/2022 22:56 PAINT	2.48 mg / cm ^2	Final	COLUMN 4E7	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E7	Negative	1.21	1 < LOD	0.03 < LOD	0.03 < LOD	3.19		
76	10/16/2022 22:56 PAINT	3.07 mg / cm ^2	Final	COLUMN 4E7	BRICK	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E7	Negative	1.3	1 < LOD	0.04 < LOD	0.04 < LOD	1.98		
77	10/16/2022 22:57 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E7 FOOTER	CONCRETE	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E7	Negative	1	1 < LOD	0.16 < LOD	0.16 < LOD	6.12		
78	10/16/2022 22:58 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E7 FOOTER	CONCRETE	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E7	Negative	2.58	1 < LOD	0.3 < LOD	0.3 < LOD	6.62		
79	10/16/2022 22:58 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E7 FOOTER	CONCRETE	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E7	Negative	2.11	1 < LOD	0.36 < LOD	0.36 < LOD	5.88		
84	10/16/2022 23:01 PAINT	2.34 mg / cm ^2	Final	COLUMN 4E6	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E6	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.31		
85	10/16/2022 23:02 PAINT	1.9 mg / cm ^2	Final	COLUMN 4E6	BRICK	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E6	Negative	3.58	1 < LOD	0.16 < LOD	0.16 < LOD	3.8		
86	10/16/2022 23:02 PAINT	2.78 mg / cm ^2	Final	COLUMN 4E6	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E6	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.22		
87	10/16/2022 23:03 PAINT	3.22 mg / cm ^2	Final	COLUMN 4E6	BRICK	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	COL 4E6	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.79		
88	10/16/2022 23:04 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E6 FOOTER	CONCRETE	A	PEELING	BEIGE	BLDG.A	JSST	FOURTH	COL 4E6	Negative	1.92	1 < LOD	0.6 < LOD	0.6 < LOD	6.32		
89	10/16/2022 23:04 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E6 FOOTER	CONCRETE	B	PEELING	BEIGE	BLDG.A	JSST	FOURTH	COL 4E6	Negative	1.06	1 < LOD	0.08 < LOD	0.08 < LOD	6.09		
90	10/16/2022 23:05 PAINT	1.03 mg / cm ^2	Final	COLUMN 4E6 FOOTER	CONCRETE	C	PEELING	BEIGE	BLDG.A	JSST	FOURTH	COL 4E6	Negative	1.55	1 < LOD	0.18 < LOD	0.18 < LOD	6.3		
91	10/16/2022 23:05 PAINT	1.02 mg / cm ^2	Final	COLUMN 4E6 FOOTER	CONCRETE	D	PEELING	BEIGE	BLDG.A	JSST	FOURTH	COL 4E6	Negative	1.88	1 < LOD	0.34 < LOD	0.34 < LOD	6.55		
9	10/17/2022 22:42 PAINT	1.02 mg / cm ^2	Final	WASH BASIN	CERAMIC	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1	1 < LOD	0.07 < LOD	0.07 < LOD	6.85	
10	10/17/2022 22:42 PAINT	1.02 mg / cm ^2	Final	WASH BASIN	CERAMIC	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.01	1 < LOD	0.15 < LOD	0.15 < LOD	7.05	
11	10/17/2022 22:43 PAINT	1.02 mg / cm ^2	Final	WALL FRAME	METAL	A	FAIR	GRAY	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.5	
12	10/17/2022 22:45 PAINT	1.02 mg / cm ^2	Final	STALL	PLASTIC	D	FAIR	RED	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.41	1 < LOD	0.36 < LOD	0.36 < LOD	4.66	
13	10/17/2022 22:46 PAINT	1.02 mg / cm ^2	Final	STALL	PLASTIC	C	FAIR	RED	BLDG.A	JSST	FOURTH	T142	women rr	Negative	2.07	1 < LOD	0.6 < LOD	0.6 < LOD	5.5	
14	10/17/2022 22:46 PAINT	1.03 mg / cm ^2	Final	STALL	PLASTIC	C	FAIR	RED	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.15	1 < LOD	0.35 < LOD	0.35 < LOD	5.6	
16	10/17/2022 22:46 PAINT	1.02 mg / cm ^2	Final	STALL	PLASTIC	C	FAIR	RED	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.17	1 < LOD	0.3 < LOD	0.3 < LOD	5.27	
17	10/17/2022 22:47 PAINT	1.02 mg / cm ^2	Final	STALL DOOR	PLASTIC	C	FAIR	RED	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.54	1 < LOD	0.6 < LOD	0.6 < LOD	4.93	
18	10/17/2022 22:48 PAINT	1.02 mg / cm ^2	Final	STALL WALL INT	PLASTIC	B	FAIR	RED	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1	1 < LOD	0.22 < LOD	0.22 < LOD	4.42	
19	10/17/2022 22:48 PAINT	1.02 mg / cm ^2	Final	STALL WALL INT	PLASTIC	D	FAIR	RED	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1	1 < LOD	0.22 < LOD	0.22 < LOD	4.95	
20	10/17/2022 22:49 PAINT	1.02 mg / cm ^2	Final	TOILET PAPER DISPENSER	METAL	D	FAIR	GRAY	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.39	
21	10/17/2022 22:51 PAINT	2.35 mg / cm ^2	Final	WALL EXTENSION	PLASTI	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1	1 < LOD	2.25 < LOD	0.14 < LOD	2.25	
22	10/17/2022 22:52 PAINT	1.02 mg / cm ^2	Final	WALL EXTENDER FRAME	METAL	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.9	
24	10/17/2022 22:54 PAINT	1.02 mg / cm ^2	Final	COMMODE	CERAMIC	D	FAIR	WHITE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.27	1 < LOD	0.45 < LOD	0.45 < LOD	7.65	
26	10/17/2022 22:55 PAINT	3.21 mg / cm ^2	Final	COMMODE	CERAMIC	D	FAIR	WHITE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.59	1	0.7	0.2	0.7	2.1
27	10/17/2022 22:56 PAINT	1.9 mg / cm ^2	Final	COMMODE	CERAMIC	D	FAIR	WHITE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.55	1	0.6	0.3	0.6	4.2
28	10/17/2022 22:57 PAINT	1.03 mg / cm ^2	Final	DOOR FRAME	WOOD	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	2.08	1 < LOD	0.28 < LOD	0.28 < LOD	3.45	
29	10/17/2022 22:57 PAINT	1.03 mg / cm ^2	Final	DOOR	WOOD	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1	1 < LOD	0.06 < LOD	0.06 < LOD	3.98	
30	10/17/2022 22:58 PAINT	1.02 mg / cm ^2	Final	DOOR JAMB	METAL	D	FAIR	BRAS	BLDG.A	JSST	FOURTH	T142	women rr	Negative	1.95	1 < LOD	0.08 < LOD	0.08 < LOD	4.8	
31	10/17/2022 22:59 PAINT	1.46 mg / cm ^2	Final	ENTRY WAY	WOOD	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	2.35	1 < LOD	0.4 < LOD	0.4 < LOD	2.55	
32	10/17/2022 22:59 PAINT	1.6 mg / cm ^2	Final	ENTRY WAY	WOOD	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	2.41	1 < LOD	0.4 < LOD	0.4 < LOD	2.4	
33	10/17/2022 23:00 PAINT	1.61 mg / cm ^2	Final	ENTRY WAY	WOOD	UPPER	FAIR	BEIGE	BLDG.A	JSST	FOURTH	T142	women rr	Negative	2.45	1 < LOD	0.4 < LOD	0.4 < LOD	2.25	
44	10/18/2022 0:44 PAINT	1.02 mg / cm ^2	Final	COMMODE	CERAMIC TILE	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.06 < LOD	0.06 < LOD	7.03	
45	10/18/2022 0:44 PAINT	1.02 mg / cm ^2	Final	COMMODE	CERAMIC TILE	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.06 < LOD	0.06 < LOD	7.35	
46	10/18/2022 0:45 PAINT	1.03 mg / cm ^2	Final	COMMODE	CERAMIC TILE	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1.05	1 < LOD	0.1 < LOD	0.1 < LOD	7.2	
47	10/18/2022 0:46 PAINT	1.02 mg / cm ^2	Final	URINAL	CERAMIC	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.06 < LOD	0.06 < LOD	6.7	
48	10/18/2022 0:46 PAINT	1.02 mg / cm ^2	Final	URINAL	CERAMIC	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.08 < LOD	0.08 < LOD	7.35	
49	10/18/2022 0:46 PAINT	1.03 mg / cm ^2	Final	URINAL	CERAMIC	B	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1.17	1 < LOD	0.14 < LOD	0.14 < LOD	7.2	
51	10/18/2022 0:47 PAINT	1.02 mg / cm ^2	Final	WASH STAND	CERAMIC	C	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1.26	1 < LOD	0.11 < LOD	0.11 < LOD	6.34	
52	10/18/2022 0:47 PAINT	1.02 mg / cm ^2	Final	WASH STAND	CERAMIC	C	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1.27	1 < LOD	0.35 < LOD	0.35 < LOD	6.33	
53	10/18/2022 0:48 PAINT	1.03 mg / cm ^2	Final	WASH STAND	CERAMIC	C	FAIR	WHITE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	2.33	1 < LOD	0.42 < LOD	0.42 < LOD	6.72	
56	10/18/2022 0:49 PAINT	1.02 mg / cm ^2	Final	STALL WALL	PLASTIC	B	FAIR	BLUE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.31	
57	10/18/2022 0:50 PAINT	1.03 mg / cm ^2	Final	STALL WALL	PLASTIC	A	FAIR	BLUE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	5.15	
58	10/18/2022 0:50 PAINT	1.02 mg / cm ^2	Final	STALL WALL	PLASTIC	C	FAIR	BLUE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.33	
59	10/18/2022 0:50 PAINT	1.6 mg / cm ^2	Final	STALL WALL	PLASTIC	B	FAIR	BLUE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	7.75	1 < LOD	0.23 < LOD	0.23 < LOD	3.03	
60	10/18/2022 0:51 PAINT	1.02 mg / cm ^2	Final	DOOR	PLASTIC	C	FAIR	BLUE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.23	
61	10/18/2022 0:52 PAINT	1.02 mg / cm ^2	Final	STALL WALL	PLASTIC	B	FAIR	BLUE	BLDG.A	JSST	FOURTH	T141	men rr	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.41	
62	10/18/2022 0:52 PAINT	1.02 mg / cm ^2	Final	STALL WALL	PLASTIC	D	FAIR	BLUE	BLDG.A	JSST	FOURTH	T141</								

23	10/18/2022 22:05 PAINT	1.02 mg / cm ^2	Final	DOOR CASING	METAL	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	SHRINK WRAP	STAIRWELL 1	Negative	1.82	1 < LOD	0.14 < LOD	0.14 < LOD	5.23
25	10/18/2022 22:08 PAINT	3.21 mg / cm ^2	Final	WALL	BRICK	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	TAPE AREA	COL D3	Negative	2.23	1 < LOD	0.04 < LOD	0.04 < LOD	1.93
26	10/18/2022 22:09 PAINT	1.02 mg / cm ^2	Final	WALL FOOTER	CONCRETE	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	TAPE AREA	COL D3	Negative	1.14	1 < LOD	0.16 < LOD	0.16 < LOD	6.15
27	10/18/2022 22:11 PAINT	3.04 mg / cm ^2	Final	PIPE	FIBERGLASS	D	FAIR	WHITE	BLDG.A	JSST	FOURTH	TAPE AREA		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	0.9
28	10/18/2022 22:12 PAINT	2.04 mg / cm ^2	Final	PIPE	METAL	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH	TAPE AREA		Negative	1.44	1 < LOD	0.04 < LOD	0.04 < LOD	1.8
32	10/18/2022 22:15 PAINT	1.46 mg / cm ^2	Final	PIPE	FIBERGLASS,	D	PEELING	WHITE	BLDG.A	JSST	FOURTH	TAPE AREA		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.51
33	10/18/2022 22:16 PAINT	3.05 mg / cm ^2	Final	PIPE	METAL	D	PEELING	BEIGE	BLDG.A	JSST	FOURTH	TAPE AREA		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.05
35	10/18/2022 22:31 PAINT	4.06 mg / cm ^2	Final	COLUMN 4E5	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	4.87	1 < LOD	0.09 < LOD	0.09 < LOD	1.5
36	10/18/2022 22:32 PAINT	3.34 mg / cm ^2	Final	COLUMN 4E5 ELECTRICAL BOX	METAL	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	10	1 < LOD	1.8 < LOD	0.45 < LOD	1.8
38	10/18/2022 22:34 PAINT	1.02 mg / cm ^2	Final	DOOR FRAME SHAFT	METAL	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	1	1 < LOD	0.05 < LOD	0.05 < LOD	3.75
39	10/18/2022 22:35 PAINT	1.02 mg / cm ^2	Final	COLUMN FOOTER 4E5	CONCRETE	A	PEELING	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	1	1 < LOD	0.09 < LOD	0.09 < LOD	5.94
40	10/18/2022 22:36 PAINT	1.02 mg / cm ^2	Final	COLUMN FOOTER 4E5	CONCRETE	B	PEELING	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	2.78	1 < LOD	0.71 < LOD	0.71 < LOD	6.26
42	10/18/2022 22:37 PAINT	3.06 mg / cm ^2	Final	COLUMN 4E5	BRICK	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	2.87	1 < LOD	0.09 < LOD	0.09 < LOD	1.75
44	10/18/2022 22:39 PAINT	3.2 mg / cm ^2	Final	COLUMN 4E5	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.68
45	10/18/2022 22:40 PAINT	1.02 mg / cm ^2	Final	COLUMN FOOTER 4E5	CONCRETE	C	CRACKED	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	1.64	1 < LOD	0.27 < LOD	0.27 < LOD	5.96
47	10/18/2022 22:42 PAINT	3.21 mg / cm ^2	Final	COLUMNF 4E5	BRICK	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH	BINDERY		Negative	1.31	1 < LOD	0.04 < LOD	0.04 < LOD	1.74
48	10/18/2022 22:43 PAINT	1.01 mg / cm ^2	Final	SAFETY RAILING	METAL	UPPER	FAIR	YELLOW	BLDG.A	JSST	FOURTH	BINDERY		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	6.6
49	10/18/2022 22:44 PAINT	1.02 mg / cm ^2	Final	WATER FOUNTAIN	METAL	D	FAIR	GRAY	BLDG.A	JSST	FOURTH	BINDERY		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.71
50	10/18/2022 22:44 PAINT	3.08 mg / cm ^2	Final	SINK	METAL	D	FAIR	GRAY	BLDG.A	JSST	FOURTH	BINDERY		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.77
52	10/18/2022 23:54 PAINT	3.78 mg / cm ^2	Final	WALL	CONCRETE	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.37
53	10/18/2022 23:57 PAINT	3.07 mg / cm ^2	Final	WALL MOLDING	WOOD	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	10	1 < LOD	1.92 < LOD	0.49 < LOD	1.92
55	10/18/2022 23:58 PAINT	3.05 mg / cm ^2	Final	WALL	DRYWALL	A	INTACT	WHITE	BLDG.A	JSST	FOURTH	RM A404		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.3
57	10/19/2022 0:00 PAINT	1.75 mg / cm ^2	Final	WALL	DRYWALL	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.77
59	10/19/2022 0:02 PAINT	3.06 mg / cm ^2	Final	WALL	CONCRETE	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	8	1 < LOD	1.95 < LOD	0.29 < LOD	1.95
61	10/19/2022 0:03 PAINT	6.55 mg / cm ^2	Final	WALL MOULDING	WOOD	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	10	1 < LOD	1.25 < LOD	0.19 < LOD	1.25
62	10/19/2022 0:05 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	WOOD	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.74
66	10/19/2022 0:08 PAINT	3.05 mg / cm ^2	Final	WALL	CONCRETE	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	4.42	1 < LOD	1.91 < LOD	0.13 < LOD	1.91
67	10/19/2022 0:09 PAINT	5.11 mg / cm ^2	Final	WALL MOLDING	WOOD	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	10	1 < LOD	1.52 < LOD	0.24 < LOD	1.52
68	10/19/2022 0:10 PAINT	6.11 mg / cm ^2	Final	WALL	CONCRETE	D	INTACT	WHITE	BLDG.A	JSST	FOURTH	RM A404		Negative	10	1 < LOD	1.07 < LOD	0.21 < LOD	1.07
69	10/19/2022 0:10 PAINT	3.06 mg / cm ^2	Final	WALL	CONCRETE	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.56
72	10/19/2022 0:12 PAINT	1.02 mg / cm ^2	Final	DOOR TRANSOM	WOOD	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	2.8
73	10/19/2022 0:12 PAINT	1.01 mg / cm ^2	Final	DOOR TRANSOM	WOOD	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	RM A404		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.72
75	10/19/2022 0:36 PAINT	3.2 mg / cm ^2	Final	COLUMN 4F5	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING		Negative	2.89	1 < LOD	0.05 < LOD	0.05 < LOD	1.61
77	10/19/2022 0:38 PAINT	1.03 mg / cm ^2	Final	COLUMN 4F5 FOOTER	CONCRETE	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING		Negative	1.63	1 < LOD	0.32 < LOD	0.32 < LOD	6
78	10/19/2022 0:39 PAINT	1.61 mg / cm ^2	Final	PIPE	FIBERGLASS	A	INTACT	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.33
79	10/19/2022 0:40 PAINT	1.02 mg / cm ^2	Final	PIPE	METAL	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTING		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.59
80	10/19/2022 0:42 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	METAL	A	INTACT	BROWN	BLDG.A	JSST	FOURTH	DIGITAL CUTTING		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.99
81	10/19/2022 0:43 PAINT	0.58 mg / cm ^2	Final	WINDOW CASING	CONCRETE	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F4		Positive	8.25	1 < LOD	42.75 < LOD	3.9 < LOD	42.75
84	10/19/2022 0:45 PAINT	3.2 mg / cm ^2	Final	WALL COL 4F4	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F4		Negative	2.59	1 < LOD	0.05 < LOD	0.05 < LOD	1.84
85	10/19/2022 0:46 PAINT	1.32 mg / cm ^2	Final	WALL COL 4F FOOTER	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F4		Negative	3.28	1 < LOD	0.6 < LOD	0.6 < LOD	5.08
86	10/19/2022 0:47 PAINT	2.77 mg / cm ^2	Final	WALL COL 4F4	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F4		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.92
87	10/19/2022 0:48 PAINT	2.19 mg / cm ^2	Final	PIPE	FIBERGLASS	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F4		Negative	1	1 < LOD	1.25 < LOD	0.04 < LOD	1.25
88	10/19/2022 0:48 PAINT	1.02 mg / cm ^2	Final	PIPE	METAL	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F4		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.84
90	10/19/2022 0:54 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	METAL	A	FAIR	GREEN	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F3		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.21
93	10/19/2022 0:57 PAINT	3.21 mg / cm ^2	Final	COLUMN 4F3	CONCRETE	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F3		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.85
94	10/19/2022 0:58 PAINT	1.02 mg / cm ^2	Final	COLUMN 4F3 FOOTER	CONCRETE	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F3		Negative	3.11	1 < LOD	0.9 < LOD	0.9 < LOD	5.28
95	10/19/2022 0:59 PAINT	0.44 mg / cm ^2	Final	PIPE	FIBERGLASS	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F3		Negative	10	1 < LOD	1.98 < LOD	0.44 < LOD	1.98
96	10/19/2022 0:59 PAINT	1.01 mg / cm ^2	Final	PIPE	METAL	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F3		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.46
98	10/19/2022 1:09 PAINT	3.2 mg / cm ^2	Final	COLUMN 4F2	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F2		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.65
99	10/19/2022 1:10 PAINT	1.03 mg / cm ^2	Final	COLUMN 4F2 FOOTER	CONCRETE	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F2		Negative	2.85	1 < LOD	0.48 < LOD	0.48 < LOD	5.73
100	10/19/2022 1:11 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	METAL	A	FAIR	BROWN	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F1		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.05
101	10/19/2022 1:12 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	METAL	A	FAIR	BROWN	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F1		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.91
106	10/19/2022 1:14 PAINT	3.21 mg / cm ^2	Final	COLUMN 4F1	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F1		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.84
107	10/19/2022 1:15 PAINT	1.02 mg / cm ^2	Final	PIPE	FIBERGLASS	A	FAIR	WHITE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F1		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.45
108	10/19/2022 1:15 PAINT	1.02 mg / cm ^2	Final	PIPE	METAL	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4F1		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.01
5	10/19/2022 20:52 PAINT	2.77 mg / cm ^2	Final	WALL	BRICK	B	FAIR	BEIGE	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.92
6	10/19/2022 20:54 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	WOOD	B	FAIR	BROWN	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.05 < LOD	0.05 < LOD	2.86
7	10/19/2022 20:54 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	WOOD	B	FAIR	BROWN	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	2.9
10	10/19/2022 20:56 PAINT	3.18 mg / cm ^2	Final	COLUMN 4E1	BRICK	B	FAIR	BEIGE	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	3.01	1 < LOD	0.06 < LOD	0.06 < LOD	1.84
12	10/19/2022 20:58 PAINT	1.01 mg / cm ^2	Final	PIPE	FIBERGLAS	B	FAIR	WHITE	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.08 < LOD	0.08 < LOD	2.04
13	10/19/2022 20:58 PAINT	1.01 mg / cm ^2	Final	PIPE	METAL	B	FAIR	BEIGE	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.14
14	10/19/2022 20:59 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	WOOD	B	FAIR	BROWN	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	3.16
15	10/19/2022 21:00 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	WOOD	B	FAIR	BROWN	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	3.06
17	10/19/2022 21:01 PAINT	1.46 mg / cm ^2	Final	WINDOW CASING	CONCRETE	B	FAIR	WHITE	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	3.36	1 < LOD	0.6 < LOD	0.6 < LOD	4.35
25	10/19/2022 21:08 PAINT	3.2 mg / cm ^2	Final	WALL	CONCRETE	B	FAIR	BEIGE	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1.17	1 < LOD	0.03 < LOD	0.03 < LOD	1.77
26	10/19/2022 21:10 PAINT	1.01 mg / cm ^2	Final	PIPE	FIBERGLASS	B	FAIR	WHITE	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.05 < LOD	0.05 < LOD	1.89
27	10/19/2022 21:11 PAINT	3.05 mg / cm ^2	Final	PIPE	METAL	B	FAIR	BEIGE	BDLG.A	JSST	FOURTH	DIGITAL CUTTIN\COL 4E1		Negative	1	1 < LOD	0.03 < LOD		

65	10/19/2022 22:05 PAINT	1.45 mg / cm ^2	Final	WALL	DRYWALL	C	INTACT	WHITE	BDLG.A	JSST	FOURTH	A409	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.42
66	10/19/2022 22:06 PAINT	1.61 mg / cm ^2	Final	PIPE	PIPE WRAP	B	INTACT	WHITE	BDLG.A	JSST	FOURTH	A409	Negative	1	1 < LOD	1.4 < LOD	0.05 < LOD	1.4
68	10/19/2022 22:07 PAINT	1.16 mg / cm ^2	Final	PIPE	METAL	B	INTACT	GRAY	BDLG.A	JSST	FOURTH	A409	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.38
69	10/19/2022 22:08 PAINT	1.02 mg / cm ^2	Final	DOOR FRAME	WOOD	C	INTACT	BROWN	BDLG.A	JSST	FOURTH	A409	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.94
70	10/19/2022 22:08 PAINT	1.02 mg / cm ^2	Final	DOOR	WOOD	C	INTACT	BROWN	BDLG.A	JSST	FOURTH	A409	Negative	1	1 < LOD	0.05 < LOD	0.05 < LOD	3.09
71	10/19/2022 22:09 PAINT	1.16 mg / cm ^2	Final	WALL	DRYWALL	D	INTACT	WHITE	BDLG.A	JSST	FOURTH	A409	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.78
73	10/19/2022 22:10 PAINT	1.02 mg / cm ^2	Final	DOOR	WOOD	D	INTACT	BROWN	BDLG.A	JSST	FOURTH	A409	Negative	1	1 < LOD	0.05 < LOD	0.05 < LOD	2.98
74	10/19/2022 22:11 PAINT	1.02 mg / cm ^2	Final	DOOR FRAME	METAL	D	INTACT	BROWN	BDLG.A	JSST	FOURTH	A409	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.66
75	10/19/2022 22:15 PAINT	1.02 mg / cm ^2	Final	SAFETY FOOTER	WOOD	B	INTACT	YELLOW	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.78
76	10/19/2022 22:16 PAINT	1.45 mg / cm ^2	Final	TRIM	WOOD	B	INTACT	YELLOW	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.3
77	10/19/2022 22:17 PAINT	1.45 mg / cm ^2	Final	WALL	DRYWALL	B	INTACT	WHITE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.14
78	10/19/2022 22:17 PAINT	1.31 mg / cm ^2	Final	WALL	DRYWALL	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.31
79	10/19/2022 22:18 PAINT	1.01 mg / cm ^2	Final	DOOR FRAME	DRYWALL	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.6
80	10/19/2022 22:19 PAINT	1.01 mg / cm ^2	Final	DOOR FRAME	METAL	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.46
81	10/19/2022 22:20 PAINT	1.02 mg / cm ^2	Final	DOOR	WOOD	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.05 < LOD	0.05 < LOD	3.75
82	10/19/2022 22:20 PAINT	1.01 mg / cm ^2	Final	WALL	METAL	A	INTACT	WHITE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.37
83	10/19/2022 22:21 PAINT	1.6 mg / cm ^2	Final	WALL	DRYWALL	A	INTACT	WHITE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.32
84	10/19/2022 22:21 PAINT	1.6 mg / cm ^2	Final	WALL	DRYWALL	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.54
85	10/19/2022 22:22 PAINT	1.02 mg / cm ^2	Final	DOOR FRAME	METAL	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	5.4
86	10/19/2022 22:23 PAINT	1.02 mg / cm ^2	Final	DOOR	WOOD	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.38
88	10/20/2022 0:29 PAINT	3.2 mg / cm ^2	Final	WALL	BRICK	A LOWER	INTACT	WHITE	BDLG.A	JSST	FOURTH	A407 ext	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.65
90	10/20/2022 0:32 PAINT	3.2 mg / cm ^2	Final	WALL	BRICK	A LOWER	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.5
91	10/20/2022 0:32 PAINT	1.31 mg / cm ^2	Final	WALL	DRYWALL	D	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.39
92	10/20/2022 0:33 PAINT	1.45 mg / cm ^2	Final	WALL	DRYWALL	B	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Negative	4.18	1 < LOD	0.13 < LOD	0.13 < LOD	2.7
93	10/20/2022 0:34 PAINT	1.89 mg / cm ^2	Final	WALL	DRYWALL	C	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.48
94	10/20/2022 0:34 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME	METAL	C	INTACT	BROWN	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.66
95	10/20/2022 0:35 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	METAL	B	INTACT	BROWN	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.44
96	10/20/2022 0:35 PAINT	1.02 mg / cm ^2	Final	DOOR FRAME	METAL	B	INTACT	BROWN	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.93
97	10/20/2022 0:36 PAINT	1.02 mg / cm ^2	Final	DOOR	METAL	B	INTACT	BROWN	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3
98	10/20/2022 0:37 PAINT	1.02 mg / cm ^2	Final	WALL EXT	DRYWALL	D	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.39
99	10/20/2022 0:37 PAINT	2.9 mg / cm ^2	Final	WALL EXT	DRYWALL	D	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.68
100	10/20/2022 0:38 PAINT	1.45 mg / cm ^2	Final	WALL EXT	WALL	A	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.29
101	10/20/2022 0:38 PAINT	2.61 mg / cm ^2	Final	WALL EXT	DRYWALL	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.74
102	10/20/2022 0:39 PAINT	2.03 mg / cm ^2	Final	WALL EXT	DRYWALL	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.07
103	10/20/2022 0:40 PAINT	1.01 mg / cm ^2	Final	WALL EXT	DRYWALL	B	INTACT	WHITE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.58
104	10/20/2022 0:40 PAINT	3.06 mg / cm ^2	Final	WALL EXT	DRYWALL	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.12
105	10/20/2022 0:41 PAINT	1.02 mg / cm ^2	Final	SAFETY GUIDE	WOOD	B	CRACKED	YELLOW	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.85
106	10/20/2022 0:41 PAINT	1.02 mg / cm ^2	Final	SAFETY GUIDE	WOOD	C	CRACKED	YELLOW	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3
107	10/20/2022 0:42 PAINT	1.02 mg / cm ^2	Final	SAFETY GUIDE	WOOD	D	CRACKED	YELLOW	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.29
108	10/20/2022 0:43 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME EXT	METAL	D	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	5.28
109	10/20/2022 0:43 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME EXT	METAL	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	6.05	1 < LOD	0.11 < LOD	0.11 < LOD	5.12
115	10/20/2022 1:06 PAINT	2.61 mg / cm ^2	Final	COLUMN 4B6	BRICK	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.42
116	10/20/2022 1:07 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B6	BRICK	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.7
117	10/20/2022 1:07 PAINT	3.21 mg / cm ^2	Final	COLUMN 4B6	BRICK	C	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.68
118	10/20/2022 1:08 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B6	BRICK	D	INTACT	BEIGE	BDLG.A	JSST	FOURTH	A408	Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.63
119	10/20/2022 1:09 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B6 FOOTER	BRICK	D	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.87	1 < LOD	0.5 < LOD	0.5 < LOD	5.7
120	10/20/2022 1:09 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B6 FOOTER	BRICK	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.26	1 < LOD	0.34 < LOD	0.34 < LOD	5.64
121	10/20/2022 1:10 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B6 FOOTER	BRICK	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.12	1 < LOD	0.16 < LOD	0.16 < LOD	5.23
122	10/20/2022 1:10 PAINT	3.21 mg / cm ^2	Final	COLUMN 4B6 FOOTER	BRICK	C	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.83
123	10/20/2022 1:11 PAINT	2.61 mg / cm ^2	Final	COLUMN 4B6 FOOTER	BRICK	D	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.92
128	10/20/2022 1:15 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B5	BRICK	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	2.08	1 < LOD	0.05 < LOD	0.05 < LOD	1.72
129	10/20/2022 1:15 PAINT	3.19 mg / cm ^2	Final	COLUMN 4B5	BRICK	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	2.82	1 < LOD	0.07 < LOD	0.07 < LOD	1.79
130	10/20/2022 1:16 PAINT	3.19 mg / cm ^2	Final	COLUMN 4B5	BRICK	C	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.53	1 < LOD	0.03 < LOD	0.03 < LOD	1.56
131	10/20/2022 1:16 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B5	BRICK	D	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.8
132	10/20/2022 1:17 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B5 FOOTER	BRICK	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.89	1 < LOD	0.37 < LOD	0.37 < LOD	5.4
133	10/20/2022 1:18 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B5 FOOTER	BRICK	C	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.5	1 < LOD	0.26 < LOD	0.26 < LOD	5.89
134	10/20/2022 1:19 PAINT	5.39 mg / cm ^2	Final	COLUMN 4B5 SINK	METAL	C	INTACT	GRAY	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.36
135	10/20/2022 1:19 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B5 DRINKING FOUNTAIN	METAL	C	INTACT	GRAY	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.45
143	10/20/2022 1:26 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B3	BRICK	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.5
144	10/20/2022 1:27 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B3	BRICK	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.37	1 < LOD	0.03 < LOD	0.03 < LOD	1.79
145	10/20/2022 1:27 PAINT	3.21 mg / cm ^2	Final	COLUMN 4B3	BRICK	C	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.74
146	10/20/2022 1:28 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B3 FOOTER	BRICK	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.96	1 < LOD	0.36 < LOD	0.36 < LOD	5.57
147	10/20/2022 1:28 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B3 FOOTER	BRICK	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1.45	1 < LOD	0.24 < LOD	0.24 < LOD	5.73
148	10/20/2022 1:29 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B4 SAFET RAILING	METAL	A	INTACT	YELLOW	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	6.36
150	10/20/2022 1:32 PAINT	3.21 mg / cm ^2	Final	COLUMN 4B2	BRICK	A	INTACT	WHITE	BDLG.A	JSST	FOURTH		Negative	4.34	1 < LOD	0.15 < LOD	0.15 < LOD	1.65
151	10/20/2022 1:33 PAINT	3.21 mg / cm ^2	Final	COLUMN 4B2	BRICK	B	INTACT	WHITE	BDLG.A	JSST	FOURTH		Negative	7.69	1 < LOD	0.3 < LOD	0.3 < LOD	1.68
152	10/20/2022 1:33 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B2	BRICK	C	INTACT	WHITE	BDLG.A	JSST	FOURTH		Negative	4.91	1 < LOD	0.24 < LOD	0.24 < LOD	1.5
153	10/20/2022 1:34 PAINT	0.58 mg / cm ^2	Final	COLUMN 4B2	BRICK	D	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	3.67	1 < LOD	41.4 < LOD	0.52 < LOD	41.4
154	10/20/2022 1:35 PAINT	0.58 mg / cm ^2	Final	COLUMN 4B2	BRICK	C	INTACT	WHITE	BDLG.A	JSST	FOURTH		Positive	8.23	1 < LOD	40.8 < LOD	2.55 < LOD	40.8
156	10/20/2022 1:36 PAINT	3.21 mg / cm ^2	Final	COLUMN 4B2	BRICK	A	INTACT	BEIGE	BDLG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.82

188	10/20/2022 1:58 PAINT	1.01 mg / cm ^2	Final	DOOR EXT	WOOD	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	RM 405			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.84		
189	10/20/2022 1:59 PAINT	1.3 mg / cm ^2	Final	WALL EXT	WOOD	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	RM 405			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.79		
190	10/20/2022 1:59 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME EXT	WOOD	B	INTACT	BEIGE	BDLG.A	JSST	FOURTH	RM 405			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.71		
191	10/20/2022 2:00 PAINT	2.32 mg / cm ^2	Final	WALL EXT	WOOD	C	INTACT	BROWN	BDLG.A	JSST	FOURTH	RM 405			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.3		
192	10/20/2022 2:01 PAINT	3.19 mg / cm ^2	Final	WALL EXT	WOOD	C	INTACT	BEIGE	BDLG.A	JSST	FOURTH	RM 405			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.28		
193	10/20/2022 2:02 PAINT	1.02 mg / cm ^2	Final	WALL EXT CORNER PROTECTOR	PLASTIC	C	INTACT	WHITE	BDLG.A	JSST	FOURTH	RM 405			Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	4.64		
5	10/20/2022 20:31 PAINT	2.63 mg / cm ^2	Final	WALL	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BILL CORNER	COL 4A7		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.06		
6	10/20/2022 20:32 PAINT	2.9 mg / cm ^2	Final	WALL FOOTER	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BILL CORNER	COL 4A7		Negative	2.43	1	0.7	0.3	0.7	0.3 < LOD	3.49
7	10/20/2022 20:39 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	METAL	B	INTACT	BROWN	BLDG.A	JSST	FOURTH	BILL CORNER	COL 4A3		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.43		
11	10/20/2022 20:42 PAINT	2.18 mg / cm ^2	Final	COLUMN 4A3	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BILL CORNER	COL 4A3		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.23		
15	10/20/2022 20:45 PAINT	2.18 mg / cm ^2	Final	COLUMN 4A5	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BILL CORNER	COL 4A3		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.47		
17	10/20/2022 20:47 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME	METAL	B	INTACT	BROWN	BLDG.A	JSST	FOURTH	BILL CORNER	COL 4A5		Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	2.66		
21	10/20/2022 20:56 PAINT	2.92 mg / cm ^2	Final	COLUMN 4B7	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.73		
23	10/20/2022 20:57 PAINT	2.9 mg / cm ^2	Final	WALL 4B8	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.4	1 < LOD	0.07 < LOD	0.07 < LOD	2.78		
28	10/20/2022 21:04 PAINT	2.32 mg / cm ^2	Final	COLUMN 4B10	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.13	1 < LOD	0.04 < LOD	0.04 < LOD	2.87		
29	10/20/2022 21:05 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B10	BRICK	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH				Negative	4.77	1 < LOD	0.12 < LOD	0.12 < LOD	1.81		
30	10/20/2022 21:05 PAINT	3.19 mg / cm ^2	Final	COLUMN 4B10	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.77		
31	10/20/2022 21:06 PAINT	3.21 mg / cm ^2	Final	COLUMN 4B10	BRICK	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.79		
33	10/20/2022 21:09 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B10 DOOR FRAME	METAL	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.52	1 < LOD	0.5 < LOD	0.5 < LOD	3.79		
34	10/20/2022 21:09 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B10 ELECTRICAL PANEL	METAL	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.96	1 < LOD	0.43 < LOD	0.43 < LOD	6.04		
35	10/20/2022 21:12 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B10 FOOTER	CONCRETE	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.23	1 < LOD	0.19 < LOD	0.19 < LOD	5.4		
38	10/20/2022 21:16 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B10 FOOTER	CONCRETE	C	PEELING	BEIGE	BLDG.A	JSST	FOURTH				Negative	4.36	1 < LOD	0.82 < LOD	0.82 < LOD	5.32		
39	10/20/2022 21:17 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B10 FOOTER	CONCRETE	D	PEELING	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.21	1 < LOD	0.39 < LOD	0.39 < LOD	5.91		
45	10/20/2022 21:37 PAINT	2.03 mg / cm ^2	Final	COLUMN 4B12	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Null	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.6		
46	10/20/2022 21:37 PAINT	2.89 mg / cm ^2	Final	COLUMN 4B12	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.86		
47	10/20/2022 21:38 PAINT	2.75 mg / cm ^2	Final	COLUMN 4B12	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.01		
48	10/20/2022 21:38 PAINT	2.33 mg / cm ^2	Final	COLUMN 4B12	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.2		
49	10/20/2022 21:39 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B12 FOOTER	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.96	1 < LOD	0.29 < LOD	0.29 < LOD	8.62		
50	10/20/2022 21:40 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B12 FOOTER	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.54	1 < LOD	0.3 < LOD	0.3 < LOD	5.85		
51	10/20/2022 21:41 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B12 FOOTER	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.2	1 < LOD	0.58 < LOD	0.58 < LOD	5.7		
59	10/20/2022 21:46 PAINT	1.6 mg / cm ^2	Final	COLUMN 4B13	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.9		
60	10/20/2022 21:47 PAINT	2.04 mg / cm ^2	Final	COLUMN 4B13	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.11		
61	10/20/2022 21:47 PAINT	2.89 mg / cm ^2	Final	COLUMN 4B13	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.02		
63	10/20/2022 21:48 PAINT	2.75 mg / cm ^2	Final	COLUMN 4B13	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.99	1 < LOD	0.06 < LOD	0.06 < LOD	2.82		
64	10/20/2022 21:49 PAINT	2.47 mg / cm ^2	Final	COLUMN 4B13	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.12		
65	10/20/2022 21:52 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B13 FOOTER	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	3.04	1 < LOD	0.4 < LOD	0.4 < LOD	6.29		
66	10/20/2022 21:53 PAINT	0.58 mg / cm ^2	Final	COLUMN 4B13 FOOTER	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Null	2.39	1 < LOD	0.44 < LOD	0.44 < LOD	10.1		
67	10/20/2022 21:53 PAINT	3.06 mg / cm ^2	Final	COLUMN 4B13 FOOTER	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	4.14	1 < LOD	0.31 < LOD	0.31 < LOD	2.55		
68	10/20/2022 21:55 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B13 FOOTER	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.53	1 < LOD	0.07 < LOD	0.07 < LOD	1.83		
69	10/20/2022 22:03 PAINT	0.72 mg / cm ^2	Final	COLUMN 4B14	BRICK	A	INTACT	WHITE	BLDG.A	JSST	FOURTH				Positive	10	1 < LOD	23.7 < LOD	4.65 < LOD	23.7		
74	10/20/2022 22:07 PAINT	3.63 mg / cm ^2	Final	COLUMN 4B14	BRICK	D	INTACT	WHITE	BLDG.A	JSST	FOURTH				Negative	7.53	1 < LOD	0.19 < LOD	0.19 < LOD	1.47		
75	10/20/2022 22:08 PAINT	2.76 mg / cm ^2	Final	COLUMN 4B14	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.03		
76	10/20/2022 22:09 PAINT	2.92 mg / cm ^2	Final	COLUMN 4B14	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.64	1 < LOD	0.05 < LOD	0.05 < LOD	2.66		
77	10/20/2022 22:09 PAINT	2.18 mg / cm ^2	Final	COLUMN 4B14	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.6	1 < LOD	0.09 < LOD	0.09 < LOD	3.34		
78	10/20/2022 22:10 PAINT	2.9 mg / cm ^2	Final	COLUMN 4B14	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.94		
79	10/20/2022 22:11 PAINT	2.76 mg / cm ^2	Final	COLUMN 4B14	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.43	1 < LOD	0.05 < LOD	0.05 < LOD	3.01		
82	10/20/2022 22:12 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B14 FOOTER	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.1	1 < LOD	0.48 < LOD	0.48 < LOD	6.01		
83	10/20/2022 22:13 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B14 FOOTER	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.71	1 < LOD	0.36 < LOD	0.36 < LOD	5.59		
84	10/20/2022 22:13 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B14 FOOTER	BRICK	D	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.52	1 < LOD	0.64 < LOD	0.64 < LOD	6.3		
87	10/20/2022 22:15 PAINT	1.16 mg / cm ^2	Final	COLUMN 4B14 RAILING	METAL	A	INTACT	YELLOW	BLDG.A	JSST	FOURTH				Negative	1.97	1	0.5	0.3	0.5	0.3 < LOD	5.55
93	10/20/2022 22:20 PAINT	3.18 mg / cm ^2	Final	COLUMN 4B15	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.92		
94	10/20/2022 22:21 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B15	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.96		
95	10/20/2022 22:21 PAINT	1.16 mg / cm ^2	Final	COLUMN 4B15	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	4.88		
96	10/20/2022 22:22 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B15 FOOTER	CONCRETE	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.42	1 < LOD	0.5 < LOD	0.5 < LOD	5.37		
97	10/20/2022 22:23 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B15 FOOTER	CONCRETE	A	INTACT	YELLOW	BLDG.A	JSST	FOURTH				Negative	3.64	1 < LOD	0.75 < LOD	0.75 < LOD	5.37		
98	10/20/2022 22:23 PAINT	1.15 mg / cm ^2	Final	COLUMN 4B15 FOOTER	METAL	A	INTACT	YELLOW	BLDG.A	JSST	FOURTH				Negative	3.23	1 < LOD	0.6 < LOD	0.6 < LOD	5.1		
99	10/20/2022 22:24 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B15 FOOTER	METAL	B	INTACT	YELLOW	BLDG.A	JSST	FOURTH				Negative	1.84	1 < LOD	0.75 < LOD	0.75 < LOD	7.36		
100	10/20/2022 22:24 PAINT	1.45 mg / cm ^2	Final	COLUMN 4B15 FOOTER	METAL	C	INTACT	YELLOW	BLDG.A	JSST	FOURTH				Negative	1.77	1	0.5	0.3	0.5	0.3 < LOD	5.43
101	10/20/2022 22:26 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B15 ELECTTICAL PANEL	METAL	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.2	1 < LOD	0.5 < LOD	0.5 < LOD	8.4		
102	10/20/2022 22:27 PAINT	1.03 mg / cm ^2	Final	COLUMN 4B15 SHAFT#3 DOOR FRAM	METAL	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	3.33		
104	10/20/2022 22:28 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B16 ELECTRICAL PANEL	METAL	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1.66	1 < LOD	0.43 < LOD	0.43 < LOD	6.03		
108	10/20/2022 22:32 PAINT	3.19 mg / cm ^2	Final	COLUMN 4B16	BRICK	A	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.92		
109	10/20/2022 22:32 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B16	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH				Negative	5.48	1 < LOD	0.24 < LOD	0.24 < LOD	1.9		
110	10/20/2022 22:33 PAINT	3.2 mg / cm ^2	Final	COLUMN 4B16	BRICK	D	POOR	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.87		
111	10/20/2022 22:34 PAINT	3.18 mg / cm ^2	Final	COLUMN 4B16	BRICK	C	POOR	BEIGE	BLDG.A	JSST	FOURTH				Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.95		
112	10/20/2022 22:35 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B16 FOOTER	CONCRETE	A	POOR	BEIGE	BLDG.A	JSST	FOURTH				Negative	2.02	1 < LOD	0.33 < LOD	0.33 < LOD	8.35		
113	10/20/2022 22:36 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B16 FOOTER	CON																	

151	10/21/2022 0:52 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B19 FOOTER	CONCRETE	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1.63	1 < LOD	0.27 < LOD	0.27 < LOD	6.3		
152	10/21/2022 0:52 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B19 FOOTER	CONCRETE	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.07 < LOD	0.07 < LOD	6.3		
153	10/21/2022 0:53 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B19 FOOTER	CONCRETE	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	3.39	1 < LOD	0.64 < LOD	0.64 < LOD	5.25		
155	10/21/2022 0:54 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B19 FOOTER	CONCRETE	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	3.7	1 < LOD	0.63 < LOD	0.63 < LOD	7.39		
156	10/21/2022 0:55 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B19 PLATFORM	CONCRETE	B	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	6.09		
158	10/21/2022 0:56 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B19 PLATFORM	CONCRETE	A	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	6.27		
159	10/21/2022 0:56 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B19 PLATFORM	CONCRETE	B	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	5.28		
160	10/21/2022 0:58 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B19 PLATFORM RAILING	METAL	A	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	6.15		
168	10/21/2022 1:07 PAINT	3.04 mg / cm ^2	Final	COLUMN 4B20	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.78		
169	10/21/2022 1:07 PAINT	3.04 mg / cm ^2	Final	COLUMN 4B20	BRICK	B	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.82		
170	10/21/2022 1:08 PAINT	3.18 mg / cm ^2	Final	COLUMN 4B20	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1.4	1 < LOD	0.03 < LOD	0.03 < LOD	1.85		
172	10/21/2022 1:09 PAINT	1.59 mg / cm ^2	Final	COLUMN 4B20 FOOTER	BRICK	A	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	2.2	1 < LOD	0.45 < LOD	0.45 < LOD	4.45		
174	10/21/2022 1:10 PAINT	3.91 mg / cm ^2	Final	COLUMN 4B20 FOOTER	METAL	A	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	2.8	1 < LOD	1.86	0.5	0.1 < LOD	1.86	
175	10/21/2022 1:10 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B20 FOOTER	METAL	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	2.45	1 < LOD	0.29 < LOD	0.29 < LOD	7.65		
176	10/21/2022 1:11 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B20 FOOTER	METAL	B	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	2.51	1 < LOD	0.21 < LOD	0.21 < LOD	8.7		
177	10/21/2022 1:12 PAINT	1.31 mg / cm ^2	Final	COLUMN 4B20 FOOTER	METAL	C	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	1.7	1 < LOD	0.45 < LOD	0.45 < LOD	5.39		
178	10/21/2022 1:12 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B20 FOOTER	METAL	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1.73	1 < LOD	0.27 < LOD	0.27 < LOD	7.61		
179	10/21/2022 1:13 PAINT	2.46 mg / cm ^2	Final	COLUMN 4B21	BRICK	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	2.36	1 < LOD	0.07 < LOD	0.07 < LOD	3.03		
180	10/21/2022 1:14 PAINT	3.18 mg / cm ^2	Final	COLUMN 4B21	BRICK	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	1.8		
182	10/21/2022 1:16 PAINT	2.17 mg / cm ^2	Final	COLUMN 4B21	BRICK	C	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1.5	1 < LOD	0.05 < LOD	0.05 < LOD	3.51		
183	10/21/2022 1:17 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B21 FOOTER	CONCRETE	A	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	2.42	1 < LOD	0.39 < LOD	0.39 < LOD	6.25		
184	10/21/2022 1:18 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B21 FOOTER	CONCRETE	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	2.47	1 < LOD	0.46 < LOD	0.46 < LOD	8.14		
185	10/21/2022 1:19 PAINT	1.01 mg / cm ^2	Final	COLUMN 4B21 IT JUNCTION BOX	METAL	D	FAIR	BEIGE	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.04 < LOD	0.04 < LOD	4.95		
186	10/21/2022 1:22 PAINT	1.02 mg / cm ^2	Final	COLUMN 4B21 IT SAFETY RAILING	METAL	A	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	1.76	1 < LOD	0.24 < LOD	0.24 < LOD	5.62		
187	10/21/2022 1:23 PAINT	2.62 mg / cm ^2	Final	COLUMN 4B21 SAFETY RAILING FOO	CONCRETE	A	FAIR	YELLOW	BLDG.A	JSST	FOURTH		Negative	1	1 < LOD	0.03 < LOD	0.03 < LOD	2.77		
5	10/23/2022 21:45 PAINT	3.17 mg / cm ^2	Final	WALL	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.95		
7	10/23/2022 21:48 PAINT	1.01 mg / cm ^2	Final	WALL FOOTER	CONCRETE	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	2.47	0.8 < LOD	0.5 < LOD	0.5 < LOD	7.31		
9	10/23/2022 21:49 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME	METAL	B	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	2.85		
11	10/23/2022 21:51 PAINT	1.01 mg / cm ^2	Final	WINDOW SILL	CONCRETE	B	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	3.06	0.8 < LOD	0.75 < LOD	0.75 < LOD	8.85		
13	10/23/2022 21:53 PAINT	3.48 mg / cm ^2	Final	COLUMN 4A10	BRICK	B	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1.04	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.67		
15	10/23/2022 21:54 PAINT	1.01 mg / cm ^2	Final	COLUMN 4A10 PIPE	FIBERGLASS	B	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.07 < LOD	0.07 < LOD	1.81		
16	10/23/2022 21:55 PAINT	2.18 mg / cm ^2	Final	COLUMN 4A10 PIPE	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.7		
18	10/23/2022 21:59 PAINT	3.9 mg / cm ^2	Final	COLUMN 4A11	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.62		
21	10/23/2022 22:01 PAINT	13.48 mg / cm ^2	Final	COLUMN 4A11 FOOTER	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	2.84	0.8	0.7	0.1	0.7	0.1 < LOD	0.9
22	10/23/2022 22:03 PAINT	1.02 mg / cm ^2	Final	COLUMN 4A11 PIPE	FIBERGLASSS	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.15		
23	10/23/2022 22:03 PAINT	1.89 mg / cm ^2	Final	COLUMN 4A11 PIPE	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.77		
24	10/23/2022 22:04 PAINT	1.01 mg / cm ^2	Final	SAFETY RAIL	METAL	C	INTACT	YELLOW	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	6.3		
25	10/23/2022 22:06 PAINT	1.16 mg / cm ^2	Final	SAFETY RAIL	METAL	C	INTACT	YELLOW	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A11	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	5.68	
26	10/23/2022 22:06 PAINT	1.02 mg / cm ^2	Final	SAFETY RAIL	METAL	C	INTACT	YELLOW	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A11	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	5.61	
27	10/23/2022 22:07 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	METAL	C	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A11	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	3.2	
28	10/23/2022 22:08 PAINT	1.02 mg / cm ^2	Final	WINDOW CASING	METAL	C	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A11	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	2.92	
29	10/23/2022 22:08 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME	METAL	C	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A11	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	2.68	
33	10/23/2022 22:22 PAINT	3.61 mg / cm ^2	Final	COLUMN 4A13	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1.38	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.69		
38	10/23/2022 22:26 PAINT	5.36 mg / cm ^2	Final	COLUMN 4A13 FOOTER	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	2.91	0.8	0.6	0.2	0.6	0.2 < LOD	1.5
39	10/23/2022 22:27 PAINT	1.29 mg / cm ^2	Final	COLUMN 4A13 PIPE	FIBERGLASS	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.44		
40	10/23/2022 22:28 PAINT	1.74 mg / cm ^2	Final	COLUMN 4A13 PIPE	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	2.32		
41	10/23/2022 22:29 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME	METAL	C	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A13	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.26	
45	10/23/2022 22:34 PAINT	3.19 mg / cm ^2	Final	COLUMN 4A14	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A13	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.96	
47	10/23/2022 22:35 PAINT	3.17 mg / cm ^2	Final	COLUMN 4A14 PIPE,	FIBERGLASS	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.72 < LOD	0.03 < LOD	0.72		
48	10/23/2022 22:36 PAINT	2.89 mg / cm ^2	Final	COLUMN 4A14 PIPE,	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.78		
49	10/23/2022 22:37 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME	METAL	C	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A14	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	2.81	
51	10/23/2022 22:39 PAINT	1.01 mg / cm ^2	Final	WINDOW CASING	WOOD	C	CRACKED	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A14	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	3.03	
52	10/23/2022 22:40 PAINT	1.15 mg / cm ^2	Final	RADIATOR	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A14	Negative	4.91	0.8 < LOD	0.67 < LOD	0.67 < LOD	5.74	
54	10/23/2022 22:43 PAINT	3.19 mg / cm ^2	Final	COLUMN 4A15	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	3.55	0.8 < LOD	0.07 < LOD	0.07 < LOD	1.73		
55	10/23/2022 22:44 PAINT	1.01 mg / cm ^2	Final	COLUMN 4A15 PIPE	FIBERGLASS	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	2.1		
56	10/23/2022 22:45 PAINT	2.46 mg / cm ^2	Final	COLUMN 4A15 PIPE	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.61		
58	10/23/2022 22:47 PAINT	1.02 mg / cm ^2	Final	WINDOW FRAME	WOOD	C	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A15	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	2.56	
59	10/23/2022 22:49 PAINT	1.01 mg / cm ^2	Final	SAFEY RAILING	METAL	C	INTACT	YELLOW	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A15	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	8.44	
61	10/23/2022 22:50 PAINT	3.19 mg / cm ^2	Final	SAFETY RAILING FOOTER	CONCRETE	C	INTACT	YELLOW	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A15	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.64	
63	10/24/2022 0:35 PAINT	3.17 mg / cm ^2	Final	COLUMN 4A17	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1.11	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.83		
64	10/24/2022 0:35 PAINT	3.18 mg / cm ^2	Final	COLUMN 4A17 FOOTER	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	2.85	0.8	0.6	0.2	0.6	0.2 < LOD	1.95
65	10/24/2022 0:36 PAINT	1.01 mg / cm ^2	Final	COLUMN 4A17 PIPE	FIBERGLASS	C	INTACT	WHITE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.78		
66	10/24/2022 0:37 PAINT	1.73 mg / cm ^2	Final	COLUMN 4A17 PIPE	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.99		
67	10/24/2022 0:37 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME	WOOD	C	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1	0.8 < LOD	0.05 < LOD	0.05 < LOD	2.97		
68	10/24/2022 0:38 PAINT	0.57 mg / cm ^2	Final	WINDOW CASING	CONCRETE	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A17	Positive	10	0.8 < LOD	42.15 < LOD	5.55 < LOD	42.15	
71	10/24/2022 0:41 PAINT	3.17 mg / cm ^2	Final	COLUMN 4A18	BRICK	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	1.59	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.61		
72	10/24/2022 0:42 PAINT	1.15 mg / cm ^2	Final	COLUMN 4A18 FOOTER	METAL	C	INTACT	BEIGE	BLDG.A	JSST	FOURTH	BINDRY AREA	Negative	3.07	0.8 < LOD	0.6 < LOD	0.6 < LOD	5.61		
73	10/24/2022 0:43 PAINT	1.01 mg / cm ^2	Final	WINDOW FRAME	WOOD	C	INTACT	BROWN	BLDG.A	JSST	FOURTH	BINDRY AREA	COL 4A18	Negative	1	0.8 &				

17	10/24/2022 21:50 PAINT	1.01 mg / cm ^2Final	RADIATOR COL 4C18	CONCRETE	A	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area		Negative	4.46	0.8 < LOD	0.52 < LOD	0.52 < LOD	8.24	
18	10/24/2022 21:51 PAINT	4.49 mg / cm ^2Final	COLUMN 4C18 FOOTER	CONCRETE	A	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area		Negative	3.44	0.8	0.15	0.09	0.15	1.5
20	10/24/2022 21:53 PAINT	7.51 mg / cm ^2Final	COLUMN 4C18 WALL	CONCRETE	LOWER	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area		Negative	3.68	0.8 < LOD	0.08 < LOD	0.08 < LOD	1.05	
23	10/24/2022 21:57 PAINT	3.18 mg / cm ^2Final	COLUMN 4C14	BRICK	A	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area		Negative	2.85	0.8 < LOD	0.08 < LOD	0.08 < LOD	1.69	
24	10/24/2022 21:58 PAINT	1.02 mg / cm ^2Final	COLUMN 4C14 FOOTER	CONCRETE	A	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area		Negative	1	0.8 < LOD	0.18 < LOD	0.18 < LOD	5.14	
25	10/24/2022 21:59 PAINT	1.01 mg / cm ^2Final	COLUMN 4C14 CABINET	WOOD	A	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area		Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	3.39	
30	10/24/2022 22:04 PAINT	2.89 mg / cm ^2Final	PIPE	FIBERGLASS	A	INTACT	WHITE	BLG.A	JSST	FOURTH	BINDERY Area	COL 4C14	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.19	
31	10/24/2022 22:05 PAINT	1.16 mg / cm ^2Final	PIPE	METAL	A	INTACT	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area	COL 4C14	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	2.18	
35	10/24/2022 22:09 PAINT	3.18 mg / cm ^2Final	COLUMN 4C12	BRICK	A	INTACT	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area	COL 4C12	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.83	
36	10/24/2022 22:11 PAINT	1.01 mg / cm ^2Final	COLUMN 4C12 FOOTER	METAL	A	INTACT	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area	COL 4C12	Negative	1	0.8 < LOD	0.15 < LOD	0.15 < LOD	7.65	
41	10/24/2022 22:16 PAINT	1.01 mg / cm ^2Final	RADIATOR	METAL	A	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area	COL 4C12	Negative	4.31	0.8 < LOD	0.42 < LOD	0.42 < LOD	7.83	
45	10/24/2022 22:23 PAINT	3.19 mg / cm ^2Final	COLUMN 4C10	BRICK	A	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area		Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.88	
51	10/24/2022 22:28 PAINT	3.18 mg / cm ^2Final	COLUMN 4C9	BRICK	A	FAIR	BEIGE	BLG.A	JSST	FOURTH	BINDERY Area		Negative	1.1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.68	
53	10/24/2022 22:33 PAINT	1 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4A21	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	4.29	
54	10/24/2022 22:34 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4A20	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	4.26	
55	10/24/2022 22:34 PAINT	1 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4A19	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.86	
56	10/24/2022 22:35 PAINT	1.02 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4A16	Negative	1.1	0.8 < LOD	0.09 < LOD	0.09 < LOD	4.18	
57	10/24/2022 22:36 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4A15	Negative	2.17	0.8 < LOD	0.22 < LOD	0.22 < LOD	4.35	
58	10/24/2022 22:36 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4A13	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	3.93	
59	10/24/2022 22:37 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4A11	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	3.81	
60	10/24/2022 22:38 PAINT	1.01 mg / cm ^2Final	FLOOR safety line	WOOD	LOWER	FAIR	YELLOW	BLG.A	JSST	FOURTH	BINDERY Area	4B12	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.36	
61	10/24/2022 22:39 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B12	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	5.52	
63	10/24/2022 22:40 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B13	Negative	1	0.8 < LOD	0.05 < LOD	0.05 < LOD	4.76	
64	10/24/2022 22:40 PAINT	1.01 mg / cm ^2Final	FLOOR safety line	WOOD	LOWER	FAIR	YELLOW	BLG.A	JSST	FOURTH	BINDERY Area	4B13	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	4.08	
65	10/24/2022 22:41 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B14	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.19	
66	10/24/2022 22:42 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B15	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.91	
67	10/24/2022 22:43 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B16	Negative	1	0.8 < LOD	0.05 < LOD	0.05 < LOD	4.09	
68	10/24/2022 22:43 PAINT	1.01 mg / cm ^2Final	FLOOR safety line	WOOD	LOWER	FAIR	YELLOW	BLG.A	JSST	FOURTH	BINDERY Area	4B16	Negative	1	0.8 < LOD	0.05 < LOD	0.05 < LOD	4.05	
69	10/24/2022 22:44 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B17	Negative	1	0.8 < LOD	0.05 < LOD	0.05 < LOD	4.2	
70	10/24/2022 22:46 PAINT	3.18 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	FAIR	GRAY	BLG.A	JSST	FOURTH	BINDERY Area	4B18	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.79	
72	10/24/2022 22:47 PAINT	3.17 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	FAIR	GRAY	BLG.A	JSST	FOURTH	BINDERY Area	4B19	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.82	
73	10/24/2022 22:49 PAINT	1 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C19	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.98	
74	10/24/2022 22:49 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C18	Negative	1	0.8 < LOD	0.06 < LOD	0.06 < LOD	4.22	
75	10/24/2022 22:50 PAINT	1 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C16	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.95	
76	10/24/2022 22:51 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C14	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.97	
77	10/24/2022 22:51 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C12	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	4.42	
78	10/24/2022 22:52 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C11	Negative	1	0.8 < LOD	0.06 < LOD	0.06 < LOD	4.27	
79	10/24/2022 22:53 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C10	Negative	1	0.8 < LOD	0.05 < LOD	0.05 < LOD	4.1	
80	10/24/2022 22:53 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C9	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	4.42	
81	10/24/2022 23:53 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C8	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.13	
82	10/24/2022 23:54 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4C7	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.96	
83	10/24/2022 23:55 PAINT	1.01 mg / cm ^2Final	FLOOR safety line	WOOD	LOWER	FAIR	YELLOW	BLG.A	JSST	FOURTH	BINDERY Area	4C7	Negative	1	0.8 < LOD	0.07 < LOD	0.07 < LOD	4.16	
84	10/24/2022 23:55 PAINT	1 mg / cm ^2Final	FLOOR safety line	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B7	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	4.24	
85	10/24/2022 23:56 PAINT	1.01 mg / cm ^2Final	FLOOR safety line	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B8	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	4.51	
86	10/24/2022 23:56 PAINT	1.01 mg / cm ^2Final	FLOOR safety line	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B9	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.07	
87	10/24/2022 23:58 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B9-4D7 passageway	Negative	1	0.8 < LOD	0.06 < LOD	0.06 < LOD	4.48	
88	10/24/2022 23:58 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B9-4D7 passageway	Negative	1	0.8 < LOD	0.11 < LOD	0.11 < LOD	4.46	
89	10/24/2022 23:59 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B9-4D7 passageway	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.35	
90	10/24/2022 23:59 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B9-4D7 passageway	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.8	
91	10/24/2022 23:59 PAINT	1 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BINDERY Area	4B9-4D7 passageway	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.01	
92	10/25/2022 0:02 PAINT	2.18 mg / cm ^2Final	FLOOR	ceramic tile	LOWER	FAIR	gray	BLG.A	JSST	FOURTH	T141 MEN RR		Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.75	
93	10/25/2022 0:03 PAINT	3.18 mg / cm ^2Final	FLOOR	ceramic tile	LOWER	FAIR	gray	BLG.A	JSST	FOURTH	T141 MEN RR		Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.78	
94	10/25/2022 0:04 PAINT	3.61 mg / cm ^2Final	FLOOR	ceramic tile	LOWER	FAIR	WHITE	BLG.A	JSST	FOURTH	T141 WOMEN RR		Negative	1.36	0.8 < LOD	0.03 < LOD	0.03 < LOD	1.49	
95	10/25/2022 0:06 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4B6	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.68	
96	10/25/2022 0:07 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4B5	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.23	
97	10/25/2022 0:07 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4B4	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	3.89	
98	10/25/2022 0:08 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4B3	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.75	
99	10/25/2022 0:08 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4B2	Negative	1	0.8 < LOD	0.07 < LOD	0.07 < LOD	4.05	
100	10/25/2022 0:10 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4A3	Negative	1.9	0.8 < LOD	0.18 < LOD	0.18 < LOD	4.35	
101	10/25/2022 0:10 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4A4	Negative	1	0.8 < LOD	0.05 < LOD	0.05 < LOD	4.16	
102	10/25/2022 0:11 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4A5	Negative	2.93	0.8 < LOD	0.33 < LOD	0.33 < LOD	3.82	
103	10/25/2022 0:11 PAINT	1 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4A6	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	4.3	
104	10/25/2022 0:12 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4A7	Negative	1	0.8 < LOD	0.04 < LOD	0.04 < LOD	3.9	
105	10/25/2022 0:28 PAINT	1.01 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4C3	Negative	1.75	0.8 < LOD	0.16 < LOD	0.16 < LOD	4.05	
106	10/25/2022 0:29 PAINT	1.02 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4C3	Negative	1	0.8 < LOD	0.06 < LOD	0.06 < LOD	4.5	
107	10/25/2022 0:29 PAINT	1.02 mg / cm ^2Final	FLOOR	WOOD	LOWER	FAIR	BROWN	BLG.A	JSST	FOURTH	BILL CORNER	4C3	Negative	1	0.8 < LOD	0.05 < LOD	0.05 < LOD	4.05	
4	10/25/2022 21:25 PAINT	1.73 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	INTACT	GRAY	BLDG.A	JSST	FIRST	BINDERY AREA	COL 4E2	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.96	
5	10/25/2022 21:26 PAINT	2.74 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	INTACT	GRAY	BLDG.A	JSST	FIRST	BINDERY AREA	COL 4E3	Negative	1	0.8 < LOD	0.03 < LOD	0.03 < LOD	3.22	
6	10/25/2022 21:27 PAINT	3.89 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	INTACT	GRAY	BLDG.A	JSST	FIRST	BINDERY AREA	COL 4E4							

27	10/25/2022 21:58 PAINT	5.2 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	INTACT	BLACK	BLDG.A	JSST	FIRST	COL 4E16	Negative	2.1	0.8	0.5	0.1	0.5	0.1 < LOD	1.52
28	10/25/2022 21:59 PAINT	5.48 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	INTACT	BLACK	BLDG.A	JSST	FIRST	COL 4E14	Negative	1.47	0.8	0.15	0.05	0.15	0.05 < LOD	1.35
29	10/25/2022 22:00 PAINT	3.17 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	INTACT	BLACK	BLDG.A	JSST	FIRST	COL 4E12	Negative	1.15	0.8 < LOD		0.03 < LOD		0.03 < LOD	1.73
30	10/25/2022 22:01 PAINT	3.17 mg / cm ^2Final	FLOOR	CONCRETE	LOWER	INTACT	BLACK	BLDG.A	JSST	FIRST	COL 4E10	Negative	1.23	0.8	0.06	0.04	0.06	0.04 < LOD	1.55