

Limited Hazardous Materials Survey

Building 2652

2652 Harney Path
JBSA – Fort Sam Houston, Texas 78234

Prepared for:

802 CES/CENME, Execution Support
2250 Engineer Street - Building 4196
JBSA - Fort Sam Houston, Texas 78234

Prepared by:

TTL, Inc.
17215 Jones Maltsberger Road, Suite 101
San Antonio, Texas 78247

Project No. 26-09-00191.00

March 11, 2026





17215 Jones Maltzberger Rd., Ste. 101
San Antonio, TX 78247
210.888.6100
www.TTLUSA.com

March 11, 2026

Mr. Eraldo David Martinez
802 CES/CENME, Execution Support (JBSA - 802 CES/CENME, EXECUTION SUPPORT)
2250 Engineer Street, Building 4196
JBSA - Fort Sam Houston, Texas 78234

P: 210.295.4727
E: eraldo.martinez@us.af.mil

RE: Limited Hazardous Materials Survey Report
Building 2652
2652 Harney Path
JBSA - Fort Sam Houston, Texas 78234
TTL Project No. 26-09-00382.00

Dear Mr. Martinez,

TTL, Inc. (TTL) is pleased to submit this Hazardous Materials Survey report for Building 2652 located at 2652 Harney Path, JBSA Fort Sam Houston, Texas, herein referred to as the "Site". It should be noted that that JBSA - Fort Sam Houston is considered a National Standards for Hazardous Air Pollutants (NESHAP) facility due to limited access to buildings and badging requirements.

Scope of Services

TTL was retained to conduct an asbestos-containing materials (ACM) survey, lead-based paint (LBP) inspection, a hazardous components survey, and a mold assessment.

The purpose of this survey was to determine the presence, quantity, and condition of suspect ACM, LBP, hazardous components, and mold growth located at the Site. The field work for the hazardous materials survey was conducted on February 10 and February 11, 2026.

Report

Laboratory results, sample location maps, and photographs are included in the appendices following the report. This report is divided into four (4) sections, which include ACM Survey, LPB Survey, Hazardous Components Survey, and a Mold Assessment. A photo log is provided in Appendix C. Applicable licenses or certifications are provided in Appendix D.

Limitations

Observations and sampling performed during this site assessment are likely to be reasonable assessment of the conditions in the areas assessed at the Site. Environmental measurements within a building can vary from day to day and represent a snapshot on the day and time of the assessment. This assessment did not include destructive sampling to check behind wallpaper, wall cavities or concealed areas for hazardous materials.

This report is intended for the sole use and benefit of JBSA - 802 CES/CENME, Execution Support and may not be relied upon by any other party without express permission of TTL.

TTL has no knowledge of any hidden or unapparent or adverse environmental conditions of the property, including the presence of hidden mold, hazardous wastes, toxic substances, etc. TTL makes

no guarantees or warranties, express or implied, regarding the condition of the property. This report is not an environmental assessment of the property.

This report and associated conclusions are based on the visible conditions of the inspected areas and materials. TTL reserves the right to revise opinions and conclusions if necessary and warranted by the discovery of new or additional circumstances. This report is specific and limited in nature and shall not be relied on as a statement that all Hazardous Materials have been identified and that more exists beyond the visibly accessible areas.

Closing

TTL appreciates the opportunity to provide environmental consulting services to JBSA - 802 CES/CENME, EXECUTION SUPPORT on this phase of the project. Should you have any questions, or require additional information regarding the Hazardous Materials Survey, please call us at your convenience.

Respectfully submitted,



Nicolas Espino
Project Professional
TDSHS Lead Risk Assessor 2071258
TDLR Mold Assessment Consultant MAC1943
TDSHS Asbestos Inspector 603646



Osanna Carrasco
Sr. Project Manager
TDSHS Lead Project Designer 2090091
TDLR Mold Assessment Consultant MAC1587

TABLE OF CONTENTS

1.0	ASBESTOS-CONTAINING MATERIAL SURVEY	4
1.1	Sampling Methods	4
1.2	Laboratory Analysis	4
1.3	Findings	8
1.4	Asbestos Recommendations.....	9
2.0	LEAD BASED PAINT SURVEY.....	10
2.1	Sampling Methods	10
2.2	Paint Chip Sample Summary.....	10
2.4	Lead Recommendations.....	12
3.0	LIMITED HAZARDOUS COMPONENTS SURVEY	13
3.1	Purpose and Scope.....	13
3.2	Polychlorinated Biphenyls	13
3.3	Mercury.....	13
4.0	LIMITED MOLD ASSESSMENT.....	15
4.1	LIMITED MOLD ASSESSMENT METHODS.....	15
4.1.1	Building Materials Moisture Assessment	15
4.1.2	Indoor Air Parameters.....	15
4.1.3	Bioaerosol Samples	15
4.2	MOLD ASSESSMENT FINDINGS.....	15
4.2.1	Visual Observations and Building Materials Moisture Assessment.....	15
4.2.2	Indoor Air Parameters.....	15
4.2.2	Bioaerosol Sample Results	16
4.3	MOLD ASSESSMENT CONCLUSIONS	17

APPENDIX A: SAMPLE LOCATION MAPS

APPENDIX B: LABORATORY RESULTS

APPENDIX C: SITE PHOTOGRAPHS

APPENDIX D: LICENSES AND CERTIFICATIONS

1.0 ASBESTOS-CONTAINING MATERIAL SURVEY

The limited asbestos survey was conducted on February 10 and February 11, 2026, by Texas Department of State Health Services (TDSHS)-licensed Asbestos inspectors Deborah Salahuddin (license number 603987), and Nicolas Espino (license number 603646).

1.1 Sampling Methods

TTL performed the limited asbestos inspection survey in general accordance with TDSHS Administrative Code Title 25, Part 1, Chapter 296, *Texas Asbestos Health Protection Rules* (TAHPR), as well as the United States Environmental Protection Agency (USEPA) National Standards for Hazardous Air Pollutants (NESHAP). Approximate quantities of suspect materials were estimated by field measurements. The condition (e.g., good, damaged, significantly damaged) and friability (i.e., easily crumbled, pulverized, or reduced to powder by hand pressure) of suspect ACM was noted for each material. The friability of each sampled material was determined by hand-touch.

- Surfacing materials, including spray-applied or troweled on wall/ceiling coatings,
- Thermal system insulation (TSI), including pipe insulation, duct insulation, boiler lagging and
- Miscellaneous materials, including ceiling panels/tiles, floor tiles and mastic, gaskets (if accessible), and wallboard/joint compound.

Suspected ACMs were grouped into homogeneous areas (i.e., a material that is uniform in texture, color, date of application, use or system, and appears identical in every other aspect). Homogeneous areas were determined by the TDSHS licensed Asbestos Inspector(s) based upon date of installation and uniformity or color and texture. Fiberglass, foam glass, rubber or wood products, plastic products, glass and steel were not sampled since they are not considered suspect ACM.

1.2 Laboratory Analysis

A total of one-hundred-eighty-nine (189) bulk samples were collected from the selected areas of the interior and exterior of the building. Samples were deposited in secure containers for transport to the analytical laboratory.

Bulk suspect asbestos samples were submitted under secure chain of custody and were analyzed utilizing Polarized Light Microscopy (PLM), following the USEPA PLM Method EPA-600/R-93/116. The bulk samples were analyzed by Moody Labs (Moody), in Farmers Branch, Texas. Moody is accredited by the National Institute of Standards and Technology National Voluntary Laboratory Accreditation Program (NVLAP No. 102056-0) and licensed by TDSHS (license number 300084).

A summary of TTL's asbestos sampling, including analytical results, sample number, material descriptions, sample locations, material condition, friability and estimated quantities is provided in Table 1 below.

TABLE 1: Asbestos Sample Results Summary Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234						
Sample No.	Suspect Material	Sample Location	Asbestos %	Estimated Quantities	Friability (F/NF)	Condition
1-01, 02, 03	Perlite Textured Drywall System	1st Floor – Lobby, Lounge, Storage	None Detected	1,000 SF	F	D
32-01, 02, 03	Black Cove Base / Mastic	1st Floor – Back Stage, Second Floor, Storage	M: 2% Chrysotile JC: 2% Chrysotile		NF	D
2-01, 02, 03	Orange Peel Textured Drywall System	1st Floor – Lounge Restroom, Back Stage	None Detected	N/A	F	D
3-01, 02, 03	Smooth Textured Drywall System	1st Floor – Storage	None Detected	N/A	F	D
4-01, 02, 03	Dimpled Textured Drywall System	1st Floor – Lobby	None Detected	N/A	F	G
5-01, 02, 03	Texture/Grout associated with Brick	1st Floor – Lounge, Back Stage	None Detected	N/A	NF	D
6-01, 02, 03	Texture/Grout associated with CMU	1st Floor – Lounge Restrooms	None Detected	N/A	NF	D
7-01, 02, 03	Texture on Concrete	1st Floor – Lounge, Back Stage, Box Office	None Detected	N/A	NF	G
8-01, 02, 03	Plaster Ceiling System	1st Floor – Kitchen, Dish Room	None Detected	N/A	F	SD
9-01, 02, 03	Drywall Ceiling System	1st Floor – Back Stage	JC / TX:2% Chrysotile	500 SF	F	D
10-01, 02, 03	1' x 1' Ceiling Tile with Fissures	1st Floor – Lounge, Box Office, Lobby	None Detected	N/A	F	SD
11-01, 02, 03	1' x 1' Ceiling Tile with Fissures	2nd Floor – West Hallway, Upstairs Lounge, Hallway at Stairwell	None Detected	N/A	F	SD
12-01, 02, 03	2' x 2' Ceiling Tile – with Long Fissures	1st Floor – Lounge Restrooms	None Detected	N/A	F	SD
13-01, 02, 03	2' x 2' Ceiling Tiles with Short Fissures	1st Floor – Lounge Restrooms	None Detected	N/A	F	SD
14-01, 02, 03	2' x 4' Ceiling Tiles with Long Fissures	1st Floor – Auditorium, Buffet, Set Prep	None Detected	N/A	F	SD
15-01, 02, 03	2' x 4' Ceiling Tiles with Short Fissures	1st Floor – Auditorium, Buffet, Set Prep	None Detected	N/A	F	SD
16-01, 02, 03	16" x 16" Ceiling Tiles	2nd Floor – Stairwell, NW & SW Storage Rooms	None Detected	N/A	F	SD
17-01, 02, 03	9" x 9" Dark Green Floor Tile with Black Mastic	1st Floor – Storage, Back Stage	FT: 3% Chrysotile M: 5% Chrysotile	250 SF	NF	D
18-01, 02, 03	9" x 9" Light Green Floor Tile with Black Mastic	1st Floor – Back Stage	FT: 3% Chrysotile M: 5% Chrysotile	250 SF	NF	D
19-01, 02, 03	9" x 9" Brown Floor Tile with Black Mastic	1st Floor – Back Stage	FT: 3% Chrysotile M: 5% Chrysotile	250 SF	NF	D

TABLE 1: Asbestos Sample Results Summary Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234						
Sample No.	Suspect Material	Sample Location	Asbestos %	Estimated Quantities	Friability (F/NF)	Condition
20-01, 02, 03	9" x 9" Tan Floor Tile with Black Mastic	1st Floor – Workspace, Set Prep	FT: 3% Chrysotile M: 5% Chrysotile	250 SF	NF	D
21-01, 02, 03	Carpet Mastic	1st Floor – Lounge, Auditorium, Box Office	5% Chrysotile	3,000 SF	NF	SD
22-01, 02, 03	Wall Fiberboard Panel	1st Floor – Storage Room, 2nd Floor - Furnace Room, Storage	None Detected	N/A	NF	SD
23-01, 02, 03	Pipe Insulation / Wrap	1st Floor – Storage Room	None Detected	N/A	F	SD
24-01, 02, 03	Fire Suppression System Gasket	1st Floor – Storage Room	None Detected	N/A	NF	G
25-01, 02, 03	White Mastic on HVAC Register	1st Floor – Set Prep, Buffet, Auditorium	None Detected	N/A	NF	D
26-01, 02, 03	1" x 1" Ceramic Floor Tile / Grout	1st Floor – Backstage Restrooms	None Detected	N/A	NF	SD
27-01, 02, 03	4" x 4" Gray Ceramic Wall Tile, Grout, & Adhesive	1st Floor – Backstage Restrooms	None Detected	N/A	NF	SD
28-01, 02, 03	4" x 4" Cream Ceramic Wall Tile, Grout & Thin set	1st Floor – Dish Room, Kitchen, Kitchen Hallway	TS: 2% Chrysotile	2,000 SF	NF	SD
29-01, 02, 03	6" x 6" Saltillo Red Floor Tile, Grout, & Thin set	1st Floor – Dish Room, Laundry, Kitchen	TS: 2% Chrysotile	1,500 SF	NF	SD
30-01, 02, 03	16" x 16" Off-white Ceramic Floor Tile, Grout, & Thin set	1st Floor – Buffet	None Detected	N/A	NF	D
31-01, 02, 03	Mastic Associated with Brown Cove base	1st Floor – Tech, Back Stage Restrooms	None Detected	N/A	NF	D
33-01, 02, 03	12" x 12" White Ceramic Floor Tile with Grout & Thin set	1st Floor – Lounge Bar	None Detected	N/A	NF	D
34-01, 02, 03	12" x 12" Red Ceramic Floor Tile with Grout & Thin set	1st Floor – Lounge Restrooms	None Detected	N/A	NF	D
35-01, 02, 03	Pipe Wrap / Insulation associated with Boiler	1st Floor – Kitchen & Laundry	10% Amosite 5% Chrysotile 65% Chrysotile	100 LF	F	D
36-01, 02, 03	Yellow Fiberglass Insulation Boiler Pipe Wrap	1st Floor – Kitchen & Laundry	None Detected	N/A	F	D
37-01, 02, 03	Perlite Textured Drywall System	2nd Floor – Hallway Women's Restroom	None Detected	N/A	F	G
38-01, 02, 03	Orange Peel Textured Drywall System	2nd Floor – Hallway, Furnace Room, Ladies Restroom	JC: 2% Chrysotile	3,000 SF	F	D

TABLE 1: Asbestos Sample Results Summary Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234						
Sample No.	Suspect Material	Sample Location	Asbestos %	Estimated Quantities	Friability (F/NF)	Condition
39-01, 02, 03	Tan Carpeted Wallpaper	2nd Floor – Upstairs Lounge	None Detected	N/A	NF	D
40-01, 02, 03	Green Wallpaper Drywall System	1st Floor – Stage Exit	None Detected	N/A	F	D
41-01, 02, 03	Vibration Dampener	2nd Floor – Furnace Room	None Detected	N/A	NF	G
42-01, 02, 03	Tan Mastic on HVAC	2nd Floor – Furnace Room	None Detected	N/A	NF	D
43-01, 02, 03	Pipe Wrap	2nd Floor – Furnace Room, Upstairs Lounge	None Detected	N/A	F	SD
44-01, 02, 03	12" x 12" Dark Grey Streaks VCT with Black Mastic	2nd Floor – Storage, Art Room, Office	FT: 3% Chrysotile M: 5% Chrysotile	500 SF	NF	D
45-01, 02, 03	12" x 12" Grey Speckled VCT with Black Mastic	2nd Floor – Men's Restroom	FT: 3% Chrysotile M: 5% Chrysotile	250 SF	NF	D
46-01, 02, 03	12" x 12" Tan VCT with Black Mastic	2nd Floor – Hallway, Hallway Storage, Props	FT: 3% Chrysotile M: 5% Chrysotile	750 SF	NF	D
47-01, 02, 03	12" x 12" Light Tan Speckled VCT with Yellow Mastic	2nd Floor – Hallway	None Detected	N/A	NF	D
48-01, 02, 03	9" x 9" Tan VCT with Black Mastic	2nd Floor – Hallway Storage	FT: 3% Chrysotile FT: 5% Chrysotile	250 SF	NF	D
49-01, 02, 03	White HVAC Duct Wrap / Insulation	2nd Floor – Storage, Office, Women's Restroom	None Detected	N/A	F	D
50-01, 02, 03	Texture & Grout associated with Brick	2nd Floor – Costumes, Men's Restroom, Women's Restroom	TX: 2% Chrysotile	3,000 SF	NF	D
51-01, 02, 03	Carpet Mastic	2nd Floor – Upstairs Lounge, Hallway, Women's Restroom	None Detected	N/A	NF	D
52-01, 02, 03	BUR Roofing Material	Low Slope Roof Section	None Detected	N/A	NF	SD
53-01, 02, 03	Gray/Black Roofing Mastic	Roof	5% Chrysotile	100 SF	NF	SD
54-01, 02, 03	Red Roofing Shingles	Roof	None Detected	N/A	NF	SD
55-01, 02, 03	Concrete Texture	Exterior – North Wall, East Wall, South Wall	None Detected	N/A	NF	D
56-01, 02, 03	Brick Texture & Grout	Exterior – North Wall, East Wall, South Wall	None Detected	N/A	NF	D
57-01, 02, 03	CMU Texture & Grout	Exterior – Behind Lounge Restrooms	None Detected	N/A	NF	D

TABLE 1: Asbestos Sample Results Summary Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234						
Sample No.	Suspect Material	Sample Location	Asbestos %	Estimated Quantities	Friability (F/NF)	Condition
58-01, 02, 03	Grey Window Caulking	Exterior – North Wall	None Detected	N/A	NF	D
59-01, 02, 03	Tan Window Caulking	Exterior – North Wall	None Detected	N/A	NF	D
60-01, 02, 03	Door Sealant	Exterior – Main Entrance	None Detected	N/A	NF	D
61-01, 02, 03	Pipe Wrap on HVAC / Insulation	Exterior – Behind Lounge Restrooms	None Detected	N/A	F	SD
62-01, 02, 03	Stucco	Exterior – North Wall	None Detected	N/A	NF	D
63-01, 02, 03	Window Glazing	Exterior – South Wall	None Detected	N/A	NF	D
LEGEND SF – Square Feet G – Good D – Damaged SD – Significantly Damaged PACM – Presumed Asbestos-Containing Materials VCT – Vinyl Composition Tile F – Friable NF – Non-Friable N/A – Not Applicable TS – Thin set FT – Floor Tile M – Mastic TX – Texture JC – Joint Compound						

1.3 Findings

The laboratory analytical results identified asbestos at 1% or greater in the following materials:

- Joint compound and texture associated with drywall ceiling system found back stage on the 1st floor.
- 9" x 9" dark green floor tile and black mastic found on 1st floor.
- 9" x 9" light green floor tile and black mastic found on 1st floor.
- 9" x 9" brown floor tile and black mastic found on 1st floor.
- 9" x 9" tan floor tile and black mastic found on 1st floor.
- Black mastic associated with carpet found on 1st floor.
- Brown mastic associated with black cove base on the 1st floor. It should be noted that a layer of joint compound was detected by the laboratory, therefore the perlite textured drywall system on the 1st floor is also considered ACM.
- Pipe wrap / insulation associated with Boiler found in kitchen and laundry.
- Joint compound associated with orange peel textured drywall system found on 2nd floor.
- 12" x 12" dark grey streaks VCT and black mastic found on 2nd floor.
- 12" x 12" grey speckled VCT and black mastic found on 2nd floor.
- 12" x 12" tan VCT and black mastic found on 2nd floor.
- 9" x 9" tan tiles and black mastic found on 2nd floor.
- Texture associated with brick found on 2nd floor
- Gray/black roofing mastic found on roof

A wrapped boiler was observed in the kitchen with a danger asbestos warning sign; therefore, the wrap is assumed to be ACM. The location of this boiler wrap was noted and included in the Site sample location map is provided in Appendix A. The laboratory report and chain of custody are provided in Appendix B.

1.4 Asbestos Recommendations

ACMs identified at the building that will be impacted by renovation or demolition should be removed and disposed of in accordance with federal, state, and local regulation, prior to disturbance. It is recommended that the asbestos abatement must be performed by a TDSHS licensed asbestos abatement contractor in accordance with a project design prepared by a TDSHS licensed asbestos consultant. In addition, third party air monitoring should be performed during the abatement. Prior to initiating an asbestos abatement project, written notification must be provided no later than 10 calendar days prior to starting abatement.

Contractors should use caution during construction related activities as concealed suspect ACM or other hazardous materials that were not previously analyzed may be encountered. If additional material, not previously sampled are later identified during construction related activities, then supplemental sample should be performed.

Materials that were noted as none-detected for asbestos may be disposed of as general construction debris.

2.0 LEAD BASED PAINT SURVEY

As part of the Hazardous Materials Survey, TTL representative Mr. Nicolas Espino, a Texas Department of State Health Services (TDSHS) certified Lead Risk Assessor (license number 2071258) conducted a lead-based paint (LBP) survey at the Site on February 10 and February 11, 2026.

2.1 Sampling Methods

The LBP sampling was conducted in general accordance with sampling guidelines and methodologies documented in the U.S. Department of Housing and Urban Development (HUD) *Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing*, Second Edition dated July 2012 and *EPA Lead: Requirements for Lead-Based Paint Activities in Target Housing and Child-Occupied Facilities*, dated August 1996. Paint chip sampling methods were utilized to complete this survey.

Lead-based paint (LBP) is defined as paint containing >1.0 milligrams per square centimeter (mg/cm²) as measured by >0.5% of lead by weight as analyzed by Atomic Absorption, for the purposes of renovation and/or demolition work. Occupational Safety and Health Administration (OSHA) defines LBP as any paint containing detectable amounts of lead.

The scope of work required a visual inspection and sampling of all painted surfaces from the Site. Paint chip samples were collected from painted areas throughout the Site.

2.2 Paint Chip Sample Summary

A total of forty-seven (47) paint chip samples were collected from painted areas at the Site. The samples were submitted to SanAir Technologies Laboratory, North Chesterfield, Virginia. The samples were analyzed for total lead utilizing EPA Method SW846/M3050B/7000B. A summary of the samples collected, and analytical results are presented in Table 2.

Table 2: Lead Based Paint Sample Results Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234				
Sample ID	Paint Color / Substrate	Sample Location	Lead Concentration % by Weight	Approximate Quantity (SF)
L-01	Tan Paint on Drywall	1st Floor Lobby	<0.009	N/A
L-02	Light Green Paint on Drywall	1st Floor - Lounge Storage	0.253	N/A
L-03	Dark Green Paint on Drywall	1st Floor - Lounge Storage	0.146	N/A
L-04	Light Green Paint on Brick Wall	1st Floor - Lounge Storage	0.461	N/A
L-05	Dark Green Paint on Brick Wall	1st Floor - Lounge Storage	0.176	N/A
L-06	Dark Green Paint on Wood Frame	1st Floor - Lounge Storage	0.300	N/A
L-07	Red Paint on Metal Stand Pipe	1st Floor - Lounge Storage	0.134	N/A
L-08	Light Green Paint on Metal Pipe	1st Floor - Lounge Storage	0.181	N/A
L-09	Dark Green Paint on Metal Pipe	1st Floor - Lounge Storage	0.265	N/A
L-10	Tan Paint on CMU Wall	1st Floor - Lounge Women's Restroom	<0.009	N/A
L-11	Tan Paint on Brick Wall	1st Floor - Lounge	<0.009	N/A
L-12	Black Paint on Drywall	1st Floor - Auditorium	<0.009	N/A

Table 2: Lead Based Paint Sample Results Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234				
Sample ID	Paint Color / Substrate	Sample Location	Lead Concentration % by Weight	Approximate Quantity (SF)
L-13	Black Paint on Wood Door Frame	1st Floor - Auditorium	<0.009	N/A
L-14	Cream Paint on Wood Door Frame	1st Floor - Auditorium	0.794	500 SF
L-15	Blue/Gray Paint on Concrete Floor	1st Floor - Auditorium	<0.009	N/A
L-16	Cream Paint on Plaster Ceiling	1st Floor - Kitchen	0.050	N/A
L-17	Red Paint on Drywall	1st Floor - Laundry	<0.009	N/A
L-18	White Paint on Drywall	1st Floor - Laundry	<0.009	N/A
L-19	Cream Paint on Metal Drain Pipe	1st Floor - Laundry	0.798	10 LF
L-20	Green Paint on Drywall	1st Floor - Buffet	<0.009	N/A
L-21	Red Paint on Wood Door	1st Floor - Auditorium Tech Booth	<0.009	N/A
L-22	White Paint on Brick Wall	1st Floor - Backstage Water Heater	0.327	N/A
L-23	Tan Paint on Concrete Column	1st Floor - Backstage	0.138	N/A
L-24	White Paint on Wood Door	1st Floor – Backstage Women’s	0.026	N/A
L-25	Green Paint on Concrete Column	1st Floor – Box office	0.073	N/A
L-26	Green Paint on Metal HVAC Duct	<0.008	<0.008	N/A
L-27	Black Paint on Concrete Column	1st Floor – Lounge	0.022	N/A
L-28	Brown Paint on Wood Door	2nd Floor - Costumes	<0.009	N/A
L-29	Pink Paint on Drywall	2nd Floor - Hallway	<0.009	N/A
L-30	Red Paint on Drywall	2nd Floor - Hallway	<0.008	N/A
L-31	Pink Paint on Metal Pipe	2nd Floor - Hallway	0.566	20 LF
L-32	Green Paint on Drywall	Stairwell	<0.008	N/A
L-33	Cream Paint on Wood Facia	Exterior West	<0.009	N/A
L-34	Cream Paint on CMU Wall	Exterior West	<0.009	N/A
L-35	Cream Paint on Brick Wall	Exterior North	3.758	3,000 SF
L-36	Cream Paint on Concrete Wall	Exterior North	<0.009	N/A
L-37	Black Paint on Metal Awning Framing	Exterior North	<0.009	N/A
L-38	Orange Paint on Stucco Wall	Exterior North	1.575	750 SF
L-39	Maroon Paint on Stucco Wall	Exterior North	0.015	N/A
L-40	Orange Paint on Brick Wall	Exterior North	3.439	5,000 SF
L-41	Maroon Paint on Brick Wall	Exterior North	2.050	5,000 SF

Table 2: Lead Based Paint Sample Results Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234				
Sample ID	Paint Color / Substrate	Sample Location	Lead Concentration % by Weight	Approximate Quantity (SF)
L-42	Cream Paint on Metal Downspout	Exterior East	0.128	N/A
L-43	Rust Brown Paint on Wood Door	Exterior East	<0.009	N/A
L-44	Rust Brown Paint on Metal Door	Exterior East	<0.009	N/A
L-45	Orange Paint on Metal Support Beam	1st Floor – Lounge	12.410	500 SF
L-46	Pink Paint on Brick Wall	2nd Floor - Costumes	0.438	N/A
L-47	Pink Paint on Concrete Wall	2nd Floor - Costumes	0.283	N/A

Laboratory analysis indicated that seven (7) of the forty-seven (47) samples collected from the Site indicated a concentration of lead of 0.5% concentration by weight or greater, as noted below:

- Cream paint on wood door frame (L-14)
- Cream paint on metal drain pipe (L-19)
- Pink paint on metal pipe (L-31)
- Cream paint on brick wall (L-35)
- Orange paint on stucco wall (L-38)
- Orange paint on brick wall (L-40)
- Maroon paint on brick wall (L-41)
- Orange paint on metal support beam (L-45)

Site sample location map is provided in Appendix A. The laboratory report and chain of custody are provided in Appendix B.

2.4 Lead Recommendations

Contractor(s) should be made aware of the results for LBP. LBP that is in poor or deteriorated condition or that is disturbed during renovation by dry sanding, scraping, brushing, or burning can produce dust with lead, which can be inhaled or enter the body from hand-to-mouth contact.

Prior to performing renovation or demolition activities, the contractor should be made aware of the presence of LBP or potential LBP particularly in the areas of observed damaged paint to satisfy the hazard communication requirements set forth by OSHA regulations. Specifically, the contractors should be required to comply with OSHA regulations including 29 CFR 1926.62, Lead Exposure in Construction: Interim Final Rule and 29 CFR 1926.59, Hazardous Communication for the Construction Industry.

If any renovation, repair or demolition activity will disturb the LBP, engineering controls such as barriers and water should be used to minimize dust levels. The public should be prevented from unauthorized access to the work area. Ambient air monitoring is recommended to document engineering controls are adequate and that the ambient airborne concentrations do not exceed the permissible exposure levels.

3.0 LIMITED HAZARDOUS COMPONENTS SURVEY

As part of this Hazardous Materials Survey, a Limited Hazardous Components Survey was conducted at the Site on February 10 and February 11, 2026.

3.1 Purpose and Scope

The purpose of the Hazardous Component Survey was to visually identify suspect hazardous components at the Site. This survey included identifying equipment that may contain Polychlorinated Biphenyls (PCBs) or Mercury that may be handled during renovation. These components may be subject to special handling for recycling or waste disposal prior to demolition activities. A hazardous component location map can be found in Appendix E.

3.2 Polychlorinated Biphenyls

PCBs are a class of man-made organic chemicals manufactured and used from the late 1920s until 1979 when the EPA banned its manufacture. PCBs are stable, resistant to acids and bases, have thermal stability, and fire resistance properties. These special properties led to widespread use of PCBs in industrial and commercial applications including electrical, heat transfer, hydraulic, and lighting equipment, caulks, paint, coatings, etc. The EPA regulates PCBs through several statutes, the most comprehensive of which is the Toxic Substances Control Act of 1976 codified in 40 CFR Part 761. This regulation governs the use, marking, storage, recording, and disposal of PCBs and PCB waste. In Texas, PCB waste is regulated by the Texas Commission on Environmental Quality (TCEQ) through 30 Texas Administrative Code (TAC) Chapter 335.

Fluorescent Lamp Ballasts

Fluorescent Lamp Ballasts (FLBs) manufactured prior to July 1, 1979 may contain PCBs. FLB manufactured between July 1, 1978 and July 1, 1998 that do not contain PCBs must be labeled “No PCBs”. If an FLB is not labeled “No PCBs”, it is best to assume it contains PCBs unless it is known to be manufactured after 1979. FLBs manufactured after 1998 are not required to be labeled.

To inspect a light fixture for the presence of PCBs, parts of the fixture were temporarily removed to expose the ballast (if present) and identify a “no PCBs” label. A photograph was taken for every newly encountered ballast before the fixture was reassembled. Details regarding the styles of fluorescent light fixtures identified are provided below.

Approximately 87 individual ceiling mounted FLBs were observed throughout the building. Approximately 10% of these fixtures were disassembled and the “No PCBs” label was observed.

Electric Transformers

Dielectric fluids in electrical transformers may contain PCBs. A pad mounted transformer was observed near the exterior on the west side of the building. The labels did not indicate the presence or absence of PCBs – additional investigation is required to determine the presence of PCBs in the dielectric fluids therein.

3.3 Mercury

Mercury is found in thermostats, switches, thermometers, compact fluorescent lamp (CFL) bulbs and fluorescent and high-intensity discharge lamps.

Approximately 87 of the ballasts at the Site were equipped with mercury containing fluorescent tube bulbs. Of the 87 ballasts observed, 70 of these lighting fixtures contained two (2) tube bulbs per ballast and 17 contained one (1) tube bulb per ballast. A total of 34 CFLs were observed throughout the interior of the building. They should be disposed of in accordance with applicable rules and regulations. All fluorescent bulbs must be disposed of as a Universal Waste at an EPA approved recycling facility prior to any renovation / demolition activities.

Three (3) mercury containing thermostats and three (3) electric thermostats were observed throughout the building. All thermostats must be disposed of as Universal Waste at an EPA approved recycling facility prior to any renovation / demolition activities.

3.4 Additional Hazardous Components

Approximately twelve (12) Illuminated exit signs were observed throughout the building. Approximately 10% of these fixtures were disassembled and they were found to contain Nickel-Cadmium rechargeable back-up batteries. These batteries must be disposed of as Universal Waste at an EPA approved recycling facility prior to any renovation / demolition activities.

4.0 LIMITED MOLD ASSESSMENT

As part of the Hazardous Materials Survey, On February 10 and February 11, 2026, TTL representative Mr. Nicolas Espino, a TDLR licensed Mold Assessment Consultant (MAC) completed a limited mold assessment and sampling of the Site area, which included the following.

4.1 LIMITED MOLD ASSESSMENT METHODS

TTL conducted a limited mold assessment in accordance with Texas Department of Licensing and Regulation (TDLR) *Texas Mold Assessors and Remediators Administrative Rules (TMARR)* as well as applicable portions of the Institute of Inspection, Cleaning and Restoration Certifications (IICRC) Standard and Reference Guide for Professional Water Damage Restoration, Fourth Addition and the American Society for Testing and Materials (ASTM) D7338-14 Standard Guide for Assessment of Fungal Growth in Buildings. The assessment included the following:

4.1.1 Building Materials Moisture Assessment

The relative moisture content (MC) of building materials potentially affected by moisture/water intrusion were measured by a moisture meter and or an infrared (IR) camera to identify temperature differentials that may be associated with wet building materials.

4.1.2 Indoor Air Parameters

TTL collected measurements of indoor relative humidity and temperature concentrations, as well as outdoors for comparison purposes utilizing a hand-held direct read instrument.

4.1.3 Bioaerosol Samples

Samples were collected in accordance with the American Council of Government Industrial Hygienist (ACGIH) protocol outlined in “Bioaerosols: Assessment and Control”. Samples were collected by drawing air across an adhesive material within a “spore trap” cassette. Ambient air is drawn over the spore trap using a high-volume vacuum pump, calibrated to draw 15 liters of air per minutes, for five minutes.

4.2 MOLD ASSESSMENT FINDINGS

4.2.1 Visual Observations and Building Materials Moisture Assessment

Areas of suspect water damage were observed in the 1st Floor lounge, auditorium, storage area, buffet room, kitchen, laundry room, dish room, and box office. As well as the 2nd floor lounge, storage area, office, men’s restroom, costume room, prop room, and furnace room. Visible mold growth was observed on the north wall of the furnace room.

Water damage and mold growth are likely due to roof leaks and a potential water intrusion event.

4.2.2 Indoor Air Parameters

The American Society of Heating, Refrigerating and Air Conditioning Engineers (ASHRAE) Standard 62.1-2016, *Ventilation for Acceptable Indoor Mold* recommends an indoor temperature of 68° Fahrenheit (F) to 74°F in the winter and 72°F to 80°F in the summer, and an indoor relative humidity (RH) level of <65% to reduce the likelihood of conditions that can lead to microbial growth. Table 3, found below, lists the conditions observed during the assessment.

Table 3: Indoor Air Parameters Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234		
Area / Location	Temperature °F	Relative Humidity (RH) %
Pre-assessment – Outdoor	59.9	53.7
1 st Floor – Lounge	65.6	58.9
1 st Floor – Auditorium	64.5	53.5
2 nd Floor Lounge	65.4	54.4

The RH readings taken throughout the Site showed RH was within normal range. The temperature throughout the building was below industry standards.

4.2.2 Bioaerosol Sample Results

Three (3) indoor spore trap samples were collected from the Site, and one (1) outdoor sample for comparison. Samples were submitted under chain of custody to Moody Labs (Moody) located in Farmers Branch, Texas. Moody is a TDLR license Mold Lab (LAB0117) and accredited by the American Industrial Hygiene Association (AIHA) (102577). Summary of sample results can be found on the table below:

Table 4: Air Spore Sample Results – Samples collected on February 11, 2026 Building 2652 2652 Harney Path JBSA – Fort Sam Houston, Texas 78234				
Sample ID.	OS-01	ST-01	ST-02	ST-03
Sample Location	Pre-Assessment Outdoor	1 st Floor – Lounge	1 st Floor – Auditorium	2 nd Floor – Lounge
Identification	Spores/m ³	Spores/m ³	Spores/m ³	Spores/m ³
Alternaria	27	107	67	
Ascospores	147	160	53	
Aspergillus / Penicillium	67	5714	800	133
Basidiospores	147	120	67	67
Chaetomium		107	13	
Cladosporium	253	1818	1493	560
Curvularia		53		
Dreschslera/Bipolaris /Helminthosporium / Exserohilum group		80	27	
Epicoccum			13	13
Ganoderma			27	
Hyphal / Spore Fragments - Dematiaceous	93	293	133	53
Myxomycete / Periconia / Rust / Smut	27	267	80	93
Spores/m³ Total	761	8719	2773	919

Laboratory results indicated higher levels of mold spores in the indoor samples of the building compared to the outdoor control samples.

Sample locations are found in Appendix A. Laboratory analysis results can be found in Appendix B.

4.3 MOLD ASSESSMENT CONCLUSIONS

Areas of suspect water damage were observed in the 1st Floor lounge, auditorium, storage area, buffet room, kitchen, laundry room, dish room, and box office, and the 2nd floor lounge, storage area, office, men's restroom, costume room, prop room, and furnace room. Visible mold growth was observed on the north wall of the furnace room.

The indoor spore trap samples of the building indicated higher levels of total mold spores compared to the outdoor comparison sample.

APPENDIX A
SAMPLE LOCATION MAPS


EXHIBIT
A-1

Drawn By: DS
Checked By: NE
Date: 02/13/2026
Scale: NOT TO SCALE
Proj. No.: 26-09-00382.00
File Name:


JBSA-Ft.Sam-B2652.dwg

**ASBESTOS CONTAINING MATERIALS
SAMPLE LOCATIONS**

HARLEQUIN THEATER - BUILDING 2652
2652 HARNEY PATH
JBSA - FORT SAM HOUSTON, TEXAS 78234

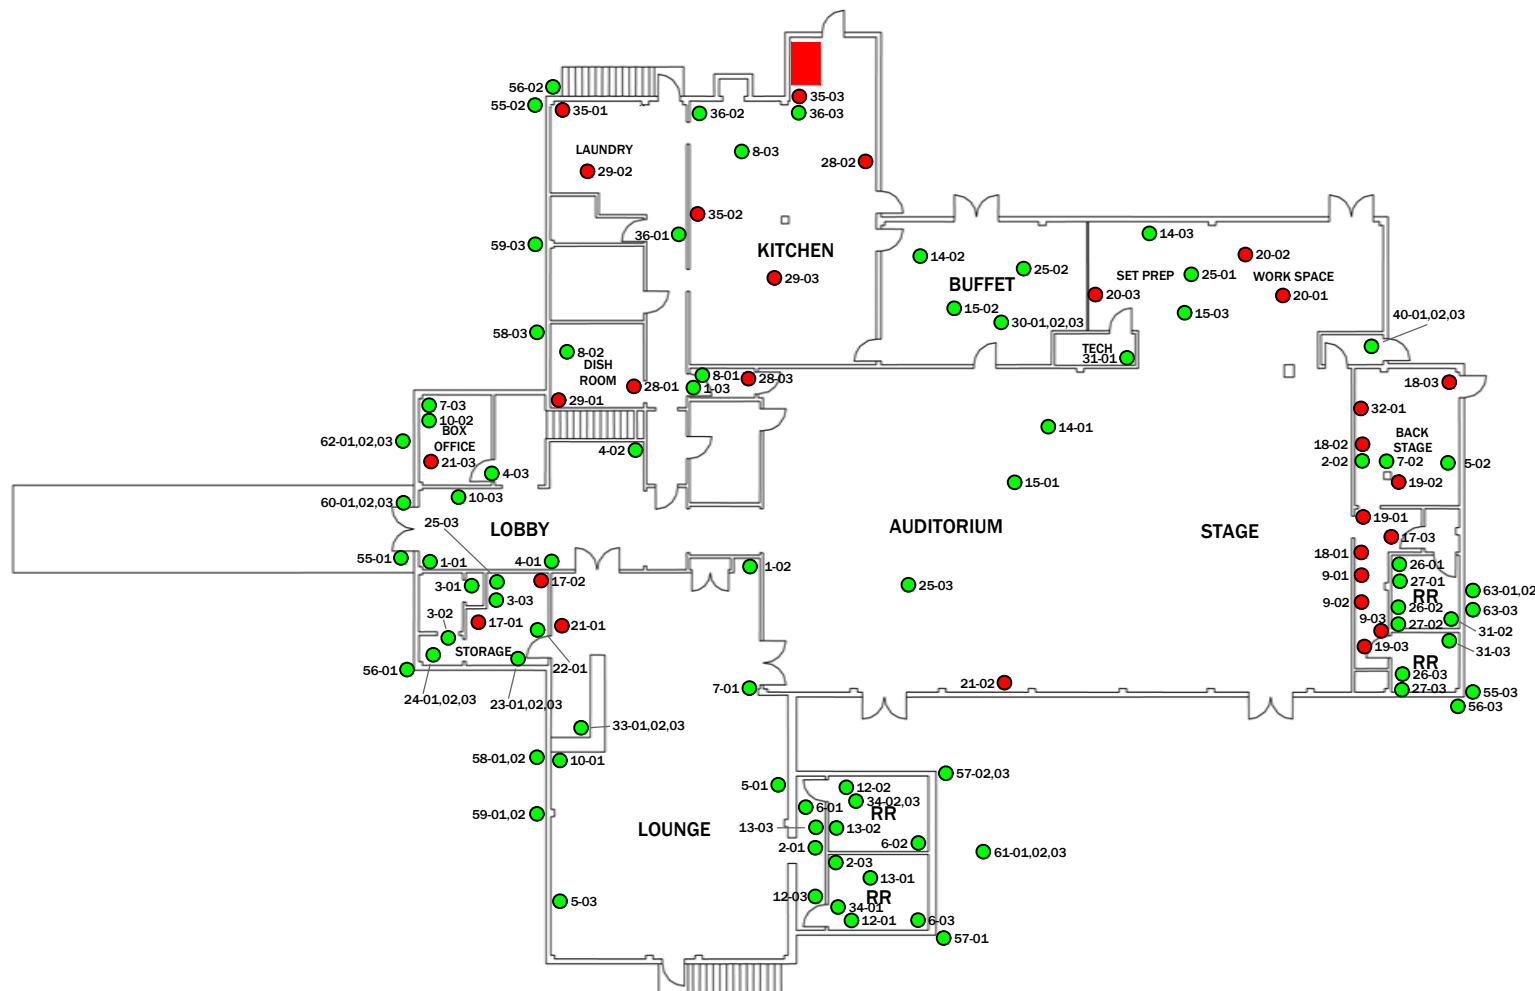

JBSF - 2652 / Floor: 1



LEGEND

- POSITIVE ASBESTOS CONTAINING MATERIALS SAMPLE LOCATION
- NEGATIVE ASBESTOS CONTAINING MATERIALS SAMPLE LOCATION
- BOILER WRAP LABELED AS ASBESTOS CONTAINING MATERIALS




17215 Jones Maltsberger Road
San Antonio, TX 78247
210.888.6100 | www.ttlusa.com
TBPE Firm Registration F-12622

EXHIBIT
A-2


Drawn By:	DS
Checked By:	NE
Date:	02/13/2026
Scale:	NOT TO SCALE
Proj. No.:	26-09-00382.00
File Name:	JBSA-Ft.Sam-B2652.dwg

**ASBESTOS CONTAINING MATERIALS
SAMPLE LOCATIONS**

HARLEQUIN THEATER - BUILDING 2652
2652 HARNEY PATH
JBSA - FORT SAM HOUSTON, TEXAS 78234

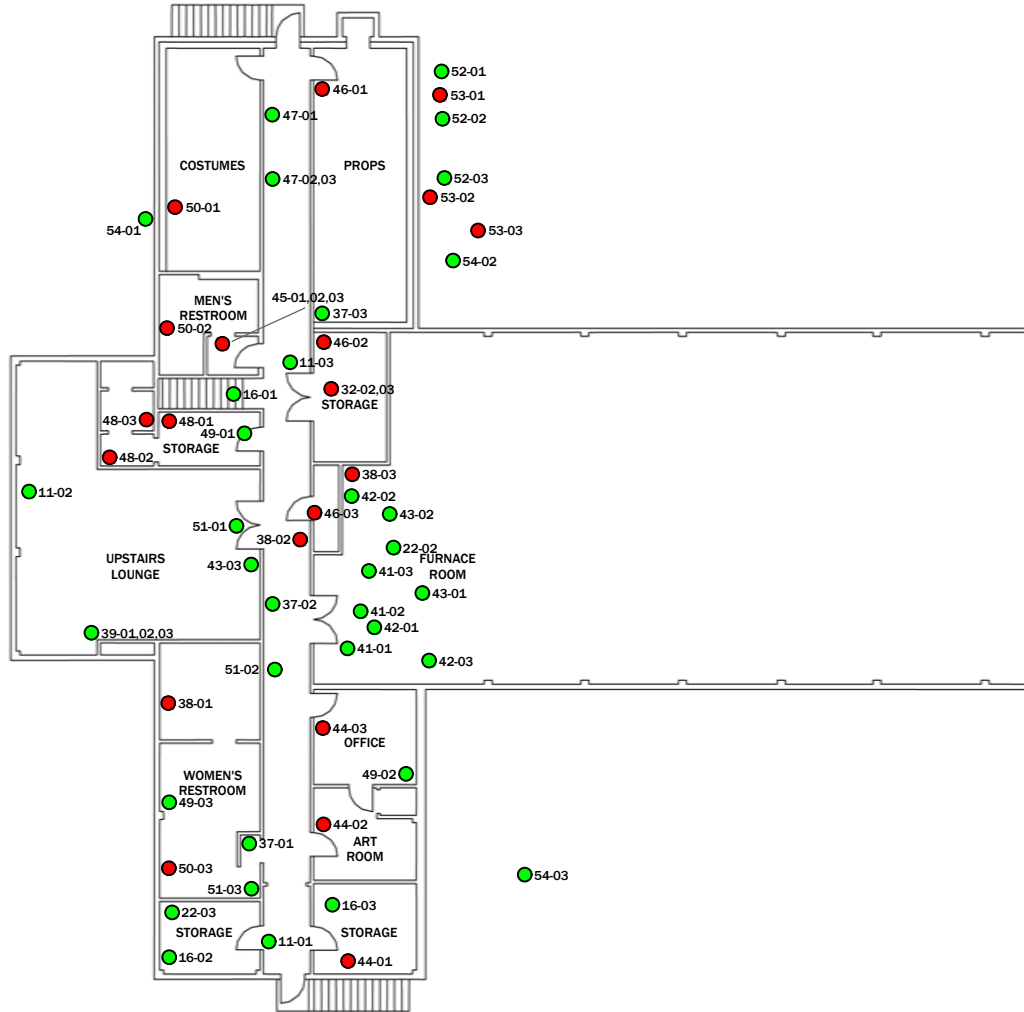

JBSF - 2652 / Floor: 2



LEGEND

- POSITIVE ASBESTOS CONTAINING MATERIALS SAMPLE LOCATION
- NEGATIVE ASBESTOS CONTAINING MATERIALS SAMPLE LOCATION



17215 Jones Maltsberger Road
San Antonio, TX 78247
210.888.6100 | www.ttlusa.com
TBPE Firm Registration F-12622


EXHIBIT
A-3

Drawn By: DS
Checked By: NE
Date: 02/13/2026
Scale: NOT TO SCALE
Proj. No.: 26-09-00382.00
File Name:


JBSA-Ft.Sam-B2652.dwg

**LEAD BASED PAINT SURVEY
SAMPLE LOCATIONS**

HARLEQUIN THEATER - BUILDING 2652
2652 HARNEY PATH
JBSA - FORT SAM HOUSTON, TEXAS 78234

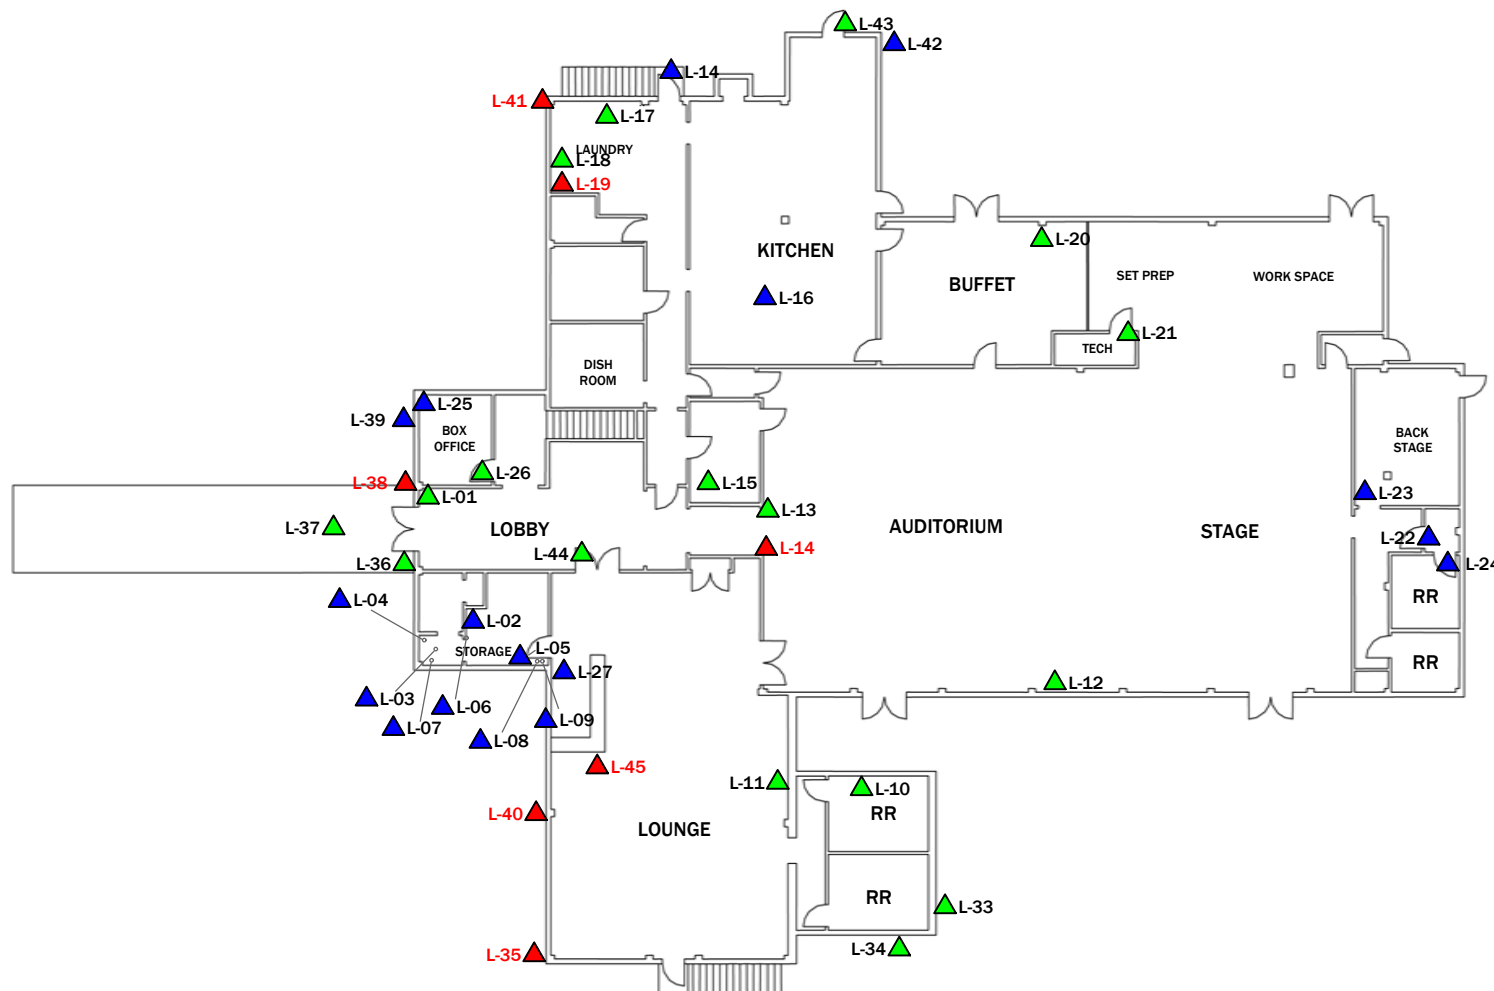

JBSF - 2652 / Floor: 1



LEGEND

- ▲ <10 ug REPORTING LIMIT FOR LEAD PAINT CHIP SAMPLE LOCATION
- ▲ <0.5% CONCENTRATION BY WEIGHT LBP SAMPLE LOCATION
- ▲ >0.5% CONCENTRATION BY WEIGHT LBP SAMPLE LOCATION



17215 Jones Maltsberger Road
San Antonio, TX 78247
210.888.6100 | www.ttlusa.com
TBPE Firm Registration F-12622

EXHIBIT
A-4

Drawn By: DS
 Checked By: NE
 Date: 02/13/2026
 Scale: NOT TO SCALE
 Proj. No.: 26-09-00382.00
 File Name:


JBSA-Ft.Sam-B2652.dwg

**LEAD BASED PAINT SURVEY
SAMPLE LOCATIONS**

HARLEQUIN THEATER - BUILDING 2652
 2652 HARNEY PATH
 JBSA - FORT SAM HOUSTON, TEXAS 78234



JBSF - 2652 / Floor: 2



LEGEND

- ▲ <10 ug REPORTING LIMIT FOR LEAD PAINT CHIP SAMPLE LOCATION
- ▲ <0.5% CONCENTRATION BY WEIGHT LBP SAMPLE LOCATION
- ▲ >0.5% CONCENTRATION BY WEIGHT LBP SAMPLE LOCATION



17215 Jones Maltsberger Road
 San Antonio, TX 78247
 210.888.6100 | www.ttlusa.com
 TBPE Firm Registration F-12622


EXHIBIT
A-5

Drawn By: DS
Checked By: NE
Date: 02/13/2026
Scale: NOT TO SCALE
Proj. No.: 26-09-00382.00
File Name:

JBSA-Ft.Sam-B2652.dwg

HAZARDOUS COMPONENTS SURVEY

HARLEQUIN THEATER - BUILDING 2652
2652 HARNEY PATH
JBSA - FORT SAM HOUSTON, TEXAS 78234

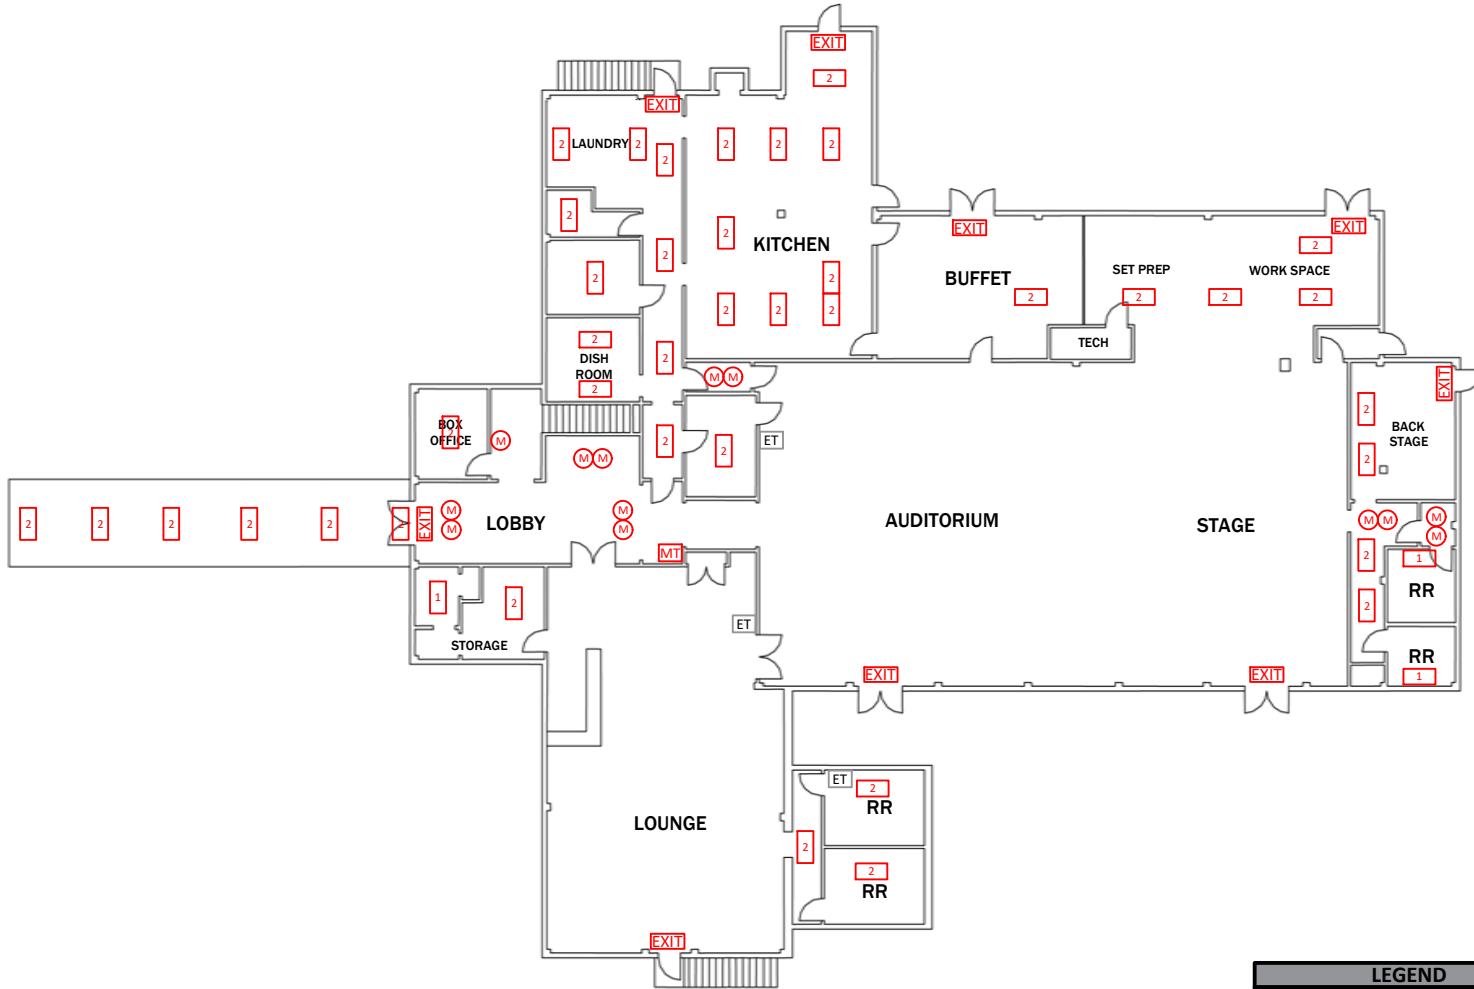

JBSF - 2652 / Floor: 1

10 5 0

LEGEND

- 2 NON-PCB LIGHTING BALLAST WITH TWO (2) MERCURY CONTAINING BULBS
- 1 NON-PCB LIGHTING BALLAST WITH ONE (1) MERCURY CONTAINING BULB
- M MERCURY CONTAINING CFL BULBS
- EXIT ILLUMINATED EXIT SIGN WITH NICKEL CADMIUM BATTERY
- MT MERCURY THERMOSTAT
- ET ELECTRONIC THERMOSTAT

TTL

17215 Jones Maltsberger Road
San Antonio, TX 78247
210.888.6100 | www.ttlusa.com
TBPE Firm Registration F-12622

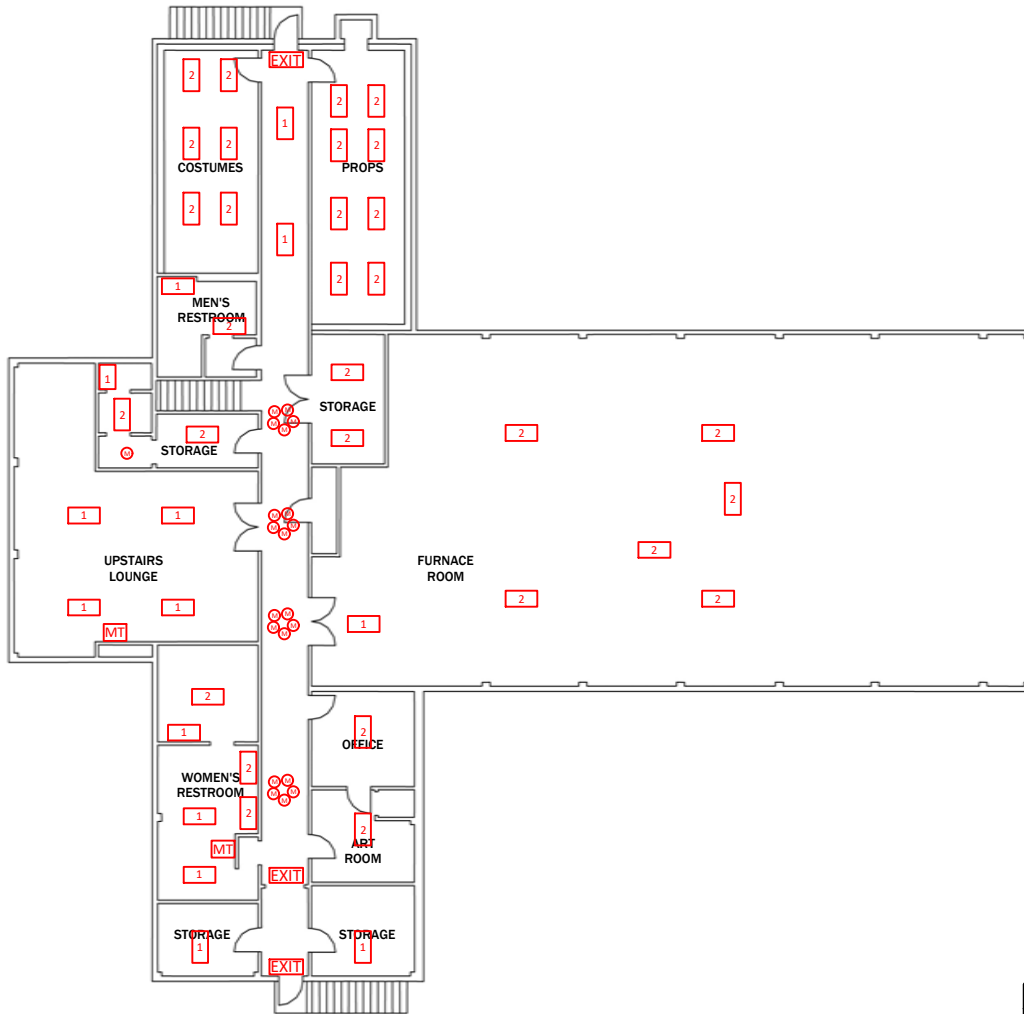


EXHIBIT
A-6


Drawn By: DS
 Checked By: NE
 Date: 02/13/2026
 Scale: NOT TO SCALE
 Proj. No.: 26-09-00382.00
 File Name: JBSA-Ft.Sam-B2652.dwg

HAZARDOUS COMPONENTS SURVEY

HARLEQUIN THEATER - BUILDING 2652
 2652 HARNEY PATH
 JBSA - FORT SAM HOUSTON, TEXAS 78234



JBSF - 2652 / Floor: 2



LEGEND

- 2 NON-PCB LIGHTING BALLAST WITH TWO (2) MERCURY CONTAINING BULBS
- 1 NON-PCB LIGHTING BALLAST WITH ONE (1) MERCURY CONTAINING BULB
- M MERCURY CONTAINING CFL BULBS
- EXIT ILLUMINATED EXIT SIGN WITH NICKEL CADMIUM BATTERY
- MT ELECTRONIC THERMOSTAT



17215 Jones Maltsberger Road
 San Antonio, TX 78247
 210.888.6100 | www.ttlusa.com
 TBPE Firm Registration F-12622

EXHIBIT
A-7

Drawn By: DS
 Checked By: NE
 Date: 02/13/2026
 Scale: NOT TO SCALE
 Proj. No.: 26-09-00382.00
 File Name:


JBSA-Ft.Sam-B2652.dwg

MOLD ASSESMENT SAMPLE LOCATION MAP


HARLEQUIN THEATER - BUILDING 2652
 2652 HARNEY PATH
 JBSA - FORT SAM HOUSTON, TEXAS 78234



17215 Jones Maltsberger Road
 San Antonio, TX 78247
 210.888.6100 | www.ttlusa.com
 TBPE Firm Registration F-12622

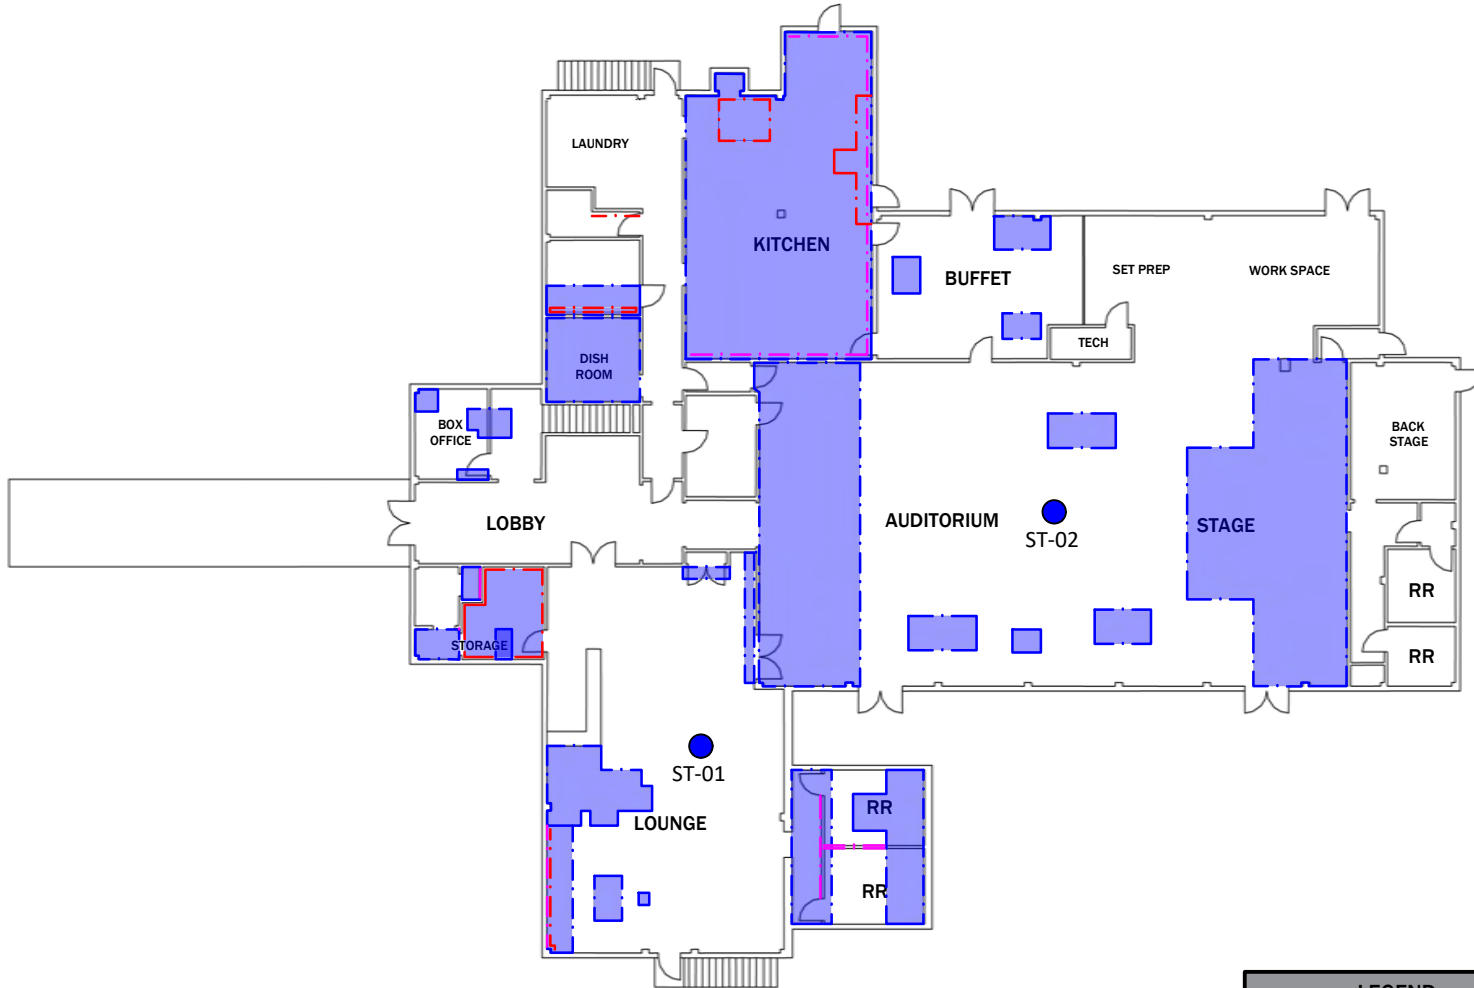

JBSF - 2652 / Floor: 1



LEGEND

- WATER DAMAGE ON FLOORS
- WATER DAMAGE ON CEILING
- WATER DAMAGE ON WALLS
- WATER DAMAGE LOCATIONS
- SPORE TRAP SAMPLE LOCATION

EXHIBIT
A-8


Drawn By: DS
Checked By: NE
Date: 02/13/2026
Scale: NOT TO SCALE
Proj. No.: 26-09-00382.00
File Name: JBSA-Ft.Sam-B2652.dwg

MOLD ASSESMENT SAMPLE LOCATION MAP

HARLEQUIN THEATER - BUILDING 2652
2652 HARNEY PATH
JBSA - FORT SAM HOUSTON, TEXAS 78234



17215 Jones Maltsberger Road
San Antonio, TX 78247
210.888.6100 | www.ttlusa.com
TBPE Firm Registration F-12622

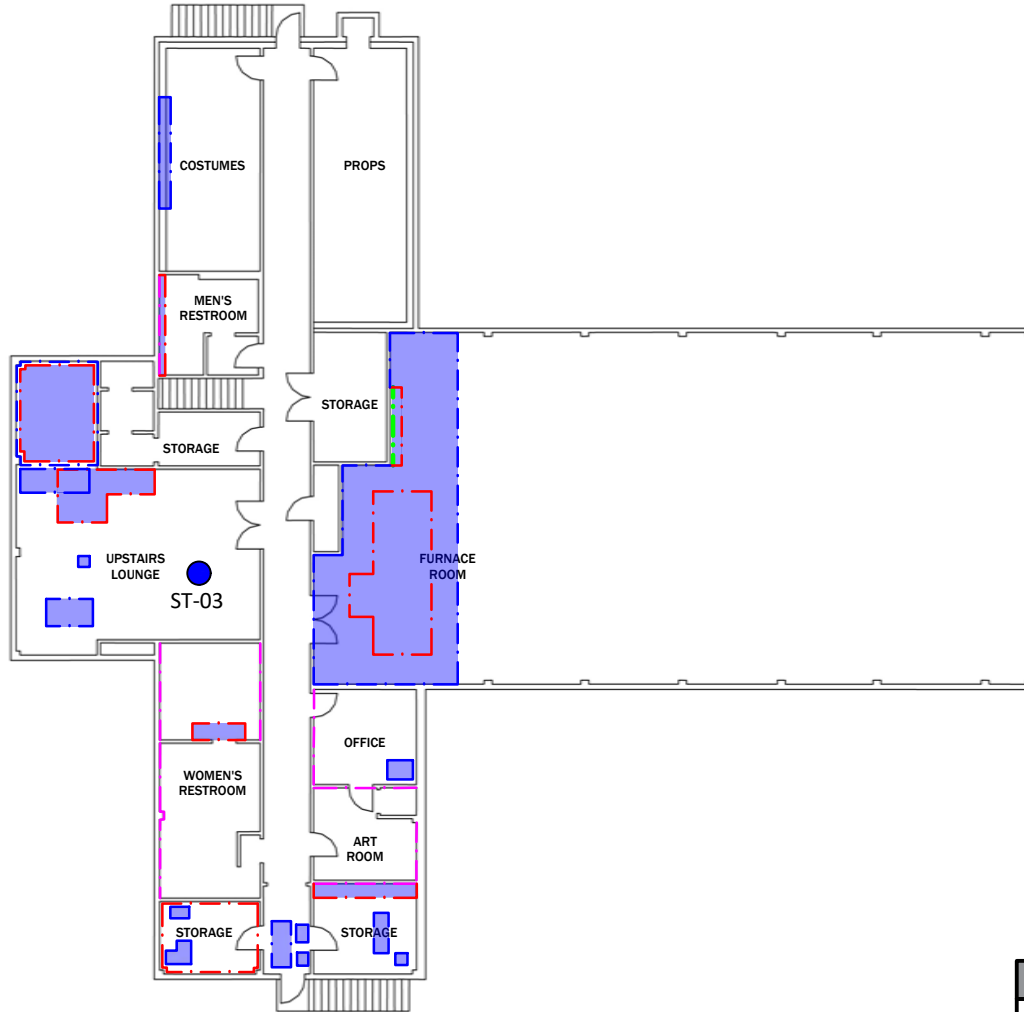

JBSF - 2652 / Floor: 2



LEGEND

- WATER DAMAGE ON FLOORS
- WATER DAMAGE ON CEILING
- WATER DAMAGE ON WALLS
- WATER DAMAGE LOCATIONS
- SPORE TRAP SAMPLE LOCATION

APPENDIX B
LABORATORY RESULTS



PLM Summary Report

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio
Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652
Project # : 26-09-00382.00
Identification : Asbestos, Bulk Sample Analysis
Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Lab Job No. : 26B-01624
Report Date : 02/19/2026
Sample Date : 02/10/2026 -
02/11/2026

Page 1 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
1-01	Textured Drywall System (Pearlite), 1st Floor, Lobby, Lounge, Storage	None Detected - Drywall Material None Detected - Joint Compound None Detected - Texture
1-02	Textured Drywall System (Pearlite), 1st Floor, Lobby, Lounge, Storage	None Detected - Drywall Material None Detected - Texture / Joint Cmpd
1-03	Textured Drywall System (Pearlite), 1st Floor, Lobby, Lounge, Storage	None Detected - Drywall Material None Detected - Joint Compound None Detected - Texture
2-01	Textured Drywall System (Orange Peel), 1st Floor, Lounge Restroom, Back Stage	None Detected - Drywall Material None Detected - Texture / Joint Cmpd
2-02	Textured Drywall System (Orange Peel), 1st Floor, Lounge Restroom, Back Stage	None Detected - Drywall Material None Detected - Joint Compound None Detected - Texture
2-03	Textured Drywall System (Orange Peel), 1st Floor, Lounge Restroom, Back Stage	None Detected - Drywall Material None Detected - Joint Compound None Detected - Texture
3-01	Textured Drywall System (Smooth), 1st Floor, Storage	None Detected - Drywall Material No Texture None Detected - Paint
3-02	Textured Drywall System (Smooth), 1st Floor, Storage	None Detected - Drywall Material No Texture None Detected - Paint
3-03	Textured Drywall System (Smooth), 1st Floor, Storage	None Detected - Drywall Material No Texture None Detected - Paint
4-01	Textured Drywall System (Dimpled), 1st Floor, Lobby	None Detected - Drywall Material None Detected - Joint Compound None Detected - Wall Covering
4-02	Textured Drywall System (Dimpled), 1st Floor, Lobby	No Drywall Material None Detected - Joint Compound None Detected - Wall Covering



PLM Summary Report

NVLAP Lab Code 102056-0

2051 Valley View Lane

TDSHS License No. 300084

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 2 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
4-03	Textured Drywall System (Dimpled), 1st Floor, Lobby	None Detected - Drywall Material None Detected - Joint Compound None Detected - Wall Covering
5-01	Brick Texture / Grout, 1st Floor, Lounge, Back Stage	None Detected - Grout None Detected - Paint / Texture
5-02	Brick Texture / Grout, 1st Floor, Lounge, Back Stage	None Detected - Grout None Detected - Paint / Texture
5-03	Brick Texture / Grout, 1st Floor, Lounge, Back Stage	None Detected - Grout None Detected - Paint / Texture
6-01	CMU Texture / Grout, 1st Floor, Lounge Restrooms	None Detected - Grout None Detected - Paint / Texture
6-02	CMU Texture / Grout, 1st Floor, Lounge Restrooms	None Detected - Grout None Detected - Paint / Texture
6-03	CMU Texture / Grout, 1st Floor, Lounge Restrooms	None Detected - Grout None Detected - Paint / Texture
7-01	Concrete Texture, 1st Floor, Lounge, Backstage, Box Office	None Detected - Paints
7-02	Concrete Texture, 1st Floor, Lounge, Backstage, Box Office	None Detected - Paints
7-03	Concrete Texture, 1st Floor, Lounge, Backstage, Box Office	None Detected - Paints
8-01	Plaster Ceiling System, 1st Floor, Kitchen, Dish Room	None Detected - Base Plaster None Detected - Top Plaster
8-02	Plaster Ceiling System, 1st Floor, Kitchen, Dish Room	None Detected - Base Plaster None Detected - Top Plaster
8-03	Plaster Ceiling System, 1st Floor, Kitchen, Dish Room	None Detected - Base Plaster None Detected - Top Plaster
9-01	Drywall Ceiling System, 1st Floor, Backstage	None Detected - Drywall Material None Detected - Joint Compound None Detected - Texture



PLM Summary Report

NVLAP Lab Code 102056-0

2051 Valley View Lane

TDSHS License No. 300084

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 3 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
9-02	Drywall Ceiling System, 1st Floor, Backstage	None Detected - Drywall Material 2% Chrysotile - Joint Compound 2% Chrysotile - Texture
9-03	Drywall Ceiling System, 1st Floor, Backstage	Not Analyzed - Positive Stop
10-01	1' x 1' Ceiling Tile (Fissures), 1st Floor, Lounge, Box Office, Lobby	None Detected - Acoustic Tile
10-02	1' x 1' Ceiling Tile (Fissures), 1st Floor, Lounge, Box Office, Lobby	None Detected - Acoustic Tile
10-03	1' x 1' Ceiling Tile (Fissures), 1st Floor, Lounge, Box Office, Lobby	None Detected - Acoustic Tile
11-01	1' x 1' Ceiling Tile (Fissures), 2nd Floor, West Hallway, Upstairs Lounge, Hallway at Stairwell	None Detected - Acoustic Tile
11-02	1' x 1' Ceiling Tile (Fissures), 2nd Floor, West Hallway, Upstairs Lounge, Hallway at Stairwell	None Detected - Acoustic Tile
11-03	1' x 1' Ceiling Tile (Fissures), 2nd Floor, West Hallway, Upstairs Lounge, Hallway at Stairwell	None Detected - Acoustic Tile
12-01	2' x 2' Ceiling Tile (Long Fissures), 1st Floor, Lounge Restrooms	None Detected - Acoustic Tile
12-02	2' x 2' Ceiling Tile (Long Fissures), 1st Floor, Lounge Restrooms	None Detected - Acoustic Tile
12-03	2' x 2' Ceiling Tile (Long Fissures), 1st Floor, Lounge Restrooms	None Detected - Acoustic Tile
13-01	2' x 2' Ceiling Tile (Short Fissures), 1st Floor, Lounge Restrooms	None Detected - Acoustic Tile
13-02	2' x 2' Ceiling Tile (Short Fissures), 1st Floor, Lounge Restrooms	None Detected - Acoustic Tile
13-03	2' x 2' Ceiling Tile (Short Fissures), 1st Floor, Lounge Restrooms	None Detected - Acoustic Tile



PLM Summary Report

NVLAP Lab Code 102056-0

TDSHS License No. 300084

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 4 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
14-01	2' x 4' Ceiling Tile (Long Fissures), 1st Floor, Auditorium, Buffet, Set Prep	None Detected - Acoustic Tile
14-02	2' x 4' Ceiling Tile (Long Fissures), 1st Floor, Auditorium, Buffet, Set Prep	None Detected - Acoustic Tile
14-03	2' x 4' Ceiling Tile (Long Fissures), 1st Floor, Auditorium, Buffet, Set Prep	None Detected - Acoustic Tile
15-01	2' x 4' Ceiling Tile (Short Fissures), 1st Floor, Auditorium, Buffet, Set Prep	None Detected - Acoustic Tile
15-02	2' x 4' Ceiling Tile (Short Fissures), 1st Floor, Auditorium, Buffet, Set Prep	None Detected - Acoustic Tile
15-03	2' x 4' Ceiling Tile (Short Fissures), 1st Floor, Auditorium, Buffet, Set Prep	None Detected - Acoustic Tile
16-01	16" x 16" Ceiling Tiles, 2nd Floor, Stairwell, Northwest and Southwest Storage Rooms	None Detected - Acoustic Tile
16-02	16" x 16" Ceiling Tiles, 2nd Floor, Stairwell, Northwest and Southwest Storage Rooms	None Detected - Acoustic Tile
16-03	16" x 16" Ceiling Tiles, 2nd Floor, Stairwell, Northwest and Southwest Storage Rooms	None Detected - Acoustic Tile
17-01	9" x 9" Tiles (Dark Green) with Mastic (Black), 1st Floor, Storage, Backstage	3% Chrysotile - Floor Tile 5% Chrysotile - Black Mastic
17-02	9" x 9" Tiles (Dark Green) with Mastic (Black), 1st Floor, Storage, Backstage	Not Analyzed - Positive Stop
17-03	9" x 9" Tiles (Dark Green) with Mastic (Black), 1st Floor, Storage, Backstage	Not Analyzed - Positive Stop
18-01	9" x 9" Tiles (Light Green) with Mastic (Black), 1st Floor, Backstage	3% Chrysotile - Floor Tile 5% Chrysotile - Black Mastic
18-02	9" x 9" Tiles (Light Green) with Mastic (Black), 1st Floor, Backstage	Not Analyzed - Positive Stop



PLM Summary Report

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client :	TTL - San Antonio	Lab Job No. : 26B-01624
Project :	JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652	Report Date : 02/19/2026
Project # :	26-09-00382.00	Sample Date : 02/10/2026 - 02/11/2026
Identification :	Asbestos, Bulk Sample Analysis	
Test Method :	Polarized Light Microscopy / Dispersion Staining (PLM/DS) EPA Method 600 / R-93 / 116	

Page 5 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
18-03	9" x 9" Tiles (Light Green) with Mastic (Black), 1st Floor, Backstage	Not Analyzed - Positive Stop
19-01	9" x 9" Tiles (Brown) with Mastic (Black), 1st Floor, Backstage	3% Chrysotile - Floor Tile 5% Chrysotile - Black Mastic
19-02	9" x 9" Tiles (Brown) with Mastic (Black), 1st Floor, Backstage	Not Analyzed - Positive Stop
19-03	9" x 9" Tiles (Brown) with Mastic (Black), 1st Floor, Backstage	Not Analyzed - Positive Stop
20-01	9" x 9" Tiles (Tan) with Mastic (Black), 1st Floor, Work Space, Set Prep	3% Chrysotile - Floor Tile 5% Chrysotile - Black Mastic
20-02	9" x 9" Tiles (Tan) with Mastic (Black), 1st Floor, Work Space, Set Prep	Not Analyzed - Positive Stop
20-03	9" x 9" Tiles (Tan) with Mastic (Black), 1st Floor, Work Space, Set Prep	Not Analyzed - Positive Stop
21-01	Carpet Mastic, 1st Floor, Lounge, Auditorium, Box Office	None Detected - Yellow Mastic 5% Chrysotile - Black Mastic
21-02	Carpet Mastic, 1st Floor, Lounge, Auditorium, Box Office	Not Analyzed - Positive Stop
21-03	Carpet Mastic, 1st Floor, Lounge, Auditorium, Box Office	Not Analyzed - Positive Stop
22-01	Wall Panel, 1st Floor, Storage Room, 2nd Floor, Furnace Room, Storage	None Detected - Fiberboard
22-02	Wall Panel, 1st Floor, Storage Room, 2nd Floor, Furnace Room, Storage	None Detected - Fiberboard
22-03	Wall Panel, 1st Floor, Storage Room, 2nd Floor, Furnace Room, Storage	None Detected - Fiberboard
23-01	Pipe Insulation (Potential Aerocell), 1st Floor, Storage Room	None Detected - Insulation None Detected - Cotton Wrap
23-02	Pipe Insulation (Potential Aerocell), 1st Floor, Storage Room	None Detected - Insulation None Detected - Cotton Wrap



PLM Summary Report

NVLAP Lab Code 102056-0

2051 Valley View Lane

TDSHS License No. 300084

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 6 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
23-03	Pipe Insulation (Potential Aerocell), 1st Floor, Storage Room	None Detected - Insulation None Detected - Cotton Wrap
24-01	Fire Suppression System Gasket, 1st Floor, Storage Room	None Detected - Gasket
24-02	Fire Suppression System Gasket, 1st Floor, Storage Room	None Detected - Gasket
24-03	Fire Suppression System Gasket, 1st Floor, Storage Room	None Detected - Gasket
25-01	HVAC Register Mastic (White), 1st Floor, Set Prep, Buffet, Auditorium	None Detected - White Mastic
25-02	HVAC Register Mastic (White), 1st Floor, Set Prep, Buffet, Auditorium	None Detected - White Mastic
25-03	HVAC Register Mastic (White), 1st Floor, Set Prep, Buffet, Auditorium	None Detected - White Mastic
26-01	1" x 1" Ceramic Floor Tile, Grout and Thinset, Backstage Restrooms	None Detected - Ceramic Tile None Detected - Grout No Thinset
26-02	1" x 1" Ceramic Floor Tile, Grout and Thinset, Backstage Restrooms	None Detected - Ceramic Tile None Detected - Grout No Thinset
26-03	1" x 1" Ceramic Floor Tile, Grout and Thinset, Backstage Restrooms	None Detected - Ceramic Tile None Detected - Grout No Thinset
27-01	4" x 4" Ceramic Wall Tile (Grey), Grout and Thinset, Backstage Restrooms	None Detected - Ceramic Tile None Detected - Grout None Detected - Yellow Adhesive No Thinset
27-02	4" x 4" Ceramic Wall Tile (Grey), Grout and Thinset, Backstage Restrooms	None Detected - Ceramic Tile None Detected - Grout No Thinset



PLM Summary Report

NVLAP Lab Code 102056-0

TDSHS License No. 300084

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 7 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
27-03	4" x 4" Ceramic Wall Tile (Grey), Grout and Thinset, Backstage Restrooms	None Detected - Ceramic Tile None Detected - Grout None Detected - Yellow Adhesive No Thinset
28-01	4" x 4" Ceramic Wall Tile (Cream), Grout and Thinset, Dish Room, Kitchen, Kitchen Hallway	None Detected - Ceramic Tile None Detected - Grout None Detected - Yellow Adhesive No Thinset
28-02	4" x 4" Ceramic Wall Tile (Cream), Grout and Thinset, Dish Room, Kitchen, Kitchen Hallway	None Detected - Ceramic Tile None Detected - Grout 2% Chrysotile - Thinset
28-03	4" x 4" Ceramic Wall Tile (Cream), Grout and Thinset, Dish Room, Kitchen, Kitchen Hallway	Not Analyzed - Positive Stop
29-01	6" x 6" Ceramic Floor Tile (Saltillo Red), Grout and Thinset, Dish Room, Laundry, Kitchen	None Detected - Ceramic Tile None Detected - Grout 2% Chrysotile - Thinset
29-02	6" x 6" Ceramic Floor Tile (Saltillo Red), Grout and Thinset, Dish Room, Laundry, Kitchen	Not Analyzed - Positive Stop
29-03	6" x 6" Ceramic Floor Tile (Saltillo Red), Grout and Thinset, Dish Room, Laundry, Kitchen	Not Analyzed - Positive Stop
30-01	16" x 16" Ceramic Floor Tile (Off-White), Grout and Thinset, Buffet	None Detected - Ceramic Tile None Detected - Grout None Detected - Thinset
30-02	16" x 16" Ceramic Floor Tile (Off-White), Grout and Thinset, Buffet	None Detected - Ceramic Tile None Detected - Grout None Detected - Thinset
30-03	16" x 16" Ceramic Floor Tile (Off-White), Grout and Thinset, Buffet	None Detected - Ceramic Tile None Detected - Grout None Detected - Thinset
31-01	Cove Base (Brown), 1st Floor, Tech, Backstage Restrooms	None Detected - Cove Base None Detected - Tan Mastic



PLM Summary Report

NVLAP Lab Code 102056-0

2051 Valley View Lane

TDSHS License No. 300084

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 8 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
31-02	Cove Base (Brown), 1st Floor, Tech, Backstage Restrooms	None Detected - Cove Base None Detected - Tan Mastic
31-03	Cove Base (Brown), 1st Floor, Tech, Backstage Restrooms	None Detected - Cove Base None Detected - Tan Mastic
32-01	Cove Base (Black), 1st Floor, Backstage, 2nd Floor, Storage	None Detected - Cove Base 2% Chrysotile - Brown Mastic 2% Chrysotile - Joint Compound
32-02	Cove Base (Black), 1st Floor, Backstage, 2nd Floor, Storage	Not Analyzed - Positive Stop
32-03	Cove Base (Black), 1st Floor, Backstage, 2nd Floor, Storage	Not Analyzed - Positive Stop
33-01	12" x 12" Ceramic Floor Tile (White) with Grout and Thinset, Lounge Bar	None Detected - Ceramic Tile None Detected - Grout None Detected - Thinset
33-02	12" x 12" Ceramic Floor Tile (White) with Grout and Thinset, Lounge Bar	None Detected - Ceramic Tile None Detected - Grout None Detected - Thinset
33-03	12" x 12" Ceramic Floor Tile (White) with Grout and Thinset, Lounge Bar	None Detected - Ceramic Tile None Detected - Grout None Detected - Thinset
34-01	12" x 12" Ceramic Floor Tile (Red) with Grout and Thinset, Lounge Restrooms	None Detected - Ceramic Tile None Detected - Tan Grout None Detected - Grey Grout None Detected - Thinset
34-02	12" x 12" Ceramic Floor Tile (Red) with Grout and Thinset, Lounge Restrooms	None Detected - Ceramic Tile None Detected - Tan Grout None Detected - Grey Grout None Detected - Thinset
34-03	12" x 12" Ceramic Floor Tile (Red) with Grout and Thinset, Lounge Restrooms	None Detected - Ceramic Tile None Detected - Tan Grout None Detected - Grey Grout None Detected - Thinset



PLM Summary Report

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio
Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652
Project # : 26-09-00382.00
Identification : Asbestos, Bulk Sample Analysis
Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Lab Job No. : 26B-01624
Report Date : 02/19/2026
Sample Date : 02/10/2026 -
02/11/2026

Page 9 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
35-01	Boiler Pipe Wrap, Kitchen and Laundry	10% Amosite - White Thermal Insulation 5% Chrysotile - White Thermal Insulation 65% Chrysotile - Grey Thermal Insulation None Detected - Paper Wrap None Detected - Cotton Wrap None Detected - White Mastic
35-02	Boiler Pipe Wrap, Kitchen and Laundry	Not Analyzed - Positive Stop
35-03	Boiler Pipe Wrap, Kitchen and Laundry	Not Analyzed - Positive Stop
36-01	Fiberglass Insulation Boiler Pipe Wrap (Yellow), Kitchen and Laundry	None Detected - Insulation None Detected - Paper / Foil Wrap
36-02	Fiberglass Insulation Boiler Pipe Wrap (Yellow), Kitchen and Laundry	None Detected - Insulation None Detected - Paper / Foil Wrap
36-03	Fiberglass Insulation Boiler Pipe Wrap (Yellow), Kitchen and Laundry	None Detected - Insulation None Detected - Paper / Foil Wrap
37-01	Textured Drywall System (Pearlite), 2nd Floor, Hallway Womens Restroom	None Detected - Drywall Material None Detected - Joint Compound None Detected - Textured Paint
37-02	Textured Drywall System (Pearlite), 2nd Floor, Hallway Womens Restroom	None Detected - Drywall Material None Detected - Joint Compound None Detected - Textured Paint
37-03	Textured Drywall System (Pearlite), 2nd Floor, Hallway Womens Restroom	None Detected - Drywall Material None Detected - Joint Compound None Detected - Textured Paint
38-01	Textured Drywall System (Orange Peel), 2nd Floor, Hallway, Furnace Room, Ladies Restroom	None Detected - Drywall Material 2% Chrysotile - Joint Compound None Detected - Textured Paint
38-02	Textured Drywall System (Orange Peel), 2nd Floor, Hallway, Furnace Room, Ladies Restroom	Not Analyzed - Positive Stop



PLM Summary Report

NVLAP Lab Code 102056-0

TDSHS License No. 300084

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 10 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
38-03	Textured Drywall System (Orange Peel), 2nd Floor, Hallway, Furnace Room, Ladies Restroom	Not Analyzed - Positive Stop
39-01	Carpeted Wallpaper (Tan), 1st Floor, Upstairs Lounge	None Detected - Drywall Material None Detected - Acoustic Tile None Detected - Yellow Mastic None Detected - Carpet
39-02	Carpeted Wallpaper (Tan), 1st Floor, Upstairs Lounge	None Detected - Drywall Material None Detected - Acoustic Tile None Detected - Yellow Mastic None Detected - Carpet
39-03	Carpeted Wallpaper (Tan), 1st Floor, Upstairs Lounge	None Detected - Drywall Material None Detected - Acoustic Tile None Detected - Yellow Mastic None Detected - Carpet
40-01	Wallpaper Drywall System (Green), 1st Floor, Stage Exit	None Detected - Drywall Material None Detected - Wall Covering
40-02	Wallpaper Drywall System (Green), 1st Floor, Stage Exit	None Detected - Drywall Material None Detected - Wall Covering
40-03	Wallpaper Drywall System (Green), 1st Floor, Stage Exit	None Detected - Drywall Material None Detected - Wall Covering
41-01	Vibration Dampener, 2nd Floor, Furnace Room	None Detected - Vibration Dampener
41-02	Vibration Dampener, 2nd Floor, Furnace Room	None Detected - Vibration Dampener
41-03	Vibration Dampener, 2nd Floor, Furnace Room	None Detected - Vibration Dampener
42-01	HVAC Mastic (Tan), 2nd Floor, Furnace Room	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - Glass Fiber Wrap None Detected - Tan Mastic



PLM Summary Report

NVLAP Lab Code 102056-0

2051 Valley View Lane

TDSHS License No. 300084

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 11 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
42-02	HVAC Mastic (Tan), 2nd Floor, Furnace Room	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - Glass Fiber Wrap None Detected - Tan Mastic
42-03	HVAC Mastic (Tan), 2nd Floor, Furnace Room	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - Tan Mastic
43-01	Pipe Wrap, 2nd Floor, Furnace Room, Upstairs Lounge	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - Tan Mastic None Detected - White Mastic
43-02	Pipe Wrap, 2nd Floor, Furnace Room, Upstairs Lounge	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - Tan Mastic
43-03	Pipe Wrap, 2nd Floor, Furnace Room, Upstairs Lounge	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - White Mastic
44-01	12" x 12" Vinyl Composition Tile (Dark Grey Streaks) with Mastic, 2nd Floor, Storage, Art Room, Office	3% Chrysotile - Floor Tile 5% Chrysotile - Black Mastic
44-02	12" x 12" Vinyl Composition Tile (Dark Grey Streaks) with Mastic, 2nd Floor, Storage, Art Room, Office	Not Analyzed - Positive Stop
44-03	12" x 12" Vinyl Composition Tile (Dark Grey Streaks) with Mastic, 2nd Floor, Storage, Art Room, Office	Not Analyzed - Positive Stop
45-01	12" x 12" Vinyl Composition Tile (Grey Speckled) with Mastic, 2nd Floor, Mens Restroom	3% Chrysotile - Floor Tile 5% Chrysotile - Black Mastic
45-02	12" x 12" Vinyl Composition Tile (Grey Speckled) with Mastic, 2nd Floor, Mens Restroom	Not Analyzed - Positive Stop
45-03	12" x 12" Vinyl Composition Tile (Grey Speckled) with Mastic, 2nd Floor, Mens Restroom	Not Analyzed - Positive Stop



PLM Summary Report

NVLAP Lab Code 102056-0

TDSHS License No. 300084

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 12 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
46-01	12" x 12" Vinyl Composition Tile (Tan) with Mastic, 2nd Floor, Hallway, Hallway Storage, Props	3% Chrysotile - Floor Tile 5% Chrysotile - Black Mastic
46-02	12" x 12" Vinyl Composition Tile (Tan) with Mastic, 2nd Floor, Hallway, Hallway Storage, Props	Not Analyzed - Positive Stop
46-03	12" x 12" Vinyl Composition Tile (Tan) with Mastic, 2nd Floor, Hallway, Hallway Storage, Props	Not Analyzed - Positive Stop
47-01	12" x 12" Vinyl Composition Tile (Light Tan Speckled) with Mastic, 2nd Floor, Hallway	None Detected - Floor Tile None Detected - Yellow Mastic
47-02	12" x 12" Vinyl Composition Tile (Light Tan Speckled) with Mastic, 2nd Floor, Hallway	None Detected - Floor Tile None Detected - Yellow Mastic
47-03	12" x 12" Vinyl Composition Tile (Light Tan Speckled) with Mastic, 2nd Floor, Hallway	None Detected - Floor Tile None Detected - Yellow Mastic
48-01	9" x 9" Vinyl Composition Tile (Tan) with Mastic, 2nd Floor, Hallway Storage	3% Chrysotile - Floor Tile 5% Chrysotile - Black Mastic
48-02	9" x 9" Vinyl Composition Tile (Tan) with Mastic, 2nd Floor, Hallway Storage	Not Analyzed - Positive Stop
48-03	9" x 9" Vinyl Composition Tile (Tan) with Mastic, 2nd Floor, Hallway Storage	Not Analyzed - Positive Stop
49-01	HVAC Duct Wrap (White), 2nd Floor, Storage, Office, Womens Restroom	None Detected - Thermal Insulation None Detected - Paper / Foil Wrap None Detected - White Mastic
49-02	HVAC Duct Wrap (White), 2nd Floor, Storage, Office, Womens Restroom	None Detected - Thermal Insulation None Detected - Paper / Foil Wrap None Detected - White Mastic
49-03	HVAC Duct Wrap (White), 2nd Floor, Storage, Office, Womens Restroom	None Detected - Thermal Insulation None Detected - Paper / Foil Wrap None Detected - White Mastic
50-01	Brick Texture and Grout, 2nd Floor, Costumes, Mens Restroom, Womens Restroom	None Detected - Grout None Detected - Paint / Texture



PLM Summary Report

NVLAP Lab Code 102056-0

2051 Valley View Lane

TDSHS License No. 300084

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 13 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
50-02	Brick Texture and Grout, 2nd Floor, Costumes, Mens Restroom, Womens Restroom	None Detected - Grout 2% Chrysotile - Old Texture None Detected - New Texture
50-03	Brick Texture and Grout, 2nd Floor, Costumes, Mens Restroom, Womens Restroom	Not Analyzed - Positive Stop
51-01	Carpet Mastic, 2nd Floor, Upstairs Lounge, Hallway, Womens Restroom	None Detected - Yellow Mastic
51-02	Carpet Mastic, 2nd Floor, Upstairs Lounge, Hallway, Womens Restroom	None Detected - Yellow Mastic
51-03	Carpet Mastic, 2nd Floor, Upstairs Lounge, Hallway, Womens Restroom	None Detected - Yellow Mastic
52-01	BUR Roofing Material, Low Slope Roof Section	None Detected - Roofing Tars None Detected - Roofing Felts None Detected - Insulation
52-02	BUR Roofing Material, Low Slope Roof Section	None Detected - Roofing Tars None Detected - Roofing Felts None Detected - Insulation
52-03	BUR Roofing Material, Low Slope Roof Section	None Detected - Roofing Tars None Detected - Roofing Felts
53-01	Roofing Mastic (Grey / Black), Roof	5% Chrysotile - Roofing Mastic
53-02	Roofing Mastic (Grey / Black), Roof	Not Analyzed - Positive Stop
53-03	Roofing Mastic (Grey / Black), Roof	Not Analyzed - Positive Stop
54-01	Roofing Shingles (Red), Roof	None Detected - Roofing Shingle
54-02	Roofing Shingles (Red), Roof	None Detected - Roofing Shingle
54-03	Roofing Shingles (Red), Roof	None Detected - Roofing Shingle
55-01	Concrete Texture, Exterior, North Wall, East Wall, South Wall	None Detected - Paint / Texture



PLM Summary Report

NVLAP Lab Code 102056-0

2051 Valley View Lane

TDSHS License No. 300084

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26B-01624

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Report Date : 02/19/2026

Project # : 26-09-00382.00

Sample Date : 02/10/2026 -
02/11/2026

Identification : Asbestos, Bulk Sample Analysis

Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Page 14 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
55-02	Concrete Texture, Exterior, North Wall, East Wall, South Wall	None Detected - Paint / Texture
55-03	Concrete Texture, Exterior, North Wall, East Wall, South Wall	None Detected - Paint / Texture
56-01	Brick Texture and Grout, Exterior, North Wall, East Wall, South Wall	None Detected - Grout None Detected - Texture
56-02	Brick Texture and Grout, Exterior, North Wall, East Wall, South Wall	None Detected - Grout None Detected - Texture
56-03	Brick Texture and Grout, Exterior, North Wall, East Wall, South Wall	None Detected - Grout None Detected - Texture
57-01	CMU Texture and Grout, Exterior, Behind Lounge Restrooms	None Detected - Grout None Detected - Paint / Texture
57-02	CMU Texture and Grout, Exterior, Behind Lounge Restrooms	None Detected - Grout None Detected - Paint / Texture
57-03	CMU Texture and Grout, Exterior, Behind Lounge Restrooms	None Detected - Grout None Detected - Paint / Texture
58-01	Window Caulking (Grey), Exterior, North Wall	None Detected - Caulking
58-02	Window Caulking (Grey), Exterior, North Wall	None Detected - Caulking
58-03	Window Caulking (Grey), Exterior, North Wall	None Detected - Caulking
59-01	Window Caulking (Tan), Exterior, North Wall	None Detected - Tan Caulking None Detected - Grey Caulking
59-02	Window Caulking (Tan), Exterior, North Wall	None Detected - Tan Caulking None Detected - Grey Caulking
59-03	Window Caulking (Tan), Exterior, North Wall	None Detected - Tan Caulking None Detected - Grey Caulking
60-01	Door Sealant, Exterior, Main Entrance	None Detected - Sealant
60-02	Door Sealant, Exterior, Main Entrance	None Detected - Sealant



PLM Summary Report

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio
Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652
Project # : 26-09-00382.00
Identification : Asbestos, Bulk Sample Analysis
Test Method : Polarized Light Microscopy / Dispersion Staining (PLM/DS)
EPA Method 600 / R-93 / 116

Lab Job No. : 26B-01624
Report Date : 02/19/2026
Sample Date : 02/10/2026 -
02/11/2026

Page 15 of 15

On 2/12/2026, one hundred eighty nine (189) bulk material samples were submitted by a representative of TTL - San Antonio for asbestos analysis by PLM/DS. The PLM Detail Report is attached; additional information may be found therein. The results are summarized below:

Sample Number	Client Sample Description / Location	Asbestos Content
60-03	Door Sealant, Exterior, Main Entrance	None Detected - Sealant
61-01	Pipe Wrap Exterior HVAC, Exterior, Behind Lounge Restrooms	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - White Mastic
61-02	Pipe Wrap Exterior HVAC, Exterior, Behind Lounge Restrooms	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - White Mastic
61-03	Pipe Wrap Exterior HVAC, Exterior, Behind Lounge Restrooms	None Detected - Insulation None Detected - Paper / Foil Wrap None Detected - White Mastic
62-01	Stucco, Exterior, North Wall	None Detected - Stucco
62-02	Stucco, Exterior, North Wall	None Detected - Stucco
62-03	Stucco, Exterior, North Wall	None Detected - Stucco
63-01	Window Glazing, Exterior, South Wall	None Detected - Window Glazing
63-02	Window Glazing, Exterior, South Wall	None Detected - Window Glazing
63-03	Window Glazing, Exterior, South Wall	None Detected - Window Glazing

These samples were analyzed by layers. Quantification, unless otherwise noted, is performed by calibrated visual estimate. The test report shall not be reproduced except in full without written approval of the laboratory. The results relate only to the items tested. These test results do not imply endorsement by NVLAP or any agency of the U.S. Government. Accredited by the National Voluntary Laboratory Accreditation Program for Bulk Asbestos Fiber Analysis under Lab Code 102056-0.



Analyst(s): Isaac Rubio, Neil Kiphen, Willie Pruitt

Lab Manager : Heather Lopez

Approved Signatory :

Lab Director : Bruce Crabb

Approved Signatory :

Thank you for choosing Moody Labs

This Page Left Intentionally Blank

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 1 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
1-01	Drywall Material (White)	2%	Cellulose Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper / Tape (Tan / White)	8%	Cellulose Fibers	100%		
	Joint Compound (White)	10%	Calcite / Talc / Binders	100%		
	Texture (White)	80%	Calcite / Talc / Binders	100%		
1-02	Drywall Material (White)	2%	Cellulose Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper Facing (Tan)	8%	Cellulose Fibers	100%		
	Texture / Joint Cmpd (White)	90%	Calcite / Talc / Binders	100%		
1-03	Drywall Material (White)	5%	Cellulose Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper / Tape (Tan / White)	10%	Cellulose Fibers	100%		
	Joint Compound (White)	40%	Calcite / Talc / Binders	100%		
	Texture (White)	45%	Calcite / Talc / Binders	100%		
2-01	Drywall Material (Light Pink)	5%	Glass Wool Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper Facing (Tan)	5%	Cellulose Fibers	100%		
	Texture / Joint Cmpd (White)	90%	Calcite / Talc / Binders	100%		
2-02	Drywall Material (Light Pink)	25%	Cellulose Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper / Tape (Tan / White)	25%	Cellulose Fibers	100%		
	Joint Compound (White)	25%	Calcite / Talc / Binders	100%		
	Texture (White)	25%	Calcite / Talc / Binders	100%		
2-03	Drywall Material (Light Pink)	25%	Cellulose Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper / Tape (Tan / White)	25%	Cellulose Fibers	100%		
	Joint Compound (Off-White)	25%	Calcite / Talc / Binders	100%		
	Texture (Off-White)	25%	Calcite / Talc / Binders	100%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 2 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
3-01	Drywall Material (White)	90%	Cellulose Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper Facing (Tan)	7%	Cellulose Fibers	100%		
	No Texture					
3-02	Paint (Green)	3%	Pigment / Binders	100%	02/19	WP
	Drywall Material (White)	90%	Cellulose Fibers	2%		
			Gypsum / Binders	98%		
	DW Paper Facing (Tan)	7%	Cellulose Fibers	100%		
3-03	No Texture				02/19	WP
	Paint (Green)	3%	Pigment / Binders	100%		
	Drywall Material (White)	90%	Cellulose Fibers	2%		
			Gypsum / Binders	98%		
4-01	DW Paper Facing (Tan)	7%	Cellulose Fibers	100%	02/19	WP
	No Texture					
	Paint (Green)	3%	Pigment / Binders	100%		
	Drywall Material (Light Pink)	20%	Cellulose Fibers	2%		
4-02			Gypsum / Binders	98%	02/19	WP
	DW Paper Facing (Tan)	5%	Cellulose Fibers	100%		
	Joint Compound (White)	60%	Calcite / Talc / Binders	100%		
	Wall Covering (Tan)	15%	Synthetic Fibers	40%		
4-02			Vinyl Binders	60%	02/19	WP
	No Drywall Material					
	Joint Compound (White)	85%	Calcite / Talc / Binders	100%		
	Wall Covering (Tan)	15%	Synthetic Fibers	40%		
			Vinyl Binders	60%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 3 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
4-03	Drywall Material (Light Pink)	15%	Cellulose Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper / Tape (Tan / White)	10%	Cellulose Fibers	100%		
	Joint Compound (White)	60%	Calcite / Talc / Binders	100%		
	Wall Covering (Tan)	15%	Synthetic Fibers	40%		
			Vinyl Binders	60%		
5-01	Grout (Grey)	50%	Aggregate	65%	02/19	WP
			Cement Binders	35%		
	Paint / Texture (Tan / White)	50%	Calcite	25%		
			Pigment / Binders	75%		
5-02	Grout (Grey)	50%	Aggregate	65%	02/19	WP
			Cement Binders	35%		
	Paint / Texture (Tan / White)	50%	Calcite	25%		
			Pigment / Binders	75%		
5-03	Grout (Grey)	50%	Aggregate	65%	02/19	WP
			Cement Binders	35%		
	Paint / Texture (Tan / White)	50%	Calcite	25%		
			Pigment / Binders	75%		
6-01	Grout (Grey)	50%	Aggregate	65%	02/19	WP
			Cement Binders	35%		
	Paint / Texture (Tan)	50%	Calcite	25%		
			Pigment / Binders	75%		
6-02	Grout (Grey)	50%	Aggregate	65%	02/19	WP
			Cement Binders	35%		
	Paint / Texture (Tan)	50%	Calcite	25%		
			Pigment / Binders	75%		
6-03	Grout (Grey)	50%	Aggregate	65%	02/19	WP
			Cement Binders	35%		
	Paint / Texture (Tan)	50%	Calcite	25%		
			Pigment / Binders	75%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 4 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
7-01	Paints (Multi-colored)	100%	Pigment / Binders	100%	02/19	WP
7-02	Paints (Multi-colored)	100%	Pigment / Binders	100%	02/19	WP
7-03	Paints (Multi-colored)	100%	Pigment / Binders	100%	02/19	WP
8-01	Base Plaster (Tan)	20%	Aggregate	65%	02/19	WP
			Calcite / Binders	35%		
	Top Plaster (White)	80%	Calcite / Binders	100%		
8-02	Base Plaster (Tan)	20%	Aggregate	65%	02/19	WP
			Calcite / Binders	35%		
	Top Plaster (White)	80%	Calcite / Binders	100%		
8-03	Base Plaster (Tan)	1%	Aggregate	65%	02/19	WP
			Calcite / Binders	35%		
	Top Plaster (White)	99%	Calcite / Binders	100%		
9-01	Drywall Material (White)	25%	Cellulose Fibers	2%	02/19	WP
			Gypsum / Binders	98%		
	DW Paper / Tape (Tan / White)	25%	Cellulose Fibers	100%		
	Joint Compound (White)	25%	Calcite / Talc / Binders	100%		
	Texture (White)	25%	Calcite / Talc / Binders	100%		
9-02	Drywall Material (White)	50%	Cellulose Fibers	3%	02/19	WP
			Gypsum / Binders	97%		
	DW Paper / Tape (Tan / White)	20%	Cellulose Fibers	100%		
	Joint Compound (Off-White)	15%	Chrysotile	2%		
			Calcite / Talc / Binders	98%		
	Texture (Off-White)	15%	Chrysotile	2%		
			Calcite / Talc / Binders	98%		
9-03	Not Analyzed - Positive Stop	100%			02/19	WP
10-01	Acoustic Tile (Light Grey)	100%	Mineral Wool Fibers	45%	02/19	WP
			Cellulose Fibers	35%		
			Perlite	20%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 5 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
10-02	Acoustic Tile (Light Grey)	100%	Mineral Wool Fibers Cellulose Fibers Perlite	45% 35% 20%	02/19	WP
10-03	Acoustic Tile (Light Grey)	100%	Mineral Wool Fibers Cellulose Fibers Perlite	45% 35% 20%	02/19	WP
11-01	Acoustic Tile (Light Grey)	100%	Mineral Wool Fibers Cellulose Fibers Perlite	45% 35% 20%	02/19	WP
11-02	Acoustic Tile (Light Grey)	100%	Mineral Wool Fibers Cellulose Fibers Perlite	45% 35% 20%	02/19	WP
11-03	Acoustic Tile (Light Grey)	100%	Mineral Wool Fibers Cellulose Fibers Perlite	45% 35% 20%	02/19	WP
12-01	Acoustic Tile (Light Tan)	100%	Cellulose Fibers Perlite	80% 20%	02/19	WP
12-02	Acoustic Tile (Light Tan)	100%	Cellulose Fibers Perlite	80% 20%	02/19	WP
12-03	Acoustic Tile (Light Tan)	100%	Cellulose Fibers Perlite	80% 20%	02/19	WP
13-01	Acoustic Tile (Light Grey)	100%	Cellulose Fibers Mineral Wool Fibers Perlite	50% 30% 20%	02/19	WP
13-02	Acoustic Tile (Light Grey)	100%	Cellulose Fibers Mineral Wool Fibers Perlite	50% 30% 20%	02/19	WP

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 6 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
13-03	Acoustic Tile (Light Grey)	100%	Cellulose Fibers Mineral Wool Fibers Perlite	50% 30% 20%	02/19	WP
14-01	Acoustic Tile (Light Tan)	100%	Cellulose Fibers Perlite	80% 20%	02/19	WP
14-02	Acoustic Tile (Light Tan)	100%	Cellulose Fibers Perlite	80% 20%	02/19	WP
14-03	Acoustic Tile (Light Tan)	100%	Cellulose Fibers Perlite	80% 20%	02/19	WP
15-01	Acoustic Tile (Light Grey)	100%	Cellulose Fibers Mineral Wool Fibers Perlite	50% 30% 20%	02/19	WP
15-02	Acoustic Tile (Light Grey)	100%	Cellulose Fibers Mineral Wool Fibers Perlite	50% 30% 20%	02/19	WP
15-03	Acoustic Tile (Light Grey)	100%	Cellulose Fibers Mineral Wool Fibers Perlite	50% 30% 20%	02/19	WP
16-01	Acoustic Tile (Tan)	100%	Wood Fibers	100%	02/19	WP
16-02	Acoustic Tile (Tan)	100%	Wood Fibers	100%	02/19	WP
16-03	Acoustic Tile (Tan)	100%	Wood Fibers	100%	02/19	WP
17-01	Floor Tile (Green) Black Mastic (Black)	98% 2%	Chrysotile Calcite / Vinyl Binders Chrysotile Tar Binders	3% 97% 5% 95%	02/19	WP
17-02	Not Analyzed - Positive Stop	100%			02/19	WP
17-03	Not Analyzed - Positive Stop	100%			02/19	WP

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 7 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
18-01	Floor Tile (Green)	90%	Chrysotile	3%	02/19	WP
			Calcite / Vinyl Binders	97%		
	Black Mastic (Black)	2%	Chrysotile	5%		
			Tar Binders	95%		
	Floor Felt (Black)	8%	Cellulose Fibers	90%		
			Tar Binders	10%		
18-02	Not Analyzed - Positive Stop	100%			02/19	WP
18-03	Not Analyzed - Positive Stop	100%			02/19	WP
19-01	Floor Tile (Brown)	98%	Chrysotile	3%	02/19	WP
			Calcite / Vinyl Binders	97%		
	Black Mastic (Black)	2%	Chrysotile	5%		
			Tar Binders	95%		
19-02	Not Analyzed - Positive Stop	100%			02/19	WP
19-03	Not Analyzed - Positive Stop	100%			02/19	WP
20-01	Floor Tile (Off-White)	97%	Chrysotile	3%	02/19	WP
			Calcite / Vinyl Binders	97%		
	Black Mastic (Black)	3%	Chrysotile	5%		
			Tar Binders	95%		
20-02	Not Analyzed - Positive Stop	100%			02/19	WP
20-03	Not Analyzed - Positive Stop	100%			02/19	WP
21-01	Yellow Mastic (Yellow)	95%	Glue Binders	100%	02/19	WP
	Black Mastic (Black)	5%	Chrysotile	5%		
			Tar Binders	95%		
21-02	Not Analyzed - Positive Stop	100%			02/19	WP
21-03	Not Analyzed - Positive Stop	100%			02/19	WP
22-01	Fiberboard (Tan)	100%	Wood Fibers	100%	02/19	WP
22-02	Fiberboard (Tan)	100%	Wood Fibers	100%	02/19	WP
22-03	Fiberboard (Tan)	100%	Wood Fibers	100%	02/19	WP

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 8 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
23-01	Insulation (Tan)	90%	Cellulose Fibers	100%	02/19	WP
	Cotton Wrap (Off-White)	10%	Cotton Fibers	100%		
23-02	Insulation (Tan)	90%	Cellulose Fibers	100%	02/19	WP
	Cotton Wrap (Off-White)	10%	Cotton Fibers	100%		
23-03	Insulation (Tan)	90%	Cellulose Fibers	100%	02/19	WP
	Cotton Wrap (Off-White)	10%	Cotton Fibers	100%		
24-01	Gasket (Brown)	100%	Cellulose Fibers	95%	02/19	WP
			Binders / Fillers	5%		
24-02	Gasket (Brown)	100%	Cellulose Fibers	95%	02/19	WP
			Binders / Fillers	5%		
24-03	Gasket (Brown)	100%	Cellulose Fibers	95%	02/19	WP
			Binders / Fillers	5%		
25-01	White Mastic (White)	100%	Synthetic Fibers	3%	02/19	WP
			Calcite	50%		
			Binders / Fillers	47%		
25-02	White Mastic (White)	100%	Synthetic Fibers	3%	02/19	WP
			Calcite	50%		
			Binders / Fillers	47%		
25-03	White Mastic (White)	100%	Synthetic Fibers	3%	02/19	WP
			Calcite	50%		
			Binders / Fillers	47%		
26-01	Ceramic Tile (Tan)	98%	Sintered Clays	100%	02/19	WP
	Grout (Grey)	2%	Aggregate	65%		
	No Thinset		Cement Binders	35%		
26-02	Ceramic Tile (Tan)	97%	Sintered Clays	100%	02/19	WP
	Grout (Grey)	3%	Aggregate	65%		
	No Thinset		Cement Binders	35%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 9 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
26-03	Ceramic Tile (Tan)	97%	Sintered Clays	100%	02/19	WP
	Grout (Grey)	3%	Aggregate	65%		
			Cement Binders	35%		
	No Thinset					
27-01	Ceramic Tile (Grey)	85%	Sintered Clays	100%	02/19	WP
	Grout (White)	14%	Calcite / Binders	100%		
	Yellow Adhesive (Yellow)	1%	Calcite	60%		
			Glue Binders	40%		
	No Thinset					
27-02	Ceramic Tile (Grey)	60%	Sintered Clays	100%	02/19	WP
	Grout (White)	40%	Calcite / Binders	100%		
	No Thinset					
27-03	Ceramic Tile (Grey)	92%	Sintered Clays	100%	02/19	WP
	Grout (White)	5%	Calcite / Binders	100%		
	Yellow Adhesive (Yellow)	3%	Calcite	60%		
			Glue Binders	40%		
	No Thinset					
28-01	Ceramic Tile (Cream)	80%	Sintered Clays	100%	02/19	WP
	Grout (White)	10%	Calcite / Binders	100%		
	Yellow Adhesive (Yellow)	10%	Calcite	60%		
			Glue Binders	40%		
	No Thinset					
28-02	Ceramic Tile (Cream)	95%	Sintered Clays	100%	02/19	WP
	Grout (White)	1%	Calcite / Binders	100%		
	Thinset (Grey)	4%	Chrysotile	2%		
			Aggregate	63%		
			Cement Binders	35%		
28-03	Not Analyzed - Positive Stop	100%			02/19	WP

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 10 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
29-01	Ceramic Tile (Red)	25%	Sintered Clays	100%	02/19	NK
	Grout (Grey)	18%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Grey / Tan)	57%	Chrysotile	2%		
			Aggregate	63%		
			Cement Binders	35%		
29-02	Not Analyzed - Positive Stop	100%	02/19			NK
29-03	Not Analyzed - Positive Stop	100%	02/19			NK
30-01	Ceramic Tile (Off-White)	47%	Sintered Clays	100%	02/19	NK
	Grout (Tan)	53%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Light Grey)	<1%	Aggregate	65%		
			Cement Binders	35%		
30-02	Ceramic Tile (Off-White)	52%	Sintered Clays	100%	02/19	NK
	Grout (Tan)	48%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Light Grey)	<1%	Aggregate	65%		
			Cement Binders	35%		
30-03	Ceramic Tile (Off-White)	83%	Sintered Clays	100%	02/19	NK
	Grout (Tan)	5%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Light Grey)	12%	Aggregate	65%		
			Cement Binders	35%		
31-01	Cove Base (Grey)	98%	Calcite / Vinyl Binders	100%	02/19	NK
	Tan Mastic (Tan)	2%	Talc Fibers	2%		
			Calcite / Talc	50%		
			Glue Binders	48%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 11 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
31-02	Cove Base (Grey)	99%	Calcite / Vinyl Binders	100%	02/19	NK
	Tan Mastic (Tan)	1%	Talc Fibers	2%		
			Calcite / Talc	50%		
			Glue Binders	48%		
31-03	Cove Base (Grey)	98%	Calcite / Vinyl Binders	100%	02/19	NK
	Tan Mastic (Tan)	2%	Talc Fibers	2%		
			Calcite / Talc	50%		
			Glue Binders	48%		
32-01	Cove Base (Black)	96%	Calcite / Vinyl Binders	100%	02/19	NK
	Brown Mastic (Brown)	4%	Chrysotile	2%		
			Glue Binders	98%		
	Joint Compound (Off-White)	<1%	Chrysotile	2%		
			Calcite / Talc / Binders	98%		
32-02	Not Analyzed - Positive Stop	100%			02/19	NK
32-03	Not Analyzed - Positive Stop	100%			02/19	NK
33-01	Ceramic Tile (White)	65%	Sintered Clays	100%	02/19	NK
	Grout (Tan)	28%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Grey)	7%	Aggregate	65%		
			Cement Binders	35%		
33-02	Ceramic Tile (White)	45%	Sintered Clays	100%	02/19	NK
	Grout (Tan)	12%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Grey)	43%	Aggregate	65%		
			Cement Binders	35%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 12 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
33-03	Ceramic Tile (White)	45%	Sintered Clays	100%	02/19	NK
	Grout (Tan)	20%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Grey)	35%	Aggregate	65%		
			Cement Binders	35%		
34-01	Ceramic Tile (Red / Beige)	78%	Sintered Clays	100%	02/19	NK
	Tan Grout (Tan)	1%	Aggregate	65%		
			Cement Binders	35%		
	Grey Grout (Grey)	20%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Light Grey)	1%	Aggregate	65%		
			Cement Binders	35%		
34-02	Ceramic Tile (Red / Beige)	71%	Sintered Clays	100%	02/19	NK
	Tan Grout (Tan)	<1%	Aggregate	65%		
			Cement Binders	35%		
	Grey Grout (Grey)	2%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Light Grey)	25%	Aggregate	65%		
			Cement Binders	35%		
	Leveling Compound (Off-White)	2%	Calcite / Binders	100%		
34-03	Ceramic Tile (Red / Beige)	77%	Sintered Clays	100%	02/19	NK
	Tan Grout (Tan)	1%	Aggregate	65%		
			Cement Binders	35%		
	Grey Grout (Grey)	8%	Aggregate	65%		
			Cement Binders	35%		
	Thinset (Light Grey)	13%	Aggregate	65%		
			Cement Binders	35%		
	Leveling Compound (Off-White)	1%	Calcite / Binders	100%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 13 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
35-01	White Thermal Insulation (Off-White)	5%	Amosite	10%	02/19	NK
			Chrysotile	5%		
			Binders / Fillers	85%		
	Grey Thermal Insulation (Grey)	84%	Chrysotile	65%		
			Binders / Fillers	35%		
	Paper Wrap (Tan)	1%	Cellulose Fibers	100%		
	Cotton Wrap (Off-White)	5%	Cotton Fibers	100%		
	White Mastic (Off-White)	5%	Pigment / Binders	100%		
35-02	Not Analyzed - Positive Stop	100%			02/19	NK
35-03	Not Analyzed - Positive Stop	100%			02/19	NK
36-01	Insulation (Yellow)	98%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (White / Silver)	2%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
	Paint (Tan)	<1%	Pigment / Binders	100%		
36-02	Insulation (Yellow)	98%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (White / Silver)	2%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
36-03	Insulation (Yellow)	98%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (White / Silver)	2%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 14 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
37-01	Drywall Material (Light Pink)	6%	Cellulose Fibers	5%	02/19	NK
			Gypsum / Binders	95%		
	DW Paper / Tape (Tan / White)	15%	Cellulose Fibers	100%		
	Joint Compound (White)	74%	Calcite / Talc / Binders	100%		
	Textured Paint (Off-White)	5%	Perlite	5%		
			Pigment / Binders	95%		
37-02	Drywall Material (Light Pink)	12%	Cellulose Fibers	5%	02/19	NK
			Gypsum / Binders	95%		
	DW Paper / Tape (Tan / White)	25%	Cellulose Fibers	100%		
	Joint Compound (White)	55%	Calcite / Talc / Binders	100%		
	Textured Paint (Pink)	8%	Perlite	5%		
			Pigment / Binders	95%		
37-03	Drywall Material (White)	6%	Wood Fibers	5%	02/19	NK
			Gypsum / Binders	95%		
	DW Paper Facing (Tan)	78%	Cellulose Fibers	100%		
	Joint Compound (White)	4%	Calcite / Talc / Binders	100%		
	Textured Paint (Off-White)	12%	Perlite	5%		
			Pigment / Binders	95%		
38-01	Drywall Material (White)	15%	Wood Fibers	5%	02/19	NK
			Gypsum / Binders	95%		
	DW Paper / Tape (Tan / White)	40%	Cellulose Fibers	100%		
	Joint Compound (Off-White)	42%	Chrysotile	2%		
			Calcite / Talc / Binders	98%		
	Textured Paint (Pink)	3%	Perlite	5%		
			Pigment / Binders	95%		
38-02	Not Analyzed - Positive Stop	100%			02/19	NK
38-03	Not Analyzed - Positive Stop	100%			02/19	NK

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 15 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
39-01	Drywall Material (Light Pink)	4%	Glass Wool Fibers	2%	02/19	NK
			Cellulose Fibers	1%		
			Gypsum / Binders	97%		
	DW Paper Facing (Tan)	5%	Cellulose Fibers	100%		
	Acoustic Tile (Light Grey)	39%	Cellulose Fibers	50%		
			Mineral Wool Fibers	30%		
			Perlite	20%		
	Yellow Mastic (Yellow)	2%	Glue Binders	100%		
	Carpet (Tan)	50%	Synthetic Fibers	75%		
			Glass Wool Fibers	10%		
			Glue Binders	15%		
39-02	Drywall Material (Light Pink)	4%	Glass Wool Fibers	2%	02/19	NK
			Cellulose Fibers	1%		
			Gypsum / Binders	97%		
	DW Paper Facing (Tan)	1%	Cellulose Fibers	100%		
	Acoustic Tile (Light Grey)	50%	Cellulose Fibers	50%		
			Mineral Wool Fibers	30%		
			Perlite	20%		
	Yellow Mastic (Yellow)	2%	Glue Binders	100%		
	Carpet (Tan)	43%	Synthetic Fibers	75%		
			Glass Wool Fibers	10%		
			Glue Binders	15%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 16 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
39-03	Drywall Material (Light Pink)	2%	Glass Wool Fibers	2%	02/19	NK
			Cellulose Fibers	1%		
			Gypsum / Binders	97%		
	DW Paper Facing (Tan)	4%	Cellulose Fibers	100%		
	Acoustic Tile (Light Grey)	45%	Cellulose Fibers	50%		
			Mineral Wool Fibers	30%		
			Perlite	20%		
	Yellow Mastic (Yellow)	2%	Glue Binders	100%		
	Carpet (Tan)	47%	Synthetic Fibers	75%		
			Glass Wool Fibers	10%		
			Glue Binders	15%		
40-01	Drywall Material (White)	55%	Cellulose Fibers	5%	02/19	NK
			Gypsum / Binders	95%		
	DW Paper Facing (Tan)	35%	Cellulose Fibers	100%		
	Wall Covering (Green / White)	10%	Synthetic Fibers	40%		
			Vinyl Binders	60%		
40-02	Drywall Material (White)	70%	Cellulose Fibers	5%	02/19	NK
			Gypsum / Binders	95%		
	DW Paper Facing (Tan)	24%	Cellulose Fibers	100%		
	Wall Covering (Green / White)	6%	Synthetic Fibers	40%		
			Vinyl Binders	60%		
40-03	Drywall Material (White)	17%	Cellulose Fibers	5%	02/19	NK
			Gypsum / Binders	95%		
	DW Paper Facing (Tan)	60%	Cellulose Fibers	100%		
	Wall Covering (Green / White)	23%	Synthetic Fibers	40%		
			Vinyl Binders	60%		
41-01	Vibration Dampener (Black)	100%	Glass Wool Fibers	25%	02/19	NK
			Rubber	75%		
41-02	Vibration Dampener (Black)	100%	Glass Wool Fibers	25%	02/19	NK
			Rubber	75%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 17 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
41-03	Vibration Dampener (Black)	100%	Glass Wool Fibers	25%	02/19	NK
			Rubber	75%		
42-01	Insulation (Yellow)	55%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	15%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
	Glass Fiber Wrap (White)	<1%	Glass Wool Fibers	100%		
	Tan Mastic (Tan)	30%	Wollastonite	5%		
			Calcite	35%		
			Binders / Fillers	60%		
42-02	Insulation (Yellow)	93%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	4%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
	Glass Fiber Wrap (White)	1%	Glass Wool Fibers	100%		
	Tan Mastic (Tan)	2%	Wollastonite	5%		
			Calcite	35%		
			Binders / Fillers	60%		
42-03	Insulation (Yellow)	97%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	2%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
	Tan Mastic (Tan)	1%	Wollastonite	5%		
			Calcite	35%		
			Binders / Fillers	60%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 18 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
43-01	Insulation (Yellow)	95%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	1%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
	Tan Mastic (Tan)	2%	Wollastonite	5%		
			Calcite	35%		
			Binders / Fillers	60%		
	White Mastic (Off-White)	2%	Synthetic Fibers	3%		
			Cellulose Fibers	2%		
			Calcite	45%		
			Binders / Fillers	50%		
43-02	Insulation (Yellow)	95%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	1%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
	Tan Mastic (Tan)	4%	Wollastonite	5%		
			Calcite	35%		
			Binders / Fillers	60%		
43-03	Insulation (Yellow)	90%	Mineral Wool Fibers	95%	02/19	NK
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	3%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
	White Mastic (Off-White)	7%	Calcite	20%		
			Binders / Fillers	80%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 19 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
44-01	Floor Tile (Dark Grey)	98%	Chrysotile	3%	02/19	NK
			Calcite / Vinyl Binders	97%		
	Black Mastic (Black)	2%	Chrysotile	5%		
			Tar Binders	95%		
44-02	Not Analyzed - Positive Stop	100%			02/19	NK
44-03	Not Analyzed - Positive Stop	100%			02/19	NK
45-01	Floor Tile (Dark Grey)	98%	Chrysotile	3%	02/19	NK
			Calcite / Vinyl Binders	97%		
	Black Mastic (Black)	2%	Chrysotile	5%		
			Cellulose Fibers	3%		
			Tar Binders	92%		
45-02	Not Analyzed - Positive Stop	100%			02/19	NK
45-03	Not Analyzed - Positive Stop	100%			02/19	NK
46-01	Floor Tile (Light Tan)	99%	Chrysotile	3%	02/19	IR
			Calcite / Vinyl Binders	97%		
	Black Mastic (Black)	1%	Chrysotile	5%		
			Tar Binders	95%		
46-02	Not Analyzed - Positive Stop	100%			02/19	IR
46-03	Not Analyzed - Positive Stop	100%			02/19	IR
47-01	Floor Tile (Light Tan)	99%	Calcite / Vinyl Binders	100%	02/19	IR
	Yellow Mastic (Yellow)	1%	Glue Binders	100%		
47-02	Floor Tile (Light Tan)	99%	Calcite / Vinyl Binders	100%	02/19	IR
	Yellow Mastic (Yellow)	1%	Glue Binders	100%		
47-03	Floor Tile (Light Tan)	99%	Calcite / Vinyl Binders	100%	02/19	IR
	Yellow Mastic (Yellow)	1%	Glue Binders	100%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 20 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
48-01	Floor Tile (Tan)	99%	Chrysotile	3%	02/19	IR
			Calcite / Vinyl Binders	97%		
	Black Mastic (Black)	1%	Chrysotile	5%		
			Tar Binders	95%		
48-02	Not Analyzed - Positive Stop	100%	02/19			IR
48-03	Not Analyzed - Positive Stop	100%	02/19			IR
49-01	Thermal Insulation (Yellow)	70%	Mineral Wool Fibers	95%	02/19	IR
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	20%	Cellulose Fibers	50%		
			Glass Wool Fibers	20%		
			Metal Foil	30%		
	White Mastic (White)	10%	Wollastonite	5%		
			Binders / Fillers	95%		
			49-02	Thermal Insulation (Yellow)		
Resin Binders	5%					
Paper / Foil Wrap (Tan / Silver)	20%	Cellulose Fibers		50%		
		Glass Wool Fibers		20%		
		Metal Foil		30%		
White Mastic (White)	10%	Wollastonite		5%		
		Binders / Fillers		95%		
		49-03		Thermal Insulation (Yellow)	70%	Mineral Wool Fibers
Resin Binders	5%					
Paper / Foil Wrap (Tan / Silver)	20%		Cellulose Fibers	50%		
			Glass Wool Fibers	20%		
			Metal Foil	30%		
White Mastic (White)	10%		Wollastonite	5%		
			Binders / Fillers	95%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 21 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
50-01	Grout (Grey)	80%	Aggregate	65%	02/19	IR
			Cement Binders	35%		
	Paint / Texture (Tan / Red)	20%	Calcite	25%		
			Pigment / Binders	75%		
50-02	Grout (Grey)	<1%	Aggregate	65%	02/19	IR
			Cement Binders	35%		
	Old Texture (Off-White)	50%	Chrysotile	2%		
			Calcite / Talc / Binders	98%		
	New Texture (White)	50%	Calcite / Talc / Binders	100%		
50-03	Not Analyzed - Positive Stop	100%			02/19	IR
51-01	Yellow Mastic (Yellow)	100%	Glue Binders	100%	02/19	IR
51-02	Yellow Mastic (Yellow)	100%	Glue Binders	100%	02/19	IR
51-03	Yellow Mastic (Yellow)	100%	Glue Binders	100%	02/19	IR
52-01	Sand Layer (Light Grey)	15%	Aggregate	100%	02/19	IR
	Roofing Tars (Black)	10%	Tar Binders	100%		
	Roofing Felts (Black)	74%	Glass Wool Fibers	45%		
			Tar Binders	55%		
	Insulation (Tan)	1%	Cellulose Fibers	80%		
			Perlite	20%		
52-02	Sand Layer (Light Grey)	15%	Aggregate	100%	02/19	IR
	Roofing Tars (Black)	10%	Tar Binders	100%		
	Roofing Felts (Black)	74%	Glass Wool Fibers	45%		
			Tar Binders	55%		
	Insulation (Tan)	1%	Cellulose Fibers	80%		
			Perlite	20%		
52-03	Sand Layer (Light Grey)	15%	Aggregate	100%	02/19	IR
	Roofing Tars (Black)	10%	Tar Binders	100%		
	Roofing Felts (Black)	75%	Glass Wool Fibers	45%		
			Tar Binders	55%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 22 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
53-01	Roofing Mastic (Black)	100%	Chrysotile	5%	02/19	IR
			Calcite	15%		
			Tar Binders	80%		
53-02	Not Analyzed - Positive Stop	100%			02/19	IR
53-03	Not Analyzed - Positive Stop	100%			02/19	IR
54-01	Sand Layer (Red)	25%	Aggregate	100%	02/19	IR
	Roofing Shingle (Black)	75%	Glass Wool Fibers	20%		
			Calcite	35%		
			Tar Binders	45%		
54-02	Sand Layer (Red)	25%	Aggregate	100%	02/19	IR
	Roofing Shingle (Black)	75%	Glass Wool Fibers	20%		
			Calcite	35%		
			Tar Binders	45%		
54-03	Sand Layer (Red)	25%	Aggregate	100%	02/19	IR
	Roofing Shingle (Black)	75%	Glass Wool Fibers	20%		
			Calcite	35%		
			Tar Binders	45%		
55-01	Paint / Texture (Multi-colored)	100%	Calcite	25%	02/19	IR
			Pigment / Binders	75%		
55-02	Paint / Texture (Off-White)	100%	Calcite	25%	02/19	IR
			Pigment / Binders	75%		
55-03	Paint / Texture (Off-White)	100%	Calcite	25%	02/19	IR
			Pigment / Binders	75%		
56-01	Grout (Grey)	10%	Aggregate	65%	02/19	IR
			Cement Binders	35%		
	Texture (Light Tan)	90%	Calcite / Talc / Binders	100%		
56-02	Grout (Grey)	20%	Aggregate	65%	02/19	IR
			Cement Binders	35%		
	Texture (Light Tan)	80%	Calcite / Talc / Binders	100%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 23 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
56-03	Grout (Grey)	90%	Aggregate	65%	02/19	IR
			Cement Binders	35%		
	Texture (Light Tan)	10%	Calcite / Talc / Binders	100%		
57-01	Grout (Grey)	99%	Aggregate	65%	02/19	IR
			Cement Binders	35%		
	Paint / Texture (Off-White)	1%	Calcite	25%		
			Pigment / Binders	75%		
57-02	Grout (Grey)	99%	Aggregate	65%	02/19	IR
			Cement Binders	35%		
	Paint / Texture (Off-White)	1%	Calcite	25%		
			Pigment / Binders	75%		
57-03	Grout (Grey)	99%	Aggregate	65%	02/19	IR
			Cement Binders	35%		
	Paint / Texture (Off-White)	1%	Calcite	25%		
			Pigment / Binders	75%		
58-01	Caulking (Grey)	100%	Calcite	60%	02/19	IR
			Binders / Fillers	40%		
58-02	Caulking (Grey)	100%	Calcite	60%	02/19	IR
			Binders / Fillers	40%		
58-03	Caulking (Grey)	100%	Calcite	60%	02/19	IR
			Binders / Fillers	40%		
59-01	Tan Caulking (Tan)	50%	Calcite	60%	02/19	IR
			Binders / Fillers	40%		
	Grey Caulking (Grey)	50%	Calcite	60%		
			Binders / Fillers	40%		
59-02	Tan Caulking (Tan)	10%	Calcite	60%	02/19	IR
			Binders / Fillers	40%		
	Grey Caulking (Grey)	90%	Calcite	60%		
			Binders / Fillers	40%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 24 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
59-03	Tan Caulking (Tan)	5%	Calcite	60%	02/19	IR
			Binders / Fillers	40%		
	Grey Caulking (Grey)	95%	Calcite	60%		
			Binders / Fillers	40%		
60-01	Sealant (Tan)	100%	Calcite	40%	02/19	IR
			Binders / Fillers	60%		
60-02	Sealant (Tan)	100%	Calcite	40%	02/19	IR
			Binders / Fillers	60%		
60-03	Sealant (Tan)	100%	Calcite	40%	02/19	IR
			Binders / Fillers	60%		
61-01	Insulation (Yellow)	45%	Mineral Wool Fibers	95%	02/19	IR
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	15%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
	Vinyl Wrap (White)	15%	Vinyl Binders	100%		
	Duct Tape (Silver)	20%	Cotton Fibers	25%		
			Vinyl Binders	50%		
			Glue Binders	25%		
	White Mastic (White)	5%	Cellulose Fibers	2%		
			Calcite	48%		
			Binders / Fillers	50%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 25 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
61-02	Insulation (Yellow)	45%	Mineral Wool Fibers	95%	02/19	IR
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	15%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
			Vinyl Binders	100%		
	Duct Tape (Silver)	20%	Cotton Fibers	25%		
			Vinyl Binders	50%		
	White Mastic (White)	5%	Glue Binders	25%		
			Cellulose Fibers	2%		
			Calcite	48%		
			Binders / Fillers	50%		
61-03	Insulation (Yellow)	75%	Mineral Wool Fibers	95%	02/19	IR
			Resin Binders	5%		
	Paper / Foil Wrap (Tan / Silver)	20%	Cellulose Fibers	60%		
			Glass Wool Fibers	20%		
			Metal Foil	20%		
			Cellulose Fibers	2%		
	White Mastic (White)	5%	Calcite	48%		
			Binders / Fillers	50%		
62-01	Stucco (Tan)	100%	Glass Wool Fibers	3%	02/19	IR
			Aggregate	62%		
			Binders / Fillers	35%		
62-02	Stucco (Tan)	100%	Glass Wool Fibers	3%	02/19	IR
			Aggregate	62%		
			Binders / Fillers	35%		
62-03	Stucco (Tan)	100%	Glass Wool Fibers	3%	02/19	IR
			Aggregate	62%		
			Binders / Fillers	35%		

Moody Labs

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

PLM Detail Report**Supplement to PLM Summary Report**

NVLAP Lab Code 102056-0

TDSHS License No. 300084

Client : TTL - San Antonio

Project : JBSA Fort Sam Houston, Harlequin Theater, Bldg 2652

Project # : 26-09-00382.00

Lab Job No. : 26B-01624

Report Date : 02/19/2026

Page 26 of 26

Sample Number	Layer	% Of Sample	Components	% of Layer	Analysis Date	Analyst
63-01	Window Glazing (Tan)	100%	Calcite Binders / Fillers	60% 40%	02/19	IR
63-02	Window Glazing (Tan)	100%	Calcite Binders / Fillers	60% 40%	02/19	IR
63-03	Window Glazing (Tan)	100%	Calcite Binders / Fillers	60% 40%	02/19	IR

2652-01624 PLM

ASBESTOS INSPECTION CHAIN OF CUSTODY FORM

Sample No.	HA	Material Description	Sample Location	Estimated Quantity	Sample Type	Disturbance Potential	Condition	Friable
1-01, 02, 03	1	Pearlite Textured Drywall System	1st floor - Lobby, Lounge, Storage		S T M	L M H	G D SD	Y N
2-01,02,03	2	Orange Peel Textured Drywall System	1st floor - Lounge Restroom, Back Stage		S T M	L M H	G D SD	Y N
3-01,02,03	3	Smooth Textured Drywall System	1st floor - Storage		S T M	L M H	G D SD	Y N
4-01,02,03	4	Dimpled Textured Drywall System	1st floor - Lobby		S T M	L M H	G D SD	Y N
5-01,02,03	5	Brick Texture/Grout	1st floor - Lounge, Back Stage		S T M	L M H	G D SD	Y N
6-01,02,03	6	CMU Texture/Grout	1st floor - Lounge Restrooms		S T M	L M H	G D SD	Y N
7-01,02,03	7	Concrete Texture	1st floor - Lounge, Back Stage, Box Office		S T M	L M H	G D SD	Y N
8-01,02,03	8	Plaster Ceiling System	1st floor - Kitchen, Dish Room		S T M	L M H	G D SD	Y N
9-01,02,03	9	Drywall Ceiling System	1st floor - BackStage		S T M	L M H	G D SD	Y N
10-01,02,03	10	1' x 1' Ceiling Tile - Fissures	1st Floor - Lounge, Box Office, Lobby		S T M	L M H	G D SD	Y N
11-01,02,03	11	1' x 1' Ceiling Tile - Fissures	2nd Floor - West Hallway, Upstairs Lounge, Hallway @ Stairwell		S T M	L M H	G D SD	Y N
12-01,02,03	12	2' x 2' Ceiling Tile - Long Fissures	1st Floor - Lounge Restrooms		S T M	L M H	G D SD	Y N

Client Name: JBSA - 802 CES/CENME, Execution Support	Date Inspected: 02/10-11/2026	Page 1 of 6
Project Name: Harlequin Theater - Building 2652	Project Number: 26-09-00382.00	
Project Location: JBSA - Fort Sam Houston	Inspector Name: Deborah Salahuddin & Nicolas Espino	
Turnaround Time: Same Day 24 Hour 3 Day 5 Day	TTL Project Manager:	
Positive Stop: Y N	Email Results to: nespino@ttlusa.com	
Analysis: PLM EPA 600 TEM Point Count		
Relinquished by (signature): Nicolas Espino	Date / Time 02-11-2026 5:30pm	Received by (Signature): Date / Time 2/12/26 9:37AM
Notes/Special Instructions:		

26B-01624

ASBESTOS INSPECTION CHAIN OF CUSTODY FORM

Sample No.	HA	Material Description	Sample Location	Estimated Quantity	Sample Type	Disturbance Potential	Condition	Friable
13-01,02,03	13	2'x2' Ceiling Tiles - Short Fissures	1st Floor - Lounge Restrooms		S T M	L M H	G D SD	Y N
14-01,02,03	14	2' x 4' Ceiling Tiles - Long Fissures	1st Floor - Auditorium, Buffet, Set Prep		S T M	L M H	G D SD	Y N
15-01,02,03	15	2' x 4' Ceiling Tiles - Short Fissures	1st Floor - Auditorium, Buffet, Set Prep		S T M	L M H	G D SD	Y N
16-01,02,03	16	16" x 16" Ceiling Tiles	2nd Floor - Stairwell, NW & SW Storage Rooms		S T M	L M H	G D SD	Y N
17-01,02,03	17	9" x 9" Dark Green Tiles with Black Mastic	1st Floor - Storage, Back Stage		S T M	L M H	G D SD	Y N
18-01,02,03	18	9" x 9" Light Green Tiles with Black Mastic	1st Floor - Back Stage		S T M	L M H	G D SD	Y N
19-01,02,03	19	9" x 9" Brown Tiles with Black Mastic	1st Floor - Back Stage		S T M	L M H	G D SD	Y N
20-01,02,03	20	9" x 9" Tan Tiles with Black Mastic	1st Floor - Work Space, Set Prep		S T M	L M H	G D SD	Y N
21-01,02,03	21	Carpet Mastic	1st Floor - Lounge, Auditorium, Box Office		S T M	L M H	G D SD	Y N
22-01,02,03	22	Wall Panel	1st Floor- Storage Room, 2nd Floor - Furnace Room, Storage		S T M	L M H	G D SD	Y N
23-01,02,03	23	Potential Aerocell Pipe Insulation	1st Floor - Storage Room		S T M	L M H	G D SD	Y N
24-01,02,03	24	Fire Suppression System Gasket	1st Floor - Storage Room		S T M	L M H	G D SD	Y N

Client Name: JBSA - 802 CES/CENME, Execution Support		Date Inspected: 02/10-11/2026	Page 2 of 6
Project Name: Harlequin Theater - Building 2652		Project Number: 26-09-00382.00	
Project Location: JBSA - Fort Sam Houston		Inspector Name: Deborah Salahuddin & Nicolas Espino	
Turnaround Time: Same Day 24 Hour 3 Day 5 Day		TTL Project Manager:	
Positive Stop: Y N		Email Results to: nespino@ttlusa.com	
Analysis: PLM EPA 600 TEM Point Count			
Relinquished by (signature): Nicolas Espino	Date / Time 02-11-2026 5:30 pm	Received by (Signature): [Signature]	Date / Time 2/11/26 9:37 AM
Notes/Special Instructions:			

26B 01624

ASBESTOS INSPECTION CHAIN OF CUSTODY FORM

Sample No.	HA	Material Description	Sample Location	Estimated Quantity	Sample Type	Disturbance Potential	Condition	Friable
25-01,02,03	3	White HVAC Register Mastic	1st Floor - Set Prep, Buffet, Auditorium		S T M	L M H	G D SD	Y N
26-01,02,03	26	1" x 1" Ceramic Floor Tile, Grout, & Thinset	Backstage Restrooms		S T M	L M H	G D SD	Y N
27-01,02,03	27	4" x 4" Gray Ceramic Wall Tile, Grout, & Thinset	Backstage Restrooms		S T M	L M H	G D SD	Y N
28-01,02,03	28	4" x 4" Cream Ceramic Wall Tile, Grout & Thinset	Dish Room, Kitchen, Kitchen Hallway		S T M	L M H	G D SD	Y N
29-01,02,03	29	6" x 6" Saltillo Red Floor Tile, Grout, & Thinset	Dish Room, Laundry, Kitchen		S T M	L M H	G D SD	Y N
30-01,02,03	30	16" x 16" Off-white Ceramic Floor Tile, Grout, & Thinset	Buffet		S T M	L M H	G D SD	Y N
31-01,02,03	31	Brown Cove Base	1st Floor - Tech, Back Stage Restrooms		S T M	L M H	G D SD	Y N
32-01,02,03	32	Black Cove Base	1st Floor - Back Stage, Second Floor - Storage		S T M	L M H	G D SD	Y N
33-01,02,03	33	12" x 12" White Ceramic Floor Tile with Grout & Thinset	Lounge Bar		S T M	L M H	G D SD	Y N
34-01,02,03	34	12" x 12" Red Ceramic Floor Tile with Grout & Thinset	Lounge Restrooms		S T M	L M H	G D SD	Y N
35-01,02,03	35	Boiler Pipe Wrap	Kitchen & Laundry		S T M	L M H	G D SD	Y N
36-01,02,03	36	Yellow Fiberglass Insulation Boiler Pipe Wrap	Kitchen & Laundry		S T M	L M H	G D SD	Y N

Client Name: JBSA - 802 CES/CENME, Execution Support		Date Inspected: 02/10-11/2026	Page 3 of 6
Project Name: Harlequin Theater - Building 2652		Project Number: 26-09-00382.00	
Project Location: JBSA - Fort Sam Houston		Inspector Name: Deborah Salahuddin & Nicolas Espino	
Turnaround Time: Same Day 24 Hour 3 Day 5 Day		TTL Project Manager:	
Positive Stop: Y N		Email Results to: nespino@ttlusa.com	
Analysis: PLM EPA 600 TEM Point Count			
Relinquished by (signature): Nicolas Espino	Date / Time 02-11-2026 5:30 pm	Received by (Signature): Good	Date / Time 2/12/26 9:37 AM
Notes/Special Instructions:			

268-01624

ASBESTOS INSPECTION CHAIN OF CUSTODY FORM

Sample No.	HA	Material Description	Sample Location	Estimated Quantity	Sample Type	Disturbance Potential	Condition	Friable
37-01,02,03	37	Pearlite Textured Drywall System	2nd Floor -Hallway Women's Restroom		S T M	L M H	G D SD	Y N
38-01,02,03	38	Orange Peel Textured Drywall System	2nd Floor - Hallway, Furnace Room, Ladies Restroom		S T M	L M H	G D SD	Y N
39-01,02,03	39	Tan Carpeted Wallpaper	1st Floor - Upstairs Lounge		S T M	L M H	G D SD	Y N
40-01,02,03	40	Green Wallpaper Drywall System	1st Floor - Stage Exit		S T M	L M H	G D SD	Y N
41-01,02,03	41	Vibration Dampener	2nd Floor - Furnace Room		S T M	L M H	G D SD	Y N
42-01,02,03	42	Tan HVAC Mastic	2nd Floor - Furnace Room		S T M	L M H	G D SD	Y N
43-01,02,03	43	Pipe Wrap	2nd Floor - Furnace Room, Upstairs Lounge		S T M	L M H	G D SD	Y N
44-01,02,03	44	12" x 12" Dark Grey Streaks VCT with Mastic	2nd Floor - Storage, Art Room, Office		S T M	L M H	G D SD	Y N
45-01,02,03	45	12" x 12" Grey Speckled VCT with Mastic	2nd Floor - Men's Restroom		S T M	L M H	G D SD	Y N
46-01,02,03	46	12" x 12" Tan VCT with Mastic	2nd Floor - Hallway, Hallway Storage, Props		S T M	L M H	G D SD	Y N
47-01,02,03	47	12" x 12" Light Tan Speckled VCT with Mastic	2nd Floor - Hallway		S T M	L M H	G D SD	Y N
48-01,02,03	48	9" x 9" Tan VCT with Mastic	2nd Floor - Hallway Storage		S T M	L M H	G D SD	Y N

Client Name: JBSA - 802 CES/CENME, Execution Support		Date Inspected: 02/10-1/2026	Page 4 of 6
Project Name: Harlequin Theater - Building 2652		Project Number: 26-09-00382.00	
Project Location: JBSA - Fort Sam Houston		Inspector Name: Deborah Salahuddin & Nicolas Espino	
Turnaround Time: Same Day 24 Hour 3 Day 5 Day		TTL Project Manager:	
Positive Stop: Y N		Email Results to: nespino@ttlusa.com	
Analysis: PLM EPA 600 TEM Point Count			
Relinquished by (signature): Nicolas Espino	Date / Time 02-11-2026 5:30pm	Received by (Signature):	Date / Time 2/11/26 9:37A
Notes/Special Instructions:			

26B-01624

ASBESTOS INSPECTION CHAIN OF CUSTODY FORM

Sample No.	HA	Material Description	Sample Location	Estimated Quantity	Sample Type	Disturbance Potential	Condition	Friable
49-01,02,03	49	White HVAC Duct Wrap	2nd Floor - Storage, Office, Women's Restroom	N/A	S T M	L M H	G D SD	Y N
50-1,02,03	50	Brick Texture & Grout	2nd Floor - Costumes, Men's Restroom, Women's Restroom	N/A	S T M	L M H	G D SD	Y N
51-1,02,03	51	Carpet Mastic	2nd Floor - Upstairs Lounge, Hallway, Women's Restroom	N/A	S T M	L M H	G D SD	Y N
52-1,02,03	52	BUR Roofing Material	Low Slope Roof Section	N/A	S T M	L M H	G D SD	Y N
53-01,02,03	53	Gray/Black Roofing Mastic	Roof	N/A	S T M	L M H	G D SD	Y N
54-01,02,03	54	Red Roofing Shingles	Roof	N/A	S T M	L M H	G D SD	Y N
55-01,02,03	55	Concrete Texture	Exterior - North Wall, East Wall, South Wall	N/A	S T M	L M H	G D SD	Y N
56-01,02,03	56	Brick Texture and Grout	Exterior - North Wall, East Wall, South Wall	N/A	S T M	L M H	G D SD	Y N
57-01,02,03	57	CMU Texture and Grout	Exterior - Behind Lounge Restrooms	N/A	S T M	L M H	G D SD	Y N
58-01,02,03	58	Grey Window Caulking	Exterior - North Wall	N/A	S T M	L M H	G D SD	Y N
59-01,02,03	59	Tan Window Caulking	Exterior - North Wall	N/A	S T M	L M H	G D SD	Y N
60-01,02,03	60	Door Sealant	Exterior - Main Entrance	N/A	S T M	L M H	G D SD	Y N
Client Name: JBSA - 802 CES/CENME, Execution Support					Date Inspected: 02/10-11-2026		Page 5 of 6	
Project Name: Harlequin Theater - Building 2652					Project Number: 26-09-00382.00			
Project Location: JBSA - Fort Sam Houston					Inspector Name: Deborah Salahuddin & Nicolas Espino			
Turnaround Time: Same Day 24 Hour 3 Day 5 Day Positive Stop: Y N Analysis: PLM EPA 600 TEM Point Count					TTL Project Manager: Email Results to: nespino@ttlusa.com			
Relinquished by (signature): Nicolas Espino			Date / Time 02-11-2026 5:30 PM		Received by (Signature): Good		Date / Time 2/12/26 9:37A	
Notes/Special Instructions:								

ASBESTOS INSPECTION CHAIN OF CUSTODY FORM

[illegible]



The Identification Specialists

Analysis Report
prepared for
TTL, Inc.

Report Date: 2/19/2026

Project Name: JBSA Ft. Sam-Harlequin Theater B2652

Project #: 26-09-00382.00

SanAir ID#: 26008280



10501 Trade Court, North Chesterfield, Virginia 23236

888.895.1177 | 804.897.1177 | fax: 804.897.0070 | LabReports@SanAir.com | SanAir.com



SanAir ID Number

26008280

FINAL REPORT

2/19/2026 3:55:15 PM

Name: TTL, Inc.

Address: 17215 Jones Maltsberger

San Antonio, TX 78247

Phone: 210-888-6100

Project Number: 26-09-00382.00

P.O. Number:

Project Name: JBSA Ft. Sam-Harlequin Theater B2652

Collected Date: 2/10/2026

Received Date: 2/12/2026 10:35:00 AM

Dear Nicolas Espino,

We at SanAir would like to thank you for the work you recently submitted. The 47 sample(s) were received on Thursday, February 12, 2026 via FedEx. The final report(s) is enclosed for the following sample(s): L-01, L-02, L-03, L-04, L-05, L-06, L-07, L-08, L-09, L-10, L-11, L-12, L-13, L-14, L-15, L-16, L-17, L-18, L-19, L-20, L-21, L-22, L-23, L-24, L-25, L-26, L-27, L-28, L-29, L-30, L-31, L-32, L-33, L-34, L-35, L-36, L-37, L-38, L-39, L-40, L-41, L-42, L-43, L-44, L-45, L-46, L-47.

These results only pertain to this job and should not be used in the interpretation of any other job. This report is only complete in its entirety. Refer to the listing below of the pages included in a complete final report.

Sincerely,

A handwritten signature in black ink, appearing to read "Abisola Kasali".

Abisola Kasali
Metals Laboratory Director
SanAir Technologies Laboratory

Final Report Includes:

- Cover Letter
- Chemistry Analysis
- Disclaimers and Additional Information

Sample conditions:

- 47 samples in Good condition.



SanAir ID Number

26008280

FINAL REPORT

2/19/2026 3:55:15 PM

Name: TTL, Inc.

Address: 17215 Jones Maltsberger

San Antonio, TX 78247

Phone: 210-888-6100

Project Number: 26-09-00382.00

P.O. Number:

Project Name: JB SA Ft. Sam-Harlequin Theater B2652

Collected Date: 2/10/2026

Received Date: 2/12/2026 10:35:00 AM

Analyst: Runkle, Maya

Test Method: SW846/M3050B/7000B

Lead Paint Analysis

PAINT Sample	Description	$\mu\text{g Pb}$ In Sample	Sample Size (grams)	Calculated RL	Sample Results	Sample Results
26008280 - 1	L-01 Tan Paint On Drywall/1st Floor-Lobby	< 10.0	0.1099	91	<91 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 2	L-02 Light Green Paint On Drywall/1st Floor-Lounge Storage	274	0.1084	92.3	2526 $\mu\text{g/g (ppm)}$	0.253 % By Weight
26008280 - 3	L-03 Dark Green Paint On Drywall/1st Floor-Lounge Storage	173	0.119	84	1455 $\mu\text{g/g (ppm)}$	0.146 % By Weight
26008280 - 4	L-04 Light Green Paint On Brick Wall/1st Floor-Lounge Storage	516	0.1121	89.2	4606 $\mu\text{g/g (ppm)}$	0.461 % By Weight
26008280 - 5	L-05 Dark Green Paint On Brick Wall/1st Floor-Lounge Storage	215	0.1222	81.8	1762 $\mu\text{g/g (ppm)}$	0.176 % By Weight
26008280 - 6	L-06 Dark Green Paint On Wood Frame/1st Floor-Lounge Storage	340	0.1134	88.2	2999 $\mu\text{g/g (ppm)}$	0.300 % By Weight
26008280 - 7	L-07 Red Paint On Metal Stand Pipe/1st Floor-Lounge Storage	161	0.1203	83.1	1342 $\mu\text{g/g (ppm)}$	0.134 % By Weight
26008280 - 8	L-08 Light Green Paint On Metal Pipe/1st Floor-Lounge Storage	207	0.1145	87.3	1808 $\mu\text{g/g (ppm)}$	0.181 % By Weight
26008280 - 9	L-09 Dark Green Paint On Metal Pipe/1st Floor-Lounge Storage	303	0.1144	87.4	2652 $\mu\text{g/g (ppm)}$	0.265 % By Weight
26008280 - 10	L-10 Tan Paint On CMU Wall/1st Floor-Lounge Women's Restroom	< 10.0	0.1138	87.9	<87.9 $\mu\text{g/g (ppm)}$	<0.009 % By Weight

Method Reporting Limit <10 $\mu\text{g}/0.1\text{ g}$ paint

Samples L-02, L-03, L-20, and L-21 contained substrate.

Signature: *Maya Runkle*

Date: 2/19/2026

Reviewed: *Kaitlyn Templeton*

Date: 2/19/2026



SanAir ID Number

26008280

FINAL REPORT

2/19/2026 3:55:15 PM

Name: TTL, Inc.

Address: 17215 Jones Maltsberger

San Antonio, TX 78247

Phone: 210-888-6100

Project Number: 26-09-00382.00

P.O. Number:

Project Name: JB SA Ft. Sam-Harlequin Theater B2652

Collected Date: 2/10/2026

Received Date: 2/12/2026 10:35:00 AM

Analyst: Runkle, Maya

Test Method: SW846/M3050B/7000B

Lead Paint Analysis

PAINT Sample	Description	$\mu\text{g Pb}$ In Sample	Sample Size (grams)	Calculated RL	Sample Results	Sample Results
26008280 - 11	L-11 Tan Paint On Brick Wall/1st Floor-Lounge	< 10.0	0.1085	92.2	<92.2 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 12	L-12 Black Paint On Drywall/1st Floor-Auditorium	< 10.0	0.1177	85	<85 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 13	L-13 Black Paint On Wood Door Frame/1st Floor-Auditorium	< 10.0	0.1122	89.1	<89.1 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 14	L-14 Cream Paint On Wood Door Frame/1st Floor-Auditorium	931	0.1173	85.3	7935 $\mu\text{g/g (ppm)}$	0.794 % By Weight
26008280 - 15	L-15 Blue/Gray Paint On Concrete Floor/1st Floor-Auditorium	< 10.0	0.1131	88.4	<88.4 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 16	L-16 Cream Paint On Plaster Ceiling/1st Floor-Kitchen	57	0.1139	87.8	498.9 $\mu\text{g/g (ppm)}$	0.050 % By Weight
26008280 - 17	L-17 Red Paint On Drywall/1st Floor-Laundry	< 10.0	0.1176	85	<85 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 18	L-18 White Paint On Drywall/1st Floor-Laundry	< 10.0	0.1178	84.9	<84.9 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 19	L-19 Cream Paint On Metal Drain Pipe/1st Floor-Laundry	939	0.1177	85	7977 $\mu\text{g/g (ppm)}$	0.798 % By Weight
26008280 - 20	L-20 Green Paint On Drywall/1st Floor-Buffer	< 10.0	0.1119	89.4	<89.4 $\mu\text{g/g (ppm)}$	<0.009 % By Weight

Method Reporting Limit <10 $\mu\text{g}/0.1\text{ g}$ paint

Samples L-02, L-03, L-20, and L-21 contained substrate.

Signature: *Maya Runkle*

Date: 2/19/2026

Reviewed: *Kaitlyn Templeton*

Date: 2/19/2026



SanAir ID Number

26008280

FINAL REPORT

2/19/2026 3:55:15 PM

Name: TTL, Inc.

Address: 17215 Jones Maltsberger

San Antonio, TX 78247

Phone: 210-888-6100

Project Number: 26-09-00382.00

P.O. Number:

Project Name: JB SA Ft. Sam-Harlequin Theater B2652

Collected Date: 2/10/2026

Received Date: 2/12/2026 10:35:00 AM

Analyst: Runkle, Maya

Test Method: SW846/M3050B/7000B

Lead Paint Analysis

PAINT Sample	Description	$\mu\text{g Pb}$ In Sample	Sample Size (grams)	Calculated RL	Sample Results $\mu\text{g/g (ppm)}$	Sample Results By Weight
26008280 - 21	L-21 Red Paint On Wood Door/1st Floor-Auditorium Tech Booth	< 10.0	0.1116	89.6	<89.6 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 22	L-22 White Paint On Brick Wall/1st Floor-Backstage Water Heater	362	0.111	90.1	3266 $\mu\text{g/g (ppm)}$	0.327 % By Weight
26008280 - 23	L-23 Tan Paint On Concrete Column/1st Floor-Backstage	165	0.12	83.3	1378 $\mu\text{g/g (ppm)}$	0.138 % By Weight
26008280 - 24	L-24 White Paint On Wood Door/1st Floor-Backstage Women's	28	0.1094	91.4	257.8 $\mu\text{g/g (ppm)}$	0.026 % By Weight
26008280 - 25	L-25 Green Paint On Concrete Column/1st Floor-BoxOffice	85	0.1167	85.7	725.3 $\mu\text{g/g (ppm)}$	0.073 % By Weight
26008280 - 26	L-26 Green Paint On Metal HVAC Duct/1st Floor-Box Office	< 10.0	0.1189	84.1	<84.1 $\mu\text{g/g (ppm)}$	<0.008 % By Weight
26008280 - 27	L-27 Black Paint On Concrete Column/1st Floor-Lounge	27	0.1218	82.1	219.8 $\mu\text{g/g (ppm)}$	0.022 % By Weight
26008280 - 28	L-28 Brown Paint On Wood Door/2nd Floor-Costumes	< 10.0	0.1075	93	<93 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 29	L-29 Pink Paint On Drywall/2nd Floor-Hallway	< 10.0	0.1144	87.4	<87.4 $\mu\text{g/g (ppm)}$	<0.009 % By Weight
26008280 - 30	L-30 Red Paint On Drywall/2nd Floor-Hallway	< 10.0	0.1241	80.6	<80.6 $\mu\text{g/g (ppm)}$	<0.008 % By Weight

Method Reporting Limit <10 $\mu\text{g}/0.1\text{ g}$ paint

Samples L-02, L-03, L-20, and L-21 contained substrate.

Signature: *Maya Runkle*

Date: 2/19/2026

Reviewed: *Kaitlyn Templeton*

Date: 2/19/2026



SanAir ID Number

26008280

FINAL REPORT

2/19/2026 3:55:15 PM

Name: TTL, Inc.

Address: 17215 Jones Maltsberger

San Antonio, TX 78247

Phone: 210-888-6100

Project Number: 26-09-00382.00

P.O. Number:

Project Name: JB SA Ft. Sam-Harlequin Theater B2652

Collected Date: 2/10/2026

Received Date: 2/12/2026 10:35:00 AM

Analyst: Runkle, Maya

Test Method: SW846/M3050B/7000B

Lead Paint Analysis

PAINT Sample	Description	$\mu\text{g Pb}$ In Sample	Sample Size (grams)	Calculated RL	Sample Results	Sample Results
26008280 - 31	L-31 Pink Paint On Metal Pipe/2nd Floor-Hallway	673	0.1189	84.1	5662 $\mu\text{g/g}$ (ppm)	0.566 % By Weight
26008280 - 32	L-32 Green Paint On Drywall/Stairwell	< 10.0	0.1212	82.5	<82.5 $\mu\text{g/g}$ (ppm)	<0.008 % By Weight
26008280 - 33	L-33 Cream Paint On Wood Facia/Exterior West	< 10.0	0.1127	88.7	<88.7 $\mu\text{g/g}$ (ppm)	<0.009 % By Weight
26008280 - 34	L-34 Cream Paint On CMU Wall/Exterior West	< 10.0	0.1128	88.7	<88.7 $\mu\text{g/g}$ (ppm)	<0.009 % By Weight
26008280 - 35	L-35 Cream Paint On Brick Wall/Exterior North	4232	0.1126	88.8	37580 $\mu\text{g/g}$ (ppm)	3.758 % By Weight
26008280 - 36	L-36 Cream Paint On Concrete Wall/Exterior North	< 10.0	0.111	90.1	<90.1 $\mu\text{g/g}$ (ppm)	<0.009 % By Weight
26008280 - 37	L-37 Black Paint On Metal Awning Framing/Exterior North	< 10.0	0.115	87	<87 $\mu\text{g/g}$ (ppm)	<0.009 % By Weight
26008280 - 38	L-38 Orange Paint On Stucco Wall/Exterior North	1866	0.1185	84.4	15750 $\mu\text{g/g}$ (ppm)	1.575 % By Weight
26008280 - 39	L-39 Maroon Paint On Stucco Wall/Exterior North	17	0.1171	85.4	145.1 $\mu\text{g/g}$ (ppm)	0.015 % By Weight
26008280 - 40	L-40 Orange Paint On Brick Wall/Exterior North	3982	0.1158	86.4	34390 $\mu\text{g/g}$ (ppm)	3.439 % By Weight
26008280 - 41	L-41	2449	0.1195	83.7	20490	2.050 %

Method Reporting Limit < 10 $\mu\text{g}/0.1\text{ g}$ paint

Samples L-02, L-03, L-20, and L-21 contained substrate.

Signature: *Maya Runkle*

Date: 2/19/2026

Reviewed: *Kaitlyn Templeton*

Date: 2/19/2026



SanAir ID Number

26008280

FINAL REPORT

2/19/2026 3:55:15 PM

Name: TTL, Inc.**Address:** 17215 Jones Maltsberger

San Antonio, TX 78247

Phone: 210-888-6100**Project Number:** 26-09-00382.00**P.O. Number:****Project Name:** JB SA Ft. Sam-Harlequin Theater B2652**Collected Date:** 2/10/2026**Received Date:** 2/12/2026 10:35:00 AM

Analyst: Runkle, Maya

Test Method: SW846/M3050B/7000B

Lead Paint Analysis

PAINT Sample	Description	$\mu\text{g Pb}$ In Sample	Sample Size (grams)	Calculated RL	Sample Results	Sample Results
	Maroon Paint On Brick Wall/Exterior North				$\mu\text{g/g (ppm)}$	By Weight
26008280 - 42	L-42	145	0.1136	88	1279	0.128 %
	Cream Paint On Metal Downspout/Exterior East				$\mu\text{g/g (ppm)}$	By Weight
26008280 - 43	L-43	< 10.0	0.1089	91.8	<91.8	<0.009 %
	Rust Brown Paint On Wood Door/Exterior East				$\mu\text{g/g (ppm)}$	By Weight
26008280 - 44	L-44	< 10.0	0.1119	89.4	<89.4	<0.009 %
	Rust Brown Paint On Metal Door/Exterior East				$\mu\text{g/g (ppm)}$	By Weight
26008280 - 45	L-45	13690	0.1103	90.7	124100	12.410 %
	Orange Paint On Metal Support Beam/1st Floor-Lounge				$\mu\text{g/g (ppm)}$	By Weight
26008280 - 46	L-46	513	0.1172	85.3	4379	0.438 %
	Pink Paint On Brick Wall/2nd Floor-Costumes				$\mu\text{g/g (ppm)}$	By Weight
26008280 - 47	L-47	324	0.1146	87.3	2825	0.283 %
	Pink Paint On Concrete Wall/2nd Floor-Costumes				$\mu\text{g/g (ppm)}$	By Weight

Method Reporting Limit < 10 $\mu\text{g}/0.1\text{ g}$ paint

Samples L-02, L-03, L-20, and L-21 contained substrate.

Signature: *Maya Runkle*

Date: 2/19/2026

Reviewed: *Kaitlyn Templeton*

Date: 2/19/2026

Disclaimer

This report is the sole property of the client account named on the chain-of-custody (COC) submitted to SanAir Technologies Laboratory, Inc. (SanAir). Results in the report are confidential information intended only for the use by the customer listed on the chain of custody. Neither results nor reports will be discussed with or released to any third party without our client's written permission. Final reports cannot be reproduced, except in full, without written approval from SanAir to assure that parts of the report are not taken out of context. This report and any information contained within shall not be edited, altered, or modified in any way by any persons or agencies receiving, viewing, distributing, or otherwise possessing a copy of this final report. The laboratory reserves the right to perform amendments to any finalized report, of which shall supersede and make obsolete any previous editions. Such changes, modifications, additions, or deletions shall be effective immediately upon notice thereof, which may be given by means including but not limited to posting on the SanAir client portal website, electronic or conventional mail, or by any other means.

The information provided in this report applies only to the samples submitted and is relevant only for the date, time, and location of sampling. The accuracy of the results of the analysis is dependent upon the method of sample procurement and information provided by the client on the COC. SanAir is not responsible for the method of sample procurement. SanAir assumes no responsibility for information provided by the client on the COC such as project number, project name, collection dates, po number, special instructions, samples collected by, sample numbers, sample identifications, sample type, selected analysis type, flow rate, total volume or area, and start stop times that may affect the validity of the results in this report. SanAir only assures the precision and accuracy of the data it generates and assumes no responsibility for errors or biasing that occur during collection prior to SanAir's receipt of the sample(s). Evaluation reports are based solely on the sample(s) in the condition in which they are received at the laboratory and on the information provided by the client on the COC. Sample(s) were received in good condition unless otherwise noted on the report. All quality control results are acceptable unless otherwise noted. SanAir does not make contamination corrections to reports based upon analysis of laboratory and/or field blanks. When the client requires samples to be tested that deviate from a specific method or condition, all reported results may be affected by the deviation. SanAir assumes no responsibility or liability for the manner in which the results are used or interpreted. SanAir's Method Detection Limits (MDL) and Reporting Limits (RL) have been derived using various materials meeting each accrediting agencies' standards. All samples are disposed of after 60 days unless otherwise requested by the client. For Lead Exposure Limits, refer to HUD Guidelines for the Evaluation and Control of Lead-Based Paint Hazards and State and Federal Regulations, where applicable.

SanAir Technologies Laboratory, Inc. participates in the Environmental Lead Accreditation Program (ELAP) administered by AIHA LAP, LLC (Laboratory ID LAP-162952), and has met the EPA's NLLAP program standards. SanAir also participates in the State of New York's DOH-ELAP program (NY Lab Id No. 11983) for lead in paint. This report does not constitute nor shall be used by the client to claim product, process, system, or person certification, approval, or endorsement by AIHA LAP, LLC, NELAC, NIST, and/or any other U.S. governmental agencies. All or some test results contained in this report may not be accredited by every local, state or federal regulatory agency. Refer to the SanAir website at www.sanair.com for copies of current certificates and scopes of various accreditations, certifications, and licenses or contact the laboratory for inquiries regarding the status or scope of an accreditation or certification.

AIHA LAP, LLC Lab ID: LAP-162952

New York State Department of Health Laboratory ID No: 11983

State of Connecticut Department of Public Health Environmental Laboratory Registration Number: PH-0105

Ohio Department of Health Environmental Lead Laboratory Approval Number E10049

State of Rhode Island Department of Health Environmental Lead Laboratory No LAO00371

Revision Date 3/24/2025



10501 Trade Ct., Suite 100
N. Chesterfield, VA 23236
804.897.1177 / 888.895.1177
Fax 804.897.0070
sanair.com

Metals & Lead Chain Of Custody

Form #70, Revision 14, 05/06/24

SanAir ID Number

26008280



Received by SL on 2/12/26 at 10:35 AM

Page 1 of 4

Company: TTL, Inc.	Project #: 26-09-00382.00	Collected By: Nicolas Espino
Address: 17215 Jones Maltsberger	Project Name: JBSA Ft. Sam - Harlequin Theater B2652	Phone #: 210.888.6100
City, St., Zip: San Antonio, Texas 78247	Date Collected: 02/10/2026	Fax #:
State Of Collection: TX Account#:	P.O. Number:	Email: nespino@ttlusa.com

Matrix Types

Metals Analysis Types

☐ Air (ug/m3) ☐ Wipe (ug/ft2)	☒ Total Concentration of Lead (AA)	☐ TCLP for Lead (TCLP)
☒ Paint ☐ Soil ☐ Bulk (ug/g or ppm)	☐ Total Concentration of RCRA 8 Metals (RCRA 8)	☐ TCLP for RCRA 8 Metals (RCRA)
☐ Other:	☐ Total Concentration of Mercury (Hg)	☐ ICP (Total Concentration of Metals) Please list metals:

Turn Around Time	Same Day ☐	1 Day ☐	2 Days ☐	3 Days ☐	4 Days ☐	5 Days ☒
------------------	-----------------------------------	--------------------------------	---------------------------------	---------------------------------	---------------------------------	--

Special Instructions	
----------------------	--

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
L-01	2-10-26 8:30am	Tan Paint on Drywall / 1st Floor - Lobby				
L-02	2-10-26 8:35am	Light Green Paint on Drywall / 1st Floor - Lounge Storage				
L-03	2-10-26 8:40am	Dark Green Paint on Drywall / 1st Floor - Lounge Storage				
L-04	2-10-26 8:45am	Light Green Paint on Brick Wall / 1st Floor - Lounge Storage				
L-05	2-10-26 8:50am	Dark Green Paint on Brick Wall / 1st Floor - Lounge Storage				
L-06	2-10-26 8:55am	Dark Green Paint on Wood Door Frame / 1st Floor - Lounge Storage				
L-07	2-10-26 9:05am	Red Paint on Metal Stand Pipe / 1st Floor - Lounge Storage				
L-08	2-10-26 9:10am	Light Green Paint on Metal Pipe / 1st Floor - Lounge Storage				
L-09	2-10-26 9:25am	Dark Green Paint on Metal Pipe / 1st Floor - Lounge Storage				
L-10	2-10-26 9:35am	Tan Paint on CMU Wall / 1st Floor - Lounge Women's Restroom				
L-11	2-10-26 9:40am	Tan Paint on Brick Wall / 1st Floor - Lounge				
L-12	2-10-26 9:45am	Black Paint on Drywall / 1st Floor - Auditorium				
L-13	2-10-26 9:55am	Black Paint on Wood Door Frame / 1st Floor - Auditorium				
L-14	2-10-26 10:00a	Cream Paint on Wood Door Frame / 1st Floor - Auditorium				

Relinquished by	Date	Time	Received by	Date	Time
Nicolas Espino	02/11/2026	5:30 pm			

If no technician is provided, then the primary contact for your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm EST will be logged in the next business day. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the 3hr TAT or a minimum charge of \$150. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Ground and Next Day Air shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.



10501 Trade Ct., Suite 100
N. Chesterfield, VA 23236
804.897.1177 / 888.895.1177
Fax 804.897.0070
sanair.com

Metals & Lead Chain Of Custody

Form #70, Revision 14, 05/06/24

SanAir ID Number: **26008280**
Received by SL on 2/12/26 at 10:35 AM
Page 2 of 4

Company: TTL, Inc.	Project #: 26-09-00382.00	Collected By: Nicolas Espino
Address: 17215 Jones Maltsberger	Project Name: JBSA Ft. Sam - Harlequin Theater B2652	Phone #: 210.888.6100
City, St., Zip: San Antonio, Texas 78247	Date Collected: 02/ 10/ 2026	Fax #:
State Of Collection: TX Account#:	P.O. Number:	Email: nespino@ttlusa.com

Matrix Types

Metals Analysis Types

☐ Air (ug/m3) ☐ Wipe (ug/ft2)	☒ Total Concentration of Lead (AA)	☐ TCLP for Lead (TCLP)
☒ Paint ☐ Soil ☐ Bulk (ug/g or ppm)	☐ Total Concentration of RCRA 8 Metals (RCRA 8)	☐ TCLP for RCRA 8 Metals (RCRA)
☐ Other:	☐ Total Concentration of Mercury (Hg)	☐ ICP (Total Concentration of Metals) Please list metals:

Turn Around Time	Same Day ☐	1 Day ☐	2 Days ☐	3 Days ☐	4 Days ☐	5 Days ☒
------------------	-----------------------------------	--------------------------------	---------------------------------	---------------------------------	---------------------------------	--

Special Instructions	
----------------------	--

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
L-15	2-10-26 10:05a	Blue/ Gray Paint on Concrete Floor / 1st Floor - Auditorium Office				
L-16	2-10-26 10:15a	Cream Paint on Plaster Ceiling / 1st Floor - Kitchen				
L-17	2-10-26 10:20a	Red Paint on Drywall / 1st Floor - Laundry				
L-18	2-10-26 10:25a	White Paint on Drywall / 1st Floor - Laundry				
L-19	2-10-26 10:35a	Cream Paint on Metal Drain Pipe / 1st Floor - Laundry				
L-20	2-10-26 10:40a	Green Paint on Drywall / 1st Floor - Buffet				
L-21	2-10-26 10:45a	Red Paint on Wood Door / 1st Floor - Auditorium Tech Booth				
L-22	2-10-26 11:00a	White Paint on Brick Wall / 1st Floor - Backstage Water Heater Closet				
L-23	2-10-26 11:05a	Tan Paint on Concrete Column / 1st Floor - Backstage				
L-24	2-10-26 11:10a	White Paint on Wood Door / 1st Floor - Backstage Women's Restroom				
L-25	2-10-26 11:15a	Green Paint on Concrete Column / 1st Floor - Box Office				
L-26	2-10-26 11:20a	Green Paint on Metal HVAC Duct / 1st Floor - Box Office				
L-27	2-10-26 11:30a	Black Paint on Concrete Column / 1st Floor - Lounge				
L-28	2-10-26 2:10pr	Brown Paint on Wood Door / 2nd Floor - Costumes				

Relinquished by	Date	Time	Received by	Date	Time
Nicolas Espino	02-11-2026	5:30 pm			

If no technician is provided, then the primary contact for your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm EST will be logged in the next business day. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the 3hr TAT or a minimum charge of \$150. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Ground and Next Day Air shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.



10501 Trade Ct., Suite 100
N. Chesterfield, VA 23236
804.897.1177 / 888.895.1177
Fax 804.897.0070
sanair.com

**Metals & Lead
Chain Of Custody**
Form #70, Revision 14, 05/06/24

SanAir ID Number

SanAir ID Number: **26008280**
Received by SL on 2/12/26 at 10:35 AM
Page 3 of 4

Company: TTL, Inc.	Project #: 26-09-00382.00	Collected By: Nicolas Espino
Address: 17215 Jones Maltsberger	Project Name: JB SA Ft. Sam - Harlequin Theater B2652	Phone #: 210.888.6100
City, St., Zip: San Antonio, Texas 78247	Date Collected: 02/10/2026	Fax #:
State Of Collection: TX Account#:	P.O. Number:	Email: nespino@ttlusa.com

Matrix Types

Metals Analysis Types

☐ Air (ug/m3) ☐ Wipe (ug/ft2)	☒ Total Concentration of Lead (AA)	☐ TCLP for Lead (TCLP)
☒ Paint ☐ Soil ☐ Bulk (ug/g or ppm)	☐ Total Concentration of RCRA 8 Metals (RCRA 8)	☐ TCLP for RCRA 8 Metals (RCRA)
☐ Other:	☐ Total Concentration of Mercury (Hg)	☐ ICP (Total Concentration of Metals) Please list metals:

Turn Around Time	Same Day ☐	1 Day ☐	2 Days ☐	3 Days ☐	4 Days ☐	5 Days ☒
------------------	-----------------------------------	--------------------------------	---------------------------------	---------------------------------	---------------------------------	--

Special Instructions	
----------------------	--

Sample #	Collection Date & Time	Sample Identification/Location	Flow Rate	Start Time	Stop Time	Volume (L) Area (Sq ft)
L-29	2-10-26 2:10pm	Pink Paint on Drywall / 2nd Floor - Hallway				
L-30	2-10-26 2:15pm	Red Paint on Drywall / 2nd Floor - Hallway				
L-31	2-10-26 2:20pm	Pink Paint on Metal Pipe / 2nd Floor - Hallway				
L-32	2-10-26 2:25pm	Green Paint on Drywall / Stairwell				
L-33	2-10-26 2:30pm	Cream Paint on Wood Facia / Exterior West				
L-34	2-10-26 2:35pm	Cream Paint on CMU Wall / Exterior West				
L-35	2-10-26 2:40pm	Cream Paint on Brick Wall / Exterior North				
L-36	2-10-26 2:45pm	Cream Paint on Concrete Wall / Exterior North				
L-37	2-10-26 2:50pm	Black Paint on Metal Awning Framing / Exterior North				
L-38	2-10-26 2:55pm	Orange Paint on Stucco Wall / Exterior North				
L-39	2-10-26 3:00pm	Maroon Paint on Stucco Wall / Exterior North				
L-40	2-10-26 3:10pm	Orange Paint on Brick Wall / Exterior North				
L-41	2-10-26 3:20pm	Maroon Paint on Brick Wall / Exterior North				
L-42	2-10-26 3:15pm	Cream Paint on Metal Downspout / Exterior East				

Relinquished by	Date	Time	Received by	Date	Time
Nicolas Espino	02-11-2026	5:30 pm			

If no technician is provided, then the primary contact for your account will be selected. Unless scheduled, the turnaround time for all samples received after 3 pm EST will be logged in the next business day. Weekend or holiday work must be scheduled ahead of time and is charged at 150% of the 3hr TAT or a minimum charge of \$150. A courier charge will be applied for same day and one-day turnaround times for offsite work. SanAir covers Ground and Next Day Air shipping. Shipments billed to SanAir with a faster shipping rate will result in additional charges.



IAQ Mold Report

Summary

TDLR License No.: LAB0117

AIHA EMPAT ID: 102577

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26F-01633

Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652

Report Date : 02/17/2026

Project # : 26-09-00382.00

Sample Date: 02/11/2026

Sample Type: Spore Trap, Non-cultured

Spore Trap Type: Zefon - Air-O-Cell

Test Method: Mold: MLQ - 0112 - Standard Profile

Page 1 of 3

On 2/12/2026, four (4) samples were submitted by a representative of TTL - San Antonio (located at 17215 Jones Maltsberger, Suite 101, San Antonio, TX 78247) for Spore Trap, Non-cultured mold analysis. This report consists of three sections; a summary section, a data detail section, and an analytical notes section.

Sample Number	Volume (liters)	Sample Description	Identification	Concentration spores/cubic meter
OS-01	75	Pre-Assessment Outdoor	Cladosporium Basidiospores Ascospores Hyphal / Spore Fragments - Dematiaceous Aspergillus / Penicillium Myxomycete / Periconia / Rust / Smut Alternaria Total:	253 33% 147 19% 147 19% 93 12% 67 9% 27 4% 27 4% 761 100%
ST-01	75	1st Floor - Lounge * See Analytical Notes report for further details	Aspergillus / Penicillium Cladosporium Hyphal / Spore Fragments - Dematiaceous Myxomycete / Periconia / Rust / Smut Ascospores Basidiospores Chaetomium Alternaria Drechslera / Bipolaris / Helminthosporum / Exserohilum group Curvularia Total:	5714 66% 1818 21% 293 3% 267 3% 160 2% 120 1% 107 1% 107 1% 80 <1% 53 <1% 8719 100%



IAQ Mold Report

Summary

TDLR License No.: LAB0117

AIHA EMPAT ID: 102577

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio**Lab Job No. :** 26F-01633**Project :** JB SA, Ft Sam Houston, Harlequin Theater, Building 2652**Report Date :** 02/17/2026**Project # :** 26-09-00382.00**Sample Date:** 02/11/2026**Sample Type:** Spore Trap, Non-cultured**Spore Trap Type:** Zefon - Air-O-Cell**Test Method:** Mold: MLQ - 0112 - Standard Profile

Page 2 of 3

On 2/12/2026, four (4) samples were submitted by a representative of TTL - San Antonio (located at 17215 Jones Maltsberger, Suite 101, San Antonio, TX 78247) for Spore Trap, Non-cultured mold analysis. This report consists of three sections; a summary section, a data detail section, and an analytical notes section.

Sample Number	Volume (liters)	Sample Description	Identification	Concentration spores/cubic meter	
ST-02	75	1st Floor - Auditorium	Cladosporium	1493	54%
			Aspergillus / Penicillium	800	29%
			Hyphal / Spore Fragments - Dematiaceous	133	5%
			Myxomycete / Periconia / Rust / Smut	80	3%
			Basidiospores	67	2%
			Alternaria	67	2%
			Ascospores	53	2%
			Ganoderma	27	<1%
			Drechslera / Bipolaris / Helminthosporium / Exserohilum group	27	<1%
			Epicoccum	13	<1%
			Chaetomium	13	<1%
			Total:	2773	100%
ST-03	75	2nd Floor - Lounge	Cladosporium	560	61%
			Aspergillus / Penicillium	133	14%
			Myxomycete / Periconia / Rust / Smut	93	10%
			Basidiospores	67	7%
			Hyphal / Spore Fragments - Dematiaceous	53	6%
			Epicoccum	13	1%
			Total:	919	100%



IAQ Mold Report

Summary

TDLR License No.: LAB0117

AIHA EMPAT ID: 102577

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio**Lab Job No. :** 26F-01633**Project :** JBSA, Ft Sam Houston, Harlequin Theater, Building 2652**Report Date :** 02/17/2026**Project # :** 26-09-00382.00**Sample Date:** 02/11/2026**Sample Type:** Spore Trap, Non-cultured**Spore Trap Type:** Zefon - Air-O-Cell**Test Method:** Mold: MLQ - 0112 - Standard Profile

Page 3 of 3

On 2/12/2026, four (4) samples were submitted by a representative of TTL - San Antonio (located at 17215 Jones Maltsberger, Suite 101, San Antonio, TX 78247) for Spore Trap, Non-cultured mold analysis. This report consists of three sections; a summary section, a data detail section, and an analytical notes section.

Sample Number	Volume (liters)	Sample Description	Identification	Concentration spores/cubic meter

This report shall not be reproduced except in full, without approval of the laboratory. Data contained in this test report relates only to the samples tested. This report does not express or imply interpretation of the results contained herein. Interpretation should be made by a qualified professional. Moody Labs assumes no responsibility for the manner in which these samples were collected or handled prior to being received at this laboratory. Volume, area, and/or weight is provided by the customer. Moody Labs assumes no responsibility for the qualifications of personnel performing sampling and/or interpretations of this data.

Analyst(s): Connor Fiscus**Lab Director :** Heather Lopez**Approved Signatory :** _____**Lab Director :** Bruce Crabb**Approved Signatory :** _____

End of Summary section (26F-01633)

Thank you for choosing Moody Labs

SMLMS v14.09

This Page Left Intentionally Blank



IAQ Mold Report

Data Detail

TDLR License No.: LAB0117

AIHA EMPAT ID: 102577

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio
Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652
Project # : 26-09-00382.00
Sample Type: Spore Trap, Non-cultured
Test Method: Mold: MLQ - 0112 - Standard Profile

Lab Job No. : 26F-01633
Report Date : 02/17/2026
Sample Date: 02/11/2026 Page 1 of 2
Spore Trap Type: Zefon - Air-O-Cell

This report consists of three sections; a summary section, a data detail section, and an analytical notes section. Results may not be reported except in full.

Sample ID:	OS-01					ST-01					ST-02				
Location:	Pre-Assessment Outdoor					1st Floor - Lounge					1st Floor - Auditorium				
Media Expires On:	Aug 2026					Oct 2026					Aug 2026				
Notes Included:						See Analytical Notes									
Volume:	75					75					75				
	Raw Ct	RL*	spores/m³	%Total	spores/m² SF	Raw Ct	RL*	spores/m³	%Total	spores/m² SF	Raw Ct	RL*	spores/m³	%Total	spores/m² SF
Alternaria	2	13	27	4%	27	8	13	107	1%	110	5	13	67	2%	67
Ascospores	11	13	147	19%	150	12	13	160	2%	160	4	13	53	2%	53
Aspergillus / Penicillium	5	13	67	9%	67	100	57	5714	66%	5700	60	13	800	29%	800
Basidiospores	11	13	147	19%	150	9	13	120	1%	120	5	13	67	2%	67
Chaetomium	-	-	-	-	-	8	13	107	1%	110	1	13	13	<1%	13
Cladosporium	19	13	253	33%	250	100	18	1818	21%	1800	112	13	1493	54%	1500
Curvularia	-	-	-	-	-	4	13	53	<1%	53	-	-	-	-	-
Drechslera / Bipolaris / Helminthosporium /	-	-	-	-	-	6	13	80	<1%	80	2	13	27	<1%	27
Epicoecum	-	-	-	-	-	-	-	-	-	-	1	13	13	<1%	13
Ganoderma	-	-	-	-	-	-	-	-	-	-	2	13	27	<1%	27
Hyphal / Spore Fragments - Dematiaceous	7	13	93	12%	93	22	13	293	3%	290	10	13	133	5%	130
Hyphal / Spore Fragments - Hyaline	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Myxomycete / Periconia / Rust / Smut	2	13	27	4%	27	20	13	267	3%	270	6	13	80	3%	80
Stachybotrys	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
TOTALS	57	-	761	100%	760	289	-	8719	100%	8700	208	-	2773	100%	2800
Analyst	Connor Fiscus					Connor Fiscus					Connor Fiscus				
Analysis Date	2/17/2026					2/17/2026					2/17/2026				
Debris Rating	2					3					2				
Debris Composition															
Fibers	2/5					2/5					1/5				
Inorganic/Other	2/5					3/5					2/5				
Insect Parts	0/5					0/5					1/5				
Pollen	1/5					0/5					2/5				
Skin/Dander	1/5					2/5					2/5				



IAQ Mold Report

Data Detail

TDLR License No.: LAB0117

AIHA EMPAT ID: 102577

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio
Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652
Project # : 26-09-00382.00
Sample Type: Spore Trap, Non-cultured
Test Method: Mold: MLQ - 0112 - Standard Profile

Lab Job No. : 26F-01633
Report Date : 02/17/2026
Sample Date: 02/11/2026 Page 2 of 2
Spore Trap Type: Zefon - Air-O-Cell

This report consists of three sections; a summary section, a data detail section, and an analytical notes section. Results may not be reported except in full.

Sample ID:	ST-03														
Location:	2nd Floor - Lounge														
Media Expires On:	Aug 2026														
Notes Included:															
Volume:	75														
	Raw Ct	RL*	spores/m ³	%Total	spores/m ² SF	-	-	-	-	-	-	-	-	-	-
Alternaria	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Ascospores	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Aspergillus / Penicillium	10	13	133	14%	130	-	-	-	-	-	-	-	-	-	-
Basidiospores	5	13	67	7%	67	-	-	-	-	-	-	-	-	-	-
Chaetomium	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Cladosporium	42	13	560	61%	560	-	-	-	-	-	-	-	-	-	-
Curvularia	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Drechslera / Bipolaris / Helminthosporium /	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Epicoecum	1	13	13	1%	13	-	-	-	-	-	-	-	-	-	-
Ganoderma	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Hyphal / Spore Fragments - Dematiaceous	4	13	53	6%	53	-	-	-	-	-	-	-	-	-	-
Hyphal / Spore Fragments - Hyaline	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
Myxomycete / Periconia / Rust / Smut	7	13	93	10%	93	-	-	-	-	-	-	-	-	-	-
Stachybotrys	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
TOTALS	69	-	919	100%	920	-	-	-	-	-	-	-	-	-	-
Analyst	Connor Fiscus														
Analysis Date	2/17/2026														
Debris Rating	2														
Debris Composition															
Fibers	1/5														
Inorganic/Other	2/5														
Insect Parts	0/5														
Pollen	1/5														
Skin/Dander	2/5														

End of Data Detail section
26F-01633

SMLMS v14.09

This Page Left Intentionally Blank



IAQ Mold Report

Analytical Notes

TDLR License No.: LAB0117

AIHA EMPAT ID: 102577

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26F-01633

Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652

Report Date : 02/17/2026

Project # : 26-09-00382.00

Sample Date : 02/11/2026

Sample Type: Spore Trap, Non-cultured

Spore Trap Type: Zefon - Air-O-Cell

Test Method: Mold: MLQ - 0112 - Standard Profile

Page 1 of 3

This report consists of three sections; a summary section, a data detail section, and an analytical notes section. Results may not be reported except in full.

Samples Analyzed

Sample No: ST-01 : 1st Floor - Lounge

Notes: Please note: the minimum reporting limit for Aspergillus / Penicillium is 57 spores / cubic meter. When comparing results to other samples, use calculated results, not raw numbers.
Please note: the minimum reporting limit for Cladosporium is 18 spores / cubic meter. When comparing results to other samples, use calculated results, not raw numbers.

Field Blanks

No discernable field blanks were submitted with this set of samples.

NOTE: All remaining samples suitable for analysis.



IAQ Mold Report

Analytical Notes

TDLR License No.: LAB0117

AIHA EMPAT ID: 102577

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Lab Job No. : 26F-01633

Project : JB SA, Ft Sam Houston, Harlequin Theater, Building 2652

Report Date : 02/17/2026

Project # : 26-09-00382.00

Sample Date : 02/11/2026

Sample Type: Spore Trap, Non-cultured

Spore Trap Type: Zefon - Air-O-Cell

Test Method: Mold: MLQ - 0112 - Standard Profile

Page 2 of 3

This report consists of three sections; a summary section, a data detail section, and an analytical notes section. Results may not be reported except in full.

Methods

Method: MLQ - 0112 / ASTM D7391: Categorization and Quantification of Airborne Fungal Structures in an Inertial Impaction.

Sample Analyzed by Optical Microscopy.

Samples are read at 100% under 400x magnification unless noted. Partial readings may be employed when concentrations are elevated. Use final spore concentrations, not raw spore counts, for interpretation of results.

Calculation: Spores/cubic meter = (Raw spore count)*(RL)

Note: RL (Reporting Limit) is based upon 1 raw spore count.

Moody Labs reports results to two significant figures (SF) for calculated values based on ASTM D7391.

This report must not be used by the customer to claim product certification, approval, or endorsement by AIHA-LAP LLC, ISO, or any agency of the Federal Government.

Legend / Key

0 - No linear trace detected (No particulate matter detected in impaction area)

1 - Trace particulate/debris (>non detect to ~5% particulate matter)

2 - Light particulate/debris (~5% to ~25% particulate matter)

3 - Moderate particulate/debris (~25% to ~75% particulate matter)

4 - Substantial particulate/debris (~75% to ~90% particulate matter)

5 - Extensive particulate/debris (>~90% particulate matter)

6 - Field blank

10 - Hold Sample

11 - Modified Analysis per Client Instructions

(-) Indicates the spore was not detected

*RL(Reporting Limit) is the analytical sensitivity, reported in spores/m³

NOTE: Particulate/debris are defined as skin, fibers, pollen grains, insect parts, fungal and/or other non-fungal particles.



IAQ Mold Report

Analytical Notes

TDLR License No.: LAB0117

AIHA EMPAT ID: 102577

2051 Valley View Lane

Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio

Project : JB SA, Ft Sam Houston, Harlequin Theater, Building 2652

Project # : 26-09-00382.00

Sample Type: Spore Trap, Non-cultured

Test Method: Mold: MLQ - 0112 - Standard Profile

Lab Job No. : 26F-01633

Report Date : 02/17/2026

Sample Date : 02/11/2026

Spore Trap Type: Zefon - Air-O-Cell

Page 3 of 3

This report consists of three sections; a summary section, a data detail section, and an analytical notes section. Results may not be reported except in full.



End of Analytical Notes section

26F-01633

This Page Left Intentionally Blank


Moody Labs
2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

IAQ Mold Report
Supplemental Overview

TDLR License No.: LAB0117
AIHA EMPAT ID: 102577

Client : TTL - San Antonio
Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652
Project # : 26-09-00382.00

Lab Job No. 26F-01633
Report Date 02/17/2026
Sample Date : 02/11/2026

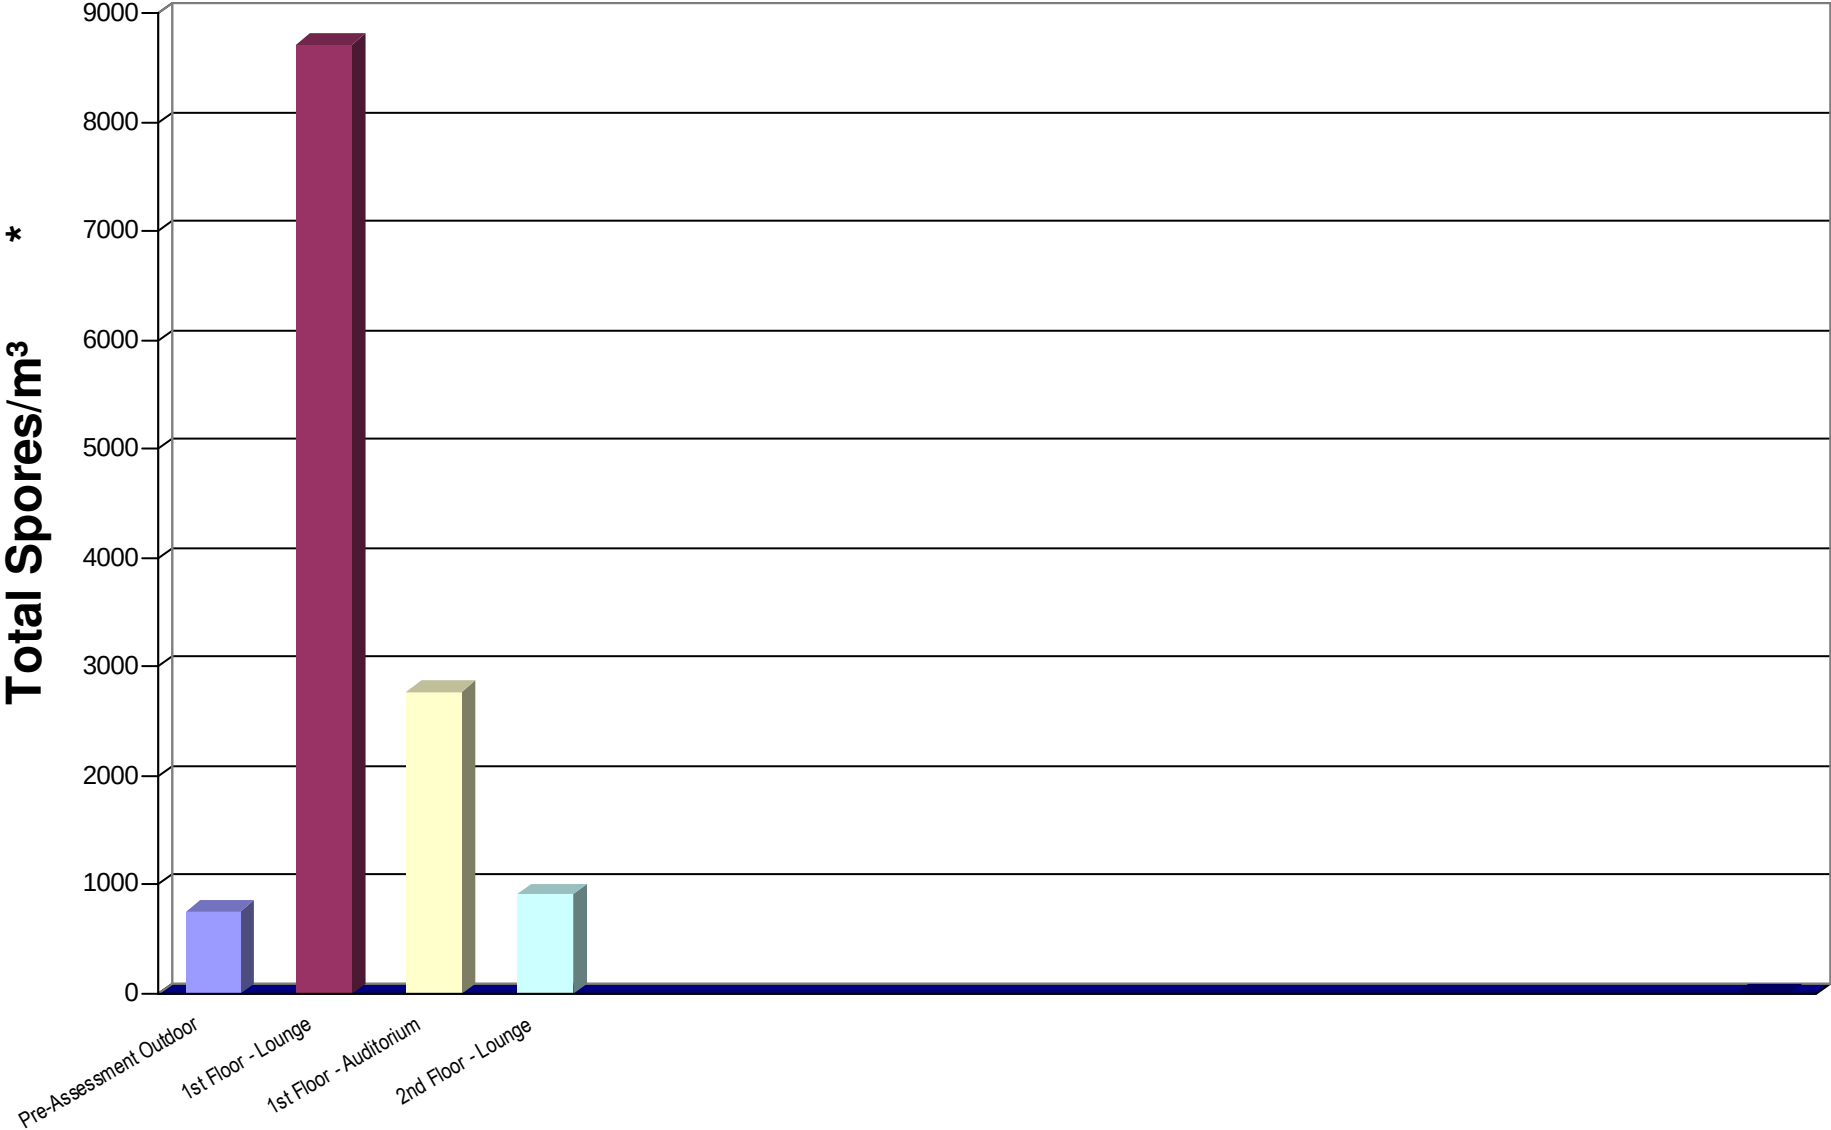



IAQ Mold Report
Supplemental Overview


TDLR License No.: LAB0117
AIHA EMPAT ID: 102577

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio
Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652
Project # : 26-09-00382.00

Pre-Assessment Outdoor

Lab Job No. 26F-01633
Report Date 02/17/2026
Sample Date : 02/11/2026

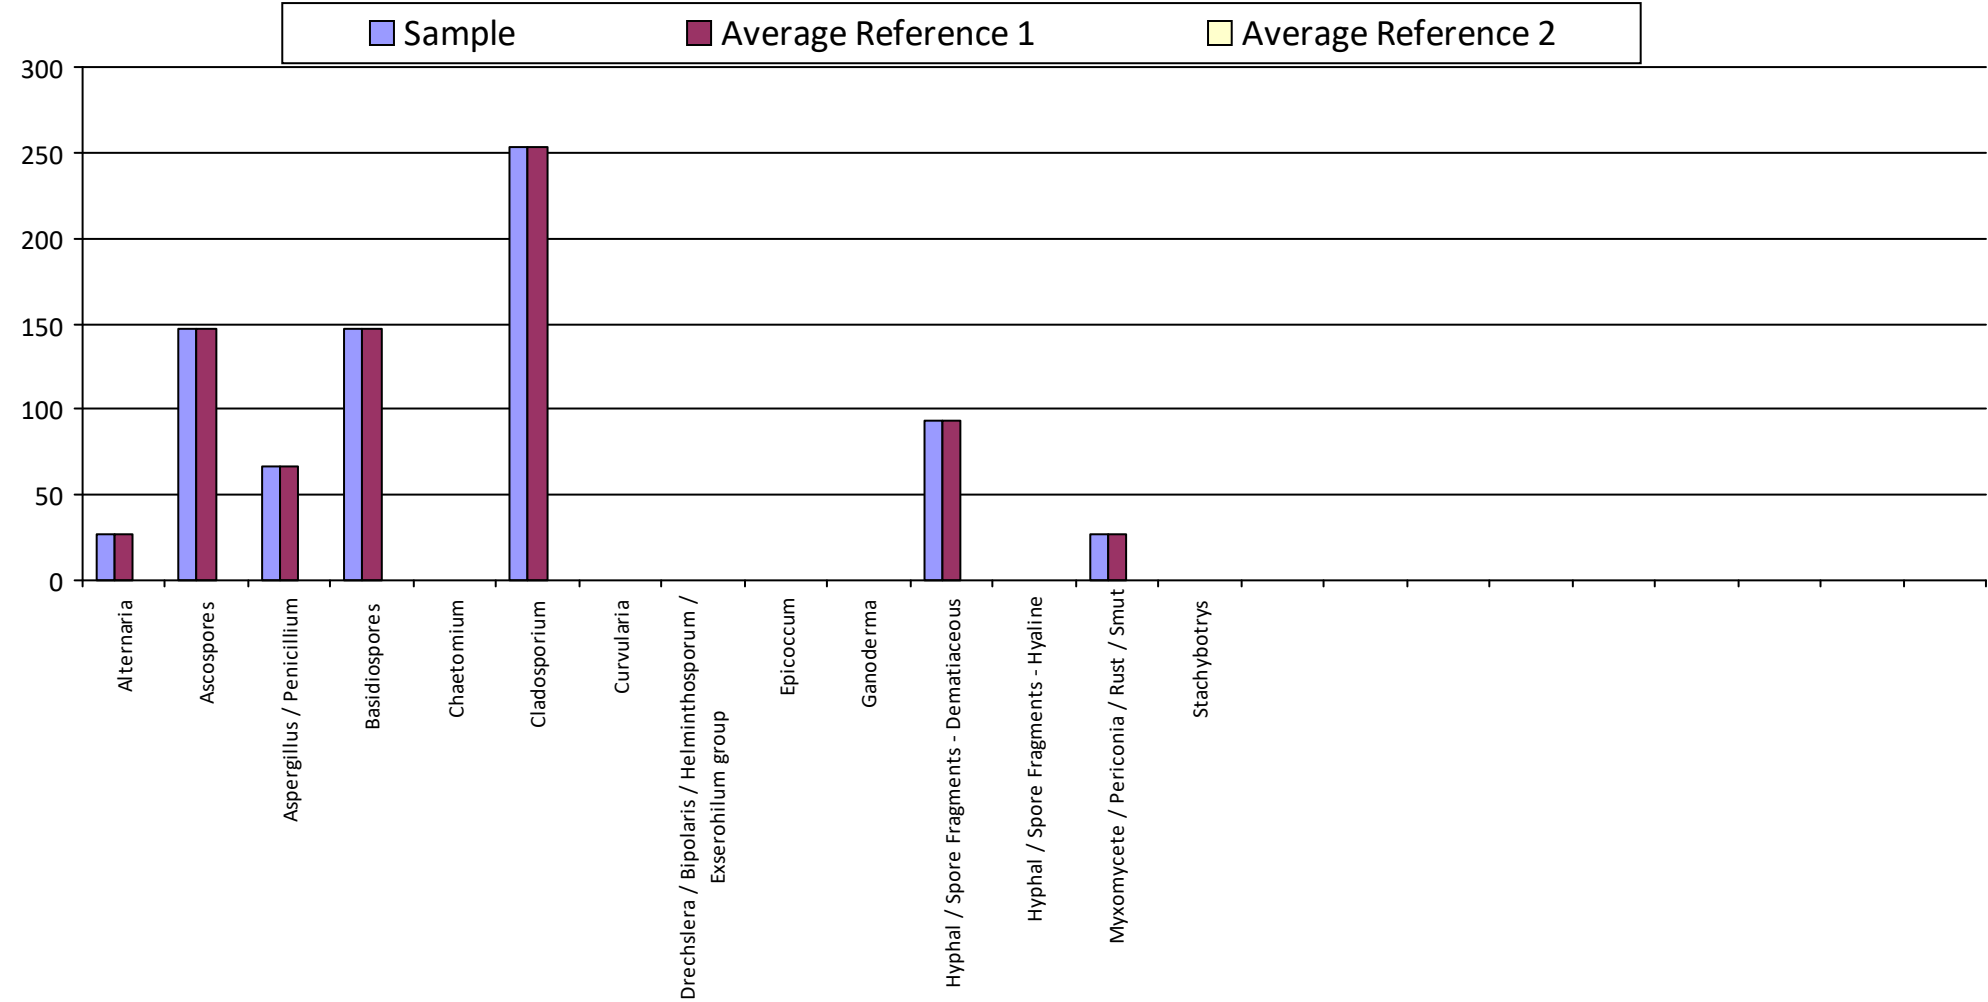

Average Reference 1 = Pre-Assessment Outdoor



IAQ Mold Report
Supplemental Overview


TDLR License No.: LAB0117
AIHA EMPAT ID: 102577

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio
Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652
Project # : 26-09-00382.00

1st Floor - Lounge

Lab Job No. 26F-01633
Report Date 02/17/2026
Sample Date : 02/11/2026

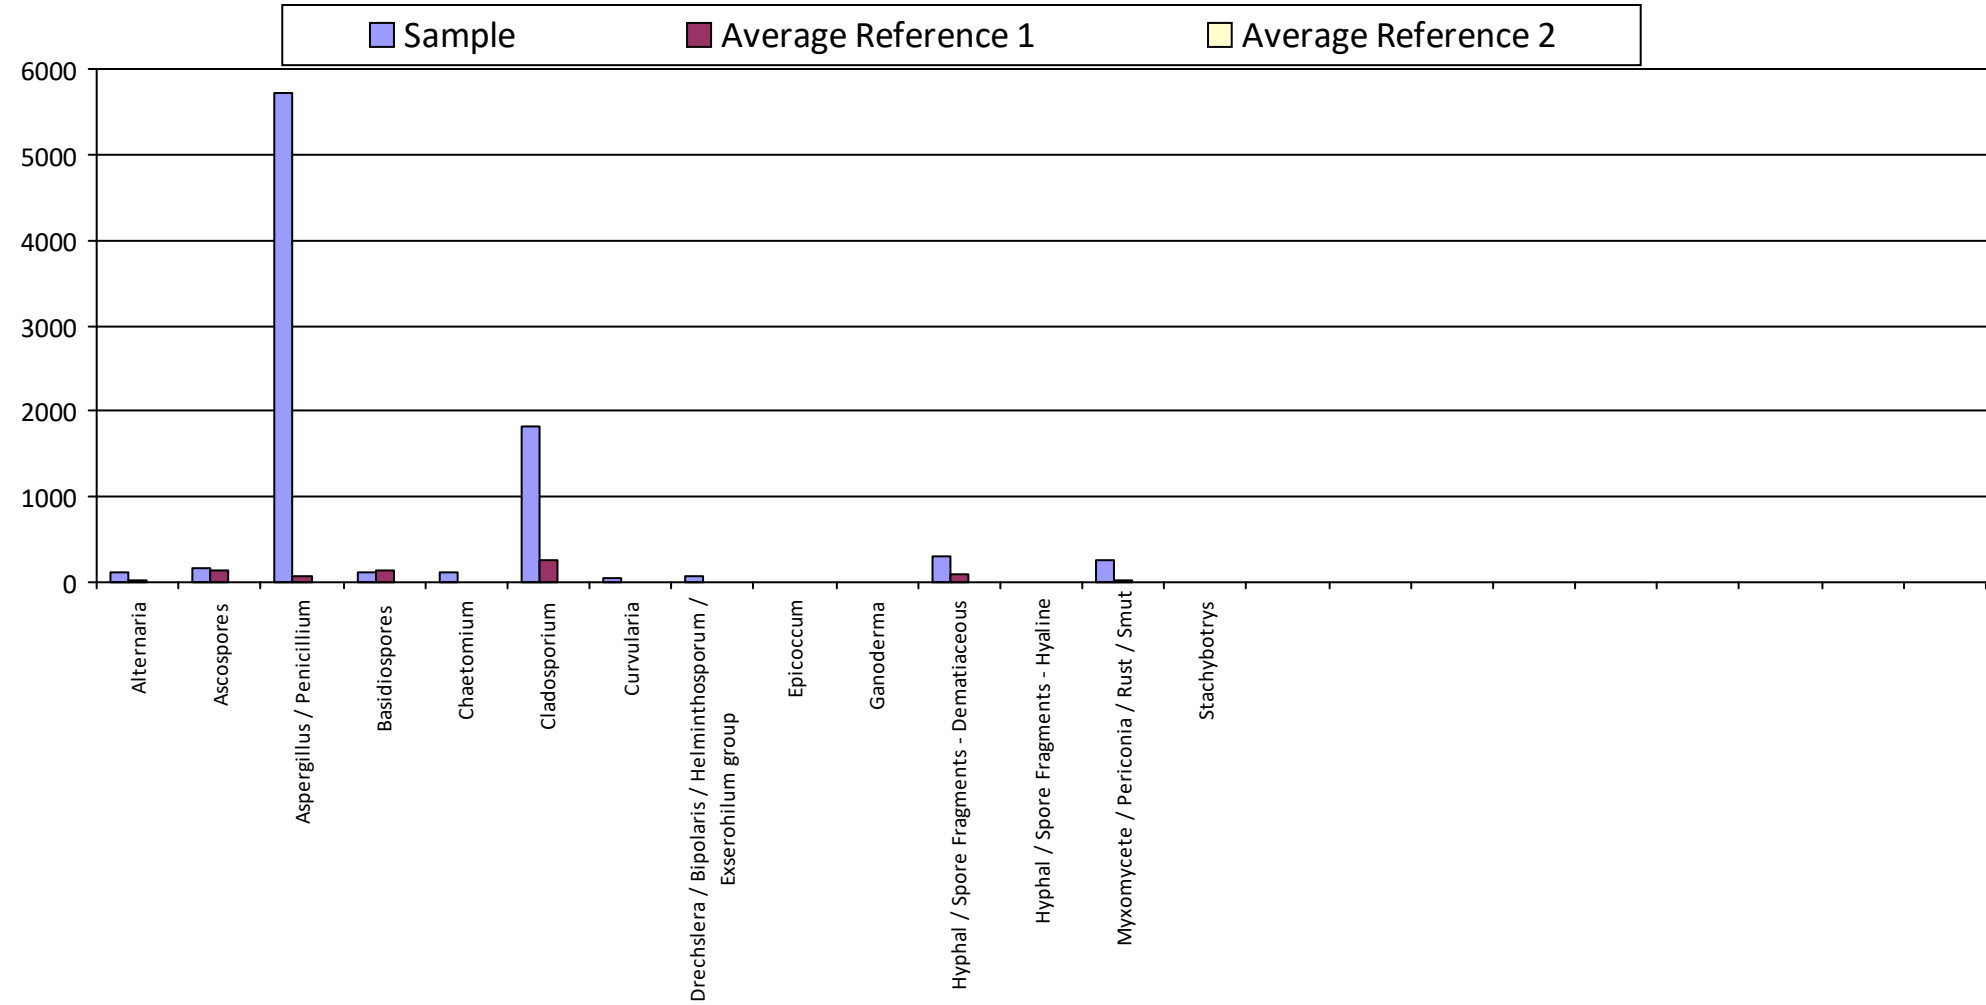

Average Reference 1 = Pre-Assessment Outdoor



IAQ Mold Report
Supplemental Overview


TDLR License No.: LAB0117
AIHA EMPAT ID: 102577

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460

Client : TTL - San Antonio
Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652
Project # : 26-09-00382.00

1st Floor - Auditorium

Lab Job No. 26F-01633
Report Date 02/17/2026
Sample Date : 02/11/2026

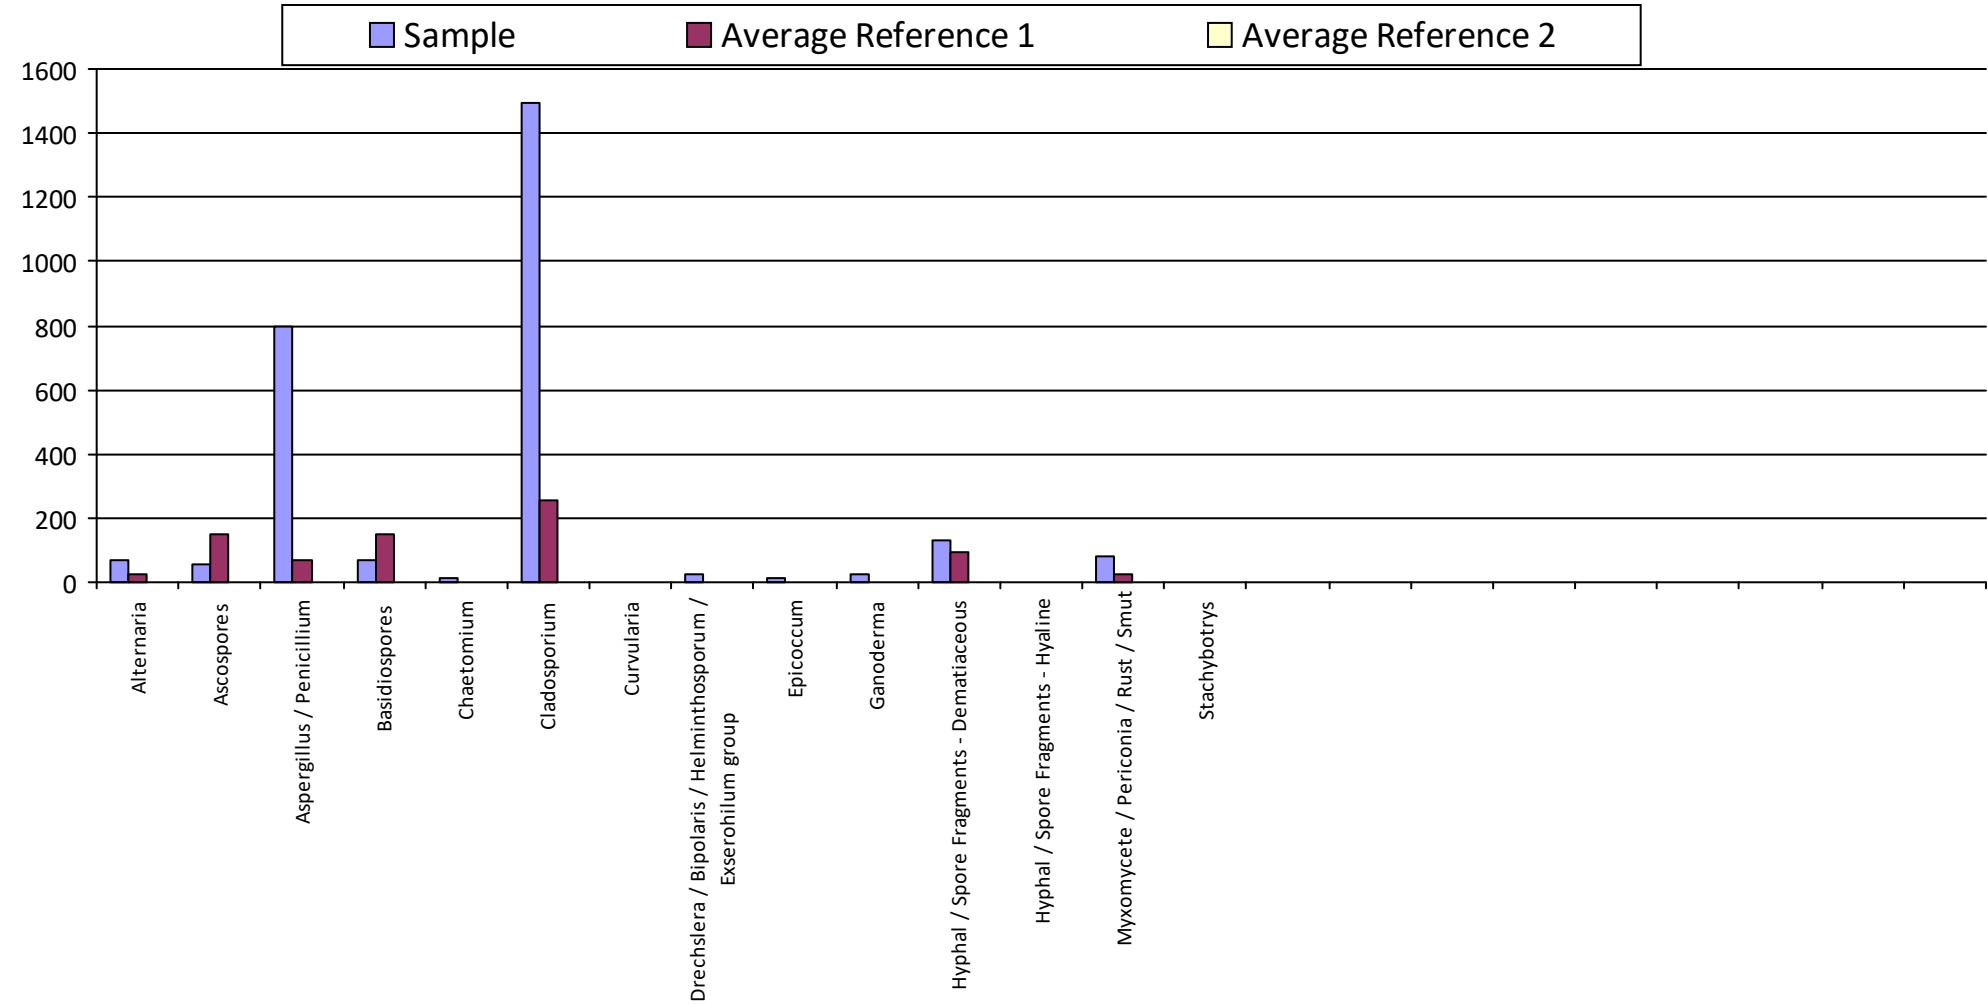

Average Reference 1 = Pre-Assessment Outdoor



IAQ Mold Report
Supplemental Overview


TDLR License No.: LAB0117
AIHA EMPAT ID: 102577

2051 Valley View Lane
Farmers Branch, TX 75234 Phone: (972) 241-8460


Client : TTL - San Antonio
Project : JBSA, Ft Sam Houston, Harlequin Theater, Building 2652
Project # : 26-09-00382.00

2nd Floor - Lounge

Lab Job No. 26F-01633
Report Date 02/17/2026
Sample Date : 02/11/2026

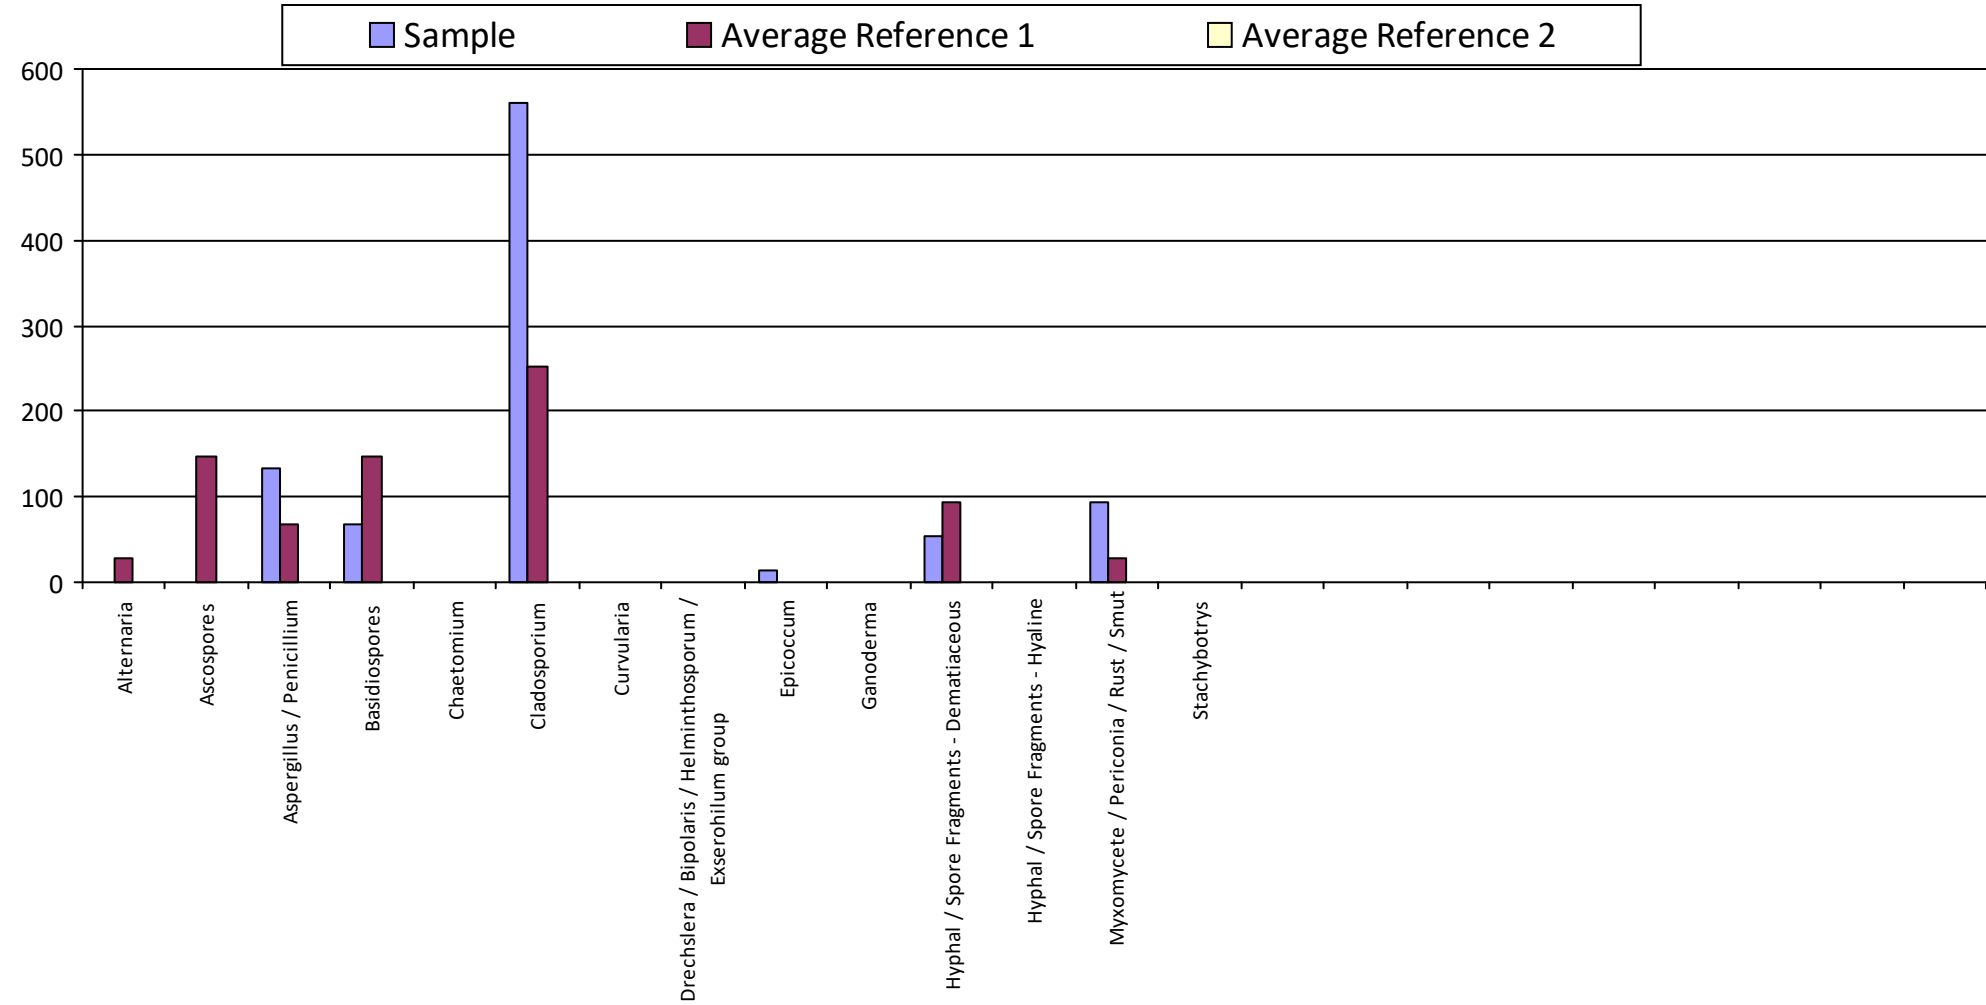

Average Reference 1 = Pre-Assessment Outdoor



Lab Job # 26F - 01633 JH Doc-4
 Lab Job # _____
 Lab Job # _____

Please call in advance for after hours / immediate pricing & availability

Page 1 of 1

Bulk ☐ Immediate ☐ 1 day ☐ 2 day ☐ 3 day ☐ 5-7 day
☐ **Analyze All** ☐ **Positive Stop**

☐ Immediate ☐ 1 day ☐ 2 day ☐ 3 day ☐ 5 day
Analyze Blanks ☐ Yes ☐ No

☐ 1 day ☐ 2 day

Air AHERA Method ☐ Late Night* ☐ 6 hr ☐ 12 hr ☐ 24 hr
 Air 7402 (Modified) ☐ 1 day ☐ 2 day ☐ 3 day
 Bulk ☐ 1 day ☐ 2 day ☐ 3 day ☐ 5 day
 Water/Wipe/Micro Vac ☐ 1 day ☐ 2 day ☐ 3 day
Analyze Blanks ☐ **Yes** ☐ **No**

*Late night analysis surcharges apply

of Samples: 4 Sample Date: 02/11/2026

Project #:26-09-00382.00

Phone #: 210.888.6100

Mobile #:

P.O. #:

☐ Direct Exam ☐ Immed ☐ 1 day ☐ 2 day ☐ 5 day
☐ Standard Air ☐ Immed ☐ 1 day ☐ 2 day ☒ 5 day
☐ Expanded Air ☐ Immed ☐ 1 day ☐ 2 day ☐ 5 day
☐ TPC w/ Yeast & Mold (TYMC)** ☐ 5 day
 Culture* ¹ ☐ 14 days
Analyze Blanks ☐ Yes ☐ No

Total Plate Count (TAMC) ☐ 2 day
Coliform & E. coli (P/A) ☐ 1 day
Coliform & E. coli (Q) ☐ 1 day

****Please note Bacteria / Mold Culture turnarounds are approximate and subject to analytical requirements****

OTHER:

[illegible]

Released By: Nicolas Espino	Date / Time: 02-11-26 / 5:30pm	Received By: Good	Date / Time: 2/12/26 9:37
Released By:	Date / Time:	Received By:	Date / Time:

APPENDIX C
SITE PHOTOGRAPHS



PHOTO 1: View is of the building exterior.



PHOTO 2: View is of the asbestos containing 9" x 9" dark green floor tile with black mastic.



PHOTO 3: View is of the asbestos containing 9" x 9" tan floor tile with black mastic.



PHOTO 4: View is of the asbestos containing insulation on boiler and associated pipe lines.

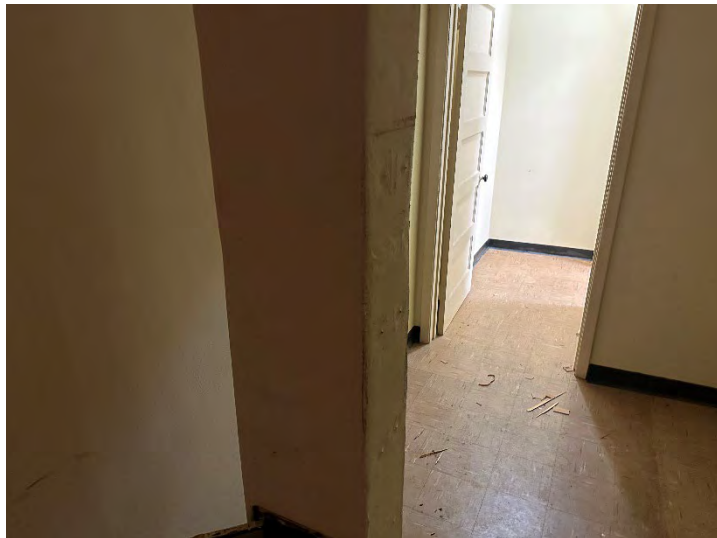


PHOTO 5: View is of the asbestos-containing 9" x 9" tan floor tile with black mastic.



PHOTO 6: View is of the asbestos-containing gray/black roofing mastic.



PHOTO 7: View is of cream Lead-Based Paint (LBP) on wood door frame.



PHOTO 8: View is of cream LBP on metal drainpipe.



PHOTO 9: View is pink LBP on metal pipe.



PHOTO 10: View is of cream LBP on brick wall.



PHOTO 11: View is of orange LBP on stucco wall.

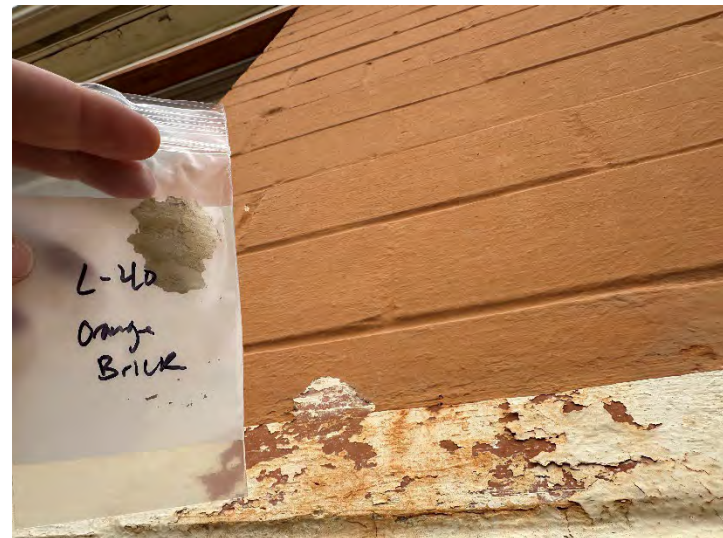


PHOTO 12: View is of orange LBP on brick wall.



PHOTO 13: View is of mercury containing fluorescent lamp



PHOTO 14: View is of CFL bulbs.



PHOTO 15: View is of the “No PCB” lamp ballast.



PHOTO 16: View is of the mercury containing thermostats.



PHOTO 17: View is of water damage in auditorium.



PHOTO 18: View is of water damage on ceiling tile in prop room.



PHOTO 19: View is of water intrusion event in kitchen.



PHOTO 20: View is of visible mold growth on wall in furnace room.

APPENDIX D
LICENSES / CERTIFICATIONS



Texas Department of State Health Services

**TTL INC DBA
TTL CONSULTING, INC**

is certified to perform as an

Asbestos Consultant Agency

in the State of Texas and is hereby governed by the rights, privileges and responsibilities set forth in Texas Occupations Code, Chapter 1954 and Title 12, Texas Administrative Code, Chapter 295 relating to Texas Asbestos Health Protection, as long as this license is not suspended or revoked.



License Number: 100550

Expiration Date: 02/06/2027

Control Number: 97732

J. Shuford, MD
**Jennifer Shuford, MD, MPH,
Commissioner of Health**

(Void After Expiration Date)

VOID IF ALTERED NON-TRANSFERABLE

SEE BACK



Texas Department of State Health Services

BE IT KNOWN THAT

**TTL INC DBA
TTL CONSULTING, INC**

is certified to perform as a

Lead Firm


*in the State of Texas and is hereby governed by the rights, privileges and responsibilities
set forth in Texas Occupations Code, Chapter 1955 and Title 25, Texas Administrative Code, Chapter 295
relating to Texas Environmental Lead Reduction, as long as this license is not suspended or revoked.*



Certification Number: 2110644

Expiration Date: 03/26/2027

Control Number: 7649


**Jennifer Shuford, MD,
MPH, Commissioner of
Health**

(Void After Expiration Date)

VOID IF ALTERED NON-TRANSFERABLE

SEE BACK



TEXAS DEPARTMENT OF LICENSING AND REGULATION

P.O. Box 12157
Austin, Texas 78711-2157
1-800-803-9202 (512) 463-6599
www.tdlr.texas.gov

If you cut around the border of the license it will fit in
a standard 5" x 7" frame.

11919382-ACO1228

TTL INC.
17215 JONES MALTSBERGER RD
SAN ANTONIO TX 78247-2808

452408010000650101



Rick Figueroa
Chair

Thomas F. Butler
Vice Chair



Gerald R. Callas, M.D., F.A.S.A.
Nora Castañeda
Sujeeth Draksharam
Lori High, R.N., N.P., Retired
Gary F. Wesson, D.D.S., M.S.

Mold Assessment Company

TTL INC.

17215 JONES MALTSBERGER RD SAN ANTONIO

CHESTER DRASH - PRESIDENT

License Number: ACO1228

The entity named above is licensed by the Texas Department of Licensing and Regulation.

License Expires: March 20, 2027

Courtney Arbour
Executive Director



TEXAS

Health and Human
Services

Texas Department of State
Health Services

Asbestos Inspector

NICOLAS A ESPINO


License Number: 603646

Control Number: 101306

Expiration Date: 29-Oct-2027



Department of State Health Services certifies that
NICOLAS A ESPINO
is certified as a
Lead Risk Assessor
Certification No: 2071258
Control No: 8394
Expires: 9/1/2027

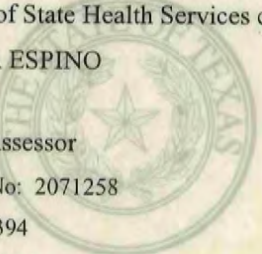The seal of the State of Texas is visible in the background of the text. It features a five-pointed star in the center, surrounded by a circular border with the words "THE STATE OF TEXAS".

STATE OF TEXAS

NICOLAS ANDRES ESPINO

MOLD ASSESSMENT CONSULTANT



LICENSE NUMBER MAC1943
EXPIRES 05/10/2027

TEXAS DEPARTMENT OF LICENSING & REGULATION

License Number: 603987

Current Date: 03/11/2026 04:12 PM

Name:	SALAHUDDIN, DEBORAH AKUA
License Type:	Asbestos Inspector
License Status:	Current
Expiry Date:	01/24/2028
Effective Rank Date:	01/25/2022

Addresses

Mailing Address

Address

SALAHUDDIN, DEBORAH AKUA
SAN ANTONIO , TX
BEXAR
78224
US

Phone Number:

2106830332