
Engine Model(s): PW150

74-11-00

Figure 1 Ignition Exciter Installation

Figure 1 Ignition Exciter Installation

Export Classification: ECCN=Contains 10-25% 9E991;ECL=NSR

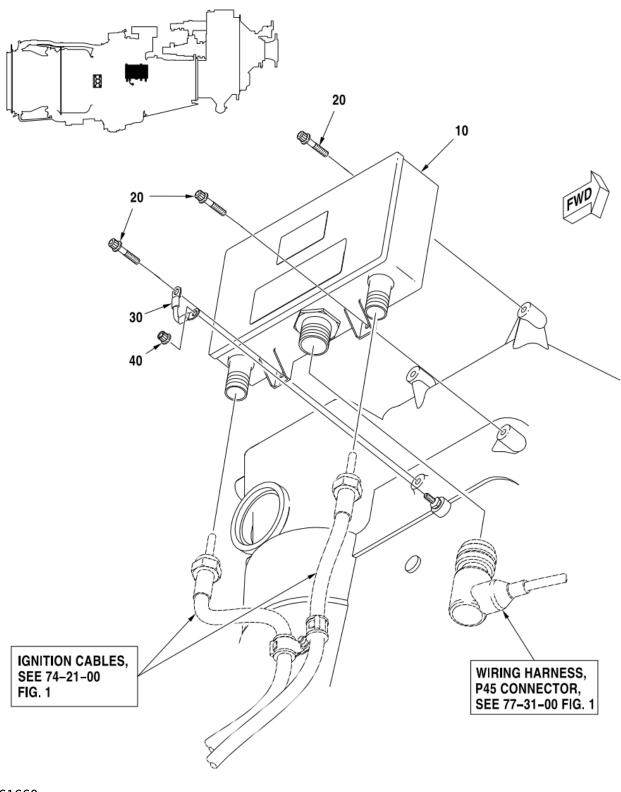

c61660

	Fig. Item	Part No.	Airline Part No.	Nomenclature	Effect Code	Units Per Assy.
_	1			IGNITION EXCITER INSTALLATION SEE 72-00-00 FIG.1 FOR NHA		REF
	10	CH92043		■ EXCITER, IGNITION FOR COMPLETE BREAKDOWN AND ADDITIONAL INFORMATION REFER TO CHAMPION AVIATION PRODUCTS COMPONENT MAINTENANCE MANUAL P/N 74-11-04 SUPPLIER CODE: 0AFL4 P&WC P/N: 3122413-05 (PRC 02): TWO-WAY INTRCHG WITH P/N CH92043-1 PRE-SB35052		1
_	10A	CH92043-		■ EXCITER, IGNITION FOR COMPLETE BREAKDOWN AND ADDITIONAL INFORMATION REFER TO CHAMPION AVIATION PRODUCTS COMPONENT MAINTENANCE MANUAL P/N 74-11-04 SUPPLIER CODE: 0AFL4 P&WC P/N: 3122413-06 (PRC 02): TWO-WAY INTRCHG WITH P/N CH92043-2 POST-SB35052 PRE-SB35104		1
_	10B	CH92043- 2		■ EXCITER, IGNITION FOR COMPLETE BREAKDOWN AND ADDITIONAL INFORMATION REFER TO CHAMPION AVIATION PRODUCTS COMPONENT MAINTENANCE MANUAL P/N 74-11-04 SUPPLIER CODE: 0AFL4 P&WC P/N: 3122413-07 (PRC 02): TWO-WAY INTRCHG WITH P/N CH92043-3 MAY BE OBTAINED BY REWORK OF P/N 3122413-06 POST-SB35104 PRE-SB35241		1
_	10C	CH92043- 3		EXCITER, IGNITION FOR COMPLETE BREAKDOWN AND ADDITIONAL INFORMATION REFER TO CHAMPION AVIATION PRODUCTS COMPONENT MAINTENANCE MANUAL		1

Fig. Item	Part No.	Airline Part No.	Nomenclature	Effect Code	Units Per Assy.
			P/N 74-11-04 SUPPLIER CODE: 0AFL4 P&WC P/N: 3122413-08 <u>POST-SB35241</u>		
20	MS9696- 08		ATTACHING PARTS • BOLT, MACHINE, DBL HEX *		4
30	ST3413- 01		CABLE ASSY, GROUND, BRAIDED		1
40	ST3030- 09		ATTACHING PARTS • NUT OPTION (IC) SEE NUT OPTION TABLE *		1

[—] ITEM NOT ILLUSTRATED