Engine Model(s): PW150

77-11-00

Figure 3 Torque Sensors Installation

Figure 3 Torque Sensors Installation

Export Classification: ECCN=Contains 10-25% 9E991;ECL=NSR

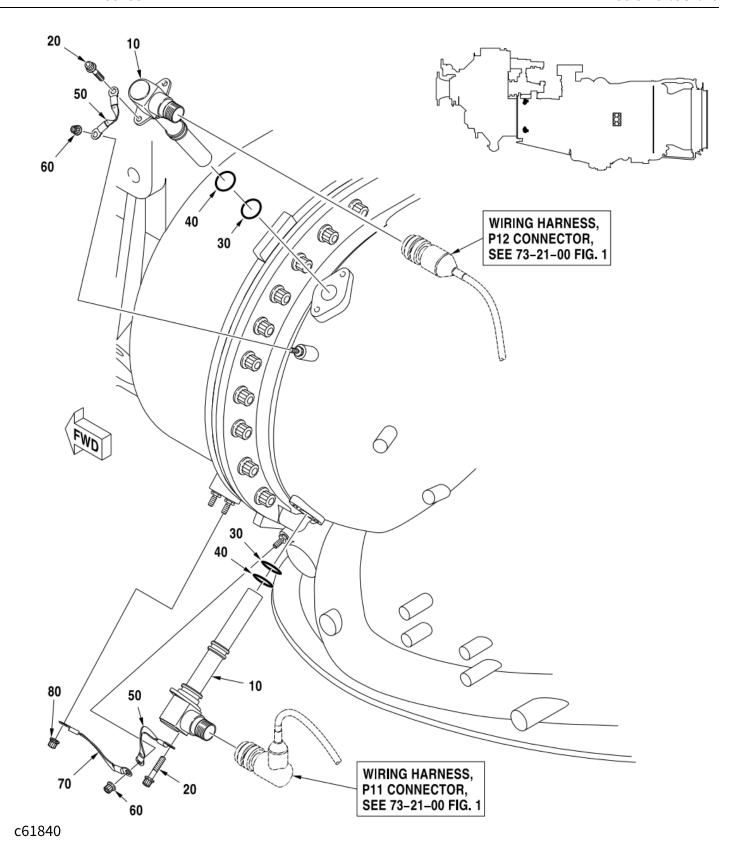


	Fig. Item	Part No.	Airline Part No.	Nomenclature	Effect Code	Units Per Assy.
_	1			TORQUE SENSORS INSTALLATION SEE 72-00-00 FIG.1 FOR NHA		REF
	10	3047252- 01		• SENSOR, TORQUE (PRC 02): TWO-WAY INTRCHG WITH P/N 3047252-02 PRE-SB35281		2
_	10A	3047252- 02		• SENSOR, TORQUE <u>POST-SB35281</u>		2
	20	MS9696- 08		ATTACHING PARTS • BOLT, MACHINE, DBL HEX *		4
	30	AS3209- 114		■ PACKING, PREFORMED (PRC 02): TWO-WAY INTRCHG WITH P/N ST6202-114 PRE-SB35178		2
_	30A	ST6202- 114		■ PACKING, PREFORMED POST-SB35178		2
	40	AS3209- 116		PACKING, PREFORMED (PRC 02): TWO-WAY INTRCHG WITH P/N ST6202-116 PRE-SB35178		2
_	40A	ST6202- 116		■ PACKING, PREFORMED POST-SB35178		2
	50	ST3413- 01		- CABLE ASSY, GROUND, BRAIDED		2
	60	ST3030- 09		ATTACHING PARTS • NUT OPTION (IC) SEE NUT OPTION TABLE *		2
	70	ST3414-		■ CABLE ASSY, GROUND, BRAIDED		1

Fig. Item	Part No.	Airline Part No.	Nomenclature	Effect Code	Units Per Assy.
80	ST3030- 09		ATTACHING PARTS • NUT OPTION (IC) SEE NUT OPTION TABLE*		1

[—] ITEM NOT ILLUSTRATED