



Radiation Tests: LT1681 Controller Chip




- TID and SEE tests performed together at a flux of 2.4×10^8 p/cm²/s
 - Frequency of output pulses were monitored, as well as 1.25 V and 5 V reference voltages
 - No change in frequencies happened and a maximum of 3% drop in 1.25 V reference voltages was seen (will cause 3% brick voltage drop)
 - The soft start pin was also being monitored for Single Event Upsets (SEUs), as there is an internal SR latch connected to this pin
 - Few SEUs were observed, but due to external protection, transients were short, and they won't cause any trips in the bricks
- In overall, **the chips passed TID and SEE tests**
- **NIEL tests showed no issues**

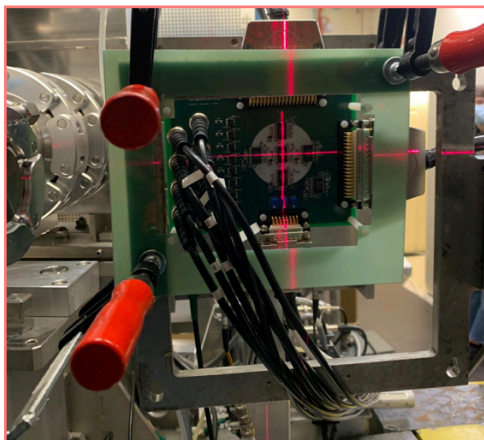

LT1681 test board at PIF

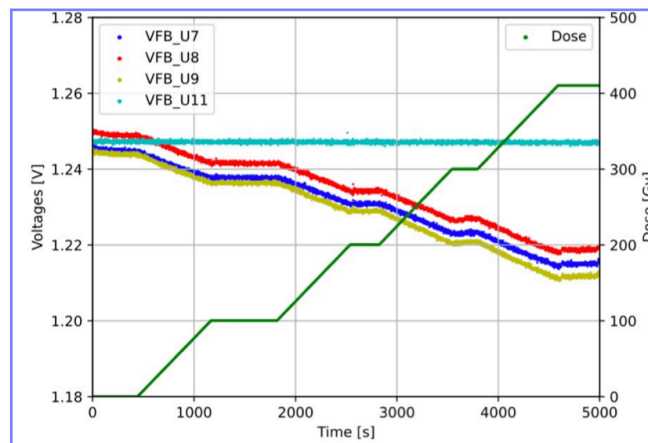

1.25 V reference voltage in LT1681

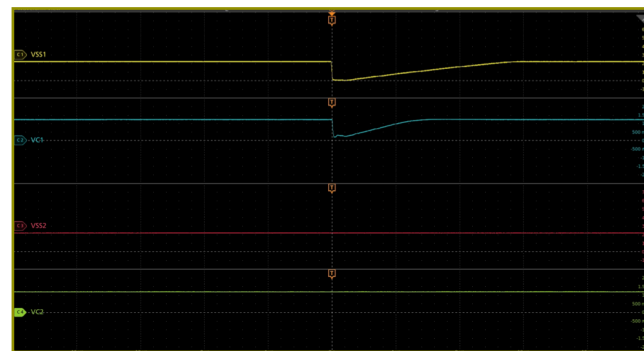

SETs in LT1681