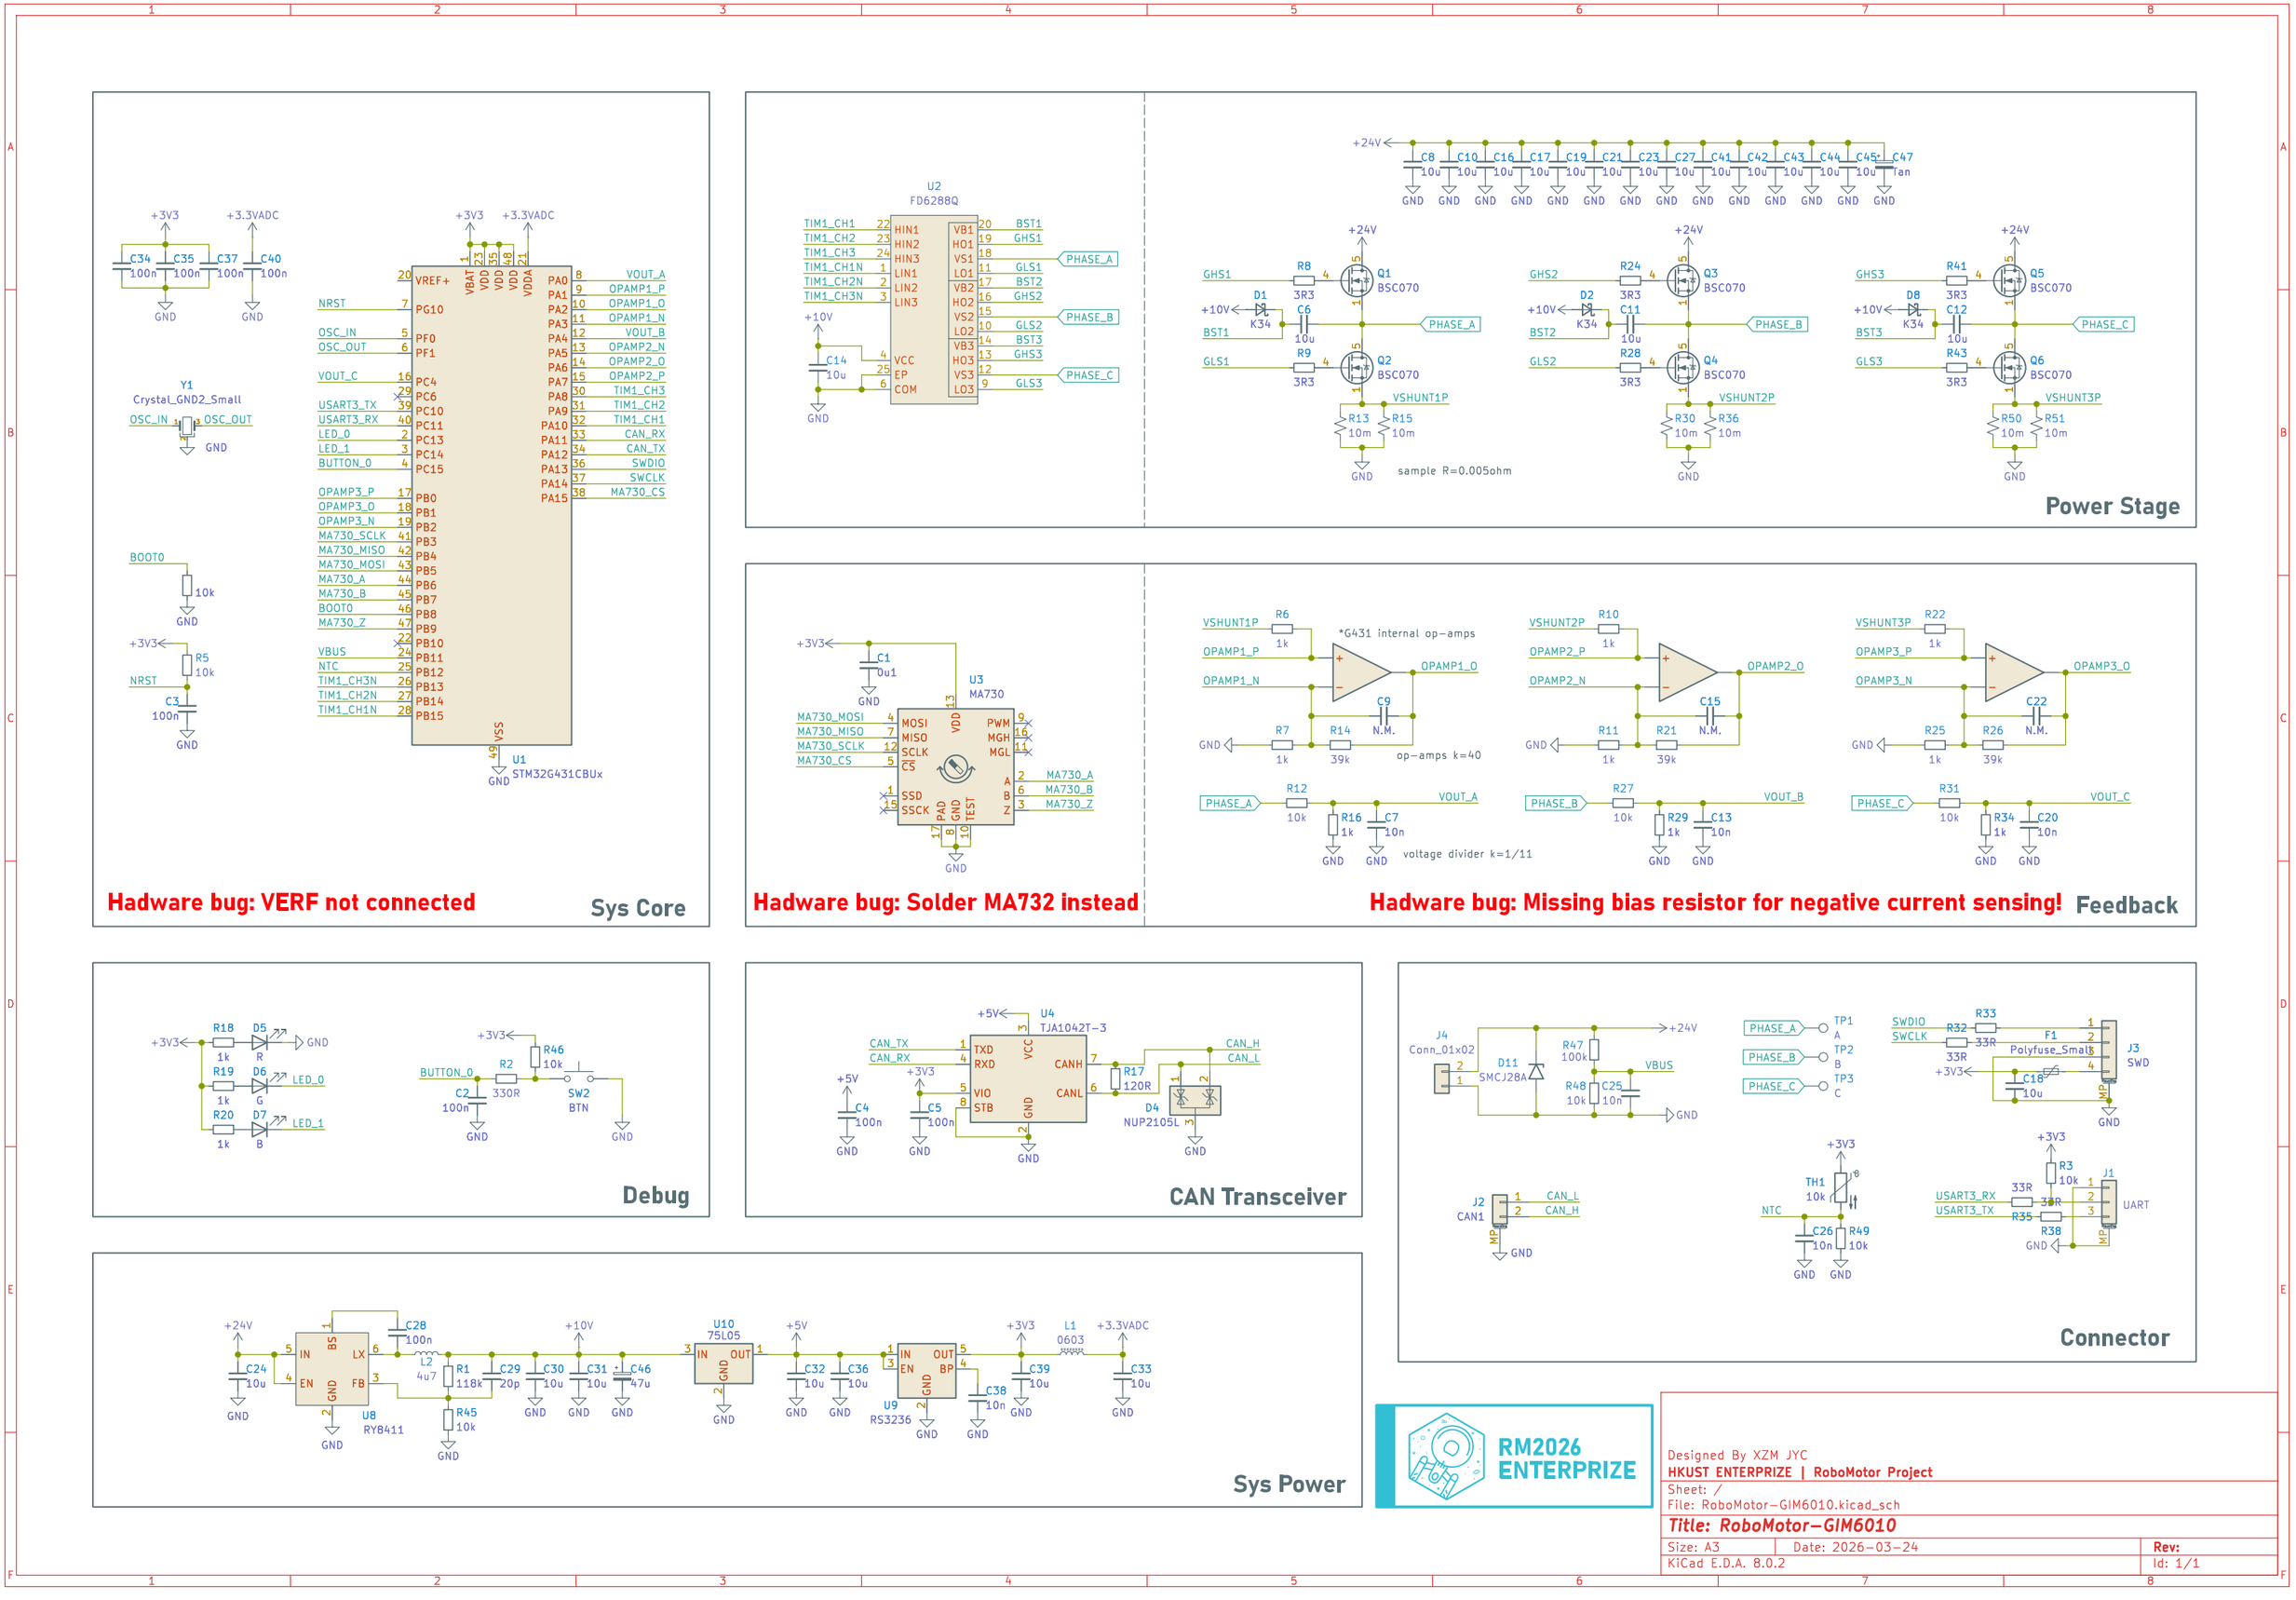
Sys Core
Hadware bug: VERF not connected
U1
STM32G431CBUx
Y1
Crystal_GND2_Small
Hadware bug: Solder MA732 instead
U2
FD6288Q
U3
MA730
Power Stage
sample R=0.005ohm
Feedback
*G431 internal op-amps
op-amps k=40
voltage divider k=1/11
Hadware bug: Missing bias resistor for negative current sensing!
Debug
CAN Transceiver
U4
TJA1042T-3
Connector
J4
Conn_01x02
J2
CAN1
J3
SWD
J1
UART
Sys Power
U8
RY8411
U10
75L05
U9
RS3236
RM2026
ENTERPRIZE
Designed By XZM JYC
HKUST ENTERPRIZE | RoboMotor Project
Sheet: /
File: RoboMotor-GIM6010.kicad_sch
Title: RoboMotor-GIM6010
Size: A3
Date: 2026-03-24
Rev:
KiCad E.D.A. 8.0.2
Id: 1/1