
FIELD REFERENCE / 3D & CAD


From pictures to printable CAD.

Recover shape · set dimensions · rebuild geometry · check the print

86 sources | 21 repositories | 22 chapters | live calculators | works offline

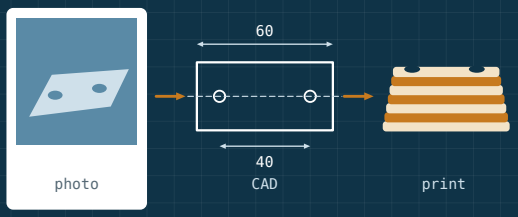

Recover shape. Establish dimensions. Build editable geometry. Check the part you print.

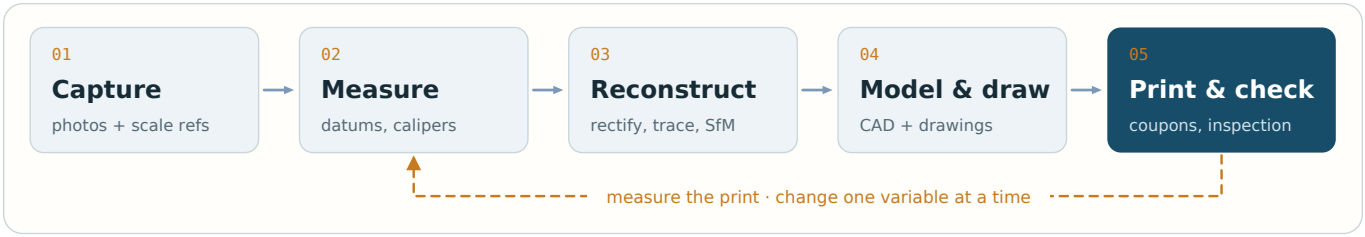

86 annotated resources · 21 GitHub projects · Practical workflows · Advanced geometry · 14 calculators · Reusable worksheets

Prepared November 8, 2026 · Revision 3

A source-backed learning and reference package. Synthetic examples are labeled. No real reconstruction, software benchmark, or physical print qualification is implied.

Contents

1. Start with the result you need 3
2. Understand the representations 5
3. What photographs can and cannot determine 6
4. Capture a useful evidence set 8
5. Scale, perspective, and uncertainty 9
6. Workflow A: one picture to a profile-based part 12
7. Workflow B: several views to editable mechanical CAD 13
8. Workflow C: photographs to a printable organic mesh 13
9. Workflow D: mesh or point cloud to engineering surfaces 14
10. Workflow E: organic subjects with mechanical interfaces 14
11. Design around a held or purchased object 16
12. Advanced geometry that pays off 17
13. AI-generated geometry and neural reconstruction 19
14. Turn the model into useful CAD drawings 20
15. Design for the actual printing process 20
16. Mechanisms: reconstruct function before decoration 22
17. Scripted pipelines and reproducible geometry 22
18. Validate the whole chain 23
19. Biology, anatomy, and specimen resources 25
20. Troubleshooting by symptom 25
21. A staged learning plan 27
22. What this reference library establishes 27
23. Companion toolkit 28
Research map and evidence notes 30
Annotated source directory 35
Synthetic two-hole plate 49
Project worksheets 50

1. Start with the result you need

This handbook is a practical reference for reconstructing objects from photographs, drawings, silhouettes, and scanned geometry. Prepared **November 8, 2026**. It combines established documentation, research leads, and original engineering examples. It is not a test report for a particular printer or reconstruction package.

For a replacement part, start with its interfaces: the holes, shafts, mating faces, clearances, and overall envelope. For a sculpture, start with silhouette, surface coverage, wall thickness, and a stable base. For a moving assembly, identify the separate bodies, joints, constraints, and collision envelope before sculpting the visible exterior.


An attractive reconstruction can be dimensionally wrong. A watertight mesh can be difficult to edit. A CAD solid can contain thousands of tiny planar faces instead of meaningful cylinders and holes. A technically correct model can still fail when printed in an unsuitable orientation. Treat these as separate milestones.

The practical default: photograph for shape, measure for size, reconstruct important features in parametric CAD, and print a small fit test before the full part. This workflow is an engineering synthesis, not a promise of automatic accuracy.

Choose a route

Available input and desired result	Start here	Deliverable	Main missing information
One image of a flat plate, sign, or profile	Correct perspective; trace a constrained outline; extrude	Editable sketch and solid	Thickness, back face, and true scale
One image of a bottle, knob, or turned shape	Establish the axis; fit a profile; revolve	Parametric revolved solid	Hidden bore, wall thickness, non-axisymmetric details
Several views of a mechanical part	Measure key interfaces; fit sketches and analytic features	Feature-based CAD and drawings	Occluded features and design intent
Many overlapping images of a textured sculpture	Photogrammetry; inspect and repair the mesh	Scaled mesh, optional CAD mounting features	Underside, deep recesses, fine texture-poor areas
Only one artistic or AI-generated image	Interpret proportions; use image-to-3D as a candidate	Approximate concept model	Unseen geometry, actual scale, physical feasibility
CT or MRI image volume	Segment calibrated voxels; extract a surface	Anatomical surface mesh	Segmentation uncertainty and application-specific validation

The COLMAP tutorial describes the multi-view reconstruction path. FreeCAD's scaled-image tutorial demonstrates an image used as a modeling reference. 3D Slicer segmentation documentation addresses the distinct volume-imaging path.

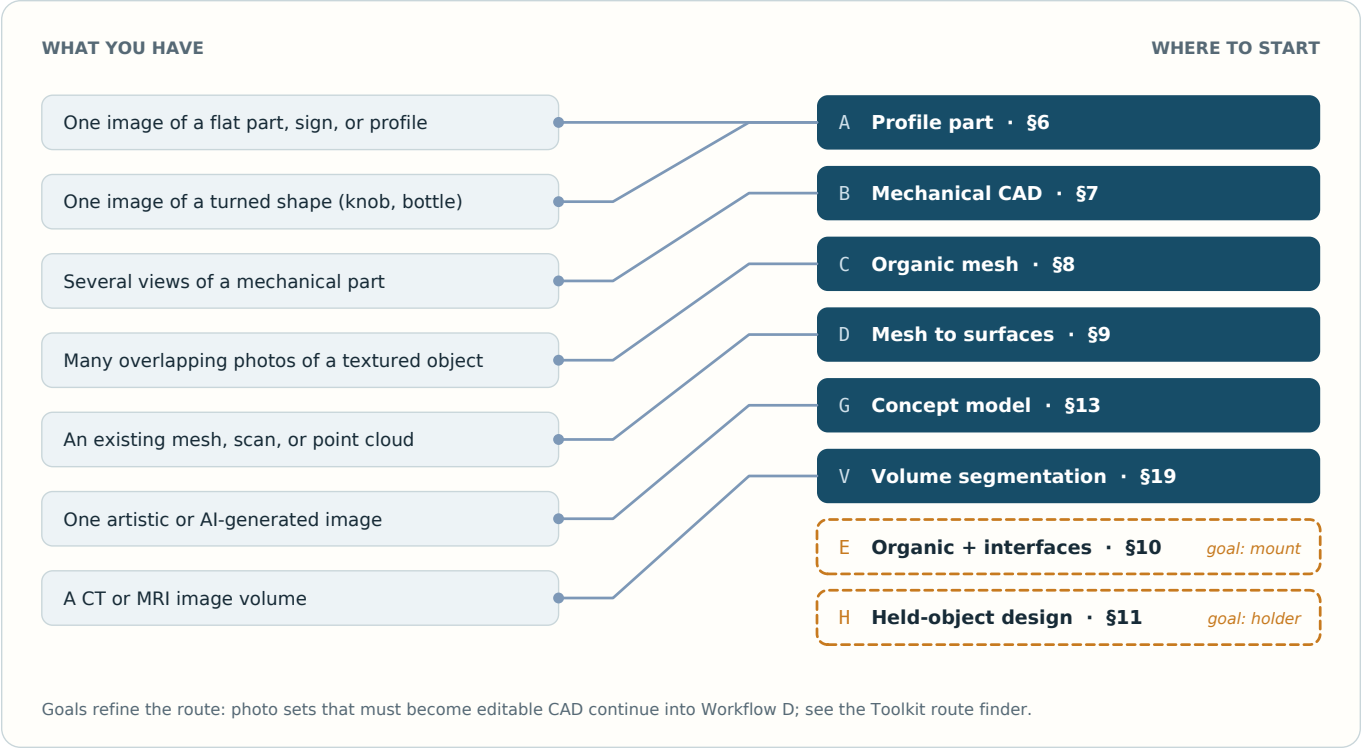

Route map. Each kind of input leads to a starting workflow; an exact mount or a held object redirects to Workflow E or section 11. The Toolkit's route finder applies the same rules and adds checks and sources.

Make the governing decisions first

A few choices control every later number. Make them explicitly, record each with a date and a reason, and change them deliberately. Otherwise each script, export, or drawing quietly implies its own answer, and the answers drift apart.

- **Use environment:** where the object will live, how it is handled, the main viewing directions, and the space around it, such as shelf height, enclosure walls, and room for hands or tools.
- **Scale:** real size, or a stated ratio such as 1:10 relative to a named reference dimension. When a scene contains several subjects, one scale factor applies to all of them unless a deliberate exception is recorded.
- **One current design and one coordinate frame:** name the origin, axes, up direction, and units. If another frame is needed, such as a scan frame, camera frame, or alternative layout, store the transform between the frames as data rather than a note not to mix them.
- **Process and machine:** filament, resin, or another process; printer; material; usable build volume; likely orientation. Minimum feature sizes have no meaning until this is chosen.
- **Part strategy:** one fused body or separate printed parts, and how parts locate, attach, and are replaced.
- **Acceptance criteria:** for each critical interface, what will be measured and what result passes.
- **Provenance and rights:** where each input came from, what its terms allow, and what may be redistributed with the project.

When alternative designs are explored, mark one as current and archive the others with their status. Parallel designs with different datums, clearances, and envelopes cause confusion that later measurement cannot resolve. The project brief and the design-parameter register in the worksheets record these decisions.

2. Understand the representations

Raster image: pixels carrying color or intensity. An edge may be geometry, paint, texture, reflection, or shadow. Ordinary photographs do not encode reliable metric depth.

Vector drawing: lines, arcs, and curves in a plane. SVG and DXF can carry useful profiles, but imported paths need checks for scale, duplicate entities, gaps, and self-intersections. A bitmap trace is usually an outline, not an engineering sketch with constraints.

Point cloud: samples of a surface. Points may include normals or colors. An empty area means no usable observation; it does not prove that the object has a hole there.

Triangle mesh: vertices, edges, and faces approximating a surface. Meshes work well for sculptures and slicing. Triangle count alone says little about measurement accuracy.

B-rep solid: a boundary representation built from surfaces, trimmed faces, edges, and vertices that delimit a volume. A sphere may be represented analytically rather than as thousands of triangles. A valid B-rep does not necessarily contain the original modeling history.

Parametric feature model: dimensions and constraints drive sketches, extrusions, revolutions, holes, fillets, patterns, and assemblies. This is often the most useful replacement-part deliverable because a measured hole position or thickness can be changed intentionally.

Drawing: selected views of the model with dimensions, datums, sections, notes, and revision information. It communicates what must be manufactured and inspected. It is a companion to the model, not a substitute for volumetric geometry when slicing.

Implicit field: a function defines the surface, often as a zero level set. Signed distance fields are useful for offsets and Boolean operations, but converting them into a printable mesh introduces sampling and meshing choices.

Useful references: CadQuery, build123d, FreeCAD TechDraw, and sxyu/sdf.

File handoff

File	Appropriate role	Check before handing it over
Native CAD file or modeling script	Editable design master	Parameters, dependencies, regeneration, and units
STEP	Exchange of engineering geometry	Solid validity, units, names, and whether history is lost
STL	Widely supported triangulated print geometry	Unit convention, scale, normals, and closed volume
3MF	Manufacturing-oriented model/package	Units and supported extensions; distinguish geometry from slicer settings
OBJ / PLY	Scan, mesh, point, or appearance exchange	Which attributes survived export and whether faces are present

File	Appropriate role	Check before handing it over
SVG / DXF	Planar profile or drawing exchange	Units, closed loops, curve interpretation, line duplication
PDF	Human-readable drawing or reference	Readable dimensions, revision, page size, and projection convention
G-code	Machine-specific manufacturing instructions	Exact printer/profile/material compatibility and preview

Prefer the editable master plus an exchange model, a print mesh, and an inspection drawing. Consult the 3MF specification directory for the format's actual capabilities. Do not assume that renaming a file converts its contents or that a mesh export preserves editable feature history.

Units, axes, and frames do not travel reliably

STL and OBJ files carry no unit. Most slicers assume millimetres, so a model authored in metres or inches can arrive 1000 or 25.4 times the wrong size. The glTF 2.0 specification defines a right-handed frame with +Y up and linear distances in metres, while many CAD and slicing tools present +Z as up in millimetres. A 3MF model declares its unit, with millimetre as the default in the 3MF core specification. Sculpting, game, and scanning tools vary.

On every import, state the expected unit and up axis, convert explicitly, and compare the resulting bounding box with a known dimension before doing anything else. A model lying on its back, or scaled by its depth instead of its height, usually traces back to this step. Record the conversion next to the file.

3. What photographs can and cannot determine


A single projected point is compatible with many positions along a viewing ray. Without extra evidence, a silhouette does not uniquely determine depth, wall thickness, back-side shape, or material. Symmetry, repeated features, known parts, and manufacturing conventions can narrow the possibilities, but those are assumptions until verified.

Separate every recovered dimension into one of four classes:

1. **Measured:** obtained directly with a suitable instrument or a verified drawing.
2. **Image-derived:** calculated from an image with a stated scale and geometric assumptions.
3. **Inferred:** chosen from symmetry, nominal standards, or likely manufacturing intent.
4. **Unknown:** unavailable and still requiring evidence.

Do not conceal an inferred depth by giving it many decimal places. Use an assumption register and identify how each important uncertainty will be resolved. A purchased bearing's manufacturer drawing is better evidence of its bore and shoulder requirements than an oblique photograph.

Evidence class propagates. A calculated value inherits the weakest class among its inputs. A 3D length computed from an image-derived position and an assumed depth is inferred, however many decimals it carries. Carry the class into derived tables, guide curves, and reports so that a proposal does not later read as a measurement.

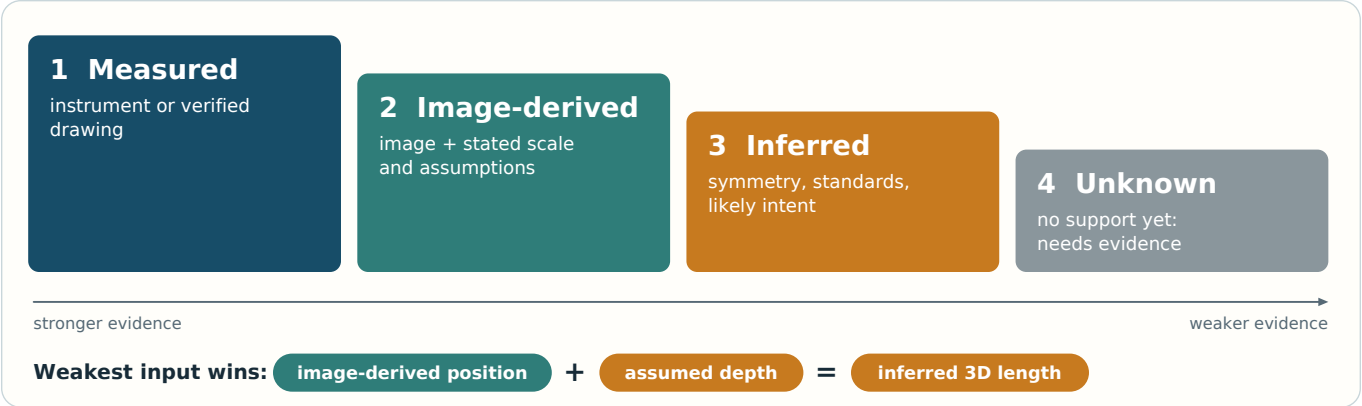

Evidence classes, strongest to weakest. A derived value takes the weakest class among its inputs.

Perspective foreshortens lengths and changes apparent angles. A circle can appear elliptical. Lens distortion can bend lines. Cropping, resizing, stabilization, computational camera processing, and screenshots can change the relation between pixels and a camera model. Keep original files and record preprocessing.

OpenCV camera calibration explains intrinsics and distortion; the homography tutorial explains planar projective correction. For deeper theory, use Hartley and Zisserman's author resources.

Know what kind of image you have

Not every picture is a photograph of the object. Record the provenance of each image, because it decides what the image can support.

Image type	What it can support	Main risks
Calibrated photograph: known camera, distortion corrected, scale reference in the measured plane	Image-derived dimensions on the referenced plane	Off-plane features and residual lens error
Ordinary photograph, original file	Shape, proportions, and approximate dimensions with a reference	Unknown camera, perspective, and distortion
Screenshot, crop, marketplace or messaging image	Shape and appearance	Resampling, cropping, compression; camera data usually lost
Rendering of a 3D model	Shape, if the model represents the real object	Unrecorded camera; the model may differ from the manufactured part
Illustration, concept art, or AI-generated image	Composition, silhouette, and intended appearance	Perspective and proportions need not be physically consistent

Images of different physical objects, such as a product, a similar object, and an illustration, form separate groups. Do not combine them as if they were views of one rigid object; multi-view methods will produce confident but invalid geometry. Identify duplicates and crops of the same frame. Repeated copies are one view, and feature matches between them are not independent observations.

Nominal labels and published dimensions

Dimensions printed on packaging, listings, or datasheets are a different kind of evidence from a measurement. Record what each label refers to: outside envelope, inside cavity, visible window, or the item it holds. Check labels against what the object must physically contain. A pocket labelled smaller than the standard item it holds is probably describing an opening or window, not the cavity.

Account for rounding. A value printed to two decimal places of an inch is consistent with any true value within ±0.005 in, which is ±0.127 mm. The GUM treats a quantity known only to lie within ±a as a rectangular distribution with standard uncertainty a/√3, here about 0.073 mm. That covers rounding alone. The manufacturing tolerance is separate, often larger, and usually unpublished. Converting 3.25 in to 82.550 mm adds digits, not knowledge.

4. Capture a useful evidence set

For a measured mechanical reconstruction

Photograph the front, back, top, bottom, and both sides when accessible. Add oblique views for interpretation and close-ups for holes, seams, shoulders, and ribs. Put a scale reference in the same plane as the feature being measured. Include a wider photograph that makes the reference placement understandable.

Measure a small number of reliable dimensions before collecting dozens of ambiguous ones. Start with overall length, width, and height; then interface diameters, center distances, thicknesses, and depth steps. Establish a datum face and two perpendicular directions. Record which instrument, setup, and repeated readings support each value.

Use calipers for accessible dimensions only when the contact arrangement is suitable. A caliper's displayed resolution is not its measurement uncertainty. Irregular surfaces, contact force, alignment, dirt, and worn reference features can dominate. For blind holes or complex recesses, consider depth measurement, gauges, disassembly, or a sectional drawing rather than guessing from darkness in a photo.

For photogrammetry

Use diffuse, steady light and a sharp, rigid subject. Capture a sequence around the object with substantial overlap and more than one height ring. Add views into recesses and under protrusions. Choose viewpoints with translation so that depth can be triangulated. Repeated images taken from exactly one camera center provide little new depth information.

The Meshroom capture guide recommends at least 60% side and 80% frontal overlap, stable focal length, and a featureless background for rotating-object setups. These figures are starting guidance, not acceptance thresholds for every object.

For a turntable, the reconstruction should follow the rotating object. A richly textured stationary background can create a conflicting motion explanation. Use suitable masking or a plain background and follow the selected package's workflow. If the object is flipped to capture the underside, plan a separate pass with sufficient common geometry and document registration between passes.

Glossy, transparent, translucent, repetitive, very dark, and textureless surfaces are difficult. Improve lighting and camera geometry first. A removable matte treatment or removable texture markers may help when appropriate for the object; any coating can add thickness and obscure detail. Record that intervention. Do

not treat a polished reconstructed surface as proof that difficult regions were observed accurately.

Minimum project folder

Keep originals, preprocessing, calibration, measurements, reconstruction, CAD, drawings, print exports, and validation in separate folders. Preserve the raw images and raw reconstructed mesh. Save tool versions and settings with the run. Give each object and revision a stable identifier so a print can be linked back to its source geometry.

The supplied capture checklist and measurement CSV template turn this into a repeatable routine.

Provenance and rights

Photographs taken by others, purchased or downloaded models, marketplace listings, and generated images each come with terms. Licenses can restrict commercial use, derivatives, redistribution, or particular uses such as automated or machine-learning processing. Creative Commons summarizes common license elements, but marketplace and custom licenses differ, and character or trademark rights can apply whatever the file license says.

Record the origin, date, terms, and a file hash for each input in a source manifest. Keep third-party inputs in an inputs area that is excluded from any archive you share unless the terms allow redistribution. Read a model's terms before running automated or AI-assisted tools on it.

5. Scale, perspective, and uncertainty

Planar scale calculation


For an undistorted, front-facing plane, or a plane correctly rectified into metric coordinates:

```
scale_mm_per_pixel = known_length_mm / reference_length_pixels
```

```
feature_length_mm = feature_length_pixels * scale_mm_per_pixel
```

Synthetic example: a 50.00 mm reference spans 1,000 pixels, so scale is 0.05000 mm/pixel. A feature spanning 640 pixels is 32.00 mm under the stated planar assumptions. This does not measure a raised feature at a different depth.

If the same plane has perspective distortion, rectify it with known coplanar correspondences before using a uniform scale. Four suitable point pairs can define a planar homography; near-collinear points or a very narrow reference region make the estimate fragile. More well-distributed control points permit residual checks. Avoid extrapolating far beyond the controlled area.

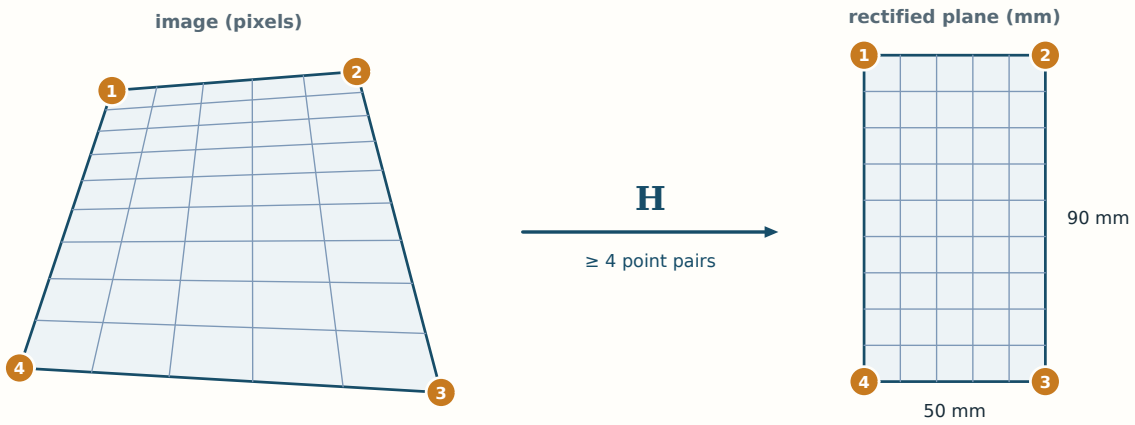

Planar rectification. A homography maps image pixels to millimetres on the reference plane. The grid on the left is the true 10 mm grid projected through the same homography.

Check a calibration against itself

With exactly four point pairs, a homography reproduces the four reference points exactly. A near-zero residual at those points is an arithmetic check, not evidence of accuracy. Use more than four well-distributed control points so that residuals mean something, and reserve an independent check length.

Before rectifying, compare the reference shape's proportions in the image with its known proportions. A tilted plane changes apparent proportions in a way that converging lines will confirm. If tilt does not explain the difference, the image may be cropped or resampled unevenly, or it may not be a physical projection at all. A homography still forces the reference into its nominal shape, and it passes the same stretch to everything else mapped through it.

Synthetic example: a rectangle known to be 50 × 90 mm (aspect 1.800) spans 400 × 675 pixels (aspect 1.6875), so it appears 6.25% too squat. The implied scales are 0.1250 mm/pixel horizontally and 0.1333 mm/pixel vertically, so content mapped through that correction is stretched vertically by about 6.7% relative to horizontally. If plane tilt is not the cause, use one uniform scale for content that is not on the reference plane, record both results, and carry the difference as uncertainty.

The local scale can also be inspected directly. The Jacobian of the homography at a point gives the millimetres-per-pixel factor in each direction there; report it alongside any mapped dimension.

Features off the reference plane


A rectified plane gives a scale for that plane only. Under a pinhole model, a feature parallel to the image plane at distance $Z + \Delta$ from the camera, where Z is the reference plane's distance, has an actual size of approximately:

$$\text{actual_size} \approx \text{size_at_reference_scale} \times (Z + \Delta) / Z$$

Features behind the reference plane ($\Delta > 0$) are larger than the reference scale suggests; features in front of it are smaller. Features that are not parallel to the image plane are foreshortened as well.

Synthetic example: with $Z = 500$ mm and $\Delta = 60$ mm the factor is 1.12, so a feature measuring 40.0 mm at the reference scale is about 44.8 mm. If Z were only known to lie between 350 and 800 mm and Δ between

30 and 80 mm, the factor could range from about 1.04 to 1.23.

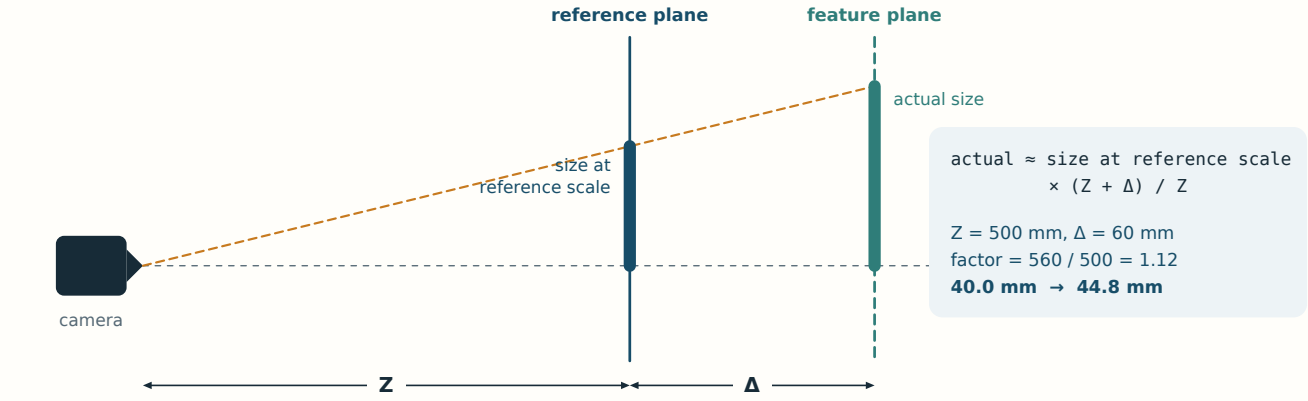

Depth correction. A feature behind the reference plane looks smaller than it is at the plane's scale; multiply by (Z + Δ) / Z.

Assigning depths to image points does not recover 3D geometry. If guides are built from projected points and proposed depths, either apply the depth correction with a stated camera distance or label the outputs as reference-plane guides.

Estimating camera distance

When the original file and camera are known, estimate the focal length in pixels. With a 35 mm-equivalent focal length, which is usually defined on the 43.27 mm full-frame diagonal, `f_px ≈ f_35mm × image_diagonal_px / 43.27`. A reference of known length L spanning `l` pixels at roughly constant depth is then at distance `Z ≈ f_px × L / l`.

Synthetic example: a 26 mm equivalent focal length on an uncropped 4000 × 3000 pixel image (5000-pixel diagonal) gives `f_px ≈ 3005`. A 100 mm reference spanning 500 pixels is then about 601 mm from the camera. This assumes the original uncropped frame, a centred principal point, and negligible distortion; screenshots and crops break those assumptions.

For a single still without camera data, fSpy estimates a camera from converging lines, and a homography of a known rectangle can be decomposed if the principal point and pixel shape are assumed. If these estimates are implausible or disagree, treat that as evidence that the image cannot set physical scale, and set scale by declaration instead.

A first uncertainty calculation

For `L = p * Lref / pref`, a small-error, independent-input approximation is:

```
(uL / L)^2 = (up / p)^2 + (uLref / Lref)^2 + (upref / pref)^2
```

Here u denotes standard uncertainty under the selected error model. Suppose `p = 640 ± 2 px`, `pref = 1000 ± 2 px`, and `Lref = 50.00 ± 0.05 mm`, with all ± values interpreted as standard uncertainties. Then `L = 32.00 mm` and `uL ≈ 0.123 mm`. This is an illustrative propagation calculation, not a measured result or a 95% coverage interval.

The calculation omits perspective error, distortion residuals, endpoint bias, and correlations. Shared image endpoints or a common scale can introduce correlation. Systematic bias is not cured by averaging many measurements. State which errors were considered, and use an independent check length at a different

location.

Scaling a 3D reconstruction

If a known separation is 100 mm and the corresponding reconstructed separation is 2 model units, the uniform scale factor is 50 mm/model unit. Verify several independent lengths and directions afterward. A model can match the chosen scale bar while remaining distorted elsewhere.

Keep scale adjustment distinct from rigid registration. A rigid transform rotates and translates a model; it does not resize it. A similarity transform can include uniform scale. Allowing scale to float during final inspection can conceal a size error that matters to manufacturing.

6. Workflow A: one picture to a profile-based part

Use this route for flat brackets, covers, signs, simple gaskets, and decorative silhouettes. The photo supplies a plan view; thickness and out-of-plane details come from measurements or explicit assumptions.

1. Decide what the part must attach to and record those interface dimensions.
2. Correct lens distortion if it is material at the intended precision.
3. Rectify a planar face if needed, using known reference geometry.
4. Import the image into CAD, place it on a named plane, and set its scale.
5. Sketch straight lines, arcs, circles, and symmetry constraints. Use as few entities as the intended shape allows.
6. Dimension the interfaces from measurement. Let noncritical cosmetic edges follow the image more loosely.
7. Close the profile, remove duplicate segments, and check self-intersections.
8. Extrude using measured thickness. Add holes, recesses, ribs, and fillets as separate features.
9. Regenerate the model after changing a major parameter to check that constraints express the intended behavior.
10. Export a drawing, exchange model, and print mesh. Make a small interface coupon before committing to the whole part.

For a flat graphic, Inkscape tracing can provide a starting vector outline. Redraw important circles and straight edges instead of preserving noisy bitmap contours. For a CAD image setup, use FreeCAD's official tutorial.

Worked example: two-hole plate

The included example is **synthetic teaching geometry**, not a reconstruction of a real supplied photograph. Assume a 60 × 30 × 4 mm rectangular plate with two 5 mm through-holes at x = -20 and +20 mm, y = 0. The hole center distance is 40 mm. The example demonstrates how named dimensions become a script and a drawing.

The dimensions say nothing about the load that plate can carry. The chosen hole diameter is not a universal fit for any particular fastener. In a real job, replace these values with measured or manufacturer-specified interfaces, establish fit requirements, and add any print compensation as a documented decision.

7. Workflow B: several views to editable mechanical CAD

Start by choosing a coordinate system that reflects function: a mounting plane, shaft axis, or symmetry plane. Align reference views to this system. Prefer a small set of measured features over forcing inconsistent photographs to agree perfectly.

Break the part into manufacturing-like features. A housing may be a main extrusion with pockets, ribs, and bosses. A knob may be a revolve with a bore and grip pattern. A bracket may be a base plate plus a perpendicular web. This is a reconstruction strategy; it does not prove the original manufacturing process.

Use lines and circles before splines. Fit a cylinder to a sufficient region of a bore or boss; do not fit it only to a noisy silhouette. Treat draft angles, tapers, edge breaks, and fillets explicitly when they affect function. Add small decorative details after the main envelope and interfaces are settled.

For repetitive features, dimension the pattern count, pitch, axis, and starting angle. For symmetry, constrain the geometry about a datum and keep any observed asymmetry in the evidence register. Wear and damage may be real observations but undesirable design targets. Decide whether the objective is an as-is replica or a replacement approximating unworn intent.

Make separate components for things that move or assemble. Specify the actual joint type: revolute, sliding, fixed, or another intended motion. A single merged watertight mesh does not describe those relationships.

CadQuery and build123d are useful when repeatable dimensions and scripting matter. FreeCAD supplies a GUI-centered route. Choose one modeling system for a first project; a long tool list is not a requirement to install everything.

8. Workflow C: photographs to a printable organic mesh

This route suits statues, rocks, shells, carvings, and other shapes whose surface is more useful than a compact feature tree.

Reconstruct: estimate camera poses and sparse structure, then recover dense geometry using the package's chosen method. Inspect which images registered and whether the camera positions are plausible. Separate reconstructions or inverted camera clusters can signal a capture or matching problem.

Scale and orient: use a measured distance, establish axes, and record the transform. Reserve other measurements for validation.

Clean conservatively: remove the background and clearly disconnected artifacts. Keep a raw copy. Fix boundaries and normals with attention to whether a gap is a missing observation or a real opening. Mark any reconstructed underside or filled cavity as inferred.

Simplify deliberately: reduce triangle count while monitoring critical contours, interfaces, and thin details. Uniform heavy smoothing can shrink an object, round edges, and erase inscriptions. A low geometric deviation on a broad face can coexist with the loss of an important small feature.

Prepare for fabrication: add a base, thicken fragile parts, split large components, or hollow where appropriate. These are design changes to the scanned shape and should be documented. Preserve a faithful reference mesh separately from the modified print model.

The MeshLab project covers mesh processing. Open3D's reconstruction tutorial introduces several ways to form a mesh from points. Those operations create a candidate surface; they cannot prove unobserved

geometry.

9. Workflow D: mesh or point cloud to engineering surfaces

A direct mesh-to-solid operation is most useful when its output structure matches the next task. A faceted solid may be sufficient for a Boolean cut or archival exchange. For dimensions that must change predictably, rebuild major planes, cylinders, cones, and profiles using constraints.

Begin by segmenting the observations into meaningful regions. Fit analytic primitives to appropriate regions and inspect residuals. Use section curves to understand transitions. Reconstruct freeform patches only where a simpler surface cannot describe the intended shape adequately.

For a curved shell, choose a manageable surface network. Avoid excessive control points that absorb noise and produce waviness. Trim and join patches carefully, then check continuity and whether the shell encloses a valid volume. Surface reconstruction and topology repair are related but different tasks.

The Fusion mesh conversion guide distinguishes faceted and prismatic conversion. McNeel's reverse engineering guide describes editable surface reconstruction. CGAL shape detection is relevant when developing custom primitive-fitting tools.

When to stop rebuilding

If the goal is a decorative statue with a precisely sized mounting socket, a hybrid result may be best: retain the organic mesh and design the socket or adapter parametrically. Turning every surface bump into CAD patches can add effort without improving the printed result. Decide based on the modifications and inspection the object actually needs. Workflow E extends this hybrid approach to whole assemblies.

10. Workflow E: organic subjects with mechanical interfaces

Statues, figures, creatures, and other sculpted subjects often have to meet something exact: a base, socket, stand, held object, or another part. Treat the organic surface and the interfaces as two kinds of geometry with different evidence and different tools. Keep the interfaces parametric and let the sculpted surface follow them.

Declare scale from a reference dimension

Choose a real-world reference, such as standing height, a limb length, or a known accessory, and a ratio. Derive model size from it. Do not scale by bounding-box height. A bounding box includes raised limbs, hair, held props, and any base supplied with a mesh, so two meshes "scaled to 150 mm" can have very different body sizes. Measure between named landmarks, ideally in a neutral rest pose, and apply one scale factor to every subject in the scene. Relative sizes then follow from the subjects' declared real sizes; any deliberate exaggeration is a recorded decision.

Pose is not a rigid transform

Translation, rotation, and uniform scale place a mesh; they cannot bend an elbow. Changing a pose means binding the mesh to an armature and transforming bones, as described in Blender's posing documentation, or editing the surface with sculpting tools. Expect volume loss and creasing at joints, and budget time for cleanup. If no sculpt in a near-final pose is available, sculpting over a posed blockout can cost less than re-posing a dense sculpt. A blockout is a simple mannequin fixed at the final pose, scale, and contact points.

Handle heavy and multi-part source meshes

Purchased or downloaded sculpts are often multi-part kits with millions of triangles. Assemble kit parts in their intended relationship first. Then make a simplified proxy for layout, collision, and clearance checks, and keep the full-resolution mesh for export. Record the simplification and either confirm the proxy's deviation is below the check tolerance or enlarge the proxy by that deviation.

Image brightness is not depth

Converting brightness to height, as relief and lithophane generators do, turns paint, highlights, and shadows into geometry. Dark areas become dents and specular highlights become bumps. This is a decorative effect, not shape recovery, and it supplies no back side or thickness.

Mount subjects deliberately

Choose pins, pegs, dowels, magnets, or a keyed socket, and record diameter, engagement depth, socket allowance, and keying in the parameter register. One round pin allows rotation; two pins or a non-circular key fixes orientation. Place pins in thick sections, with material around the hole on both parts. Prefer real support points such as feet or a hand resting on terrain, and confirm that every part is supported by the build plate or the assembly rather than floating.

Plan splits along natural seams

Cut along clothing edges, armour plates, joints, hairlines, or behind other parts where a seam is hidden. Add locating features to each cut, and confirm each part fits the chosen printer with its supports. The PrusaSlicer cut tool is one way to cut a model and add plug, dowel, or snap connectors; test connector fit with a coupon first.

Protect fragile features

Long thin cantilevers such as blades, spikes, antennae, tails, cables, and fingers concentrate stress at the root and break during handling. Thicken the root. Connect long features to the body or base at more than one point. Orient filament prints so that layers run along the feature rather than across it. Consider an embedded metal rod for slender parts, or make the feature a separate, replaceable piece. Keep fragile features out of the zones that hands enter during normal use.

Check the composition from real viewpoints

View the assembly from the intended viewing positions with any held object or contents in place. Detail hidden behind opaque contents or other parts may not be worth printing; detail that reads only in a concept image may not read at physical scale.

11. Design around a held or purchased object

Holders, mounts, enclosures, adapters, and display stands are defined by an object you do not design: a device, container, tool, or case. That object is the controlling interface, and its real geometry outranks any picture of it.

Measure the real object

Record maximum width, thickness, and length, including bulges at seams, latches, hinges, magnets, buttons, and labels. Record corner radii, edge chamfers, and the minimum dimensions that retention depends on. Measure more than one unit if possible, because manufacturing variation is real. Model the object as an envelope with those radii and local bulges, not as a sharp box at nominal size.

Define the insertion and removal path

Sweep the measured envelope along the actual path, whether a straight lift, a slide, a tilt, or a combination. Check clearance to everything else as a minimum distance that must exceed the chosen gap. Zero intersection volume only proves that the shapes do not overlap; contact also passes that test.

The removal travel equals the engaged length. A deep guide therefore needs headroom above the object equal to that length plus room to grip it, and that space must exist where the object will actually stand. Shorter engagement, a tilt-out path, a front opening, or detent or magnetic retention can reduce it.

Reserve access and visibility volumes

Fingers or tools need room to grasp the object; a few millimetres exposed above a guide may be too little. Model a keep-out volume for the grasp and check it like any other clearance. If something must remain visible, such as a label, screen, or the contents, reserve the region between the expected viewpoints and that feature. Opaque contents hide everything behind them, so review renders with representative contents in place rather than an empty, transparent proxy.

Hold without damage

Printed layer lines and support scars can scratch clear plastics and finished surfaces. Limit contact to edges or small pads, orient contact faces for the best finish, add lead-in chamfers at entry edges, and consider felt or flocking. Decide how the object resists tipping and vibration: friction, gravity with a lean angle, detents, or magnets. Avoid an interference fit unless it has been tested.

Test the fit in its final state

Primer, paint, and other coatings add thickness to every surface. A slot coated on both faces loses about twice the coating thickness. **Synthetic example:** a 0.08 mm coat on each face removes 0.16 mm of slot width. Test the coupon in the finished state, or reserve the allowance in the parameter register.

A short slice of a long guide checks the cross-section, not straightness, lean, or warp over the full length. When engagement is long, print a reduced-width guide at full length as well.

12. Advanced geometry that pays off

Coordinate frames and projection

A pinhole camera model can be written `λ [u,v,1]^T = K [R|t] [X,Y,Z,1]^T`. K describes intrinsics; R and t describe camera pose. The unknown projective scale λ explains why a pixel does not specify one 3D location. Keep world, camera, CAD, and printer axes explicit, especially when software mixes conventions.

For two calibrated views, a point in one image constrains the corresponding point to an epipolar line in the other. Useful triangulation needs a suitable baseline and reliable correspondence. More images help only if they add geometric information and usable observations. Multiple View Geometry is the deeper reference.

Least squares and robust fitting

Least squares chooses parameters to minimize a sum of squared residuals. It can be appropriate for approximately Gaussian measurement errors, but large outliers can dominate. Robust losses or RANSAC-style hypothesis testing can reduce outlier influence. Neither can compensate for fitting the wrong shape to the wrong region.

Use residual maps, spatial coverage, and independent measurements. A small residual from fitting a plane to a tiny patch is weak evidence about the full face. CGAL shape detection provides implementation references.

Registration

Rigid registration estimates rotation and translation; similarity registration also estimates scale. ICP iteratively updates correspondences and alignment. It generally needs a reasonable starting pose and enough distinctive overlap. Repeated teeth, flat regions, and symmetry can produce ambiguous alignments. Open3D's ICP tutorial explains the initial-alignment requirement.

Curves, NURBS, and continuity

A rational B-spline curve combines control points, basis functions, and weights. NURBS can represent both freeform curves and exact conic shapes. More control points increase flexibility but can also fit noise. Prefer low-complexity curves that satisfy the measurements and intended smoothness.

`G0` means surfaces meet in position. `G1` means tangent directions agree at the join. `G2` adds curvature continuity. Parametric `C1` and `C2` conditions are stronger statements about derivatives under the chosen parameterization. A visually smooth join may still contain undesirable curvature behavior. The MIT hyperbook covers the mathematical foundations.

Sweeping along a guide curve: a profile swept along a centreline folds into itself wherever the curve's radius of curvature, `R = 1/κ`, is smaller than the profile's extent toward the centre of curvature, which is half its width for a profile centred on the curve. Sample curvature along a guide before sweeping. A curve interpolated through noisy or widely spaced points, such as estimated joint centres, can contain kinks with radii well under a millimetre even when it looks smooth at overview scale. Smooth or refit the guide rather than thinning the profile to suit it.

Mesh topology and geometry

For an ordinary closed manifold surface, each edge belongs to two faces, and the faces around each vertex form a single fan. The edge condition alone misses two shells that touch at one corner, which share a vertex but no edge. Neither condition rules out self-intersections, inverted regions, duplicated internal shells, or zero-thickness contacts. Check connected components, orientation, intersections, and volume interpretation. Intentional separate bodies may legitimately produce several closed components.


Boolean unions of separately modelled parts need their own checks. Count connected components after the union and compare the count with intent: small extra components are floating islands that print as loose debris or fail. Overlapping regions can also leave slivers and walls thinner than any printable path. Measure local thickness after the Boolean, not only on the inputs.

Poisson-style reconstruction uses oriented samples to estimate a surface and can create geometry in poorly sampled regions. Ball pivoting and alpha-shape methods make different assumptions about connectivity and scale. Use the output's support in the observations, not just visual smoothness, to decide whether it is acceptable. Open3D surface reconstruction and CGAL mesh processing provide practical starting points.


Tessellation error

For a circle of radius R represented by n equal chords, the maximum radial chord error is $e = R \times (1 - \cos(\pi/n))$. Thus $n \geq \pi \,/\, \operatorname{acos}(1 - e/R)$ for the usual positive-error range; round up to an integer.

Synthetic example: for $R = 10$ mm and $e = 0.02$ mm, at least 50 segments are needed around the circle. This controls idealized polygon approximation only. It does not establish the accuracy of a printed hole or include slicer and machine errors. Prefer chordal and angular export settings when the CAD package exposes them.

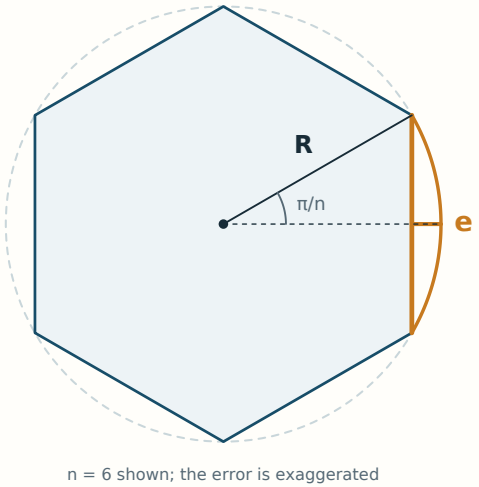

n = 6 shown; the error is exaggerated

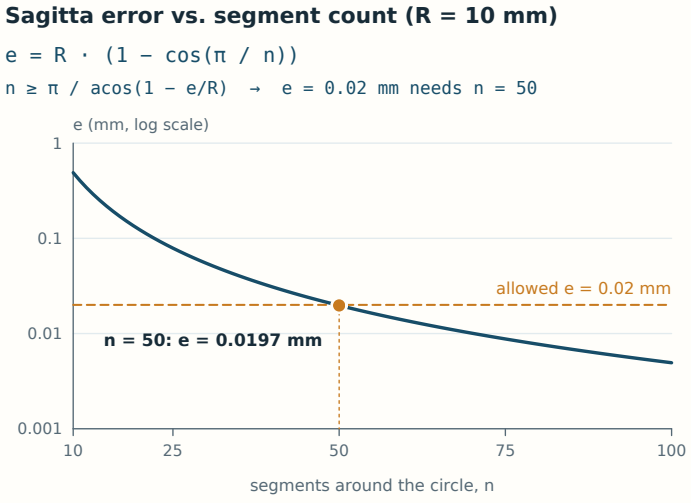

Tessellation error. Left: the sagitta e between a chord and its arc. Right: e for R = 10 mm falls below 0.02 mm at n = 50, computed from the formula above.

Signed distance fields and lattices

An exact signed distance field records distance to a surface with a chosen sign convention. A constant-distance level set can describe an offset. Arbitrary implicit functions and smooth Boolean combinations are not always exact distance fields; using their values as physical thickness can be wrong.

A common periodic implicit expression used to construct gyroid-like lattices is `sin(x)cos(y) + sin(y)cos(z) + sin(z)cos(x) = 0`. The coordinates are dimensionless phase variables, so spatial scaling must be explicit. A narrow field band is not automatically a constant-thickness shell. Validate minimum feature thickness after meshing. This is an advanced design construction, not a method for recovering hidden structure from a photograph.

For further study, use Geometry Central, libigl's tutorial, and Crane's Discrete Differential Geometry course.

13. AI-generated geometry and neural reconstruction

Image-conditioned 3D generators can help explore plausible silhouettes and unseen sides. Treat these surfaces as design candidates. A generated back face, cavity, fastener seat, or tooth profile is not an observation. Validate every functional interface from independent evidence.

TRELLIS and Hunyuan3D-2 are relevant image-to-3D research projects. Their code, weights, dependencies, and compute needs require separate review before installation. This library did not run them or compare their output quality.

Neural radiance fields and related rendering representations target appearance from new viewpoints. Surface extraction, scale recovery, thin-feature preservation, and closed-volume construction are additional problems. Rendering quality is not a dimensional acceptance test. Nerfstudio is a research entry point.

CAD-specific learning targets another representation: sketches, operations, or B-rep geometry. DeepCAD and BrepGen are useful foundational reading. The literature directory also includes recent image-to-CAD and mesh-to-CAD leads, explicitly marked as abstract-level discovery where deeper review was not completed.

Evaluate an AI CAD claim

Ask whether the input is a real photograph, synthetic rendering, depth map, mesh, or point cloud. Identify the output representation and supported operations. Check how invalid outputs are counted, whether test objects overlap training data, and whether scale is normalized away. Inspect holes, thin walls, assemblies, and occluded surfaces. Require independent dimensions and an actual editable model before calling the result manufacturing-ready.

Generated images used as targets

A generated or painted image is often used as the look a build should achieve. It shows appearance, not geometry. Its perspective, lighting, and proportions need not match any physical camera, and known objects in it may be drawn at the wrong proportions. Check it against known shapes before calibrating anything from it (section 5).

Use such an image for composition, silhouette, and proportions within a single subject, and set physical scale by decision. Expect a physical build seen from the same direction to differ. Subjects measured at a front reference plane's scale and then placed behind it will look smaller than in the image. A generated image may also show empty or transparent states that will not exist in use.

14. Turn the model into useful CAD drawings

Choose views that explain the object with little ambiguity. Include orthographic views for geometry, a section through hidden functional features, and an isometric view for orientation. Declare the projection convention. Avoid dimensioning the same requirement twice in inconsistent ways.

Give the drawing a part identifier, revision, units, material/process assumptions, and a scale statement. Show overall dimensions, datum references, hole sizes and locations, thicknesses, depths, and interface requirements. Distinguish reference dimensions from dimensions controlling acceptance. Use tolerances appropriate to function and verified capability rather than attaching an arbitrary tight tolerance to every number.

Use baseline or datum-based dimensions where an interface depends on a common reference. A long chain of small dimensions can accumulate error. For assemblies, provide component identifiers, an exploded view if helpful, a bill of materials, joint relationships, and assembly access notes.

Export the drawing to PDF and open it independently. Check that text, hidden lines, sections, and symbols survived. When a model changes, regenerate the drawing and review dimensions attached to geometry that may have changed identity. FreeCAD TechDraw documents model-derived drawing tools and export options.

A good handoff also includes a short inspection plan: which instrument or gauge checks each critical feature, what constitutes acceptance, and which assumptions remain unresolved.

15. Design for the actual printing process

Choose the process before the details

Minimum wall thickness, smallest detail, hole accuracy, support strategy, and maximum part size all depend on the process. Choose it before setting feature sizes, and record the machine and material.

Consideration	Filament extrusion (FDM/FFF)	Resin vat photopolymerization (SLA/MSLA)
Smallest reliable detail	Set by extrusion width and layer height	Set by XY resolution, exposure, and resin
Typical strengths	Large parts, tough materials, low cost per volume	Fine surface detail, small features, smooth faces
Supports	Overhangs and bridges; marks on supported faces	Most overhangs and every island; many small contact points
Large solid volumes	Infill controls mass and time	Hollow shell with drain holes, or a solid print at higher cost
Characteristic failures	Warping, first-layer flare, layers splitting along thin features	Suction or cupping, trapped resin, brittle thin features, post-cure distortion
Post-processing	Support removal and sanding	Washing, post-curing, and support removal

These are general tendencies to test, not specifications. Mixed-process assemblies are common: a large base printed in filament and small detailed parts in resin. Their interfaces must tolerate both processes' errors.

Hollow resin parts need drain and vent holes so that uncured resin can escape and suction does not form inside them. Formlabs' hollowing guide advises adding at least one more drain hole after the first. Wall thickness trades strength against material and time.

Check build-volume fit in the chosen orientation, including supports, raft or brim, and the printer's exclusion zones. A part that fits only diagonally, or only without its supports, does not fit.

Walls, details, and orientation


Choose wall thickness with the slicer's actual path planning in mind. Nozzle diameter, extrusion width, layer height, wall algorithm, and material affect which thin features survive. Inspect the toolpath at the thinnest ribs and smallest holes. A CAD wall that exists mathematically can disappear or become one fragile extrusion in the slice.

Orientation affects support placement, surface finish, hole shape, and the way layers carry load. Keep important mating faces away from difficult support interfaces when possible. Evaluate long thin features and overhangs locally. A fixed overhang-angle rule does not cover every material, cooling condition, and geometry.

The Prusa design guide and layers/perimeters reference connect design choices with slicing behavior. Their machine-specific examples should not be transferred as universal guarantees.

Clearances and compensation

Define clearance precisely. For concentric circular parts, **diametral clearance** is hole diameter minus shaft diameter; **radial clearance** is half that value. For a rectangular tongue centered in a slot, distinguish total width difference from the gap on each side. Record which definition a test coupon uses.

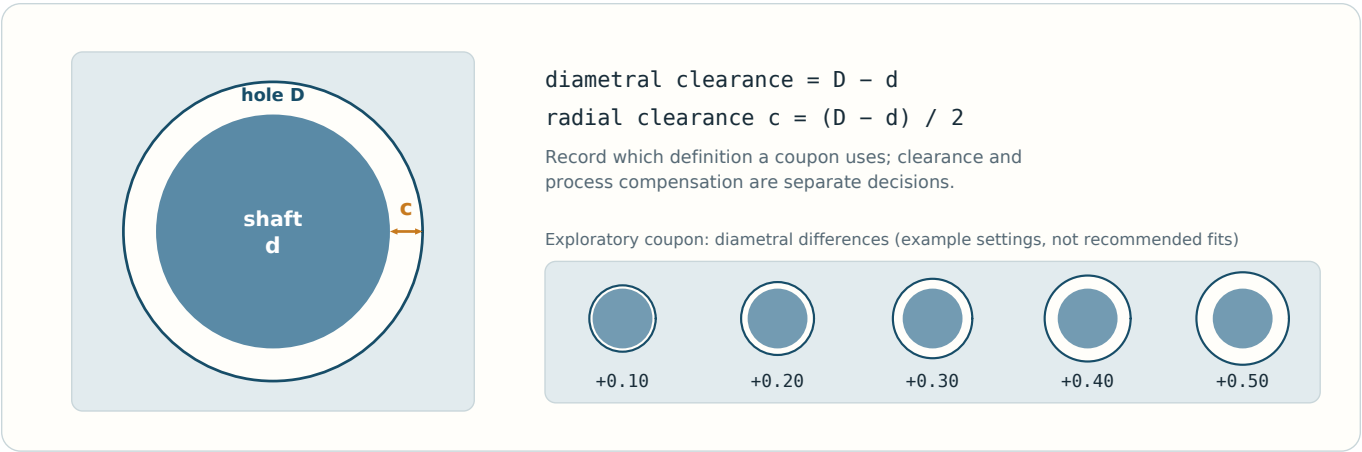

Clearance definitions and an exploratory coupon. examples/clearance-coupon.scad generates a printable version.

A useful exploratory coupon might test total or diametral differences of 0.10, 0.20, 0.30, 0.40, and 0.50 mm. These are example test settings, not recommended fits or claims about your machine. Choose a wider or narrower range when the scale and process justify it. Use the same material, orientation, layer settings, and cooling as the intended part.

Separate design clearance from process compensation. A joint may need a deliberate running gap even if the printer reproduced nominal geometry perfectly. A measured manufacturing bias may need

compensation in addition. Keep an uncompensated nominal model when useful, and record where compensation is applied so it is not accidentally doubled in CAD and the slicer.

Coatings count as well. Primer and paint reduce every clearance they touch, so reserve a finish allowance or test the coupon after finishing (section 11).

Segmentation and assembly

Split a large object along accessible, low-visibility or structurally sensible interfaces. Include locating features, assembly order, fastener access, and adequate material around joints. Account for brim/support space and printer exclusion zones, not just nominal build volume. Print a joint coupon before splitting a large assembly into many parts.

For moving parts, consider bearing seats, shaft alignment, axial retention, backlash, and friction. Test the simplest joint first. An animation demonstrates a selected motion model; it does not establish load capacity, friction, wear, or start-up behavior.

16. Mechanisms: reconstruct function before decoration

For a gear-driven or wind-driven sculpture, create a mechanism diagram before tracing its exterior. Identify fixed frames, rotating bodies, axes, gear ratios, and the range of motion. Check whether apparently separate features in the image intersect in 3D or need impossible support.

For standard external spur gears at nominal center distance, pitch diameter is `d = m × z`, where `m` is module and `z` is tooth count. For two compatible, unshifted gears, nominal center distance is `a = m × (z1 + z2) / 2`. Their angular speed ratio is `ω2 / ω1 = -z1 / z2`. These relations do not define the complete tooth profile, backlash, strength, or suitability of profile-shifted gears.

Synthetic example: module 2 mm and tooth counts 20 and 40 give pitch diameters 40 and 80 mm, nominal center distance 60 mm, and an output speed of -0.5 times the input speed. Do not trace tooth tips from a perspective photo and assume those tips define pitch circles. Use a validated gear generator or manufacturer geometry and verify the chosen system. KHK's gear-dimension reference covers the distinctions between gear families and profile-shift cases.

A first wind-energy estimate is `P = 0.5 × ρ × A × v^3 × Cp`, where `Cp` describes extracted power in the operating condition. This is not a start-up torque formula. The running relation `torque = P / ω` cannot be evaluated at zero speed to prove starting performance. Starting torque must overcome friction, imbalance, and mechanism resistance at the actual initial configuration.

Build a small bearing-and-drive prototype and measure when it starts, stalls, reverses, and binds. Keep cosmetic panels off during early tests. General formulas here are teaching relationships; they do not qualify a particular wind sculpture, printer, or installation.

17. Scripted pipelines and reproducible geometry

Scripted CAD and mesh processing, with tools such as CadQuery, build123d, OpenSCAD, or mesh libraries, make geometry repeatable. That only holds if the scripts are organized so that a change in one place reaches every output.

- **One parameter source.** Keep every governing value in one parameter file that geometry, drawings, renders, checks, and reports all read. That includes held-object dimensions, clearances, scale, datums, pin sizes, and process limits. A value retyped into a render or drawing script will eventually disagree with the model.
- **Named frames with stored transforms.** Name each coordinate frame and store the transforms between frames as data. Convert at the boundary where data enters.
- **Downstream steps read upstream outputs.** If a step produces landmarks, guide curves, or placements, later steps read those files instead of re-entering numbers by hand.
- **Relative paths and a hashed inputs folder.** Scripts find inputs relative to the project, never in temporary or machine-specific directories. Recorded input hashes let a rebuild confirm it used the same evidence.
- **Version control instead of filename versions.** Use a version-control system and tag the revision that produced each print. Files named v2, v3, and v4 drift apart and lose the reason for each change.
- **Pinned environments.** Record the interpreter version and pin dependencies with a lock file. Geometry kernels and mesh libraries change behaviour between releases.
- **Explicit import handling.** Every mesh import states units and up axis and checks the expected extents (section 2).
- **Proxies for heavy checks.** Run collision and clearance checks on simplified proxies with a known deviation, and export from full-resolution geometry.
- **Generated files are disposable.** Treat STL, STEP, renders, and drawings as build products that can be regenerated. The scripts and the parameter file are the source.

trimesh and CadQuery provide the component counts, distance queries, and Boolean checks these steps need. Section 18 describes how to organize the checks themselves.


The library's own synthetic plate follows this structure on a small scale: `examples/plate-parameters.csv` is the single parameter source, `examples/build_plate.py` passes it to OpenSCAD as `-D` overrides, and the resulting STL is checked by `python3 -m cadkit meshcheck` rules before a validation CSV is written. Section 23 lists the commands.

18. Validate the whole chain

Separate three comparisons

1. **Capture fidelity:** reconstructed geometry versus independently measured original geometry.
2. **CAD fidelity:** rebuilt CAD versus the observations and intended replacement dimensions.
3. **Manufacturing fidelity:** the printed part versus the approved CAD requirements.

Comparing CAD to a scan checks agreement with that scan. If the scan is distorted, the comparison can be excellent while the part remains wrong. Hold back some measurements from modeling and use them for independent evaluation.

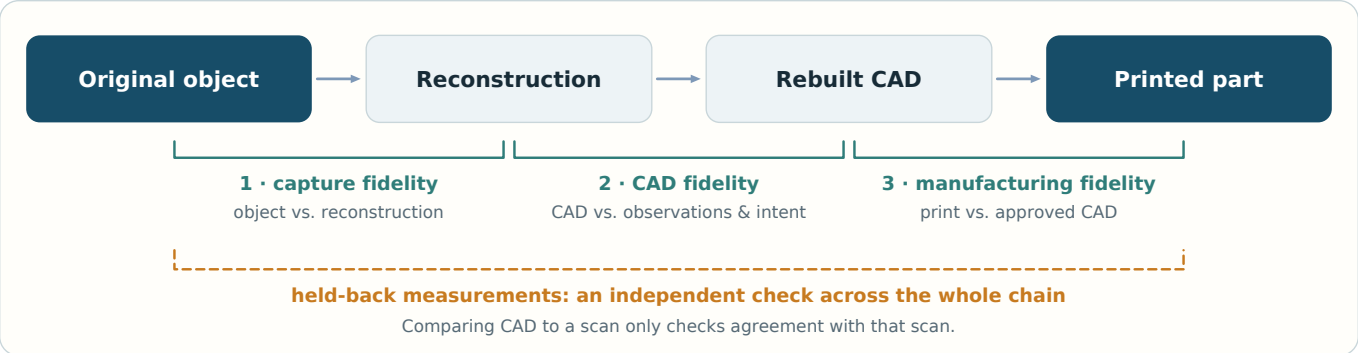


Three comparisons. Held-back measurements are the only check that spans the whole chain.

Three tiers of checks

Automated and manual checks answer different questions. Report each tier separately.

1. **Consistency checks:** files reopen, counts and hashes match, units are declared, and reports quote the model correctly. These prove that the package agrees with itself.
2. **Design-rule checks:** these say whether the design can work.
   - Each printable part is one connected volume, and every part is supported.
   - Minimum walls and features meet the chosen process's demonstrated limits.
   - Parts fit the build volume with their supports.
   - Keep-out volumes for insertion, access, and visibility are clear by at least the stated distance.
   - Parts that must not touch keep their gap.
   - The combined centre of mass lies inside the support footprint with margin.
3. **Physical acceptance:** coupons and prints measured against stated criteria (sections 11 and 15 and the acceptance worksheet).

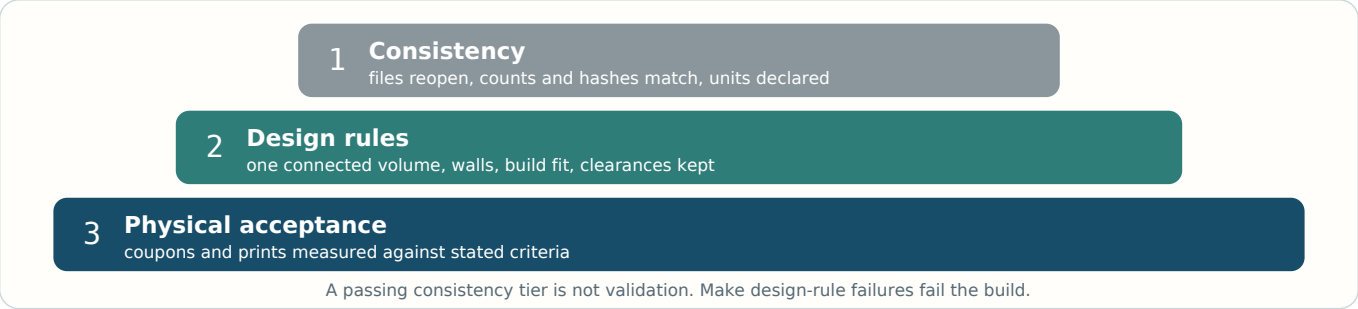

Three tiers of checks. Report each tier separately; only the third says the part works.

A passing consistency tier is often presented as validation; it is not. When an audit finds a problem, such as an island, a sliver wall, or a clearance below target, make the check fail the build rather than only listing the value. Use minimum-distance queries rather than intersection volume for clearances, because zero intersection still allows contact.

Distances and registration

Record units, reference identity, alignment method, sampling density, and any excluded regions. Use a datum-based alignment when functional interfaces define the coordinate system. If using best-fit alignment, state what degrees of freedom were allowed. Report signed deviation only when orientation and the tool's sign convention are understood.

A mean or RMS distance can hide a localized bad hole. Include a maximum or high-percentile absolute deviation, regional checks, and critical feature measurements. A percentile requires a stated sample set. Hausdorff distance is sensitive to extreme discrepancies; Chamfer-type averages depend on sampling and can hide missing features. Neither metric alone establishes functional equivalence.

CloudCompare's distance documentation distinguishes point-cloud and mesh comparisons. The NIST additive manufacturing test artifact illustrates the value of testing multiple feature types rather than relying on one overall dimension.

An acceptance record

For each critical feature, record target, tolerance or fit criterion, measured value, instrument/setup, uncertainty or known limitation, pass/fail/not-tested status, and evidence file. Avoid a single global accuracy percentage. A 99% length match can still be unacceptable for a bearing seat.

Inspect the exported mesh in the actual slicer. Verify dimensions, component count, layers, support contact, holes, thin walls, and estimated assembly clearances. Then print a coupon or reduced-scope prototype. Measure after relevant cooling or post-processing. Keep a failed result as evidence and change one meaningful variable at a time.

19. Biology, anatomy, and specimen resources

Photogrammetry can capture an exposed specimen surface. It cannot reveal internal anatomy hidden inside an opaque object. CT or MRI volumes support a different workflow: respect voxel spacing, segment structures, extract surfaces, and track changes caused by smoothing and meshing.

NIH 3D provides scientific models and workflows. MorphoSource's official project describes a repository for specimen and other scholarly-object media. Its live catalog blocked automated access during this research, so individual dataset rights and downloads were not checked. The Smithsonian 3D program is useful for object-digitization context.

Use 3D Slicer's training compendium and segmentation/export documentation for image-volume exercises. Use the Stanford scanning repository for geometry-processing practice, recognizing that its classic scans are not phone-photogrammetry validation data.

For research datasets, record source identifier, units, acquisition modality, preprocessing, license, and model version. A scientific model suitable for education is not automatically suitable for clinical manufacture or patient-specific decisions. No clinical workflow is being qualified by this library.

20. Troubleshooting by symptom

Symptom	Likely questions to investigate	Next useful action
Wrong overall scale	Unit mismatch? Reference at a different depth?	Verify units and several independent dimensions
Separate reconstruction islands	Poor overlap? Repetitive texture? Camera changes?	Inspect registration and recapture bridging viewpoints
Holes filled by a smooth cap	Was the recess observed? Did reconstruction extrapolate?	Preserve raw data and capture the missing region
CAD becomes slow after mesh conversion	Thousands of tiny faces?	Rebuild major features or retain a hybrid mesh workflow
Thin details vanish in the slice	Mesh too coarse? Wall below printable path width?	Inspect export tolerance and per-layer toolpaths
Parts almost fit but bind	Clearance definition? Orientation? Local distortion?	Print an interface coupon and measure the actual contact
Scan comparison looks good but assembly fails	Best fit hiding interface errors? Wrong reference?	Align to functional datums and inspect each critical interface
Smooth freeform CAD looks wavy	Too many control points? Poor patch layout?	Simplify surfaces and inspect curvature behavior
AI result has a plausible but wrong back	Hidden geometry generated from learned priors?	Replace the assumption with measurements or additional views
Mechanism moves on screen but stalls	Friction, imbalance, collision, or poor alignment?	Test one joint or drive stage physically
Imported mesh lies on its side or is far too large or small	Up-axis or unit mismatch? Scaled by a bounding box?	Convert explicitly and check expected extents on import
Image-derived shapes look stretched in one direction	Reference drawn at the wrong proportions? Image not a physical projection?	Compare the reference's image proportions with its known proportions; use one uniform scale off the plane
Features behind the reference come out too small	Depth not corrected after planar calibration?	Apply $(Z + \Delta) / Z$ with a stated camera distance, or label as plane-scale guides
Subjects are the wrong size relative to each other	Scaled separately, or by bounding boxes?	Declare one scale from reference dimensions
Part fits the coupon but binds over full length or after painting	Guide lean or warp? Coating thickness?	Print a full-length guide and test in the finished state
Held object cannot be removed where the assembly stands	Removal travel and headroom never designed?	Model the path and headroom; shorten engagement or change the path
Automated validation passes but the print fails	Only consistency checks ran?	Add design-rule checks that fail the build
Boolean union leaves small floating pieces	Overlapping, separately modelled parts?	Count components after each Boolean; connect or remove islands

Symptom	Likely questions to investigate	Next useful action
Detail disappears in the finished display	Reviewed with an empty or transparent proxy?	Render with representative contents from real viewpoints

21. A staged learning plan

Exercise 1 - Flat profile: use a simple, noncritical object and one measured reference. Produce a constrained sketch, extrusion, and drawing. Compare at least three dimensions not all used to set scale.

Exercise 2 - Revolved part: choose a rotationally symmetric object. Measure several diameters and heights. Build a revolve and explicitly document any unknown cavity or wall thickness.

Exercise 3 - Textured object: capture a small rigid object with substantial texture. Reconstruct, scale, inspect coverage, and print a mesh. Keep reconstructed and fabrication-modified meshes separate.

Exercise 4 - Hybrid interface: add a measured mounting feature to an organic model. Print only the adapter or joint first, then the full assembly after the fit is established.

Exercise 5 - Advanced inspection: register two models, compute deviations, and explain what the statistics omit. Inspect local critical features in addition to global averages.

Exercise 6 - Automation experiment: try a research pipeline in an isolated environment on a nonprivate sample. Compare its geometry and editability with the manually measured baseline. Record unsupported features and failure cases, not just attractive successes.

Exercise 7 - Single-image depth check: photograph a rectangle of known size with a second object of known size placed 50-100 mm behind it. Rectify the plane, measure the rear object at the plane's scale, then apply the depth correction using an estimated camera distance. Compare both results with caliper measurements, and record which assumptions explain the remaining error.

Exercise 8 - Held-object stand: measure a small purchased object's real envelope, including bulges and corner radii. Design a holder with an explicit insertion path, a grasp volume, and a coating allowance, all read from one parameter file. Print a full-length guide coupon before the stand.

A useful first tool combination is FreeCAD for editable mechanical models and drawings, MeshLab for mesh cleanup, CloudCompare for comparison, and one familiar slicer. Add a reconstruction package when multi-view photographs are actually the chosen route, and Blender when organic subjects must be posed or sculpted. This is a task-based starting suggestion, not a benchmark ranking.

22. What this reference library establishes

The library provides current source links, workflow explanations, an annotated tool directory, research leads, templates, and synthetic calculation examples. Official project pages and GitHub metadata were checked on November 8, 2026; each catalog entry records the depth of review. Scholarly discovery is not a systematic review, and several recent papers remain abstract-level leads.

No private photo set was processed. No AI reconstruction package was installed or benchmarked, and no CAD package was compared with another; OpenSCAD was used only to render the synthetic examples

(Revision 3). No real object, printer tolerance, mechanical assembly, or printed part was validated. The included example has no load or fit qualification. The useful next proof is a small measured object taken through one complete workflow, with independent checks before and after printing.

Revision 2, November 8, 2026. This revision adds:

- governing decisions to make first, unit and axis conventions in exchange files, and image provenance
- interpretation of published labels and rounding
- checks for a single-view calibration, off-plane depth correction, and camera-distance estimates
- an organic-subject workflow with mechanical interfaces, and design around held objects
- process selection, structure for scripted pipelines, and three tiers of checks
- new troubleshooting rows, two exercises, a design-parameter register, and seven catalog sources

The additions are engineering synthesis with synthetic arithmetic. They were not validated by a physical reconstruction or print.

Revision 3, November 8, 2026. This revision adds:

- ten explanatory figures generated from the handbook's own formulas and data, shared by the HTML library, the Markdown, and the PDF
- a Toolkit with a route finder and fourteen calculators in the HTML library, and the `cadkit` Python package that implements the same arithmetic and mesh checks from the command line (section 23)
- a parameter-driven example pipeline: the plate's register drives an OpenSCAD render whose STL is checked for extents, closure, orientation, connectivity, and minimum walls, plus a printable clearance coupon
- automated tests that compare every browser calculator and every route recommendation with the Python implementation, check the catalog and documentation for internal consistency, and exercise the HTML in a browser
- a refreshed GitHub metadata snapshot, a link check of every catalog URL, and removal of tracking parameters from eight research links

OpenSCAD 2021.01 rendered the two synthetic examples and their meshes passed the geometry checks. That establishes that the CAD sources produce the intended closed solids; it is not a slicing, printing, fit, or strength result.

23. Companion toolkit

The calculators are conveniences for the arithmetic in this handbook. They state their assumptions and raise the warnings described in the text, but they cannot supply missing evidence: a result inherits the weakest evidence class of its inputs.

In the HTML library

Open the **Toolkit** tab of `index.html`. The route finder takes what you have and what you need, and returns a starting workflow, any follow-on workflow, warnings for risky combinations, checks before printing, sources to read first, and the relevant calculators. The calculators cover planar scale, scale uncertainty, the calibration self-check, a homography fit with residuals and local scale, off-plane depth correction, camera distance, label rounding, circle tessellation, a clearance-coupon planner, coating allowance, spur-gear relations, import-unit diagnosis, evidence-class propagation, and a first wind-power estimate. Everything runs locally; links such as `index.html#calc-depth` open a calculator directly.

From the command line

Run `python3 -m cadkit --help` in the `reference-library` folder. The package uses only the Python standard library.

Command	Section	Purpose
`route`	1	Recommend a workflow for an input and a goal
`scale`, `uncertainty`, `aspect`, `homography`, `depth`, `camera`	5	Image scale, propagation, calibration checks, rectification, depth, camera distance
`label`, `evidence`	3	Rounding of published values; weakest evidence class
`units`, `meshcheck`	2, 12, 18	Unit mismatch on import; STL extents, volume, closure, vertex manifoldness, orientation, components, through-holes
`chord`, `coupon`, `coating`	11, 12, 15	Tessellation, clearance series, finish allowance
`gear`, `wind`	16	Nominal gear relations with an undercut warning; first wind-power estimate
`params`, `new-project`	4, 17	Validate a design-parameter register; scaffold the minimum project folder

`cadkit/README.md` documents every option with real output.

How the pieces are kept consistent

The browser calculators (`assets/js/cadcalc.js`) and `cadkit` implement the same formulas and thresholds, and the test suite compares them on the handbook's examples and on additional inputs. The worked numbers in this handbook are reproduced by `examples/calculate.py` and checked against `examples/calculation-results.json`; the figures are drawn from the same formulas. `BUILD.md` lists the build and test commands.

Research map and evidence notes

Prepared November 8, 2026. This is a curated reference search, not a systematic review or a software benchmark.

What was searched

Public web searches covered photo capture, camera calibration, planar rectification, structure from motion, mesh reconstruction, mesh-to-CAD conversion, CAD drawings, NURBS and differential geometry, additive-manufacturing inspection, and scientific 3D datasets. Official project documentation, author pages, university materials, specifications, and original research were preferred.

GitHub's connected tools were used for repository discovery and live metadata checks. The directory records the default branch, last push, archived flag, and API-reported license identifier. Those fields do not establish build quality, security, release stability, or that every bundled component has the same license. `NOASSERTION` means the API did not assign a definitive SPDX identifier; it does not mean unrestricted use.

SciSpace was searched with two questions:

- Which methods reconstruct editable parametric CAD models from photographs, sketches, or 3D point clouds, and how is dimensional accuracy evaluated?
- How accurate is close-range photogrammetry for reverse engineering physical objects for additive manufacturing compared with measured reference geometry?

Eight relevant records were selected for the interactive SciSpace table and the persistent catalog. The full bibliographic record and abstract of Turek and colleagues' 2024 paper were fetched. The other selected records were reviewed at search-excerpt level. No paper was treated as fully reviewed merely because it appeared in the search.

The Life Sciences Literature Entrez helper searched PubMed for photogrammetry combined with printing/reverse engineering, then a bounded anatomy-focused query for 2015-2024. Selected bibliographic identifiers were checked with summary/fetch calls. A spectacles paper is retained as a bibliographic lead only. The guide makes no clinical efficacy claims.

Google Drive was searched for existing CAD material. A matching PDF was inspected and found to concern an unrelated building project, so its contents were excluded. Other unrelated results were not used. No private Drive text, file identifiers, or personal drawing details are included in this package, and no Drive document was changed or created.

The Data and Product Design routing skills were consulted. This task concerns engineering reference writing and a source catalog, not a warehouse analysis or a software-interface redesign. Life Sciences Databases' genomic workflow was reviewed and was not forced into an unrelated CAD problem. Relevant scientific 3D repositories were instead researched through their official public pages.

A reading order that answers practical questions

Question	Read first	Why it matters
How do I photograph an object usefully?	Meshroom capture guide; COLMAP tutorial	Coverage, texture, and viewpoint geometry precede reconstruction settings
How do I trace a measurable part?	FreeCAD scaled-image tutorial; OpenCV calibration/homography	Establish the plane and scale before fitting an outline
Why is my converted STL hard to edit?	Fusion mesh conversion; McNeel reverse engineering	Mesh faces, analytic surfaces, and feature history are different representations
How do I know the geometry is right?	CloudCompare distances; NIST test artifact	Alignment, independent references, and feature-specific inspection matter
How do I learn the mathematics?	Oxford multi-view geometry; MIT hyperbook; CMU DDG	Study projection, curve/surface geometry, and discrete surfaces in that order
Can AI recover a useful CAD model?	DeepCAD and BrepGen author/code pages; then recent leads	Separate representation research from real-photo metrology
How do images of anatomy become printable?	3D Slicer segmentation and training	Volumetric images and exterior photographs require different workflows
Which way is up, and what unit is this file in?	glTF 2.0 specification; 3MF core specification	Exchange formats differ in axes and units; convert explicitly on import
How do I re-pose or adapt a sculpted subject?	Blender posing; Blender sculpting	Pose changes need an armature or sculpting, not a rigid transform
How should I hollow or split a large print?	Formlabs hollowing guide; PrusaSlicer cut tool	Drain holes and connectors need a fit test in the real material
How uncertain is a rounded published dimension?	JCGM 100 (GUM), section 4.3.7	A bound of ±a gives standard uncertainty a/√3 for rounding alone
Can I share or adapt this model or image?	Creative Commons license types; the asset's own terms	File licenses and character or trademark rights are separate questions

How to interpret the research

Turek and colleagues' 2024 CAD accuracy study is particularly relevant because its abstract distinguishes measurement data and subsequent CAD modeling. The reported geometry-specific deviations are not transferred to a phone camera or this user's printer. Use the study to design separate checks for acquisition and remodeling.

The older artifact-reproduction and small-object photogrammetry studies in the catalog provide workflow precedents. They do not establish a universal tolerance. Surface preparation, object size, camera calibration, acquisition geometry, measurement reference, and post-processing can all change the result. A published percentage should never be copied without its denominator and test conditions.

DeepCAD is an operation-sequence research baseline; BrepGen addresses B-rep generation. Neither project's presence in a tool directory establishes one-click reconstruction of an arbitrary photographed part. Recent CADFit, Image2CADSeq, and RealCAD records are useful discovery leads. Their full methods, publication status, implementation availability, and benchmarks require further verification before adopting them.

Evaluate papers with this worksheet

- Input modality: real photos, synthetic renders, RGB-D, CT, mesh, or point cloud?
- Calibration: camera model, physical scale, coordinate frames, and control targets?
- Object set: number, materials, sizes, topology, and functional features?
- Output: mesh, implicit field, B-rep, editable operation sequence, or assembly?
- Ground truth: independent metrology, existing CAD, or another unqualified scan?
- Alignment: rigid, similarity, or deformable; were dimensions normalized away?
- Metrics: physical units, regional errors, quantiles, invalid-model rate, and editability?
- Selection: all attempts or only successful reconstructions; exclusions explained?
- Reproducibility: code, exact versions, dataset split, licenses, and compute cost?
- Printing: was a part actually fabricated and measured, or only rendered/sliced?

Retrieval limitations

- MorphoSource's live catalog returned an access-denied page. Its official repository description supports the directory entry; no individual media record was inspected.
- Some PubMed pages returned only a minimal shell. Entrez was used for identifiers and metadata; the catalog distinguishes bibliographic-only entries.
- The direct MDPI landing page for the 2024 study returned HTTP 429. Its SciSpace record supplied the abstract and bibliographic data; no repeated attempts were made to bypass the limit.
- The CVF landing page for Structure-from-Motion Revisited returned HTTP 403 after discovery. Its search-index abstract and COLMAP's documentation provided bounded context.
- An old guessed Meshroom requirements URL returned 404 and was omitted. Consult the current project documentation before installation.
- KHK's page initially appeared as compressed binary in the web parser. A normal public HTTP retrieval with gzip decoding exposed the technical reference; the catalog records this alternate read.
- An incorrect candidate repository path for BrepGen failed. The author-linked `samxuxiang/BrepGen` repository was found and checked instead.
- Revision 2: two guessed Formlabs hollowing URLs returned 404, and a guessed Prusa article number led to an unrelated hotend guide. A web search found the current Formlabs hollowing article, whose page text was then read. A guessed Blender sculpting subpage returned 404; the sculpting index page was used instead.

Revision 2 additions

Revision 2, prepared November 8, 2026, extends the handbook with generic methods prompted by a review of a hybrid project: a sculpted subject combined with a precisely held purchased object. Project-specific data is not included. The new material is engineering synthesis; its worked numbers are synthetic and reproduced by `examples/calculate.py`.

Seven sources were added after their page text was read on November 8, 2026:

- The glTF 2.0 specification, section 3.4 on coordinate system and units.
- The Blender manual's posing introduction and sculpting index.
- PrusaSlicer's cut-tool article, which is filed under a legacy release.
- The Formlabs hollowing article.
- Creative Commons' license overview.
- JCGM 100:2008 (GUM), whose section 4.3.7 rectangular-distribution text was extracted from the BIPM PDF.

The existing 3MF core specification entry was reused for the 3MF unit default. No new software was installed, run, or benchmarked.

Revision 3 maintenance

Revision 3, prepared November 8, 2026, added no new sources and changed no review depths. It made three maintenance checks:


- **Repository metadata:** `scripts/refresh-github.mjs` re-read all 21 repositories from the public GitHub API. Four had pushed since the Revision 2 snapshot (COLMAP, FreeCAD, CadQuery, and OrcaSlicer); only their `last_push` values changed. No repository was archived, renamed, or relicensed.
- **Link availability:** `scripts/check-links.mjs` requested every catalog URL. In the first run (21:03 UTC), 84 of 86 responded normally. The two Smithsonian pages returned HTTP 403 to the automated client, which is a refusal of automated access, not evidence that the pages are gone. In a second run about half an hour later, the whole open3d.org site timed out; a third run reached it again. Availability varies from run to run, and `verification.json` records the most recent one. Every external link in the handbook and these notes is also a catalog entry.
- **Tracking parameters:** the eight SciSpace research URLs carried `utm_source` and `utm_medium` parameters added by the discovery tool. They were removed; the pages are unchanged.

A link check shows that a server answered at the time of the check. It does not re-review a page's content or confirm that the text supporting an annotation is still there.

Refreshing the library

Keep the conceptual explanations stable and refresh software versions, dependency requirements, licenses, and repository status before installation. For a future research update, record the query, date, selected sources, review depth, and reasons for exclusions. Add substantive findings only after reading enough of the source to support them. The `sources.json` and `sources.csv` files provide the structured starting point.

Annotated source directory

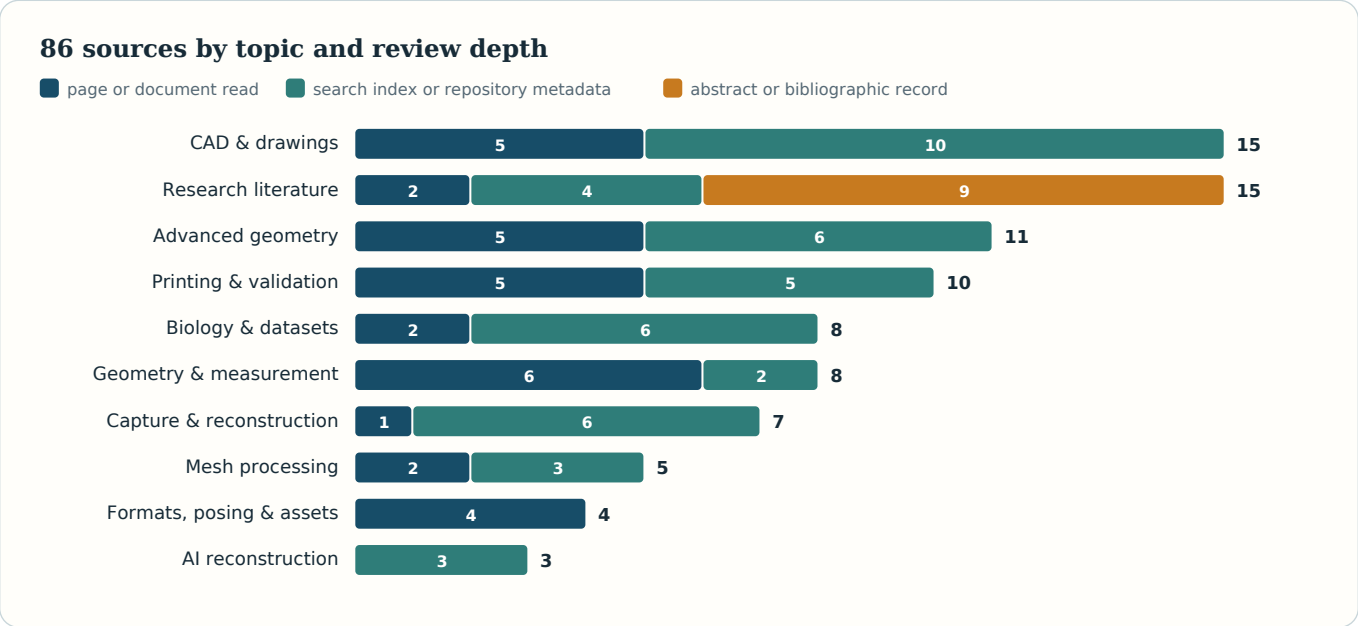

Catalog composition by topic and review depth, drawn from sources.json.

86 resources. Checked November 8, 2026. Review depth is recorded for each entry; links are not claims of full-document review.

Capture & reconstruction

COLMAP reconstruction tutorial

Official documentation | Beginner-advanced | Search-index content checked

Explains sparse structure from motion and dense reconstruction from overlapping photographs.

Limit: Use for multi-view recovery; metric scale and independent dimensions still need external references.

Meshroom capture guide

Official documentation | Beginner | Search-index content checked

Practical photography guidance: coverage, diffuse lighting, stable focal length, and turntable backgrounds.

Limit: Versioned manual; image overlap is guidance, not a dimensional-accuracy guarantee.

COLMAP installation and build options

Official documentation | Intermediate | Page content checked

Check supported builds, compute backends, and dependencies before choosing a reconstruction setup.

Limit: Read the instructions for the chosen release; no local installation was performed.

Smithsonian photogrammetry and 3D technologies

Institutional guidance | Beginner | Search-index content checked

Introduces image-based digitization in conservation.

Limit: Conservation workflows may prioritize visual recording over engineering fit.

colmap/colmap

GitHub repository | Intermediate-advanced | Repository metadata checked

Sparse and dense reconstruction from photographs.

Limit: Inspect the installed build for supported compute backends.

alicevision/Meshroom

GitHub repository | Intermediate-advanced | Repository metadata checked

Graph-based reconstruction workflows in the AliceVision ecosystem.

Limit: Pipeline and GPU requirements vary by release; inspect current setup instructions.

cdcseacave/openMVS

GitHub repository | Intermediate-advanced | Repository metadata checked

Dense reconstruction and meshing tools.

Limit: Inspect the chosen pipeline's required camera/scene inputs.

Geometry & measurement

OpenCV camera calibration

Official documentation | Intermediate | Page content checked

Camera intrinsics, lens distortion, and undistortion using calibration targets.

Limit: Calibration residuals do not by themselves establish object-space accuracy.

OpenCV homography tutorial

Official documentation | Intermediate | Page content checked

Projective mapping and perspective correction for a plane.

Limit: A single plane correction cannot recover arbitrary 3D depth.

fSpy camera matching

Official project | Beginner-intermediate | Page content checked

Recover a useful camera match for interpreting perspective in one still image.

Limit: Camera matching does not reveal hidden shape or establish all dimensions.

CloudCompare distance computation

Official documentation | Intermediate | Page content checked

Explains cloud-to-cloud and cloud-to-mesh comparison.

Limit: Nearest-neighbor distance depends on sampling; alignment and reference quality matter.

Open3D ICP registration tutorial

Official documentation | Intermediate | Page content checked

Refine alignment from an initial approximate transform.

Limit: A plausible local alignment can still be incorrect, especially for repeated or symmetric shapes.

CloudCompare/CloudCompare

GitHub repository | Intermediate-advanced | Repository metadata checked

Point-cloud registration and deviation inspection.

Limit: Compare against an independent, appropriately aligned reference.

isl-org/Open3D

GitHub repository | Intermediate-advanced | Repository metadata checked

Programmable processing of point clouds and meshes.

Limit: Library outputs need coordinate, unit, and quality checks.

JCGM 100:2008 Guide to the expression of uncertainty in measurement (GUM)

International guidance document | Advanced | Page content checked

Defines standard uncertainty and Type B evaluation, including the bounded rectangular case where a quantity known only within ±a has standard uncertainty a/√3.

Limit: A rounding interval or published bound is one input. The guide does not supply perspective, distortion, picking, or manufacturing errors for an image-based measurement.

CAD & drawings

FreeCAD: importing and scaling reference images

Official tutorial | Beginner | Page content checked

Import a reference image and calibrate it using a known distance.

Limit: Use coplanar measurement references; retain measured dimensions separately.

FreeCAD TechDraw workbench

Official documentation | Beginner-intermediate | Repository document read

Create drawing views, dimensions, sections, annotations, and PDF/SVG/DXF exports from 3D models.

Limit: A drawing conveys design intent only when datums, dimensions, and inspection requirements are chosen.

FreeCAD traditional 2D drafting manual

Official documentation | Beginner | Search-index content checked

Introduces Draft as a bridge between 2D geometry and 3D modeling.

Limit: Use Sketcher for constrained profiles and TechDraw for model-derived drawings.

Fusion canvas calibration concepts

Official documentation | Beginner-intermediate | Search-index content checked

Explains canvas size and calibration in Fusion.

Limit: License and platform requirements must be checked separately.

Fusion: convert a mesh to a solid

Official documentation | Intermediate | Page content checked

Describes faceted and prismatic mesh conversions and their timeline options.

Limit: Conversion is not proof of recovered original feature history; availability can depend on entitlement.

Autodesk University: reverse engineering with imported data

Official training PDF | Intermediate | Search-index content checked

Long-form training on mesh, canvas, and imported-data workflows.

Limit: Older course; use current documentation for interface and licensing details.

McNeel reverse engineering guide

Official documentation | Intermediate-advanced | Search-index content checked

Orientation to reconstructing editable surfaces from mesh or point-cloud measurements.

Limit: Some linked examples are historical; distinguish surface reconstruction from mesh wrapping.

CadQuery documentation

Official documentation | Intermediate | Page content checked

Python-based parametric CAD with engineering export formats.

Limit: A modeling tool, not an automatic photograph measurement system.

build123d documentation

Official documentation | Intermediate | Page content checked

Python parametric B-rep modeling based on Open Cascade.

Limit: Pin a release when reproducing examples; latest documentation can describe development code.

OpenSCAD documentation

Official documentation | Beginner-intermediate | Search-index content checked

Scripted constructive geometry, extrusion, and reusable dimensions.

Limit: Keep the script as editable source; mesh export is not a feature-history CAD exchange.

Inkscape: tracing an image

Project documentation | Beginner | Search-index content checked

Turn bitmap silhouettes into vector paths for cleaned-up profiles and extrusion.

Limit: Trace results need scale, node simplification, and closed-loop checks.

FreeCAD/FreeCAD

GitHub repository | Intermediate-advanced | Repository metadata checked

Editable mechanical CAD and model-derived drawings.

Limit: Build constraints from measured features; importing a mesh alone does not restore intent.

gumyr/build123d

GitHub repository | Intermediate-advanced | Repository metadata checked

Python-based CAD construction.

Limit: Pin dependencies for repeatable model generation.

openscad/openscad

GitHub repository | Intermediate-advanced | Repository metadata checked

Scripted constructive-solid models.

Limit: Use native source for editability; do not equate STL with feature history.

CadQuery/cadquery

GitHub repository | Intermediate-advanced | Repository metadata checked

Parametric CAD as Python code.

Limit: Photo interpretation and measurement remain upstream tasks.

Mesh processing

Rhino ShrinkWrap

Official feature guide | Intermediate | Search-index content checked

Constructs a watertight mesh around several geometry types.

Limit: Wrapping can alter gaps, cavities, and small features; inspect deviations afterward.

MeshLab project and capabilities

Official project | Beginner-intermediate | Page content checked

Mesh cleaning, inspection, healing, simplification, and conversion.

Limit: Smoothing and decimation can remove dimensional features.

Open3D surface reconstruction

Official documentation | Intermediate | Page content checked

Alpha shapes, ball pivoting, and Poisson reconstruction from point clouds.

Limit: Normals, sampling, and low-support regions influence the resulting mesh.

cnr-isti-vclab/meshlab

GitHub repository | Intermediate-advanced | Repository metadata checked

Interactive processing of scanned triangle meshes.

Limit: Retain a raw copy before smoothing, repair, or decimation.

mikedh/trimesh

GitHub repository | Intermediate-advanced | Repository metadata checked

Mesh loading, analysis, transformations, and export.

Limit: Watertightness is only one acceptance criterion.

Advanced geometry

CGAL shape detection

Official documentation | Advanced | Search-index content checked

Primitive detection and region growing for point sets and meshes.

Limit: Detected primitives are hypotheses that need tolerance and coverage checks.

CGAL polygon mesh processing

Official documentation | Advanced | Search-index content checked

Mesh geometry, repair, remeshing, intersections, and distance tools.

Limit: Check the license of the particular CGAL packages used.

MIT Shape Interrogation hyperbook

University textbook | Advanced | Page content checked

Mathematical reference for curves, surfaces, NURBS, intersections, curvature, and offsets.

Limit: Study selectively after learning vectors, calculus, and parametric curves.

Keenan Crane: Discrete Differential Geometry

University course | Advanced | Page content checked

Develops computational surface geometry and geometric operators.

Limit: Foundational material; not an end-to-end CAD conversion recipe.

Hartley and Zisserman: Multiple View Geometry

Author book resources | Advanced | Page content checked

Sample chapters and supporting material for projective and multi-view geometry.

Limit: The landing page provides selected resources, not necessarily the full book.

libigl tutorial

Official documentation | Advanced | Search-index content checked

Hands-on geometry processing and differential operators.

Limit: Programmer-oriented; component licenses should be read before redistribution.

Geometry Central

Official documentation | Advanced | Page content checked

Surface mesh data structures and geometry-processing algorithms.

Limit: Useful for custom tools; not a desktop reverse-engineering workflow by itself.

libigl/libigl

GitHub repository | Intermediate-advanced | Repository metadata checked

Geometry-processing algorithms and experiments.

Limit: API license metadata differs from project description; inspect component licenses.

CGAL/cgal

GitHub repository | Intermediate-advanced | Repository metadata checked

Computational geometry primitives and mesh algorithms.

Limit: Licensing varies among packages; review selected modules.

sxyu/sdf

GitHub repository | Intermediate-advanced | Repository metadata checked

Convert a triangle mesh into a continuous signed distance representation.

Limit: This direction is mesh to distance field, not photograph to CAD.

KHK: calculation of gear dimensions

Manufacturer technical reference | Intermediate-advanced | Page content checked via HTTP

Dimension relationships for spur, internal, helical, and other gear systems.

Limit: Use the correct gear family and profile-shift assumptions; the equations do not establish print strength or backlash.

Printing & validation

Prusa: modeling with 3D printing in mind

Manufacturer guide | Beginner | Page content checked

Design constraints for walls, overhangs, orientation, and fitting parts.

Limit: No universal clearance; validate the printer, material, and orientation actually used.

Prusa: layers and perimeters

Manufacturer guide | Beginner-intermediate | Search-index content checked

Connects shell and layer settings with printable geometry.

Limit: Slicer settings and extrusion width affect thin-wall outcomes.

Blender 3D Print Toolbox extension

Official extension listing | Beginner-intermediate | Search-index content checked

Tools for mesh checks, volume, wall work, orientation, and print preparation.

Limit: An automated mesh check cannot validate mechanical fit or load capacity.

3MF specification directory

Format specification | Intermediate | Page content checked

Authoritative entry point to 3MF core and extension specifications.

Limit: Check which extensions the exporter and slicer actually support.

3MF Core Specification source

Format specification | Advanced | Search-index content checked

Detailed model, mesh, coordinate, and packaging requirements.

Limit: A 3MF project from a slicer may also contain vendor-specific settings.

NIST additive manufacturing test artifact

Primary research | Intermediate | Page content checked

Feature-based evaluation of additive manufacturing geometry.

Limit: The test concept transfers; published system results are not predictions for a hobby printer.

prusa3d/PrusaSlicer

GitHub repository | Intermediate-advanced | Repository metadata checked

Slicing and toolpath preview.

Limit: Recheck the selected printer profile and resulting dimensions.

OrcaSlicer/OrcaSlicer

GitHub repository | Intermediate-advanced | Repository metadata checked

Slicing and calibration workflows.

Limit: A successful slice does not establish physical fit or strength.

PrusaSlicer cut tool with connectors

Manufacturer guide | Beginner-intermediate | Page content checked

Cuts a model into parts and generates plug, dowel, or snap connectors for reassembly.

Limit: The article is filed under a legacy slicer release; check the current version, and test connector fit with a coupon in the intended material.

Formlabs: hollowing models and adding drain holes

Manufacturer guide | Beginner-intermediate | Page content checked

Walks through orienting, hollowing, and adding drain holes so resin can escape and cupping is avoided, including adding at least one extra drain hole.

Limit: Vendor workflow for its own software and printers; wall thickness, hole size, and orientation must be validated for the actual resin and machine.

Biology & datasets

NIH 3D

Institutional model database | Beginner | Page content checked

Discover biomedical and scientific 3D models and workflows.

Limit: Read each entry's provenance, units, version, and permitted uses.

NIH 3D FAQs

Institutional guidance | Beginner | Search-index content checked

Model use, citation, and platform guidance.

Limit: A repository entry is not automatic clinical or manufacturing approval.

MorphoSource repository description

Official repository | Beginner-intermediate | Search-index content checked

Biological, fossil, and cultural-object 3D, 2D, and audiovisual data platform.

Limit: The live catalog blocked automated access; individual datasets and permissions were not inspected.

Smithsonian 3D digitization program

Institutional program | Beginner | Search-index content checked

Object capture, research, access, and collection digitization.

Limit: Verify the license and available download on each collection record.

3D Slicer image segmentation

Official documentation | Intermediate | Search-index content checked

Delineate structures in image volumes before surface extraction.

Limit: CT/MRI slice stacks are a different input problem from exterior photographs.

3D Slicer segmentations and export

Official documentation | Intermediate | Search-index content checked

Segmentation representations and creating surfaces for printing.

Limit: Voxel spacing, threshold choices, and smoothing affect final geometry.

3D Slicer training compendium

Official tutorials | Beginner-intermediate | Search-index content checked

Guided exercises with sample data.

Limit: Use sample datasets for learning; do not infer clinical fitness from an export.

Stanford 3D scanning repository

University dataset | Intermediate | Page content checked

Classic range-scan and mesh data for registration and reconstruction practice.

Limit: These are scanner datasets, not evidence of phone-photogrammetry accuracy.

Research literature

Structure-from-Motion Revisited

Primary research | Advanced | Search-index content checked

Schönberger and Frahm, CVPR 2016: foundation for the COLMAP reconstruction pipeline.

Limit: Search-index abstract checked; direct page fetch returned 403.

DeepCAD author project page

Primary research | Advanced | Page content checked

Wu, Xiao, and Zheng, ICCV 2021: generative modeling of CAD operation sequences.

Limit: Research on CAD representation and generation is not a dimensional photo-conversion guarantee.

BrepGen paper

Primary research PDF | Advanced | Search-index content checked

Xu and collaborators, SIGGRAPH 2024: B-rep generation with structured latent geometry.

Limit: Generation of valid geometry and recovery of the exact observed part are different tasks.

Photogrammetry-derived printed sheep scapula comparison

PubMed primary study | Intermediate | Page content checked

An anatomy example comparing models made with PLA and TPU.

Limit: Single study and application; no general phone accuracy or material equivalence is inferred.

Optical face scanner for customized 3D-printed spectacles

PubMed bibliographic record | Intermediate | Bibliographic metadata only

A related application linking anatomical surface capture with customized printed products.

Limit: Title and identifiers checked through Entrez; abstract and full methods were not reviewed.

rundiwu/DeepCAD

GitHub repository | Intermediate-advanced | Repository metadata checked

Implementation accompanying the DeepCAD research paper.

Limit: Research code; repository metadata reports its last push in 2024.

samxuxiang/BrepGen

GitHub repository | Intermediate-advanced | Repository metadata checked

Official implementation for BrepGen.

Limit: Research generation method, not an assured photo-measurement product.

Analysis of the Accuracy of CAD Modeling in Engineering and Medical Industries Based on Measurement Data Using Reverse Engineering Methods

SciSpace scholarly record | Intermediate-advanced | Abstract / scholarly record

Turek and colleagues (2024). Tracks reconstruction and CAD-modeling deviations across several shapes.

Limit: Abstract and complete bibliographic record reviewed; reported deviations are setup-specific.

Towards the Fitting of Parametric 2D Sketches and 3D CAD Models to Point Clouds of Digitized Assemblies for Reverse Engineering

SciSpace scholarly record | Intermediate-advanced | Abstract / scholarly record

Parametric sketch and CAD fitting to scanned assemblies (2019).

Limit: Abstract-level discovery; inspect the paper before implementing its fitting method.

Investigation of the accuracy of close-range photogrammetry - a 3d printing case study

SciSpace scholarly record | Intermediate-advanced | Abstract / scholarly record

Small-object photogrammetry and 3D-printing accuracy case study (2015).

Limit: One case study; accuracy and repeatability are separate questions.

Reverse Engineering Using Close Range Photogrammetry for Additive Manufactured Reproduction of Egyptian Artifacts and Other Objets d'art

SciSpace scholarly record | Intermediate-advanced | Abstract / scholarly record

Photogrammetry-to-additive-manufacturing workflow for cultural artifacts (2015).

Limit: Useful workflow precedent; does not establish mechanical mating tolerances.

Experimental comparison of photogrammetry for additive manufactured parts with and without laser speckle projection

SciSpace scholarly record | Intermediate-advanced | Abstract / scholarly record

Study of surface appearance and projected speckle for scanning printed parts (2017).

Limit: Abstract reviewed; no instrumentation or accuracy claim is generalized.

CADFit: Precise Mesh-to-CAD Program Generation with Hybrid Optimization

SciSpace scholarly record | Intermediate-advanced | Discovery abstract only

Research on recovering editable CAD operations from meshes (2026).

Limit: Discovery lead only: publication status, code, and benchmark details need full-paper verification.

Image2CADSeq: Computer-Aided Design Sequence and Knowledge Inference from Product Images

SciSpace scholarly record | Intermediate-advanced | Discovery abstract only

Research on recovering CAD sequences from product images (2026).

Limit: Discovery lead only; no local implementation or real-part accuracy test performed.

RealCAD: Towards Real-World Image-to-CAD Reconstruction under Domain Shift and Parameter Bias

SciSpace scholarly record | Intermediate-advanced | Discovery abstract only

Research on synthetic-to-real domain shift and CAD parameter bias (2026).

Limit: Discovery lead only; do not treat a search abstract as independent validation.

AI reconstruction

microsoft/TRELLIS

GitHub repository | Intermediate-advanced | Repository metadata checked

Image-conditioned 3D asset generation research.

Limit: Generated unseen surfaces are hypotheses; inspect weights and dependency terms separately.

nerfstudio-project/nerfstudio

GitHub repository | Intermediate-advanced | Repository metadata checked

Neural rendering research and reconstruction tooling.

Limit: View-synthesis quality and recovered surface accuracy must be tested separately.

Tencent-Hunyuan/Hunyuan3D-2

GitHub repository | Intermediate-advanced | Repository metadata checked

Image-to-3D shape and texture generation research.

Limit: Inspect model-specific terms and hardware requirements before use.

Formats, posing & assets

glTF 2.0 specification

Format specification | Intermediate | Page content checked

Defines the glTF coordinate system and units: right-handed, +Y up, +Z forward, and linear distances in metres.

Limit: Many CAD and slicing tools present Z-up millimetres; convert explicitly on import and check extents rather than trusting a viewer.

Blender manual: posing armatures

Official documentation | Intermediate | Page content checked

Explains Pose Mode: transforming bones deforms the skinned mesh relative to the armature rest position, which is how a static character mesh is re-posed.

Limit: Re-posing a dense sculpt needs skin weights and joint cleanup; a convincing on-screen pose still needs wall, support, and contact checks.

Blender manual: sculpting

Official documentation | Beginner-intermediate | Page content checked

Brush-based Sculpt Mode for shaping over a blockout and repairing deformation after posing.

Limit: Sculpted surfaces are design interpretation; measured interfaces should remain parametric and be joined afterward.

Creative Commons license types


Institutional guidance | Beginner | Page content checked

Summarizes common license elements (attribution, non-commercial, no derivatives, share-alike) that govern many shared models and images.

Limit: Marketplace and custom licenses differ from Creative Commons; read the terms attached to each asset. Character and trademark rights can apply regardless of the file license.

Synthetic two-hole plate

This diagram accompanies the editable OpenSCAD source and its parameter register (examples/plate-parameters.csv). All values are illustrative, with no real photograph, dimensional inspection, fit test, or physical printing result.

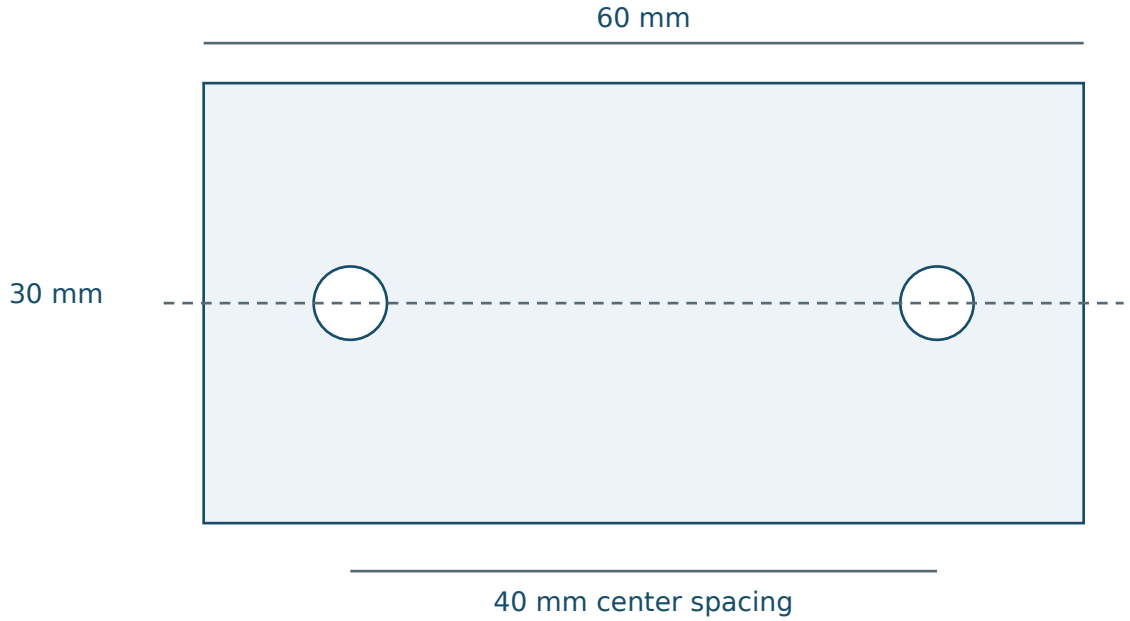

2 holes: 5 mm diameter | Thickness: 4 mm

OpenSCAD 2021.01 rendered the source; examples/build_plate.py checked the STL for its 60 x 30 x 4 mm extents, a single closed and consistently oriented component, and minimum walls (examples/README.md). No part was sliced or printed. The Python calculation script checks the handbook’s scale, uncertainty, tessellation, gear, calibration-proportion, off-plane depth, camera-distance, label-rounding, and coating arithmetic.

Project worksheets

Picture-to-CAD project brief

Object and purpose: _____

Use environment (where it lives, handling, viewing directions, surrounding space): _____

Available input: photographs / physical object / drawings / point cloud / mesh / volume images.

Input provenance and rights (who made each image or model, its terms, what may be shared): _____

Required outputs: editable CAD / STEP / print mesh / dimensioned PDF / assembly instructions.

Current design and coordinate frame (origin, axes, up direction, units; transforms to any other frame): _____

Scale declaration (real size, or ratio and the reference dimension it applies to; one factor for all subjects): _____

Known dimensions and source: _____

Critical interfaces and fit requirements: _____

Held or purchased objects (measured envelope, insertion path, grasp and visibility volumes, finish allowance): _____

Unknown or inaccessible features: _____

Intended printer, process, material, build envelope, and orientation constraints: _____

Part strategy (one body or separate parts; mounting, keying, and split locations): _____

Parameter register location (the one file every script and drawing reads): _____

Success measurements and independent reference: _____

Reconstruction route and why it fits: _____

First small prototype or coupon: _____

Open assumptions and next evidence needed: _____

A useful request for CAD assistance

“Use these photographs and this measurement table to reconstruct [object] for [purpose] at [scale], to be printed by [process and printer]. Mark unmeasured dimensions as assumptions and keep every governing value in one parameter file. Prioritize [interfaces] and keep [insertion path / grasp / visibility] volumes clear by [distance]. Produce an editable model, an exchange model, a dimensioned drawing, and a print-preparation checklist. Start with [coupon]. Report which dimensions and print behaviors are verified and which remain untested.”

Capture checklist

Object ID: _____ Revision: _____ Date: _____

Define success

- ☐ Intended result: replica / replacement / decorative interpretation / mechanism.
- ☐ Critical interfaces and acceptance criteria listed.
- ☐ Required physical scale and target units recorded.
- ☐ Scale declaration states the reference dimension; one factor applies to every subject.
- ☐ Known, inferred, and unknown geometry separated.
- ☐ Original object condition and any damage documented.

Prepare the evidence

- ☐ Original photographs retained without overwriting.
- ☐ Each image's provenance recorded: calibrated photo / ordinary photo / screenshot or crop / render / illustration or generated image.
- ☐ Duplicates and crops of the same frame identified; images of different physical objects kept in separate groups.
- ☐ Published labels recorded with what they refer to (envelope, cavity, window, contents) and their rounding interval.
- ☐ Terms for each third-party input recorded in the source manifest, with file hashes.
- ☐ Front/back/top/bottom/side and interpretive oblique views captured as needed.
- ☐ Scale reference placed in the appropriate plane and its placement photographed.
- ☐ At least two additional check lengths reserved from modeling.
- ☐ Camera/lens, focus/zoom choices, illumination, and preprocessing recorded.
- ☐ Blur, clipping, reflections, and missing coverage reviewed.
- ☐ Turntable background or masking strategy appropriate to the chosen software.
- ☐ Any surface treatment or markers documented.
- ☐ Separate underside pass has a planned alignment method.

Reconstruct and inspect

- ☐ Registered views and camera arrangement look plausible.
- ☐ Raw reconstruction preserved.

- ☐ Scale and coordinate transforms saved.
- ☐ Reference-shape proportions checked before trusting a single-image rectification.
- ☐ Off-plane image measurements corrected for depth with a stated camera distance, or labelled as plane-scale guides.
- ☐ Derived values carry the weakest evidence class of their inputs.
- ☐ Missing observations distinguished from actual openings.
- ☐ Filled or inferred surfaces marked in the assumption register.
- ☐ Cleanup, smoothing, and decimation changes recorded.
- ☐ Independent lengths checked after scaling.

Evidence folder: _____ Remaining uncertainties: _____

CAD and print acceptance worksheet

Part: _____ Model revision: _____ Drawing revision: _____

Printer/profile: _____ Material/batch: _____ Orientation: _____

CAD handoff

- ☐ Native editable master included and regenerates.
- ☐ Governing values come from one parameter file; drawings, renders, and checks regenerate from it.
- ☐ Units, datums, and origin documented.
- ☐ Imported meshes converted explicitly for units and up axis, with extents checked.
- ☐ Exchange model opens independently.
- ☐ Critical dimensions have evidence and explicit acceptance criteria.
- ☐ Drawing views, sections, projection convention, and revision reviewed.
- ☐ Assumptions remain visibly labeled.

Export and slicing

- ☐ Export dimensions match the CAD envelope.
- ☐ Closed-volume, orientation, intersection, and component checks appropriate to the model.
- ☐ Each printable part is one connected volume; no floating islands after Boolean operations.
- ☐ Minimum walls and features meet the chosen process's demonstrated limits.
- ☐ Thin walls, holes, supports, and small details inspected in layer preview.
- ☐ Hollow resin parts have drain and vent holes.
- ☐ Build-volume fit includes support/brim and exclusion areas.
- ☐ Keep-out volumes (insertion path, grasp, visibility) clear by the stated minimum distance, not merely non-intersecting.
- ☐ Assembly and tool access possible.
- ☐ Design clearance, process compensation, and finish allowance recorded separately.

Physical validation

- ☐ Interface coupon printed using representative settings.
- ☐ Coupon tested in the finished state (primer, paint, or coating applied).
- ☐ Long guides or rails checked over their full engaged length.

☐ Measurements taken after relevant cooling/post-processing.

☐ Independent critical features inspected and results recorded.

☐ Assembly fit and intended motion tested where applicable.

☐ Fragile features survive normal handling and access; assembly is stable on its footprint.

☐ Load, wear, environmental, or start-up tests performed only if required and specified.

☐ Status stated as pass / fail / not tested, with no blank fields treated as passes.

Decision: _____ Limitations: _____ Evidence: _____