## TECHNICAL NOTE

**Edition Anglaise** 



## 77 11 202 728 NOVEMBER 1998

514A

	Туре	S/Section
Twingo Phase II	X06 X	75
Mégane	XA0 X	75
Laguna Phase II	X56 X	75

75

SAFETY OPERATION TO BE CARRIED OUT PRIOR TO REMOVING A FRONT SEAT EQUIPPED WITH A SIDE AIR BAG AND/OR SECTIONS OF PANELLING IN THE AREA OF THE SIDE IMPACT SENSOR

Other sub-sections concerned:




43


## **SAFETY**

It is PROHIBITED to carry out an operation on a vehicle equipped with side air bags without first disconnecting the vehicle's battery.

This safety measure is to be applied for all operations requiring the following :

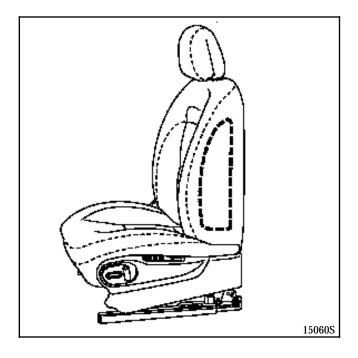

- removal of front seats fitted with a side air bag,

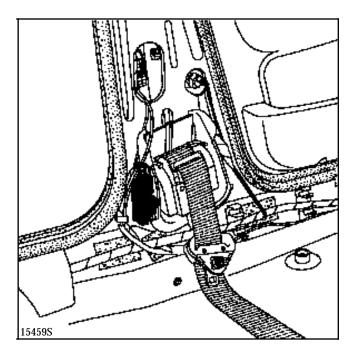

 operations relating to the repair or complete or partial replacement of any upper side structural section (for example, sill panel, centre pillar) and lower structural section (for example, floor panel).

Following complete refit of the vehicle, it is ESSENTIAL to make sure that after connecting the battery, the AIR BAG warning light on the dashboard is extinguished.

If it is not extinguished, carry out a check using the XR 25 test box (refer to section 88 of the AIR BAG manual for the vehicle concerned).

The methods may be modified as a result of changes by the manufacturer in the production of the various component units and accessories from which his vehicles are constructed".

All copyrights reserved by Renault.

Copying or translating, in part or in full, of this document or use of the service part reference numbering system is forbidden without the prior written authority of RENAULT.

