



GTC4Lusso USA - Luggage compartment lid - Latest Update: 2021-01-26


Protected by copyright. Copying for private or commercial purposes, in part or in whole, is not permitted unless authorised by Ferrari S.p.A. Ferrari S.p.A. does not guarantee or accept any liability with respect to the correctness of information in this document.

Copyright by Ferrari S.p.A. - P.IVA 00159560366

E3.02 Luggage compartment lid

Removing the luggage compartment lid


- Disconnect the battery ( F2.01).
- Remove the roof trim panels ( E4.04).
-  Remove the lateral roof trim panels.

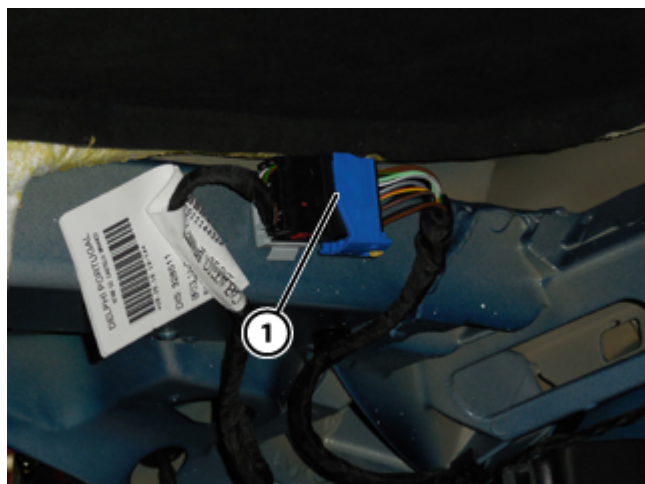


- Disconnect the connector (1) and release the respective cable.



- Adequately support the weight of luggage compartment lid.
- Detach the gas struts **(A)** from the indicated pins.

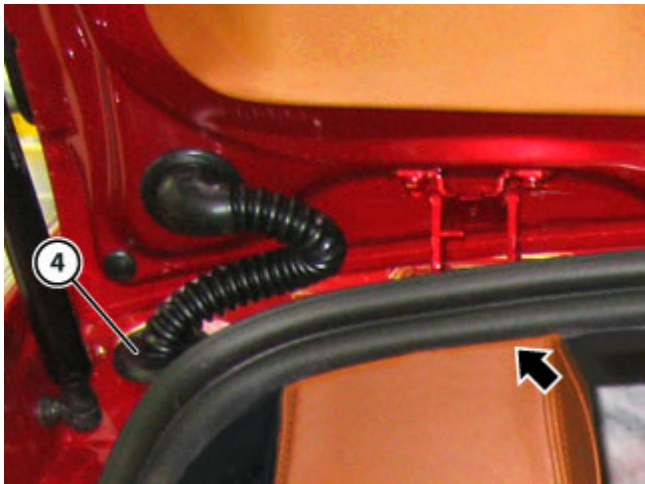

- Detach the cable guide sheath **(4)**.
- Undo the indicated nut.

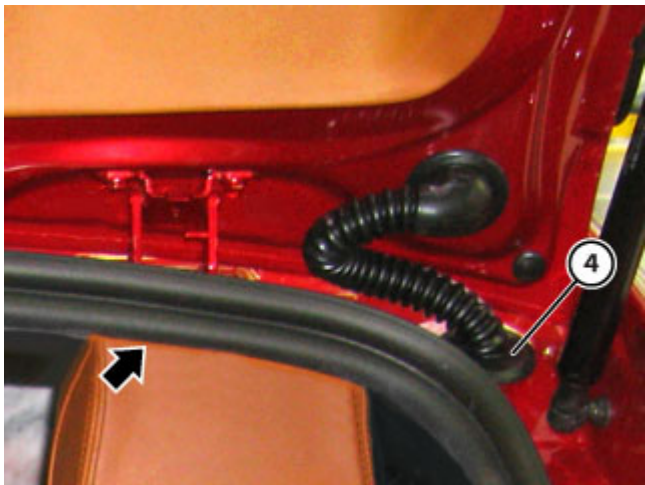


- Detach the cable guide sheath **(4)**.
- Undo the indicated nut.

- Remove the luggage compartment lid, pulling out the respective cables.

Refitting the luggage compartment lid

			
Tightening torque		Nm	Class
Fastening luggage compartment lid	Nut	24 Nm	B


- Supporting the weight of the lid adequately, fit the luggage compartment lid, inserting the respective cables.

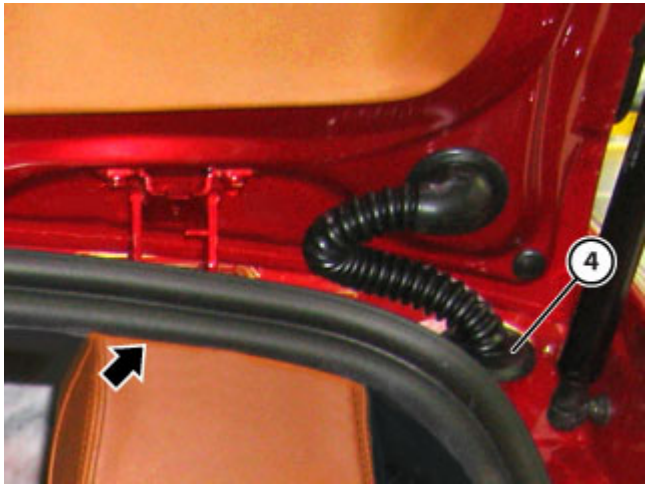

- Tighten the indicated nut.

		
Tightening torque	Nm	Class
Nut	24 Nm	B

- Fit the cable guide sheath (4).

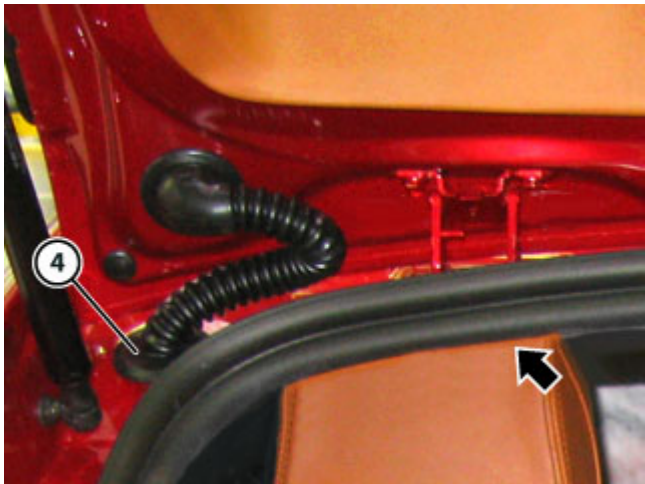


- Tighten the indicated nut.

		
Tightening torque	Nm	Class
Nut	24 Nm	B

- Fit the cable guide sheath (4).



- Fasten the gas struts (A) to the indicated pins.

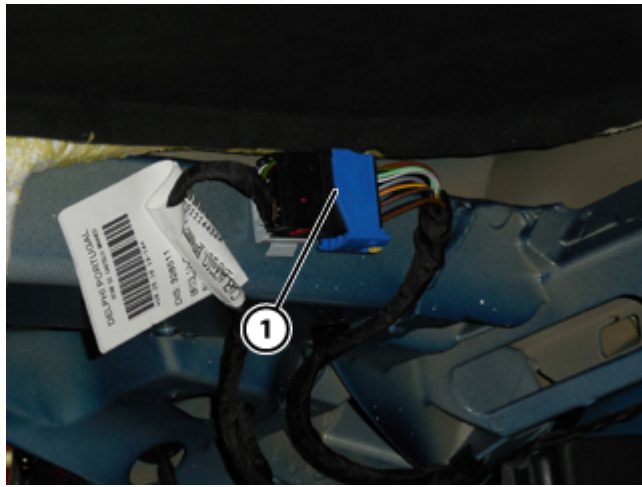

- Connect the connector **(1)** and fasten the respective cable.



- Check that the luggage compartment lid closes correctly and is correctly aligned.
- If the luggage compartment lid does not close correctly and/or is incorrectly aligned, correct lid alignment by altering the number of lock shims and adjusting the lock striker.
- Check again that the luggage compartment lid closes correctly and is correctly aligned.

➤ Refit the roof trim panels (🔑 E4.04).

➤ Refit the lateral roof trim panels.

➤ Connect the battery (🔑 F2.01).