



GTC4Lusso USA - AC system condenser - Latest Update: 2021-01-26


Protected by copyright. Copying for private or commercial purposes, in part or in whole, is not permitted unless authorised by Ferrari S.p.A. Ferrari S.p.A. does not guarantee or accept any liability with respect to the correctness of information in this document.

Copyright by Ferrari S.p.A. - P.IVA 00159560366

F5.04 AC system condenser

Refitting the AC system compressor

- Discharge the air conditioning and heating system ( F5.11).
- Remove the engine air duct ( B4.02).

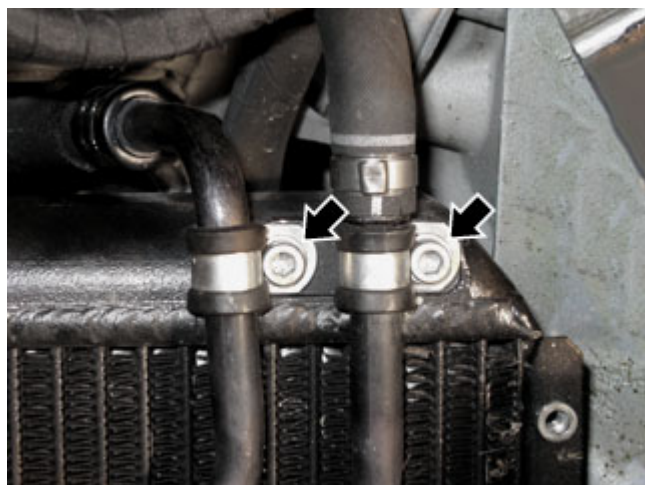


- Undo the screws indicated.
- Remove the power steering fluid coil ( D5.05).
- Remove the power steering fluid radiator without disconnecting the relative pipes, and move aside so that it does not hinder the following operations.



- Disconnect the pipes (1), undoing the respective nuts indicated, and move them aside so that they do not hinder the following operations.
- Undo the screws indicated.



- Undo the indicated screw.

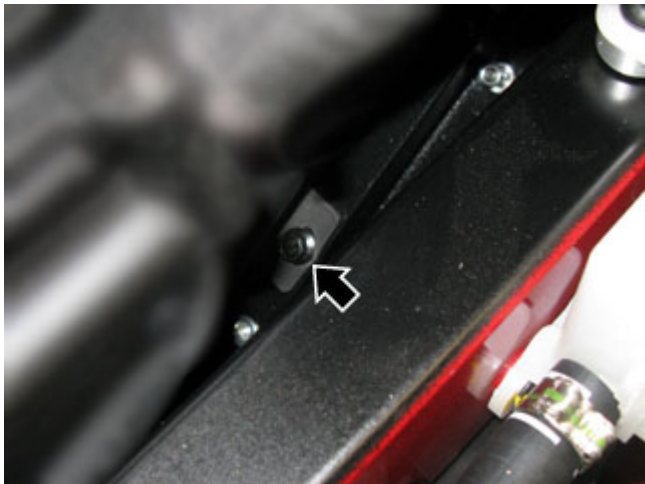


- Undo the indicated screw.

- Remove the condenser.

Refitting the condenser

			
Tightening torque		Nm	Class
Fastening condenser	Screw	5 Nm	B
Fastening Freon pipes	Nut	16 Nm	B
	Screw	9 Nm	B
	Nut	24 Nm	B
	Screw	5 Nm	B
Fastening power steering fluid pipes	Screw	9 Nm	B

- Fit the condenser.

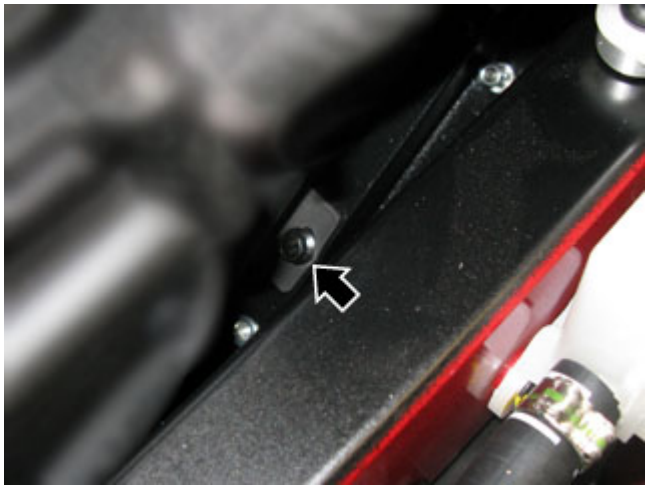

- Tighten the indicated screw.

		
Tightening torque	Nm	Class
Screw	5 Nm	B



- Tighten the indicated screw.

		
Tightening torque	Nm	Class
Screw	5 Nm	B




- Replace the O-rings on the pipes (1).
- Connect the pipes (1), tightening the respective nuts.

		
Tightening torque	Nm	Class
Nut	24 Nm	B

- Tighten the screws indicated.

		
Tightening torque	Nm	Class
Screw	5 Nm	B

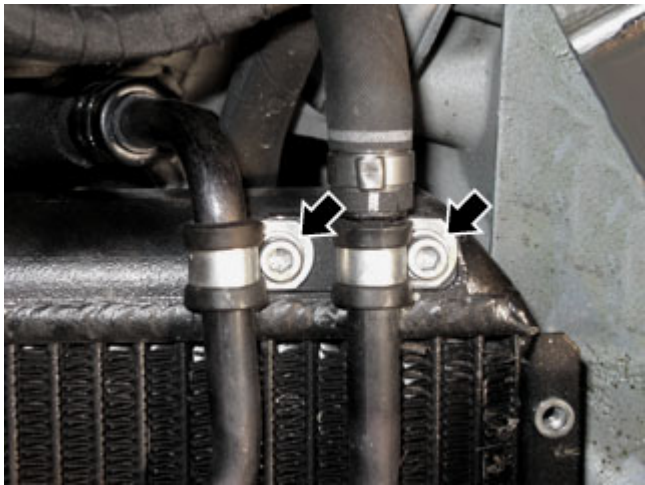

- Refit the power steering fluid radiator (🔧 D5.05).
- Tighten the screws indicated.

Tightening torque	Nm	Class
Screw	9 Nm	B

- Refit the engine air duct (🔧 B4.02).
- Charge the air conditioning and heating system (🔧 F5.11).