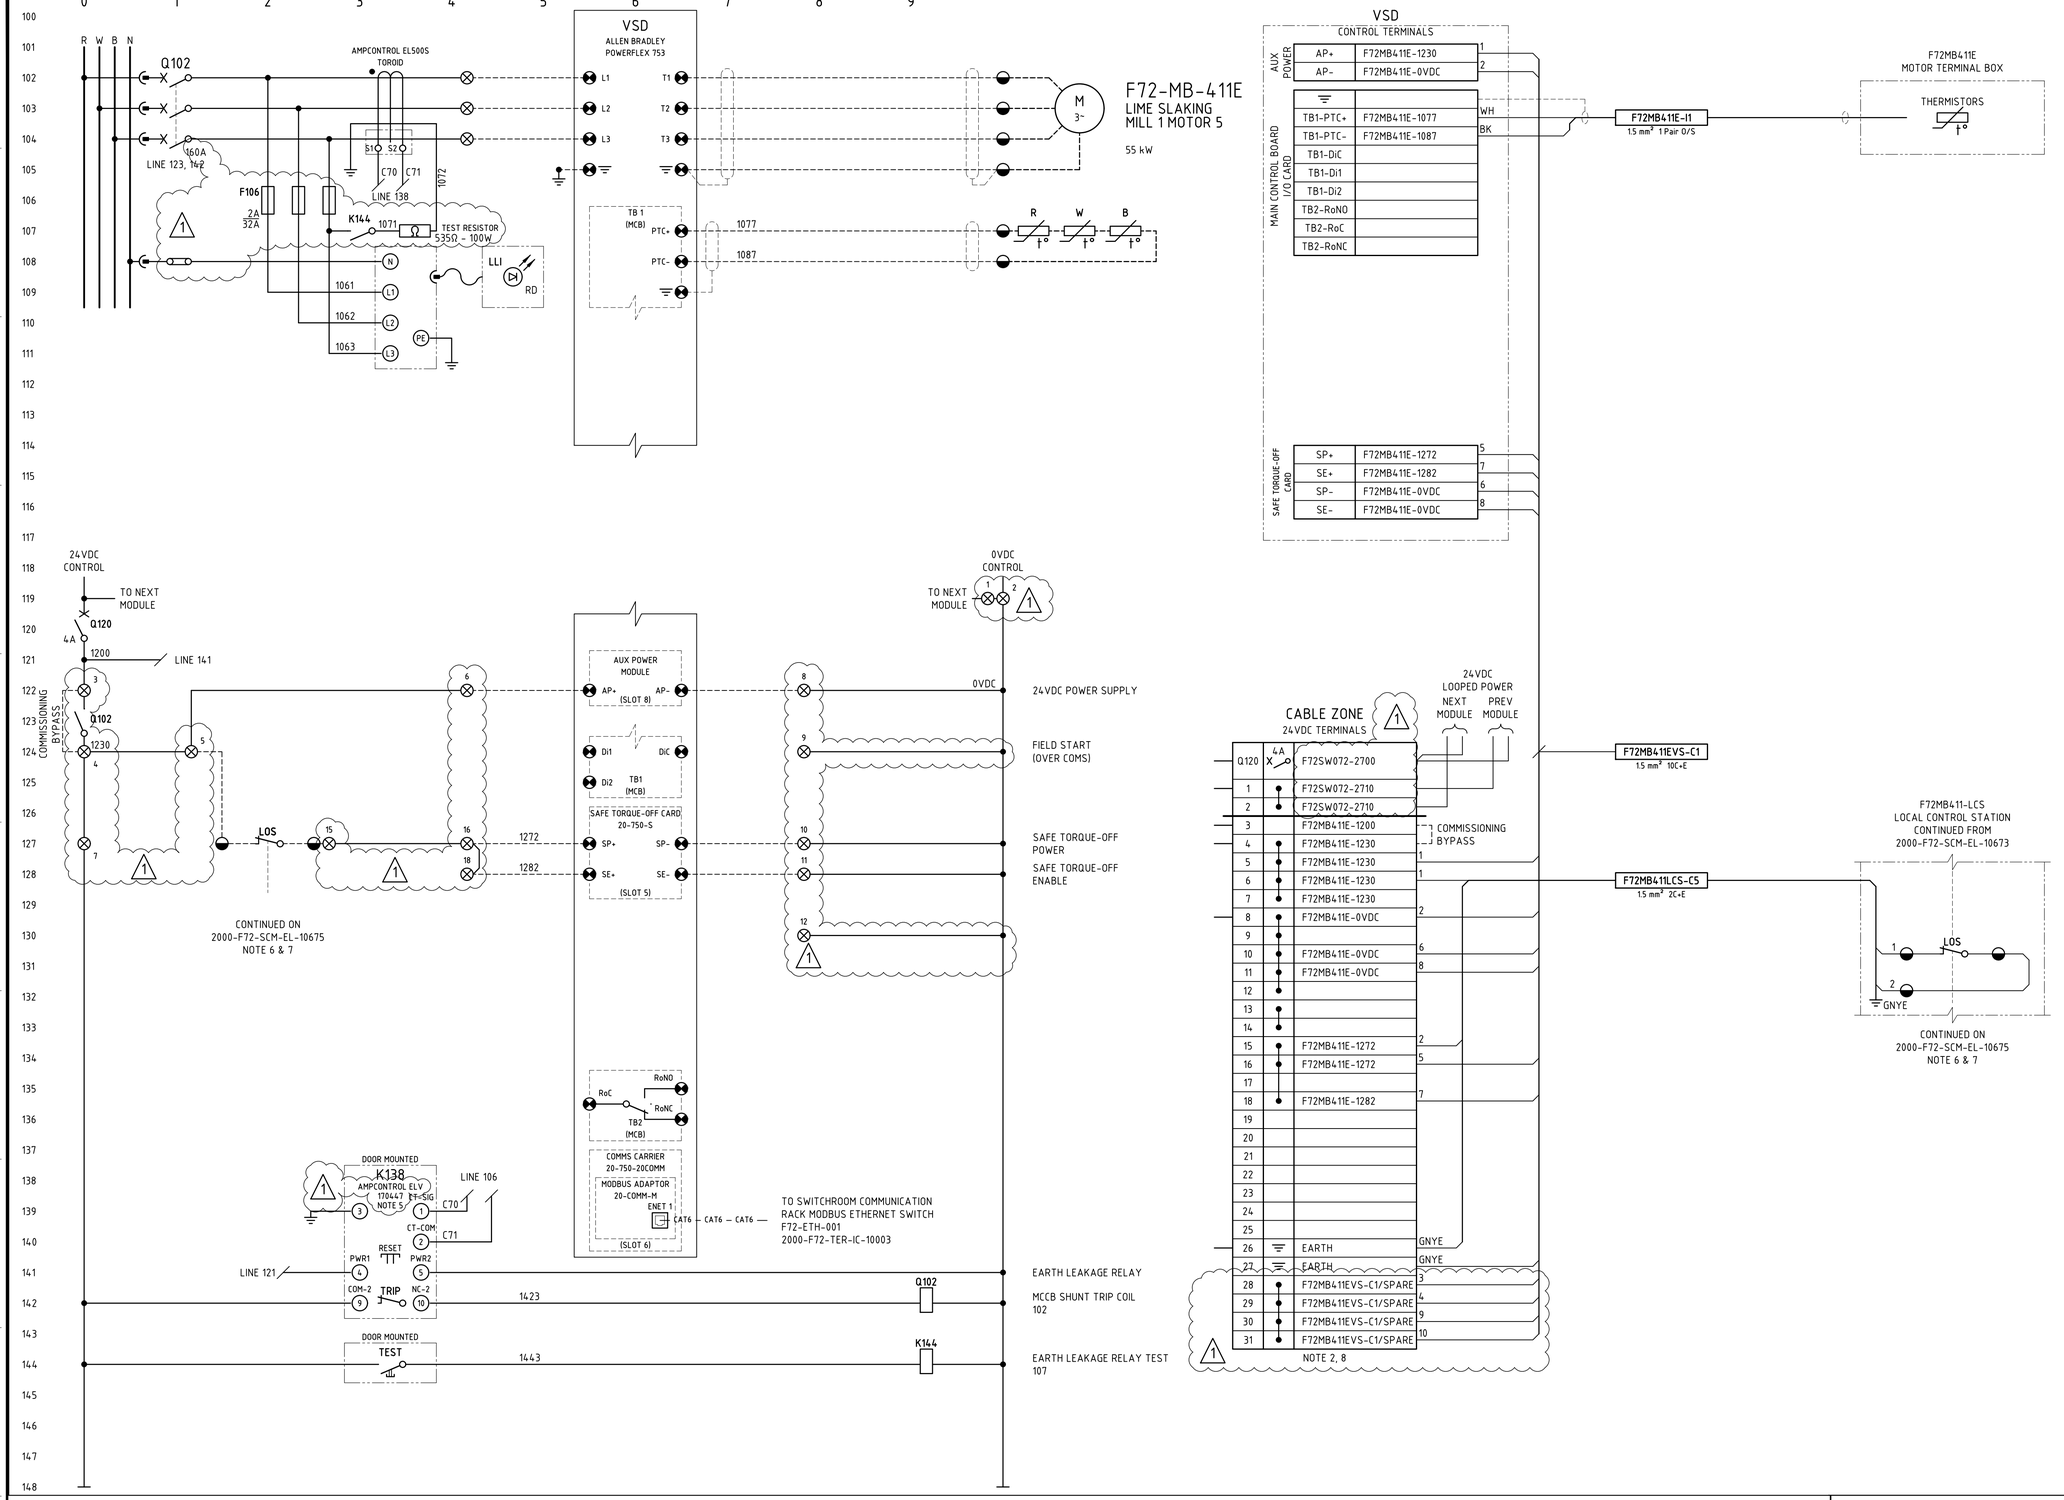


NOTES

1. TERMINALS ON TERMINAL STRIPS ABOVE 50VAC SHALL HAVE A SEPARATE PERSPEX SHROUD AND SHALL BE LABELLED "DANGER xxxVAC".
2. WIRE NUMBER FERRULES ON TERMINAL STRIP SHALL BE PREFIXED WITH EQUIPMENT NUMBER e.g. F72MB411E-1200, UNLESS OTHERWISE NOTED.
3. EACH WIRE SHALL BE IDENTIFIED AT BOTH ENDS WITH FERRULES.
4. AMPCONTROL 10164.9 100/1A TOROID. (1)
5. EARTH LEAKAGE RELAY (ELV) USER INTERFACE TO BE MOUNTED ON MCC MODULE DOOR. RELAY ENERGISED (NORMALLY CLOSED CONTACT OPEN) IN NORMAL OPERATION.
6. COMMON FIELD START BUTTON FOR LIME SLAKING MILL 1 MOTORS WIRED TO MILL 1 MOTOR 1 VSD DIGITAL INPUT. DCS WILL PERFORM SIMULTANEOUS START OF ALL 6 MILL MOTOR DRIVES VIA MODBUS COMMS.
7. COMMON E-STOP BUTTON WITH 6 OFF CONTACTS. ONE CONTACT WILL BE USED FOR EACH LIME SLAKING MILL MOTOR'S STO CIRCUIT.
8. SPARE CORES ARE TERMINATED AND EARTHED. (1)


(1)

LEGEND

- 00/01/00 — DCS DIGITAL INPUT
- 00/02/00 — DCS DIGITAL OUTPUT
- MCC TERMINAL
- VSD TERMINAL
- FIELD TERMINAL
- DCS OR I/O TERMINAL
- MARSHALLING TERMINAL
- DEVICE TERMINAL
- INDICATION LAMP cc = COLOUR

(1)

TERMINATION LEGEND

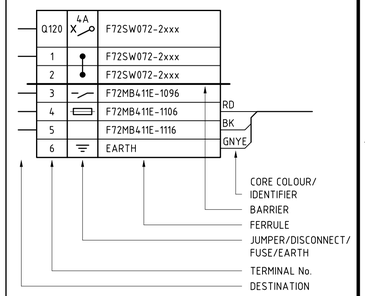

2000-F72-SCM-EL-10674_Rev1

F72-SW-072 F72-MB-411E lime slaking mill 1 motor 5 schematic and termination diagram