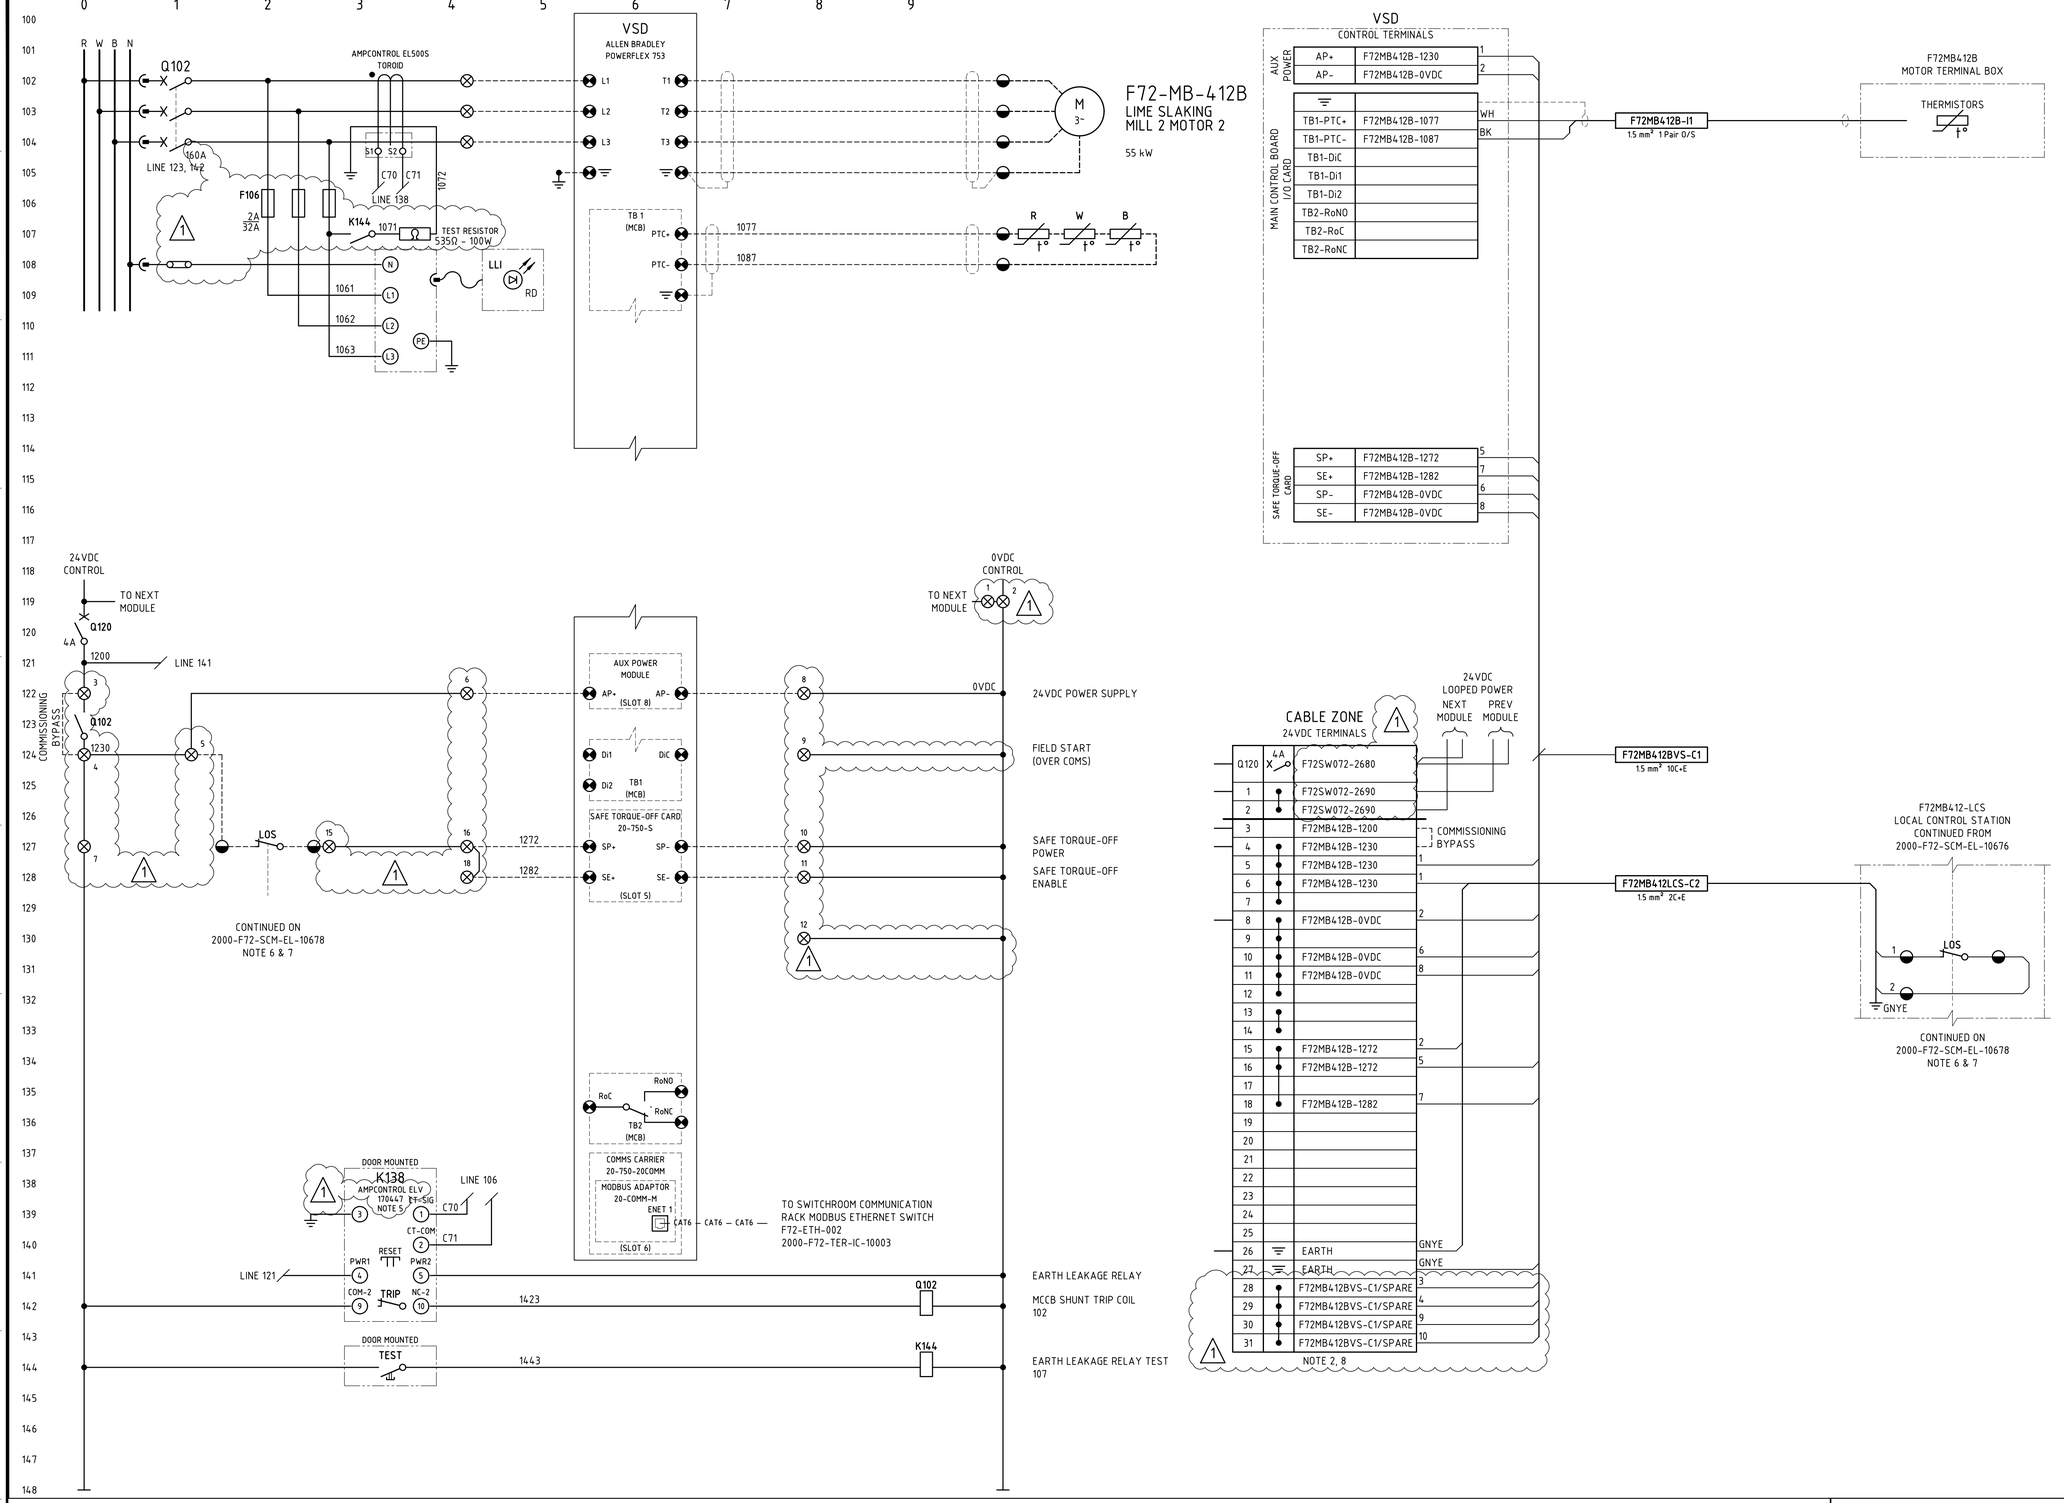


NOTES

1. TERMINALS ON TERMINAL STRIPS ABOVE 50VAC SHALL HAVE A SEPARATE PERSPEX SHROUD AND SHALL BE LABELLED "DANGER xxxVAC".
2. WIRE NUMBER FERRULES ON TERMINAL STRIP SHALL BE PREFIXED WITH EQUIPMENT NUMBER e.g. F72MB412B-1200, UNLESS OTHERWISE NOTED.
3. EACH WIRE SHALL BE IDENTIFIED AT BOTH ENDS WITH FERRULES.
4. AMPCONTROL 101649 100/1A TOROID. (1)
5. EARTH LEAKAGE RELAY (ELV) USER INTERFACE TO BE MOUNTED ON MCC MODULE DOOR. RELAY ENERGISED (NORMALLY CLOSED CONTACT OPEN) IN NORMAL OPERATION.
6. COMMON FIELD START BUTTON FOR LIME SLAKING MILL 2 MOTORS WIRED TO MILL 2 MOTOR 1 VSD DIGITAL INPUT. DCS WILL PERFORM SIMULTANEOUS START OF ALL 6 MILL MOTOR DRIVES VIA MODBUS COMMS.
7. COMMON E-STOP BUTTON WITH 6 OFF CONTACTS. ONE CONTACT WILL BE USED FOR EACH LIME SLAKING MILL MOTOR'S STO CIRCUIT.
8. SPARE CORES ARE TERMINATED AND EARTHED. (1)

(1)

LEGEND

- 00/01/00 — DCS DIGITAL INPUT
- 00/02/00 — DCS DIGITAL OUTPUT
- MCC TERMINAL
- VSD TERMINAL
- FIELD TERMINAL
- DCS OR I/O TERMINAL
- MARSHALLING TERMINAL
- DEVICE TERMINAL
- INDICATION LAMP (cc = COLOUR)

(1)

TERMINATION LEGEND

Q120	4A	F72SW072-2xxx	
1		F72SW072-2xxx	
2		F72SW072-2xxx	
3		F72MB412B-1096	RD
4		F72MB412B-1106	BK
5		F72MB412B-1116	GNYE
6		EARTH	

- CORE COLOUR/ IDENTIFIER
- BARRIER
- FERRULE
- JUMPER/DISCONNECT/ FUSE/EARTH
- TERMINAL No. DESTINATION

2000-F72-SCM-EL-10677_Rev1

F72-SW-072 F72-MB-412B lime slaking mill 2 motor 2 schematic and termination diagram