**VIEW FROM THE ETCH FACE - SCALE 1:1 - DO NOT SCALE: USE THE DXF FOR ALL GEOMETRY**

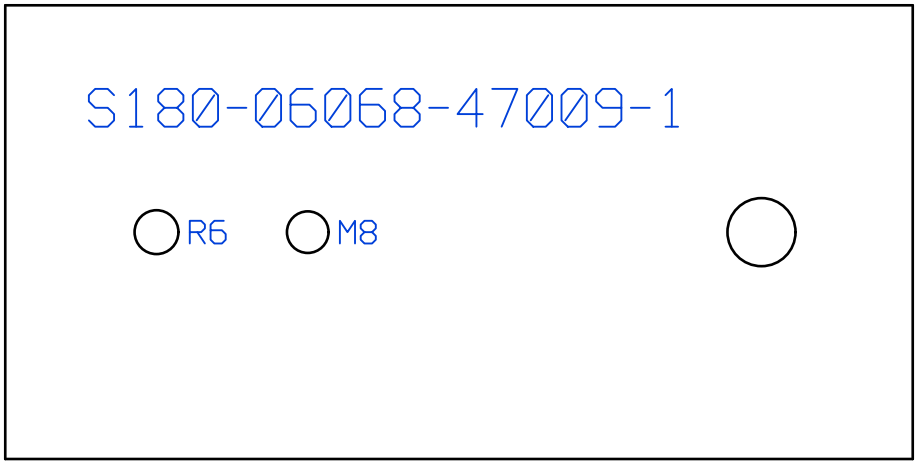


## LASER CUTTING NOTES

1. Cut the profile and all holes from the DXF file S180-06068-47009-1.dxf (layer CUT).
2. **ETCH ALL TEXT ON LAYER ETCH (shown blue on this sheet): the part number S180-06068-47009-1 and every hole label. Do not omit any etching.**
3. Etch on the face shown - this view is from the etch side.
4. Material: MILD STEEL 6 mm thick.
5. Remove all burrs and sharp edges.

**HOLE LABELS (etched next to each hole, shown blue):**

R6 x1 - 6 mm reamed dowel hole - ream after cutting (laser cut Ø5.8)

M8 x1 - M8 tapped hole - drill and tap after cutting (laser cut Ø5.5)

| | |
|---|---|
| **POLAR** | **LASER CUTTING INSTRUCTION** |
| DESCRIPTION: **RING SUPPORT - JIG** | |
| PART No: **S180-06068-47009** | REV: **1** |
| MATERIAL: **MILD STEEL** | THICKNESS: **6 mm** |
| QTY: | SCALE: **1:1** / SHEET: **A4** |
| DRAWN: | DATE: **19/10/2026** / DXF FILE: **S180-06068-47009-1.dxf** |