

Settings

Anthropic API Key

.....

👁

Inspection Category

Cable Tray Condition and Fill Level

Input Type

Single Photograph

Video Walkthrough

Frame extraction interval (seconds)

5

Maximum frames to analyse

10

AI-Assisted Electrical Installation Inspector

Upload a site photograph or video walkthrough to receive a preliminary compliance assessment under SS 638: Code of Practice for Electrical Installations.

⚠

This tool is a preliminary screening aid only. It does not constitute a formal electrical inspection report and carries no legal or regulatory standing under EMA requirements.

Upload video walkthrough

📺

WhatsApp....08.33.mp4

7.9MB

✕

+

Video uploaded: WhatsApp Video 2026-06-07 at 12.08.33.mp4

Extract Frames and Run Inspection

10 frame(s) extracted. Sending to Claude Opus 4.8...

Session Summary

Frames Analysed	Pass	Flag for Review	Fail
10	0	7	3
Worst-case result across session: FAIL			


Frame-by-Frame Results

Frame 1 | t=0.0s | Result: FLAG FOR REVIEW

Cable Tray 1 | PASS

Cable Tray 2 | FLAG FOR REVIEW Cable Tray3 | CANNOT DETER

Floor / Clearance | CANNOT DETERMINE

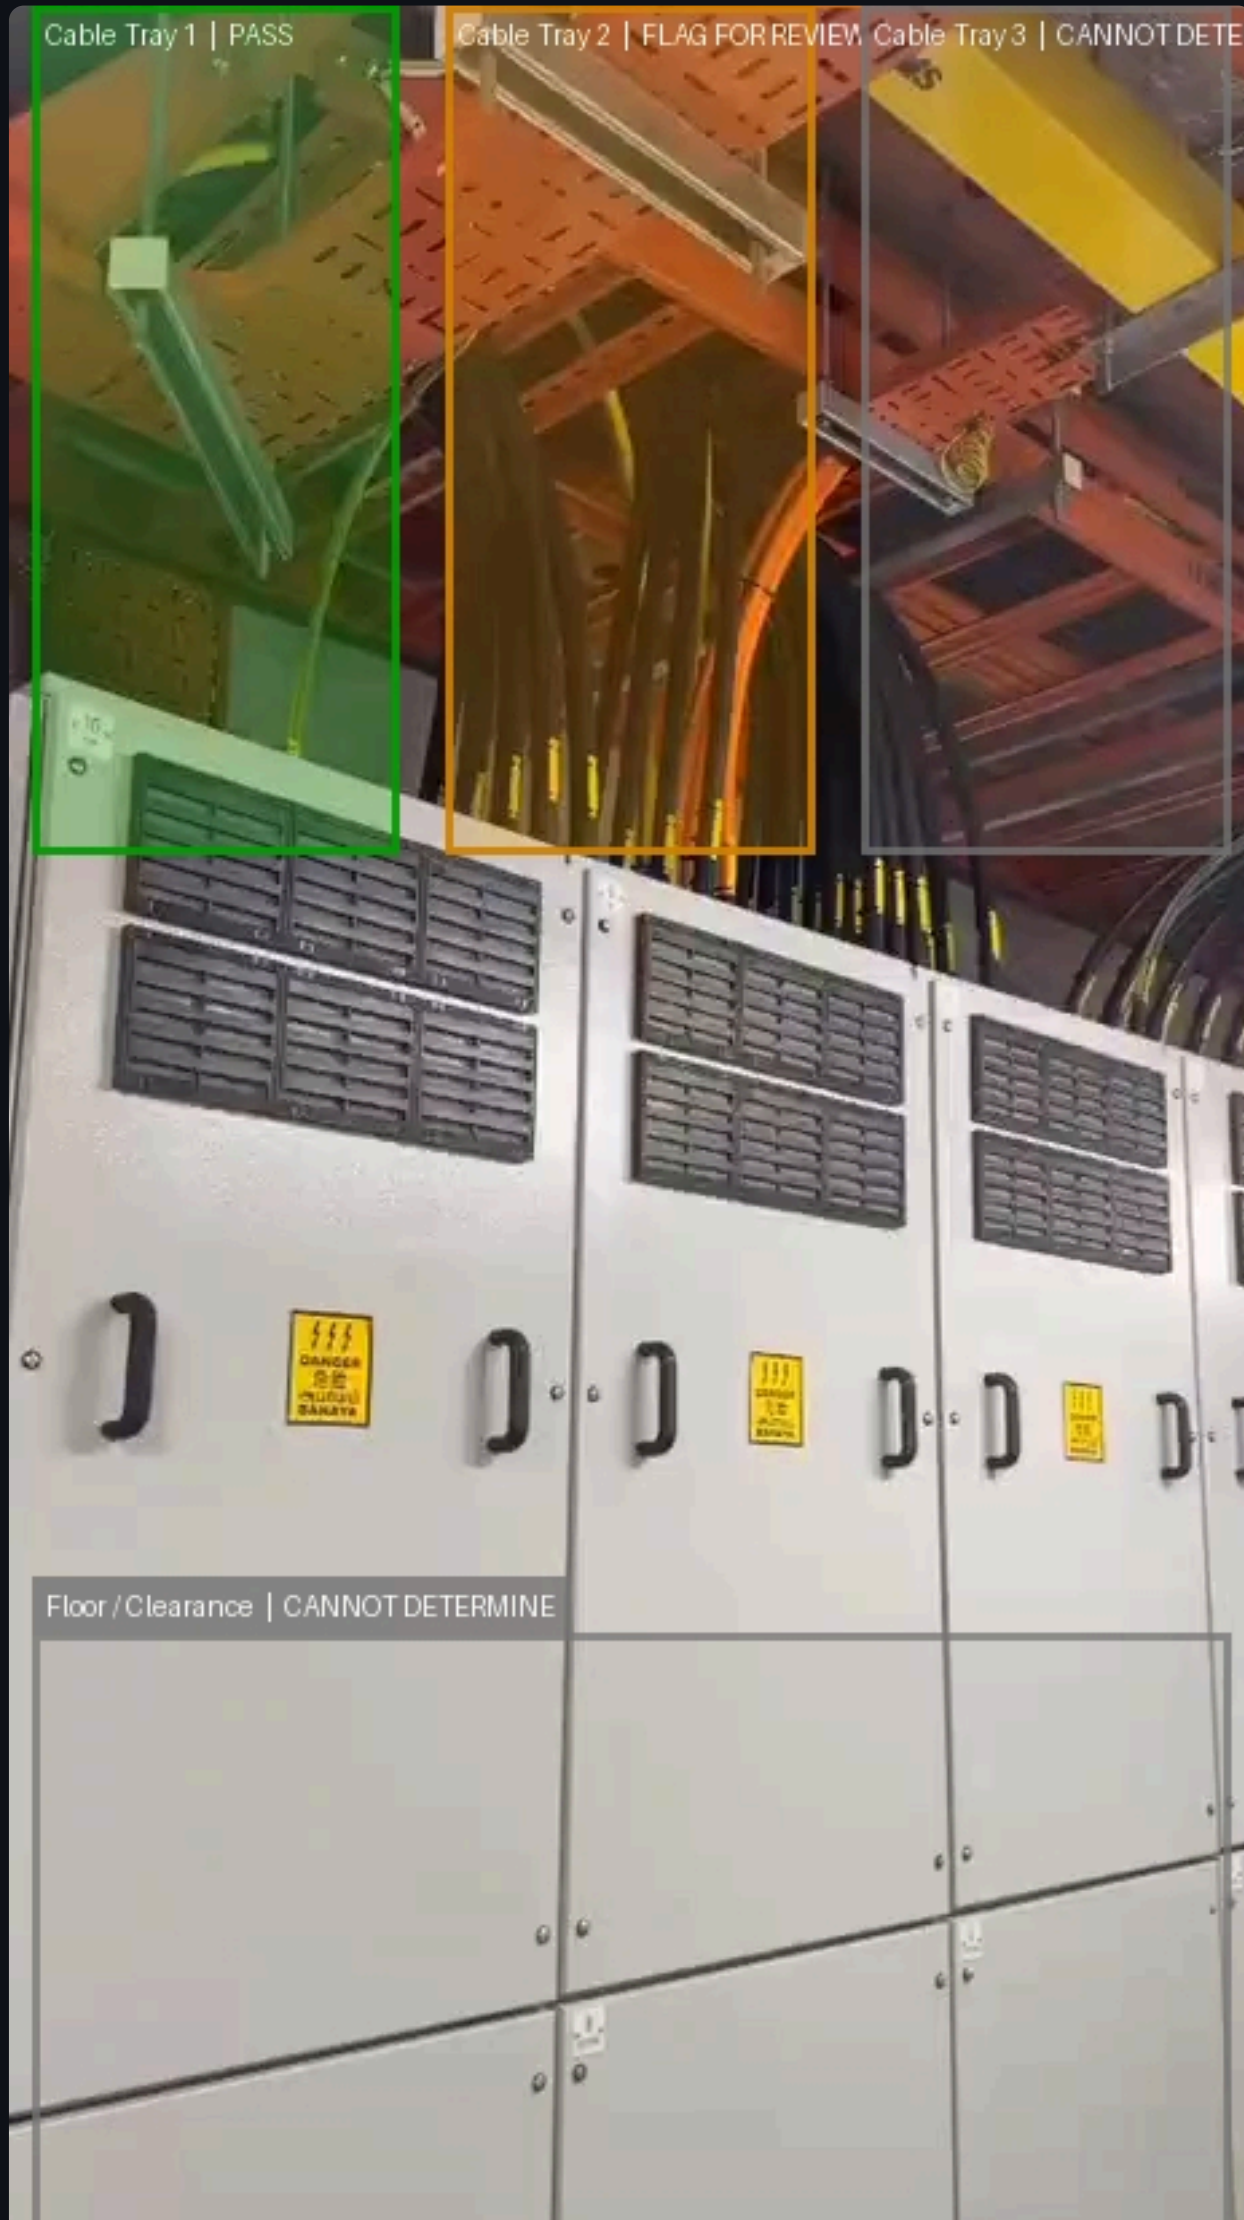

Overall Result: FLAG FOR REVIEW

Detected Elements

Cable Tray 1	PASS
Cable Tray 2	FLAG FOR REVIEW
Cable Tray 3	CANNOT DETERMINE
Floor / Clearance	CANNOT DETERMINE

Full Assessment Report

Electrical Installation Inspection — SS 638 Preliminary Assessment

Important caveat: This is a single low-angle photograph with limited resolution and partial views. Several assessments cannot be reliably made and are marked accordingly. This should not substitute for an on-site inspection.

Visible Cable Containment

I can identify the following at the ceiling level:

- Perforated cable trays (orange/red) — at least 2–3 ladder/perforated tray runs crossing overhead.
- A large bundle of black and orange cables descending from the trays into the top of the switchboard cubicles (this is a cable drop/entry, not a tray).
- Trunking/ducting (grey and yellow) running horizontally.

I will assess the distinct tray runs I can reasonably distinguish.

Cable Tray 1 (upper orange perforated tray, top-left/horizontal): Fill level appears low to moderate — well under 40%. No visible crushing or deformation. No green-and-yellow earth conductor clearly visible. Condition: PASS. Earth continuity: CANNOT DETERMINE.

Cable Tray 2 (orange tray carrying the cable bundle into the switchboard): This tray feeds a dense black/orange cable bundle into the cubicles. Fill in the visible cross-section appears to approach or potentially exceed 40% where cables converge — **FLAG FOR REVIEW**. No clear deformation visible. No distinct green-and-yellow earth conductor visible among the descending bundle. Earth continuity: CANNOT DETERMINE.

Cable Tray 3 (rear/secondary orange tray, partially obscured): Largely hidden behind the cable drop and structural beams. Fill, condition, and earthing: **CANNOT DETERMINE** — insufficient view.

Floor cables:

NO — no loose cables are visible lying on the floor in this image.

Overall:

FLAG FOR REVIEW

Summary:

The cable drop into the switchboard shows a dense bundle where fill may approach or exceed the 40% threshold, and no earth continuity conductor (green-and-yellow) is clearly identifiable in any run, warranting verification on site. Tray condition appears acceptable where visible, but several runs are obscured and key compliance items (earthing, accurate fill) cannot be confirmed from this single photograph.

Cable Tray 1 | FLAG FOR REVIEW Cable Tray 2 | FLAG FOR REVIEW Cable Tray 3 | CANNOT DETERMINE



Floor / Clearance | FLAG FOR REVIEW



Annotated output — colour-coded by element and severity

Overall Result: FLAG FOR REVIEW	
Detected Elements	
Cable Tray 1	FLAG FOR REVIEW
Cable Tray 2	FLAG FOR REVIEW
Cable Tray 3	CANNOT DETERMINE
Floor / Clearance	FLAG FOR REVIEW

Full Assessment Report

Preliminary Electrical Installation Inspection — SS 638

Visible Cable Tray / Trunking Assessment

I can identify approximately **3 distinct cable tray/trunking runs** in this photograph, all mounted overhead along the orange support structure. I will assess each based on what is clearly visible.

Cable Tray 1: (Left-side run, carrying the dense bundle of black cables along the upper-left ceiling)

- Fill level:** The cables appear densely bundled and tightly packed in this run. Fill may approach or exceed the ~40% threshold, but the tray cross-section and depth are not clearly visible to confirm. → **FLAG FOR REVIEW**
- Tray condition:** No visible crushing, cracking, or deformation in the visible section. → **PASS**
- Earth continuity conductor:** No green-and-yellow conductor clearly distinguishable among the dark cables due to lighting glare and distance. → **CANNOT DETERMINE**

- Verdict: FLAG FOR REVIEW

Cable Tray 2: (Central/perforated orange tray running front-to-back below the lighting fixture)

- Fill level: Tray appears lightly loaded or partially empty in the visible portion. → PASS
- Tray condition: No visible deformation; perforated tray structure intact. → PASS
- Earth continuity conductor: Not clearly visible; backlit by the luminaire glare. → CANNOT DETERMINE
- Verdict: FLAG FOR REVIEW (earthing cannot be confirmed)

Cable Tray 3: (Right-side run near the danger/415V signage)

- Fill level: Cannot assess — partially obscured by signage, distance, and lighting glare. → CANNOT DETERMINE
- Tray condition: No obvious damage visible, but resolution is insufficient for confidence. → CANNOT DETERMINE
- Earth continuity conductor: Not visible. → CANNOT DETERMINE
- Verdict: CANNOT DETERMINE

Summary Findings

- Floor cables: NO loose cables visible on floor — the floor area appears clear in the foreground.
- Overall: FLAG FOR REVIEW
- Summary: Several overhead cable trays are visible but lighting glare, viewing angle, and distance prevent confirmation of earth continuity conductors and exact fill levels across all runs. Tray 1's dense cable bundle and the inability to verify protective earthing on multiple runs require on-site verification before any pass can be issued.


Note: This is a preliminary visual assessment only. Earth continuity, fill percentages, and tray condition should be physically verified on-site, as photographic limitations (glare, angle, resolution) prevent definitive compliance verdicts for most items here.

▼ Frame 3 | t=10.0s | Result: FAIL

Cable Tray 1 | CANNOT DETERMINE Cable Tray 2 | CANNOT DETERMINE Cable Tray 3 | CANNOT DETERMINE



Floor/Clearance | FAIL

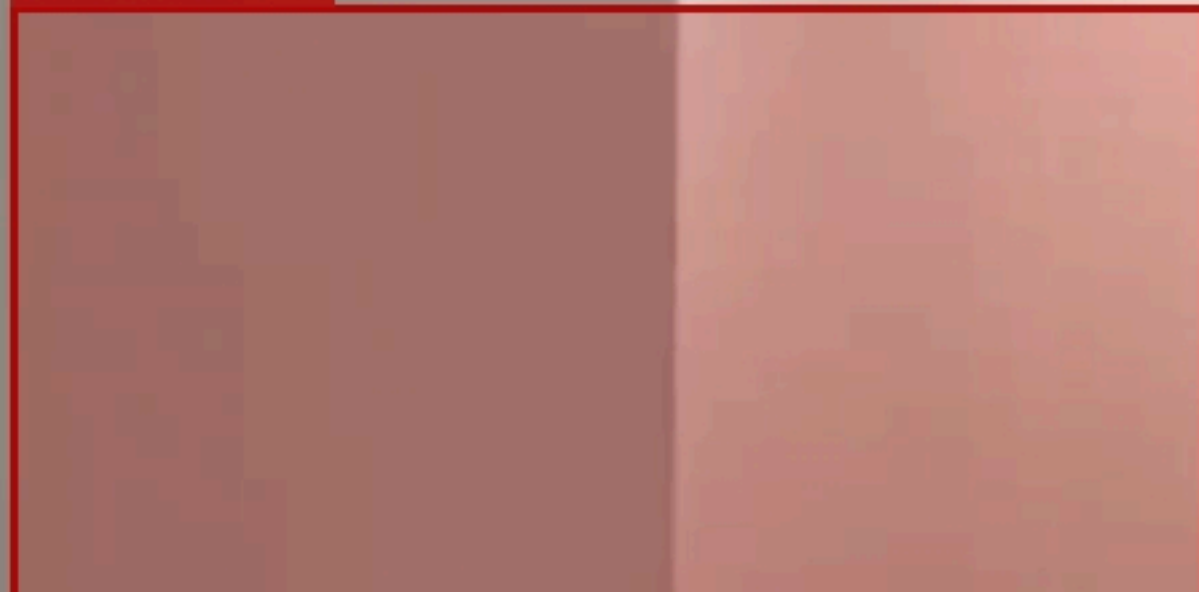

Annotated output — colour-coded by element and severity

Overall Result: FAIL	
Detected Elements	
Cable Tray 1	CANNOT DETERMINE
Cable Tray 2	CANNOT DETERMINE
Cable Tray 3	CANNOT DETERMINE
Floor / Clearance	FAIL

Full Assessment Report

Preliminary Electrical Installation Inspection — SS 638

Important Caveat

This photograph is taken from a low upward angle in poor/uneven lighting. The orange structures visible overhead appear to be **perforated cable tray/ladder runs and structural support members**, but I cannot see any cables clearly populating them. A large pale panel/partition obscures the lower-left portion of the frame. My assessment is limited accordingly.

Cable Tray Assessment

Cable Tray 1 (upper orange perforated run, top-left of frame):

- Fill level — No cables clearly visible within the tray. CANNOT DETERMINE.
- Tray condition — No obvious crushing or cracking visible, but resolution and angle are poor. CANNOT DETERMINE.

3. Earth continuity conductor — No green-and-yellow conductor visible. CANNOT DETERMINE.

- **Verdict: CANNOT DETERMINE**

Cable Tray 2 (orange perforated run, central/right overhead):

1. Fill level — No cable bundle resolvable; tray appears empty or out of focus. CANNOT DETERMINE.
2. Tray condition — No deformation visible from this angle. CANNOT DETERMINE.
3. Earth continuity conductor — Not visible. CANNOT DETERMINE.

- **Verdict: CANNOT DETERMINE**

Cable Tray 3 (lower orange channel/support members near the linear light fitting):

1. Fill level — These appear to be structural beams or support brackets rather than populated trays; no cables visible. CANNOT DETERMINE.
2. Tray condition — No visible damage. CANNOT DETERMINE.
3. Earth continuity conductor — Not visible. CANNOT DETERMINE.

- **Verdict: CANNOT DETERMINE**


(Note: It is not possible to reliably distinguish individual tray runs from structural steelwork in this image. The count of "3" is approximate.)

Final Summary


- **Floor cables:** NO loose cables visible on floor (floor area is largely obscured by the partition/panel; cannot confirm clear floor either).
- **Overall: CANNOT DETERMINE**
- **Summary:** The image shows overhead orange perforated tray/support steelwork but no clearly resolvable cabling, fill level, earth bonding conductors, or damage, so no compliance verdict can be issued. A re-inspection with proper lighting, closer/level camera angles, and unobstructed views of each tray run is required before any PASS/FAIL determination under SS 638.

▼ Frame 4 | t=15.0s | Result: FLAG FOR REVIEW

Cable Tray 1 | FLAG FOR REVIEW

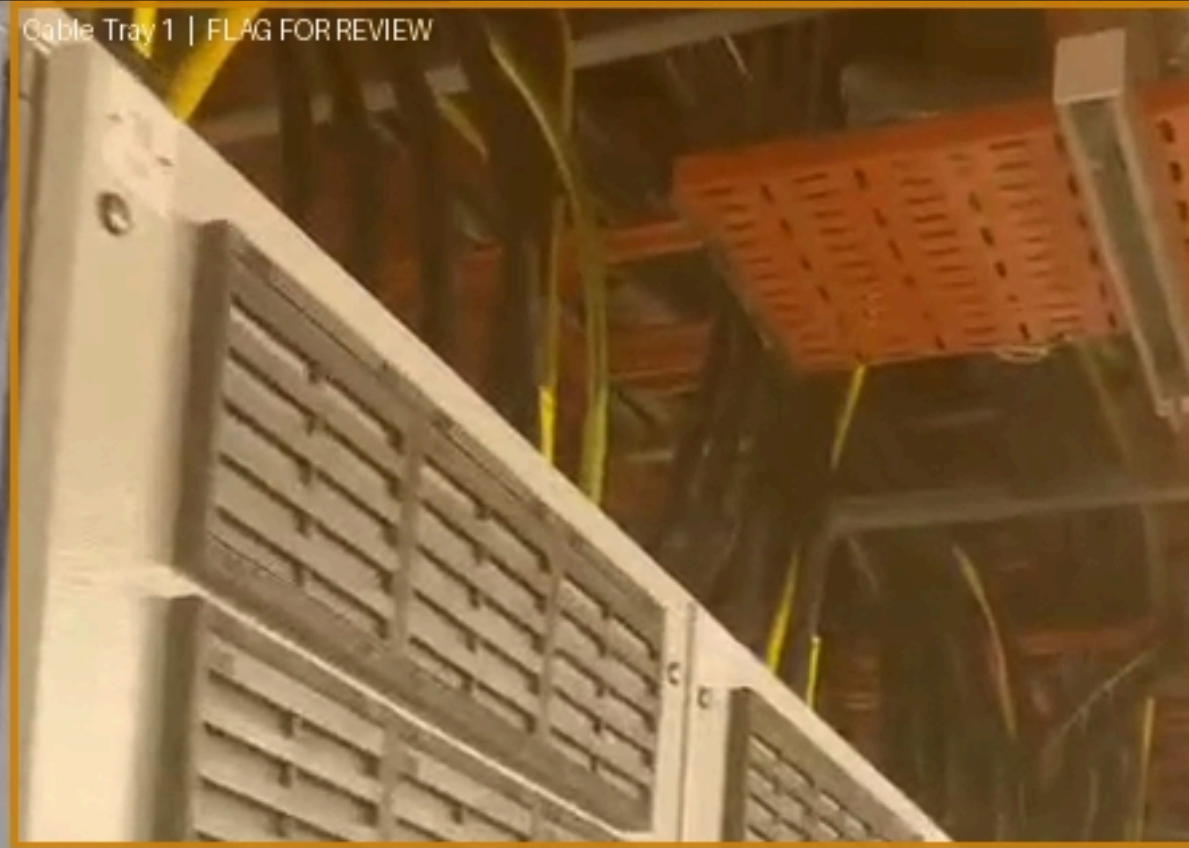

Floor/Clearance | FAIL

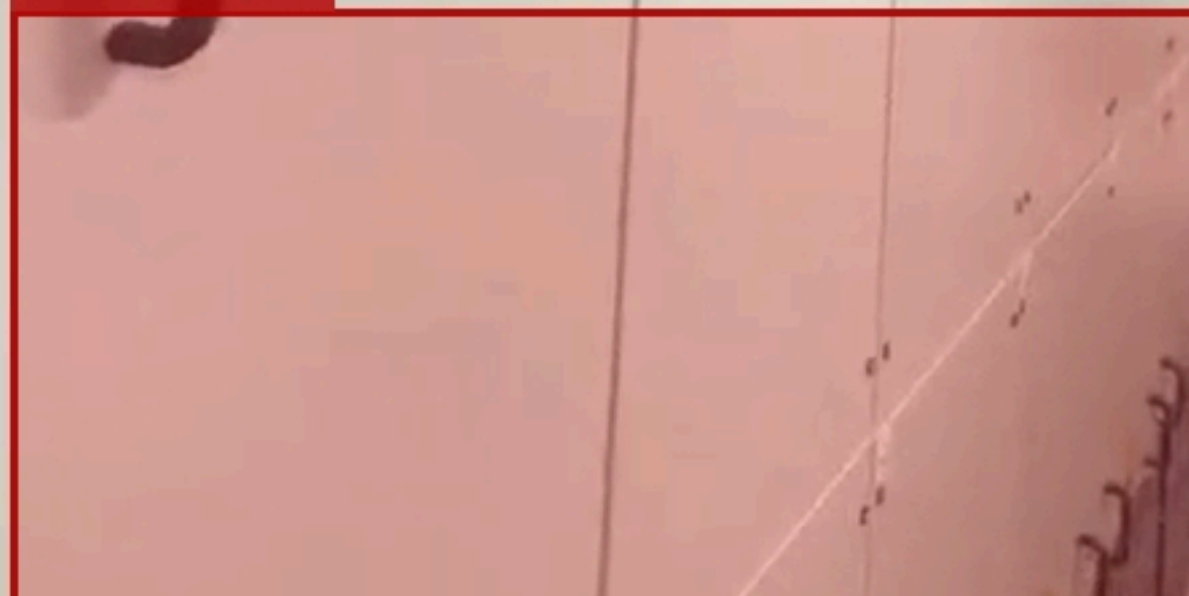

Overall Result: FLAG FOR REVIEW

Detected Elements

Cable Tray 1	FLAG FOR REVIEW
Floor / Clearance	FAIL

Full Assessment Report

Electrical Installation Inspection — SS 638 Preliminary Assessment

Cable Tray / Trunking Assessment

I can identify **one** overhead cable tray/trunking run in this photograph. The orange perforated tray structure runs along the upper portion of the image, carrying a bundle of yellow-jacketed cables. The lower two-thirds of the image shows electrical switchgear/distribution cabinets with ventilation louvres, handles, and warning labels — these are not cable trays.

Cable Tray 1 (orange perforated tray, overhead):

- Fill level** — The visible yellow cable bundle appears to occupy a significant portion of the tray, but the tray's full cross-sectional depth and the complete cable arrangement are obscured by viewing angle and lighting. **CANNOT DETERMINE.**
- Tray condition** — No obvious crushing, cracking, or deformation is visible in the portions shown, but much of the run is poorly lit and partially out of frame. **CANNOT DETERMINE** (insufficient clear view to confirm sound condition along the full run).
- Earth continuity conductor** — No green-and-yellow earth conductor is clearly distinguishable among the cable bundle. The cables visible appear predominantly yellow; I cannot confirm presence or absence of a dedicated G/Y CPC. **CANNOT DETERMINE.**


Verdict: FLAG FOR REVIEW — earth continuity cannot be verified and tray condition/fill require closer physical inspection.

Summary


- **Floor cables:** NO loose cables on floor visible (floor is not in frame).
- **Overall:** FLAG FOR REVIEW
- **Summary:** Only one overhead cable tray is clearly identifiable, and key compliance items — fill percentage, full tray condition, and presence of a green-and-yellow earth continuity conductor — cannot be reliably confirmed from this single angle and lighting condition. A closer on-site inspection with better illumination and access to the full tray run is required before any pass/fail determination can be made.

▼ Frame 5 | t=19.9s | Result: FAIL

Cable Tray 1 | CANNOT DETERMINE

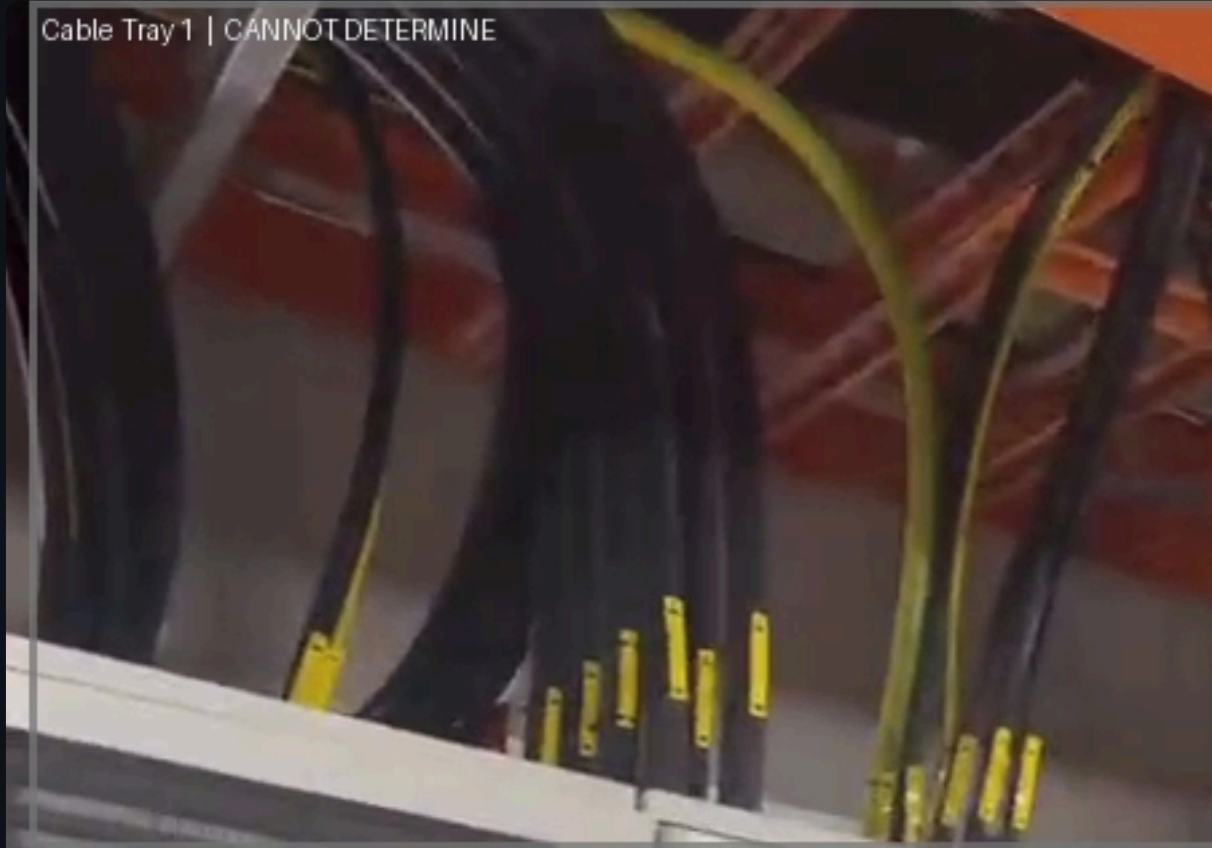

Floor/Clearance | FAIL

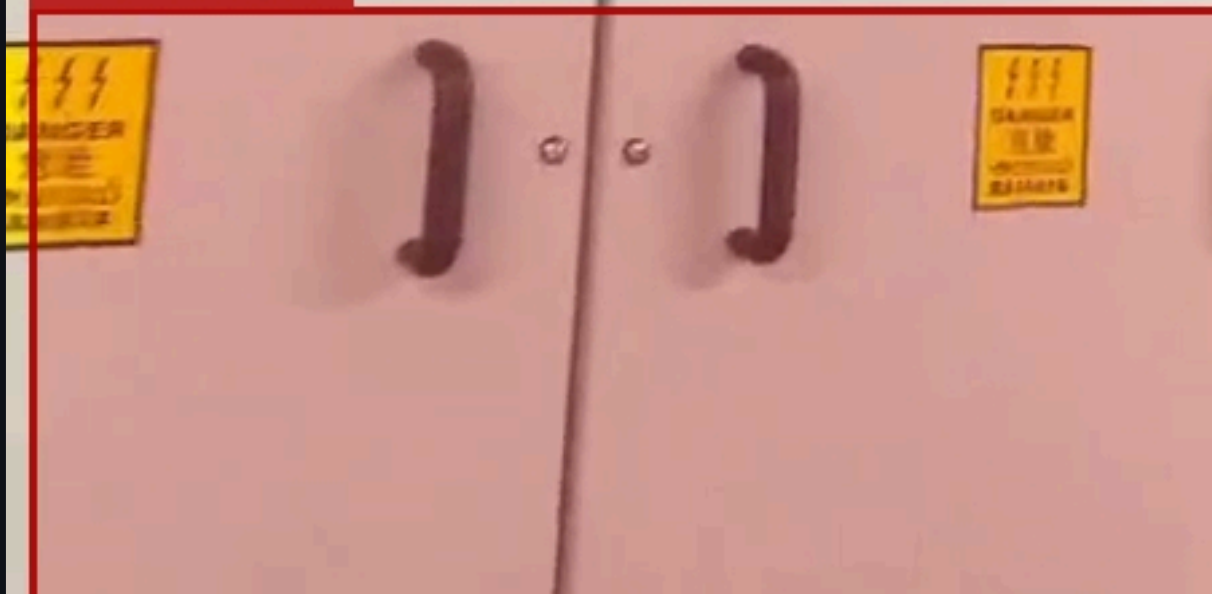

Annotated output — colour-coded by element and severity

Overall Result: FAIL

Cable Tray 1

CANNOT DETERMINE

Floor / Clearance

FAIL

Full Assessment Report

Electrical Installation Inspection — SS 638 Preliminary Assessment

Visible Infrastructure Assessment

I can see cabling entering the tops of electrical distribution cabinets/panels. However, I must note that **no actual cable tray or trunking structure is clearly visible** in this image. The cables (black conductors and green-and-yellow conductors) are seen emerging from the ceiling area and routing into the cabinet tops, but the supporting tray/trunking infrastructure itself is obscured by the cabinets and the upper framing.

Cable Tray 1 (overhead routing zone, partially visible):

- Fill level** — CANNOT DETERMINE. No tray cross-section is visible to assess the ~40% fill threshold.
- Tray condition** — CANNOT DETERMINE. No tray surface, side rail, or rung is clearly visible to inspect for crushing, cracking, or deformation.
- Earth continuity conductor** — FLAG FOR REVIEW. Multiple green-and-yellow conductors ARE visible running alongside the black live conductors entering the cabinets. Their presence is positive, but proper bonding/termination cannot be confirmed from this view.

Verdict: CANNOT DETERMINE (insufficient view of any tray/trunking structure)

Additional Observations

- The orange/red structure at the top is likely structural framing or busbar support, not a cable tray.
- Green-and-yellow earthing conductors are present, which is a positive indicator.
- Cable entry into the cabinets appears generally orderly.


-
- **Floor cables:** NO — no loose cables visible on the floor in this frame.
 - **Overall: CANNOT DETERMINE**
 - **Summary:** No cable tray or trunking structure is sufficiently visible in this image to assess fill level or physical condition against SS 638 requirements. Green-and-yellow earth conductors are present alongside the live conductors, which is encouraging, but a clearer view of the tray runs and conductor terminations is required before any pass/fail verdict can be issued.

▼ Frame 6 | t=24.9s | Result: FLAG FOR REVIEW

Cable Tray 1 | CANNOT DETERMINE



Floor / Clearance | CANNOT DETERMINE

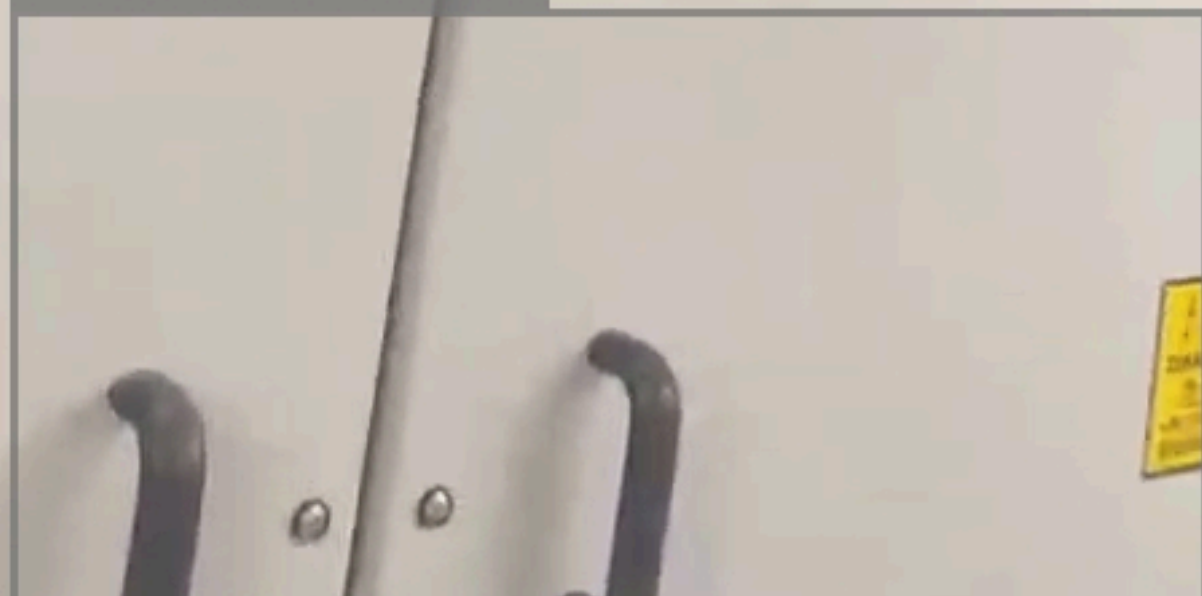

Annotated output — colour-coded by element and severity

Overall Result: FLAG FOR REVIEW

Detected Elements

Cable Tray 1

CANNOT DETERMINE

Floor / Clearance

CANNOT DETERMINE

Full Assessment Report

Preliminary Electrical Installation Inspection — SS 638

Important Limitation

The image shows what appears to be a ceiling/overhead run of conduits and cables above an electrical enclosure/switchgear cabinet. I do **not** see a conventional ladder-type or perforated cable tray in this image. What is visible is a bundle of orange conduits (likely uPVC or HDPE ducting) curving overhead, with no clearly defined tray structure. I will assess what is genuinely visible and avoid guessing.

Cable Tray 1 (overhead orange conduit/duct bundle):

- Fill level:** CANNOT DETERMINE. These are individual orange conduits, not an open tray with a measurable cross-sectional fill. No tray cross-section is visible to assess a 40% threshold.
- Tray condition:** CANNOT DETERMINE. No tray structure visible; the conduits themselves are not clearly deformed, but no supporting tray is in view to inspect for crushing/cracking.
- Earth continuity conductor:** FLAG FOR REVIEW. A green-and-yellow conductor IS visible running across/alongside the orange conduits in the upper portion of the image. Its termination, bonding to the enclosure, and continuity cannot be confirmed from this view.
- Verdict:** CANNOT DETERMINE (for tray-specific criteria); earth conductor presence noted positively but bonding unverified.

Final Assessment

Floor cables: NO — no floor is visible in this frame; cannot confirm presence of loose floor cables (the image is oriented toward the ceiling and cabinet face only).


Overall: CANNOT DETERMINE

Summary: No standard cable tray is clearly visible in this image — only overhead orange conduits and an enclosure face — so fill level and tray condition cannot be properly assessed under IEC 61537 / SS 638 Clause 522.6.1. A green-and-yellow earth conductor is visible among the conduits, which is positive, but its continuity and bonding require physical verification and a clearer photograph of the full tray/trunking run and cabinet interior.

▼ Frame 7 | t=29.9s | Result: FLAG FOR REVIEW



Floor / Clearance | CANNOT DETERMINE

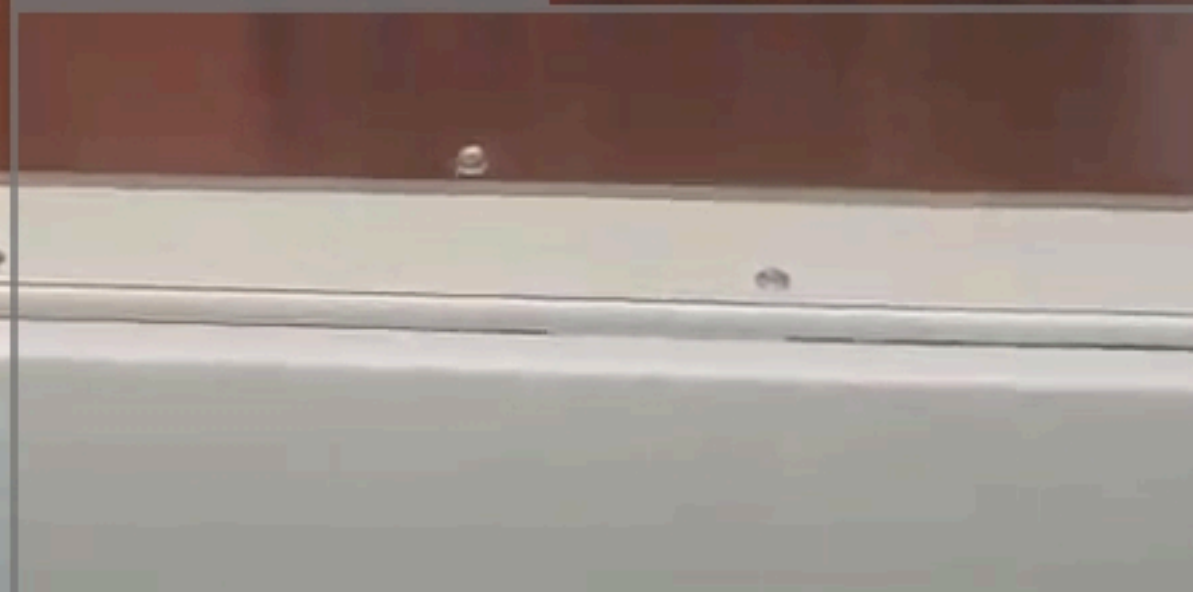

Overall Result: FLAG FOR REVIEW

Detected Elements

Floor / Clearance

CANNOT DETERMINE

Full Assessment Report

Preliminary Electrical Installation Inspection — SS 638

Important Observation on Support System Type

Before assessment, I must note that the support system visible in this photograph is **not a cable tray or cable trunking**. What is shown is a **perforated mounting backplane/panel** (slotted orange sheet metal) with cables running **vertically** down its face, secured at intervals by **cable cleats/saddle clamps** (the yellow fixings visible at multiple horizontal rows).

This is a **vertical cable riser / clamped cable run on a backplane**, not a horizontal cable tray system. I will assess it as the cable support arrangement that is actually present, since reporting "trays" that are not there would be inaccurate.

Number of cable trays visible: 0 (zero conventional cable trays/trunking)

The cables are organised into approximately **2 grouped runs** (a left/centre group of dark cables and a right group of orange cables), supported on a single backplane.

Assessment of the Visible Cable Support Run

Cable Run 1 (clamped backplane run — full width):

- 1. **Fill level** — CANNOT DETERMINE. Fill percentage is a containment (tray/trunking/conduit) metric. This is an open clamped run on a backplane, so the 40% IEC 61537 cross-section rule does not directly apply. No enclosed cross-section is visible to assess.
- 2. **Support/condition** — FLAG FOR REVIEW. Cables appear individually clamped and reasonably ordered. However, lower clamp rows show cables bunched and bowing outward, and clamp spacing/tightness cannot be fully verified from this angle. Mechanical security at the bottom transition needs closer inspection.
- 3. **Earth continuity conductor** — PASS (visible). Green-and-yellow conductors are clearly visible running alongside the live conductors in immediate proximity throughout the run, including at both the upper and lower clamp rows.

Verdict: FLAG FOR REVIEW

Floor and Final Findings

Floor cables: NO — cables terminate/exit at the lower trunking/cill but no loose cables are seen lying on the floor; the lower grey surface appears clear.

Overall: FLAG FOR REVIEW


Summary: No conventional cable tray or trunking is present in this image — the installation is a vertically clamped cable run on a perforated backplane, so the IEC 61537 fill criterion cannot be applied. Green/yellow earth conductors are clearly present alongside the live cables (a positive finding), but clamp security and the bowed cable grouping at the lower section warrant closer physical inspection before a PASS can be confirmed.

Note: This is a preliminary visual assessment only. Verification of conductor sizing, earth bonding terminations, clamp torque, and segregation requires physical inspection and is beyond what can be determined from a single photograph.

Cable Tray 1 | FLAG FOR REVIEW Cable Tray 2 | FLAG FOR REVIEW Cable Tray 3 | FLAG FOR REVIEW



Floor / Clearance | FLAG FOR REVIEW

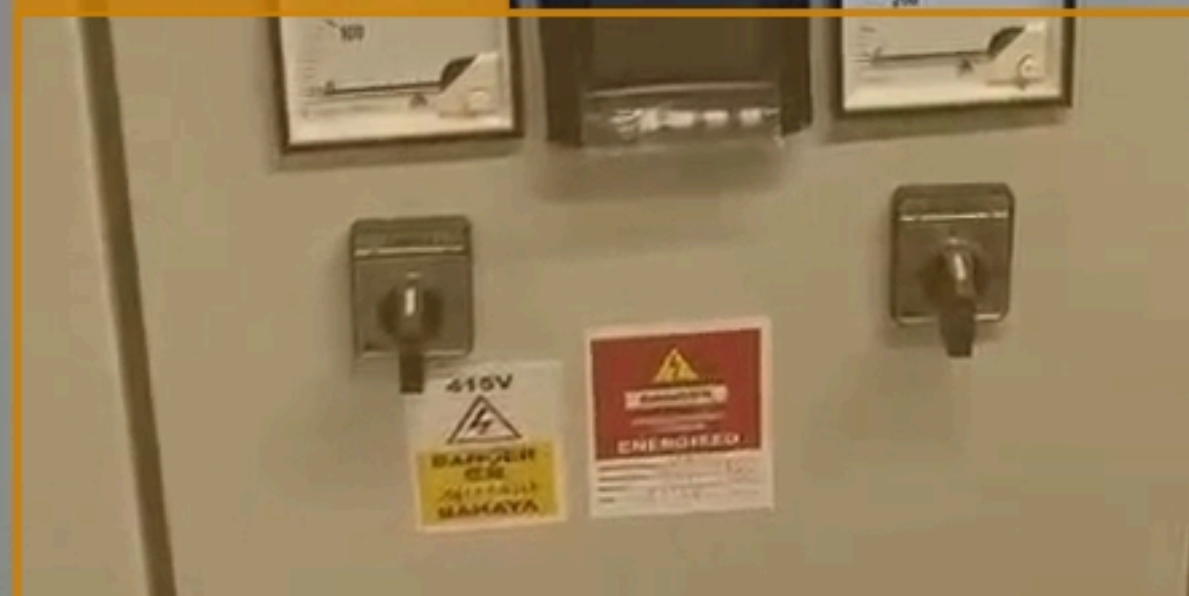

Annotated output — colour-coded by element and severity

Overall Result: FLAG FOR REVIEW

Detected Elements

Cable Tray 1	FLAG FOR REVIEW
Cable Tray 2	FLAG FOR REVIEW
Cable Tray 3	FLAG FOR REVIEW
Floor / Clearance	FLAG FOR REVIEW

Full Assessment Report

Preliminary Electrical Installation Inspection — SS 638

Important Caveat

This image shows what appears to be an **electrical switchboard/panel (LV distribution board)** with vertical cable risers behind perforated orange barriers, rather than conventional horizontal cable trays. The visible busbar/cable arrangement makes precise assessment difficult. I will report only what is clearly visible and use CANNOT DETERMINE where appropriate.

Cable Tray / Riser Assessment

I can identify approximately 3 **vertical cable riser channels** (separated by the orange perforated barrier panels with black vertical busbar/cable segregation).

Cable Tray 1 (left riser channel):

- Fill level: CANNOT DETERMINE — the conductor bundle is partially obscured behind the perforated barrier; cross-sectional fill not measurable from this angle.

- Condition: No visible crushing or deformation. PASS on visible condition.
- Earth continuity: Green-and-yellow conductor IS visible. PASS on earth visibility.
- **Verdict: FLAG FOR REVIEW** (fill not determinable)

Cable Tray 2 (center riser channel):

- Fill level: CANNOT DETERMINE — obscured by barrier panel.
- Condition: No visible damage. PASS on visible condition.
- Earth continuity: Green-and-yellow conductor IS visible (yellow conductor loops prominently). PASS.
- **Verdict: FLAG FOR REVIEW** (fill not determinable)

Cable Tray 3 (right riser channel):

- Fill level: CANNOT DETERMINE.
- Condition: No visible damage. PASS on visible condition.
- Earth continuity: CANNOT DETERMINE — green/yellow not clearly distinguishable in this channel.
- **Verdict: FLAG FOR REVIEW**

Final Report

Floor cables: NO — no loose cables visible on the floor in this frame.

Overall: FLAG FOR REVIEW

Summary: The image depicts a switchboard riser arrangement rather than open horizontal cable trays, and the perforated segregation barriers obscure conductor cross-sections so that fill levels cannot be reliably verified against the ~40% IEC 61537 threshold. Earth continuity (green-and-yellow) is visibly present in at least two channels and no physical tray damage or loose floor cables are evident, but on-site close inspection with the barriers removed is required to confirm fill and full earth continuity.


Cable Tray 1 | CANNOT DETERMINE



Cable Tray 2 | CANNOT DETERMINE



Floor/Clearance | FAIL

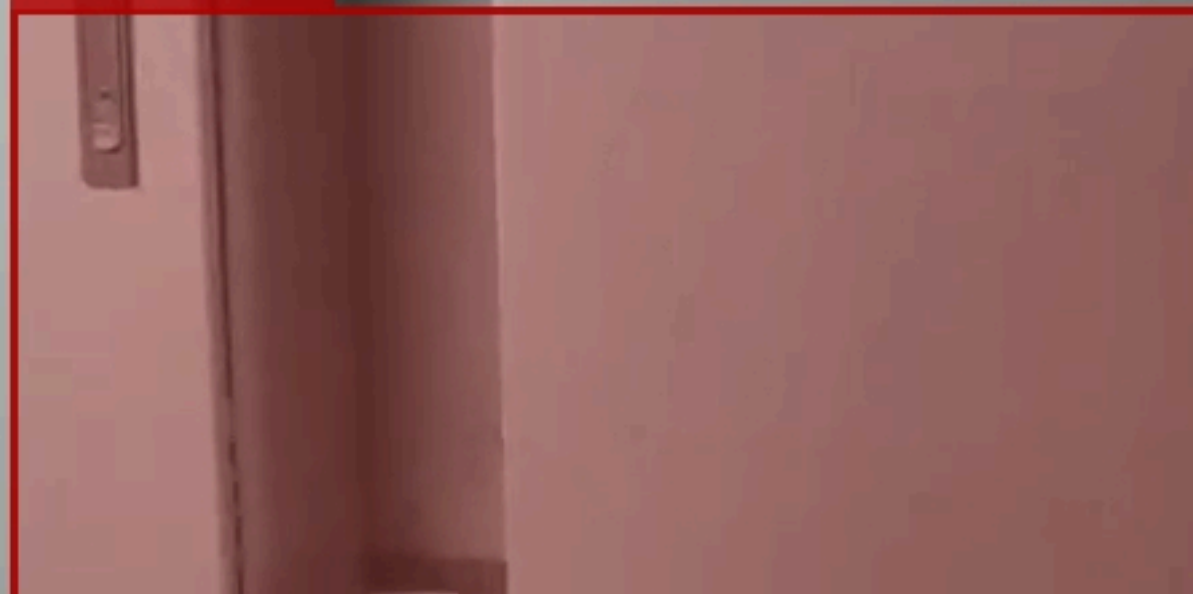

Annotated output — colour-coded by element and severity

Overall Result: FAIL

Detected Elements

Cable Tray 1	CANNOT DETERMINE
Cable Tray 2	CANNOT DETERMINE
Floor / Clearance	FAIL

Full Assessment Report

Electrical Installation Inspection — SS 638 Preliminary Assessment

Visible Cable Management Systems

I can identify the following in this image. Note that the upper portion shows **orange/red perforated vertical cable support channels (strut/rack structures)** with cabling, rather than conventional horizontal enclosed trunking. I will assess what is visible.

Cable Tray 1 (upper-left orange perforated channel):

- Fill level: CANNOT DETERMINE — the cross-section is partially obscured and viewed at an angle; actual fill percentage is not reliably visible.
- Condition: No obvious crushing or cracking visible, but view is partial. CANNOT DETERMINE fully.
- Earth continuity: A yellow conductor is visible, but I cannot confirm green-and-yellow striping (earth) versus a plain yellow cable. CANNOT DETERMINE.
- Verdict: CANNOT DETERMINE

Cable Tray 2 (upper-center/right orange perforated channels):

- Fill level: Appears lightly populated, but the run continues out of frame. CANNOT DETERMINE.
- Condition: No visible deformation, but partial view.
- Earth continuity: Yellow cable(s) visible; green-and-yellow striping not clearly confirmable. A coiled yellow conductor is present but its function is unclear.
- Verdict: CANNOT DETERMINE

Other Observations

- The lower portion shows **grey switchgear/distribution panels** with illuminated blue indicator lamps, an "ENERGISED" warning label, and a 415V hazard label — these are panel enclosures, not cable trays, so fill/earth criteria do not apply.
- The energised warning suggests **live equipment** — inspection should observe safe-distance/permit-to-work controls.

Final Assessment

- **Floor cables:** NO — no loose cables are visible lying on the floor in this frame.
- **Overall:** CANNOT DETERMINE
- **Summary:** The visible cable support channels are seen only partially and at an angle, preventing reliable assessment of fill level, mechanical condition, and earth-continuity conductor identification. A closer, unobstructed inspection of each tray run — with confirmation of green-and-yellow earth bonding — is required before any PASS/FAIL verdict can be issued, and live-equipment safety controls should be verified given the energised panel label.

Note: This is a preliminary visual screening only and does not replace a full on-site inspection with direct access and measurement.

Cable Tray 1 | FLAG FOR REVIEW



Floor/Clearance | CANNOT DETERMINE



Overall Result: FLAG FOR REVIEW

Detected Elements

Floor / Clearance

CANNOT DETERMINE

Cable Tray 1

FLAG FOR REVIEW

Full Assessment Report

Preliminary Electrical Installation Inspection — SS 638

Cable Tray / Trunking Assessment

I can identify **1 cable tray/trunking run** clearly visible in this photograph — the horizontal cable run at floor level, to the lower-left of the electrical switchboard cabinets, where colored cables (red, orange) are visible exiting from beneath the panels and running along a tray near the floor/wall junction.

Cable Tray 1: (Horizontal floor-level run, lower-left of switchboard)

- Fill level** — Multiple cables (red, orange, and others) are visible bunched together at the tray entry beneath the cabinets. The full cross-section of the tray is **not clearly visible** (partially obscured by the cabinet base and shadow), so a reliable 40% fill determination cannot be made. **CANNOT DETERMINE.**
- Tray condition** — No visible crushing, cracking, or deformation in the portion shown, but the tray run is largely hidden in shadow and behind the cabinet plinth. Insufficient view for a complete condition assessment. **CANNOT DETERMINE.**
- Earth continuity conductor** — No clearly identifiable green-and-yellow conductor can be distinguished running alongside the live conductors in the visible portion. The cabling appears to be red/orange phase or numbered conductors. **FLAG FOR REVIEW** (absence not confirmed — view obscured).

Verdict: FLAG FOR REVIEW

Summary Findings

- **Floor cables:** NO — no loose/unsecured cables are seen lying free across the floor. There is a thin dark line on the right side of the floor that could be a single cable/wire, but it is not clearly within an installation area and is ambiguous. The main cabling is contained within the floor-level tray, not loose.
- **Overall: FLAG FOR REVIEW**
- **Summary:** Only one cable tray/trunking run is visible and it is substantially obscured by shadow and the switchboard plinth, preventing reliable verification of fill level, condition, and the presence of an earth continuity conductor. A closer follow-up inspection with the tray fully exposed is required before any pass/fail determination can be issued.

Note: This is a preliminary visual assessment only. The majority of the image shows the closed switchboard cabinet doors, behind which internal cabling cannot be inspected. A full inspection requires open access to all trunking and tray runs.