

FORMAL ADA/PROWAG CIVIL RIGHTS GRIEVANCE

City of Bloomington, Indiana

717 S. Henderson Street — Removal of Accessible Pedestrian Route During Redevelopment; Failure of ADA/PROWAG Review in Planning, Permitting, Construction, and Complaint-Intake Process

Submitted to: Michael Shermis, ADA Coordinator / Human Rights Commission Director

City: City of Bloomington, Indiana

Date: July 7, 2026

Re: ADA / PROWAG Non-Compliance — Removal of Accessible Pedestrian Route, 717 S. Henderson Street; Failure to Provide Accessible Alternate Route During Construction; Failure of ADA/PROWAG Review and Complaint-Routing Process

1. Introduction and Overview

This document constitutes a formal civil-rights grievance filed pursuant to Title II of the Americans with Disabilities Act of 1990, 42 U.S.C. § 12131 et seq., and relies on the Public Rights-of-Way Accessibility Guidelines, 36 C.F.R. Part 1190, as Bloomington's adopted public-right-of-way accessibility standard and as the current federal technical guideline for accessible pedestrian facilities in the public right-of-way. The complaint concerns a recent redevelopment project at 717 S. Henderson Street in which a continuous, direct pedestrian access route was interrupted and, for a period of many weeks, left as a route directing pedestrians across loose gravel and over an abrupt vertical drop.

This complaint is deliberately framed around process, not only around the physical condition of the sidewalk at this moment. The complainant anticipates that by the time this complaint is reviewed, the City may already have corrected the physical defect documented herein — whether in response to this complaint, in response to other public reports, or in the ordinary course of project completion. That correction, if it occurs, does not resolve this complaint. The central concern is that the City's planning, permitting, construction-inspection, and complaint-intake processes allowed an existing accessible pedestrian route to be degraded in the first place, without adequate ADA/PROWAG review, and without an accessible alternate route during the period of construction. A physical fix made after the fact does not establish that the underlying process failure has been corrected, and the complainant requests that the City's response address the process failure directly rather than treating remediation of the physical condition as a complete response.

This complaint should not be treated as resolved by repaving or regrading the area described in Section 2.3, even if that work is completed before the City responds. The City's response should separately address the process failures described in Sections 5 and 6.

The redevelopment at 717 S. Henderson Street is one of a series of locations where the complainant has observed City pedestrian infrastructure projects proceed without apparent

ADA/PROWAG review. This complaint is filed as a distinct matter, addressed to the specific facts at 717 S. Henderson Street, and is independent of any other ADA/PROWAG complaint the complainant has filed or may file with the City.

In summary, the complainant requests that the City:

- Confirm the date and nature of any physical correction;
- Identify whether ADA/PROWAG review occurred during planning, permitting, construction, or inspection;
- Identify what accessible temporary or alternate pedestrian access route was provided while the route was obstructed; and
- Establish or confirm a complaint-routing and ADA/PROWAG review process for right-of-way-adjacent projects affecting pedestrian access routes.

2. Factual Background and Timeline

2.1 Location and Parcels

The property at 717 S. Henderson Street was recently redeveloped: an existing house was demolished and replaced with a duplex. The adjoining property to the north, at 715 S. Henderson Street, is a separate parcel. Based on the City's GIS parcel map (Fig. 1), the redeveloped lot is identified as Parcel 53-08-04-112-052.000-009, and the lot immediately to the north is Parcel 53-08-04-112-008.000-009. An alley right-of-way appears to run between these two parcels, separating the redeveloped lot from the parcel to its north, and to continue across Henderson Street to the west side, where it adjoins residences located at 712 and 710 S. Henderson Street.

The complainant requests that the City confirm, as part of its response to this complaint, the dedicated or right-of-way status of this alley, including whether it is platted public right-of-way, a recorded easement, or an unrecorded de facto path. Regardless of its formal platted status, the alley functions as the only pedestrian connection available at this location once the prior continuous sidewalk was interrupted, and the City required or permitted it to serve that function during and after the redevelopment.



Fig. 1: City of Bloomington GIS parcel map showing the redeveloped lot (53-08-04-112-052.000-009), the adjoining parcel to the north (53-08-04-112-008.000-009), and the alley right-of-way running between them and continuing west across S. Henderson Street (complainant's annotated screen capture).

2.2 The Pre-Redevelopment Pedestrian Route

The complainant's understanding of the history of this frontage, based on available Google Street View imagery and direct observation, is as follows. In approximately 2017, and as late as May 2019, the sidewalk condition in this area was discontinuous and did not provide a continuous accessible pedestrian route (Fig. 2). At some point after 2019, and before the 717 S. Henderson redevelopment began, the City or a prior property owner improved the frontage to provide a continuous, direct, paved concrete pedestrian route. Google Maps Street View imagery dated April 2026 — captured after redevelopment had begun but before the sidewalk was relocated — shows that a continuous concrete sidewalk ran in a straight line along this frontage and that the alley crossing was paved at that time (Fig. 3).

This sequence matters because it establishes that the City had already moved this location toward accessibility compliance by the time the 717 S. Henderson redevelopment began. The redevelopment did not occur at a location where no accessible route had ever existed; it occurred at a location where a continuous accessible route already existed and was then interrupted and replaced by a substantially worse condition.

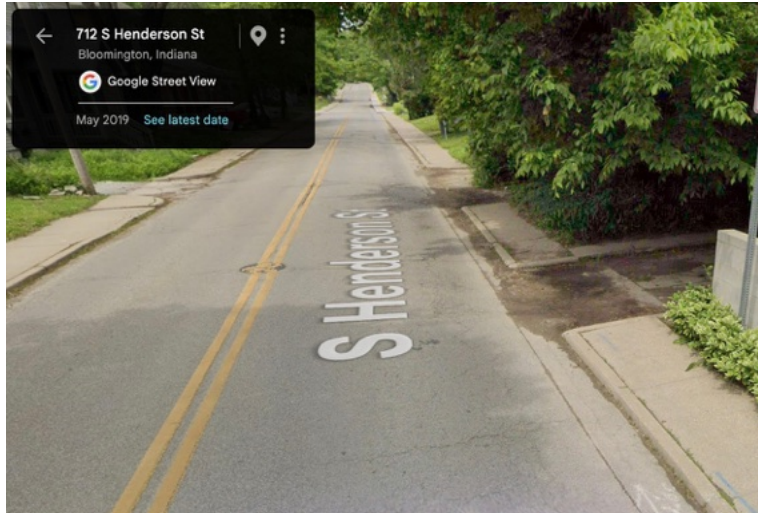


Fig. 2: Google Street View imagery dated May 2019, 717 S. Henderson on right.



Fig. 3: Google Maps Street View imagery dated April 2026, showing a continuous concrete sidewalk running in a straight line along the 717 S. Henderson frontage with the alley crossing paved, at a point when redevelopment had begun but the sidewalk had not yet been relocated (Google Maps).

2.3 The Redevelopment and the New Barrier

As part of the 717 S. Henderson redevelopment, and consistent with applicable code requirements, the builder reconstructed the sidewalk frontage with a setback from the property line. The complainant does not dispute that a setback was required by code and takes no position on the setback requirement itself. The complaint concerns the pedestrian connection the City permitted or accepted within and beyond that setback area, as observed by the complainant: rather than a continuous compliant sidewalk, the observed condition directs

pedestrians off the new concrete sidewalk, across a loose gravel alley surface, and includes an abrupt vertical drop of greater than 3 inches at or near the transition between the concrete and the gravel (Fig. 4). If the City has since altered or corrected this condition, or considers the project ongoing, that does not change what was permitted and left in place for the period documented in this complaint. A required setback does not, by itself, justify or explain a noncompliant transition and a gravel crossing within the resulting frontage; the City retained discretion over how the connection across that frontage was designed, permitted, and approved.



Fig. 4: Complainant's photograph, June 2026, showing the condition at 717 S. Henderson Street following the sidewalk reconstruction. The new concrete sidewalk ends at a loose gravel alley crossing, with an abrupt vertical drop at the transition. See Fig. 6 for a close-up photograph of the drop.

2.4 Duration of the Obstruction

The complainant does not have the precise construction dates and will request them from the City as part of this complaint. Based on the complainant's observation, the condition shown in Fig. 4 was already in place when first noted on approximately June 11, 2026, and remained in that condition for at least several weeks thereafter.

The complainant's position is that the duration of an unaddressed obstruction is relevant to the severity of the violation, but is not a precondition to it. The obligation to provide an accessible route — including a compliant temporary or alternate accessible route during construction — attaches from the moment an existing accessible route is closed or interrupted, regardless of how long the closure is expected to last. Even a brief obstruction triggers the obligation to provide, identify, and maintain a compliant temporary route. That said, the complainant specifically asks the City to explain why a multi-week, complete obstruction of the only accessible route to this frontage was allowed to persist without any documented accessible

alternate route being established, signed, or maintained. A violation of several weeks' duration is not a marginal or technical lapse; it is a sustained denial of access that compounds the underlying process failure.

2.5 The West-Side Alternative Is Not a Meaningful Accessible Route

To the extent the City takes the position that pedestrians could simply use the sidewalk on the opposite (west) side of S. Henderson Street, that position does not withstand examination. The west-side sidewalk, at the point where it adjoins the continuation of the same alley right-of-way, itself contains an impassable or noncompliant alley-cut condition (Fig. 5). A pedestrian using a wheelchair or other mobility device who is blocked at 717 S. Henderson cannot simply cross the street to a fully accessible alternate route; the opposite frontage presents a comparable barrier at the same alley crossing.



Fig. 5: Photograph of the alley-cut condition on the west side of S. Henderson Street, at the continuation of the same alley right-of-way shown in Fig. 1 (complainant's photograph).

2.6 Close-Up Documentation of the Vertical Drop

Fig. 6 is a close-up photograph of the vertical drop at the concrete-to-gravel transition on the east side of the crossing (717 S. Henderson Street). The foam block is roughly 2 and 3/4 inches in height. Independent of any precise measurement, the photograph makes plain that the drop is an abrupt change in level well in excess of what PROWAG R302.6.2 permits without a compliant sloped transition. R302.6.2 allows an abrupt vertical change of only up to 0.25 inch (and up to 0.5 inch if beveled); any greater change must be achieved by a sloped transition, not an abrupt drop. The drop is problematic from any viewing angle, and the complainant offers the photograph on that basis rather than as a precise dimensional reading.



Fig. 6: Close-up photograph of the vertical drop at the concrete-to-gravel transition, east side (717 S. Henderson Street), documenting an abrupt change in level well in excess of what PROWAG R302.6.2 permits without a compliant sloped transition. The foam is roughly 2 and 3/4 inches in height. (complainant's photograph).

3. Applicable Regulatory Framework

3.1 Title II of the ADA — Program Accessibility (28 C.F.R. § 35.150)

Under 28 C.F.R. § 35.150(a), a public entity shall operate each service, program, or activity so that it is readily accessible to and usable by individuals with disabilities when viewed in its entirety. This obligation does not depend on the occurrence of a recent alteration; it is the City's ongoing, unconditional obligation, in effect since January 26, 1992. Where the City's own redevelopment-approval and construction process results in the loss of an existing accessible route, the program accessibility obligation requires the City to ensure a compliant route is restored or maintained, including during the period of construction.

3.2 PROWAG Requirements for Alterations and Temporary Conditions

Under PROWAG, where a pedestrian circulation path is temporarily closed by construction, maintenance operations, or similar conditions, an alternate pedestrian access route must be provided (R201.2). That alternate route must comply with R303 and R402 (R204.1): its surface must comply with R302.6 or be no less accessible than the temporarily closed path (R303.3), and it must provide a continuous clear width of 48 inches (1220 mm) minimum (R303.4). Only where establishing or maintaining an alternate route is technically infeasible due to site conditions or existing physical constraints may the public entity instead provide an alternate means of access (R204.1 Exception). The complainant is not aware of any accessible alternate route having been identified, signed, or provided during the period the 717 S. Henderson frontage was obstructed.

Independently, PROWAG R202.4 provides that an alteration shall not decrease the accessibility of an existing pedestrian facility or element below the requirements of these guidelines. The redevelopment at 717 S. Henderson did not merely fail to improve an inaccessible condition; on the evidence available to the complainant, it interrupted a continuous concrete pedestrian route and, for a period of many weeks, left in its place a materially less accessible gravel crossing with an abrupt change in level. Whether or not the connection is subsequently paved, the decrease in accessibility during that period is precisely the outcome R202.4 is intended to prevent.

3.3 PROWAG Technical Standards

The following PROWAG technical provisions are directly relevant to the condition described in Section 2.3:

- **R302.6 (Surfaces):** Surfaces of pedestrian access routes shall be firm, stable, and slip resistant. Loose, uncompacted gravel does not satisfy this requirement.
- **R302.6.2 (Changes in Level):** A change in level up to 0.25 inch (6.4 mm) may be vertical; a change between 0.25 inch and 0.5 inch (13 mm) must be beveled; a change greater than 0.5 inch and up to 6 inches must be achieved by a running slope no steeper than 1:12 (8.3%); and a change greater than 6 inches must be provided as a ramp complying with R407. The abrupt vertical drop at this transition, visible in Fig. 4 and shown in close-up in Fig. 6, is a change in level far in excess of what R302.6.2 permits without a compliant sloped transition, and cannot be treated as an acceptable change in level within a pedestrian access route.
- **R203.3 (Pedestrian Circulation Paths):** A pedestrian access route complying with R302 must be provided within pedestrian circulation paths, including sidewalks. A path that diverts a pedestrian off a concrete sidewalk, down an abrupt change in level, across loose gravel, and back to a sidewalk does not provide the continuous pedestrian access route R203.3 requires.

The complainant has not yet obtained running-slope or cross-slope measurements for the transition area, but the visible condition in Fig. 4 raises serious concerns about compliance with PROWAG grade and cross-slope requirements, and the complainant requests that the City's ADA Compliance Officer or another qualified accessibility reviewer inspect and measure the area before it is altered further.

3.4 City of Bloomington PROWAG Adoption (2011)

The Bloomington Board of Public Works formally adopted PROWAG by Resolution 2011-99 on September 27, 2011. Because the redevelopment at 717 S. Henderson occurred well after 2011, the City was on notice of the applicable accessibility standards at the time the project was reviewed, permitted, and inspected.

4. Current Physical Noncompliance

Section 2.3 and Section 3.3 above describe, in combination, the specific respects in which the condition documented at 717 S. Henderson Street fails to comply with PROWAG: a non-firm, non-stable, slip-prone gravel surface in place of a continuous pedestrian access route; an abrupt change in level far in excess of what R302.6.2 permits without a compliant sloped transition; and a route that is not continuous within the meaning of R203.3. The complainant

requests that the City's response confirm whether its inspection and closeout process for this project included any PROWAG-specific review of the pedestrian connection, and if so, what that review found.

5. Failure to Provide an Accessible Route During Construction or Alteration

Independent of the condition of the pedestrian connection as observed by the complainant, the City's obligations existed throughout the construction and alteration process, not only after construction activity concluded. The violation here operates at two levels. First, the condition observed by the complainant appears inaccessible, as described above. Second, and independently, the construction and alteration process interrupted an existing accessible route without ensuring an accessible temporary route was provided in its place.

As described in Section 2.5, the obvious candidate for an alternate route — the opposite, west-side sidewalk — itself contains an impassable or noncompliant alley-cut condition at the same crossing point. This means that even if the City or the contractor assumed pedestrians could simply use the other side of the street, that assumption was incorrect on the facts. The complainant requests that the City identify, in its response, what accessible alternate pedestrian access route was provided during construction, where it was located, how it was signed, how it was inspected, and who certified that it complied with PROWAG. If the City cannot answer these questions, that failure independently supports the broader administrative concerns described in Section 6.

6. Failure of ADA Compliance Administration and Complaint Routing

The third and broader concern raised by this complaint is administrative: the facts suggest that Bloomington's ADA compliance process is not effectively integrated into the City's planning, permitting, construction, inspection, or complaint-response systems for right-of-way projects.

6.1 Absence of ADA/PROWAG Review During Planning and Permitting

On the complainant's understanding, the City's ADA Compliance Officer was not aware of the condition at 717 S. Henderson Street until the complainant raised it. A recent right-of-way construction project created an obvious access barrier at a location where an accessible route had previously existed, yet the City's ADA compliance function does not appear to have detected the issue during planning, permitting, construction, or inspection. The complainant requests that the City confirm whether ADA/PROWAG review is a required step in the site-plan or permit-approval process for redevelopment projects that affect an existing sidewalk frontage, and if so, why that review did not identify this condition.

6.2 Failure to Route Complaints Through the ADA Compliance Officer

Based on secondhand reporting, the complainant's understanding is that City staff who received citizen complaints about this location did not direct callers to contact the ADA Compliance Officer, nor did staff forward the complaints to the ADA Coordinator themselves. City staff did not respond by acknowledging the presence of apparent PROWAG violations. Because the complainant's information about these exchanges is secondhand, the complainant does not

attribute these statements to a particular individual and does not ask the City to take any action against any specific employee.

The complainant requests that the City establish, or confirm the existence of, a clear intake and escalation policy so that any City employee or official who receives a complaint about a pedestrian accessibility barrier knows that the matter must be forwarded to the ADA Compliance Officer or a designated accessibility-review process, regardless of which department first receives it.

6.3 Staffing and Capacity of the ADA Compliance Function

The City reportedly has approximately 500 employees but a single ADA Compliance Officer. The complainant does not contend that this, by itself, violates the minimum coordinator requirement applicable to public entities with 50 or more employees. The complainant's concern is narrower and more practical: a single ADA Compliance Officer may be unable to provide timely review, training, inspection coordination, and complaint response across all City departments and right-of-way projects. The problem is not the individual officer; it is an institutional structure that appears to depend on one person after the fact, while planning, permitting, inspection, and construction-oversight systems continue to operate without effective ADA/PROWAG review built in at the front end.

7. Regulatory Violations

The conditions described above constitute violations of the following:

- **28 C.F.R. § 35.150(a)** — Failure to operate the City's pedestrian program, including its redevelopment-approval process, so that it remains readily accessible to and usable by individuals with disabilities.
- **PROWAG R202.4** — An alteration that decreases the accessibility of an existing pedestrian facility below the requirements of the guidelines, by interrupting a continuous compliant sidewalk and leaving, for a period of weeks, a noncompliant gravel crossing and abrupt change in level.
- **PROWAG R302.6** — Surface not firm, stable, or slip resistant (loose gravel alley crossing).
- **PROWAG R302.6.2** — Abrupt change in level far in excess of what is permitted without a compliant sloped transition.
- **PROWAG R203.3** — No continuous pedestrian access route provided within the pedestrian circulation path across the frontage.
- **PROWAG R201.2, R204.1, and R303** — Failure to provide a documented, accessible alternate pedestrian access route during construction.

8. Potential City Responses and Why They Do Not Resolve the Complaint

8.1 “The Condition Has Already Been Corrected”

As discussed in Section 1, the City may respond that the gravel crossing and the abrupt drop have already been repaved, regraded, or otherwise corrected by the time this complaint is reviewed. The complainant welcomes physical correction of the condition. Correction of the physical condition, however, does not answer the questions this complaint raises about how the condition was permitted to occur in the first place, whether an accessible alternate route was provided during the weeks the area was obstructed, and whether the City's planning, permitting, and inspection process for this project included any ADA/PROWAG review. A complete response to this complaint addresses those questions directly rather than treating repaving as a substitute answer.

8.2 “The Setback Was Required by Code”

The complainant does not dispute that the building setback at 717 S. Henderson Street was required by code, and takes no position on that requirement. A required setback explains why the building and the new sidewalk are positioned where they are. It does not explain, and does not excuse, why the resulting pedestrian connection across that frontage was permitted to run through loose gravel with an abrupt drop of greater than three inches rather than a compliant route. The City retained full discretion over the design and approval of that connection.

8.3 “This Was an Isolated Construction Issue, Not a Systemic Problem”

The City may characterize this as a single, isolated construction defect rather than evidence of a systemic gap in its ADA compliance process. The complainant's position, set out in Section 6, is that the relevant facts — the absence of any apparent ADA/PROWAG review during permitting and inspection, the ADA Compliance Officer's reported unfamiliarity with the condition until it was raised by the public, and the apparent absence of a reliable complaint-routing process — are independent evidence of an administrative gap regardless of how this one location is ultimately resolved. A single corrected sidewalk segment does not address whether the next redevelopment project in the City will receive ADA/PROWAG review before, during, and after construction.

8.4 “Pedestrians Could Use the Other Side of the Street”

As documented in Section 2.5 and Fig. 5, the west-side sidewalk presents a comparable barrier at the same alley crossing and is not a meaningful accessible alternative.

9. Remedies Requested

Tier 1 — Essential Remedies Requested

Remedy 1A — Confirmation and Documentation of Physical Correction

If the condition described in Section 2.3 has been or will be physically corrected, the City shall confirm in writing the date of correction, the nature of the work performed, and confirmation that the corrected route complies with PROWAG R302.2 (48-inch / 4.0 ft minimum continuous clear width), R302.6 (firm, stable, slip-resistant surface), and R302.6.2 (compliant changes in level, with no abrupt vertical change greater than that permitted without a sloped transition). If the condition has not yet been corrected, the City shall provide a specific construction start date, completion date, and the contractor or City crew assigned.

Remedy 1B — Process Accounting

The City shall produce a written accounting of the ADA/PROWAG review process applicable to the 717 S. Henderson redevelopment, including:

- Whether ADA/PROWAG review occurred at the site-plan, permitting, or inspection stage, and if so, by whom and with what result;
- What accessible alternate pedestrian access route, if any, was identified, signed, or provided during the period the frontage was obstructed, and how that route was inspected or certified;
- The dates construction began and ended at this frontage; and
- The dedicated or right-of-way status of the alley shown in Fig. 1.

Remedy 1C — Written Acknowledgment

The complainant requests a written response addressing each apparent violation or compliance concern identified in Section 7. If the City's position is that no violation occurred, the complainant requests that the City explain the factual and legal basis for that position in writing.

Tier 2 — Preferred Systemic Remedies

The complainant recognizes that the City faces competing demands on its resources, and offers the following as preferred additional measures rather than a waiver of the Tier 1 remedies above.

Remedy 2A — Written ADA/PROWAG Review Requirement for Right-of-Way-Adjacent Projects

For construction, redevelopment, utility, sidewalk, driveway, alley, or right-of-way projects that affect an existing pedestrian circulation path, the City should require a written ADA/PROWAG review before approval, documenting the existing route, whether the project will disturb or close it, the accessible temporary alternate route, the final route, any known PROWAG issues, and the person or office responsible for verifying compliance.

Remedy 2B — Certification of Accessible Alternate Routes Before Construction

Before construction begins on any project affecting a pedestrian route, the City should require written confirmation that an accessible alternate pedestrian access route is available, identifying the route and explaining how it satisfies PROWAG — not merely an assumption that pedestrians can cross the street or find another path.

Remedy 2C — Inspection and Closeout Procedure

The City should require inspection before any altered pedestrian route is opened to the public, verifying PROWAG compliance for surface, changes in level, slope, cross-slope, width, and continuity, with a written closeout record.

Remedy 2D — Complaint-Routing Procedure

The City should establish a written process requiring that all ADA-related complaints involving sidewalks, curb ramps, alleys, street crossings, construction closures, obstructions, or pedestrian access routes be routed to the ADA Compliance Officer or a formally designated accessibility reviewer, regardless of which City office first receives the complaint.

Remedy 2E — ADA/PROWAG Training

All relevant City staff — Planning, Public Works, Engineering, Inspectors, HAND, Utilities, applicable boards and commissions, and staff who respond to public complaints about sidewalks or pedestrian access — should receive mandatory ADA/PROWAG training. The ADA Compliance Officer should maintain training records and document recurring categories of error so that targeted retraining can be provided where needed.

Remedy 2F — Capacity Evaluation

The City should evaluate whether its ADA compliance function has sufficient staffing, authority, and administrative support to provide timely review and complaint resolution, including written response timelines, delegated trained reviewers where appropriate, escalation procedures for overdue requests, and integration of ADA review into permitting and inspection systems.

10. Notice of Intent to Escalate

Should the City fail to provide a substantive response within 60 days of receiving this complaint, or should the response consist of confirmation that the physical condition was corrected without addressing the process questions raised in Sections 6 and 9, the complainant reserves the right to submit this complaint and the City's response to the Indiana Civil Rights Commission and to the U.S. Department of Justice, Civil Rights Division, Disability Rights Section.

The complainant notes that separate ADA/PROWAG complaints submitted to the City on March 20, 2026 and March 27, 2026 remain outstanding without a formal written response. As of July 7, 2026, those complaints have been pending for 103 and 96 days, respectively. This history is noted only as relevant context regarding the City's current response timeline; the complainant is not consolidating those matters with this complaint or requesting relief here on their basis.

11. Supporting Documents and References

- U.S. Access Board, Public Rights-of-Way Accessibility Guidelines (PROWAG), Final Rule, 36 CFR Part 1190, effective October 7, 2023 (88 FR 53608).
- City of Bloomington, Board of Public Works, Resolution 2011-99, September 27, 2011 (PROWAG adoption).
- U.S. Department of Justice / Department of Transportation, Joint Technical Assistance on Title II ADA Requirements to Provide Curb Ramps when Streets, Roads, or Highways are Altered through Resurfacing (2013), and 2015 Supplement.
- U.S. Department of Justice, Title II Technical Assistance Manual (1993) and subsequent guidance on program accessibility under 28 C.F.R. § 35.150.
- Fig. 1: City of Bloomington GIS parcel map, 717 S. Henderson Street and adjoining parcels (complainant's annotated screen capture).
- Fig. 2: Google Street View imagery, May 2019, geolocated to 712 S. Henderson Street.
- Fig. 3: Google Maps Street View imagery, April 2026, showing continuous concrete sidewalk with paved alley crossing prior to relocation of the sidewalk.
- Fig. 4: Complainant's photograph, June 2026, showing gravel alley crossing and abrupt drop following redevelopment.

- Fig. 5: Complainant's photograph showing the west-side alley-cut condition opposite 717 S. Henderson Street.
- Fig. 6: Complainant's close-up photograph of the vertical drop, east side (717 S. Henderson Street).

Respectfully submitted,

Name: [REDACTED]

Address: [REDACTED]

Phone / Email: [REDACTED]

July 7, 2026

This complaint was prepared by the complainant with drafting assistance from AI tools.