



INSPECTION REPORT
726 Sunnywood Rd
York SC 29745

INSPECTED BY
Frank Signa
(704)517-9493
Frank@hicarolina.com
NC #3569 - SC #49055

Frank Signa

INSPECTION DATE
📅 9/18/2025
Home Inspection
Carolina



TABLE OF CONTENTS

Cover Page 1

Table of Contents 2

Intro Page 3

1 Deck(s)/Patio(s)/Porches 6

2 Exterior/Trim/Foundation 8

3 Grounds/Pavings 10

4 Garage-Carport 11

5 Roof Systems 12

6 Attic Interior System 14

7 Plumbing System 15

8 Laundry Area 19

9 Electrical System 20

10 HVAC System(s) Information 22

11 Cooling System(s) 24

12 Heating System 25

13 Interior Components 27

14 Bathrooms 32

15 Kitchen-Appliances 34

16 Crawlspace 36

Back Page 40

Summary 41

Complete Home Inspection Report

Exclusively for: Valorie Redwine

Including: Limitations, Recommendations, Material Types, and Additional Photos

THIS REPORT WAS INTENDED TO BE VIEWED IN COLOR.

Date:
9/18/2025

Property:
726 Sunnywood Rd
York SC 29745

Buyers Agent:
Will Sheppard



Inspector:
Frank Signa
(704)517-9493
Frank@hicarolina.com
NC #3569 - SC #49055

Frank Signa

People present at the time of inspection:

Buyer(s), Buyers Agent

Building Type:

Single Family.

Utilities Status:

All utilities on

Outside Temperature (F):

80-90 Degrees

Payment Type:

Credit Card Online

House Occupancy/Limitations:

The home was occupied at the time of inspection. When a home is occupied with furniture, clothing, and other stored items, it can obstruct the view and access to walls, receptacle outlets, under sinks, etc.

INSPECTION INFORMATION

The summary section is NOT the entire report.

Your complete report contains important information that may be of great concern to you. You are highly advised to review the entire report promptly. If you have any questions about the negotiability of any item in the report under the real estate purchase contract, please reach out to your real estate agent or an attorney for assistance.

Important - A qualified licensed contractor specializing in the fields mentioned in the report must be consulted to assess all findings or defects. Additional repairs may be necessary. Concealed defects could exist beyond initial inspection. It is highly recommended to have a thorough evaluation of the damage and necessary repairs before the home sale closes and during due diligence, or the contingency period. This report serves solely as a visual inspection. Its purpose is to offer guidance for your assessment of the home's overall condition. It does not determine the property's value or offer advice on its purchase.

THIS REPORT WAS INTENDED TO BE VIEWED IN COLOR.

INSPECTION REPORT INFORMATION

Your summary section is NOT the entire report.

The complete report may include additional information of great concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney.

IMPORTANT - Due to the findings or defects stated within the report. A qualified licensed contractor who specializes in the respective fields of our findings or defects listed should be consulted to evaluate any and all findings or defects further. To determine the full extent of any damage(s) and or determine if additional repairs are required, which may be deemed necessary by the qualified licensed contractor. There may be other defects concealed and or otherwise unseen at the time of the initial inspection.

Further evaluation is recommended before the close of escrow on the home, due diligence, and or contingency period, whichever comes first, to thoroughly understand the extent of the damage(s) and the full extent of the repairs needed, required, or deemed necessary by the qualified licensed contractor.

Please understand that this is a visual inspection only. The report provided is intended only as a general guide to help you make your own evaluation of the overall condition of the home. This inspection is not intended to reflect the value of the premises nor make any representation as to the advisability of purchase.

Home Inspection Definitions

Home Inspection: A home inspection is a limited, non-invasive visual examination of the condition of a home. To visually inspect essential components of a residential dwelling designed to identify MATERIAL DEFECTS.

Direction: Our State requirements require us to direct our clients to consult with qualified licensed contractors for further evaluation of all defects identified within our report. It is essential that you thoroughly understand the extent of any problem before the close of escrow on the home.

Ancillary Services: Ancillary services, such as Mold Sampling, Radon Tests, etc., are not part of this home inspection and do not fall under state Standard of Practice guidelines. For your convenience, other services may be listed within this report; however, they are to be viewed as independent services and individually. For more information on additional ancillary services we provide, please get in touch with our office or visit our website at <https://www.homeinspectioncarolina.com/services/>

Material Defects: A material defect is a specific issue with a system or component of a residential property that may have a significant, adverse impact on the property's value or pose an unreasonable risk to people.

The following report reflects the visual conditions of the property at the time of the inspection only. The summary and main report are a list of items found to be defective, needing repair, or further evaluation. Please understand there may be hidden or concealed damage that could not be viewed, seen, or present at the time of inspection. For your protection, we strongly recommend consulting with a qualified licensed contractor to evaluate further all defects noted within this report. Hidden or concealed defects are not inspected and are not included in this report. No warranty is either expressed or implied in the home inspection report. This report is not an insurance policy nor a warranty service.

The point of reference for this report is from the street looking at the front of the house. (The front, right crawl space would be the front, right corner of the home, not the front right corner from the crawl space access door unless otherwise stated).

This inspection has been completed according to the standards of practice and code of ethics within the states of North or South Carolina. Please for a copy of the NC SOP, please [Click Here](#). For SC, [Click Here](#).

1. DECK(S)/PATIO(S)/PORCHES

DESCRIPTION

DECK INFORMATION

Decks and porches are often built close to the ground, where no viewing or access is possible. Any areas too low to enter or not accessible are excluded from the inspection. There is no inspection and/or evaluation or moving of landscape components such as but not limited to trees, shrubs, fountains, ponds, statuary, pottery, fire pits, patio fans, heat lamps, and decorative or low-voltage lighting.

TYPES & DESCRIPTIONS: DECK(S)/PATIO(S)/PORCHES

Deck Materials:

- Wood Columns
- Wood Framing
- Wood Decking

Patio Type:

- Concrete


ITEMS: DECK(S)/PATIO(S)/PORCHES

1.0 DECK/PATIO/PORCH VISUAL FINDINGS

FURTHER EVALUATION IS NEEDED.

(1) **There are several posts on the front porch that are rotted.** Repair/replacement is needed to prevent further damage and to ensure the roof structure is properly supported.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

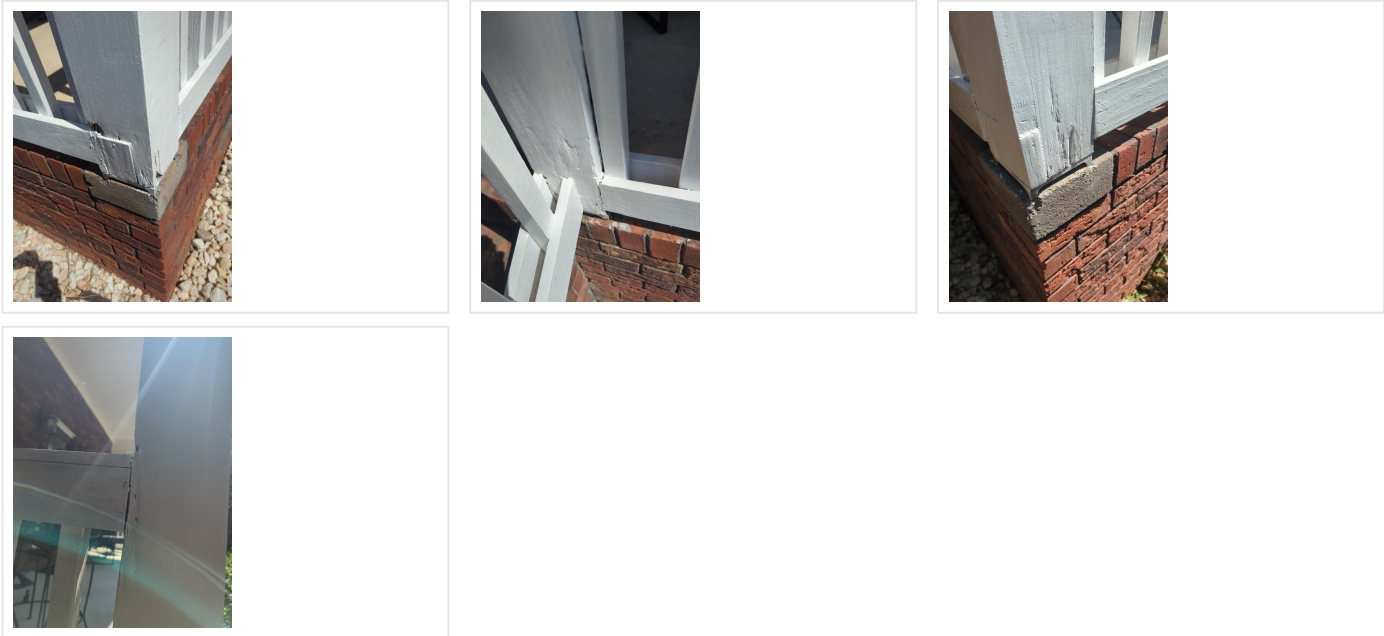



(2) The items listed below require repair or replacement to prevent further damage. It is recommended to consult a qualified licensed contractor to assess these concerns and address any additional repairs that may be

necessary during the evaluation.

a, Due to the height of the deck, cross bracing is needed. Cross bracing provides stability and support to deck preventing possible movement or swaying.

b. The stair risers need to have solid risers or openings restricted to prevent a 4 inch sphere from passing through for safety.

c. The stair stringers are not secured by any ledger or joist hanger. A ledger or joist hanger gives the joist additional support, also preventing it from twisting or moving. A ledger or joist hanger needs to be installed to provide proper support and stability.

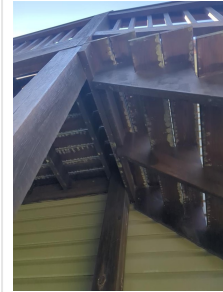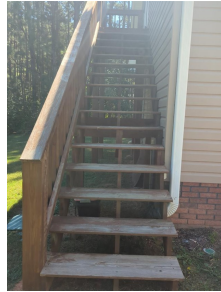

1.1 DECK/PATIO SURROUNDINGS LIMITATIONS



Unable to view and/or access under the deck area due to lattice being installed and screwed to the deck. Disassembly would be required to access under the deck area which is beyond the scope of a normal home inspection.

2. EXTERIOR/TRIM/FOUNDATION

DESCRIPTION

EXTERIOR INFORMATION

In accordance with our standards of practice, we identify foundation types and look for any evidence of structural deficiencies. However, minor cracks or deteriorated surfaces are common in many foundations and most do not represent a structural problem. If major cracks are present along with bowing, we routinely recommend further evaluation be made by a qualified licensed engineer that specializes in residential dwellings. The inspection will certainly alert you to any suspicious cracks if they are clearly visible. We are not specialists, and in the absence of any major defects, we may not recommend that you consult with a foundation contractor, an engineer that specializes in residential dwellings, or a geologist, but this should not deter you from seeking the opinion of any such expert. It is also routinely recommended that inquiry is made with the seller about knowledge of any prior foundation or structural repairs.

All items that are freshly painted including, but not limited to, trim, exterior siding, fascia, and soffit cannot be fully or completely viewed to determine if wood rot exists. Have the seller disclose any recent repairs or painting to determine if any damage has been hidden or concealed before the close of escrow on the home.

TYPES & DESCRIPTIONS: EXTERIOR/TRIM/FOUNDATION

Siding Types:

Vinyl Siding

Brick Veneer

Stories/Foundation:

2 Stories on a Crawlspace

Foundation


ITEMS: EXTERIOR/TRIM/FOUNDATION

2.0 EXTERIOR VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

There is a gap in the siding on the right side of the garage. Repair is needed to prevent wind and water damage.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

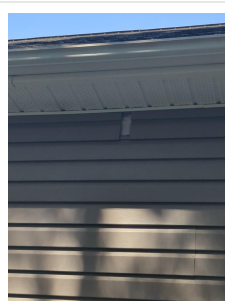

Right side of garage

2.1 TRIM VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

2.2 FOUNDATION VISUAL FINDINGS

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

3. GROUNDS/PAVINGS

DESCRIPTION

GROUND INFORMATION

This inspection is not intended to address or include any geological conditions or site stability information. There are no comments or reporting on coatings or cosmetic deficiencies and the wear and tear associated with the passage of time, which would be apparent to the average person. However, cracks in hard surfaces can imply the presence of expansive soils that can result in continuous movement, but this can only be confirmed by a geological evaluation of the soil. Any reference to grade is limited to only areas around the exterior of the exposed portions around the foundation or exterior walls. The inspection and/or evaluation are not made on any mechanical or remotely controlled components such as driveway gates.

ITEMS: GROUNDS/PAVINGS


3.0 GROUND AREA VISUAL FINDINGS:

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

3.1 EXTERIOR SURROUNDINGS RECOMMENDATIONS/INFORMATION

 .

There are termite bait stations around the exterior foundation of the home. This home may be under a termite bond and may be transferable. Ask the seller if the home is bonded and the rates to transfer the bond to a new owner.

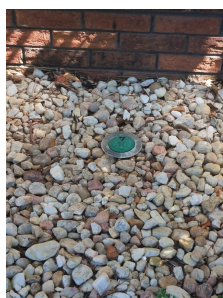

 4. GARAGE-CARPORT

 DESCRIPTION

GARAGE INFORMATION

Determining the heat resistance rating of firewalls is beyond the scope of this inspection. Flammable materials should not be stored within closed garage areas. It is not uncommon for moisture to penetrate garages, particularly with slabs-on-grade construction, and this may be apparent in the form of efflorescence or salt crystal formations on the concrete. This inspection does not include the inspection of detached garages, however, if a detached garage was inspected without additional costs it was inspected as a courtesy and should not be considered a part of the home inspection as it is not attached to the main structural inspection of the home.

 TYPES & DESCRIPTIONS: GARAGE-CARPORT

Reverse Tension Tested: Yes -The reverse tension was evaluated by testing the response to downward force.	Garage Sensors (photoelectric safety devices): Tested and present at the time of inspection
---	---

 ITEMS: GARAGE-CARPORT

4.0 GARAGE VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

The auto-reverse tension setting for the garage door did not respond or react properly when testing at the time of inspection. When in operation, if the garage door were to hit something, the door should automatically reverse to prevent damage to the item that it hits and/or the garage door. Proper corrections and/or adjustments are needed to prevent possible damage.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

 5. ROOF SYSTEMS

 DESCRIPTION

ROOF INFORMATION

Although not required, we generally attempt to evaluate various roof types by walking on their surfaces. If we are unable or unwilling to do this for any reason, we will indicate the method used to evaluate them. Every roof will wear differently relative to its age, the number of layers, quality of material, the method of application, exposure to weather conditions, and the regularity of its maintenance. The inspection provided is visual only and the opinion of the general quality and condition of the roofing material can be subjective. Any and all additional concerns should be addressed by a qualified licensed roofing contractor.

Every roof is inspected conscientiously; the remaining life expectancy, or guarantee that it will not leak, cannot and will not be provided by the inspector. It is recommended that you ask the sellers to disclose any information pertaining to repairs, leaks, and/or any additional information. Attached accessories including, but not limited to, solar systems, antennae, and lightning arrestors are not inspected. It is at the discretion of the inspector to climb and/or walk on the roof as it is not a requirement to do so.

 TYPES & DESCRIPTIONS: ROOF SYSTEMS

Roof Covering Materials:

Asphalt Shingles

Roof Access:

Due to the pitch, height, or the discretion of the inspector, the roof was viewed from the ground with binoculars. It is at the discretion of the inspector to climb and/or walk on the roof as it is not a requirement to do so.


 ITEMS: ROOF SYSTEMS

5.0 GUTTER VISUAL FINDING(S)

 FURTHER EVALUATION IS NEEDED.

A splash block is needed to properly direct water away from the foundation of the home at the left rear corner of the home.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

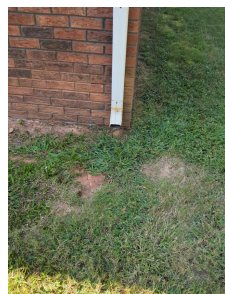

Left rear

5.1 ROOF VISUAL FINDING(S)

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

5.2 FLASHING VISUAL FINDING(S)

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

5.3 FASCIA/SOFFITS/EAVE VISUAL FINDING(S)

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

5.4 RECOMMENDATIONS/INFORMATION

☑ .

The roof was installed with architectural shingles in a weaving method at the valleys. Some manufactures may approve this method. However, during the inspection, it is unable to determine the manufacture or the manufactures installation requirements. Because of this, you may want to consult with a roofing contractor to ensure proper installation.

The downspouts drain into an underground system. Unable to determine where the gutters empty and if they are draining properly.

🏠 6. ATTIC INTERIOR SYSTEM

📋 DESCRIPTION

ATTIC INFORMATION

In accordance with our standards, attics that have less than thirty-six inches of headroom are not inspected, area restricted by ducts are not inspected, or in which the insulation obscures the joists and thereby makes mobility hazardous are not inspected, in which case the attic is inspected to the best of the inspectors ability from the access point. In regard to evaluating the type of insulation in the attic and on the attic floor, we do not sample or test the material for specific identification. Also, insulation is not disturbed or moved which may well obscure water pipes, electrical conduits, junction boxes, exhaust fans, and/or other components.

Due to pitch and/or height of the outer edges and corners cannot be viewed within the attic areas, These areas could not be fully viewed or inspected at the time of inspection and no claims could be made to the conditions and/or structure of these areas. The insulation in the attic obstructs viewing of the ceiling below while covering the framing and any electrical components throughout the attic area. Due to the insulation NOT being moved as this would disrupt the insulation from its original state, the conditions of the framing, ceiling below, electrical components, and any other areas or items that are covered or blocked by the insulation could not be viewed and no claims could be made as to the structure or conditions of the covered areas.

✂ TYPES & DESCRIPTIONS: ATTIC INTERIOR SYSTEM

Framing and Component	Unfinished Area Insulation	Attic Location(s):
Types: A rafter system is installed in the attic cavity to support the roof decking OSB Roof Sheathing OSB Floor Sheathing	Type(s): Fiberglass Batts or Rolled Batts	Main Attic above the majority or entire home.

👁 ITEMS: ATTIC INTERIOR SYSTEM

6.0 ATTIC VISUAL FINDINGS

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

6.1 ATTIC LIMITATIONS

☑ .

Due to framing, truss designs, and/or no flooring, the inspection of the attic was limited to the scuttle hole or floored area only by flash light. The structure condition could not be fully viewed and the conditions are unknown. Ask the seller for full disclosure as to any repairs or defects that may have occurred in the past and if corrections have been made to correct them.

7. PLUMBING SYSTEM

DESCRIPTION

PLUMBING INFORMATION

Water quality or hazardous materials testing is available however is not included with this inspection unless added as an additional service. Underground piping related to water supply, waste, sprinkler, as well as drainage systems is excluded from this inspection. The presence of mineral build-up that may gradually restrict their inner diameter and reduce water volume cannot be inspected.

The water main shut off valve, and shut off valves under sinks and behind toilets is not tested. By turning the valves it may cause them to leak causing damage to the property. Because of this, shut off valves are not turned, tested, or operated.

The inspection does not assure that the plumbing systems of the home will meet the demands of a family when in use.

TYPES & DESCRIPTIONS: PLUMBING SYSTEM

Visible Plumbing Materials: PEX PVC Copper Piping	Plumbing Vent Pipe Material Type(s): PVC	Water Heater Power Source: Gas
Water Heater Ventilation Type: Power Exhaust Vent	Water Heater Capacity: 75 Gallons	Water Temperature: 119 Degrees
Water Heater Location: - : Media Room	Main Water Shut Off Location: Crawl space	


ITEMS: PLUMBING SYSTEM

7.0 PLUMBING CONDITIONS/VISUAL FINDINGS

FURTHER EVALUATION IS NEEDED.

(1) **There are not any anti-backflow preventer valves installed at the exterior hose faucets.** Backflow preventer valves are required to prevent cross-contamination between water supply sources.

Consult with a qualified licensed contractor to fully understand the extent of the repairs needed and determine if corrective actions are required.

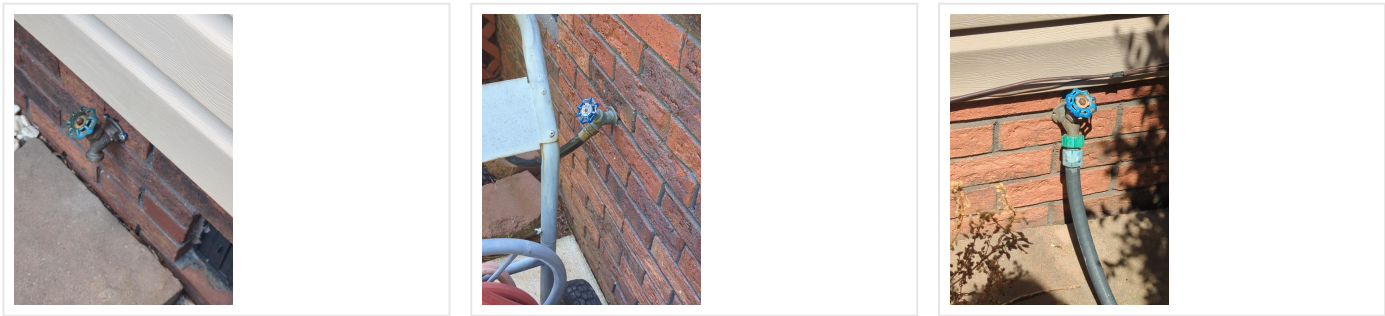

(2) The items listed below require repair or replacement to prevent further damage. It is recommended to consult a qualified licensed contractor to assess these concerns and address any additional repairs that may be necessary during the evaluation.

a. The drain line utilizes a flexible style pipe under the media room sink and primary sinks. Although the line appeared to be clear at the time of inspection, these lines tend to clog easily. Continue to monitor and make any future repairs as necessary.

b. There was an improper drain trap that needs to be corrected and/or repaired properly under the media room sink. The drain trap is designed to hold water to prevent sewage gases from coming up the pipe and entering the home. The current "S" trap design under the sink will pull water out of the trap when draining, allowing sewage gases to enter the home.



primary bathroom



primary bathroom

(3) The water supply pipes are not supported properly in the crawl space and need corrections to prevent possible damage to the water lines.

Consult with a qualified licensed contractor to fully understand the extent of the repairs needed and determine if corrective actions are required.



(4) The visible plumbing lines in this home are plastic PEX with brass metal fittings. Evidence of fitting deterioration was noted during the inspection in a few/several locations. The deterioration could be the result of a known problem referred to as “dezincification”. Dezincification occurs when brass fittings that are considered a high-zinc copper alloy are exposed to water and the zinc is leached from the fitting or component leaving the fitting in a weakened state. This process also leads to a build-up inside the fitting, restricting water flow and ultimately leaving the plumbing system prone to breakage and leaking. A licensed plumbing contractor should be consulted for a complete evaluation of the plumbing system to determine the general condition of the plumbing distribution and supply lines, the significance of this concern, and make necessary repairs.

Consult with a qualified licensed contractor to fully understand the extent of the repairs needed and determine if corrective actions are required.



7.1 WATER HEATER CONDITIONS/VISUAL FINDINGS

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

7.2 WATER TEMPERATURE INFORMATION

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

The water temperature was found to range between 110 and 119 degrees. To ensure optimal performance, adjust the temperature to 120 degrees. [Click here](#) to discover how to set your water heater to a safe and efficient temperature level.



7.3 PLUMBING RECOMMENDATIONS/INFORMATION



The property has a well. The well and functioning system of the well, is outside the scope of a home inspection. It is recommended that you have a qualified licensed contractor inspect the well and pump house and a water test to evaluate the quality of the water.



8. LAUNDRY AREA

DESCRIPTION

LAUNDRY INFORMATION

Washer and dryers are not tested at the time of inspection as this is beyond the scope of a home inspection. The 220v electric dryer hookup, if so equipped is not tested during a normal home inspection. If washer and dryers are installed in the laundry room viewing of the wall and/or inspect the washer and dryer hookups cannot be completed due to the washer and dryer blocking the wall and hookups. No claims can be made regarding the condition of the wall and hookups.

ITEMS: LAUNDRY AREA

8.0 LAUNDRY AREA VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

8.1 LAUNDRY AREA LIMITATIONS

 .

Unable to view the walls, flooring, and piping at the time of inspection due to the washing machine and/or dryer being installed obstructing viewing of these areas. No claims can be made to the condition of these areas at the time of inspection.

Please note: Unable to determine the outlet type due to dryer blocking access or viewing of the outlet.



🏠 9. ELECTRICAL SYSTEM

📋 DESCRIPTION

ELECTRICAL INFORMATION

Load-calculations are not performed to determine if the supply meets the demand. Any electrical repairs or upgrades should be made by a licensed electrical contractor. Aluminum wiring requires periodic inspection and maintenance by a licensed electrical contractor. Smoke Alarms should be installed within 15 feet of all bedroom doors and tested regularly.

🔧 TYPES & DESCRIPTIONS: ELECTRICAL SYSTEM

Panel Location(s): Media Room	Main Power Panel Size: 200 amp service	Service Entry Conductor Type: Aluminum
Service Voltage: The incoming electrical service to the structure is 120/240 volts, with circuit breakers.	Branching Circuit Wiring Type: Branching Copper Wiring with Aluminum on (220) appliances.	Service Type: Underground


👁️ ITEMS: ELECTRICAL SYSTEM

9.0 ELECTRICAL VISUAL FINDINGS

📋 FURTHER EVALUATION IS NEEDED.

(1) **The garage outlets are not protected by a GFCI(s) outlets.** Ground fault interrupters work by sensing a loss of current in the circuit. When a GFCI senses such a problem, the electrical current to the outlet is shut down almost immediately.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

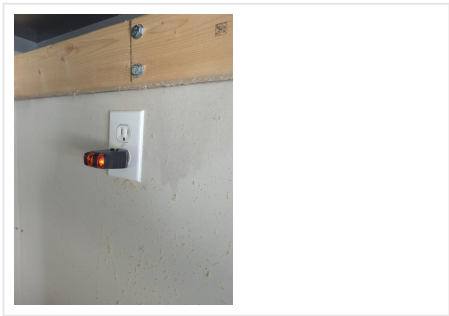

(2) **Missing strain relief at panel inside the electrical panel.** The strain relief's are needed to prevent possible damage to the wiring where it enters the electrical panel. Proper corrections are needed for protection of the wiring.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



9.1 ELECTRICAL LIMITATIONS



There are stored items throughout the home that prevent access and testing at some outlets and switches. Because of this not all outlets and switches could be tested at the time of inspection. The conditions of the outlets that were not tested are unknown at the time of inspection, no claims could be made as to whether they function properly.

🏠 10. HVAC SYSTEM(S) INFORMATION

📋 DESCRIPTION

HVAC System(s) Information and Limitations

The interior AC coil(s) are not inspected as they could not be viewed at the time of inspection due to being taped sealed/closed. The fan units operated when testing (if temperature permits), but the interior was not visually observed. No claims could be made to the condition of the interior of the unit as this would require a complete invasive inspection of the unit, which is beyond the scope of a home inspection.

During this inspection, it is impossible to determine the condition of the interior of the flue/vents. The interior of the flue/vents may be deteriorated, but during a visual inspection, the interior walls were not inspected as this would require disassembly.

The interior heat unit portion of the heating system(s) is difficult to view or access without disassembly, and cannot be adequately checked during a visual inspection as disassembly is required. It is recommended that the unit is serviced yearly to ensure the unit operates and functions efficiently.

The home inspector does not determine the age of the HVAC unit. If the unit(s) are older than 10 years or if the age or the age is unknown, it is highly recommended that the unit(s) have a complete invasive inspection of the entire unit by a licensed HVAC contractor. Ask the seller for disclosure on any previously required services and/or repairs that have been previously made to the unit and routine servicing. If the home is vacant or in foreclosure, a complete invasive inspection of the entire unit by a licensed HVAC contractor is strongly recommended before the closing of escrow on the home.

✂ TYPES & DESCRIPTIONS: HVAC SYSTEM(S) INFORMATION

Air Conditioning Type(s): Central Split System(s)	Power Source: Electric 220 Volt	Heating Type(s): Forced Air Unit(s)
Fuel/Power Source(s): Natural Gas	Ducts/Air Supply Types: Metal Distribution Boxes: Flexible round duct work	Access Panel(s) Removed during visual inspection?: Yes

👁 ITEMS: HVAC SYSTEM(S) INFORMATION

10.0 AIR TEMP DROP DIFFERENTIAL

☑ THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

primary unit differential - The primary unit is producing an adequate air temperature drop. The temperature differentials when tested should be between 14 and 24 degrees. The differentials at the time of inspection were at 21 degrees.

Primary Unit :

Main Return Air Temperature- 70 degrees.

Main Supply Air Temperature- 49 degrees.



During this inspection, it is impossible to determine the condition of the interior of the ductwork or vent systems. The interior of the ductwork or vent systems may be deteriorated, but during a visual inspection, the interior walls were not inspected as this would require disassembly. Please also Note: During the home inspection the home is not inspected for mold, mildew, or other organic growth. We are not mold inspectors and are not certified in identifying types of mold within the home.

Some types of organic growth are common and/or natural to see within the home, however, dirty ductwork and high moisture levels around the duct work this may indicate, but does not guarantee, an organic growth problem. Many factors are needed to have excessive growth within or under a home and/or within duct systems. If mold, mildew, or other organic growth is a concern have a licensed or certified fungus specialist further evaluate to determine if the type of fungus within the ductwork is dangerous and determine if removal is needed.

11. COOLING SYSTEM(S)

DESCRIPTION

HVAC INFORMATION

Even modern heating systems can produce carbon monoxide, which in a poorly ventilated room can result in sickness and even death. Therefore, it is essential that any recommendations made for service or further evaluation be scheduled before the close of escrow, as a licensed specialist may reveal additional defects or recommend further upgrades that could affect your evaluation of the property, as our service does not include any form or warranty or guarantee.

On January 1, 2010, the Environmental Protection Agency (EPA) implemented a ban on the production and import of R22, except for continuing servicing needs of existing equipment. On January 1, 2020, R22 becomes illegal to purchase. As a result, repairing older R22 systems will become very expensive when the repair requires adding refrigerant to the system. If repair is needed, you may want to consider a replacement if the current AC unit was built before 2010. For more information please [click here](#).

ITEMS: COOLING SYSTEM(S)

11.0 AIR CONDITIONER VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

The interior cover for the HVAC disconnect panel is missing and needs to be replaced for safety.

Consult a qualified licensed contractor to assess the areas of concern and perform any additional repairs deemed necessary during their evaluation.



11.1 HVAC SYSTEM(S) RECOMMENDATIONS

 .

This homes catch pans at the HVAC units has a "float switch" installed. These are designed to automatically shut the unit off if water ever fills the overflow pan. If the unit continues to turn off periodically this may indicate water in the overflow pan and repairs are needed.

12. HEATING SYSTEM

DESCRIPTION

HVAC INFORMATION

Even modern heating systems can produce carbon monoxide, which in a poorly ventilated room can result in sickness and even death. Therefore, it is essential that any recommendations made for service or further evaluation be scheduled before the close of escrow, as a licensed specialist may reveal additional defects or recommend further upgrades that could affect your evaluation of the property, as our service does not include any form or warranty or guarantee.

On January 1, 2010, the Environmental Protection Agency (EPA) implemented a ban on the production and import of R22, except for continuing servicing needs of existing equipment. On January 1, 2020, R22 becomes illegal to purchase. As a result, repairing older R22 systems will become very expensive when the repair requires adding refrigerant to the system. If repair is needed, you may want to consider a replacement if the current AC unit was built before 2010. For more information please [click here](#).

ITEMS: HEATING SYSTEM


12.0 HEATING COMPONENT VISUAL FINDINGS

FURTHER EVALUATION IS NEEDED.

The items listed below require repair or replacement to prevent further damage. It is recommended to consult a qualified licensed contractor to assess these concerns and address any additional repairs that may be necessary during the evaluation.

a. The gas piping in this house includes corrugated stainless steel tubing (CSST). There is not an electrical bonding connection between the gas piping system and the electrical system, other than connections at the gas appliances that utilize the grounding conductors for the appliances. The lack of strong electrical bonding may increase the potential for lightning strikes to cause arcing at the CSST gas piping that may result in perforation of the piping, gas leaks, and fires.

b. There is CSST (corrugated stainless steel tubing) noted within the crawl space that was found to have the stainless steel areas exposed near the fittings. The exposed stainless steel needs to be sealed or covered with the proper and/or approved tape to prevent corrosion and/or rusting.

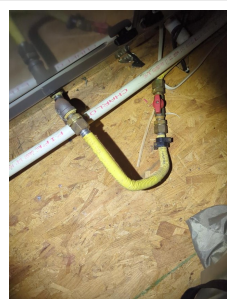

12.1 HEATING UNIT(S) LIMITATIONS



Equipment and controls which are part of the furnace block access to the heat exchanger. The heat exchanger portion of a gas fired heater is difficult to access without disassembly; they must be removed to view the heat exchanger, which is beyond the scope of this inspection.

Unable to test the heating unit at the time of inspection due to the exterior temperature being above 70 degrees. When the exterior temperature is above 70 degrees damage can occur to the system and/or evaporator coils if the system has been running in the AC mode. The hot air blowing across the extremely cold coils may cause damage to the evaporator coil ultimately causing damage to the unit. Note: The unit was placed in the heating mode for a very brief time to be sure that the reversing switch and control panel operate. Note: The unit did respond at the time of inspection; however unable to determine if the unit is functioning properly at the time of inspection.

 13. INTERIOR COMPONENTS

 DESCRIPTION

INTERIOR INFORMATION

The inspection of living space includes the visually accessible areas of walls, floors, cabinets and closets, and the testing of a representative number of windows and doors, switches and outlets. We do not evaluate window treatments, move furnishings or possessions, lift carpets or rugs, empty closets or cabinets, nor comment on cosmetic deficiencies. We may not comment on cracks that appear around windows and doors, along lines of framing members or along seams of drywall and plasterboard, as these may be caused by minor movement, such as wood shrinkage, common settling, and seismic activity, and will often reappear if they are not correctly repaired. Such cracks can become the subject of disputes, and are therefore best evaluated by a specialist.

It is recommended that smoke/carbon monoxide detector(s) be replaced after moving in the home and every five years; homes that do not have carbon monoxide detectors already installed should have one installed on every floor for safety.

All items that are freshly painted including, but not limited to walls and ceilings cannot be fully or completely viewed to determine if water damage exists. Have the seller disclose any recent repairs or painting to determine if any damage has been hidden or concealed before the close of escrow on the home.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

 TYPES & DESCRIPTIONS: INTERIOR COMPONENTS

Smoke Detectors: Wired & Tested, Responded - Designed to respond all at once.	Carbon Monoxide Detector(s): The home was built after 2008 - None were present at the time of inspection.	Fireplace Location(s): Great Room
Fireplace Type(s): Vent Free Gas Logs	Wall Structure Type(s): Not Accessible	Ceiling Structure Type(s): Single Story - The ceiling structure is comprised of wooden dimensional lumber which can ONLY be viewed from the attic area.
Flooring Structure Type(s): Not Accessible		


 ITEMS: INTERIOR COMPONENTS

13.0 INTERIOR COMPONENT CONDITIONS/VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.


- (1) Properly installed handrail returns need to be installed at the top and bottom of the stairway for safety in accordance with today's standards.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

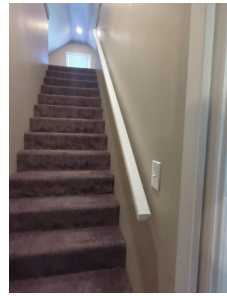

(2) **Daylight can be seen at the bottom of the rear exterior door.** Additional weather stripping and/or adjustments are needed to prevent possible water, air, and/or insect intrusion.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

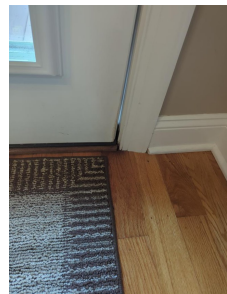

13.1 FIREPLACE/FIREBOX/GAS LOG CONDITIONS/VISUAL FINDINGS

☑ COMPONENT/ITEM WAS NOT INSPECTED DUE TO LIMITATION

13.2 WINDOW VISUAL FINDINGS

📋 FURTHER EVALUATION IS NEEDED.

(1) **The following window and/or sashes were found to have a bad or broken thermal seal.** When a bad or broken thermal seal is found, it is possible there may be more that cannot be found at the time of inspection. Because of this it is recommended that all windows be evaluated to prevent heating and air loss. right rear bedroom

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




Right rear bedroom

(2) **The following window(s) have a bad reverse tension spring(s) or weights.** This prevents the window from staying up when opening. If the spring or rope is bad, the window will slide back down when operating. Corrections and/or repairs are needed so the windows will stay up or function properly: right rear bedroom, primary bedroom, family room


Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.





Right rear bedroom

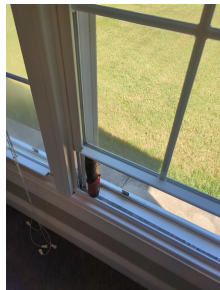

Right rear bedroom

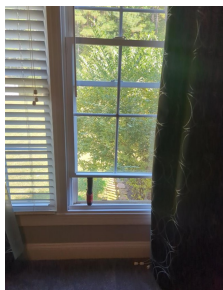

primary bedroom

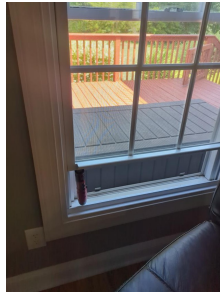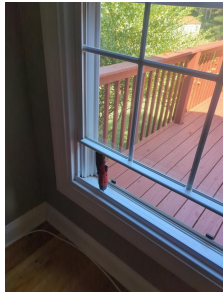

13.3 INTERIOR COMPONENT RECOMMENDATIONS




(1) Smoke detector(s) were located, and the test button on the Smoke detector(s) or combination with carbon monoxide detector(s) was pressed and responded. Please understand that the smoke or carbon monoxide simulation cannot be performed or tested during the inspection. To ensure safety, all smoke detector(s) and carbon monoxide detectors should be replaced after closing on the house and replaced as often per the manufacturer's recommendations.

(2) Carbon monoxide detector(s) were missing at the time of inspection and need to be replaced and installed to ensure safety and detect harmful levels of CO within the house.

13.4 FIREPLACE ADDITIONAL LIMITATIONS



Unable to test the gas logs due to the gas being off at the time of inspection. Note: If a unit(s)/component(s) is not functional and/or the services needed for a unit(s)/component(s) (water, gas, propane, electrical, etc) are not operational at the time of inspection, the unit(s)/component(s) cannot be inspected and no other part of that unit(s)/component(s) can be inspected for efficiency, operation, and/or functionality of the unit(s)/component(s). All unit(s)/component(s) require the proper source(s) to determine the efficiency, operation, and/or functionality of the unit(s)/component(s).

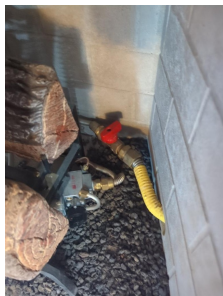

13.5 INTERIOR LIMITATIONS



Stored items and furniture prevent a full viewing of wall surfaces and floor surfaces. The inspection report applies to viewable surfaces only.

Stored items and/or rugs prevented a full viewing of the floored areas.

Stored items in closets prevented a full view of wall and floor conditions in those areas; the conditions in these areas are unknown and may expose damage after items are removed.

When one window is found to have a broken thermal seal, others may be in need of repair or replacement that are not listed below or within the report. Because of this, It is recommended that all windows be cleaned and further evaluated by the qualified licensed contractor or certified professional to determine if any additional windows are in need of replacement before the close of escrow. Any additional windows that are found to have a broken or bad thermal seal should also be repaired and/or replaced at that time by the qualified licensed contractor or certified professional that was recommended to further evaluate. The window at this point has lost its argon gas thus reduces the original R-Value of the window. All windows are located as if looking from the inside out toward the road or yard. -Overcast days, dirty windows, and/or rain can obstruct the view of the window or make it difficult to identify a bad thermal seal. The thermal window seal is the gasket that prevents fogging and moisture from entering in between the interior of the window panes.

14. BATHROOMS

DESCRIPTION

BATHROOM INFORMATION

Tub and bathroom sink overflows are not tested at the time of inspection. Inspectors are unable to determine if the overflow is connected properly in the wall at the time of inspection. If the overflow line is not connected properly testing them can cause damage to the property. Also, the shutoff valves under sinks are not tested. By turning the valves it may cause them to leak causing damage to the property. Because of this shutoff valves are not turned, tested, or operated.

TYPES & DESCRIPTIONS: BATHROOMS

Ventilation Types:

Electric power exhaust vent

ITEMS: BATHROOMS

14.0 PRIMARY BATHROOM VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

14.1 HALL BATHROOM VISUAL FINDINGS

 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

14.2 BATHROOM RECOMMENDATIONS/INFORMATION

 .

The access panel for the jacuzzi style tub is located at the front of the tub. Please note: The viewing access is limited to the access panel only and/or what could be viewed from the access panel. Areas on the opposite sides of the access panel cannot be viewed nor can they be inspected. No claims can be made as to the condition of non accessible or non viewable areas.




14.3 BATHROOM LIMITATIONS

 .

726 Sunnywood Rd

There were stored items under the sink that obstructed full viewing of the cabinet, drain, and supply lines located in the primary bathroom. No active leaks were viewed at the time of the inspection.

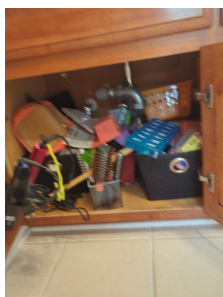

 15. KITCHEN-APPLIANCES

 DESCRIPTION

KITCHEN INFORMATION

The kitchen appliances are tested for basic functionality and cannot be evaluated for their performance nor for the variety of their settings or cycles. Appliances older than ten years may exhibit decreased efficiency. Even if general comments are made, these items are not inspected: free-standing appliances, refrigerators, freezers, ice makers, trash-compactors, built-in toasters, coffee-makers, can-openers, blenders, non-built in or non-secured microwave(s), instant hot water dispensers, water-purifiers, barbecues, grills, or rotisseries, timers, clocks, thermostats, the self-cleaning and cooking capability of ovens, and concealed or countertop lighting, which is convenient but often installed after the initial construction and not wired to national electrical standards. These items are considered outside the scope of the inspection. Appliances are not moved during the inspection as they may cause damage. Portable dishwashers are not inspected, as they require a connection to facilitate testing.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

 TYPES & DESCRIPTIONS: KITCHEN-APPLIANCES

Kitchen Sink: Tested	Dishwasher: Dishwasher - Operated	Range: Gas Operated
Microwave: Operated	Garbage Disposal: Non Installed	

 ITEMS: KITCHEN-APPLIANCES

15.0 KITCHEN COMPONENTS VISUAL FINDINGS


 THIS AREA OR SYSTEM WAS VISUALLY INSPECTED

15.1 KITCHEN APPLIANCE VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

The microwave installed has an internal vent installed with a gas cooktop/range installed below it. It is never a good idea to have a re-circulating exhaust fan, especially when you have a gas cooktop/range below it. There may be affects of long term exposure to even low levels of CO levels. Though not required, many manufacturers require external venting with gas appliances. Manufacturer requirements supersede all residential code. Have the seller provide information from the manufacturer stating that it is ok for this type of gas appliance to vent indoors to ensure safety.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

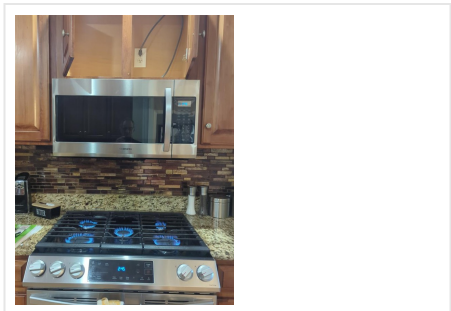

15.2 KITCHEN INFORMATION




- (1) The sink was tested for leaks at the time of the inspection.
- (2) The dishwasher underwent testing and ran through a full normal cycle during the inspection. Other cycles were not tested due to time constraints.
- (3) During the inspection, the gas range underwent tests by operating the burners, broiler (if available), bake option, and convection (if available). Please note that self-cleaning or other specialized modes were not tested.
- (4) The microwave was tested and responded during the inspection.

15.3 KITCHEN LIMITATIONS



There where stored items under the sink that obstructed viewing the cabinet and full view of the drain and supply lines at the time of inspection.

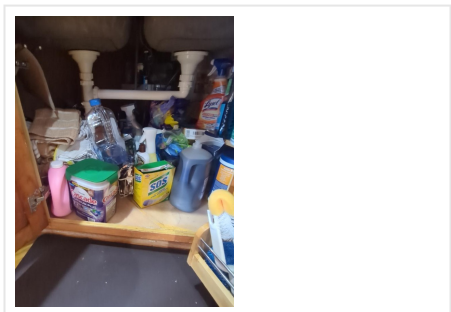

 16. CRAWLSPACE

 DESCRIPTION

CRAWL SPACE INFORMATION

While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. During the course of the inspection, the inspector does not enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely affect the health of the inspector or other persons. The under the floor insulation, between the floor joists, restricts viewing of the subfloor area and a percentage of the floor joists that are not removed during the inspection. If high moisture levels were noted to be above 20% during the inspection, this may indicate but does not guarantee an organic growth problem. Many factors are needed to have excessive growth within or under a home and/or within duct systems. If mold, mildew, or other organic growth is a concern please contact us to perform a mold test or mold inspection to help determine if removal or remediation is needed.

When building components have surface discolorations and decay typical of fungal growths, such as mold, mildew, and wood destroying fungi, the home inspection focuses only on moisture concerns and evidence of wood damage. Health issues related to the presence of mold are beyond the scope of the home inspection. If the client has concerns beyond the scope of the home inspection, a certified professional such as an industrial hygienist should be consulted prior to purchasing the home.

Please review the entire report and/or refer to the signed agreement/contract for any items that are outside the scope of the inspection performed.

 TYPES & DESCRIPTIONS: CRAWLSPACE

Access Location: Back of the home	Method Used to Inspect: Crawled with a flashlight, moisture meter, and a probing tool.	Floor Type: Soil
Foundation and Structure Types: Common with wood joists. Wall types are brick and concrete masonry units.		

 ITEMS: CRAWLSPACE

16.0 CRAWLSPACE VISUAL FINDINGS

 FURTHER EVALUATION IS NEEDED.

(1) **A cut or modifications were observed at the floor joist under the primary bathroom for the plumbing waste line.** The modifications made may have compromised the structural integrity of the floor joist. Additional support may be required depending on the extent of the cut to prevent structural movement..

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(2) **Insulation was noted to be missing, falling, fallen and/or is drooping within the crawl space area.** The insulation needs to be re-installed and/or supported properly. Note: Where it has touched the ground and become damaged needs to be replaced. Not all areas of concern are pictured.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(3) The girders are currently shimmed with "wedge shims" and should be properly shimmed to properly support the girders, as "wedge shims" are known to be unstable. Not all areas of concern are pictured.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



(4) There is an electrical wire lying on the ground in the crawl space at the rear side. The wiring needs to be properly secured along the bottom of the floor joists to prevent a possible hazard.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



16.1 RECOMMENDATIONS/INFORMATION



There are signs of previous termite treatment in the crawl space by drill holes in the support columns and walls. The drill holes are used to spray termite treatment in the cinder block voids to treat all areas of the home and foundation that is touching the ground.



Organic growth is common within all homes and buildings. The home inspection does not include or determine the presence or toxicity of mold and/or other organic growth(s) within the home. If there is evidence of mold and/or other organic growth(s) within the home it is strongly recommended that it be tested to determine its toxicity for you to determine if remediation is required or needed. If you are sensitive to mold and/or other organic growth(s) than it is

726 Sunnywood Rd

strongly recommended that the home is tested within the allotted time frame to make an educated discussion before purchasing the home. If tests are not completed before taking ownership of the home and mold is later discovered the corrections and/or remediation is solely the responsibility left to you "the buyer".

Valorie Redwine,

Thank you for trusting HIC to perform your inspection at 726 Sunnywood Rd
York SC 29745

. If you have any questions regarding this report, please do not hesitate to contact us and set up a time to review your report. Our inspectors are always willing to help answer any questions to ensure you completely understand the information provided in your report. Contact your inspector directly or our office at [704-542-6575](tel:704-542-6575) with any questions.

Sincerely,

Frank Signa

(704)517-9493

Frank@hicarolina.com

NC #3569 - SC #49055



Office - [704-542-6575](tel:704-542-6575)

info@hicarolina.com

www.homeinspectioncarolina.com



Home Inspection Summary

Exclusively for Valorie Redwine

Please see main body of the report for any additional pictures and information

THIS REPORT IS INTENDED TO BE VIEWED IN COLOR.

Inspection Address

726 Sunnywood Rd
York SC 29745



Inspector Contact

Frank Signa
(704)517-9493
Frank@hicarolina.com
NC #3569 - SC #49055

Thank you for choosing Home Inspection Carolina (HIC). At your request, a visual inspection of the above-referenced property was conducted on 9/18/2025. An earnest effort was made on your behalf to discover all visible defects; however, in the event of an oversight, maximum liability must be limited to the total inspection fee paid. It is strongly recommended that you promptly read the complete and entire report. The summary and main report are not limited to additional negotiable items identified outside this inspection. For more information on negotiable items identified outside this inspection, please contact your Real Estate Agent or attorney.

This summary page is not the entire report. The complete report may include additional information of interest or concern to you. It is strongly recommended that you promptly read the complete report. For information regarding the negotiability of any item in this report under the real estate purchase contract, contact your North Carolina real estate agent or an attorney. For South Carolina, contact your South Carolina real estate agent or an attorney.

Home Inspection Definitions

Home Inspection: A home inspection is a limited, non-invasive visual examination of the condition of a home. To visually inspect essential components of a residential dwelling designed to identify MATERIAL DEFECTS.

Direction: Our State requirements require us to direct our clients to consult with qualified licensed contractors for further evaluation of all defects identified within our report. It is essential that you thoroughly understand the extent of any problem before the close of escrow on the home.

Ancillary Services: Ancillary services, such as Mold Sampling, Radon Tests, etc., are not part of this home inspection and do not fall under state Standard of Practice guidelines. For your convenience, other services may be listed within this report; however, they are to be viewed as independent services and individually. For more information on additional ancillary services we provide, please get in touch with our office or visit our website at <https://www.homeinspectioncarolina.com/services/>

Material Defects: A material defect is a specific issue with a system or component of a residential property that may have a significant, adverse impact on the property's value or pose an unreasonable risk to people.

The following report reflects the visual conditions of the property at the time of the inspection only. The summary and main report are a list of items found to be defective, needing repair, or further evaluation. Please understand there may be hidden or concealed damage that could not be viewed, seen, or present at the time of inspection. For your protection, we strongly recommend consulting with a qualified licensed contractor to evaluate further all defects noted within this report. Hidden or concealed defects are not inspected and are not included in this report. **No warranty is either expressed or implied in the home inspection report. This report is not an insurance policy nor a warranty service.**

*The point of reference for this report is from the street looking at the front of the house. (The front, right crawl space would be the front, right corner of the home, not the front right corner from the crawl space access door unless otherwise stated).

1. DECK(S)/PATIO(S)/PORCHES

General Summary

DECK/PATIO/PORCH VISUAL FINDINGS

1. (1) **There are several posts on the front porch that are rotted.** Repair/replacement is needed to prevent further damage and to ensure the roof structure is properly supported.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



2. (2) The items listed below require repair or replacement to prevent further damage. It is recommended to consult a qualified licensed contractor to assess these concerns and address any additional repairs that may be necessary during the evaluation.

a, Due to the height of the deck, cross bracing is needed. Cross bracing provides stability and support to deck preventing possible movement or swaying.

b. The stair risers need to have solid risers or openings restricted to prevent a 4 inch sphere from passing through for safety.

c. The stair stringers are not secured by any ledger or joist hanger. A ledger or joist hanger gives the joist additional support, also preventing it from twisting or moving. A ledger or joist hanger needs to be installed to provide proper support and stability.



2. EXTERIOR/TRIM/FOUNDATION

General Summary

EXTERIOR VISUAL FINDINGS

- 3. There is a gap in the siding on the right side of the garage.** Repair is needed to prevent wind and water damage.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



Right side of garage

4. GARAGE-CARPORT

General Summary

GARAGE VISUAL FINDINGS

4. **The auto-reverse tension setting for the garage door did not respond or react properly when testing at the time of inspection.** When in operation, if the garage door were to hit something, the door should automatically reverse to prevent damage to the item that it hits and/or the garage door. Proper corrections and/or adjustments are needed to prevent possible damage.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

5. ROOF SYSTEMS

General Summary

GUTTER VISUAL FINDING(S)

5. **A splash block is needed to properly direct water away from the foundation of the home at the left rear corner of the home.**

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



Left rear



7. PLUMBING SYSTEM

General Summary

PLUMBING CONDITIONS/VISUAL FINDINGS

6. (1) **There are not any anti-backflow preventer valves installed at the exterior hose faucets.** Backflow preventer valves are required to prevent cross-contamination between water supply sources.

Consult with a qualified licensed contractor to fully understand the extent of the repairs needed and determine if corrective actions are required.

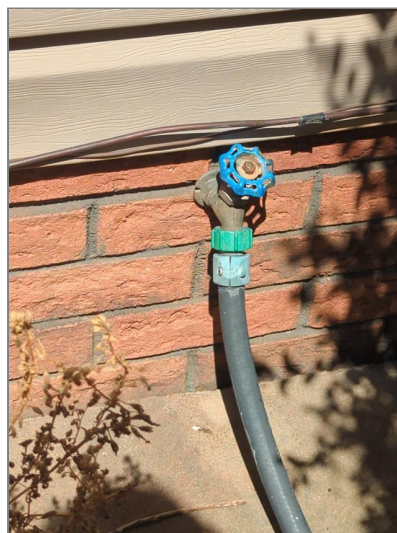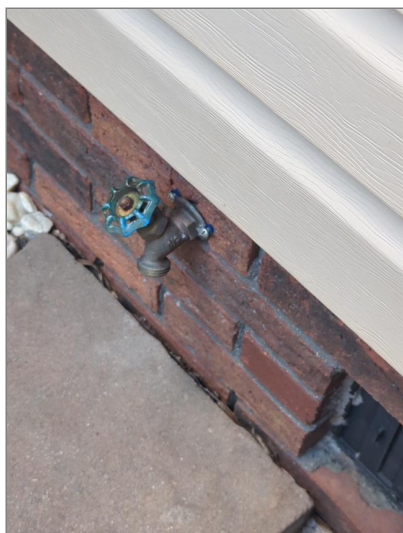

7. (2) The items listed below require repair or replacement to prevent further damage. It is recommended to consult a qualified licensed contractor to assess these concerns and address any additional repairs that may be necessary during the evaluation.

a. The drain line utilizes a flexible style pipe under the media room sink and primary sinks. Although the line appeared to be clear at the time of inspection, these lines tend to clog easily. Continue to monitor and make any future repairs as necessary.

b. There was an improper drain trap that needs to be corrected and/or repaired properly under the media room sink. The drain trap is designed to hold water to prevent sewage gases from coming up the pipe and entering the home. The current "S" trap design under the sink will pull water out of the trap when draining, allowing sewage gases to enter the home.



primary bathroom



primary bathroom


8. (3) **The water supply pipes are not supported properly in the crawl space and need corrections to prevent possible damage to the water lines.**

Consult with a qualified licensed contractor to fully understand the extent of the repairs needed and determine if corrective actions are required.



9. (4) The visible plumbing lines in this home are plastic PEX with brass metal fittings. Evidence of fitting deterioration was noted during the inspection in a few/several locations. The deterioration could be the result of a known problem referred to as "dezincification". Dezincification occurs when brass fittings that are considered a high-zinc copper alloy are exposed to water and the zinc is leached from the fitting or component leaving the fitting in a weakened state. This process also leads to a build-up inside the fitting, restricting water flow and ultimately leaving the plumbing system prone to breakage and leaking. A licensed plumbing contractor should be consulted for a complete evaluation of the plumbing system to determine the general condition of the plumbing distribution and supply lines, the significance of this concern, and make necessary repairs.

Consult with a qualified licensed contractor to fully understand the extent of the repairs needed and determine if corrective actions are required.

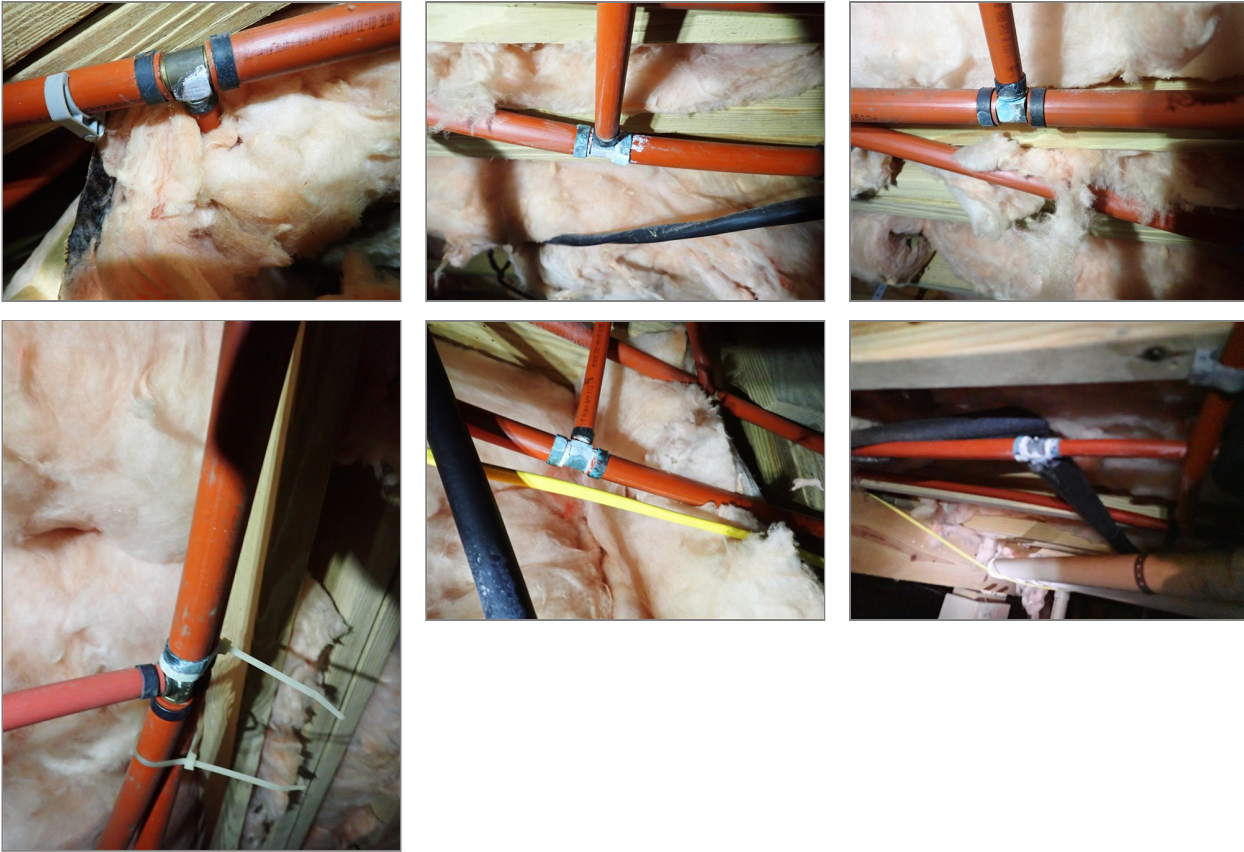

9. ELECTRICAL SYSTEM

General Summary

ELECTRICAL VISUAL FINDINGS


10. (1) **The garage outlets are not protected by a GFCI(s) outlets.** Ground fault interrupters work by sensing a loss of current in the circuit. When a GFCI senses such a problem, the electrical current to the outlet is shut down almost immediately.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



11. (2) **Missing strain relief at panel inside the electrical panel.** The strain relief's are needed to prevent possible damage to the wiring where it enters the electrical panel. Proper corrections are needed for protection of the wiring.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.

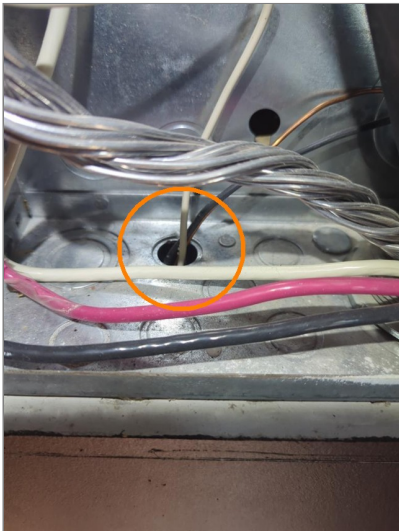

11. COOLING SYSTEM(S)

General Summary

AIR CONDITIONER VISUAL FINDINGS

12. **The interior cover for the HVAC disconnect panel is missing and needs to be replaced for safety.**

Consult a qualified licensed contractor to assess the areas of concern and perform any additional repairs deemed necessary during their evaluation.



12. HEATING SYSTEM

General Summary

HEATING COMPONENT VISUAL FINDINGS

13. The items listed below require repair or replacement to prevent further damage. It is recommended to consult a qualified licensed contractor to assess these concerns and address any additional repairs that may be necessary during the evaluation.
 - a. **The gas piping in this house includes corrugated stainless steel tubing (CSST). There is not an electrical bonding connection between the gas piping system and the electrical system**, other than connections at the gas appliances that utilize the grounding conductors for the appliances. The lack of strong electrical bonding may increase the potential for lightning strikes to cause arcing at the CSST gas piping that may result in perforation of the piping, gas leaks, and fires.
 - b. **There is CSST (corrugated stainless steel tubing) noted within the crawl space that was found to have the stainless steel areas exposed near the fittings.** The exposed stainless steel needs to be sealed or covered with the proper and/or approved tape to prevent corrosion and/or rusting.



13. INTERIOR COMPONENTS

General Summary

INTERIOR COMPONENT CONDITIONS/VISUAL FINDINGS

14. (1) **Properly installed handrail returns need to be installed at the top and bottom of the stairway for safety in accordance with today's standards.**

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



15. (2) **Daylight can be seen at the bottom of the rear exterior door.** Additional weather stripping and/or adjustments are needed to prevent possible water, air, and/or insect intrusion.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



WINDOW VISUAL FINDINGS

16. (1) **The following window and/or sashes were found to have a bad or broken thermal seal.** When a bad or broken thermal seal is found, it is possible there may be more that cannot be found at the time of inspection. Because of this it is recommended that all windows be evaluated to prevent heating and air loss. right rear bedroom

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



Right rear bedroom

17. (2) **The following window(s) have a bad reverse tension spring(s) or weights.** This prevents the window from staying up when opening. If the spring or rope is bad, the window will slide back down when operating. Corrections and/or repairs are needed so the windows will stay up or function properly: right rear bedroom, primary bedroom, family room

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.




Right rear bedroom



Right rear bedroom



primary bedroom

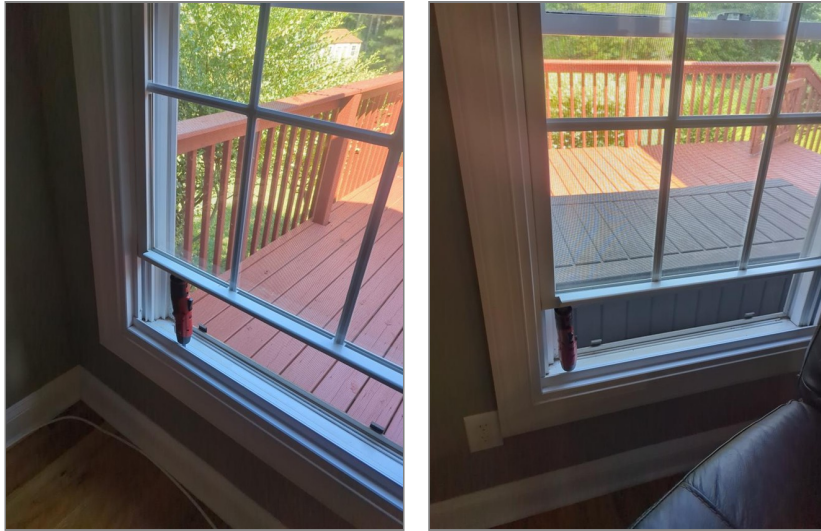

INTERIOR COMPONENT RECOMMENDATIONS

18. (2) Carbon monoxide detector(s) were missing at the time of inspection and need to be replaced and installed to ensure safety and detect harmful levels of CO within the house.

15. KITCHEN-APPLIANCES

General Summary

KITCHEN APPLIANCE VISUAL FINDINGS

19. **The microwave installed has an internal vent installed with a gas cooktop/range installed below it.** It is never a good idea to have a re-circulating exhaust fan, especially when you have a gas cooktop/range below it. There may be affects of long term exposure to even low levels of CO levels. Though not required, many manufacturers require external venting with gas appliances. Manufacturer requirements supersede all residential code. Have the seller provide information from the manufacturer stating that it is ok for this type of gas appliance to vent indoors to ensure safety.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



16. CRAWLSPACE

General Summary

CRAWLSPACE VISUAL FINDINGS

20. (1) **A cut or modifications were observed at the floor joist under the primary bathroom for the plumbing waste line.** The modifications made may have compromised the structural integrity of the floor joist. Additional support may be required depending on the extent of the cut to prevent structural movement..

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



21. (2) **Insulation was noted to be missing, falling, fallen and/or is drooping within the crawl space area.** The insulation needs to be re-installed and/or supported properly. Note: Where it has touched the ground and become damaged needs to be replaced. Not all areas of concern are pictured.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



22. (3) The girders are currently shimmed with "wedge shims" and should be properly shimmed to properly support the girders, as "wedge shims" are known to be unstable. Not all areas of concern are pictured.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



23. (4) There is an electrical wire lying on the ground in the crawl space at the rear side. The wiring needs to be properly secured along the bottom of the floor joists to prevent a possible hazard.

Consult with a qualified licensed contractor to evaluate the area(s) of concern and make any additional repairs as deemed necessary during their evaluation.



Valorie Redwine,

Thank you for trusting HIC to perform your inspection at 726 Sunnywood Rd
York SC 29745

If you have any questions regarding this report, please do not hesitate to contact us and set up a time to review your report. Our inspectors are always willing to help answer any questions to ensure you completely understand the information provided in your report. Contact your inspector directly or our office atÂ 704-542-6575Â with any questions.

Sincerely,



Frank Signa
(704)517-9493
Frank@hicarolina.com
NC #3569 - SC #49055
Home Inspection Carolina
Office - 704-542-6575
Fax - 704.540.7313
info@hicarolina.com
www.homeinspectioncarolina.com



v09.10.24

Prepared Using HomeGauge <http://www.HomeGauge.com> : Licensed To Frank Signa