

**Our Ref:** a.qdos261253

**Your Ref:** JF/SBU/45190/1

**Date:** 18/05/2026

FAO The Court  
C/o QDOS Assistance  
3rd Floor, Crown House  
Manchester Road  
Wilmslow  
SK91BH

### **REPAIRABLE REPORT**

Dear Sirs


**RE: Road traffic Accident: Mrs Karin Solomons: 25/04/2026**


In accordance with your instructions received on 07/05/2026 requesting us to provide an independent accident damage report, we assessed the damage on 18/05/2026. Vehicle located at Image-based Assessment. Our findings are as detailed below:

|                |                           |                  |                     |
|----------------|---------------------------|------------------|---------------------|
| Make           | <b>TESLA</b>              | Registration     | <b>LD710GY</b>      |
| Model          | <b>MODEL 3 LONG RANGE</b> | Status           | <b>Repair</b>       |
| Category       |                           | Salvage Value    |                     |
| Repair Cost    | <b>£10,874.77</b>         | Legal Status     | <b>Unroadworthy</b> |
| Engineer Value | <b>£15,700.00</b>         | Impact Magnitude | <b>Moderate</b>     |



Impact Area

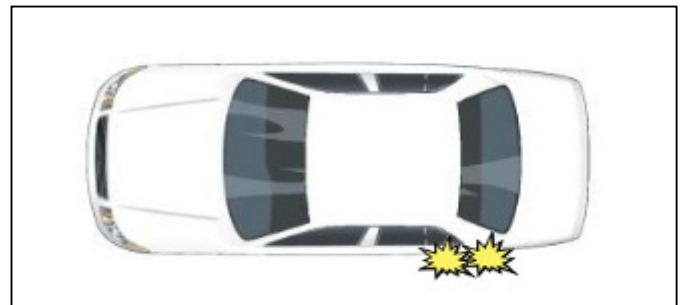

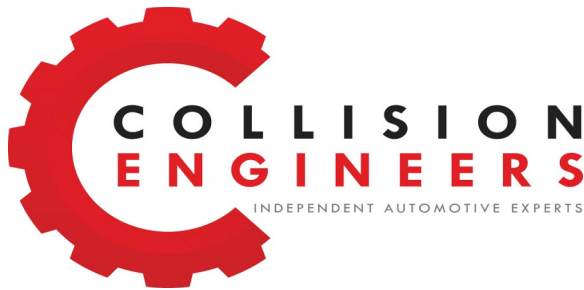

**Our Ref:** a.qdos261253

**Your Ref:** JF/SBU/45190/1

**Date:** 18/05/2026

### **DESKTOP ASSESSMENT**

This report has been compiled from a desktop review of the information available relating to this claim.

### **NATURE OF INCIDENT**


The vehicle has suffered moderate collision/impact damage to the left hand side.

### **ENGINEER'S COMMENTS**

The mileage has been calculated from online MOT data.

Please note the vehicle is unroadworthy due to the possible wheel, suspension and tyre damage and the NSR door is compromised and not sealing.

UPDATED REPORT: L/R Door New Part Painting Mat Price changed from 0.00 to 1,323.74. Preparation For Pre-Painting Paint changed from 2.00 to 3.40. L/R Door Price changed from 683.33 to 750.00. L/R Door Seal Price changed from 46.67 to 60.83. Sundry Parts Price changed from 67.18 to 41.95. Corrosion Protection Materials External Price changed from 7.29 to 22.90. Toolbox Tesla Diagnos Schalt/Ab-Anschalt has been added to the parts. Program Charging Connection has been added to the parts. Headlining has been added to the parts. L/Head Airbag has been added to the parts. L/F Door Trim has been added to the parts. L/F Inner Door Channel Moulding has been added to the parts. L/F Outer Window Channel Moulding has been added to the parts. Left Front Door Window has been added to the parts. Left Mirror has been added to the parts. L/F Door Module has been added to the parts. Left Front Outer Door Handle has been added to the parts. L/Outer Mirror Cover has been added to the parts. L/Door Sill Protector has been added to the parts. Left Upper A-Pillar Trim has been added to the parts. L/R Weatherstrip has been added to the parts. L/Fr Sill Panel Cover has been added to the parts. Left Upper B-Pillar Trim has been added to the parts. Renew L/R Side Panel Cpl has been added to the parts. L/R Side Panel Trim has been added to the parts. Right Upper A-Pillar Trim has been added to the parts. Right Upper B-Pillar Tri has been added to the parts. Boot Lid has been added to the parts. Rear Screen has been added to the parts. Boot Lid Seal has been added to the parts. Rear Bumper has been added to the parts. Rear Floor Carpet has been added to the parts. Right Rear Outer Seat Armrest has been added to the parts. Rear Seat Cushion has been added to the parts. L/F Window: Adjust has been added to the parts. Heavy Stone Chip R&R / New Parts has been added to the parts. Health Safety 2 Man Lift has been added to the parts. Door To Stand has been added to the parts. Test Weld has been added to the parts. Road Test And Quality Control has been added to the parts. Wash And Vac has been added to the parts. Adas Extensive Road Test has been added to the parts. Specialist Yard Charge has been added to the parts. Water Test has been added to the parts. Corrosion Prote To 2 Panels has been added to the parts. L/R Side Panel Cpl New Part Painting has been added to the parts. L/R Sill Pr2 Surface Paint has been added to the parts. De Nib has been added to the parts. Screen Mask Frt Surface Paint has been added to the parts. Touch Up Bolts Surface Paint has been added to the parts. Open Apperture X1 Detail Mask has been added to the parts. L/R Door Insulat has been added to the parts. L/R Mounting Kit has been added to the parts. L/Fastening Clip has been added to the parts. L/Screw has been added to the parts. L/Tank Strap has been added to the parts. Rr Scrn Frt Up Seal has been added to the parts. Rear Screen Lwr Seal has been added to the parts. Rear Screen Bond Kit has been added to the parts. Rear Screen Primer has been added to the parts. Rear Screen Harness has been added to the parts. Rear Screen Harness has been added to the parts. L/R Side Panel Cpl has been added to the parts. Lh Panel Repair Kit has been added to the parts. Blind Rivet has been added to the parts. Short Rivet 4.8Mm has been added to the parts. Blind Rivet has been added to the parts. Rivet Set C 5X7 H4 has been added to the parts. Structure Adhesive has been added to the parts. Bead Sealer has been added to the parts. Sound Pad Small has been added to the parts. Heavy Stone Chip has been added to the parts. E.P.A. Charge has been added to the parts. Methods Research Specialist has been added to the parts. Post\_Rep\_Diag\_Chec Specialist has been added to the parts. Pre\_Rep\_Diag\_Check Specialist has been added to the parts. Car Care Kit has been added to the parts. Body Filler has been added to the parts. Glass Lifting Tape Specialist has been added to the parts. Tyre Disposal has been added to the parts.

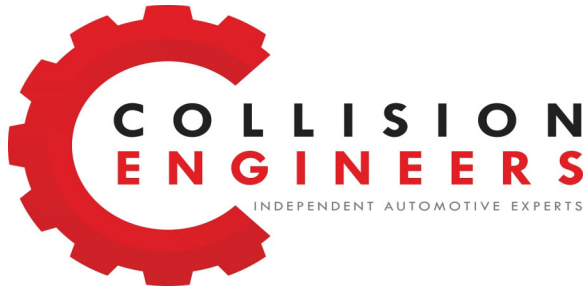

**Our Ref:** a.qdos261253

**Your Ref:** JF/SBU/45190/1

**Date:** 18/05/2026

Tyre Nsr has been added to the parts. Paint Consumable has been added to the parts. Delivery To Client Returning Veh has been added to the parts. Left Rear Side Window Glass has been removed from the parts. Left Rear Door has been removed from the parts. L/Upper C-Pillar Trim has been removed from the parts. Left Outer Taillamp has been removed from the parts. Ramp Load & Unload has been removed from the parts. Specialist Swap Spare Wheel has been removed from the parts. 2Nd Man Lift has been removed from the parts. Specialist Corrison Mat Labour has been removed from the parts. Specialist Ev / Hybrid Risk has been removed from the parts. Specialist Post Repair Check has been removed from the parts. Specialist Pre Repair

#### **VEHICLE HISTORY CHECK**

We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

#### **PRE-INCIDENT CONDITION**

The vehicle is considered to be in good condition for its age and type.

#### **RESERVE**


We consider that a repair reserve of £10,875.00 would be reasonable on this occasion.

#### **REPAIR DURATION**

We consider that this repair will take some 11 to 12 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

### **Vehicle Data**

|                  |                          |
|------------------|--------------------------|
| Retail Value     |                          |
| Trade Value      |                          |
| Engineer's Value | <b>£15,700.00</b>        |
| Glass's Code     |                          |
| VIN              | <b>LRW3F7EK7MC321713</b> |
| Odometer         | <b>44097</b>             |
| Engine           | <b>0</b>                 |
| Fuel             | <b>Electric</b>          |
| Extras           | <b>Not Seen</b>          |
| Condition        | <b>Good</b>              |

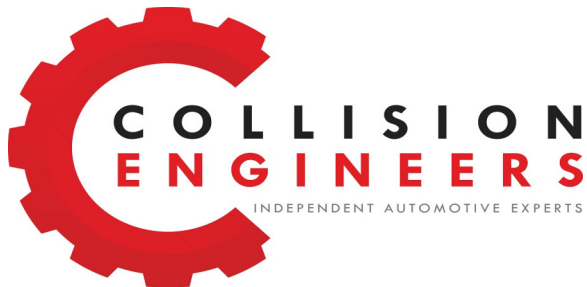

**Our Ref:** a.qdos261253

**Your Ref:** JF/SBU/45190/1

**Date:** 18/05/2026

### Main new parts required

L/R Door  
L/R Door Insulat  
L/Fastening Clip  
L/Tank Strap  
Rear Screen Lwr Seal  
Rear Screen Primer  
Rear Screen Harness  
Lh Panel Repair Kit  
Short Rivet 4.8Mm  
Blind Rivet  
Structure Adhesive  
L/R S-Window Primer  
Bead Sealer  
Heavy Stone Chip  
Welding Materials

L/R Door Seal  
L/R Mounting Kit  
L/Screw  
Rr Scrn Frt Up Seal  
Rear Screen Bond Kit  
Rear Screen Harness  
L/R Side Panel Cpl  
Blind Rivet  
Blind Rivet  
Rivet Set C 5X7 H4  
L/R Wdw Adhesive Kit  
L/R Wheel Cover  
Sound Pad Small  
Boron Drills (8Mm)  
Sundry Parts

### Repairs required

Test Weld

### Additional operations

Check Wash And Vac  
Paint L/R Door New Part Painting  
Blend Left Front Door Surface Paint  
Blend L/Upp A-Pillar Surface Paint  
Paint De Nib  
Blend Touch Up Bolts Surface Paint  
Paint Preparation For Pre-Painting  
Methods Research Specialist  
Pre\_Rep\_Diag\_Check Specialist  
Body Filler  
Wheel Alignment  
Tyre Nsr  
Paint Consumable  
Corrosion Protection Materials External

Check Water Test  
Paint L/R Side Panel Cpl New Part Painting  
Blend L/R Sill Pr2 Surface Paint  
Blend L/Roof Rail Surface Paint  
Blend Screen Mask Frt Surface Paint  
Paint Open Apperture X1 Detail Mask  
E.P.A. Charge  
Post\_Rep\_Diag\_Chec Specialist  
Car Care Kit  
Glass Lifting Tape Specialist  
Tyre Disposal  
First Calibration  
Delivery To Client Returning Veh



## Repair Cost Calculations


|                      |                   |
|----------------------|-------------------|
| Hours                | <b>48.48</b>      |
| Hourly Rate          | <b>£95.00</b>     |
| Total Labour         | <b>£4,605.60</b>  |
| Parts                | <b>£2,142.08</b>  |
| Paint/Materials      | <b>£1,323.74</b>  |
| Specialist/Other     | <b>£990.89</b>    |
| Sub total            | <b>£9,062.31</b>  |
| Vat                  | <b>£1,812.46</b>  |
| Total Estimated Cost | <b>£10,874.77</b> |









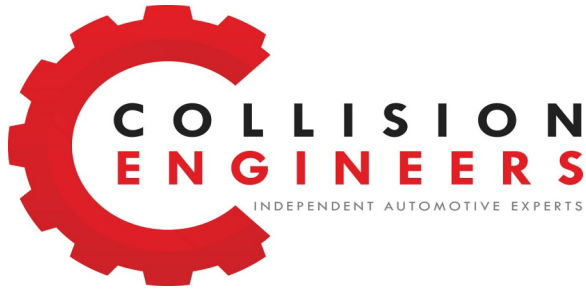

**Our Ref:** a.qdos261253

**Your Ref:** JF/SBU/45190/1

**Date:** 18/05/2026

### **Statement of Truth**

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully

Edward Mawdsley - ATA VDA AQP  
engineers@collisionengineers.co.uk



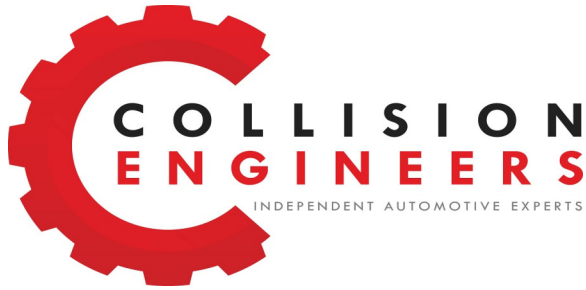

**Our Ref:** a.qdos261253

**Your Ref:** JF/SBU/45190/1

**Date:** 18/05/2026

FAO The Court  
C/o QDOS Assistance  
3rd Floor, Crown House  
Manchester Road  
Wilmslow  
SK91BH

### Fee Note

LD710GY.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

**Agreed Fee: £100.00**

**Sub Total: £100.00**

**VAT: £20.00**

**Total Due: £120.00**

### Payment

Please make cheques payable to Collision Engineers and quote reference a.qdos261253.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o QDOS Assistance confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10