

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025

FAO The Court
C/O Blackstone Legal
Unit 18, Girlington Road
Bradford
BD8 9NL

TOTAL LOSS REPORT

Dear Sirs


RE: Road traffic Accident: Abdur Hosain: 15/12/2024

In accordance with your instructions received on 19/01/2025 requesting us to provide an independent accident damage report, we assessed the damage on 20/01/2025. Vehicle located at Road solutions, 2 Kiln Lane, Hay Mills, Birmingham, B25 8HF. Our findings are as detailed below:


Make	TOYOTA	Registration	BH17MWG
Model	PRIUS HYBRID	Status	T/Loss
Category	N	Salvage Value	£1,475.00
Repair Cost	£21,624.71	Legal Status	Unroadworthy
Engineer Value	£14,750.00	Impact Magnitude	Heavy



Impact Area

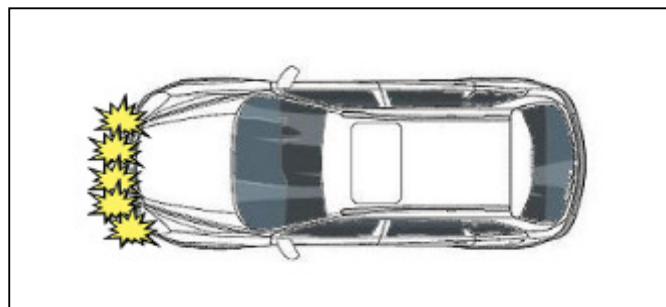

Document produced
using the EVA system

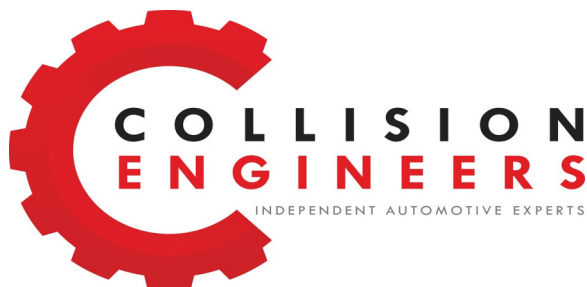

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025

NATURE OF INCIDENT

The vehicle has suffered heavy collision/impact damage to the front.

ENGINEER'S COMMENTS

20/01/2025 - Please note the vehicle is unroadworthy due to the extent of panel distortion sustained to the front end.

Value based on market research.

24/1/2025 UPDATED REPORT: - The vehicle owner has disputed our valuation and provided some market research as evidence to dispute the same. On review of this and through conducting our own, we feel the value is £14,750.00

VEHICLE HISTORY CHECK

According to the Experian database; Vehicle imported from outside the EU on date of first registration. See the Additional DVLA Data.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

SETTLEMENT


We consider that an equitable settlement would be £13,275.00 which represents the pre-accident engineer value of the vehicle of £14,750.00 less the value of the salvage of £1,475.00.

SALVAGE

Under the current salvage categorisation matrix this would be Category 'N' meaning there was no apparent structural damage evident within the scope of our inspection. Further information is available at www.abi.org.uk. We suggest that the sale of the salvage will realise in the order of £1,475.00. **We have not taken any action towards removal of the salvage at this time.**

Vehicle Data

Retail Value	
Trade Value	
Engineer's Value	£14,750.00
Glass's Code	
VIN	ZVW51-6052470
Odometer	45207
Engine	1797
Fuel	
Extras	
Condition	Good
Unrelated Damage	

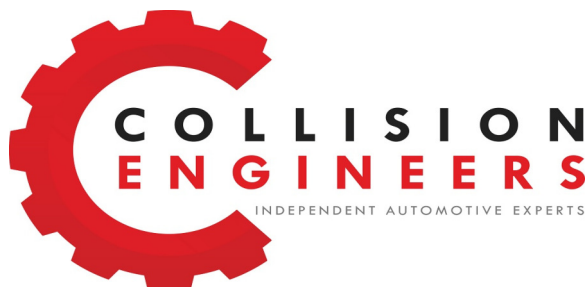


Our Ref: black25014

Your Ref: SA:25348SA

Date: 20/01/2025

Main new parts required

Front Bumper Lining	Front Bumper Impact Absorber/Filler
Front Bumper Reinforcement	Left Front Bumper Side Reinforcement
Right Front Bumper Side Reinforcement	Left Front Bumper Side Support
Right Front Bumper Side Support	Front Bumper Grille
Left Front Bumper Air Guide	Right Front Bumper Air Guide
Front Bumper Lower Air Guide	Front Bumper Repair kit
Front Bumper Lower Spoiler	Front Bumper Wiring
Front Bumper Lining Clip	Front Bumper Lining Screw
LED Headlamp, Complete (Both)	Left LED Headlamp, Complete
Right LED Headlamp, Complete	Left Daytime Driving Lights
Right Daytime Driving Lights	Left Front Fog Lamp, Complete
Right Front Fog Lamp, Complete	Front Fog Lamps (Both)
Left Front Wing	Right Front Wing
Front Wing (Both)	Left Front Wing Repair Kit
Right Front Wing Repair Kit	Left Front Wing Cover
Right Front Wing Cover	Left Front Wing Emblem (Letters)
Right Front Wing Emblem (Letters)	Left Front Wing Liner
Right Front Wing Liner	Left Front Wing Liner, Front
Right Front Wing Liner, Front	Left Front Wing Panel Screw
Right Front Wing Panel Screw	Left Front Wing Panel Nut
Right Front Wing Panel Nut	Front Grille
Front Grille, Upper	Front Grille Badge
Front Grille Repair/Fastening Kit	Front Grille Clip
Front Grille Screw	Bonnet
Bonnet Insulation	Bonnet Insulation Repair/Fastening Kit
Left Bonnet Hinge	Right Bonnet Hinge
Bonnet Latch	Bonnet Lock Release Cable
Bonnet Clip	Windscreen (Tinted)
Windscreen Repair/Bonding Kit	Left Windscreen Spacing Block
Right Windscreen Spacing Block	Windscreen Lower Weatherstrip
Windscreen Moulding (Complete)	Scuttle Grille
Left Front Door Covering Sheet (Skin)	Right Front Door Covering Sheet (Skin)
Driver Airbag	Driver Airbag Winding Coil
Passenger Airbag	Left Front Seat Airbag
Right Front Seat Airbag	Left Roof Side Airbag
Right Roof Side Airbag	Airbag ECU
Left Front Seat Belt	Right Front Seat Belt
Left Front Seat Belt Buckle	Right Front Seat Belt Buckle
Right Rear Seat Belt	Right Rear Seat Belt Buckle
Driver Airbag Activated	Passenger Airbag Activated
ESP Sensor	Left Side Airbag Sensor
Right Side Airbag Sensor	Left Airbag Sensor
Right Airbag Sensor	Left Rear Side Airbag Sensor
Right Rear Side Airbag Sensor	Radiator
Left Radiator Lower Hose	Right Radiator Lower Hose

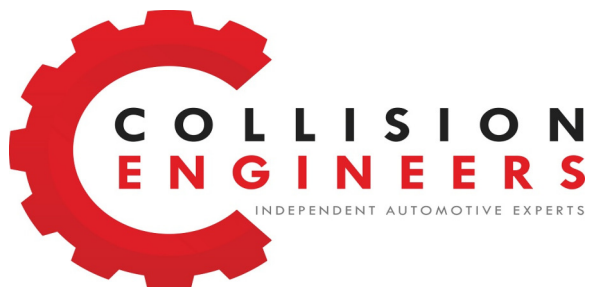

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025

New Parts - Continued

Upper Radiator Cowl
Air-Conditioning Condenser
Electric Drive Radiator Outlet Pipe
Headlining

Fan Cowl
Electric Drive Radiator
Dashboard Lower


Additional operations

Check "A" Pillars
Corrosion Protection
Electric / hybrid shutdown and power up
Environmental Charge
Second man lift
System Diagnostic Check (Post Repair)
Vehicle Care Kit
Wheel Alignment (4 wheel)
Paint Left Front Wing, Complete
Paint Bonnet
Paint Right A-Post, Upper
Paint Right Front Door, Complete
Paint Right Roof Panel, Side
Paint Prep. synthetics (combined-operation work)
Paint Sample colour creation (1)

ADAS methods Research Fee
De-nib/ polish
Energy cost supplement
QC & Road Test
Sundries
System Diagnostic Check (Pre Repair)
Wash/Clean
Paint Front Bumper
Paint Right Front Wing, Complete
Paint Left A-Post, Upper
Paint Left Front Door, Complete
Paint Left Roof Panel, Side
Paint Prep. metal (on vehicle without pre-painting)
Paint Colour mixing (1)

Repair Cost Calculations


Hours	45.43
Hourly Rate	£80.00
Total Labour	£3,634.40
Parts	£11,768.49
Paint/Materials	£1,806.70
Specialist/Other	£811.00
Sub total	£18,020.59
Vat	£3,604.12
Total Estimated Cost	£21,624.71

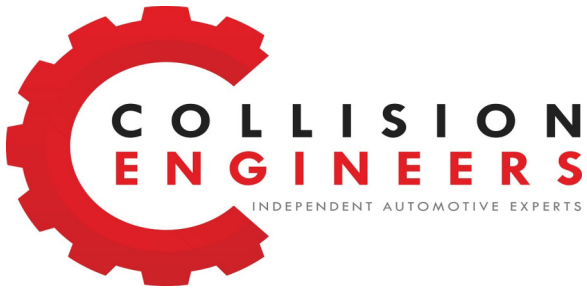

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025




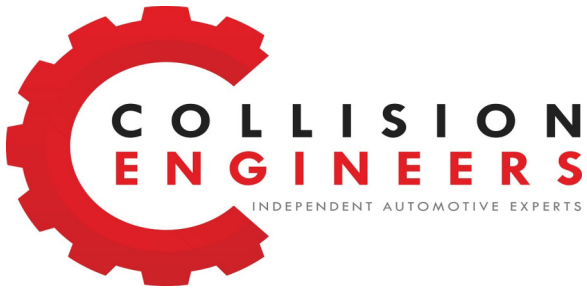

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025




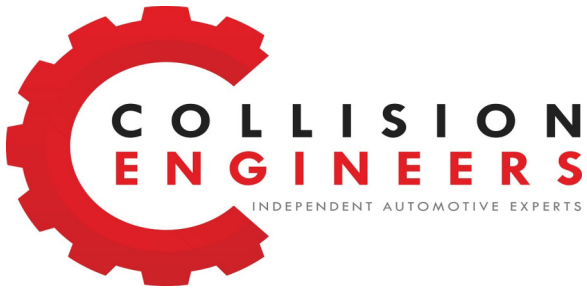

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025




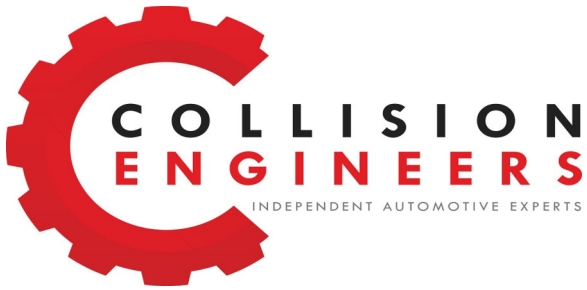

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025



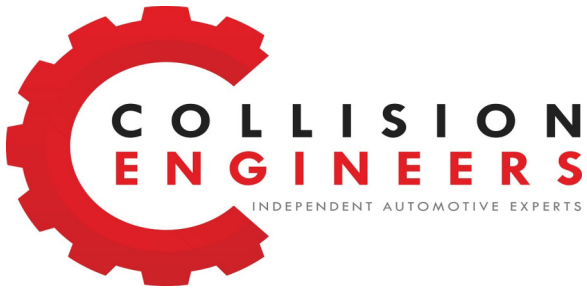


Our Ref: black25014

Your Ref: SA:25348SA

Date: 20/01/2025



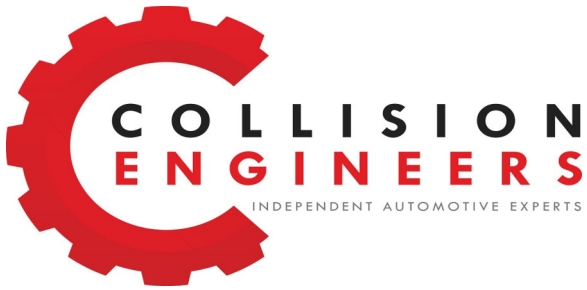


Our Ref: black25014

Your Ref: SA:25348SA

Date: 20/01/2025






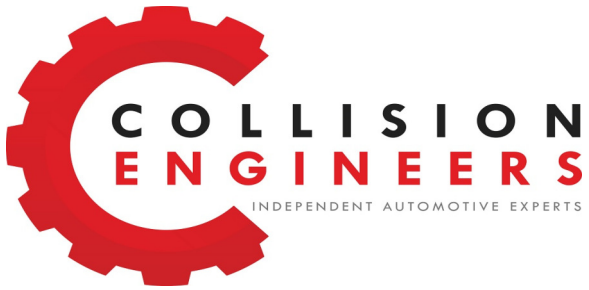

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025



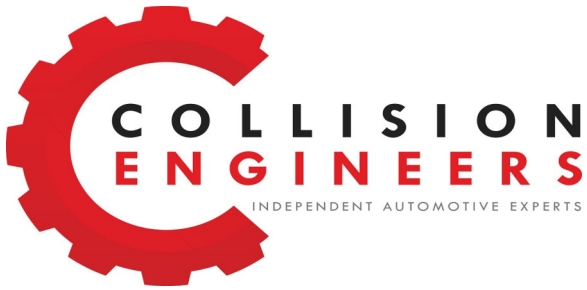


Our Ref: black25014

Your Ref: SA:25348SA

Date: 20/01/2025




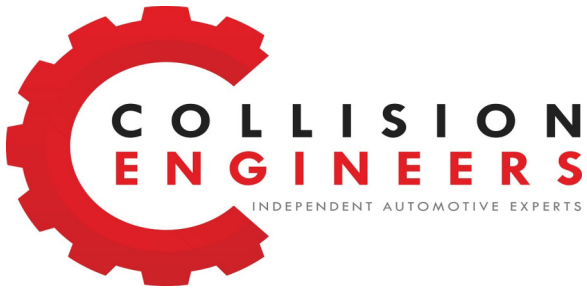

Our Ref: black25014
Your Ref: SA:25348SA

Date: 20/01/2025



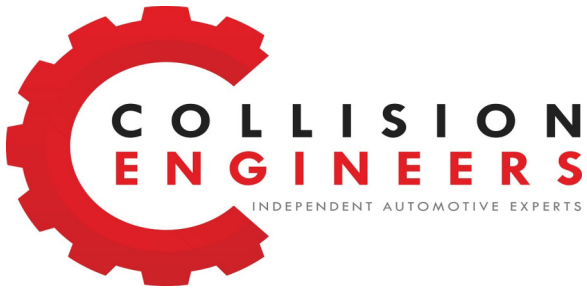


Our Ref: black25014

Your Ref: SA:25348SA

Date: 20/01/2025



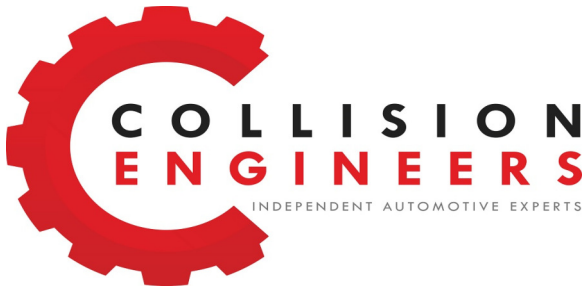

Our Ref: black25014

Your Ref: SA:25348SA

Date: 20/01/2025

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.

We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully



A Patterson - A Patterson M.Inst.IAEA
engineers@collisionengineers.co.uk