

Our Ref: qdos221404

Your Ref: JW/CS/14362/1

Date: 24/08/2022

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

TOTAL LOSS REPORT

Dear Sirs


RE: Road traffic Accident: James McNeil: 18/08/2022


In accordance with your instructions received on 23/08/2022 requesting us to provide an independent accident damage report, we assessed the damage on 24/08/2022. Vehicle located at Image Based Assessment. Our findings are as detailed below:

Make	VOLKSWAGEN	Registration	H8JTM
Model	GOLF GTD	Status	T/Loss
Category	N	Salvage Value	£4,250.00
Repair Cost	£11,344.50	Legal Status	Unroadworthy
Engineer Value	£17,000.00	Impact Magnitude	Moderate to Heavy



Impact Area

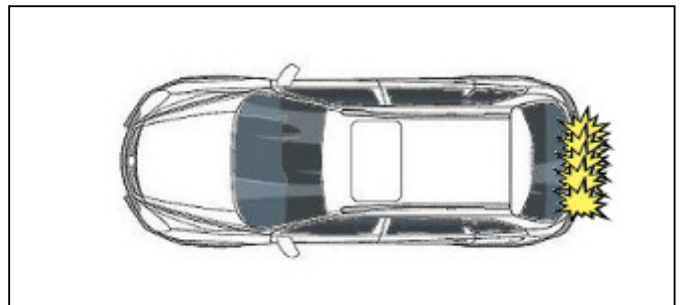

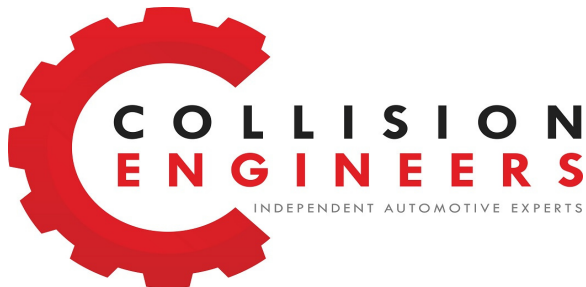

Our Ref: qdos221404

Your Ref: JW/CS/14362/1

Date: 24/08/2022

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate to heavy collision/impact damage to the rear.

ENGINEER'S COMMENTS

24/08/2022 - Please note the vehicle is unroadworthy as the rear body has been compromised.

VEHICLE HISTORY CHECK

24/08/2022 - According to the Experian database; there is a plate change on record

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

SETTLEMENT


We consider that an equitable settlement would be £12,750.00 which represents the pre-accident engineer value of the vehicle of £17,000.00 less the value of the salvage of £4,250.00.

SALVAGE

Under the current salvage categorisation matrix this would be Category 'N' meaning there was no apparent structural damage evident within the scope of our inspection. Further information is available at www.abi.org.uk. We suggest that the sale of the salvage will realise in the order of £4,250.00. **We have not taken any action towards removal of the salvage at this time.**

Vehicle Data

Retail Value	
Trade Value	
Engineer's Value	£17,000.00
Glass's Code	PKBP
VIN	WVWZZZAUZHW187917
Odometer	33161
Engine	1968
Fuel	Diesel
Extras	
Condition	Good
Unrelated Damage	

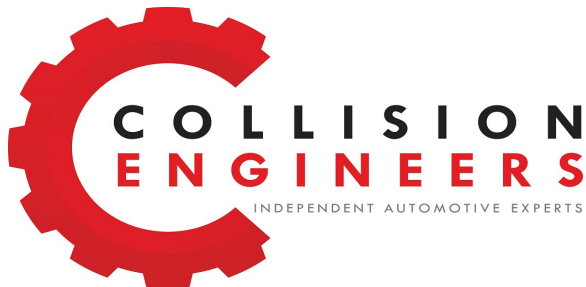

Our Ref: qdos221404

Your Ref: JW/CS/14362/1

Date: 24/08/2022

Main new parts required


Rear Bumper Lining
 Rear Bumper Protection Trim
 Right Rear Bumper Side Stoneguard
 Left Rear Bumper Side Bracket
 Left Rear Bumper Outer Bracket
 Rear Bumper Repair Kit
 Right Rear Bumper Distance-Sensor
 Right Rear Bumper Inner Side Distance-Sensor
 Right Rear Bumper Distance-Sensor Bracket
 Right R. Bumper Inner Distance-Sensor Bracket
 Right R. Bumper Outer Distance-Sensor Bracket
 Rear Bumper Parking Aid Wiring
 Right Inner Rear Lamp, Complete
 Right Number Plate Lamp
 Left Reflector
 Left Side Panel Liner
 Rear Panel
 Rear Floor
 Boot Lid/Tailgate/Back Door Weatherstrip
 Right Boot Lid/Tailgate Hinge
 Boot Lid/Back Door/Tailgate Striker
 Left Side Type Designation
 Rear Window Additional Cartridge
 Left Rear Window Spacing Block/Sleeve
 Left Rear Window Upper Spacing Block/Sleeve
 Left Rear Window Lower Spacing Block/Sleeve
 Rear Window Primer
 Rear Window Activator
 Rear Panel Interior Trim
 Tailgate/Boot Lid Trim Clip

Rear Bumper Reinforcement
 Left Rear Bumper Side Stoneguard
 Rear Bumper Bracket
 Right Rear Bumper Side Bracket
 Right Rear Bumper Outer Bracket
 Left Rear Bumper Distance-Sensor
 Left Rear Bumper Inner Side Distance-Sensor
 Left Rear Bumper Distance-Sensor Bracket
 Left R. Bumper Inner Distance-Sensor Bracket
 Left R. Bumper Outer Distance-Sensor Bracket
 Rear Bumper Distance-Sensor Kit
 Rear Bumper Distance-Sensor Glue Kit
 Left Number Plate Lamp
 Number Plate Lamp (Both)
 Right Reflector
 Right Side Panel Liner
 Rear Panel, Lower
 Tailgate
 Left Boot Lid/Tailgate Hinge
 Latch with Central Locking
 Boot Lid/Back Door/Tailgate Badge
 Boot Lid/Tailgate Upper Rear Spoiler
 Rear Window Repair/Bonding Kit
 Right Rear Window Spacing Block/Sleeve
 Right Rear Window Upper Spacing Block/Sleeve
 Right Rear Window Lower Spacing Block/Sleeve
 Rear Window Applicator
 Rear Exhaust Silencer
 Lower Tailgate/Back Door Trim
 Sundries/clips/fixings

Repairs required

Left Rear Lamp Panel

Right Rear Lamp Panel

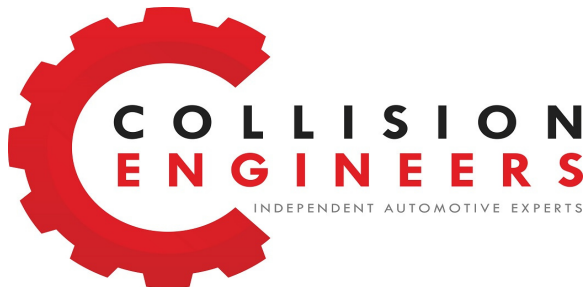

Our Ref: qdos221404

Your Ref: JW/CS/14362/1

Date: 24/08/2022

Additional operations

Jig set up, clamp and pull
Panel bonding kit
Number Plate
Seam Sealant
System Diagnostic Check (Pre Repair)
Check and adjust four wheel alignment
Environmental Charge
Wash/Clean
Paint Right A-Post, Upper
Paint Right Rear Side Panel, Complete
Paint Tailgate Rear Spoiler
Paint Rear Panel, Complete
Paint Right Rear Panel, Complete
Paint Left Rear Bumper Distance-Sensor
Paint Right Rear Bumper Distance-Sensor
Paint Prep. metal (on vehicle without pre-painting)
Paint Colour mixing (1)
Covid Clean
ADAS Calibration

Drill bits/cutting disc
Bumper protection trim
Repair Method Research Allowance
System Diagnostic Check (Post Repair)
Car Care Kit
De-Nib/Polish
Final Inspection & Road Test
Paint Left A-Post, Upper
Paint Left Rear Side Panel, Complete
Paint Tailgate (with Window Frame)
Paint Rear Floor
Paint Left Rear Panel, Complete
Paint Rear Bumper k/e
Paint Left Rear Bumper Distance-Sensor
Paint Right Rear Bumper Distance-Sensor
Paint Prep. synthetics (combined-operation work)
Paint Sample colour creation (1)
Qc

Repair Cost Calculations

Hours	52.60
Hourly Rate	£62.50
Total Labour	£3,287.50
Parts	£3,846.47
Paint/Materials	£1,564.78
Specialist/Other	£755.00
Sub total	£9,453.75
Vat	£1,890.75
Total Estimated Cost	£11,344.50



81c7d3e8-fd90-49b4-99db-544f647d6e8f.jpg



330a406f-4c50-4dd7-8e56-2e9abe694c18.jpg



1491ae81-4bcb-4f4b-8b50-
ba8870a00d0f.ipq



5915e269-fb4c-4cd5-abe2-126bb35a061c
(1).jpg



9867b1e9-1b26-4e02-af1a-6b91d3fc36e4
(1).jpg



a3c8e87f-b907-42c4-ac2d-
7b4504005271.jpg



a4317b36-002a-482f-9379-
1143284f77e9.jpg



a8566136-2f7c-4153-949b-
9781e237bd3a.jpg



b9c4d2ee-3642-435b-9a26-
515ce0df3cb0.jpg



e7716163-c599-4ff0-9c92-
28b69170b90d.jpg



eff1408e-525c-4204-8e78-
70352072a6ad.jpg



f02eec9e-a95b-43bd-b983-
cb74e796f411.jpg



f54885eb-971d-4d2d-8fe2-
6b7418d6e4ac.ipq



1ac0df79-72da-4e6d-b11b-
ef08373591ea.jpg



1bed24f8-e0e0-4da5-b5dd-
bd10a793aae3.jpg




14cdef57-a608-4857-8fa7-
8bdab1432f29.jpg



43a4ed2e-be0f-4700-9ce4-
cd304236d139.jpg



77af281b-5586-41e2-be7d-
e939994ad9f0.jpg

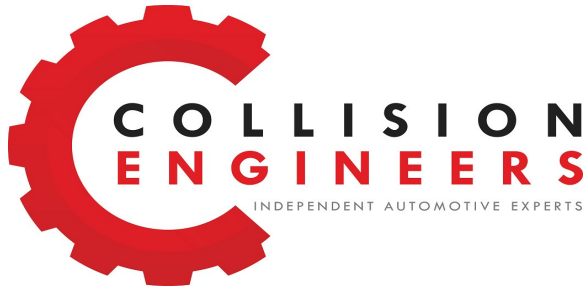

Our Ref: qdos221404

Your Ref: JW/CS/14362/1

Date: 24/08/2022

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully



A Patterson - A Patterson M.Inst.IAEA
engineers@collisionengineers.co.uk

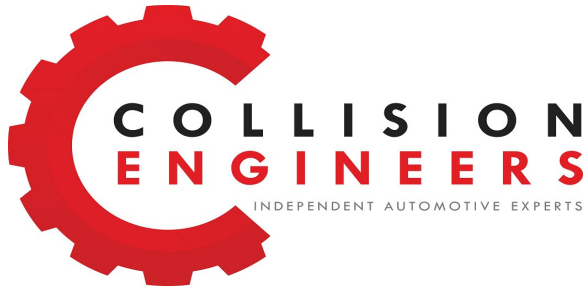

Our Ref: qdos221404

Your Ref: JW/CS/14362/1

Date: 24/08/2022

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

Fee Note

H8JTM.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

Agreed Fee: £100.00

Sub Total: £100.00

VAT: £20.00

Total Due: £120.00

Payment

Please make cheques payable to Collision Engineers and quote reference qdos221404.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o QDOS Assistance confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10